MILITARY SPECIFICATION

# FUZE, ROCKET: M433
# LESS BOOSTER AND BOOSTER LEAD

This Specification is approved for use within the U.S. Army Armament, Munitions and Chemical Command, and is available for use by all Departments and Agencies of the Department of defense.

## 1. SCOPE.

1.1 Scope. This specification contains requirements not normally covered by the drawings and provide quality assurance provisions for the fabrication of parts and the manufacture, assembly, and packing of fuze Rocket: M433, with detonator less booster and booster lead for the 2.75 Inch Folding Fin Aerial Rocket.

## 2. APPLICABLE DOCUMENTS.

2.1 Government documents.

2.1.1 Specifications and standards. The following specifications and standards form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

MILITARY

MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification for
MIL-D-45495 - Detonator, Electric M84, Parts for and Loading, Assembling, and Packing

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, U.S Army Armament, Munitions and Chemical Command, Attn: AMSMC-QA, Picatinny Arsenal, New Jersey 07806-5000 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter

AMSC N/A FSC 1340
DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

STANDARDS

MILITARY

| | | |
|---|---|---|
| MIL-STD-105 | - | Sampling Procedures and Tables for Inspection, by Attributes |
| MIL-STD-202 | - | Test Methods, Electrical and Electronic Components |
| MIL-STD-331 | - | Fuze and Fuze Components Environmental and Performance Tests for |
| MIL-STD-1167 | - | Ammunition Data Card |
| MIL-STD-1235 | - | Single and Multi-Level Continuous Sampling Procedures and Tables for Inspection by Attributes |

2.1.1 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

DRAWINGS (See 6.7)

US ARMY ARMAMENT, RESEARCH, DEVELOPMENT AND ENGINEERING CENTER (ARDEC)

| | |
|---|---|
| 8882186-3 | Warhead, 2.75 Inch Rocket, HE M151/without Fuze |
| 8861213 | Box Wirebound, Packing Ammunition for Artillery Type or Rocket Fuzes |
| 8864492 | Box, Ammo, Metal, for Artillery Type and Rocket Fuzes |
| 9221050 | 2.75 Inch: Warhead: M230 |
| 9230113 | Container Ammo, Fiber PA30 for Rocket 2.75 Inch: (Warheads M151, M156, XM157, XM158, XM282 and M230) |
| 9230114 | Box Packing, Ammunition for Rocket 2.75 Inch: (Warheads M151, M156, XM157, XM158, M230, XM232 and M247) |
| 9230116 | Box, Packing - Ammunition for Rocket 2.75 Inch |
| 9260701 | Fuze, Rocket, M433 |
| 9260702 | Support, Top (within M2A1 Box) |
| 9260703 | Support, Bottom (within M2A1 Box) |
| 9260886 | Fuze, Rocket, M433, Less Booster and Booster Lead |
| 2-R-376 | 2.75 IN: Warhead: M230 Photo Flash |



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

(Copies of specifications, standards, drawings, and publications required by the contractors in connection with specific procurement functions should be obtained from the contracting activity or as directed by the contracting officer.)

2.2 Order of precedence. In the event of a conflict between the test of this specification and the references cited herein (except for associated detail specifications, specification sheets or MS standards), the text of this specification shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS.

3.1 Materials. Materials shall be in accordance with applicable drawings and specifications.

3.2 Molded or plastic components. All molded and plastic components shall be in accordance with applicable drawings and specifications.

3.3 Fuze assemblies and parts. The fuze assemblies and parts shall comply with all requirements specified on drawing 9260886 and associated drawings and with all requirements specified in applicable standards and specifications. Ambient temperature is defined as 70°F ± 15°F unless otherwise specified.

3.3.1 Spring embrittlement. None of the springs used in the fabrication of the Safety and Arming Device (S&A) shall break when extended to the point of minimum permanent distortion.

3.3.2 Spring set. The setback spring Dwg. 8883718, after being subjected to a temperature of 175°F to 180°F at a compressed length of .750 inch for 24 hours and then allowed to cool at ambient for 24 hours, shall return to within .015 inch of its original free length.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

3.3.3 Detonators. Detonators prior to assembling to rotors, shall meet the requirements of MIL-D-45495.

3.3.4 Top plate assembly. Dwg. 9332603.

3.3.4.1 Conductor strip rivets. The rivets shall withstand a minimum straight push-out force of one (1) pound applied to the swaged end.

3.3.5 Fuze body assembly. Dwg. 9260888.

3.3.5.1 Umbilical assembly. The Umbilical Assembly shall withstand a straight pull-out force of 10 pounds applied at the Coaxicon Umbilical Contact Assembly without breaking the adhesive seal or the cable continuity.

3.3.5.2 Umbilical assembly. Dwg. 9260889. The insulation resistance at 500 Vdc shall be greater than 10 megohms and the continuity shall be less than 0.5 ohm when tested as per MIL-STD-202.

3.4 Electronics module assembly (module). Dwg. 9260878; Figure 2.

3.4.1 Module time delay function - (drawings 9260685, 9260878).

3.4.1.1 Fixed voltage test.

a. After shorting pins 5, 6 and 4 together for four seconds, the electronic module shall be capable of accepting a setting charge and exhibiting a corresponding time delay as listed in Table IA. The positive voltage applied to Pin 1 referenced to Pin 4 shall be followed by the negative voltage as shown in Table IA, Vc1 and Vc4, respectively. The time of applied voltage shall be 6 msec ± 1% for Vc1 and 40 msec ± 1% for Vc4. These voltages will be supplied thru a 47 ohm series resister to Pin 1 with reference to ground connected to Pin 4. The time delay shall be the time interval from the time Pin 2 is connected to Pin 4 and the leading edge of the output pulse exits Pin 3. The firing output (Pin 3) pulse shall provide at least 1000 ergs of energy in less than 100 microseconds into an M84



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

detonator or a resistor of 3.5 ± 1.5 ohms. Record the input voltages, time interval and energy output (greater than, equal or less than) by serial number of module. The 20 msec, 200 msec and 600 msec settings shall be used for production information tests on lot 1 through lot 4. All other settings are for lot 1 information only.

b. A seven (7) second time delay shall follow the charging of each module prior to initiating the module timing circuit.

TABLE IA

| Time Delay Setting (msec) | Capacitor Inputs (Volts) Vc1* (Timing) | Vc4*(Firing) | Function Time Delay Output (msec) |
|---|---|---|---|
| 20 | 0.93 | -15.07 | 17 to 23 |
| 50 | 1.57 | -14.43 | 43 to 57 |
| 100 | 2.58 | -13.42 | 87 to 114 |
| 200 | 4.33 | -11.67 | 174 to 228 |
| 300 | 5.83 | -10.17 | 260 to 343 |
| 400 | 7.08 | - 8.92 | 346 to 458 |
| 500 | 8.11 | - 7.89 | 432 to 575 |
| 600 | 8.98 | - 7.02 | 517 to 695 |

*Initial values of Vc1 and Vc4 shall not vary by more than ±1% from the nominal values shown.

3.4.1.2 Compensated voltage testing.

a. A compensated voltage setter that represents the helicopter setter systems shall be used for delay time acceptance tests for both first article and lot acceptance tests.

b. After shorting pins 5, 6 and 4 together for four seconds the electronic module shall be capable of accepting a setting charge from the compensated voltage setter and exhibiting a corresponding time delay as listed in Table IB. The time delay shall be the time interval from the time pin 2 is connected to pin 4 and the leading edge of the output pulse exits pin 3. The firing output (Pin 3) shall provide at least 1000 ergs of energy in less than 100 microseconds into an M84 detonator or a resistor of 3.5 ± 1.5 ohms. Record the time delay setting, function time delay and energy output (equal to, greater than or less than) by serial number or module lot no. The 20 msec, 200 msec and 600 msec settings shall be used for all first article and production lot acceptance tests.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE IB

| Time-Delay Setting (msec) | Function Time Delay Output (msec) |
|---|---|
| 20 | 5 - 3 5 |
| 200 | 185 - 215 |
| 600 | 570 - 630 |

3.4.2 Module turn on time. After applying -16 Vdc to Pin 1 for 100 msec, wait 7 sec and then short Pins 2 and 4 together. An output plus shall appear at Pin 3 within 600 microsecond of the shorting of Pins 2 and 4.

3.5 M433 S&A device without switch (S&A). Dwg. 9260751.

3.5.1 Separation of annular gear from #2 gear and pinion assembly. The separation distance between the annular gear and #2 gear and pinion, when the rotor and #2 gear are at their extreme separated position in the S&A, shall be .038 inch maximum.

3.5.2 Rotor reset capability. The rotor assembly in the S&A, after being rotated between 26 degrees and 35 degrees from the safe position and then released, shall without external assistance and in a continuous motion, be returned by the spring loaded setback weight to its fully safe and locked position.

3.5.3 Setback weight return capability. The setback weight in the S&A, after being bottomed to the base of the rotor housing by a force of 20lbs. applied equally to its two top surfaces and then released, shall return in a continuous motion to the fully safe position of locking the rotor.

3.5.4 Alignment of detonator cavity. The detonator cavity when the rotor is in the free armed detented position, shall be in line with the outside diameter of the rotor housing within .060 in T.I.R. functionally.

3.5.5 Height of rotor assembly. The height of rotor above the inside surface of the rotor housing, with rotor in safe position, shall be 1.030 in. max.

3.6 M433 S&A assembly (S&A assy). Dwg. 9260750.

3.6.1 Pull - off tests.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

3.6.1.1 Pull-off test of switch cap. The switch cap shall be capable of withstanding a pull-off force of 2 pounds minimum without separating from the switch insulator.

3.6.1.2 Pull-off test of switch assembly. The switch assembly shall be capable of withstanding a pull-off force of 5 pounds minimum without separating from the setback weight.

3.6.2 Continuity. Dwgs. 9260750 and 9260756. The M433 S&A Assembly, Dwg. 9260750, shall satisfy the continuity requirements specified in Table II of this specification.

3.6.3 Insulation resistance. Dwgs. 9260750 and 9260756. The M433 S&A Assembly, Dwg. 9260750, shall satisfy the insulation requirements specified in Table II of this specification.

TABLE II

| Position of S&A Dev. | Terminals | Requirements |
|---|---|---|
| Safe | #1 & #2 (Charge Switch) | 30 Megohms Min @ 500 Vdc |
| Safe | #1 & #5 (Charge Switch) | 100 Milliohms Max. |
| Armed | #1 & #5 (Charge Switch) | 30 Megohms Min @ 500 Vdc |
| Armed | #4 & #6 & Rotor | 100 Milliohms Max. |

3.6.4 Non-arming. The rotor assembly in the loaded S&A shall not armed when subjected to an arming acceleration of 12.00g's minimum for a period of 5 seconds. This test may be performed with a simulated detonator (unloaded S&A).

3.7 M433 S&A Assembly (S&A assembly loaded). Dwg. 9260750. Appropriate safety precautions shall be taken in testing for the following requirements.

3.7.1 Continuity through detonator (armed). The resistance measured between the detonator socket pin and speed chip or between terminal #3 and #4 shall be 3.5 + 1.5 ohms. Caution: Any continuity measurement which shall pass electrical current through the detonator shall be limited to one milliampere maximum.

3.7.2 S&A arming.

3.7.2.1 Ambient temperature arming. The S&A device, after conditioning at a temperature of 70° ± 15°F, for 2 hours minimum, shall arm between 0.92 and 1.19 seconds when subjected to an arming acceleration of 40.0 ± 0.5g.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

3.7.2.2 Low temperature arming. The S&A device after being conditioned at a temperature of -60° ± -5°F, for 3 hours minimum, shall arm between 0.92 and 1.19 seconds when subjected to an arming acceleration of 27.0 ± 0.5g.

3.7.2.3 High temperature arming. The S&A device after being conditioned at a temperature of +155° ± 5°F, for 3 hours minimum, shall arm between 0.92 and 1.19 seconds when subjected to an arming acceleration of 40.0 ± 0.5g.

3.7.3 S&A position. The safe position of the S&A shall be verified just before insertion into the fuze body. After insertion of the S&A, fuze handling shall be controlled to preclude any chance of inadvertent arming or substitution of the S&A until assembly of the booster housing.

3.7.4 Load test of detonator. The detonator shall not move more than .005 inch when a push out force of 5 pounds is applied to the detonator socket.

3.8 Fuze assembly. Dwg. 9260886.

3.8.1 Fuze arming.

3.8.1.1 Ambient temperature fuze arming time. The fuze assembly, after conditioning at a temperature of 70° ± l5°F, for 2 hours minimum, shall arm between 0.88 and 1.25 seconds when subjected to an arming acceleration of 40.0 ± 0.5g.

3.8.1.2 Low temperature arming time. The fuze assembly, after being conditioned at a temperature of -60° ± -5°F, for 8 hours minimum, shall arm between 1.08 and 1.65 seconds when subjected to an arming acceleration of 27.0 ± 0.5g.

3.8.1.3 High temperature arming time. The fuze assembly, after being conditioned at a temperature of +155° ± 5°F, for 8 hours minimum, shall arm between 0.88 and 1.25 seconds when subjected to an arming acceleration of 40.0 ± 0.5g.

3.8.2 Charge circuit continuity. (Fuze unarmed) - The continuity of the charge circuit, through its umbilical, shall be 220 ohms minimum and 3.3k ohms maximum.

3.8.3 Charge-arm-function. The fuze assembly shall be charged through its umbilical terminals, armed in accordance with fuze requirement 3.8.1.1 and shall, upon the closure of its canopy switch, exhibit corresponding function time delays as shown in Table VI (continued), Section 4.



Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:26Z
Check the source to verify that this is the current version before use.

3.8.4 Environmental conditioning.

3.8.4.1 Performance. The fuze, Dwg. 9260886, shall meet all performance requirements after being subjected to any one or combination of the following environmental conditions.

a. Temperature conditions. At -60° ± 5°F (-40° ± 5°F for ballistic firing test), ambient (70° ± 15°F); +155° ± 5°F, for a minimum of 8 hours after stabilization.

b. Temperature and humidity. Per MIL-STD-331, Test 105.1, limited to one 14 day cycle.

c. Thermal shock. The fuze shall withstand the thermal shock test per MIL-STD-331, Test 113.

3.8.5 Safety.

3.8.5.1 Non-arming. The fuze shall not arm when subjected to an arming acceleration of 12.0 ± .5g for a minimum of 5 seconds

3.8.5.2 Mechanical interrupter. The fuze shall be incapable of being charged in the armed condition.

3.8.5.3 Jolt and jumble. The fuze assembly shall be subjected to and must withstand the jolt test specified in MIL-STD-331, with the exception that the fuze shall not be disassembled and inspected after the jolt test. After completion of the jolt test, the same fuze shall be subjected to and must withstand the jumble test specified in MIL-STD-331.

3.8.5.4 Forty-foot drop. The complete fuze warhead and motor assembly shall withstand the forty-foot drop test specified in MIL-STD-331. To satisfy the requirements of MIL-STD-331, the disassembled fuze must display the following conditions:

a. No loose explosive material shall be present in the fuze body assembly.

b. The lock roller pin on the rotor shall not be broken.

c. The rotor shall be in the safe position, secured such that it cannot be turned to the armed position with finger pressure.

d. The g-weight shall be in the fully safe position.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

3.8.5.5 Five-foot drop. The fuze shall be safe to handle, fire or dispose of following the five-foot drop test. It need not be operable.

3.9 Fuze assembly operational test. The fuzes shall be subjected to and must withstand the following operational tests: Non-Environmental Test - Non-Arm and Arming Times only; Ballistic Test; Helicopter Vibration Test, (See Figure 1); Transportation Vibration Test, Procedure 1, Test 119, of MIL-STD-331.

3.10 Fuze firing. The fuze assembly shall function the detonator high order when properly charged and armed.

3.11 Ballistic firing test. The fuze shall be subjected to and function, as intended when subjected to this test.

3.12 Data requirements. The contractor shall generate data in accordance with the requirements of the data item description cited in 4.5.37.

3,13 First article inspection. This specification makes provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.14 Workmanship.

a. Mechanical. All parts and assemblies shall be from burrs, chips, sharp edges, cracks, unblended radii, surface defects, dirt, grease, rust, porosity, warpage, burn marks, checks, blisters, excess flash, corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part nor shall the parts be contaminated by the cleaning agents. Surface coating shall be continuous except for a few slight scratches not exposing base material. The loading and assembly operations shall be performed in a thorough, workmanlike manner consistent with the best practices of the industry. All required markings shall be neat and sharply defined.

b. Electrical. Cable assemblies and wires shall be dressed in such manner as to prevent pinching or chafing of the wire insulation. Ends of wires shall be free from burrs, sharp edges, or points. All parts shall be free from flux, chips, dirt, grease, rust or foreign material.



Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:26Z
Check the source to verify that this is the current version before use.

## 4. QUALITY ASSURANCE PROVISIONS.

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.2 Classification of inspection. The following types of inspection shall be conducted on this item:

a. First article inspection.

b. Quality conformance inspection.

4.3 First article inspection.

4.3.1 Submission. The contractor shall submit a first article sample as designated by the contracting officer for evaluation in accordance with provisions of 4.3.2. The first article sample shall consist of the following items in sample quantities as indicated:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

| Part Description | Drawing | Quantity |
|---|---|---|
| Device, Safety and Arming without Case Assembly | 9260751 | 25 |
| M433 S&A Assembly | 9260750 | 25 |
| Rotor Housing Assembly | 9260767 | 10 |
| Spring, Detent | 8883713 | 10 |
| Spring, Setback Weight | 8883718 | 20 |
| Gear and Pinion Assembly No. 1 | 8883703 | 25 |
| Gear and Pinion Assembly No. 2 | 8883700 | 25 |
| Escapement Gear and Pinion Assembly | 8883710 | 25 |
| Lever Assembly | 9260776 | 30 |
| Rotor Assembly | 9260769 | 20 |
| inner Plate Assembly | 9260804 | 20 |
| Escapement Assembly | 9260774 | 20 |
| Strap, Rotor Ground | 9260772 | 20 |
| Speed Chip | 9260891 | 20 |
| Housing, Booster | 8883682 | 25 |
| Stud, Spring | 8883721 | 10 |
| Pin Interfacing | 9260697 | 40 |
| Impact Sensor Probe | 9260736 | 25 |
| Housing, Rotor | 9260768 | 10 |
| Setback Weight Assembly | 12551817 | 25 |
| Case Assembly | 9332604 | 25 |
| Case | 9332602 | 25 |
| Top Plate Assembly | 1255812 | 25 |
| Socket, Detonator | 9260773 | 25 |
| Contact | 9260875 | 25 |
| Molded Electronics Assembly (Mold) | 9260878 | 5 per cavity |
| Fuze Protector | 9260879 | 25 |
| Body | 9260883 | 25 |
| Connector | 9260885 | 25 |
| “O”Ring | MS28775 | 25 |
| Fuze Rocket, M433, Less Booster and Booster Lead | 9260886 | 366 |
| Body Assembly | 9260888 | 25 |
| Electronic Assembly | 9260685 | 25 |
| Electronic Module Assembly | 9260887 | 25 |
| Molded Electronics Assembly (Module) | 9260878 | 702 |
| Environmental Protector | 9329847 | 25 |
| Rivet | 9331168 | 25 |
| Contact, Charge Input | 12551811 | 25 |
| Contact, Module Input | 12551810 | 25 |
| Contact | 9332598 | 25 |
| Contact | 9332599 | 25 |



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

4.3.2 Inspections to be performed. See MIL-A-48078, Table III and Table VI specified herein.

4.3.3 Rejection. See MIL-A-48078.

4.3.4 Process specification plastic parts. When a multiple cavity mold is used in the fabrication of plastic components five (5) components from each mold cavity shall be included in the First Article Sample. The components shall bear a mark which identifies the component with the individual cavities.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS**



| PARAGRAPH | TITLE | | SHEET 1 OF 10 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| | Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Device, Safety and Arming without Case Assembly (Dwg. 9260751) | | | | |
| | Examination for defects | 25 | -- | 3.3 | 4.4.2.1 |
| | Torque test of rotor stop stud | 25 | -- | 3.3 | 4.5.6.12 |
| | Setback weight return capability | 25 | -- | 3.5.3 | 4.5.10 |
| | Rotor reset capability | 25 | -- | 3.5.2 | 4.5.11 |
| | M433 S&A Assembly (Loaded) (Dwg. 9260750) | | | | |
| | Examination for defects | 25 | -- | 3.3 | 4.4.2.2 |
| | Load test of detonator | 25 | -- | 3.7.4 | 4.5.8 |
| | S&A arming Time (a) | 25 | -- | 3.7.2 | 4.5.9 & 4.5.12 |
| | Non-arming (a) | 25 | -- | 3.6.4 | 4.5.13 |
| | Rotor Housing Assembly (Dwg. 9260767) | | | | |
| | Examination for defects | 10 | -- | 3.3 | 4.4.2.3 |
| | Load test of spring stud | 10 | -- | 3.3 | 4.5.6.10 |
| | Housing, Rotor (Dwg. 9260768) | | | | |
| | Examination for defects | 10 | -- | 3.3 | 4.4.2.35 |

NOTES:
(a) This test may be performed with a simulated detonator (unloaded S&A).



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS** MIL-F-6328lA (AR)

| PARAGRAPH | TITLE: Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | SHEET 2 OF 10 | | DRAWING NUMBER / NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Spring, Detent (Dwg. 8883713) | | | | |
| | Examination for defects | 10 | -- | 3.3 | 4.4.2.4 |
| | Spring embrittlement | 10 | -- | 3.3.1 | 4.5.4 |
| | Spring, Setback Weight (Dwg. 8883718) | | | | |
| | Examination for defects | 20 | -- | 3.3 | 4.4.2.5 |
| | Spring embrittlement | 10 | -- | 3.3.1 | 4.5.4 |
| | Setback weight spring set | 10 | -- | 3.3.2 | 4.5.5 |
| | Gear and Pinion Assembly No. 1 (Dwg. 8883703) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.6 |
| | Load test of No. 1 gear and pinion assembly | 25 | | 3.3 | 4.5.6.1 |
| | Gear and Pinion Assembly No. 1 (Dwg. 8883700) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.7 |
| | Load test of No. 2 gear and pinion assembly | 25 | | 3.3 | 4.5.6.2 |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS**



| PARAGRAPH | TITLE | | SHEET 3 OF 10 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| | Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Escapement Gear and Pinion Assembly (Dwg. 8883710) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.8 |
| | Load test of escapement gear and pinion assembly | 25 | | 3.3 | 4.5.6.3 |
| | Lever Assembly (Dwg. 9260776) | | | | |
| | Examination for defects | 30 | | 3.3 | 4.4.2.9 |
| | Load test of lever shaft | 10 | | 3.3 | 4.5.6.4 |
| | Load test of lever pallet | 10 | | 3.3 | 4.5.6.5 |
| | Torque test of lever shaft | 10 | | 3.3 | 4.5.6.8 |
| | Rotor Assembly (Dwg. 9260769) | | | | |
| | Examination for defects | 20 | | 3.3 | 4.4.2.10 |
| | Load test of annular gear | 10 | | 3.3 | 4.5.6.6 |
| | Load test of lock roller pin | 10 | | 3.3 | 4.5.6.7 |
| | Inner Plate Assembly (Dwg. 9260804) | | | | |
| | Examination for defects | 20 | | 3.3 | 4.4.2.11 |
| | Load test of bridge rivet | 20 | | 3.3 | 4.5.6.9 |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS** MIL-F-63281A (AR)

| PARAGRAPH | TITLE: Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | SHEET 4 OF 10 | | DRAWING NUMBER / NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Escapement and Gear Assembly (Dwg. 9260774) | | | | |
| | Examination for defects | 20 | | 3.3 | 4.4.2.12 |
| | Load test of pillars | 20 | | 3.3 | 4.5.6.11 |
| | Strap, Rotor Ground (Dwg. 9260772) | | | | |
| | Examination for defects | 20 | | 3.3 | 4.4.2.13 |
| | Speed Clip (Dwg. 9260891) | | | | |
| | Examination for defects | 20 | | 3.3 | 4.4.2.15 |
| | Housing, Booster (Dwg. 8883682) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.16 |
| | Stud, Spring (Dwg. 8883721) | | | | |
| | Examination for defects | 10 | | 3.3 | 4.4.2.17 |

NOTES:



AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS** MIL-F-63281A (AR)

| PARAGRAPH | TITLE<br>Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | SHEET 5 OF 10 | | DRAWING NUMBER<br>NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Electronic Assembly<br>(Dwg. 9260685) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.18 |
| | Pin Interfacing<br>(Dwg. 9260697) | | | | |
| | Examination for defects | 10(a) | | 3.3 | 4.4.2.19 |
| | Impact Sensor Probe<br>(Dwg. 9260736) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.20 |
| | Electronic Module Assembly<br>(Dwg. 9260887) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.28 |
| | Setback Weight Assembly<br>(Dwg. 9260752) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.22 |
| | Pull off test of switch cap | 25 | | 3.6.1.1 | 4.5.32 |
| | Pull off test of switch assembly | 25 | | 3.6.1.2 | 4.5.33 |

NOTES:
(a) Quantity of 10 for each type required.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS**



| PARAGRAPH | TITLE: Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | SHEET 6 OF 10 | | DRAWING NUMBER / NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Case Assembly (Dwg. 9332604) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.23 |
| | Top Plate Assembly (Dwg. 12551812) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.25 |
| | Rivet push out test | 25 | | 3.3.4.1 | 4.5.26 |
| | Socket, Detonator (Dwg. 9260773) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.26 |
| | Contact (Dwg. 9260875) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.27 |
| | Molded Electronics Assembly (Dwg. 9260878) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.21 |
| | Thermal shock | 72 | | 3.8.4.1 | 4.5.29B |
| | Module turn on time | 702 | | 3.4.2 | 4.5.30 |
| | Module time delay function | 702 | | 3.4.1 | 4.5.31 |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS** MIL-F-63281A (AR)

| PARAGRAPH | TITLE: Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | SHEET 7 OF 10 | | DRAWING NUMBER / NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Fuze Protector (Dwg. 9260879) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.29 |
| | Body (Dwg. 9260883) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.30 |
| | Connector (Dwg. 9260885) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.31 |
| | "O" Ring (Dwg. MS 28775) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.32 |
| | Fuze, Rocket, M433 Less Booster and Booster Lead (Dwg. 9260886) | | | | |
| | Examination for defects | 366 | | 3.3 | 4.4.2.33 |
| | S&A position check | 366 | | 3.7.3 | 4.5.14 |
| | Jolt, MIL-STD-331, Test 101 | 12 | | 3.8.5.3 | 4.5.18 |
| NOTES: | | | | | |

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the currentversion before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS**



| PARAGRAPH | TITLE | | SHEET 8 OF 10 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| | Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Non-arm | 32 | | 3.8.5.1 | 4.5.16 |
| | Forty foot drop | 10 | | 3.8.5.4 | 4.5.17 |
| | Jumble, MIL-STD-331, Test 102 | 12 | | 3.8.5.3 | 4.5.18 |
| | Five Foot Drop, MIL-STD-331, Test 111 | 25 | | 3.8.5.5 | 4.5.19 |
| | Non-environmental test | 67 | | 3.9 | 4.5.20 |
| | Aircraft vibration, helicopter (see Figure 1) | 81 | | 3.9 | 4.5.21 |
| | Arming time (under minimum) | 32 | | 3.8.1 | 4.5.22/4.5.15 |
| | Arming time (over max. or fail to arm) | 32 | | 3.8.1 | 4.5.22/4.5.15 |
| | Mechanical interrupt | 32 | | 3.8.5.2 | 4.5.22/4.5.37 |
| | Temperature and humidity test | 21 | | 3.8.4.1 | 4.5.28 |
| | Thermal shock | 30 | | 3.8.4.1 | 4.5.29A |
| | Charge circuit continuity | 366 | | 3.8.2 | 4.4.2.33 |
| | Ballistic firing test | 138 | | 3.11 | 4.5.35 |
| | Transportation vibration | 120 | | 3.9 | 4.5.38 |
| | Fuze Body Assembly (Dwg. 9260888) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.34 |
| | Corrosion resistance of protective coating | 25 | | 3.3 | 4.5.7 |
| | Umbilical assembly pull test | 25 | | 3.3.5.1 | 4.5.27 |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS**



| PARAGRAPH | TITLE: Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | SHEET 9 OF 10 | | DRAWING NUMBER / NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Case (Dwg. 9332602) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.24 |
| | Rivet (Dwg. 9331168) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.37 |
| | Contact, Charge Input (Dwg. 12551811) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.14 |
| | Contact, Module Input (Dwg. 12551810) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.36 |
| | Contact (Dwg. 9332598) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.38 |

NOTES:



AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the currentversion before use.

TABLE III. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS**



| PARAGRAPH | TITLE | | SHEET 10 OF 10 | | DRAWING NUMBER / NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| | Fuze, Rocket, M433, Less Booster and Booster Lead and Components | | | | |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Contact (Dwg. 9332599) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.39 |
| | Environmental Protector (Dwg. 9329847) | | | | |
| | Examination for defects | 25 | | 3.3 | 4.4.2.41 |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, each inspection lot of loaded fuzes may contain:

a. Detonators from as many as three detonator lots.

b. Metal parts form one lot number.

c. Safety and Arming devices form not more than two lots.

4.4.2 Examination. See MIL-A-48078 and Table VII.

Sampling plans. Unless otherwise specified in the Classification of Defects and Test Tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Normal Inspection Level II.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | SHEET 1 OF 2 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.1 | Device, Safety and Arming without Case Assembly | | 9260751 |
| | | | NEXT HIGHER ASSEMBLY 9260750 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | | | | | |
| 1 | Setback weight return capability | | 100% | 3.5.3 | 4.5.10 |
| 2 | Rotor reset capability | | 100% | 3.5.2 | 4.5.11 |
| 3 | Distance between annular gear and No. 2 gear, max. | | 100% | 3.3 | Gage |
| Major | | | | | |
| 101 | Height from upper surface of base to top of rotor, max. | | 0.40% | 3.3 | Gage |
| 102 | Distance from rotor flat to edge of base, min. | | 0.40% | 3.3 | Gage |
| 103 | Detonator socket contact missing | | 0.40% | 3.3 | Visual |
| 104 | Rotor ground strap missing | | 0.40% | 3.3 | Visual |
| 105 | Rotor ground strap deformed | | 0.40% | 3.3 | Visual |
| 106 | Rotor ground strap not making contact with detonator socket contact | | 0.40% | 3.3 | Visual |
| 107 | Foreign matter present | | 0.40% | 3.3 | Visual |
| 108 | lubricant missing | | 0.40% | 3.3 | Visual |
| 109 | Diameter across outside corners of posts of rotor housing, min. | | 0.40% | 3.3 | Gage |
| 110 | Protective finish missing or incomplete | | 0.40% | 3.3 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 2 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.1 | Device, Safety and Arming without Case Assembly | | | | 9260751 |
| | | | | | NEXT HIGHER ASSEMBLY 9260750 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| 111 | Markings missing or incomplete | | 0.40% | 3.3 | Visual |
| 112 | Alignment of detonator cavity with the outside diameter | | 0.40% | 3.3 | Gage |
| 113 | Torque test of rotor stop stud | | 0.65% | 3.3 | 4.5.6.12 |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.2 | M433 S&A Assembly (Loaded) | | | | 9260750 |
| | | | | | NEXT HIGHER ASSEMBLY 9260886 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Non-arming 12.0g ± .5g minimum for a minimum of 5 seconds | (a)(e | 100% | 3.6.4 | 4.5.13 |
| Major | | | | | |
| 101 | Setback weight actuator pin improperly positioned on common contact | | | | |
| 102 | Less than two speed clip tabs remaining detonator or no speed clip tabs in at least point contact with end of detonator, or detonator protrudes beyond rotor outside surface | | 0.40% | 3.3 | Visual |
| 103 | Continuity through detonator | (b) | 100% | 3.7.1 | Ohmmeter with current limited to one milliampere |
| 104 | Overall length | | 0.40% | 3.3 | Gage/Dwg. Note 7 |
| 105 | S&A improperly assembled and seated in switch case assembly | | 0.40% | 3.3 | Visual |
| 106 | Detonator shorting switch not contacting detonator high terminal | | 0.40% | 3.3 | Visual |
| 107 | Detonator perforated or damaged | | 0.40% | 3.3 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 2 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.2 | M433 S&A Assembly (Loaded) | | | | 9260750 |
| | | | | | NEXT HIGHER ASSEMBLY 9260886 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| 108 | Load test of detonator | (e) | 0.40% | 3.7.4 | 4.5.8 |
| 109 | Arming time | | 100% | 3.7.2 | 4.5.9(d) |
| 110 | Distance from detonator disc to bottom of S&A rotor housing (armed position) | | 0.40% | 3.3 | Gage |
| 111 | Outside diameter | | 0.40% | 3.3 | Gage |
| 112 | Contact resistance between #4 and #6 contacts and rotor (armed, less detonator) | | 100% | 3.6.3 | Milliohmmeter & Gage |
| Minor | | | | | |
| 201 | Marking missing or incomplete | | 0.65% | 3.3 | Visual |
| 202 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:
(a) This shall be last test prior to inserting S&A Assy into fuze body assy. Dwg. 9260888.
(b) This test shall consist of arming S&A, measuring continuity, returning rotor to safe position.
(c) Detonators are to be tested in accordance with 4.5.2.
(d) To be performed at ambient temperature only.
(e) May be performed with a simulated detonator.



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the currentversion before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9260767 |
|---|---|---|---|---|---|
| 4.4.2.3 | Rotor Housing Assembly | | | | NEXT HIGHER ASSEMBLY 9260750 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Load test of spring stud | | 0.40% | 3.3 | 4.5.6.10 |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.4 | Spring, Detent | | | | 8883713 |
| | | | | | NEXT HIGHER ASSEMBLY 9260774 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Spring Embrittlement | 10 | (a) | 3.3.1 | 4.5.4 |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

(a) If one or more springs are found defective, the spring lot shall be rejected.





Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the currenversion before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.5 | Spring, Setback, Weight | | | | 8883718 |
| | | | | | NEXT HIGHER ASSEMBLY 9260774 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Spring Embrittlement | 10 | (a) | 3.3.1 | 4.5.4 |
| 102 | Setback weight spring set | 10 | (a) | 3.3.2 | 4.5.5 |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

(a) If one or more springs are found defective, the spring lot shall be rejected.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 8883703 |
|---|---|---|---|---|---|
| 4.4.2.6 | Gear and Pinion Assembly No. 1 | | | | NEXT HIGHER ASSEMBLY 9260774 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Load test of No. 1 gear and pinion assembly | | 100% | 3.3 | 4.5.6.1 |
| 2 | Maximum gap between gear and pinion | | 100% | 3.3 | Gage |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63281A (AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 8883700 |
|---|---|---|---|---|---|
| 4.4.2.7 | Gear and Pinion Assembly No. 2 | | | | NEXT HIGHER ASSEMBLY 9260774 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Load test of No. 2 gear and pinion assembly | | 100% | 3.3 | 4.5.6.2 |
| 2 | Maximum gap between gear and pinion | | 100% | 3.3 | Gage |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.8 | Escapement Gear and Pinion Assembly | | | | 8883710 |
| | | | | | NEXT HIGHER ASSEMBLY 9260774 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Load test of escapement gear and pinion assembly | | 100% | 3.3 | 4.5.6.3 |
| 2 | Maximum gap between gear and pinion | | 100% | 3.3 | Gage |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.9 | Lever Assembly | | | | 9260776 |
| | | | | | NEXT HIGHER ASSEMBLY 9260774 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Load test of lever shaft | | 100% | 3.3 | 4.5.6.4 |
| 2 | Load test of lever pallet | | 100% | 3.3 | 4.5.6.5 |
| 3 | Maximum gap between lever and shaft | | 100% | 3.3 | Gage |
| Special | | | | | |
| A | Torque test of lever shaft (See Note) | | 0.040% | 3.3 | 4.5.6.8 |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |
| | Note: The sampling plan for this test shall be in accordance with MIL-STD-105 using inspection Level II and an AQL of 0.040 percent. Continuous sampling may be using inspection Level II, CSP-I and an AQL of 0.015 percent. | | | | |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.10 | Rotor Assembly | | | | 9260769 |
| | | | | | NEXT HIGHER ASSEMBLY 9260751 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Load test of annular gear | | 100% | 3.3 | 4.5.6.6 |
| Special | | | | | |
| A | Load test of lock roller pin (See Note) | | 0.040% | 3.3 | 4.5.6.7 |
| Major | | | | | |
| 101 | Banking stud pullout test | | 0.40% | 3.3 | Gage |
| 102 | Rotor ground strap and detonator socket contact resistance | | 0.40% | 3.3 | Milliohmmeter |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |
| | Note: The sampling plan for this test shall be in accordance with MIL-STD-105 using inspection Level II and an AQL of 0.040 percent. Continuous sampling may be used in accordance with MIL-STD-1235 using inspection Level II, CSP-1, and an AQL of 0.015 percent. | | | | |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.11 | Inner Plate Assembly | | | | 9260804 |
| | | | | | NEXT HIGHER ASSEMBLY 9260751 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| | None defined. | | | | |
| Special | | | | | |
| A | Load test of bridge rivet (See Note) | | 0.40% | 3.3 | 4.5.6.9 |
| Major | | | | | |
| 101 | Pillar push test | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |
| | Note: The sampling plan for this test shall be in accordance with MIL-STD-105 using inspection Level II and an AQL of 0.040 percent. Continuous sampling may be used in accordance with MIL-STD-1235 using inspection Level II, CSP-I, and an AQL of 0.015 percent. | | | | |
| NOTES: | | | | | |





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.12 | Escapement and Gear Assembly | | | | 9260774 |
| | | | | | NEXT HIGHER ASSEMBLY 9260751 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Load test of pillars | | 0.40% | 3.3 | 4.5.6.11 |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.13 | Strap, Rotor Ground | | | | 9260772 |
| | | | | | NEXT HIGHER ASSEMBLY 9260769 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Width at detonator end | | 0.40% | 3.3 | Gage |
| 102 | Width of detonator groove | | 0.40% | 3.3 | Gage |
| 103 | Strap improperly bent | | 0.40% | 3.3 | Gage/Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 12551811 |
|---|---|---|---|---|---|
| 4.4.2.14 | Contact, Charge Input | | | | NEXT HIGHER ASSEMBLY 12551812 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Angle of bend ($58^{\circ} + 2^{\circ}$) | | 0.40% | 3.3 | Gage |
| 102 | Angle of bend ($15^{\circ} + 5^{\circ}$) | | 0.40% | 3.3 | Gage |
| 103 | Thickness of strip | | 0.40% | 3.3 | Gage |
| 104 | Poor quality of plating | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |
| NOTES: | | | | | |



Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.15 | Speed Clip | | | | 9260891 |
| | | | | | NEXT HIGHER ASSEMBLY 9260750 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Length of clip | | 0.40% | 3.3 | Gage |
| 102 | Diameter of clip | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.16 | Housing, Booster | | | | 8883682 |
| | | | | | NEXT HIGHER ASSEMBLY 9260886 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Diameter of lead cavity | | 0.40% | 3.3 | Gage |
| 102 | Thickness at end of lead cavity | | 0.40% | 3.3 | Gage |
| 103 | Total length | | 0.40% | 3.3 | Gage |
| 104 | Location of counterbore from bottom of booster cavity | | 0.40% | 3.3 | Gage |
| 105 | Diameter of booster cavity | | 0.40% | 3.3 | Gage |
| 106 | Depth of lead cavity | | 0.40% | 3.3 | Gage |
| 107 | Height of lead | | 0.40% | 3.3 | Gage |
| 108 | Width of "O" ring groove | | 0.40% | 3.3 | Gage |
| 109 | Diameter of "O" ring groove | | 0.40% | 3.3 | Gage |
| 110 | Concentricity of thread pitch diameter with booster cavity | | 0.40% | 3.3 | Gage |
| 111 | Concentricity of lead cavity with booster cavity | | 0.40% | 3.3 | Gage |
| 112 | Major diameter of threads | | 0.40% | 3.3 | Gage |
| 113 | Concentricity of "O" ring groove with pitch diameter | | 0.40% | 3.3 | Gage |
| 114 | Finish of "O" ring groove | | 0.40% | 3.3 | Gage |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 2 OF 2 | | DRAWING NUMBER 8883682 |
|---|---|---|---|---|---|
| 4.4.2.16 | Housing, Booster | | | | NEXT HIGHER ASSEMBLY 9260886 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| 115 | Perpendicularity of bottom lead cavity with side wall of lead cavity | | 0.40% | 3.3 | Gage |
| 116 | Evidence of tooling indentations | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Width across wrench flats | | 0.65% | 3.3 | Gage |
| 202 | Symmetry of wrench flats | | 0.65% | 3.3 | Gage |
| 203 | Inside diameter at crimp section | | 0.65% | 3.3 | Gage |
| 204 | Wall thickness at crimp section | | 0.65% | 3.3 | Gage |
| 205 | Protective finish missing or imcomplete | | 0.65% | 3.3 | Gage |
| 206 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63281A (AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 8883721 |
|---|---|---|---|---|---|
| 4.4.2.17 | Stud, Spring | | | | NEXT HIGHER ASSEMBLY 9260767 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Diameter of stud, min. | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.18 | Electronic Assembly | | | | 9260685 |
| | | | | | NEXT HIGHER ASSEMBLY 9260878 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Defective soldered connections | | 0.40% | 3.3 | Visual |
| 102 | Components improperly mounted on substrate | | 0.40% | 3.3 | Visual |
| 103 | Components missing from substrate | | 0.40% | 3.3 | Visual |
| 104 | Coating missing, incomplete or defective | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9260697 |
|---|---|---|---|---|---|
| 4.4.2.19 | Pin Interfacing (applicable pins only) | | | | NEXT HIGHER ASSEMBLY 9260685 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Longer length after bending | | 0.40% | 3.3 | Gage |
| 102 | Shorter length after bending | | 0.40% | 3.3 | Gage |
| 103 | Diameter of wire | | 0.40% | 3.3 | Gage |
| 104 | Wire tip flat over max. | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

REMARKS:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.20 | Impact Sensor Probe | | 9260736 |
| | | | NEXT HIGHER ASSEMBLY 9260888 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | True position of point stem to outside diameter of wafer | | 0.40% | 3.3 | Gage |
| 102 | True position of contact stem to outside diameter of wafer | | 0.40% | 3.3 | Gage |
| 103 | Length of contact stem, min. | | 0.40% | 3.3 | Gage |
| 104 | Thickness of flexible recess section | | 0.40% | 3.3 | Gage |
| 105 | Outside diameter of wafer, max. | | 0.40% | 3.3 | Gage |
| 106 | Diameter of contact stem, max. | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.21 | Molded Electronics Assembly (Mold) | | | | 9260878 |
| | | | | | NEXT HIGHER ASSEMBLY 9260887 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Length of three interface pins from mold at center line of pins | | 0.40% | 3.3 | Gage |
| 102 | True position of three pins to reference diameter A | | 0.40% | 3.3 | Gage |
| 103 | Mold inspection | 5/ Cavity | 0.40% | 3.3, 4.3.4 | 4.5.26, Gage |
| 104 | Outside diameter of mold, min. | | 0.40% | 3.3 | Gage |
| 105 | Length from center line of mold to connector interface surface, min. | | 0.40% | 3.3 | Gage |
| 106 | Chamfer at forward banking surface | | 0.40% | 3.3 | Gage/Visual |
| 107 | Overall length | | 0.40% | 3.3 | Gage |
| 108 | Function time delay | 20Msec | 100% | 3.4.1.2 | 4.5.34 |
| 109 | Function time delay | 200Msec | 100% | 3.4.1.2 | 4.5.34 |
| 110 | Function time delay | 600Msec | 100% | 3.4.1.2 | 4.5.34 |
| 111 | Module turn on time | | 0.40% | 3.4.2 | 4.5.30 |
| 112 | Thermal shock | 30 | | 3.8.4 | 4.5.29b |
| 113 | Maximum envelope distortion gage | | 0.40% | 3.3 | Gage |

NOTES:







Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 2 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.21 | Molded Electronics Assembly (Mold) | | | | 9260878 |
| | | | | | NEXT HIGHER ASSEMBLY 9260887 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Minor | | | | | |
| 201 | Pins not clean of mold material or have improper spherical termination | | 0.65% | 3.3 | Visual |
| 202 | Mold cavity identification not permanent or illegible | | 0.65% | 3.3 | Visual |
| 203 | Length of capacitor shorting pins | | 0.65% | 3.3 | Gage |
| 204 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63281A (AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.22 | Setback Weight Assembly | | | | 12551817 |
| | | | | | NEXT HIGHER ASSEMBLY 9260751 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Maximum height of switch cap above setback weight | | 100% | 3.3 | Gage |
| Major | | | | | |
| 101 | Switch pin insulator - missing, scored, with voids or cracks | | 0.40% | 3.3 | Visual |
| 102 | Pull-off test of switch cap | (a) | 0.40% | 3.6.1.1 | 4.5.32 |
| 103 | Pull-off test of switch assembly | (a) | 0.40% | 3.6.1.2 | 4.5.33 |
| 104 | Resistance between switch cap and weight | | 0.40% | 3.3 | Megohmeters at 500 Vdc |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES: (a) The same sample units shall be used for each test. Perform Major 102 Before 103.



AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

# CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.23 | Case Assembly | 1 OF 1 | 9332604 |
| | | | NEXT HIGHER ASSEMBLY 9260750 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Symmetrical location of detonator contact | | 0.40% | 3.3 | Visual |
| 102 | Contact resistance between #1 & #5 contacts (safe) (a) | | 100% | 3.6.2 | Milliohmmeter & Gage |
| 103 | Insulation resistance of #1 & #2 contacts (safe) (a) | | 100% | 3.6.3 | Megohmmeter, test voltage 500 VDC |
| 104 | Continuity through detonator (a) | | 0.40% | 3.7.1 | Gage |
| 105 | Insulation resistance of #1 & #5 contacts (armed) (a) | | 100% | 3.6.3 | Megohmmeter, test voltage 500 VDC |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:
(a) Majors 102 to 105 are predicated on using a gage simulating a safe/armed S&A, incorporating test features: 1. A setback weight with a switch actuator pin. 2. A rotor with a detonator socket grounded by a strap.





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63281A (AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.24 | Case | | 9332602 |
| | | | NEXT HIGHER ASSEMBLY 9332604 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Rotor O.D. clearance radius | | 0.40% | 3.3 | Gage |
| 102 | Detonator socket clearance radius | | 0.40% | 3.3 | Gage |
| 103 | Lock roller clearance radius | | 0.40% | 3.3 | Gage |
| 104 | Depth of setback weight actuator pin clearance | | 0.40% | 3.3 | Gage |
| 105 | Molded case inspection | 5/ cavity | | 3.3<br>4.3.4 | 4.5.25 |
| 106 | Radius of S&A housing retainer, 2 places | | 0.40% | 3.3 | Gage |
| 107 | True position of guide boss, 2 places | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor molding/workmanship | | 0.65% | 3.14 | Visual |

NOTES:



AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9332603 |
|---|---|---|---|---|---|
| 4.4.2.25 | Top Plate Assembly | | | | NEXT HIGHER ASSEMBLY 9332604 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Conical end of any rivet protrudes from plate (5 places) | | 0.40% | 3.3 | Visual |
| 102 | Alignment of N.C. contact | | 0.40% | 3.3 | Visual |
| 103 | Alignment of common contact | | 0.40% | 3.3 | Visual |
| 104 | Alignment of N.O. contact | | 0.40% | 3.3 | Visual |
| 105 | Loose connectors | | 0.40% | 3.3 | Visual |
| 106 | Push-out test of 5 rivets | | 0.40% | 3.3.4.1 | 4.5.26 |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:
N.C. = Normally closed
N.O. = Normally open

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9260773 |
|---|---|---|---|---|---|
| 4.4.2.26 | Socket, Detonator | | | | NEXT HIGHER ASSEMBLY 9260769 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Detonator pin socket diameter | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9260875 |
|---|---|---|---|---|---|
| 4.4.2.27 | Contact | | | | NEXT HIGHER ASSEMBLY 9260887 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Location of center of contact cup from contact plate side | | 0.40% | 3.3 | Gage |
| 102 | Inside depth of contact cup | | 0.40% | 3.3 | Gage |
| 103 | Distance of wire slot to center of contact cup | | 0.40% | 3.3 | Gage |
| 104 | Flatness of contact plate | | 0.40% | 3.3 | Gage |
| 105 | Inside diameter of contact cup | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Clearance cut out radius | | 0.65% | 3.3 | Visual |
| 202 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9260887 |
|---|---|---|---|---|---|
| 4.4.2.28 | Electronics Module Assembly | | | | NEXT HIGHER ASSEMBLY 9260886 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | True position of contact cup to diameter "A" | | 0.40% | 3.3 | Gage |
| 102 | Height of soldered pin from top (near surface) of molded module, min. | | 0.40% | 3.3 | Gage |
| 103 | Improper soldering | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Improper bonding of contact | | 0.65% | 3.3 | Visual |
| 202 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.29 | Fuze Protector | | 9260879 |
| | | | NEXT HIGHER ASSEMBLY 9260886 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Inside diameter (fuze body) | | 0.40% | 3.3 | Gage |
| 102 | Thickness at 45° angle | | 0.40% | 3.3 | Gage |
| 103 | Parallelism of sides at 45° angle | | 0.40% | 3.3 | Gage |
| 104 | Mold inspection | 5/ Cavity | | 3.3, 4.3.4 | 4.5.26 |
| 105 | Full radius of nose | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 3 | | DRAWING NUMBER 9260883 |
|---|---|---|---|---|---|
| 4.4.2.30 | Body | | | | NEXT HIGHER ASSEMBLY 9260888 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | True position of pitch diameter of warhead mounting threads to body inside diameter | | 0.40% | 3.3 | Gage |
| 102 | Pitch diameter of warhead mtg. thread | | 0.40% | 3.3 | Gage |
| 103 | Inside diameter of body cavity | | 0.40% | 3.3 | Gage |
| 104 | True position of booster o-ring seat diameter to inside diameter of body | | 0.40% | 3.3 | Gage |
| 105 | Diameter of booster o-ring seat | | 0.40% | 3.3 | Gage |
| 106 | True position of pitch diameter of booster cavity thread to inside diameter of body cavity | | 0.40% | 3.3 | Gage |
| 107 | Pitch diameter of booster cavity thread | | 0.40% | 3.3 | Gage |
| 108 | True position of small diameter to large diameter of umbilical hole | | 0.40% | 3.3 | Gage |
| 109 | True position of intermediate diameter to large diameter of the umbilical hole | | 0.40% | 3.3 | Gage |
| 110 | Perpendicularity of bottom of body cavity to inside diameter of body | | 0.40% | 3.3 | Gage |
| 111 | Perpendicularity of bottom of probe flange cavity to inside diameter of body | | 0.40% | 3.3 | Gage |
| 112 | Length of minor umbilical cavity diameter | | 0.40% | 3.3 | Gage |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | SHEET 2 OF 3 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.30 | Body | | 9260883 |
| | | | NEXT HIGHER ASSEMBLY 9260888 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| 113 | Depth of body cavity | | 0.40% | 3.3 | Gage |
| 114 | Length between body cavity bottom and bottom of probe flange cavity | | 0.40% | 3.3 | Gage |
| 115 | True position of probe actuating stem cavity diameter to inside diameter of body | | 0.40% | 3.3 | Gage |
| 116 | Surface finish for o-ring | | 0.40% | 3.3 | Gage |
| 117 | Diameter of probe actuating stem cavity | | 0.40% | 3.3 | Gage |
| 118 | Inside probe sensor chamfer | | 0.40% | 3.3 | Gage |
| 119 | Outside probe sensor chamfer | | 0.40% | 3.3 | Gage |
| 120 | Depth of probe flange cavity | | 0.40% | 3.3 | Gage |
| 121 | Bore diameter of probe flange cavity | | 0.40% | 3.3 | Gage |
| 122 | Small outside diameter | | 0.40% | 3.3 | Gage |
| 123 | Length from aft end to warhead interface shoulder | | 0.40% | 3.3 | Gage |
| 124 | Length from warhead interface shoulder to automated service groove | | 0.40% | 3.3 | Gage |
| 125 | Outside diameter of nose | | 0.40% | 3.3 | Gage |
| 126 | Inside diameter of crimp seal cavity | | 0.40% | 3.3 | Gage |
| 127 | Large diameter of umbilical hole | | 0.40% | 3.3 | Gage |
| 128 | Depth of probe flange cavity from nose of body | | 0.40% | 3.3 | Gage |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 3 OF 3 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.30 | Body | | | | 9260883 |
| | | | | | NEXT HIGHER ASSEMBLY 9260888 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Minor | | | | | |
| 201 | Distance between wrench slots, max. | | 0.65% | 3.3 | Gage |
| 202 | Major diameter of warhead mounting thread | | 0.65% | 3.3 | Gage |
| 203 | Improper finish | | 0.65% | 3.3 | Visual |
| 204 | Width of wrench slots, min. | | 0.65% | 3.3 | Gage |
| 205 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.31 | Connector | | | | 9260885 |
| | | | | | NEXT HIGHER ASSEMBLY 9260886 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | True position of pin with ref's A & B, two pins | | 0.40% | 3.3 | Gage |
| 102 | True position of ground receptacle with ref's A & B | | 0.40% | 3.3 | Gage |
| 103 | Molded connector inspection | 5/ cavity | | 3.3<br>4.3.4 | 4.5.25 |
| 104 | Overall length | | 0.40% | 3.3 | Gage |
| 105 | Chamfer at forward banking surface | | 0.40% | 3.3 | Visual |
| 106 | Interface length of 2 pins | | 0.40% | 3.3 | Gage |
| 107 | Depth of forward end of ground receptacle | | 0.40% | 3.3 | Gage |
| 108 | Depth of aft end of ground receptacle | | 0.40% | 3.3 | Gage |
| 109 | Diameter of S&A interface pin, 2 pins | | 0.40% | 3.3 | Gage |
| 110 | Diameter of umbilical conn. pin | | 0.40% | 3.3 | Gage |
| 111 | Diameter of ground receptacle | | 0.40% | 3.3 | Gage |
| 112 | Thickness of mold | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Umbilical hole chamfer | | 0.65% | 3.3 | Visual |
| 202 | Interface pins bent or damaged | | 0.65% | 3.3 | Visual |
| 203 | Evidence of poor molding/workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.32 | "O" Ring | | | | MS 28775-120 |
| | | | | | NEXT HIGHER ASSEMBLY 9254707 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Outside diameter | | 0.40% | 3.3 | Gage |
| 102 | Inside diameter | | 0.40% | 3.3 | Gage |
| 103 | Wall thickness not uniform | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.33 | Fuze, Rocket, M433 Less Booster and Booster Lead | 1 OF 2 | 9260886 |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | | | | | |
| 1 | S&A position check | | 100% | 3.7.3 | 4.5.14 |
| 2 | Non-arm | 32a | | 3.8.5.1 | 4.5.16 |
| 3 | Forty-foot drop | 10b | | 3.8.5.4 | 4.5.17 |
| 4 | Jolt - MIL-STD-331, Test 101 | 12 | | 3.8.5.3 | 4.5.18 |
| 5 | Jumble - MIL-STD-331, Test 102 | | | 3.8.5.3 | 4.5.18 |
| 6 | Five foot drop - MIL-STD-331, Test 111 | 6 | | 3.9 | 4.5.19 |
| 7 | Non-environmental test | 38 | | 3.9 | 4.5.20 |
| 8 | Helicopter vibration, See Appendix A | 63 | | 3.9 | 4.5.21 |
| 9 | Arming time (under minimum) | 32a | | 3.8.1 | 4.5.22/4.5.15 |
| 10 | Mechanical interrupt | 32a | | 3.8.5.2 | 4.5.22/4.5.37 |
| 11 | Transportation vibration | 30 | | 3.9 | 4.5.38 |
| Special | | | | | |
| a | Booster housing improperly torqued | | 0.40% | 3.3 | Gage |
| Major | | | | | |
| 101 | Length from aft face to end of booster housing, max. | | 0.40% | 3.3 | Gage |
| 102 | Arming time (over max or fail to arm) | 32 | a | 3.8.1 | 4.5.22/4.5.15 |
| 103 | Temperature and humidity test | 21 | b | 3.8.4.1 | 4.5.28 |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 2 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.33 | Fuze, Rocket, M433 Less Booster and Booster Lead | | | | 9260886 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| 104 | Ballistic fuze firing test | 90 | | 3.11 | 4.5.35 |
| 105 | Charge circuit continuity | | 100% | 3.8.2 | Gage (c) |
| 106 | Charge circuit continuity (following helicopter vibration) | 54 | | 3.8.2 | Gage (c) |
| 107 | Charge circuit continuity (following Transportation vibration | 120 | | 3.9 | Gage (c) |
| Minor | | | | | |
| 201 | Stamping missing | | 0.65% | 3.3 | Visual |
| 202 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

a. Samples taken from Aircraft vibration and non-environmental: Note 5 foot drop not done on every lot.

b. First Article only.

c. The instrument to be used shall meet the following criteria: (1) Output pulsewidth 100 ± 10 msec; (2) Output impedance 150K ohms typical; (3) Output open circuit voltage 100 ± 10 millivolts.





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9260888 |
|---|---|---|---|---|---|
| 4.4.2.34 | Fuze Body Assembly | | | | NEXT HIGHER ASSEMBLY 9260886 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Umbilical assembly pull test | | 0.40% | 3.3.5.1 | 4.5.27 |
| 102 | Location of contact stem to int. diam. of fuze body | | 0.40% | 3.3 | Gage |
| 103 | Stake of umbilical, 3 places | | 0.40% | 3.3 | Visual |
| 104 | Umbilical - Insulation resistance | | 0.40% | 3.3.5.2 | Megohmmeter at 500 VDC |
| 105 | Umbilical electrical continuity | | 0.40% | 3.3.5.2 | Milliohmmeter |
| 106 | Loose or improperly secured probe | | 0.40% | 3.3 | Visual |
| 107 | Umbilical-outer insulation free from damage or separation exposing braid | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Umbilical adhesive missing or improperly applied | | 0.65% | 3.3 | Visual |
| 202 | Impact probe sealant missing or improperly applied | | 0.65% | 3.3 | Visual |
| 203 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9260768 |
|---|---|---|---|---|---|
| 4.4.2.35 | Rotor Housing | | | | NEXT HIGHER ASSEMBLY 9260767 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Diameter of base | | 0.40% | 3.3 | Gage |
| 102 | Rotor housing post separation | | 0.40% | 3.3 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.36 | Contact, Module Input | | 12551810 |
| | | | NEXT HIGHER ASSEMBLY 12551812 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Angle of bend ($58^{\circ} + 2^{\circ}$) | | 0.40% | 3.3 | Gage |
| 102 | Angle of bend ($15^{\circ} + 5^{\circ}$) | | 0.40% | 3.3 | Gage |
| 103 | Thickness of strip | | 0.40% | 3.3 | Gage |
| 104 | Poor quality of plating | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9331168 |
|---|---|---|---|---|---|
| 4.4.2.37 | Rivet | | | | NEXT HIGHER ASSEMBLY 9332603 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Poor quality of plating | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

COVER:





Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the currentversion before use.

# CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9332598 |
|---|---|---|---|---|---|
| 4.4.2.38 | Contact | | | | NEXT HIGHER ASSEMBLY 9332603 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Angle of bend ($30^{o} + 2^{o}$) | | 0.40% | 3.3 | Gage |
| 102 | Thickness of strip | | 0.40% | 3.3 | Gage |
| 103 | Poor quality of plating | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

# CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9332599 |
|---|---|---|---|---|---|
| 4.4.2.39 | Contact | | | | NEXT HIGHER ASSEMBLY 9332603 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Angle of bends (58° + 2°, 2 places) | | 0.40% | 3.3 | Gage |
| 102 | Thickness of strip | | 0.40% | 3.3 | Gage |
| 103 | Poor quality of plating | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9329847 |
|---|---|---|---|---|---|
| 4.4.2.41 | Environmental Protector | | | | NEXT HIGHER ASSEMBLY 9260886 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Holes or cracks in surface | | 0.40% | 3.3 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.4.3 Testing. Testing is described in the First Article and Quality Conformance Inspection Tables.

4.4.4 Inspection equipment. The inspection equipment required to perform the examinations and tests prescribed herein is described in the "Paragraph Reference/Inspection Method" column in the tables starting with paragraph 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078 and Section 6.4 herein.

4.4.4.1 Contractor inspection system. As part of contractor's approved quality procedure, there shall be a provision for checking the adequacy of inspections made in connection with listed critical or major defects. These procedures shall include the following provisions:

4.4.4.1.1 Handling procedure. A Design Agency approved procedure shall be instituted that shall preclude unauthorized handling of the S&A's and fuzes from the S&A position check until the booster housing has been installed. The procedure shall be fail safe to eliminate armed fuzes from being introduced into the lot. Fail safe is defined as follows: Any equipment failure shall operate to cause rejection of the part or otherwise prevent its subsequent use.

4. 4.4.1.2 Identification of rejected material. All material listed below, rejected as containing defects, shall be isolated to preclude its inclusion with acceptable material:

a. All S&A's failing 4.5.10, 4.5.11, 4.5.12, 4.5.13, or 4.5.14.

b. All modules failing 4.5.30, 4.5.31, 4.5.35.

c. All fuzes failing 4.5.7, 4.5.15, 4.5.18, 4.5.19, 4.5.20, 4.5.22, and 4.5.23.

4.4.4.2 Use of simulated defect standards. The following listed verified inspections shall be validated and inspection equipment verified once per shift using Design Agency approved item facsimiles or standards containing the defects and supplied by the contractor. The contractor shall resupply the item facsimiles when it is determined by the Government that the facsimiles are no longer representative enough of the product to make it unidentifiable to the contractor inspection personnel or it is not functioning in



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

the necessary manner and cannot be corrected satisfactorily. These standards should be inert and readily identifiable to the Government to ensure recovery should they be inadvertently introduced into production. Simulated defect standards used to verify the following verified inspections should be constructed and identified in such a manner that they are not readily recognizable to the contractor inspection personnel as defect standards. Standards should be used so that their number, time, and sequence of introduction into the inspection cycle is known only to those personnel responsible for checking the accuracy of the operation. Adequacy of the standards shall be verified at least once each week.

Verified Inspection

Paragraph 4.5.11 - Setback weight return capability
Paragraph 4.5.15 - S&A position check
Paragraph 4.5.31 - Module turn on time
Paragraph 4.5.35 - Module time delay function test

Note: When there is automatic detection and automatic rejection of defective items to a controlled area or a controlled rejection of defective items, it is permissible for the defect standards to be identifiable and their introduction into production noticeable to contractor inspection personnel.

4.4.4.3 Undetected defect standards. Provisions shall be established for the corrective action to be taken where the equipment or contractor inspection personnel fail to identify a standard as defective. These provisions shall include a reinspection of all acceptable material subsequent to the last acceptable verification check as a minimum.

4.5 Methods of inspection.

PRECAUTION: This specification covers sampling and testing of chemical, toxic, or explosive materials which are potentially hazardous to personnel. Accordingly, it is emphasized that all applicable safety rules, regulations, and procedures must be followed in handling and processing these materials.

4.5.1 Materials, components, and processes. Compliance with all requirements of Section 3 of this specification shall be ascertained by current and continuing examinations of inspection and test data to determine that all components (parts, subassemblies, and materials) have been inspected and tested and found to comply with their respective drawing and specification requirements, and that all specified manufacturing processes have been followed.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.1.1 Visual and mechanical inspection. The visual, manual, and mechanical inspections and tests shall verify compliance with the requirements of Sections 3 and 5 of this specification in accordance with 4.4.2 herein and Table III.

4.5.2 Check test for deterioration of detonators. If the total time between original acceptance of any detonator lot and the assembly of that lot into the fuzes exceeds two years, at any time since previous tests, the detonator lot shall be subjected to and must satisfactorily pass the functioning and output tests specified in MIL-D-45495 immediately before the detonator lot is assembled into the fuzes. The test shall be performed by the contractor on detonators randomly selected by a Government Inspector. The test shall be conducted at Government expense without cost to the contractor who loaded the detonators or the contractor who is to assemble the detonators into the fuzes. The test shall not constitute a basis for fuze lot rejection against either contractor except where deterioration has occurred as a direct result of carelessness in handling, storage, etc., permitted while the detonator lot was under the jurisdiction of either contractor.

4.5.4 Spring embrittlement. The spring shall be stretched along its longitudinal axis in the case of a coil spring, or bent in the case of a flat spring until the spring no longer returns to its original position. When the spring no longer returns to its original length or profile, it shall be considered distorted permanently. Any spring that breaks prior to this point shall be Classed defective.

4.5.5 Setback weight spring set. The spring shall be measured at their original free length, assembled in a restraining fixture in accordance with 4.4.4 and compressed to a normal height of .75-inches, placed in an oven and subjected to a temperature of not more than 180 degrees fahrenheit (Fe) or less than 175°F for 24 hours. The springs shall be removed from the oven and be cooled to ambient temperature. After cooling the springs for 24 hours minimum, the springs shall be measured and the measurement shall be compared to the original free length to ascertain compliance with the specified requirement. Any spring that fails the requirement shall be classed defective.

4.5.6 S&A mechanical tests.

4.5.6.1 Load test of No. 1 gear and pinion assembly. Apply the axial load perpendicular to the No. 1 gear and in such a direction as to test the assembly of the No. 1 gear and pinion. The required



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

force shall act against the No. 1 gear. Upon removal of the required force, the maximum permissible gap shall be inspected for compliance with the drawing requirement. Any No. 1 gear and pinion assembly that fails the requirement shall be classed defective.

4.5.6.2 Load test of No. 2 gear and pinion assembly. Apply an axial load perpendicular to the No. 2 gear and in such a direction as to test the assembly of the No. 2 gear and pinion. The required force shall act against the No. 2 gear. Upon removal of the required force, the maximum permissible gap shall be inspected for compliance with the drawing requirement. Any No. 2 gear and pinion assembly that fails the requirement shall be classed defective.

4.5.6.3 Load test of escapement gear and pinion assembly. Apply an axial load perpendicular to the escapement gear and in such a direction as to test the assembly of the escapement gear and pinion. The required force shall act against the escapement gear. Upon removal of the required force, the maximum permissible gap shall be inspected for compliance with the drawing requirement. Any escapement gear and pinion assembly that fails the requirement shall be classed defective.

4.5.6.4 Load test of lever shaft. Apply the axial load perpendicular to the lever and in such a direction as to test the assembly of the lever and shaft. The required force shall act against the lever. Upon removal of the required force, the maximum permissible gap shall be inspected for compliance with the drawing requirement. Any lever shaft that fails the requirement shall be classed defective.

4.5.6.5 Load test of lever pallet. Apply an axial load perpendicular to the lever and in such a direction as to test the assembly of the lever and the lever pallet. The required force shall act against the lever. Upon removal of the required force, the height of the lever pallet above the lever shall be inspected for compliance with the drawing requirement. Any lever pallet that fails the requirement shall be classed defective.

4.5.6.6 Load test of annular gear. Apply a load perpendicular to the rotor and in such a direction as to test the assembly of the annular gear studs to the annular gear and the rotor. The required force shall act against the rotor. Upon removal of the required force, the distance from the face of the rotor to the outside face of the annular gear shall be inspected for compliance with the drawing requirement. Any annular gear that fails the requirement shall be classed defective.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.6.7 Load test of lock roller pin. Apply an axial load perpendicular to the rotor and in such a direction as to test the strength of the assembly of the lock roller pin to the rotor. The required force shall act against the rotor. Any lock roller pin that fails the requirement shall be classed defective.

4.5.6.8 Torque test of lever shaft. A torque shall be applied between the lever and the lever shaft. Any lever shaft that fails the requirement shall be classed defective.

4.5.6.9 Load test of bridge rivet. Apply the required load perpendicular to the inner plate and into the bridge rivet from the side opposite the bridge. The required force shall act against the inner plate. Any bridge rivet that fails the requirement shall be classed defective.

4.5.6.10 Load test of spring stud. Apply an axial load perpendicular to the rotor housing and in such a direction as to test the assembly of the spring stud and the rotor housing. The required force shall act against the rotor housing. Any spring stud that fails the requirement shall be classed defective.

4.5.6.11 Load test of pillars. Apply the required axial load perpendicular to the inner plate and in such a direction as to test the assembly of the pillars to the inner plate and outer plate. The required force shall act against the inner plate. Any pillars that fail the requirement shall be classed defective.

4.5.6.12 Torque test of rotor stop stud (eccentric pin). The required torque shall be applied between the rotor stop stud and gear assembly. The required force shall act on the gear assembly. Any rotor stop stud that fails the requirement shall be classed defective.

4.5.7 Corrosion resistance of protective finish. The testing of the sample shall be in accordance with MIL-STD-331, Test 107. The significant area for examination shall be the outside surface of the specimens.

The specimens shall show no more than five (5) rust spots or pits, none larger than 1/32 inch in diameter, except in those areas within 1/16 inch from the edges, corner, identification markings, and holding during processing. Any sample that fails the requirement shall be classed defective.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.8 Load test of detonator. Apply the required axial load perpendicular to the rotor and in such a direction as to test the strength of the speed clip holding the detonator in the rotor. Any speed clip that fails the requirement shall be classed defective and the S&A removed from the lot.

WARNING: This test may be dangerous and should be performed behind a suitable barricade.

4.5.9 M433 S&A arming tests ambient and hot. The S&A in the safe position shall be assembled to the test equipment in accordance with 4.4.4. The g-weight shall be to the right when looking from the outside of the centrifuge spin table toward the center of rotation of the spin table. The equipment shall accelerate the Safety and Arming Device to 40.0g's ± 0.5g's in a direction which simulates rocket launch. The arming time shall be recorded to the nearest hundredth of a second using a calibrated timer. At the completion of acceleration, the equipment shall be halted and visual observation shall be made for the locking position of the detent to ascertain positive arming. At the completion of the test, the Safety and Arming Device shall be returned to the safe position. Any S&A that fails the requirement shall be classed defective and removed from the lot.

WARNING: This test may be dangerous, and should be performed behind a suitable barricade.

4.5.10 Setback weight return capability. The S&A in the safe Position shall be assembled to the test equipment in accordance with 4.4.4. The S&A shall be securely held in place during a 20 pound load test with a hold down force. The 20 pound load shall be applied at an average rate of 300 ± 50 inches per minute to the setback weight. It is mandatory that the setback weight maintain contact with the 20 pound load applicator until the setback weight fully bottoms. The 20 pound force shall then be removed. S&A's failing to completely return to the fully safe position shall be classed defective and removed from the lot. Defect standards for verification of the inspection process shall be in accordance with 4.4.4.2 and 4.4.4.3. Defect standards for use with automatic equipment shall be as follows:

a. Units with setback weights which bind when depressed and remain in the depressed condition.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

b. Units with setback weights which start to return but do not completely return to the original locking position.

c. Units with setback weights which return from the depressed condition at a slower than normal rate causing rejection.

4.5.11 Rotor reset capability. The loaded S&A shall be assembled to the test fixture in accordance with 4.4.4. The rotor shall be rotated to a position at least 26 degrees, but not more than 35 degrees from the fully safe position and released. Observation shall be made for rotor return to the fully safe position. S&A's failing to comply with the specified requirement shall be classed defective and removed from the lot.

4.5.12 M433 S&A arming time test - cold. The S&A in the safe position shall be assembled to the test equipment in accordance with 4.4.4. The setback weight shall be to the right when looking from the outside of the centrifuge spin table toward the center of rotation of the spin table. The equipment shall accelerate the loaded Safety and Arming Device in a clockwise direction to 27.0g's plus or minus 0.5g's and the arming time shall be recorded to the nearest hundredth of a second using a calibrated timer. S&A's failing to comply with the specified requirements shall be classed defective.

4.5.13 M433 S&A non-arming test. The S&A in the safe position shall be assembled to the test equipment in accordance with 4.4.4. The setback weight shall be to the right when looking from the outside of the centrifuge spin table toward the center of rotation of the spin table. The equipment shall accelerate the loaded Safety and Arming Device in a clockwise direction to 12.0g's minimum for a minimum of five (5) seconds. Observation shall be made for rotor in the safe position. S&A's failing to comply with the specified requirement shall be classed defective and removed from the lot.

4.5.14 S&A position check. The S&A position, before insertion into the fuze body just prior to assembly of the booster housing, shall be inspected. Any armed S&A shall be considered defective and removed from the lot, and the assembly operation shall be halted until operation is corrected to Government satisfaction. The inspection shall be performed to the requirements of 3.7.4 using procedures in accordance with 4.4.4.2 and 4.4.4.3 and the equipment in accordance with 4.4.4.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

Defect standards with semi-armed and fully armed conditions shall be introduced at various times to verify test performance. The Design Agency approved handling procedure to preclude untested S&A's from being introduced into the fuze prior to the booster housing being installed shall also be assessed when the standards are introduced. If an improper procedure is being used as determined by the Government, all fuzes accepted subsequent to the last acceptable handling procedure assessment shall be screened as determined by the Government.

4.5.15 M433 fuze assembly arming time test. The fuze assembly shall be assembled to the equipment in accordance with 4.4.4. The setback weight shall be to the right when looking from the outside of the centrifuge spin table toward the center of rotation of the spin table. The equipment shall accelerate the loaded fuze in a clockwise direction to 40.0g's plus or minus 0.5g's except for cold temperature which shall be done at 27g's plus or minus 0.5g's and the arming time shall be recorded to the nearest hundredth of a second using a swing fixture and acoustic pick-up feeding the arming cycle noise signal to a design agency approved recorder. Any fuze assembly that fails the requirements of the arming time test shall be classed defective.

4.5.16 M433 fuze assembly non-arming test. The fuze assembly shall be assembled to the equipment in accordance with 4.4.4. The g-weight shall be to the right when looking from the outside of the centrifuge spin table toward the center of rotation of the spin table. The equipment shall accelerate the loaded fuze assembly in a clockwise direction to 12.0g's plus or minus 0.5g's for a minimum of three (3) seconds. An examination shall be made for rotor in the safe position. Any fuze assembly that fails the requirements of the non-arming time test shall be classed defective.

4.5.17 Forty foot drop. The fuze assembly with inert booster, inert booster lead, XM230 warhead, and inert motor, shall be subjected to the forty foot drop test as specified in MIL-STD-331 with the exception that the round shall be dropped base down only. The complete pack is as specified on Dwg. 9230113 and 9230114 shall be used. Any fuze assembly that fails the requirement shall be classed defective.

4.5.18 Jolt and jumble. The fuze assembly shall be subjected to the Jolt Test specified in MIL-STD-331 with the exception that the fuze shall not be disassembled and inspected after the Jolt



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

Test. After completion of the Jolt Test, the same fuze shall be subjected to and withstand the Jumble Test specified in MIL-STD-331. Any fuze assembly that fails the requirements shall be cause for lot rejection.

4.5.19 Five foot drop test. A random sample of six (6) fuzes (with fuze protector) shall be selected and subjected to the test as specified in MIL-STD-331 with the following conditions:

a. The fuze assembly will be assembled to an inert booster, inert booster lead, and M230 Warhead (the Government shall supply the warhead for the contractor's use) and with impact orientation of the warhead-fuze assemblies for the drop test as follows:

(1) Major axis horizontal
(2) Major axis 450 from vertical base down
(3) Base down

Two (2) fuzes each must be dropped in the above (1, 2, 3) orientations. No fuze shall be subjected to more than one drop. The orientation of the Safety and Arming Device (specifically the g-weight) of the fuze shall be random.

b. The Five Foot Drop Test, as specified in MIL-STD-331, shall be performed until three (3) consecutive lots (a minimum lot size of one week's production) have complied with the acceptance criteria specified. After satisfying the above requirement, one lot (a mminimum lot size of one week's production) per month shall be selected by the Government and subjected to and pass the Five Foot Drop Test. Should the one lot (per month) fail the acceptance criteria, the contractor shall be required to return to the three (3) consecutive lot procedures above for process qualification.

c. The fuzes shall be subjected to the tests and acceptance or rejection criteria as specified in Table IV. Fuzes must be safe to handle and safe to fire or dispose of (not necessarily operable) following the Five Foot Drop Test and prior to performing the Non-Arm and Arming Time Tests.

TABLE IV

| Test | Accept | Reject | Test Method Paragraph |
|---|---|---|---|
| Non-Arm | 0 | 1 | 4.5.17 |
| Arming Time | | | 4.5.16 |
| Safety Failure | 0 | 1 | 4.5.24 |
| Under Min. | 0 | 1 | 4.5.24 |



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

Any fuze that is unsafe to handle, fire or dispose of following the Five Foot Drop Test or does not meet the arming time safety definitions of 4.5.23 is classified as a safety failure. If the sample fails the above acceptance criteria, the lot shall be rejected.

4.5.20 Non-environmental test. A random sample of eight (8) fuzes shall be selected and subjected to the test and acceptance or rejection criteria as specified in 4.5.22.

4.5.21 Vibration test. Fuzes shall be subjected to Helicopter Vibration as specified in Figure 1. Vibration conditioning at resonance is not required. After vibration, the fuzes shall be subjected to the tests and acceptance or rejection criteria specified in 4.5.22.

Note: The fuzes shall be subjected to and must pass the continuity test following the vibration test. If one or more continuity failures occur in the test sample the lot shall be rejected.

4.5.22 Acceptance criteria. The sample fuzes from the Non-environmental (8) and Vibration (24) tests shall be combined into one sample and subjected to the following tests specified in Table V.

TABLE V

Sample Size - 32

| Test | Accept | Reject | Test Method Paragraph |
|---|---|---|---|
| Non-arm | 0 | 1 | 4.5.17 |
| Arming Time Safety Failure | 0 | 1 | 4.5.24 |
| Arming Time Under Min. | 1 | 2 | 4.5.24 |
| Arming Time Over Max. | 0 | 1 | 4.5.24 |
| Fail to Arm | 0 | 1 | 4.5.24 |
| Mechanical interrupt | 0 | 1 | 4.5.38 |

If all tests are acceptable, the sample fuzes from the Non-environmental test may be returned to the lot after disassembly, resetting the S&A into the safe position, and reassembly.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.23 Fuze arming and non-arming definitions.

4.5.23.1 Ambient temperature.

a. Times under .63 seconds are classed as arming time safety failure.

b. Times .63 through 0.88 seconds are classed as arming time under minimum.

c. Times 1.26 seconds through 1.60 seconds are classed as arming time over maximum.

d. Times over 1.61 seconds or fuzes which do not arm or fuzes which time but not detent are classed as failures to arm.

4.5. 23.2 Cold temperature.

a. Times under .63 seconds are classed as arming time safety failure.

b. Times .63 through 1.08 seconds are classed as arming time under minimum.

c. Times 1.66 seconds through 2.00 seconds are classed as arming time over maximum.

d. Times over 2.01 seconds or fuzes which do not arm or fuzes which time but do not detent are classed as failures to arm.

4. 5.23.2 Hot temperature.

a. Times under .63 seconds are classed as arming time safety failure.

b. Times .63 through .88 seconds are classed as arming time under minimum.

c. Times 1.26 seconds through 1.60 seconds are classed as arming time over maximum.

d. Times over 1.61 seconds or fuzes which do not arm or fuzes which time but do not detent are classed as failures to arm.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4. 5.23.4 Defect identification. Identification of defects as non-arm failures, arming time safety failures, arming time under minimum failures will depend on both centrifuge testing and umbilical continuity examination. In addition, items with these failures shall be removed and not subjected to the firing test.

4. 5.23.5 Electrical inspection of fuzes. All fuzes which are not classed as a failure shall be electrically inspected prior to firing for umbilical continuity.

4. 5.23.6 Test equipment failure. If the test equipment fails to produce an arming readout (i.e., recording paper skewes, audio pick-up, or amplifier inoperative) during the arming time test as verified by the Government, the Safety and Arming Device shall be visually inspected for arming; if found to be armed or partially armed, the Safety and Arming Device shall be reset into the unarmed position, reassembled into the same fuze body, and retimed once as a fuze. The only handling action performed on the Safety and Arming Device shall be the reset of the device just prior to the arming time test. The timing record produces by the fuze on the approved fuze timing equipment shall be considered the timing record of the fuze under the applicable defect classification.

4. 5.23.7 Rounding of fuze arming times. Fuze arming times, if recorded to the thousandth of a second shall be “rounded off" to the nearest hundredth of a second. Example:

| Cold temperature | Ambient and hot temperature |
|---|---|
| .625 shall be .62<br>.626 shall be .63 | .625 shall be .62<br>.626 shall be .63 |
| 1.074 shall be 1.07<br>1.075 shall be 1.08 | 0.874 sjall be 0.87<br>0.875 shall be 0.88 |
| 1.654 shall be 1.65<br>1.655 shall be 1.66 | 1.254 shall be 1.25<br>1.266 shall be 1.26 |
| 2.005 shall be 2.00<br>2.006 shall be 2.01 | 1.605 shall be 1.60<br>1.606 shall be 1.61 |



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.24 Correlation factor. A correlation factor, which correlated the fuze arming time method (swing fixture) to the in-line S&A arming time method, shall be run for this fuze. Correlation tests shall be performed by the contractor with DCAS verification. Correlation factors shall be validated at six month intervals (maximum) and re-established whenever:

a. A new contract is issued.

b. A change of fuze type.

c. Fuze timing equipment is modified.

For the correlation procedure, a digital counter or an approved equivalent device shall be used, set to read milliseconds for S&A timing and set for oscillograph traces, to the nearest millisecond, for the fuze. The correlation shall be accomplished as follows:

a. Select five (5) S&A's demonstrating acceptable arming time. Each S&A shall have repeatable arming times within ± 25 milliseconds in five successive runs on the approved S&A timing equipment. S&A arming times readings shall be obtained from the first movement of the set-back weight to the detent locking in the rotor.

b. The same S&A's shall be assembled to the electronic modules and placed in fuze bodies; secured in place with a booster housing, less "O" ring, and properly torqued. The assemblies shall then be timed five (5) times on the approved fuze timing equipment. Readings of the fuze arming time traces, from setback weight bottoming to rotor detent, shall be recorded.

c. The shift in average fuze time, if any, when compared with the average S&A time (taken as a standard) shall be used as the correlation correction and applied to the acceptance test results.

Data obtained in accordance with the above procedure shall be submitted to address shown in 6.4.

4.5.25 Dimensional control of molded or plastic parts. In place of normal sampling and ispection associated with the Classification of Defects, and after a curing time for the parts has been approved (see Note 1) a sample of five (5) parts as molded from each cavity shall be fully inspected dimensionally to qualify a new



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

or reworked cavity for use in production. The molded parts shall carry the individual cavity identification. As a control of each cavity during production, the above quantity of parts from each cavity shall be inspected for at least the defects listed in 4.4.2.21, 4.4.2.24, 4.4.2.29, 4.4.2.31, after continuous production of each 5,000 parts or at the end of each week, whichever occurs first. Of the sample, one (1) part shall be the last produced. If any defective parts are found during qualification of the cavity, the cavity producing the defective part will not be used in production. If any defective parts are found when inspection is performed for the control of the cavity, the cavity producing the defective part shall be removed from production. Further, that portion of production since the last control check shall be returned to the contractor for inspection for each type of defect according to MIL-STD-105, using the AQL's detailed in the classification of details. All cavities removed from production because of some fault, may, after reworking, be returned to production providing they pass the qualification test above. The contractor may request a change of inspection frequency providing he presents objective evidence to the contracting officer to substantiate the request.

Note 1: In establishing a curing time, dimensionally check ten (10) parts from each cavity at periodic intervals (e.g., every 30, 60, etc. minutes) until dimensional stability is attained. The curing time will be from the time the part comes out of the mold until dimensional stability is attained. The inspection data used in determining the curing time shall be sent to address shown in 6.4. If there is a change in material, or in the cycle time, or if a cavity is reworked, or a new cavity is used, a new curing time shall be established and approved.

4.5.26 Rivet push-out test. The resistive force shall act against the plate while avoiding support of the conductor strip. Apply the force with a 0.047 ± .003 diameter pin. Any rivet that pushes out shall be classed defective.

4.5.27 Umbilical assembly pull test. The umbilical assembly shall be placed in a holding fixture. A straight pull-out force of 10 pounds shall be applied at the Coaxicon Umbilical Contact Assembly. If the adhesive's seal or the cable's continuity become defective as a result of this test, the assembly shall be classed defective and be removed from the lot.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.28 Temperature and humidity. The fuze assembly shall be subjected to the Temperature and Humidity Test per MIL-STD-331, Test 105.1 with the exception that only one 14 day cycle be used. Any fuze that does not meet MIL-STD-331 test requirements shall be classed defective.

4.5.29 Thermal shock.

a. The fuze shall be subjected to the Thermal Shock Test in accordance with MIL-STD-331, Test 113. These fuzes shall then be centrifuge fired. The fuze shall be charged to the nominal 600 msec time before arming. After arming, the sensor probe should be activated and the fuze fired. Any fuze that does not meet test requirements shall be classified defective.

b. The Module shall be subjected to the Thermal Shock Test in accordance with MIL-STD-331, Test 113. These modules shall then be subjected to the timing test as specified in Table VI. Any module that does not meet the test requirements shall be classed defective. One defect shall be cause for lot rejection.

4.5.30 Module turn on time. The module shall be tested in accordance with 3.4.2. Any module that does not meet the specified requirements shall be classed defective.

4.5.31 Continuity through detonator test. The S&A shall be armed in the case and the resistance measured between terminals three and four. The value shall be 3.5 ± 1.5 ohms. After the test, the acceptable S&A's shall be disarmed and returned to line for further assembly. The S&A failing the requirement shall be classed defective.

4.5.32 Pull-off test of switch cap. Secure the setback weight in a holding fixture. An axial pull of 2 pounds minimum shall be applied to the switch cap. Any separation of switch cap from the switch insulator of 0.001 inch or more shall classify the unit as defective.

4.5.33 Pull-off test of switch assembly. Secure the setback weight in a holding fixture. An axial pull of 5 pounds minimum shall be applied to the switch insulator. Any separation of switch insulator from the setback weight of 0.001 inch or more shall classify the unit as defective.

4.5.34 Module time delay function test. The module shall be tested in accordance with the requirements of 3.4.1. Any module that does not meet the requirements shall be classed defective.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.35 Ballistic firing test. The loaded M433 fuze shall be conditioned in accordance with Table VI or Table VII, whichever is applicable. This test shall be performed at a Government facility using M230 warheads with photoflash cartridges for the bunker and canopy tests and M151 warheads for the superquick tests. MK40, Mod 3 rocket motors shall be used for all tests and they shall be temperature preconditioned to +155°F ± 4°F prior to assembling to warhead/fuze. The fuze shall be set with a setter that represents the helicopter setting system. A hard copy of the fuze charge signature shall be made at this time. Prior to setting and firing, the fuzes shall be checked for charge circuit continuity. Fuzes that fail the continuity tests shall not be subjected to the ballistic test. Range markers shall be situated along the flight path. Airburst range behind the target shall be detected and recorded.

4.5.35.1 Superquick test. The SQ setting shall be used for this test. The launcher shall be so located that rockets will impact at a slant range of approximately 3000 feet when launched at a QE of 0 to -20°. A QE of -70 will be used unless otherwise specified by the procuring agency. The impact area shall be such that a rocket launched from this altitude shall not have a trajectory resulting in a slant range in excess of 4000 feet. Impact shall cause the warhead to detonate high order.

4. 5.35.2 Simulated bunker test. A 20 msec setting shall be used for this test. The rounds shall be tested against a 30-to 40-inch thick bunker made of nominal 1-foot square logs or equivalent and located at a distance of 1100 feet from the launcher. Velocity at target impact will be about 1700 feet per second.

4. 5.35.3 Simulated forest penetration (canopy) test. The 200 and 460 msec settings shall be used for this test. The rounds shall be tested against a 20-foot high by 40-foot wide wall of 3/4 inch thick plywood located at a distance of 1100 feet from the launcher. Velocity at target impact will be about 1700 feet per second.

4. 5.35.4 No-test criteria. Some ballistic firings may result in conditions that do not properly test fuze function in the bunker and canopy operating modes. If the following conditions occur during a test firing, that launch will be scored as a “no test”:

a. The rocket misses the target.

b. The rocket hit the ground before reaching the target.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

c. The rocket impacts the target, but hits the ground before the maximum acceptable range behind the target is reached.

d. The rocket hits the target supports.

e. The rocket passes through a hole in the target made by a previous firing.

4.5.35.5 Acceptance criteria for operating mode tests.

| Nominal Time Setting | Target | Acceptance Criteria |
|---|---|---|
| Superquick | Natural Terrain | Function on impact. |
| 20msec | Bunker | Surface contact to 85 feet behind the target. |
| 200msec | Canopy | Function at 25 to 475 feet after first target contact. |
| 460msec | Canopy | Function at 50 to 1075 feet after first target contact. |

4.5.35.6 Rejection criteria. For scoring the ballistic test, umbilical failures and improper charging signals shall not be charged to any individual operating mode test of 4.5.35.5.

4.5.35.6.1 First article sample. If five (5) or more units do not meet the requirements in any one of the operating mode tests of 4.5.35.5, or four (4) or more units fail the charge circuit continuity tests, or sixteen (16) or more units fail the overall ballistic test (Table VI), the first article ballistic sample shall be rejected.

4.5.35.6.2 Lot acceptance sample. If three (3) or more units do not meet the requirements in any one of the operating mode tests of 4.5.35.5, or two (2) or more units fail the charge circuit continuity tests, or seven (7) or more units fail the overall ballistic test (Table VII), the lot shall be rejected.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.36 Data items. The contractor shall submit a quality inspection test demonstration and evaluation report in accordance with Data Item Description DI-R-1721 and DI-R-1724 giving the detailed test results.

4.5.37 Mechanical interrupt test. The armed fuze assemblies from 4.5.15 shall be checked for charge circuit continuity using the gage described in Note c of 4.4.2.33. The gage shall indicate an open circuit between the charge circuit and the umbilical. Any fuze assembly that fails the requirement shall be classed defective.

4.5.38 Transportation vibration. The fuze shall be subjected to the Transportation Vibration Test in accordance with MIL-STD-331, Test 119, Procedure 1. The fuze shall be subjected to and must pass the continuity test following the Transportation Vibration Test. If one or more continuity failures occur in the test sample, the lot shall be rejected.

5. PACKAGING.

5.1 Packaging and marking. Level C - Packaging and marking of fuzes shall be as specified on Dwgs. 8864492, 9260702, and 9260703.

5.2 Packing and marking. Level C - The packaged fuzes shall be packed and marked as specified on Dwg. 8886458.

5.3 Ammunition data cards. Data card information shall be as specified in MIL-STD-1167.

6. NOTES.

6.1 Definition of safe to handle. The fuze will be considered safe to handle if after electronic examination and tear down the following conditions are met:

a. The rotor shall be in the safe position and secured by the setback weight such that it cannot be turned to the armed position.

b. The lock roller pin on the rotor shall not be broken.

c. The setback weight shall be in the fully safe position (raised to its highest position).

d. No loose explosive shall be present in the fuze assembly.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

e. No parts shall be broken or deformed which could present a safety hazard in handling or inadvertent firing.

6.2 Intended use. The fuze assemblies covered by this specification are intended for the 2.75 Inch Rocket System.

6.3 Ordering data. See MIL-A-48078 (PA).

6.4 Submission of design for approval. See 6.2 of MIL-A-48078. Submit equipment designs, as required to Commander, AMCCOM, ATTN: AMSMC-QAF-I (D), Picatinny Arsenal, NJ 07806-5000. This address will be specified on the Contract Data Requirements List, DD Form 1423, in the contract. Unless otherwise specified data item DI-R-1714 will apply.

6.5 Government furnished parts.

6.5.1 Packaging and packing. The procuring agency will provide the packaging and the packing for the Forty Foot Drop.

6.5.2 Boosters, booster leads and warheads.

a. The procuring agency will provide inert boosters, inert booster leads and M230 warheads for the five-foot drop test.

b. The procuring agency will provide inert boosters, inert booster leads, M230 warheads and inert rocket motors for the forty-foot drop test.


c. The procuring agency will provide boosters, booster leads, M151 warheads, M230 warheads, photoflash charges and rocket motors for the ballistic firing test.

6.6 Defect reporting. From each lot produced, the contractor shall submit to US AMCCOM HQ, ATTN: AMSMC-QAF-T(D), results of the Module, Jolt, Jumble, Helicopter Vibration, and Centrifuge tests within three (3) days after completion of acceptance testing of the lot. If fuze and tests in addition to acceptance requirements are utilized to evaluate the lot, results of these tests will also be submitted three (3) days after the additional tests are completed. The defective fuzes shall be saved pending review of the results.

6.7 Drawings. Drawings listed in Section 2 of this specification under the heading US Army Armament Research, Development, and Engineering Center, ARDEC, may also include drawings prepared by, and identified as Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal, or Picatinny Arsenal drawings. Technical data originally prepared by these activities is now under the cognizance of ARDEC.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

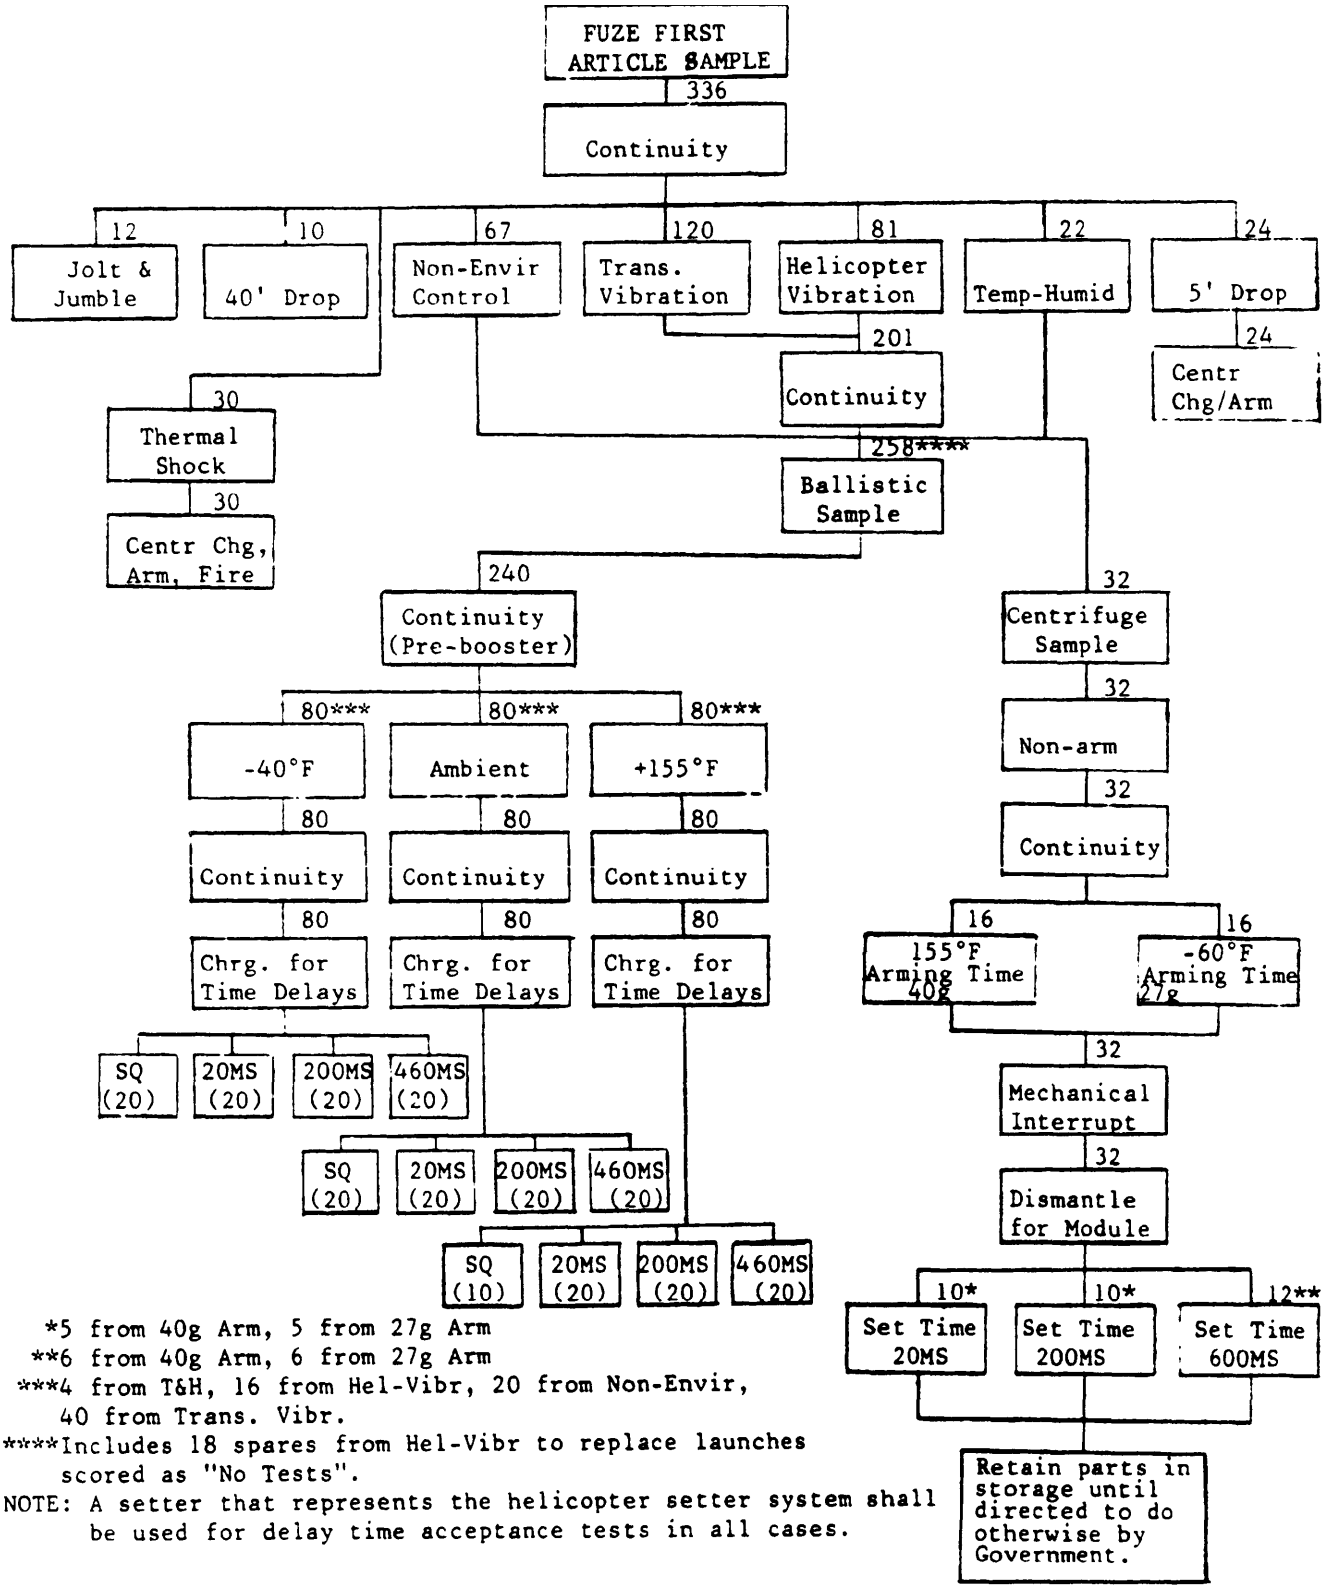


*5 from 40g Arm, 5 from 27g Arm
**6 from 40g Arm, 6 from 27g Arm
***4 from T&H, 16 from Hel-Vibr, 20 from Non-Envir, 40 from Trans. Vibr.
****Includes 18 spares from Hel-Vibr to replace launches scored as "No Tests".
NOTE: A setter that represents the helicopter setter system shall be used for delay time acceptance tests in all cases.

TABLE VI. First article test



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE VI (Cont'd)

First article sample

Module

1. All modules shall be serialized.

2. A setter that represents the helicopter setter system shall be used for acceptance of all modules.

3. Fixed voltage setter to be used for information on all modules.

4. The same units shall be tested in the same sequence using the same module for both the compensated and fixed voltage sections and data be readily identifiable back to the serialized units. There shall be a one day interval between the compensated and fixed voltage tests with the compensated test preceding the fixed voltage test.

| Nominal Time Settings | Environment | Module Quantity | Acceptance Limits |
|---|---|---|---|
| 20MS | -60°F | 70 | 5 to 35MSec |
| | Ambient | 70 | |
| | +155°F | 70 | |
| | Thermal Shock | 24 | |
| 200MS | -60°F | 70 | 185 to 215MSec |
| | Ambient | 70 | |
| | +155°F | 70 | |
| | Thermal Shock | 24 | |
| 600MA | -60°F | 70 | 570 to 630MSec |
| | Ambient | 70 | |
| | +155°F | 70 | The firing capacitor shall be checked to insure that at least minimum detonator firing output pulse is present when the detonator firing circuit is tripped at the conclusion of the time delay. |
| | Thermal Shock | 24 | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

5. Modules shall be temperature conditioned for a minimum of two (2) hours after stabilization at temperature specified in Section 4 above.


6. All modules shall be checked for module turn on time. Data obtained from these checks shall be recorded and be made traceable to individual modules.

7. A seven (7) second time delay shall follow the charging of each module and before the module timing circuit is tripped.

8. Additional nominal time settings (at ambient temperature) shall be used for informational purposes only, the nominal time settings are as follows: 50MSec, 100MSec, 300MSec, 400MSec, 500MSec. Both setters shall be used. Modules that were tested at ambient temperature in the preceding segment (Section 4 above) may be used for this test segment.



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

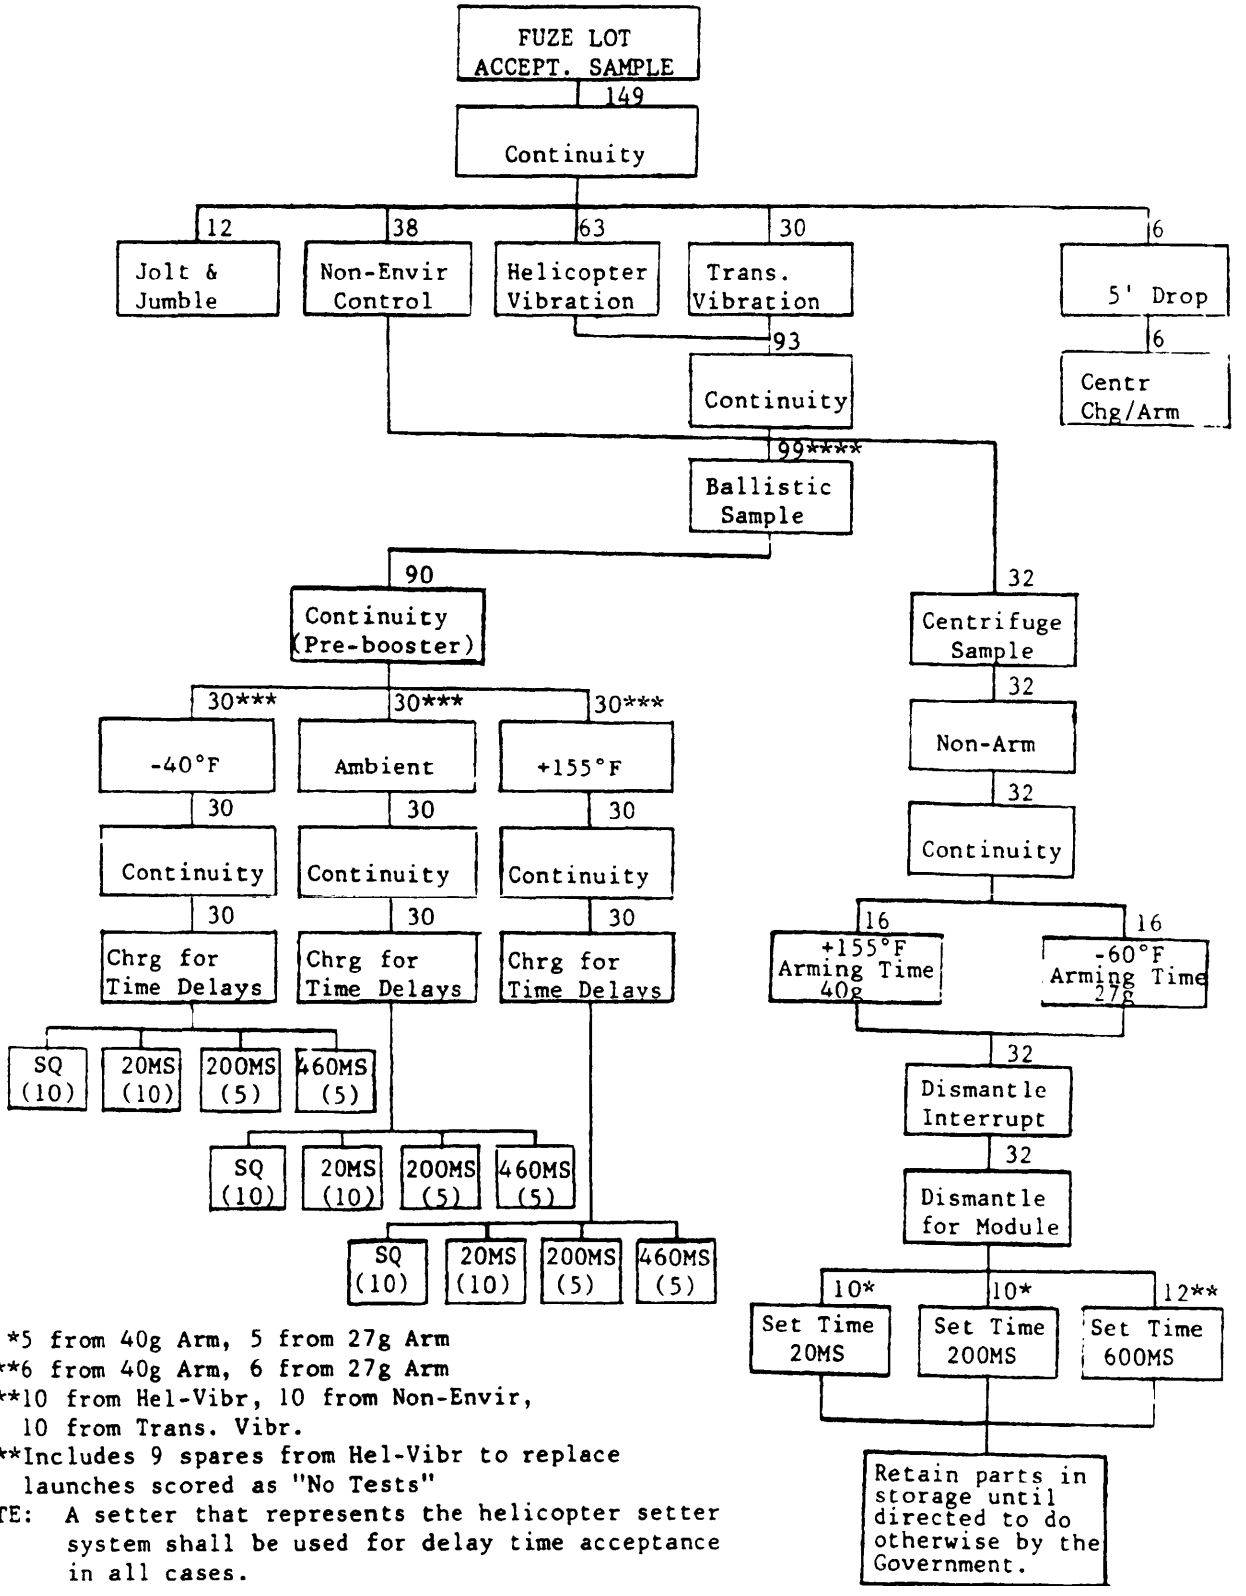


*5 from 40g Arm, 5 from 27g Arm
**6 from 40g Arm, 6 from 27g Arm
***10 from Hel-Vibr, 10 from Non-Envir, 10 from Trans. Vibr.
****Includes 9 spares from Hel-Vibr to replace launches scored as "No Tests"
NOTE: A setter that represents the helicopter setter system shall be used for delay time acceptance in all cases.


TABLE VII. Lot acceptance test.



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the currentversion before use.

FIGURE 1. Helicopter vibration


One 15 minute sinusoidal sweep (5-500-5 Hz) shall be performed for each of three axes. No dwell time shall be spent on any one frequency. A search for resonance shall not be done.

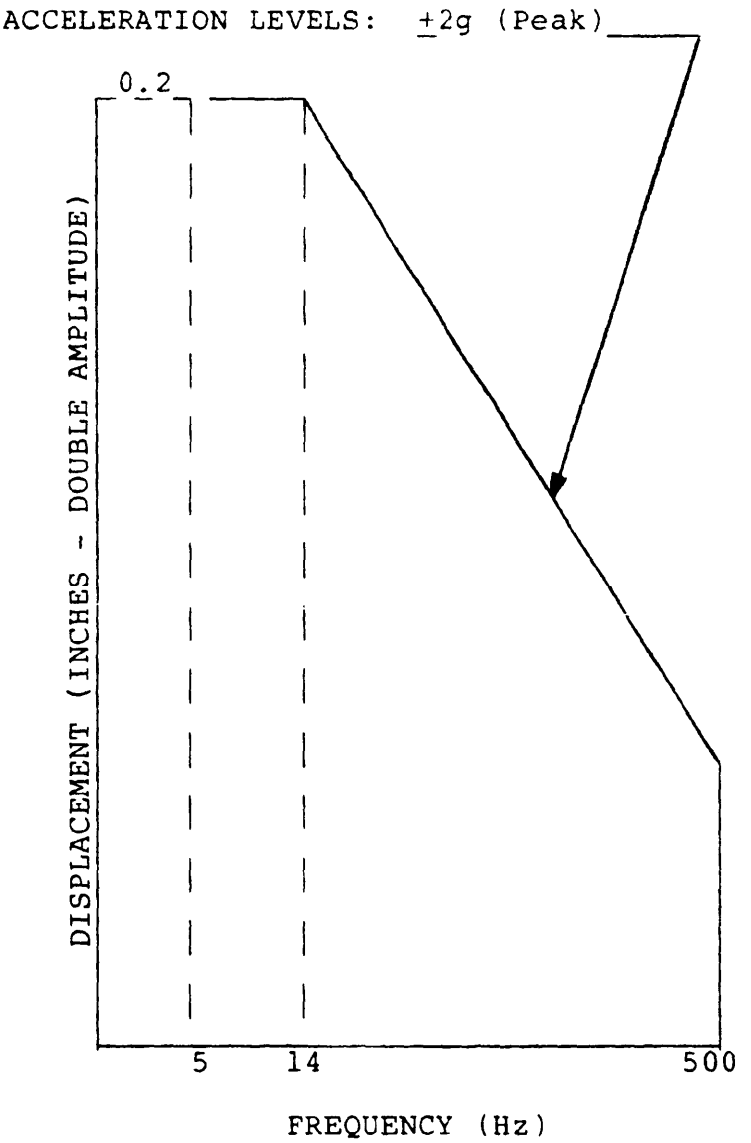




Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

FIGURE 2. Electronic module terminal diagram

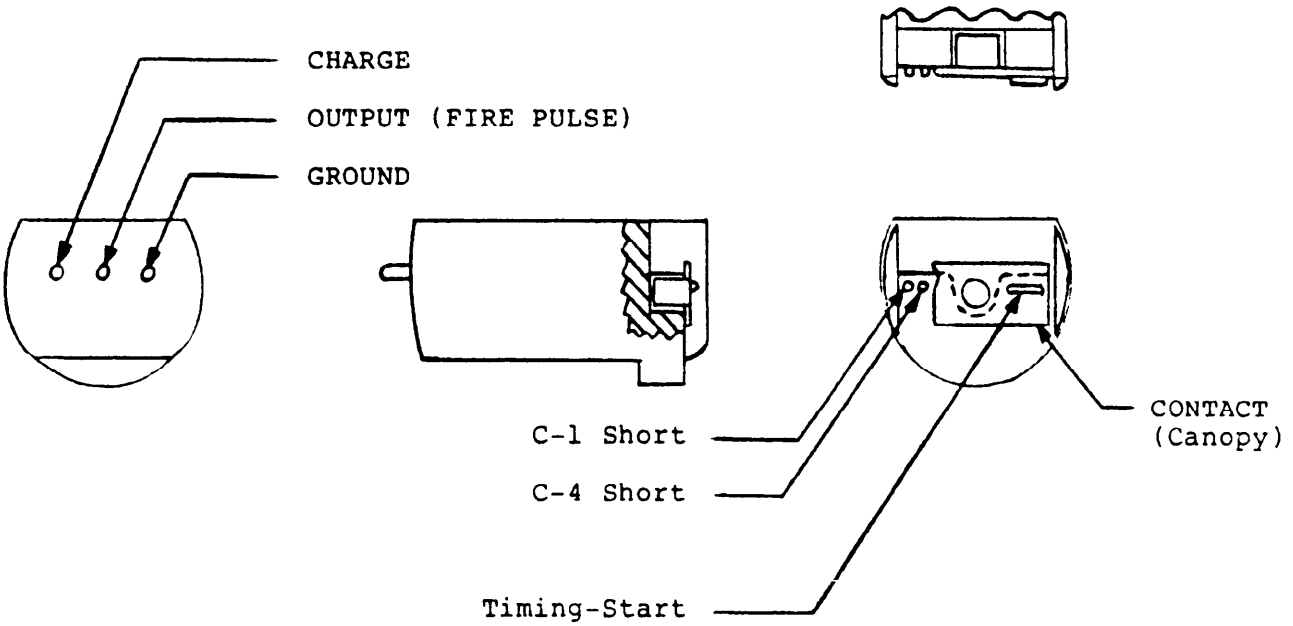


CR1, (1,2)
CR2, (C4 SHORT, 1)
REF. DWGS: 9260685
9260887
9260750



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

FIGURE 3. Lot Acceptance Test Data

M_____METAL PARTS LOT ACCEPTANCE TEST DATA

Contractor:_____ Fuze Lot No:_____

Date of Test:_____ Lot Quality (Gross):_____

Start:_____ Sample Size (Total):_____

End:_____ Sample Size Returned
Returned to Lot:_____

Date Shipped:_____ Lot Quantity (Net):_____

Five Foot Drop Test

5' Drop

| Sample Size | Serial No. of Defect | Failure Analysis |
|---|---|---|
| | | |

Non-Arm

| Sample Size | Serial No. of Defect | Failure Analysis |
|---|---|---|
| | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

Arming Time

| Sample | Number Accepted | Serial No. of Short Times | Serial No. of Long Times | Timed but Failed to Arm | Not Timed and Failed To Arm | Armed but Not Timed |
|---|---|---|---|---|---|---|
| | | | | | | |

Attach list of fuze serial numbers and arming times.

Firing Test

| Sample Size | Serial No. of Defect | Failure Analysis |
|---|---|---|
| | | |

5' Drop Failure Analysis

| |
|---|
| |

Operational Tests

Vibration Test

| Sample Size | Serial No. of Defect | Failure Analysis |
|---|---|---|
| | | |



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the currentversion before use.

Seal Leakage Test

| Sample Size | Serial No. of Defect | Failure Analysis |
|---|---|---|
| | | |

Fuze Non-Arm and Arming-Time Tests

Non-Arm Test

| Sample Size | Serial No. of Defect | Failure Analysis |
|---|---|---|
| | | |

Arming Time Test

| Sample | Number Accepted | Serial No. of Short Times | Serial No. of Long Times | Timed but Failed to Arm | Not Timed and Failed To Arm | Armed but Not Timed |
|---|---|---|---|---|---|---|
| | | | | | | |

Attach list of fuze serial numbers and arming times.

Failure Analysis

Correlation Factor applied to the arming time readings of the Five Foot Drop test and the Operational Test samples was _____ Seconds.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

Module Time Delay Tests

| Sample | Number Accepted | Serial No. of Short Times | Serial No. of Long Times | Serial No. of Failures to Function | Serial No. of Low Outputs |
|---|---|---|---|---|---|
| | | | | | |

Jolt and Jumble

| Sample Size | Serial No. of Defect | Failure Analysis |
|---|---|---|
| | | |

Failure Analysis

If lot failure is due to other than test conditioning.

_____

Government Inspector/Date

_____

Contractor Representative/Date



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

6.8 Data requirements. Deliverable data required by this specification in the following paragraph:

| Paragraph | Data Requirement | Applicable DID |
|---|---|---|
| 4.5.36 | Quality Inspection Test Demonstration and Evaluation Report | DI-R-1724 |
| 4.5.36 | Quality Inspection Defect Report | DI-R-1721 |

(Copies of data item description required by the contractor in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

6.9 Subject term (key word) listing.

Military specification
Fuze
Warhead, HE
Rocket (2.75 Inch)

6.10 Changes from previous issue. Asterisks (or vertical lines) are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1340-A749)



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

(TO DETACH THIS FORM, CUT ALONG THIS LINE.)

# STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

*(See Instructions – Reverse Side)*

| 1. DOCUMENT NUMBER | 2. DOCUMENT TITLE |
|---|---|
| MIL-F-63281A | FUZE, ROCKET: M433 LESS BOOSTER AND BOOSTER LEAD |

| 3a. NAME OF SUBMITTING ORGANIZATION | 4. TYPE OF ORGANIZATION *(Mark one)* |
|---|---|
| | ☐ VENDOR<br>☐ USER<br>☐ MANUFACTURER<br>☐ OTHER *(Specify)*: _____ |
| b. ADDRESS *(Street, City, State, ZIP Code)* | |

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

| 7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional | b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional |
|---|---|
| c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional | 8. DATE OF SUBMISSION *(YYMMDD)* |

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.