MIL-M-63305B(AR)
3 February 1987
SUPERSEDING
MIL-M-63305A(AR)
1 December 1981

MILITARY SPECIFICATION

MINE, ANTITANK: HE, M75
LOADING, ASSEMBLING AND PACKING

This Specification is approved for use within the U S Army Armament, Munitions and Chemical Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers quality assurance provisions for the loading, assembling and packing for one type of mine designated as Mine, Antitank: HE, M75.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. The following specifications and standards form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

MILITARY

MIL-S-45743 -Soldering, Manual Type, High Reliability, Electrical and Electronic Equipment

MIL-A-48078 -Ammunition, Standard Quality Assurance Provisions, General Specification For

MIL-D-63303 -Dispenser, Mine, Ground Vehicle: M128

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, U.S. Army Armament, Munitions and Chemical Command, Attn: AMSMC-QA, Dover, New Jersey 07801-5001 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 1345
DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the current version before use.

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes

MIL-STD-286 - Propellant, Solid: Sampling, Examination and Testing

MIL-STD-652D - Propellant, Solid for Cannon Requirements and Packing

MIL-STD-1235 - Single and Multi-Level Continuous Sampling Procedures and Tables for Inspection by Attributes

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

DRAWINGS (See 6.5)

U S ARMY ARMAMENT RESEARCH, DEVELOPMENT AND ENGINEERING CENTER (ARDEC)

PRODUCT AND PACKAGING DRAWINGS

9343804 - Pkg & Mkg for Plastic Ammo Cntr: PA 83 for Mine, AT: He, M75

9243805 - Pkg & Mkg For Shipping & Storage Container, Mine For Mine, AT: HE, M75; Mine, AP: HE, M74 Or Mine, AT, Prac: M79 In Cntr, Ammo, Plastic: PA-83

9292227 - Mine, Antitank: HE, M75

12624467 - M74 and M75 Mine Performance Requirements.

12624514 - Pkg & Mkg for Shipping & Storage Container, Mine for Mine, AT: HE, M75; Mine, AP: HE, M74 or Mine, AT, Prac: M79

12624515 - Pkg & Mkg for Container, Fiberboard for Mine, AP: HE, M74; Mine, AT: HE, M75; or Mine, AT, Prac: M79.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

INSPECTION EQUIPMENT DRAWINGS

9277922	-	Mine, Demonstrator
9293021	-	Power Supply, Transmitter
9293046	-	Transmitter Assembly
9331518	-	Test Mine, Hazardous

U S ARMY MATERIEL DEVELOPMENT AND READINESS COMMAND

19-48-4116/95M-20PA1002 -Unitization Procedure For Boxed Ammunition and Components on 4-Way Entry Pellets

(Copies of specifications, standards, handbooks, drawings and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer).

2.1.3 Other publications. The following document(s) form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of the documents which are DOD adopted shall be those listed in the issue of the DoDISS specified in the solicitation. Unless otherwise specified, the issues of documents not listed in the DoDISS shall be the issue of the nongovernment documents which is current on the date of the solicitation.

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

ASTM-D-792 - Specific Gravity and Density of Plastics by Displacement, Method A-1.

(ASTM materials are available from ASTM: American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA. 19103).

2.2 Order of precedence. In the event of a conflict between the text of this specification and references cited herein (except for associated detail specifications, specification sheets or MS standards), the text of this specification shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Material. Material shall be in accordance with the applicable drawings, specifications and standards.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

3.2 Mine assembly. The Mine Assembly shall comply with all requirements specified on Drawing (DWG) 9292227 and all associated drawings and with all requirements specified in applicable specifications and standards.

3.2.1 Air pressure test. The leakage in the mine when subjected to a positive external air pressure of 5 + 0.5 psig shall not cause a pressure drop greater than 0.003 psig in fifteen seconds.

3.3 Safe condition and circuit continuity verification.

3.3.1 S&A assembly. The S&A Assembly (DWG 9328756) shall be in a full safe condition and have all safety features in the proper position as evidenced by the following:

a. Safe position of both spring-loaded centrifugal locks.

b. Safe position of spring-loaded slider assembly. (Distance from end of S&A body to slider assembly, max.)

c. Safe position of slider release pin with shear pin engaged.

d. The detonators and piston actuator circuits of the flexible cable shall be shorted to S&A case ground.

There shall be no damage to the two (2) MDF's or to the flex cable. Damaged MDF is described as any crack in the lead sheathing or necking down (reduction in diameter) below 75% of the original diameter anywhere along the length of the MDF. Also, the end caps shall not be damaged, crushed or loose. The lock plate shall not be pushed into either centrifugal lock cups.

3.3.2 Electronics - MCD assembly. Prior to assembly of S & A into a mine, verification checks shall be made of the unactivated battery voltage, integrity of shorting bars and continuity/resistance of the circuits listed in DWG 9292225.

3.3.3 Shunting of the S&A assy flexible cable circuits. Prior to assembly of S&A into a mine, the shunts or shortings of the parallel detonators and of the micropiston actuator circuits shall meet the requirement of Dwg. 9328756. After soldering S&A flexible cable to Electronics - MCD Assy, the resistance of the same circuits shall meet the requirement of Dwg. 9292225.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the currentversion before use.

3.4 Soldering. Soldering of the S&A flexprint to the electronic assembly terminals shall be performed in a thorough, workmanlike manner in accordance with MIL-S-45743.

3.5 Explosive output performance

3.5.1 Pretest of booster explosive. Each lot of Booster Explosive used to manufacture booster shall be statically tested for qualification prior to its use in production. The Booster (DWG 9277827) when initiated, shall propagate to the Main Charge resulting in a high order detonation of the Main Charge and penetration of the M-S Plate through a one (1) inch thick and a one-half (1/2) inch thick hot rolled steel plates spaced apart and produce spall on subsequent witness plates. (See 4.5.3). Spall is defined as any evidence of particle indentation of the third plate.

3.5.2 Pretest of main charge explosive. Each lot of Main Charge Explosive used to manufacture main charges shall be statically tested for qualification prior to its use in production. The Main Charge (DWG. 9278018) when initiated by the Booster, shall produce a high order detonation and penetration of the M-S Plate through a one (1) inch thick and a one-half (1/2) inch thick hot rolled steel plates spaced apart and produce spall on subsequent witness plates. (See 4.5.3). Spall is defined as any evidence of particle indentation of the third plate.

3.6 Mine functioning. After initiation by a device simulating the spin and electromagnetic pulse (MCS) features of the M128 Dispenser MIL-D-63303 (See 4.4.5), the mines shall be in the commit to arm mode. Following initiation, the S&A of the mine shall arm followed by the enabling of the sensors. After enable, the mines (see 6.6 and 6.7) shall be functioned as per 3.6.2 and 3.6.3.

3.6.1 Arming delay. The S&A of the mine shall arm upon the elapse of the mine arming time specified on DWG 12624467 as evidenced by functioning of the micropiston actuator.

3.6.2 Hazardous test mines. The Test Mines as defined in 6.6.b shall be used to subject Hazardous Test Mine Assemblies to Prime Target Sensor, Anti-Disturbance and Self Destruct modes of functioning.

3.6.2.1 Prime target sensor function. The armed Hazardous Test Mine shall function properly, as evidenced by functioning of the clearing charge and high order detonation of the S&A leads PA517, when either flat side of the mine is positioned on a horizontal surface and subjected to a valid target signature.

3.6.2.2 Self-destruct (SD) function. The armed Hazardous Test Mine shall function properly within the set self destruct time specified on DWG 12624477, as evidence by functioning of the clearing charge and high order detonation of the S&A explosive leads PA 517.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

3.6.2.3 Anti-disturbance function. The armed Hazardous Test Mines that contain anti-disturbance switches shall function properly, as evidenced by functioning of the clearing charge and high order detonation of the S&A leads, during tilting of the mine up to 90° from the horizontal in two directions 180° apart.

3.6.3 Tactical HE mines. The armed HE Mines with and without AD switches shall function high order when subjected to a valid target signature.

3.6.3.1 Prime target sensor mode functioning. The armed HE Mine subjected to a valid target signature shall produce a high order detonation and penetration of the M-S plate through a one (1) inch thick and one-half (1/2) inch thick hot rolled steel plate spaced apart and produce spall on subsequent witness plates (See 4.5.3, 4.5.6). Spall is defined as any evidence of particle indentation on the third witness plate.

3.6.4 Functioning after maximum time. The armed Hazardous Test Mines, DWG 9331518, which fails to self destruct (SD) after the maximum set SD time as specified on DWG 12624467 has elapsed shall not be capable of being functioned by target sensor, anti-disturbance, self destruction or any other non-destructive stimuli.

3.7 Controls in use of adhesives. The contractor shall develop a documented operational procedure for utilization of adhesives. This procedure shall provide for quality control of raw materials and process to be used; details associated with intended use, such as proper handling, dispensing, mixing, curing cyles, pot life, etc., cleaning agents, safety precautions, special ventilation, drying or other processes, and any other information of a similar nature that is considered necessary for the particular adhesive in use. This procedure shall be updated whenever a change is made such that the original assurance of product quality is affected. Submission of this procedure shall be in accordance with Data Item Description DI-T-5372 (Tailored). (See 6.8)

3.8 Documentation of plan for safety in handling and processing of munitions. Prior to loading, the contractor shall document a detailed plan of the procedures to be employed during handling of the munition. This documentation shall describe, as a minimum, the procedures to be employed to assure that:

(1) The two (2) types of electronic assemblies (with/without A.D. switch) remain segregated at all times.

(2) The proper mix of mines (w/ and w/o AD switches) is packed in the Plastic Ammunition Container PA-83.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

(3) Markings on electronics assemblies and tagging or temporary marking on mine assemblies are consistent and handling of the items controlled to prevent intermixing.

(4) The temperature of the electronics assemblies, mine assemblies, packed, PA 83 Plastic Ammuntion Containers and packed Shipping and Storage Containers does not exceed 165°F at any time during processing or storage and in such instances the time at 165°F shall not exceed one (1) hour unless otherwise specified herein. In no case shall continuous storage of the items be at a temperature above 100°F for a period exceeding 30 days.

(5) High explosive (HE) munition items remain segregated from hazardous (see 6.6) munitions at all times and that indentification of hazardous munitions be strictly maintained.

Submission of the plan shall be in accordance with data item description DI-T-5372 (tailored). (See 6.8)

3.9 First article inspection. This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.10 Data requirement. The contractor shall generate data in accordance with the requirements of the data item description cited in 6.10.

3.11 Workmanship. All Parts and assemblies shall be fabricated, loaded and assembled in a thorough workmanlike manner, and all manufacturing, processing, and assembling operations shall be correctly performed. All parts and assemblies shall be clean, free of burrs, sharp edges, cracks, dirt, grease, rust, and other foreign matter that may impair proper functioning. The cleaning method used shall not be injurious to any part, nor shall the parts be contaminated by the cleaning agent(s). Exterior surface coating shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined. Required packing shall be dry. The boosters and main charges shall be free of surface defects (voids, protrusions, inclusions). Breakage (chips, nicks) on the outside edge (corner) of the Main Charge (HE) not exceeding 1/8 sq. inch in area and 1/8 inch in depth and not exceeding three (3) per side are acceptable. Breakage (chips, nicks) on the outside edge (corner) of the Main Charge Simulant not exceeding 1/4 square inch in area and 1/4 inch in depth and not exceeding four (4) per side are acceptable.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsiblity for inspection . Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.2 Classification of inspections. The following types of inspections shall be conducted on this item.

a. First Article Inspection

b. Quality Conformance Inspection

4.3 First article inspection

4.3.1 Submission. The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with the provisions of 4.3.2. The first article sample shall consist of the following items in sample quantities as indicated.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

Part Description	Drawings
Quantity	
Booster	9277827
5	
Main Charge	9278018
5	
Test Mine, Hazardous	
w/o AD Switch	9331518-1
18	
w/AD Switch	9331518-2
3	
Mine, Antitank:	
HE, M75	
w/o AD Switch	9292227-1
8	
w/AD Switch	9292227-2
3	

4.3.2 Inspections to be performed. See MIL-A-48078 and Table I specified herein.

4.3.3 Rejection. See MIL-A-48078.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the currentversion before use.

TABLE I. - First article inspection

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2	DRAWING NUMBER
	Mine, Antitank: HE, M75			See Below
				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH / PARAGRAPH REFERENCE /INSPECTION METHOD
	Main Charge (Dwg. 9278018)			
	Examination of Defects	5		3.2 / 4.4.2.1
	Density	5		3.2 / 4.5.2
	Explosive output performance	5		3.5.2 / 4.5.3
	Booster (Dwg. 9277827)			
	Examination of Defects	5		3.2 / 4.4.2.2
	Density	5		3.2 / 4.5.2
	Explosive output performance	5		3.5.1 / 4.5.3
	Test Mine, Hazardous (Dwg. 9331518-1)	18		
	Incorrect Electronics - MCD Assy	all		6.6b / Visual 1/
	Prime Sensor Functioning	10		3.6.2.1 / 4.5.5.1
	SD Normal Functioning	8		3.6.2.2 / 4.5.5.2
	Test Mine, Hazardous (Dwg. 9331518-2)	3		
	Incorrect Electronics - MCD Assy			6.6b / Visual 1/
	Anti-Disturbance Functioning			3.6.2.3 / 4.5.5.3
	Mine, Antitank: HE, M75 (Dwg. 9292227-1)	8		
	Incorrect Electronics - MCD Assy	all		3.2 / Visual 1/
	Cracks in H.E. Material	all		3.2 / Visual 1/
	Prime Sensor Functioning	all		3.6.3.1 / 4.5.6
	Air Test	all		3.2.1 / 4.5.9

NOTES:

1/ Inspection to be performed before or during assembly of mine.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE I - First article inspection

CLASSIFICATION OF DEFECTS & TESTS MIL-M-63305B(AR)

PARAGRAPH	TITLE: Mine, Antitank: HE, M75		SHEET 2 OF 2		DRAWING NUMBER: See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Mine, Antitank: HE, M75 (Dwg. 9292227-2)	3			
	Incorrect Electronics - MCD Assy			3.2	Visual 1/
	Cracks in H.E. Material			3.2	Visual 1/
	Prime Sensor Functioning			3.6.3.1	4.5.6

NOTES: 1/ Inspection to be performed before or during assembly of mine.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2016-12-20 05:28
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection

4.4.1 Inspection lot formation. Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of mines shall contain:

a. S&A Assemblies (DWG 9328756) of one lot interfix from one manufacturer.

b. Electronics - MCD Assemblies (DWG 9292225-1,-2) of one lot interfix number from one manufacturer.

c. Main Charge (DWG 9278018) of one lot interfix number from one manufacturer.

d. Booster (DWG 9277827) of one lot interfix number from one manufacturer.

e. Propellant Cup Assemblies (DWG 9292175) of one lot interfix from one manufacturer.

f. M-S plates (DWG 9277742) of one lot interfix number from one manufacturer.

Maximum lot size shall be no more than one (1) month production (30 calendar day period).

4.4.2 Examination. (See MIL-A-48078) and 4.4.2.1 thru 4.4.2.15. Unless otherwise specified in the Classification of Defects and Test Forms, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II. Equivalent continuous sampling plans in accordance with MIL-STD-1235 may be utilized. The choice of the plan shall be subject to approval from the procuring activity. In any case, inspection for critical defects shall be maintained at 100%.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the currentversion before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.1	Main Charge				9278018
					NEXT HIGHER ASSEMBLY 9292227-1, -2
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter		(a)	3.2	Gage
102	Inside diameter		(a)	3.2	Gage
103	True position of ID to OD		(a)	3.2	Gage
104	Spherical radius, 360° around (2 sides)		(a)	3.2	Gage
105	Length		(a)	3.2	Gage
106	Thickness		(a)	3.2	Gage
107	Density		(b)	3.2	4.5.2
108	Cracks or laminations		0.40%	3.2	Visual
109	Material				Certification
110	Explosive output test (See Note d)		(c)	3.5.2	4.5.3
Minor					
201	Poor workmanship		0.65%	3.10	Visual
	NOTES:				
	(a) See 4.4.3.1 for sampling plan and accept/ reject criteria.				
	(b) See 4.4.3.2 for sampling plan and accept/ reject criteria.				
	(c) See 4.4.3.3 for sampling plan and accept/ reject criteria.				
	(d) Data item description DI-R-1724 applies for the test. Submit each time test is run.				

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9277827
4.4.2.2	Booster				NEXT HIGHER ASSEMBLY 9292227-1, -2
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter		(a)	3.2	Gage
102	Inside diameter		(a)	3.2	Gage
103	True position of ID to OD		(a)	3.2	Gage
104	Length		(a)	3.2	Gage
105	Cracks or laminations		(a)	3.2	Visual
106	Density		(b)	3.2	4.5.2
107	Material				Certification of Conformance
108	Explosive output test (See Note d)		(c)	3.5.1	4.5.3
Minor					
201	Poor workmanship		0.65%	3.10	Visual
	NOTES: (a) See 4.4.3.1 for sampling plan and accept/ reject criteria. (b) See 4.4.3.2 for sampling plan and accept/ reject criteria. (c) See 4.4.3.3 for sampling plan and accept/ reject criteria. (d) Data item description DI-R-1724 applies for the test. Supply data each time test is performed				
NOTES:					

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9333804
4.4.2.3	Main Charge, Simulant				NEXT HIGHER ASSEMBLY 9331518
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter		a	6.6b	Gage
102	Inside diameter		a	6.6b	Gage
103	True position of ID to OD		a	6.6b	Gage
104	Spherical radius (360° around) two sides		a	6.6b	Gage
105	Length		a	6.6b	Gage
106	Thickness		a	6.6b	Gage
107	Cracks or laminations		0.40%	6.6b	Visual
108	Material		-		Certification of Conformance
109	Through inspection hole missing, 2 places		0.40%	6.6b	Visual
Minor					
201	Poor workmanship		0.65%	3.10	Visual

NOTES:

a) See 4.4.3.1 for sampling plan and accept/reject criteria.

Source: https://assist.dla.mil -- Downloaded: 2026-04-26 04:26
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.4	Booster, Simulant		9277763
			NEXT HIGHER ASSEMBLY 9331518

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter		a	6.6b	Gage
102	Inside diameter		a	6.6b	Gage
103	True position of ID to OD		a	6.6b	Gage
104	Length		a	6.6b	Gage
105	Material		-		Certification of Conformance
106	Cracks or laminations		0.40%	6.6b	Visual
Minor					
201	Poor workmanship		0.65%	3.10	Visual

NOTES:

a) See 4.4.3.1 for sampling plan and accept/reject criteria.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-04-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.5	Propellant Cup Assembly				9292175
					NEXT HIGHER ASSEMBLY
					9292227/9331518
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Weight of propellant incorrect	1/	0.40%	3.2	Balance
102	Cup waterproofness destroyed (separation of seal, cup punctured, etc.)	1/	0.40%	3.2	Visual
103	Moisture and volatile contents of propellant	1/	0.40%	3.2	4.5.7
104	Packaging container(s) for assemblies lack seal or humidity control, see drawing requirement; MIL-STD-652D.	1/	0.40%	3.2	Visual
Minor					
201	Poor workmanship		0.65%	3.10	Visual

NOTES: 1/ If secured from vendor: Certification of conformance attesting to above requirements will be satisifactory.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2021-10-26T04:22
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.6	S&A Assembly (Prior to the assembly of the S&A to the Electronics - MCD Assy)		9328756
			NEXT HIGHER ASSEMBLY 9292227/9331518

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Unshunted detonator or micropiston actuator	Note1	100%	3.3.3	4.5.1.3, Testor
2	Length from body to slider assy, max		100%	3.3.1	4.5.1.1, Gage
3	Slider release pin and shear pin improperly assembled or missing		100%	3.3.1	4.5.1.1, Visual
4	Centrifugal locks improperly assembled or missing		100%	3.3.1	4.5.1.1, Visual
Major					
101	MDF damaged, 2 places		0.40%	3.3.1	Visual
102	End cap cup damaged, 2 places		0.40%	3.3.1	Visual
103	Main charge lead improperly installed, 4 places		0.40%	3.2	Visual, Note 3
104	Lock plate missing, damaged or pushed into lock cup, 2 places		100%	3.2	Visual
105	MDF cup(s) improperly crimped		0.40%	3.2	Visual/Manual
106	Adhesive disc incorrect		0.40%	3.2	Visual
107	Shield missing damaged or blocking main charge leads		0.40%	3.2	Visual
Minor					
201	Poor workmanship		0.65%	3.10	Visual

NOTES:
1. Circuit(s) of flexible cable are received unshunted.
2. Data item DI-R-1721 applies - report required only when critical defects are found.
3. Improperly staked, obstructed or wrong color end, loose or missing.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-04-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.7	Electronics - MCD Assy (Prior to assy of S&A Assy to the Electronics - MCD Assy)	1 OF 1	9292225
			NEXT HIGHER ASSEMBLY: 9292227/9331518

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Short across firing capacitor: open	Note1	100%	3.3.2	4.5.1.2
2	Fuse and ID resistance check, pins 10 &9	Note1	100%	3.3.2	4.5.1.2
3	Test pads insulator missing(inside well)		100%	3.2	Visual (Note 3)
Major					
101	Battery activated, 3-9, 8-3	Note1	100%	3.3.2	4.5.1.2
102	MCD and shorting bar circuit resistance, D-F & G-F incorrect		0.40%	3.3.2	4.5.1.2
103	Pads 12 to 9 not open circuited	Note2	0.40%	3.3.2	4.5.1.2
104	Terminal pins not clean, 2 locations		0.40%	3.2	Visual
105	EBP bushing missing or above flush		0.40%	3.3	Visual
106	Visual damage		0.40%	3.2	Visual
107	Identification code incorrect		0.40%	3.2	Visual
108	MCD coil soldering improper		0.40%	3.2	Visual
109	MCD assy incorrect, improperly assembled or damaged		0.40%	3.2	Visual
Minor					
201	Poor workmanship		0.65%	3.10	Visual

NOTES: 1. Data item description DI-R-1721 applies. Submission of the report shall be whenever critical and Major 101 defects are found. 2. GEMSS versus GATOR lens identification (ID) check: At present Pad 12 of DWG 9292225 is open whereas Pad 12 for the GATOR lens should be 20K ± 5% ohms. 3. To be performed prior to operations noted in 4.4.2.8.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.8	Mine Subassembly (Consisting of S&A; M-S Plate; Electronics - MCD Assy; Elec. End Bracket assy; Propellant Cup Assy, Elec. Outer Cup)	1 OF 2	9331518/9292227
			NEXT HIGHER ASSEMBLY: ---

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Test pads insulator missing (between cover and pads)		100%	3.2	Visual (Note 3)
Major					
	Prior to Uploading with Simulant/Main Charge				
101	Electronic end bracket assy insulation tape missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Incorrect electronic lens, -1 Vs -2		0.40%	3.2	Visual
103	MDF cord pinched or damaged or incorrectly seated in bracket assy		0.40%	3.2	Visual
104	Propellant cup assy missing		0.40%	3.2	Visual
105	Tape missing from cable (over exposed termination area)		0.40%	3.2	Visual
106	Solder joint incorrect, 3 places	Note1	0.40%	3.4	Visual
107	Parallel detonators resistance, incorrect	Note2	100%	3.3.3	4.5.1.3
108	Micropiston actuator resistance, incorrect		100%	3.3.3	4.5.1.3
109	Resistance of the MCD, after soldering of flex cable, incorrect		100%	3.3.2	4.5.1.2

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.8	Mine Subassembly (Consisting of S&A; M-S Plate; Electronics - MCD Assy; Elec. End Bracket assy; Propellant Cup Assy, Elec. Outer Cup)				9331518/9292227
					NEXT HIGHER ASSEMBLY ---
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
110	Flexible cable cracked, twisted or improperly routed		0.40%	3.2	Visual
111	Elec. outer cup missing or improperly seated		0.40%	3.2	Visual
Minor 201	Poor workmanship		0.65%	3.10	Visual

NOTES:
1. Soldering of flexible cable.
2. Shunting section of flexible cable is cut off at notches.
3. To be performed following soldering and cleaning of S&A flex cable.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER 9331518
4.4.2.9	Test Mine, Hazardous				NEXT HIGHER ASSEMBLY --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical			See *		
1	Identifying number of mine case doesn't match identifying number of the Mine Subassembly			3.2	Visual
2	Main charge simulant (color) not inert			3.2	Visual
3	Booster simulant (color) not inert			3.2	Visual
Major	During Final Assembly				
101	Cracks in simulants			3.2	Visual, 1/
102	Exposure of M5 propellant, 2 places			3.2	Visual
103	Spacer end bracket assy improperly assembled			3.2	Visual
104	Identifying sticker missing or incorrect			3.2	Visual
105	Pressure ring incorrectly inserted			3.2	Visual
106	MDF cord pinched or damaged, or incorrectly seated in bracket assy			3.2	Visual
107	Clearing charge not seated in cavity			3.2	Visual
108	Adhesive incorrect, missing or incorrectly applied			3.2	Visual, 4.4.3.4
109	"O" rings missing or improperly located			3.2	Visual
110	Insulating disc missing(across lens)			3.2	Visual
	After Completed Assembly				
111	Inspection hole in case and main charge missing, 2 places			3.2	Visual

NOTES:

1/ Prior to assembly.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER 9331518
4.4.2.9	Test Mine, Hazardous				NEXT HIGHER ASSEMBLY --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
			See *		
112	Any cover gasket wrinkled and extruded from cover, or missing			3.2	Visual
113	Cover mine case not crimped or sealed 360°, top and bottom			3.2	Visual
114	Overall diameter			3.2	Gage
115	Overall height			3.2	Gage
116	Any cover loose			3.2	Visual/Manual
Minor					
201	Poor workmanship			3.10	Visual

*

HAZARDOUS TEST MINES

INSPECTION LOT SIZE	SAMPLE SIZE	ACCEPT - REJECT CRITERIA CRITICAL	MAJOR	MINOR
501-1200	21	0-1	0-1	0-1
1201-3200	35	0-1	0-1	0-1
3201-10,000	54	0-1	0-1	1-2
10,001-35,000	82	0-1	1-2	2-3

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.10	Mine Antitank: HE, M75				9292227
					NEXT HIGHER ASSEMBLY --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Identifying number of mine case doesn't match identifying number of the Mine Subassembly		100%	3.2	Visual
Major	During Final Assembly				
101	Cracks in HE material		0.40%	3.2	Visual, 1/
102	Exposure of M5 propellant, 2 places		0.40%	3.2	Visual
103	Spacer end bracket assy improperly assembled		0.40%	3.2	Visual
104	Identifying sticker missing or incorrect		0.40%	3.2	Visual
105	Pressure ring incorrectly inserted		0.40%	3.2	Visual
106	MDF cord pinched or damaged, or incorrectly seated in bracket assy		0.40%	3.2	Visual
107	Clearing charge not seated in cavity		0.40%	3.2	Visual
108	Adhesive incorrect, missing or incorrectly applied		0.40%	3.2	Visual, 4.4.3.4
109	"O" rings missing or improperly located		0.40%	3.2	Visual
110	Insulating disc missing		0.40%	3.2	Visual
	After Completed Assembly				
111	Identifying stickers not removed		0.40%	3.2	Visual
112	Any cover gasket wrinkled and extruded from cover, or missing		0.40%	3.2	Visual

NOTES:

1/ Prior to assembly.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.10 Cont'd	Mine, Antitank: HE, M75				9292227
					NEXT HIGHER ASSEMBLY
					--
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
113	Mine case not crimped or sealed 360°, top and bottom		100%	3.2	Visual
114	Overall diameter		0.40%	3.2	Gage
115	Overall height		0.40%	3.2	Gage
116	Any cover loose		0.40%	3.2	Visual/Manual
117	Air test		0.40%	3.2.1	4.5.8, 2/
Minor					
201	Paint damaged or incomplete		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

1. Data item description DI-R-1724 applies for the test. Submit variable data each time test is performed (see 6.8).

Source: https://assist.dla.mil -- Downloaded: 2022-10-10T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

Paragraph 4.4.2.11 & 4.4.2.12

LOT ACCEPTANCE TEST ("A" & "B")

Inspection Lot Size	Sample Size	Mine, Hazardous -1	Mine, Hazardous -2	Mine,HE -1	Mine,HE -2	SD Setting Normal	SD Setting Extended
501-1200	32	18	3	8	3	32	-
1201-3200	50	30	5	10	5	50	-
3201-10000	80	46	8	18	8	80	-
10001-35000	124	70	12	30	12	124	-

Paragraph 4.4.2.11

"A" - HAZARDOUS TEST MINES (SEE 6.6) 4/ 5/

"A" Sample	SD Normal	Prime Sensor	1/ AD Mode	ACCEPT - REJECT CRITERIA 2/ Premature Arming	Premature Detonation	Early SD	Hazardous Duds	3/ Failure
21	8	10	3	0-1	0-1	2-3	0-1	1-2
35	12	18	5	0-1	0-1	3-4	0-1	1-2
54	18	28	8	0-1	0-1	5-6	0-1	2-3
82	30	40	12	0-1	0-1	8-9	0-1	3-4

Paragraph 4.4.2.12

"B" - TACTICAL HE MINES (SEE 6.6) 4/

"B" Sample	Prime wo/AD	Sensor w/AD	ACCEPT - REJECT CRITERIA 2/ Premature Arming	Premature Detonation	Early SD	3/ Failure
11	8	3	0-1	0-1	1-2	0-1
15	10	5	0-1	0-1	1-2	1-2
26	18	8	0-1	0-1	3-4	1-2
42	30	12	0-1	0-1	4-5	2-3

NOTES:

1/ Only mines slated for functioning in anti-disturbance mode shall have switches.
2/ See 6.7 for definitions of defects. 3/ Failures: Low order or failure to function.
4/ Function Mode; Accept and Reject Criteria; Requirement: 3.6.2/3.6.3; Test Method: 4.5.5/4.5.6.
5/ Non-Hazardous duds (Hazardous Test Mines Only) shall be dismantled and failure analyzed (4.5.5.4, 6.7.f).

Source: https://assist.dla.mil -- Downloaded: 2026-04-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9331518-1
4.4.2.13	Hazardous Test Mine				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Hazardous Test Mines (See 6.7)				
	Function Mode: Self Destruct - Extended	8	1/	3.6.2.2	4.5.5, 4.5.5.2
	Defects		2/		
	Arming time failure				6.7
	Hazardous duds (Functioned by target sensor)				4.5.5.2, 6.7
	Failures - low order or failure to function				6.7
	Dismantling and failure analysis				4.5.5.4, 6.7.f

NOTES:
1/ For engineering information only. Eight (8) samples per inspection lot.
2/ Information to be recorded and submitted (see 6.8).

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.14	Case, Mine See Note 1				9333803
					NEXT HIGHER ASSEMBLY
					9331518
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
Minor					
101	Inspection hole diam., 2 places		1.0%	6.6	Gage
102	Height of inspection hole		1.0%	6.6	Gage

NOTES:
1. P/N 9333803 is made from P/N 9292142.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.15	Pkg For Plastic Ammunition Container PA-83 for Mine, AT: HE, M75				9243804
					NEXT HIGHER ASSEMBLY 9243805
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of mine type in containers, improper		0.40%	3.2	Visual/Manual
102	Mix of mines in containers, improper		0.40%	3.2	Visual/Manual
103	Retainers (2) not secured properly		0.40%	3.2	Visual/Manual
104	Marking missing, incorrect, or illegible		0.40%	3.2	Visual
Minor					
201	Poor workmanship		0.65%	3.10	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.2.16	Pkg & Mkg For Shipping & Storage Container, Mine, For Mine, AT: HE, M75; Mine, AP: HE, M74; Or Mine AT, Prac: M79, In Cntr, Ammo, Plastic: PA-83	1	1	9243805
				NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
	Prior to Securing Cover:				
101	Marking missing, incorrect or illegible		100%	3.2	Visual
102	Bags (2) of Desiccant missing		0.40%	3.2	Visual
103	Filler on bottom missing		0.40%	3.2	Visual
104	Any Plastic Ammo Containers missing		0.40%	3.2	Visual
105	Number of Slotted Fillers not adequate for tight packing		0.40%	3.2	Visual/Manual
106	Slotted Fillers positioned incorrectly		0.40%	3.2	Visual
107	Number of top fillers not adequate for tight packing		0.40%	3.2	Visual/Manual
108	Dirt or foreign material on Gasket or Gasket Track (Cover and Base)		0.40%	3.2	Visual
109	Any lifting strap missing, 8 required		0.40%	3.2	Visual
	After Securing Cover:				
110	Vent Assembly Cap not hand tight		0.40%	3.2	Manual
111	Humidity Indicator torqued improperly		0.40%	3.2	Gage
112	Fastener Nuts (8) torqued improperly		0.40%	3.2	Gage
113	Vent Assembly Nut torqued improperly		0.40%	3.2	Gage
114	Humidity indicator dots not proper color		100%	3.2	Visual
Minor					
201	Poor workmanship		0.65%	3.10	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA.(D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.17	Pkg & Mkg for Container, Fiberboard for Mine, AP: HE, M74; Mine, AT: HE,M75; or Mine, AT, Prac: M79				12624515
					NEXT HIGHER ASSEMBLY 12624514
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any mines missing from container		0.40%	3.2	Visual/Manual
102	Closure; not properly secured		0.40%	3.2	Visual/Manual
103	Marking missing, incorrect or illegible		0.40%	3.2	Visual
Minor					
201	Poor workmanship		0.65%	3.10	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2020-10-26T04:26Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63305B(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.18	Pkg & Mkg For Shipping & Storage Container, Mine, For Mine, AT: HE, M75; Mine, AP: HE, M74; Or Mine AT, Prac: M79,	1 OF 1	12624514
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
	Prior to Securing Cover:				
101	Marking missing, incorrect or illegible		100%	3.2	Visual
102	Bags (2) of Desiccant missing		0.40%	3.2	Visual
103	Filler on bottom missing		0.40%	3.2	Visual
104	Any Fiberboard Ammo Containers missing		0.40%	3.2	Visual
105	Number of Slotted Fillers not adequate for tight packing		0.40%	3.2	Visual/Manual
106	Slotted Fillers positioned incorrectly		0.40%	3.2	Visual
107	Number of top fillers not adequate for tight packing		0.40%	3.2	Visual/Manual
108	Dirt or foreign material on Gasket or Gasket Track (Cover and Base)		0.40%	3.2	Visual
	After Securing Cover:				
110	Vent Assembly Cap not hand tight		0.40%	3.2	Manual
111	Humidity Indicator torqued improperly		0.40%	3.2	Gage
112	Fastener Nuts (8) torqued improperly		0.40%	3.2	Gage
113	Vent Assembly Nut torqued improperly		0.40%	3.2	Gage
114	Humidity indicator dots not proper color		100%	3.2	Visual
Minor					
201	Fiberboard Ammo Containers not position properly		0.65%	3.2	Visual
202	Poor workmanship		0.65%	3.10	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Dimensional control of main charges and boosters (See DWGS 9277827 and 9278018). The dimensions/parameters specified in 4.4.2.1 and 4.4.2.2 for the main charges and boosters shall be checked by randomly selecting three (3) samples from the quantity produced by each press during a period not to exceed four (4) hours. The samples shall be allowed to cool and become dimensionally stable prior to inspecting. The quantity represented by the samples shall be identified and not used in production until the dimensional inspections are completed. If any one (1) sample fails to comply with the dimensional requirements, the quantity of parts represented by the sample shall be subjected to 100% inspection. The contractor and technical agency shall determine the amount of time required for cooling and supply this information to the resident Government inspector. The above inspection shall also be performed each time a new lot of explosive material is used.

4.4.3.2 Density of the main charge and booster (See DWGS 9278018 and 9277827). The density of the main charges and boosters produced from each press shall be checked by randomly selecting one (1) sample from the quantity produced by each press during a period not to exceed four (4) hours. The boosters and main charges shall be allowed to cool, become dimensionally stable and meet dimensional requirements prior to performing the density measurement. The quantity represented by the sample shall be identified and not used in production until the density measurement is made and the part accepted. If the sample fails to comply with the density requirements of the applicable drawing, the quantity of parts represented by the sample shall be subjected to 100% inspection. The contractor and technical agency shall determine the amount of time required for cooling and supply this information to the resident Government inspector. The above test shall also be performed each time a new lot of explosive material is used. The test shall be performed as specified in 4.5.2.

4.4.3.3 Explosive performance. A sample of each lot of explosive used to manufacture main charges and boosters shall be tested at the start of each new explosive lot usage. One (1) main charge shall be randomly selected and inspected for the defects listed in 4.4.2.6. The density of the sample shall be determined (See 4.5.2) (must be within acceptable limits) and set aside for explosive performance tests. The main charges shall be tested in accordance with 4.5.3 using boosters from a previously accepted booster lot.

Similarly, one (1) booster shall be randomly selected and inspected for the defects listed in 4.4.2.5. The density of the sample shall be determined (see 4.5.2) (must be within acceptable limits) and set aside for explosive performance tests. One (1) booster shall be tested in accordance with 4.5.3 using a main charge from a previously accepted main charge lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

Failure of the explosive performance sample to comply with the requirements of 3.6 shall result in rejection of the lot of explosive material represented by the sample. Results of these tests shall be supplied in accordance with 6.8.

4.4.3.4 Adhesive application. At the start of each days production and after each four (4) hours during production and at the end of each shift a verification of proper adhesive application shall be made following procedures generated by the contractor (See 3.7). The procedure shall assure that the proper amount of adhesive has been and is being dispensed and properly applied. The method shall assure that adhesive is not migrating to the S&A assembly. Additionally, all other process controls, delineated in 3.7, shall be verified at least once a shift. Evidence of inadequate adhesive application or migration of adhesive to the S&A during any of the verification checks shall result in rejection of that quantity of mines assembled since the last acceptable check. If the adhesive application does not comply with all requirements at the start of the production the Contractor shall not proceed with production until corrective action has been taken and all requirements met.

4.4.3.5 Lot acceptance testing. The sample size for lot acceptance test shall be per MIL-STD-105, Inspection Level I, and consist of Tactical HE Mines and Hazardous Test Mines in proportion shown in 4.4.2.11 and 4.4.2.12.

a. HE Mines for lot acceptance test shall be selected in accordance to MIL-STD-105.

b. Hazardous Test Mines for lot acceptance tests shall be selected in accordance with MIL-STD-105, but modified as follows:

(1) The subassemblies and parts shall be randomly selected from a inspection lot formation, but shall be tested continuously on short periodic basis, e.g., daily , every xx days.....

(2) The Hazardous Test Mine will differ from the continuous flow assembly, as in assembly of HE Mine, in having two main steps in assembly: a partially loaded subassembly randomly selected (See b(3) below) and a final assembly of finish loading of mine with inert components.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

(3) The partial loaded assembly will consist of an S&A, M-S plate, electronic end bracket asembly, propellant cup assembly, electronic outer cup and electronics - MCD assembly. This subassembly will be randomly selected as per "b(1)" above and transferred to a controlled area to be uploaded and tested on a periodic basis. This mine sample will be built on the identical production facility using the identical production hardware used to produce the HE loaded mines with the following exceptions.

(A) The main charge and booster will be inert or simulants.

(B) The mine case and main charge simulant will have holes to permit verification that both simulants are inert.

(C) Special colors may be added to verify the mine type and permit easy identification for the up-side select testing.

4.4.4 Inspection equipment. The inspection equipment required to perform the examinations and tests prescribed in this specification is identified, either directly or by reference, in the "Paragraph Reference/Inspection Method" column of the First Article or Quality Conformance Inspection Forms herein. The contractor shall submit inspection equipment designs to the Government for approval in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and 6.3 herein.

4.4.5 Launch simulator. The Simulator Device(s) shall simulate the M128 Ground Vehicle Dispenser launch features of spin and electromagnetic pulse environments to initiate arming and activate the batteries. SPIN: 3075-3600 RPM. Transmitter Assembly (DWGS 9293021, 9293046) which can be set as required to transmit electromagnetic pulses (MCS) for either Normal or Extended SD.

4.5 Methods of inspection or testing. PRECAUTION: This specification covers sampling and testing of explosive materials which are potentially hazardous to personnel. Accordingly, it is emphasized that all safety rules, regulations and procedures must be followed in handling and processing these materials.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.1 Safety determination and circuit integrity verificaion prior to assembly of mine.

4.5.1.1 Verification of safe condition of S&A assembly. Prior to assembly to the Electronics - MCD assembly, the safe position of the S&A's slider assembly shall be verified. A flush pin gage shall be used to measure safe position of slider assembly. S&A inspection ports shall be used to verify presence and safe position of the other safety components. Observation shall be made for compliance with requirements of 3.3.1. Any S&A failing requirement shall be classed defective and removed from the lot. (Non-destructive test)

4.5.1.2 Electronics - MCD assembly. Prior to assembly of the Electronics - MCD Assembly to the S&A Assembly resistance/continuity and battery voltage checks of each assembly shall be made to assure safe condition of the battery and positive shorting of the firing capacitor also the integrity of electrical circuits listed in DWG 9292225. The MCD circuit shall also be rechecked after the S&A flexible cable is soldered. A ten (10) megohm input impedance voltmeter shall be used to test battery voltage and a milliohmmeter having a test current of one milliamp or less shall be used to perform electrical checks listed in DWG 9292225. Observation shall be made for compliance with requirement of 3.3.2. Any assembly failing any requirement shall be classed defective and removed from the lot. (Non-destructive test)

4.5.1.3 S&A assy flexible cable circuits. Prior to assembly of the S&A to the Electronics-MCD Assy, the shunting feature of the S&A electrical circuits shall be verified. Following soldering of S&A flexible cable to Electronics - MCD Assy, the shunting feature shall be removed and the resistance of the parallel detonators circuit, and of the micropiston actuator circuit shall be checked. Observation shall be made for compliance with requirements of 3.3.3. (Non-Destructive Test)

4.5.2 Density of the main charge and booster. Density of the main charge (9278018) and booster (9277827) shall be performed in accordance with the procedure specified in ASTM Designation D792 - "Specific Gravity and Density of Plastics by Displacement", Method A-1. The contractor may use alternate procedures than that specified herein, subject to the approval of the Government.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.3 Explosive output performance. The main charges or boosters to be tested (See 4.4.3.3) shall be assembled and functioned in accordance with DWG 9277922. The mine assembly shall be functioned under the plates configured in Fig. 1 below following approved safety procedures.

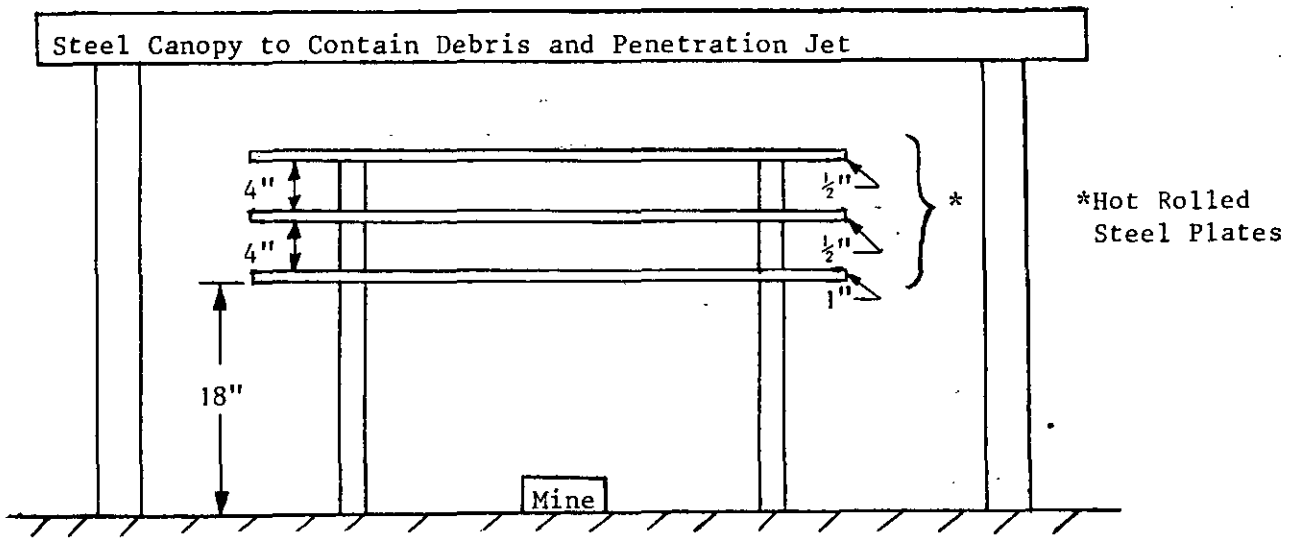


FIGURE 1. Target for HE mine functioning.

4.5.4 Mine functioning. Mine functioning will consist of initiating the mine; final arming of the S&A; and functioning of Hazardous Test or HE mines as follows:

a. Initiating and emplacement of mine. Using the Launch Simulator (4.4.5), the lot acceptance test mine (Hazardous/HE) shall be spun; given the MCS signal then placed in a container or pit containing a microphone and, for mines selected for prime sensor, a target signature simulating coil. This initiation will activate the cell batteries and commit-to-arm the S&A assembly.

b. Final arming. After initiation, emplacement and the elapse of arming time specified in DWG 9292196, the micropiston actuator will be initiated by the Electronics-MCD Assy freeing the spring loaded slider and allowing it to come-in-line.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the current version before use.

c. Mine functioning. After final arming and elapse of maximum sensor enable time plus 5 minutes minimum (See 6.7) the lot acceptance test mines shall be functioned. Hazardous Test Mines (6.6): by Prime Target Sensor, AD and SD modes. Duds shall be dismantled and failure analyzed. Tactical HE Mines shall be functioned by Prime Target Sensor mode only, with Duds destroyed in place.

d. Recording of events. Recording instruments shall be used to determine the test times to events. The starting point for arming time, SD time, etc. shall be the application of the electromagnetic pulse (MCS) to the mine. Time for the micropiston actuator and for the mine to function shall be recorded. All test mines shall be serialized and their location noted to insure that the correct times are recorded for each mine. The up-side, Electronics or Spacer, of the Hazardous or HE Mine, shall be recorded.

4.5.5 Hazardous test mine (See 6.6). In addition to 6.6, Lot Acceptance Testing (4.4.3.5 b) gives a more detail description of the selection and assembly of this mine. The Hazardous Mine will be initiated and armed as per 4.4.5 and 4.5.4 and then be emplaced in a test container or pit for functioning. A steel cover shall be used to contain the spacer cover assembly or electronic lens assy and other metal fragments. All Hazardous Test mines shall be placed on a flat horizontal surface for functioning with ninety (90) percent of the test sample oriented with the spacer cover assy side facing up and the remainder with the electronics side facing up. The up side of the mine shall be recorded. After the time for arming and sensor enable events (See 6.7) have elapsed the mine shall be functioned in either the prime target sensor, self-destruct or anti-disturbance (AD) mode.

4.5.5.1 Prime target sensor (PTS) mode. After final arming and sensor enable (See 4.5.4, 6.7d) a valid target signature shall be applied to the mine.

CAUTION: Hazardous Test Mines contain clearing charges which will propel the spacer and cover assembly or the electronics - MCD assy from the mine at a velocity in excess of one hundred (100) feet per second. Close handling should be avoided unless adequately protected. This caution also applies to handling of those failing to function and declared duds in 4.5.5.1, 4.5.5.2 and 4.5.5.3.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:26Z
Check the source to verify that this is the current version before use.

Observation shall be made for compliance with requirement of 3.6.2.1. If any mine fails to function after the first attempt, the signature simulator circuit adequacy shall be verified (from safety of bunker) and a second attempt shall be made to function the mine by the simulator. Success in the second attempt will be reported as a second attempt success. Failing to function by prime target mode, the mine shall be classed defective and set aside for dismantling and failure analysis. (See 4.5.5.4)

4.5.5.2 Self destruct (SD) mode. - After initial arming the mine shall be placed in a pit for self destruct functioning. If a mine fails to function by the maximum set self destruct time plus 24 hours, a valid target signature shall be applied. Observation shall be made for compliance with requirements of 3.6.2.2 and 3.6.2.1. Failing to function in the two modes, it shall be classed defective and set aside for dismantling and failure analysis. (See 4.5.5.4)

4.5.5.3 Anti-disturbance (AD) mode. After emplacement in a test pit (See 4.5.4 and 4.5.5) the mines containing AD switches shall be slowly tilted 90° with the horizontal followed by a slow tilt of 90°/(180° apart) in the opposite direction. Failing this mode, an attempt shall be made to function it by the prime target sensor signature simulator coil. Observation shall be made for compliance with requirements of 3.6.2.3 and 3.6.2.1. Following failure in AD and PTS, the mine shall be classed defective and set aside for dismantling and failure analysis. (See 4.5.5.4).

4.5.5.4 Dismantling and failure analysis of hazardous test mine duds.

CAUTION: Once the mine has been initiated (See 4.4.5) it could function at any time and thus should never be approached without adequate shield between the mine and the operator.

Hazardous Test Mines which fail to arm or function (LAT fallouts) shall be dismantled and failure analyzed. The two rolled crimps shall be milled off and all components removed from the mine case. The condition or state of the main subassemblies shall be checked or inspected and shall be recorded:

a. S&A assembly: slider assy, explosive leads, MDF cords, flexible cable assy, microdets and micropiston actuator, primary and secondary safety.

b. Electronic - MCD assy: EBP, Battery, shorting bars, MCD assy, fuses.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

Electrical checks	Test Points
Firing Capacitor Voltage	6-9
Battery Voltage	3-9, 8-3
*Fuse condition(Voltage)	10-9
Fuse status (Resistance)	D-C
Status of Electric Battery Primer	

* If battery is not active, external power will be required to test the fuse.

c. Propellant charge assemblies.

Any defects, whether it was the root cause or had no contributary effect on the malfunction, shall be recorded. Results of this failure analysis shall be supplied in accordance with 6.8.

4.5.6 Tactical HE test mines. Following emplacement of mine in a test pit and prior to arming, a target identical to that shown in Fig. 1 shall be positioned over a test mine. The MCS signal shall be for normal SD level. The mines shall be emplaced spacer side up on a flat horizontal surface. The up side of the mine shall be recorded. The HE test mine with and without AD switches shall be functioned by prime target mode only (4.5.4). After the time interval, for arming and enable (6.7) events plus 5 minutes; has elapsed, a valid target signature shall be applied. If any mine fails to function after the first attempt, the signature simulator circuit adequacy shall be checked (from safety of bunker) and if found adequate a second attempt shall be made to function the mine by the simulator. Success in the second attempt will be reported as a second attempt success. Failure in the second attempt will be reported. The mine shall be classed defective and will be destroyed in place. Observation shall be made for compliance with requirements of 3.6.3.1.

4.5.7 Moisture and volatiles content of charge assembly propellant. The contractor shall provide adequate controls to insure compliance with the applicable requirement of DWG 9292175. The moisture and total volatiles content of each lot of propellant shall be determined at the loading station at the time of loading the charge assemblies. This determination shall be made at least once for eight (8) hours of production. Sampling and testing of the propellant shall be in accordance with MIL-STD-286, Method 101.1.2. If the moisture and total volatiles content fails to comply with the requirement specified on the applicable drawing and loading of the charge assemblies has not begun, the propellant lot shall be rejected until corrective action has been taken as verified by repeating the moisture and total volatiles content determination. If loading has begun, charge assemblies loaded with the non-conforming propellant shall be rejected.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5.8 Air pressure test of HE mine. The assembled HE mine prior to painting shall be placed in a chamber and a pre-determined volume of air shall be delivered to produce five (5) + 0.5 pounds per square inch gage pressure (psig) between the outside of the mine and the interior of the chamber. After initial stabilization of the pressure the mine shall withstand the external pressure (5 + 0.5 psig) for fifteen seconds without exhibiting more than the specified drop in pressure. Observation shall be made for compliance with requirement of 3.2.1. Non-destructive test. All test and calibration instructions, equipment and procedures shall be approved in accordance with 4.4.4.

5. PACKAGING

5.1 Preservation and packaging.

5.1.1 Level A. (Fiberboard sleeve) The mines shall be preserved and packaged in accordance with Dwg. 12624515.

5.1.2 Level A. (Plastic sleeve) The mines shall be preserved and packaged in accordance with Dwg. 9243804.

5.2 Packing.

5.2.1 Level A. (Fiberboard sleeve) Packing shall be in accordance with Dwg. 12624514.

5.2.2 Level A. (Plastic sleeve) Packing shall be in accordance with Dwg. 9243805.

5.3 Marking

5.3.1 Level A. Marking shall be in accordance with Dwgs. (9243804 and 9243805) or (12624515 and 12624514) as applicable.

5.4 Unitization.

5.4.1 Level A. Unitization of mines as packed in 5.2.1 or 5.2.2 shall be in accordance with DWG 19-48-4116/95M-20PA1002 (DARCOM Ammo Center).

5.5 Shipping. When mines from more than one lot interfix are shipped at one time, each lot shall be kept separate and the division between lots clearly indicated to prevent mixing of the lots in transit.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

5.6 Packing. Packing of the mines in Fiberboard Ammunition Containers and corresponding Steel Shipping and Storage Container (in accordance with Dwgs. 12624515 and 12624514) is the preferred packaging. Packing in Plastic Ammunition Container: PA-83 and corresponding Steel Container (in accordance with Dwgs. 9243804 and 9243805) is the alternative method.

6. NOTES

6.1 Intended use. The Mine, Antitank: HE, M75 covered by this specification is intended for use as an antitank mine to be dispensed from Dispenser, Mine, Ground Vehicle, M128.

6.2 Ordering data. See MIL-A-48078.

6.3 Submission of inspection equipment designs for approval. (See MIL-A-48078). Submit equipment designs as required to Commander, U S Army Armament Research, Development and Engineering Center, Attn: AMSMC-QAT-I(D), Dover, New Jersey 07801-5001.

6.4 Distribution of ammunition data cards and test data. Distribution of data cards and test data shall include the following: Commander, U S Army Armament Research, Development and Engineering Center, Attn: AMSMC-QAT-M(D), Dover, New Jersey 07801-5001.

6.5 Drawings. Drawings listed in Section 2 of this specification under the heading US Army Armament Research, Development and Engineering Center (ARDEC), may also include drawings prepared by, and identified as Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal, ARRADCOM, or Picatinny Arsenal drawings. Technical data originally prepared by these activities is now under cognizance of ARDEC.

6.6 Munition test items. The munition test items specified herein are described below:

a. Fully Tactical HE items

Mine, Antitank: HE, M75 P/N 9292227-1,-2

b. Hazardous type items

Test Mine, Hazardous P/N 9331518-1,-2

(1) Contains inert booster and inert main charge (simulants).

(2) All clearing charges are present.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

(3) Main charge simulant and mine case have drilled inspection holes.

(4) All explosive elements including MDF cords are present in S&A assy.

(5) Contains an Electronics-MCD assembly.

6.7 Premature arming; premature detonation; early self destruct (SD); enable time; hazardous duds; non-hazardous dud (Dud); high order function: hazardous/HE mines. For purposes of the tests in this specification, the following terms are defined:

a. Premature arming. Is defined as arming of the S&A assy (evidenced by actuation of piston actuator) before the minimum mine arming time specified on DWG 12624467.

b. Premature detonation. Is defined as detonation of mine (S&A armed) occuring before the minimum sensor enable time specified on DWG 12624467.

c. Early self destruct. Is defined as detonation of the mine (S&A armed) occuring at or after the minimum sensor enable time specified on DWG 12624467 but before being functioned by any intended mode.

d. Enable time. Is defined as the maximum sensor enable time specified on DWG 12624467 plus 5 minutes minimum after application of electromagetic pulse (see 4.4.5).

e. Hazardous dud. Is defined as an armed mine capable of being functioned, after the maximum set S&D time has elapsed, by target sensor, anti-disturbance, self-destruction or any other non-destructive stimuli (See 3.6.4).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

f. Non-hazardous dud (Dud). Is defined as a mine incapable of being functioned, after the maximum set SD time has elapsed, by any of the modes listed in 6.7e above (See 3.6.4).

g. High order functioning. Hazardous Test Mine: High order functioning will be evidenced by high order functioning of the MDF clearing charge train and high velocity propelling of the spacer end cover assy or electronics end fragments and high order functioning of the main explosive leads PA-517.

HE Mine: High order functioning will be evidenced by high order detonation of the Main charge train as exhibited by penetration of the M-S plate through a one (1) inch thick and a one-half (1/2) thick hot rolled steel plates and spall on subsequent witness plate (See 3.6.3.1 and 4.5.6). High order functioning of the main charge leads is defined as: At least two main charge leads, PA 517, must function and produce a nominal hole of 1/4 inch at the lead cavity in the applicable S&A Casting.

h. Hazardous/HE mines. See 6.6.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the currentversion before use.

6.8 Data requirements. Deliverable data required by this specification is cited in the following paragraphs:

Paragraph	Date Requirement	Applicable DID
3.7, 4.4.3.4	Plan for control in use of adhesives	* DI-T-5372 (Tailored)
3.8,	Safety Plans	* DI-T-5372 (Tailored)

* Delete a, b, c, d of previous paragraph 1 block 10, DD Form 1664 and substitute contractor designated parameters and limits.

4.4.2.6,4.4.2.7 4.5.5.4	Quality Inspection Defect Reports (Critical and designated majors)	DI-R-1721
4.4.2.1,4.4.2.2 4.4.3.3,4.4.2.10 4.4.2.13	Quality Inspection Test, Demonstration & Evaluation Report	DI-R-1724
6.4	Ammunition Data Card	DI-L-1410

6.9 Change from previous issue. Due to the extensiveness of the changes, asterisks to identify changes with respect to the previous issue are not used in this revision.

6.10 Subject term (key word) listing.
Mine
Anti-personnel
HE, M75
Main charge
Hazardous
Tactical HE
Anti-disturbance
Explosive
Self-destruct

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1345-A406)

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:26Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-M-63305B (AR)	

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

(TO DETACH THIS FORM, CUT ALONG THIS LINE.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.