MILITARY SPECIFICATION

TEST SET, ELECTRONIC SYSTEMS: M92

This specification is approved for use by the U.S. Army Armament Research and Development Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the performance and acceptance inspection requirements for the Test Set, Electronic Systems: M92 associated with the M-130 Aircraft General Purpose Dispenser.

2. APPLICABLE DOCUMENTS

2.1 The following documents of issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-S-45743 - Soldering, Manual Type, High Reliability, Electronic Equipment

MIL-S-46844 - Solder Bath Soldering of Printed Wiring Assemblies, Automatic Machine Type

MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification For

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes

MIL-STD-331 - Fuze and Fuze Components, Environmental and Performance Tests For

FSC: 4925

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

MIL-STD-810 - Environmental Test Methods
MIL-STD-1169 - Packaging, Packing and Marking for Shipment of Inert Ammunition Components

DRAWINGS (see 6.5)

U.S. ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND

PRODUCT AND PACKAGE DRAWINGS

9325901 - Test Set, Electronic Systems: M92
9327670 - Packing and Marking for Box Exterior for Test Set, Electronic Systems: M92

INSPECTION EQUIPMENT DRAWINGS

9272533 - Dispenser Control Panel Assembly
9311431 - Electronics Module Assembly
9311434 - Dispenser Assembly

(Copies of specifications, standards, drawings and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer).

2.2 Other publications. - The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on the date of invitation for bids or request for proposal shall apply.

CODE OF FEDERAL REGULATIONS

Title 49 - Transportation, Parts 100-199

(The Code of Federal Regulations is available from the Superintendent of Documents, U.S. Government Printing Officer, Washington, D.C. 20402. Orders should specify, "49 CFR 100-199 (latest revision)").

3. REQUIREMENTS

3.1 Materials. - Materials shall be in accordance with the applicable drawings and specifications.

3.2 Components and assemblies. - The components and assemblies shall comply with all requirements specified on drawing 9325900 and associated drawings and with all requirements specified in applicable specifications and standards.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

3.3 Performance. - The M92 Test Set shall perform as specified herein. See Functional Test, 4.4.3.1.

3.4 Environmental requirements. - The test methods in the following subparagraphs are contained in MIL-STD-810, except for temperature humidity which is contained in MIL-STD-331.

3.4.1 Transportation vibration. - The M92 Test Set shall perform all functions satisfactorily after being subjected to Method 514.2, Procedure X.

3.4.2 Temperature humidity. - The M92 Test Set shall perform all functions satisfactorily after being subjected to Test 105.1 of MIL-STD-331. (Two fourteen day cycles shall be completed for a total test period of 28 days except -65°F shall be used in lieu of -80°F for storage temperature.)

3.5 Wiring and soldering. - Soldering of electrical wires, cables, connectors, components and assemblies shall be performed in a thorough, workmanlike manner in accordance with MIL-STD-1460, except that para. 4.1.3 does not apply.

3.6 First article inspection. - This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be specified in the contract.

3.7 Workmanship. - All parts and assemblies shall be fabricated and finished in a thorough workmanlike manner, and all manufacturing, processing, and assembly operations shall be correctly performed. They shall be clean and free of burrs, sharp edges, unblended radii, surface defects, chips, dirt, grease and oil (except where specifically required), corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part or assembly nor shall they be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined. Required packing shall be dry.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection and standard quality assurance provisions. - Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.2 Classification of inspection. - The following types of inspection shall be conducted on this item.

a. First Article Inspection
b. Quality Conformance Inspection

4.3 First article inspection

4.3.1 Submission. - The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3. 2 and 4.3.3. The first article sample shall consist of the items in sample quantities as indicated in Table 1.

4.3.2 Inspections to be performed. - See MIL-A-48078 and paras 4.4.2.1 thru 4.4.2.14, testing per para. 4.4.3 and Table I specified herein.

4.3.3 Rejection. - See MIL-A-48078.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TABLE 1 - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-T-63264(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
	Test Set, Electronic Systems: M92		9325901
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Examination for defects	2	100%	3.2	4.4.2.1 thru 4.4.2.10
	Transportation vibration	2	100%	3.4.1	4.4.3.2
	Temperature-Humidity	2	100%	3.4.2	4.4.3.3
	Functioning	2	100%	3.3	4.4.3.1

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection

4.4.1 Inspection lot formation. - Inspection lots shall comply with the lot formation provisions of MIL-A-48078.

4.4.2 Examination. - (See MIL-A-48078). Unless otherwise specified in the classification of defects and test tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9324928
4.4.2.1	Plate, Base				NEXT HIGHER ASSEMBLY 9326211
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Overall length or width incorrect		0.40%	3.2	Gage
102	Any hole location incorrect		0.40%	3.2	Gage
103	Hole size "Z", 2 places, incorrect		0.40%	3.2	Gage
Minor					
201	Protective finish in holes		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.2	Spring				9326072
					NEXT HIGHER ASSEMBLY 9326211
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Coil diameter incorrect		0.65%	3.2	Gage
202	Minimum free length incorrect		0.65%	3.2	Gage
203	Maximum solid height incorrect		0.65%	3.2	Gage
204	Spring rate incorrect		0.65%	3.2	Gage
205	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9326048
4.4.2.3	Rod, Push				NEXT HIGHER ASSEMBLY 9326211
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Overall length incorrect		0.40%	3.2	Gage
102	Slot length incorrect		0.40%	3.2	Gage
103	Hole location incorrect		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9326211
4.4.2.4	Dispenser Test Adapter Assembly				NEXT HIGHER ASSEMBLY 9325901
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any part missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Circuit resistance greater than 0.15 ohms		0.40%	3.2	MIL-STD-202, Method 303
103	Insulation resistance less than 20 megohms		0.40%	3.2	MIL-STD-202, Method 302 Test Condition A
Minor					
201	Lacing missing or inadequate		0.65%	3.2	Visual
202	Push rod does not operate smoothly		0.65%	3.2	Manual
203	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9324925
4.4.2.5	Relay Plate Assembly				NEXT HIGHER ASSEMBLY 9326202
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any part missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Soldering missing or improper		0.40%	3.5	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9325975
4.4.2.6	Interconnecting Board				NEXT HIGHER ASSEMBLY 9326202
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing, damaged, incorrect or improperly assembled		0.40%	3.2	Visual
102	Soldering missing or improper		0.40%	3.5	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAF-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9326202
4.4.2.7	Test Set Electronic Assembly				NEXT HIGHER ASSEMBLY 9325901
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any component missing damaged or improperly assembled		0.40%	3.2	Visual
102	Soldering missing or incorrect		0.40%	3.5	Visual
103	Heat shrinkable sleeving missing		0.40%	3.2	Visual
Minor					
201	Identification plate missing, illegible or improperly annotated		0.65%	3.2	Visual
202	Cable lacing missing or inadequate		0.65%	3.2	Visual
203	S4 or S11 switches not aligned properly with panel marking in all positions		0.65%	3.2	Visual/Manual
204	Insulation compound missing or improperly applied		0.65%	3.2	Visual
205	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9326713
4.4.2.8	Electronic Flash Assembly				NEXT HIGHER ASSEMBLY 9326117
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Soldering improper		0.40%	3.2	Visual
102	Insulation sleeving missing from splice or connector pins		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-T-63264(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.9	Flare Simulator Assembly		9326117
			NEXT HIGHER ASSEMBLY 9325901

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any part missing, damaged or improperly assembly		0.40%	3.2	Visual
Minor					
201	Identification plate missing, illegible or improperly annotated		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9325991
4.4.2.10	Test Cable No. 1				NEXT HIGHER ASSEMBLY 9325901
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE / INSPECTION METHOD
Critical	None defined				
Major					
101	Cable length incorrect		0.40%	3.2	Gage
102	Connectors incorrect or damaged		0.40%	3.2	Visual
103	Circuit resistance greater than 0.3 ohms		0.40%	3.2	MIL-STD-202, Method 303
104	Insulation resistance less than 20 megohms		0.40%	3.2	MIL-STD-202, Method 302, Test Condition A
Minor					
201	Marking missing, improper or illegible		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9325992
4.4.2.11	Test Cable No. 2				NEXT HIGHER ASSEMBLY 9325901
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cable length incorrect		0.40%	3.2	Gage
102	Connectors incorrect or damaged		0.40%	3.2	Visual
103	Circuit resistance greater than 0.3 ohms		0.40%	3.2	MIL-STD-202, Method 303
104	Insulation resistance less than 20 megohms		0.40%	3.2	MIL-STD-202, Method 302, Test Condition A
Minor					
201	Marking missing, improper or illegible		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9325993
4.4.2.12	Test Cable No. 3				NEXT HIGHER ASSEMBLY 9325901
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cable length incorrect		0.40%	3.2	Gage
102	Connectors incorrect or damaged		0.40%	3.2	Visual
103	Circuit resistance greater than 0.3 ohms		0.40%	3.2	MIL-STD-202, Method 303
104	Insulation resistance less than 20 megohms		0.40%	3.2	MIL-STD-202, Method 302, Test Condition A
Minor					
201	Marking missing, improper or illegible		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.13	Power Cable No. 1				9325989
					NEXT HIGHER ASSEMBLY 9325901
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cable length incorrect		0.40%	3.2	Gage
102	Connectors incorrect or damaged		0.40%	3.2	Visual
103	Circuit resistance greater than 0.3 ohms		0.40%	3.2	MIL-STD-202, Method 303
104	Insulation resistance less than 20 megohms		0.40%	3.2	MIL-STD-202, Method 302, Test Condition A
Minor					
201	Marking missing, improper or illegible		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.14	Power Cable No. 2				9325990
					NEXT HIGHER ASSEMBLY 9325901
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cable length incorrect		0.40%	3.2	Gage
102	Connectors incorrect or damaged		0.40%	3.2	Visual
103	Circuit resistance greater then 0.3 ohms		0.40%	3.2	MIL-STD-202, Method 303
104	Insulation resistance less than 20 megohms		0.40%	3.2	MIL-STD-202, Method 302. Test Condition A
Minor					
201	Marking missing, improper or illegible		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.15	Case, Carrying				9326021
					NEXT HIGHER ASSEMBLY
					9325901
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Case dented or damaged		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.16	Test Set, Electronic Systems: M92				9325901
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE / INSPECTION METHOD
Critical	None defined				
Major					
101	Any part missing, damaged or improperly assembled		0.40%	3.2	Visual
102	Function test		100%	3.3	4.4.3.1
Minor					
201	Identification plate missing, illegible or improperly annotated		0.65%	3.2	Visual
202	Decal missing or improperly located		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET OF		DRAWING NUMBER
4.4.2.17	Packing Box (prior to sealing)				9327670
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Packing missing or inadequate (contents loose)		0.40%	5.2	Visual/Manual
102	Carton or filler damp or wet		0.40%	5.2	Visual/Manual
103	Integrity of barrier bag destroyed by puncture or heat seal separation		0.40%	5.2	Visual
Minor					
201	Heat seal of barrier bag located so that subsequent seals cannot be applied		0.65%	5.2	Visual
202	Marking on barrier bag missing, incorrect or illegible		0.65%	5.3	Visual
203	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS - MIL-T-63264(AR)

PARAGRAPH	TITLE		SHEET OF		DRAWING NUMBER
4.4.2.18	Packing and Marking for Box Exterior for Test Set, Electronics Systems: M92				9327670
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Box damaged to the extent that contents are exposed or liable to become exposed		0.40%	5.2	Visual
102	Box improperly sealed		0.40%	5.2	Visual
Minor					
201	Marking on box missing, incorrect or illegible		0.65%	5.3	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.4.3 Testing.

4.4.3.1 Functioning. - Major Defect - Each M92 Test Set shall be subjected to this test. The test shall be performed as specified in 4.5.1 using equipment in accordance with 4.4.4. If any unit fails to comply with the applicable requirements, it shall be classified defective and removed from the lot.

4.4.3.2 Transportation vibration. - Major Defect - Each M92 Test Set submitted for first article testing shall be subjected to this test. The test shall be performed as specified in 4.5.3 using equipment in accordance with 4.4.4. If any unit fails to comply with the applicable requirements, the first article sample shall be rejected.

4.4.3.3 Temperature and humidity. - Major Defect - Each M92 Test Set submitted for first article testing shall be subjected to this test. The test shall be performed as specified in 4.5.4 using equipment in accordance with 4.4.4. If any unit fails to comply with the applicable requirements, the first article sample shall be rejected.

4.4.3.4 Improper soldering. - Major Defect - Each M92 Test Set shall be inspected for improper soldering in accordance with MIL-S-45743 or MIL-S-46844 as applicable. If any wiring or printed circuit card assembly fails to comply with the requirements, the unit shall be classified defective and removed from the lot.

4.4.4 Inspection equipment. - The inspection equipment required to perform the inspections and tests prescribed in this specification is identified in the "Paragraph Reference/ Inspection Method" column in the tables starting with paragraph 4.4.2.1, and the test method paragraphs (see 4.5). The contractor shall submit for approval, inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and Section 6.3 herein.

TABLE 2

Functional Test Equipment (See 4.4.4)

Dispenser Assembly	GFE	9311434
Electronics Module	GFE	9311431
Dispenser Control Panel	GFE	9272533
28 VDC Power Supply	Contractor	Commercial
Ohmmeter	Contractor	Commercial
Oscilloscope	Contractor	Commercial
Test Set Tester	Contract	See Figure 10

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 1

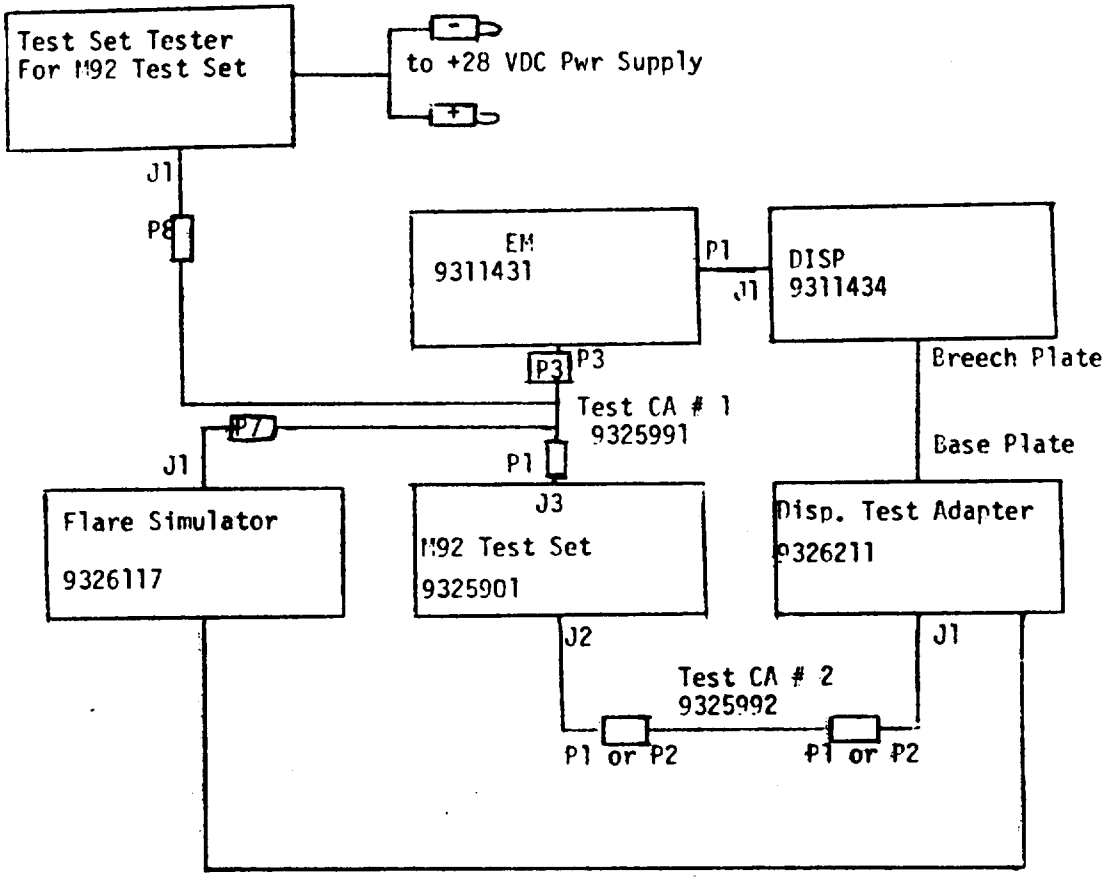


FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 2

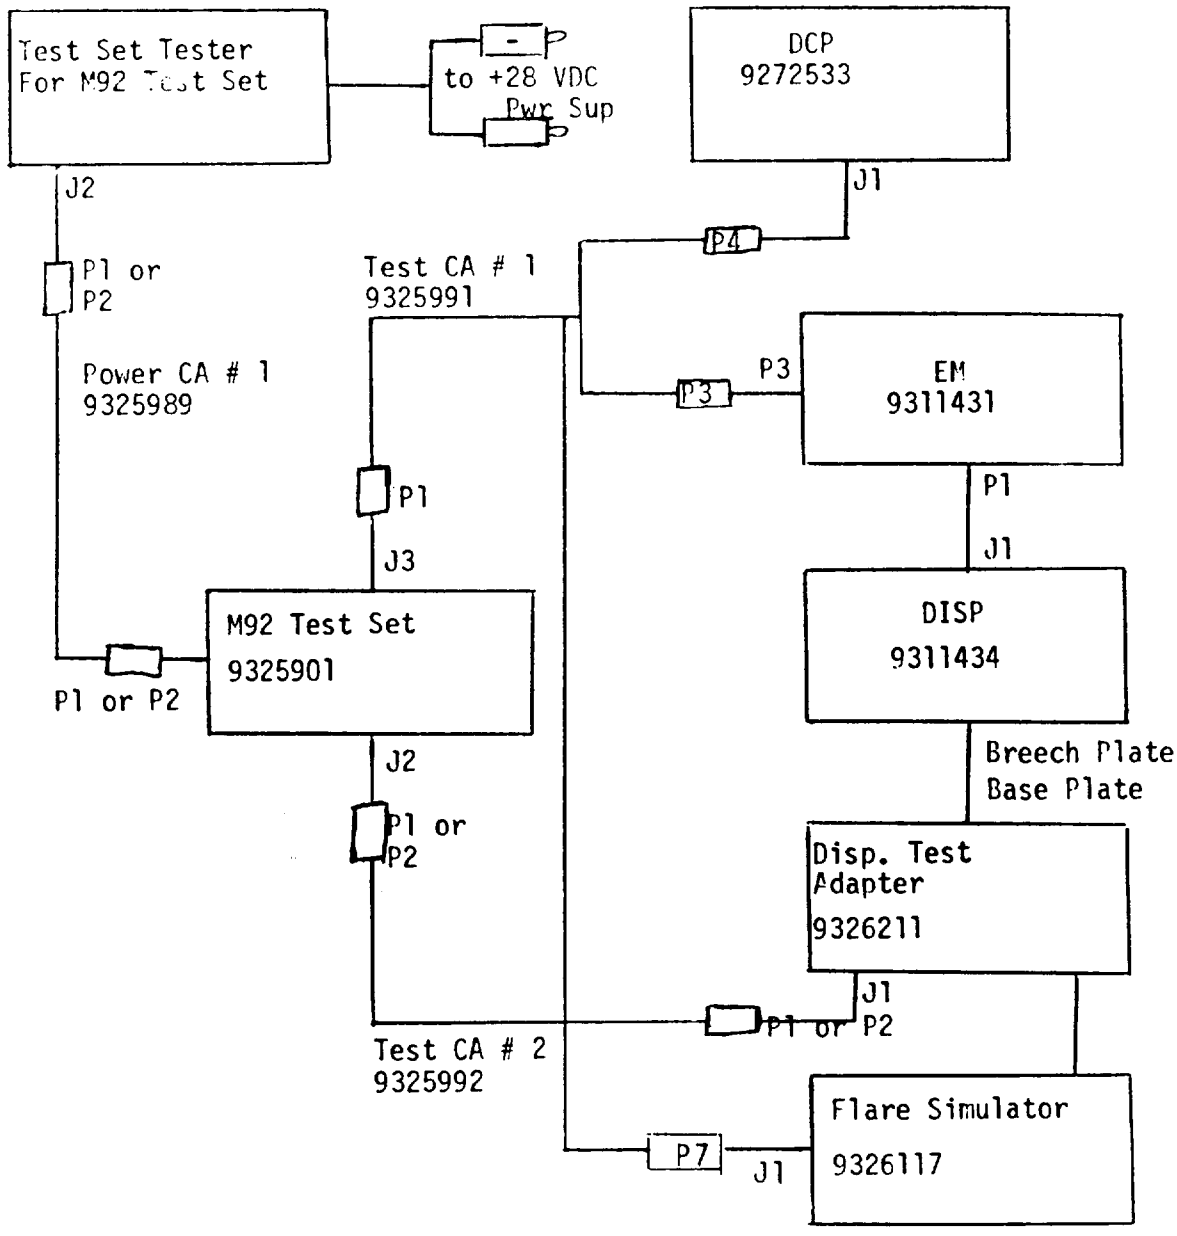


FIGURE 2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 3

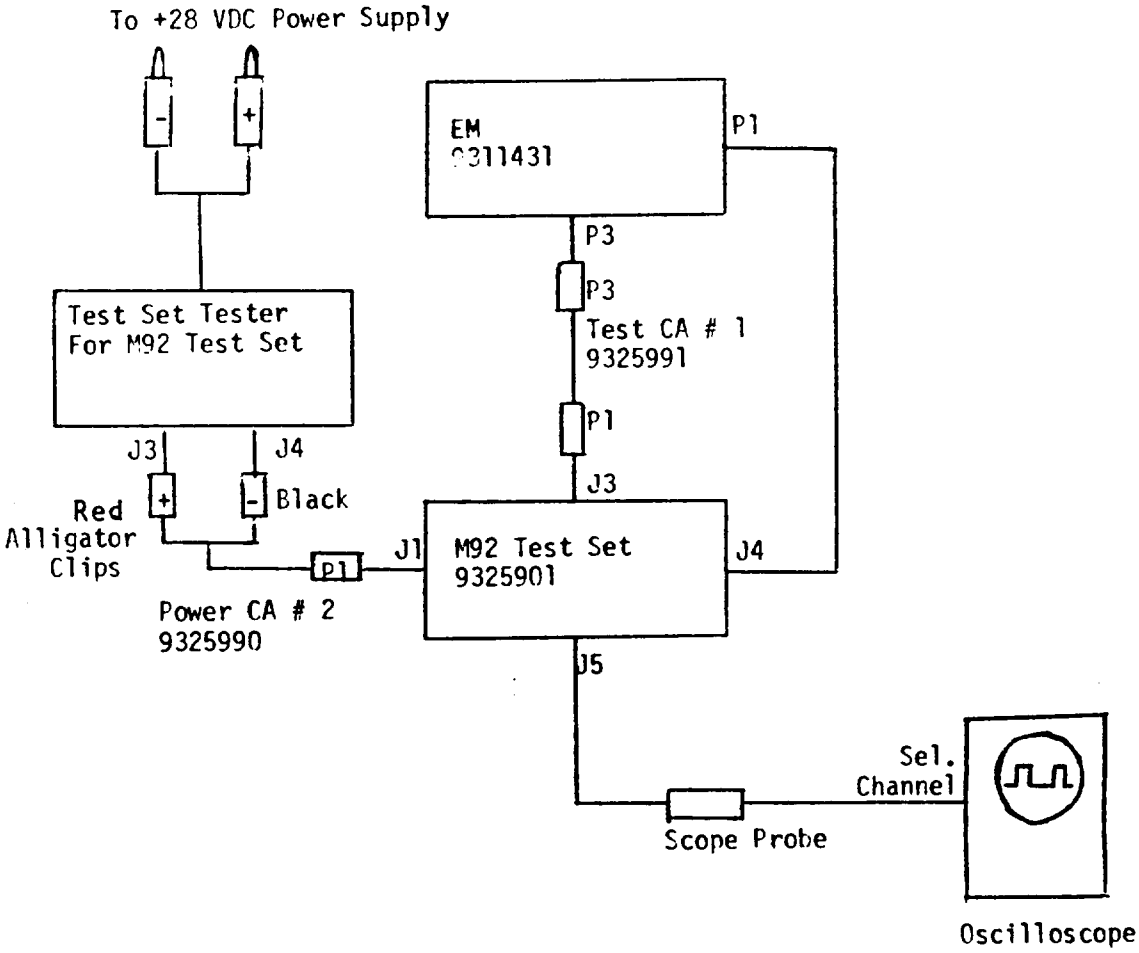


FIGURE 3

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 4

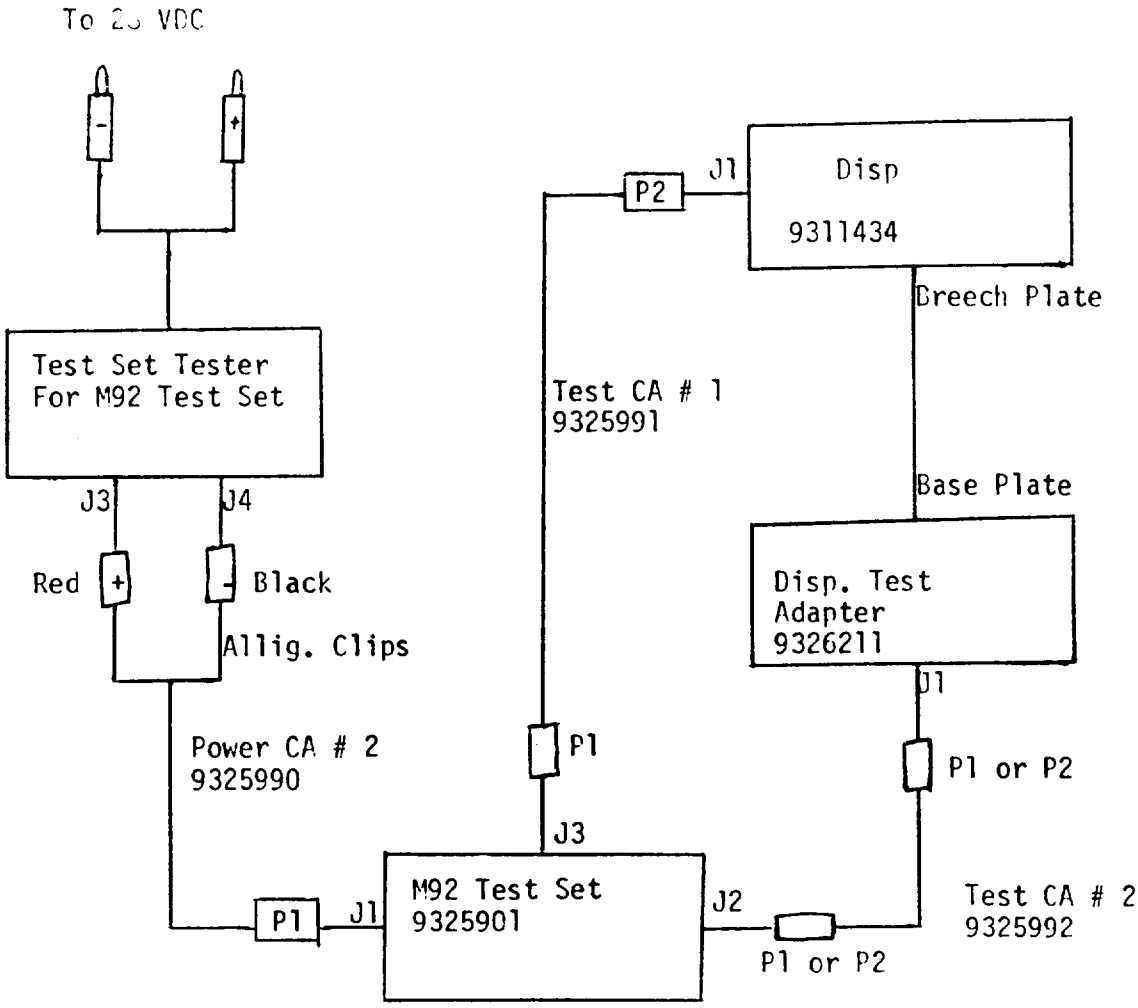


FIGURE 4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 5

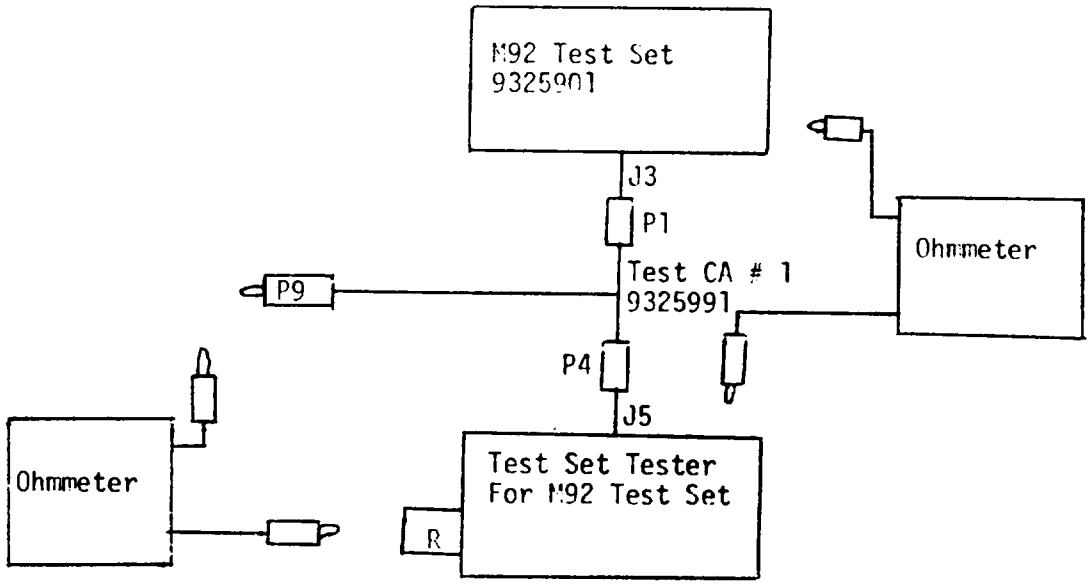


FIGURE 5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

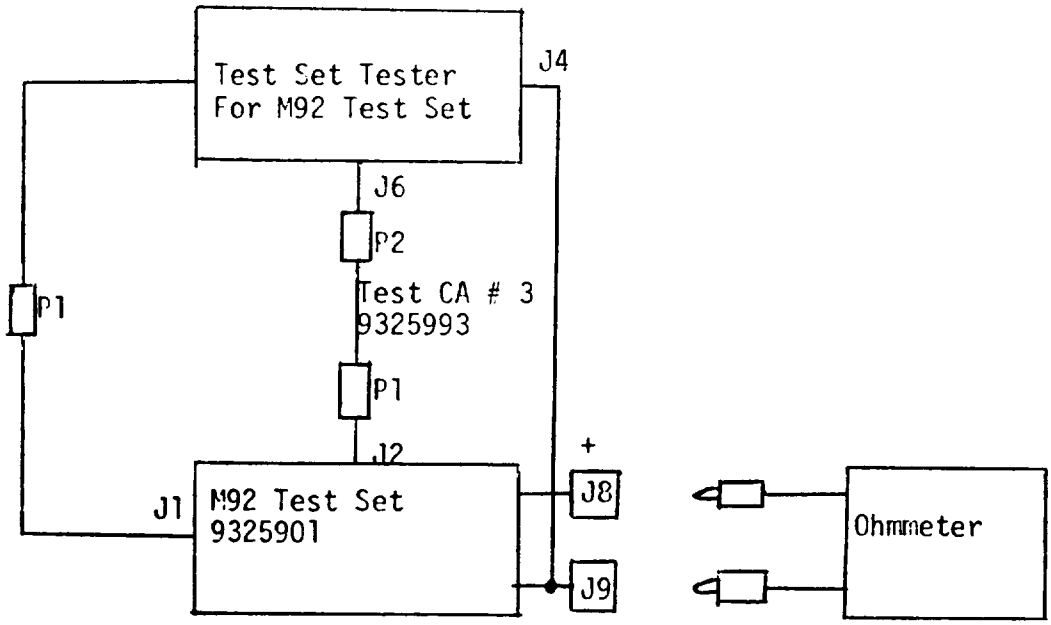


FIGURE 6

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 7

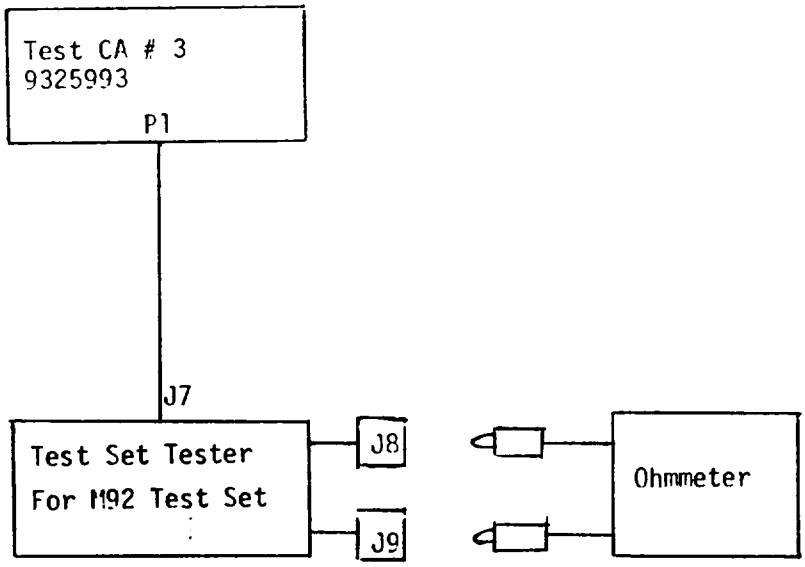


FIGURE 7

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 8

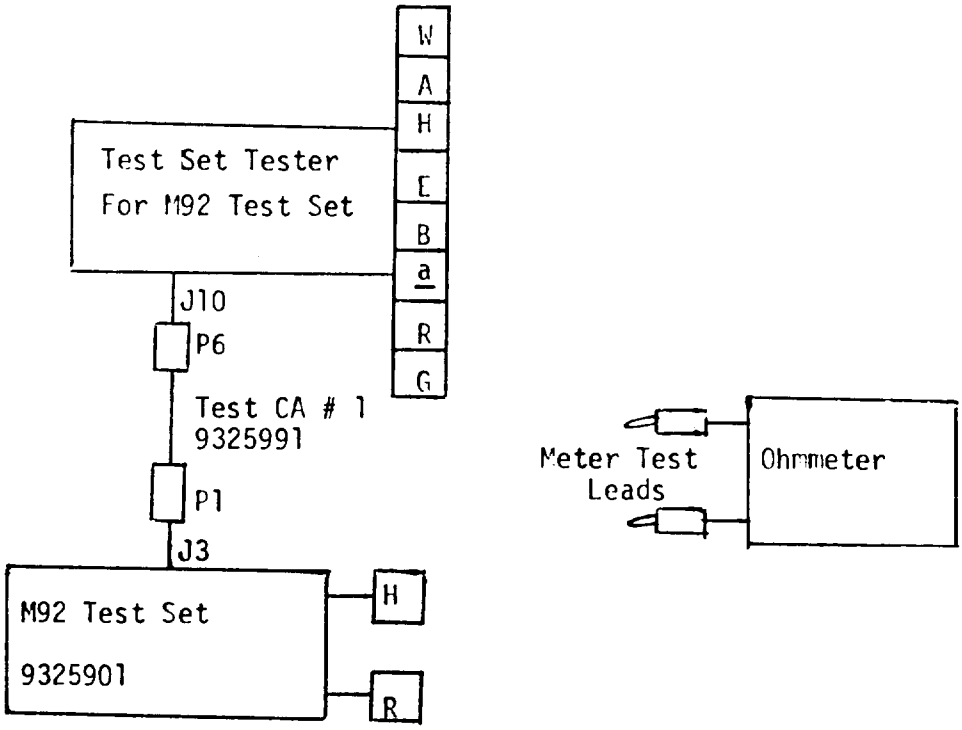


FIGURE 8

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 9


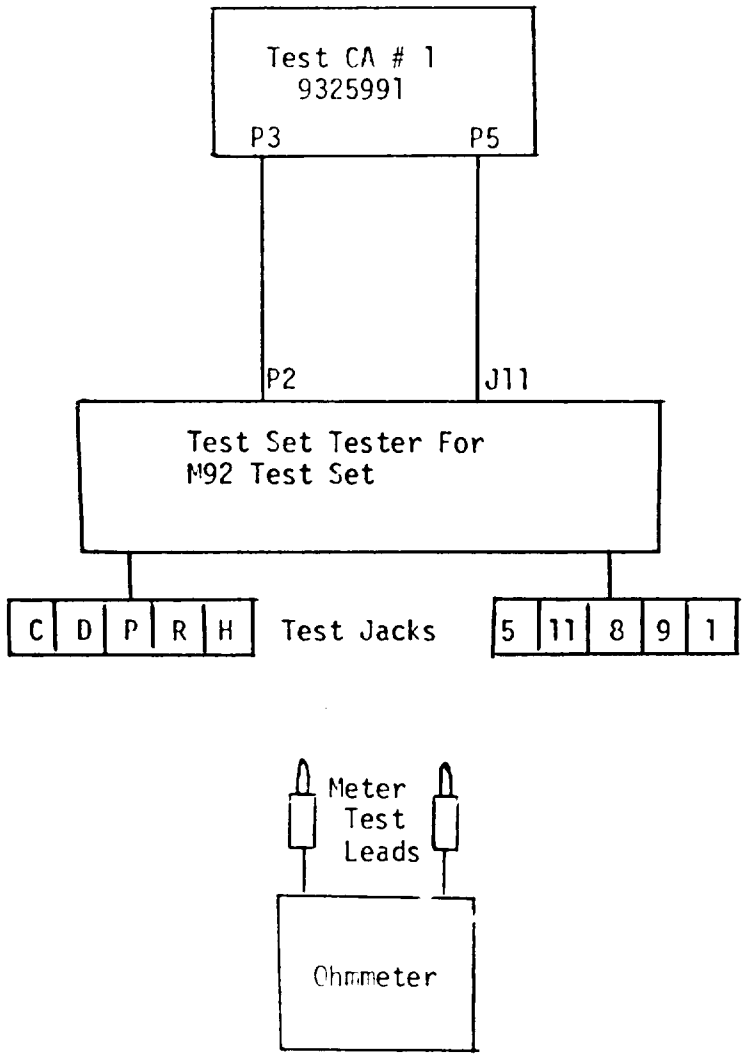


FIGURE 9

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

M92 Test Set Tester Schematic

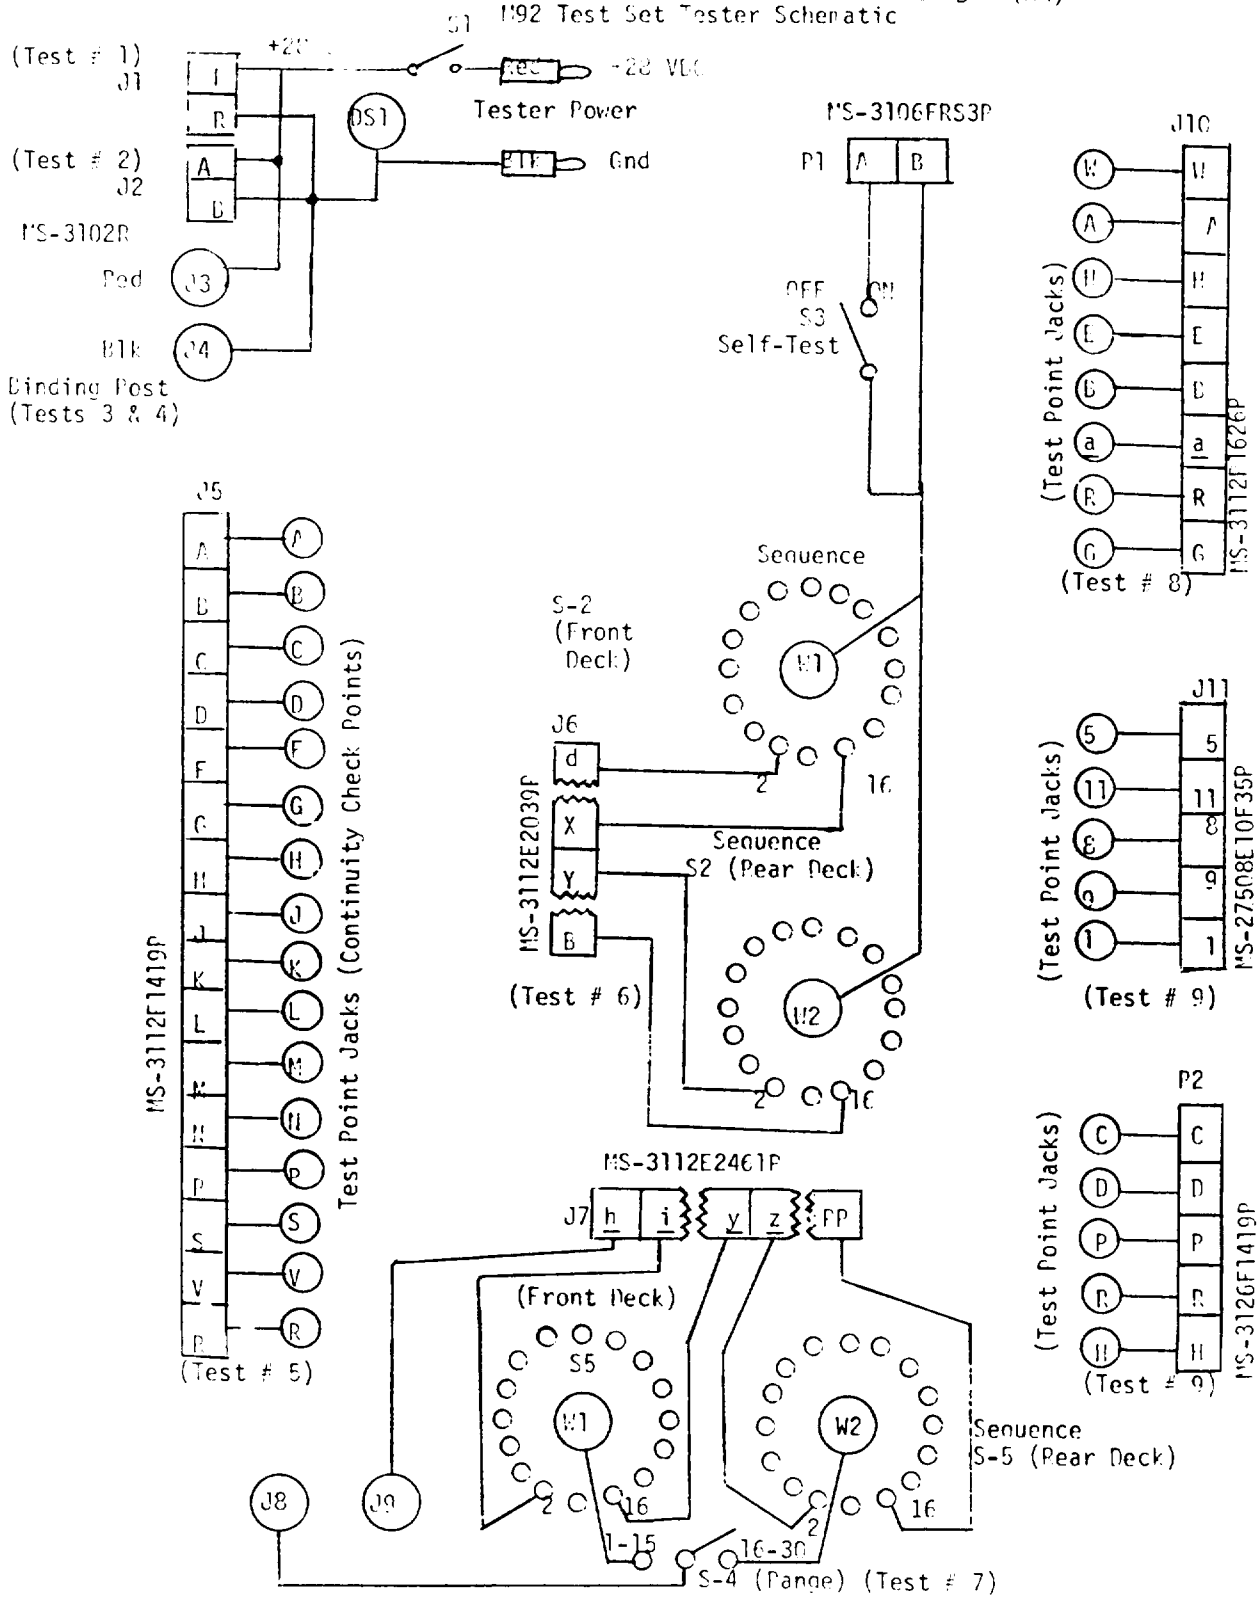

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

4.5 Test methods and procedures

4.5.1 Functioning. - Utilizing the test equipment in accordance with Table 2 the M92 Test Set shall be installed in a suitable test set up (See Figures 1 thru 9) and subjected to the following procedure:

FUNCTIONAL TESTS

M92 TEST SET

PRESETTING REQUIREMENT

1. On the M92 Test Set, set "Power On" switch (S1) to "On" position; set "Unit Power" switch (S14) to "On" position; set "Mode Select" switch (S4) to "Flare Man" position.

2. On the Dispenser Assembly, set "C-F" switch to "F" position.

OPERATION PROCEDURE

TEST # 1 (Connect/Test Set-up per Figure 1, Test # 1);

1. On the M92 Test Set Tester, set "Tester Power" switch (S1) to the "On" position. On the Control Panel of the M92 Test Set: "Power On" lamp (DS31) should light; "Firing Orders" indicators #1 through 30 should be RED. If not, depress "Firing Orders Reset" switch (S2). On the Flare Simulator Assembly of M92 Test Set, Lamp (amber) should light. If not, on the M92 Test Set, depress "Flare Simulator Reset" switch (S15).

2. On the M92 Test Set, depress "Dispense" switch (S3), Firing Order Indicator # 1 should turn to White at the same instant the Flare Simulator Assembly light flashes.

3. On the control panel of the M92 Test Set, depress "Depense" switch (S3) ten (10) times in succession. Firing Orders indicators will change to white in groups of three (3) except the last group will be two (2) (firing order #29 & 30).

4. On the control panel of the M92 Test Set, depress the "Flare Simulator Reset" Switch (S15). A few seconds later, the Flare Simulator Assembly lamp (amber) should light.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

5. On the Dispenser Test Adapter", press & release the "Manual System Reset" button the sound of the selector switch resetting should be heard.

6. Reset the following switches:

a. On the M92 Test Set Tester, place the "Tester Power" switch (S1) in the "Off" position.

b. On the Control Panel of the M92 Test Set, Place the "Power On" switch (S1) to the "Off" position and the "Unit Power" switch (S14) to "Off" position.

TEST # 2 (Connect/Test Set-Up per Figure 2, Test # 2):

1. On the Dispenser Assembly assure the "C-F" switch is in the "F" position.

2. On the DCP, set each "Flare & Chaff" counter to read "30" and set "Safe-Arm" switch, to "Arm" position.

3. On the M92 Test Set Tester, set "Tester Power" switch (S1) to the "On" position. On the M92 Test Set: Set the "Power On" lamp (DS31) should light; "Firing Orders" indicators 1 thru 30 should be RED (If not, depress the "Firing Orders Reset" switch (S2). On the Flare Simulator Assembly of M92 Test Set, lamp (amber) should light (if not, on M92 Test Set, depress "Flare Simulator Reset" switch (S15)). On DCP, ARM lamp should light.

4. On the M92 Test Set, depress "Dispense" switch (Flare-S6). Firing Order Indicator # 1 should turn to "White" at the same instant the Flare Simulator Assembly light flashes.

5. On the M92 Test Set, depress: Dispense" switch (Flare-S6) Two (2) times in sequence. Firing Orders change to WHITE in groups of three (3) . . . . at the end of firing, indicators # 1 thru # 7 should be White and on DCP, Flare counter should read "23".

6. On the DCP, set the "Ripple Fire" switch guard and switch to the "Up" position, the Flare counter will decrease from "23" to "00". On the Control Panel of M92 Test Set, Firing Order Indicators #8 thru #30 should change to White.

7. On the Dispenser Assembly, set "C-F" switch to "C" position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

8. On the "Dispenser Test Adapter", press & release the "Manual System Reset" button. (The sound of the selector switch resetting should be heard).

9. On the Control Panel of M92 Test Set, depress the "Firing Orders Reset" switch (S2). Firing Order Indicators # 1 thru # 30 should change from White to Red.

10. On the DCP, set "Man-Prgm" switch to "Man" position.

11. On the Electronics Module, set the Chaff Program switches as follows:

SALVO: Count on 8 and Interval on 1

BURST: Count on 3 and Interval on .1

12. On the M92 Test Set, press and release the "Dispense" switch (CHAFF-S7) six (6) times. Firing Order Indicators # 1 thru # 6 will change to White. On the DCP, the CHAFF counter will decrease 6 counts. (At the end of 6 presses, the counter will read "24")

13. On the DCP, set the "Man-Prgm" switch to the "Prgm" position.

14. On the M92 Test Set, press and release the "Dispense" switch (CHAFF-S7) once. Firing Orders Indicators # 7 thru # 30 should change to White in accordance with the program set at the EM. On the DCP, the CHAFF counter will decrease by the program as set at the EM (At the end of the firing sequence, the counter will read "00").

15. On the "Dispenser Test Adapter" press & release the "Manual System Reset" button. The sound of the selector switch resetting will be heard.

16. Reset the following switches:

a. On the M92 Test Set Tester, set the "Tester Power" switch (S1) to the "Off" position.

b. On the M92 Test Set, set the "Power On" switch (S1) to the "Off" position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 3 (Connect/Test Set-Up per Figure 3, Test # 3)

1. On the M92 Test Set Tester, set the "Tester Power" switch (S1) to "On". On the M92 Test Set, set the "Power On" switch to "On". The "Power On" lamp (DS31) should light.

2. On the M92 Test Set:

Set the "Mode Select" switch (S4) to the "Flare-Man" position; set the "C/F Select" switch (S10) to the "Flare" position; set the "Unit Power" switch (S14) to the "On" position.

3. On the M92 Test Set, press & release the "Dispense" switch (S3). The oscilloscope should display three (3) square waves.

4. On the M92 Test Set, set the "Mode Select" switch (S4) to the "Flare-Ripple" position.

5. On the M92 Test Set, press & hold the "Dispense" switch (S3), the oscilloscope will display a series of square waves.

6. On the M92 Test Set:

Set the "Mode Select" switch (S4) to the "Chaff-Man" position; set the "C/F Select" switch (S10) to the "Chaff" position.

7. On the M92 Test Set, press & release the "Dispense" switch (S3). The oscilloscope will display (one) square-wave.

8. On the M92 Test Set, set the "Mode Select" switch (S4) to "Chaff-Prgm" position.

9. On the M92 Test Set, press & release the "Dispense" switch (S3), the oscilloscope will display a series (SALVO increment) of square waves.

10. Reset the following switches:

a. On the M92 Test Set Tester, turn on "Tester Power" switch (S1) to the "Off" position.

b. On the M92 Test Set, turn the "Power On" switch (S1) to the "Off" position and the "Unit Power" switch (S14) to the "Off" position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST # 4 (Connect/Test Set-Up per Figure 4, Test # 4)

1. On the Dispenser Assembly, set the "C-F" switch to the "F" position.

2. On the M92 Test Set Tester, set the "Tester Power" switch (S1) to the "On" position. On the M92 Test Set: Set the "Power On" switch to the "On" position. The "Power On" lamp (DS31) should light. "Firing Orders" indicators # 1 thru 30 should be Red (If not depress the "Firing Orders Reset" switch (S2)).

3. On the M92 Test Set, press & release the "Dispense" switch (Flare-S8) thirty (30) times; the corresponding Firing Order indicators will change to White. Press & release the thirty-first (31) time; the "Flare-Cascade" lamp (green-DS32) should light.

4. On the "Dispenser Test Adapter" press & release the "Manual System Reset" button. The sound of the selector switch resetting will be heard.

5. On the Dispenser Assembly, set the "C-F" select switch to the "C" position.

6. On the M92 Test Set, press & release the "Firing Orders Reset" switch (S2). All "Firing Order" indicators # 1 thru # 30 will change to Red.

7. On the M92 Test Set, press & release the "Dispense" switch (Chaff-S9) thirty (30) times. The corresponding Firing Order inidcators should change to White. Press & release the thirty-first (31) time. The "Chaff-Cascade" lamp (green - DS33) should light.

8. On the "Dispenser Test Adapter" press & release the "Manual System Reset" button. The sound of the selector switch resetting will be heard.

9. Reset the following switches:

a. On the M92 Test Set Tester, set the "Tester Power" switch (S1) to the "Off" position.

b. On the M92 Test Set, set the "Power On" switch (S1) to the "Off" position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

TEST #5 (Connect/Test Set-Up per Figure 5, Test # 5)

(CAUTION: When using an ohmmeter for continuity checks, NO external power shall be applied to the Test Set Tester.)

1. A continuity check (using an ohmmeter) shall be observed (not more then 0.5 ohm) between the corresponding test points of "M92 Test Set Tester, Test # 5 and the M92 Test Set, DCP TEST". A continuity check shall be observed between the M92 Test Set Tester, Test # 5, Test point G and the M92 Test Set, DCP TEST, test point F. Then on the M92 Test Set Press and hold S5 switch and read 14 ± 3 ohms with meter connected from test point "G" on Test Set Tester and "R" on the M92 Test Set.

2. A continuity check shall be observed between "Test Cable # 1, P9" and "Test Point - R, Test # 5, Test Set Tester".

TEST # 6 (Connect/Test Set-Up per Figure 6, Test # 6)

1. On M92 Test Set Tester, Test # 6: Set the SEQUENCE switch (S2) to the "Off" position; set the "Self Test" switch (S3) to the "On" position.

2. On the M92 Test Set: Set the "RANGE" switch (S13) to the "1 to 15" position and the "SEQUENCE" switch (S11) to the "Off" position. Press the "Stray Voltage Self Test" switch (S12); ohmmeter reads 14 ± 3 ohms set the "RANGE" switch (S13) to the "16 to 30" position and then, press the "Stray Voltage Self Test" switch (S12); ohmmeter reads 14 ± 3 ohms.

3. On the M92 Test Set Tester, Test # 6, reset the "Self Test" switch (S3) to the "Off" position.

4. On the M92 Test Set Tester, Test # 6, "SEQUENCE" switch (S2) and the M92 Test Set, "RANGE" switch (S13) and the "SEQUENCE" switch (S11): Rotate thru each of the 30 corresponding positions of both the tester and the test set and observe a continuity (.2 to .6 ohms) at each position.

TEST # 7 (Connect/Test Set-Up per Figure 7, Test # 7)

A continuity check shall be observed (not more than 0.5 ohm) for the following rest positions:

1. On the M92 Test Set Tester, Test # 7, set the "RANGE" switch (S4) to the "1 to 15" position and rotate the "SEQUENCE" switch (S5) to each position. A continuity should be observed at each position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

2. On the M92 Test Set Tester, Test # 7, set the "RANGE" switch (S4) to the "16 - 20" position and rotate the "SEQUENCE" switch (S5) to each position. A continuity should be observed at each position.

TEST # 8 (Connect/Test Set-Up per Figure 8, Test # 8)

A continuity check shall be observed (not more than 0.5 ohm) for the following test positions:

M92 Test Set DCP Test points H & R	M92 Test Set Tester Test # 8 Test points
Test point "H"	Test points "W" & "A"
Test point "R"	Test point "H"
Test point "H" w/S10 on "CHAFF" S4 on "MAN CHAFF" & Press S3	Test point "B"
Test point "H" w/S4 on "PGRM CHAFF" & press S3	Test point "a"
Test point "H" w/S4 on "MAN FLARE" & press S3	Test point "R"
Test point "H" w/S4 on "RIPPLE FLARE" & press S3	Test point "G"

TEST # 9 (Connect/Test Set-Up per Figure 9, Test # 9)

A continuity check shall be observed (not more then 0.5 ohm) for the following test positions:

Test points; "C to 5", "D to 11", "P to 8", "R to 9", "H to 1" of the M92 Test Set Tester, Test # 9 test points".

4.5.2 Aircraft vibration. - Using equipment in accordance with 4.4.4, subject each first article unit to the vibration requirements of MIL-STD-810C, Method 514.2, Procedure IIc to

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

verify conformance to 3.4.1. Following this test examine each M92 Test Set for evidence of damage and submit each item to the procedure of 4.5.1. Any item which fails to comply to the applicable requiremetns shall be rejected.

4.5.3 Transportation vibration. - Using equipment in accordance with 4.4.4. subject each first article unit to the vibration requirements of MIL-STD-810C, Method 514.2, Procedure X to verify conformance to 3.4.2. Following this test, inspect each M92 Test Set for evidence of damage and submit each item the procedure of 4.5.1. Any item which fails to comply to the applicable requirements shall be rejected.

4.5.4 Temperature and humidity. - Using equipment in accordance with 4.4.4, subject each first article unit to test 105 of MIL-STD-331 to verify conformance to 3.4.3. Following this 28 day test, lower the chamber temperature to 130°F minimum and allow to stabilize for a minimum of 4 hours. Subject each M92 Test Set to the functioning test, 4.4.3.1, at 130°F. If the test cannot be conducted in the chamber, the test shall be completed within 30 minutes maximum after removal from the chamber. Following this test, place the units in a chamber at -40°F for a minimum of 4 hours and repeat the functioning test. Any item which fails to meet applicable requirements shall cause the first article sample to be rejected.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging

5.2 Packing. - Packing shall be in accordance with 9327670.

5.3 Marking. - Marking shall be in accordance with 9327670.

6. NOTES

6.1 Intended use. - This item is used to test the Aircraft General Purpose Dispenser, M-130.

6.2 Ordering data. - Procurement documents shall specify the following:

a. Title, number and date of this specification.
b. Provisions for submission of first article samples.
c. Provisions of MIL-A-48078.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

6.3 Submission of inspection equipment designs for approval.- (See MIL-A-48078). Submit equipment designs as required, to Commander: U.S. Army Armament Research and Development Command, ATTN: DRDAR-QAA-I, Dover, New Jersey 07801.

6.4 Distribution of ammunition data cards. - Distribution of data cards shall include the following: Commander, U.S. Army Armament Research and Development Command, ATTN: DRDAR-QAA-Q.

6.5 Drawings. - Drawings listed in Section 2 of this specification under the heading US Army Armament Research and Development Command (ARRADCOM) may also include drawings prepared by, and identified as, Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal or Picatinny Arsenal drawings. Technical data originally prepared by these activities if now under the cognizance of ARRADCOM.

Custodian:
Army-AR

Preparing Activity:
Army-AR

Project Number: 4925-A-032

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS. This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.

NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-T-63264 TEST SET, ELECTRONIC SYSTEMS: M92

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1 OCT 76 1426

EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID



OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

Commander
US Army Armament R&D Command
ATTN: DRDAR-QAA
Dover, New Jersey 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:26Z
Check the source to verify that this is the current version before use.