MILITARY SPECIFICATION

TEST SET, D.C. POWER SUPPLY, MARK 366 MOD 1

This specification has been approved by the
Bureau of Naval Weapons, Department of the Navy.

1. SCOPE

1.1 Scope. - This specification covers one type of special purpose test set designed for use in the testing and maintenance of the d.c. control circuits of the Mk 45 Torpedo. This unit performs the following functions:

A. Monitors 28 volt d.c. torpedo control power.
B. Monitors 28 volt d.c. auxiliary power.
C. Provides fixed nominal 245 volt d.c. output at 2 amperes.
D. Provides d.c. output variable from 145 to 265 volts, at 200 milliamperes.

2. APPLICABLE DOCUMENTS

2.1 The following specifications, standards, drawings, and publications, or such portion thereof as may be designated herein, of the issue in effect on the date of invitation for bids, form a part of this specification.

SPECIFICATIONS

FEDERAL

PPP-B-575	Box; Paper-Overlaid Veneer (Strap-Around Type)
PPP-B-585	Boxes; Wood, Wirebound
PPP-B-591	Boxes; Fiberboard, Wood-Cleated
PPP-B-601	Boxes; Wood, Cleated-Plywood
PPP-B-621	Boxes; Wood, Nailed and Lock-Corner
PPP-B-636	Boxes; Fiber
PPP-B-640	Boxes; Folding, Fiberboard, Corrugated, Triple Wall.
PPP-B-645	Boxes; Folding, Fiberboard, Heavy Duty

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T15:30Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-P-116	Preservation, Methods of
MIL-B-10377	Box; Wood, Cleated, Veneer, Paper Overlaid
MIL-E-17555	Electronic and Electrical Equipment and Associated Repair Parts, Preparation for Delivery of.
MIL-E-22403	Environmental Requirements and Tests (For Torpedo Mark 45 Mod 0 Components and Assemblies)

STANDARDS

MILITARY

MIL-STD-129	Marking for Shipment and Storage

DRAWINGS

NAVY DEPARTMENT

BUORD LD-542952, Test Set, D.C. Power, Mark 366 Mod 1

PUBLICATIONS

BUREAU OF NAVAL WEAPONS

NAVORD OD 12301	Insulation Resistance and High Potential Measurements and Procedures

(Copies of specifications, standards, drawings, and publications requested by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.2 Other publications. - The following documents form a part of this specification. Unless otherwise indicated, the issue in effect on the date of invitation for bids shall apply.

NATIONAL BUREAU OF STANDARDS PUBLICATIONS

Handbook H28 and all supplements thereto	Screw thread standards for the Federal Services.

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the currentversion before use.

(Application for copies should be addressed to the Superintendent of Documents, Government Printing Office, Washington 25, D. C.)

3. REQUIREMENTS

3.1 General requirements

3.1.1 Pre-production samples. - Unless otherwise specified in the contract or order, pre-production samples of the test set shall be manufactured by the methods and procedures proposed for the production lot. These samples shall be tested as specified in section 4 herein and are for the purpose of determining that the production items meet the requirements of this specification and the design. See 4.1.2.

3.1.2 Materials. - Unless otherwise specified in the contract, requisition, or order, all materials and purchased parts entering into the final assembly of the test set shall conform to the detailed requirements given on the drawings and specifications listed in BUORD LD-542952.

3.1.3 Finishes, coatings, construction, and dimensions. - Finishes, coatings, construction, and dimensions for the test set shall be in accordance with the applicable drawings, specifications, and publications listed in BUORD LD-542952.

3.1.4 Moisture, fungus, and corrosion. - The test set shall be rendered moisture, fungus, and corrosion resistant in accordance with detail requirements specified on drawings and specifications in BUORD LD-542952.

3.1.5 Marking. - Marking of assemblies, sub-assemblies, and parts shall be in accor lance with the applicable drawings listed in BUORD LD-542952.

3.1.6 Interchangeability. - Component parts of the assembled units (unless otherwise specified on the applicable drawings) fabricated in accordance with applicable drawings shall be interchangeable and shall assemble with mating components of the unit without selection or fitting. If, during assembly of the fabricated parts of a unit, selection or fitting is required, then changes in dimensions are necessary, and revision and correction of the applicable drawings is required. See 3.1.9.

3.1.7 Gages. - The contractor shall provide himself with whatever gages are necessary and adequate to ensure that the material to which this specification applies will meet the dimensional requirements shown on the applicable drawings. If so stipulated in the contract, order or requisition, the Government will furnish drawings of pertinent Navy Final Inspection Gages for guidance in the design of the contractor's inspection gages. However, such procedure shall not relieve the contractor of his responsibility in the

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the currentversion before use.

design and manufacture of such gages as may be required for the satisfactory fulfillment of the contract requirements, but is intended to facilitate acceptance of all components and assemblies by Navy Final Inspection Gages.

3.1.8 Threads. - Unless otherwise specified, all threads shall be in accordance with the National Bureau of Standards Handbook H28 and all Supplements thereto. The class or fit for threads shall be as specified on the applicable drawings, and the NOT-GO gaging practice shall be as set forth in the Supplement to the aforementioned Handbook H28.

3.1.9 Conflicting requirements. - Conflicting requirement arising between this specification and any specification, publication, or drawing listed herein shall be referred in writing to the procuring agency or appointed agent for interpretation, clarification, and resolution (or correction).

3.2 Definitions. - Definitions applicable to the environmental requirements of this specification are set forth in Specification MIL-E-22403.

3.3 Performance requirements and product characteristics. - The test set shall meet the following performance requirements and product characteristics:

3.3.1 All pin, plug, and component numbers referred to herein are given on BUORD Dwg. 2412267.

3.3.2 Input voltages. - The test set shall operate with the following input voltages. 120 volts a.c. plus or minus 10 percent, 60 cycles per second (c.p.s.) plus or minus 5 percent; and 28 volts d.c. plus or minus 10 percent.

3.3.3 Circuit continuities. - Circuit continuities shall be as specified in Table I of this specification, when tested as specified in 4.4.4.2.

3.3.4 28 volt input meter. - When the 28 volt d.c. input switch is in the ON position, the 28 volt input meter shall be capable of measuring input voltages between pins A and B of J16, pin B being positive polarity, over a range of 25 to 31 volts d.c., with maximum error of 3 percent of full scale, when tested as in 4.4.4.3.3 and 4.4.4.3.4.

3.3.4.1 28 volt input indicator. - With the test set powered as in 3.3.4, the 28 volt input indicator shall be lit, when tested as in 4.4.4.3.

3.3.4.2 28 volt torpedo output circuit breaker. - With the test set powered as in 3.3.4 and with a 6.0 plus or minus 0.5 ohm load connected between pins C and K of J14, the 28 volt torpedo circuit breaker shall trip within 40 seconds maximum after it is placed in its ON position, when tested as in 4.4.4.5.1.

Source: https://assist.dla.mil -- Downloaded: 202640-19T15:30Z
Check the source to verify that this is the current version before use.

3.3.4.2.1 With the test set powered as in 3.3.4 and with a 0.6 plus or minus 0.2 ohm load connected between pins E and K of J14, the 28 volt torpedo circuit breaker shall trip with 40 seconds maximum after being placed in its ON position, when tested as in 4.4.4.5.1.2.

3.3.4.2.2 With the test set powered as in 3.3.4 and with a 11.0 plus or minus 0.7 ohm load connected between pins C and K of J14, the 28 volt torpedo circuit breaker shall not trip after it is placed in its ON position, when tested as in 4.4.4.5.3.1.

3.3.4.2.3 With the test set powered as in 3.3.4 and with a 1.5 plus or minus 0.2 ohm load connected between pins E and K of J14, the 28 volt torpedo circuit breaker shall not trip after it is placed in its ON position, when tested as in 4.4.4.5.3.1.

3.3.4.3 28 volt torpedo output indicator. - With the test set powered as in 3.3.4, the 28 volt torpedo output indicator shall light when the 28 volt torpedo output circuit breaker is in its ON position, when tested as in 4.4.4.3.1.

3.3.4.4 28 volt auxiliary output circuit breaker. - With the test set powered as in 3.3.4 and with a 6 plus or minus 0.5 ohm load connected between pins A and B of J12, the 28 volt auxiliary circuit breaker shall trip within 3 seconds maximum after being placed in its ON position, when tested as in 4.4.4.5.2.

3.3.4.4.1 With the test set powered as in 3.3.4 and with a 11.0 plus or minus 0.7 ohm load connected between pins A and B of J12, the 28 volt auxiliary circuit breaker shall not trip after it is placed in its ON position, when tested as in 4.4.4.5.3.2.

3.3.4.5 28 volt auxiliary output indicator. - With the test set powered as in 3.3.4, the 28 volt auxiliary output indicator shall light when the 28 volt auxiliary output circuit breaker is in its ON position, when tested as in 4.4.4.3.2.

3.3.5 Output to torpedo meter. - When the 28 volt d.c. input switch and the 28 volt torpedo output circuit breaker are in the ON position, the output to the torpedo ammeter shall be capable of measuring current flow between pins B of J16 and C and E of J14, pin B being positive polarity, over a range of 2 to 28 amperes d.c., with a maximum error of 2 percent of full scale value, when tested as in 4.4.4.4.1, 4.4.4.4.2, and 4.4.4.4.3.

3.3.6 110 volt a.c. input indicator. - The 110 volt a.c. input indicator shall light when the 110 volt a.c. input circuit breaker is in its ON position and a 60 cycle a.c. potential of 120 volts plus or minus 10 percent is applied between pins A and B of J15, when tested as in 4.4.4.6.

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the currentversion before use.

3.3.6.1 110 volt a.c. input circuit breaker. With the test set powered as in 3.3.6 and with a 6.7 plus or minus 0.5 ohm load connected between pin A of J15 and TP1, the 110 volt a.c. input circuit breaker shall trip within 65 seconds maximum after it is placed in its ON position, when tested as in 4.4.4.8.1.

3.3.6.1.1 With the test set powered as in 3.3.6 and with a 6.7 plus or minus 0.5 ohm load connected between pin B of J15 and TP2, the 110 volt a.c. input circuit breaker shall trip within 65 seconds maximum after being placed in its ON position, when tested as in 4.4.4.8.2.

3.3.6.1.2 With the test set powered as in 3.3.6 and with a 12.0 plus or minus 1.0 ohm load connected between pin A of J15 and TP1, the 110 volt a.c. input circuit breaker shall not trip after it is placed in its ON position, when tested as in 4.4.4.8.5.1.

3.3.6.1.3 With the test set powered as in 3.3.6 and with a 12.0 plus or minus 1.0 ohm load connected between pin B of J15 and TP2, the 110 volt a.c. input circuit breaker shall not trip after it is placed in its ON position, when tested as in 4.4.4.8.5.2.

3.3.6.2 260 volt d.c. output. - With the test set powered as in 3.3.6 and the 260 volt d.c. output circuit breaker in its ON position, the potential between pins A and B of J11, pin B being positive polarity, shall be 300 volts d.c. plus or minus 60, with a maximum ripple content of 10 percent when a .2 ampere load is connected between pins A and B of J11 and 400 volts maximum at no load. Test as in 4.4.4.6.3, 4.4.4.6.4, and 4.4.4.6.4.1.

3.3.6.2.1 260 volt d.c. output indicator. - With the test set powered as in 3.3.6, the 260 volt d.c. output indicator shall light when the 260 volt d.c. output circuit breaker is in its ON position, when tested as in 4.4.4.6.1.

3.3.6.2.2 260 volt d.c. output circuit breaker. - With the test set powered as in 3.3.6, and with a 38 plus or minus 2 ohm load connected between pins A and B of J11, the 260 volt d.c. output circuit breaker shall trip within 50 seconds maximum after being placed in its ON position, when tested as in 4.4.4.8.3.

3.3.6.2.3 With the test set powered as in 3.3.6 and with a 82.0 plus or minus 5.0 ohm load connected between pins A and B of J11, the 260 volt d.c. output circuit breaker shall not trip after it is placed in its ON position, when tested as in 4.4.4.8.5.3.

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the current version before use.

3.3.6.3 Variable output. - With the test set powered as in 3.3.6, and with the J13 output circuit breaker in its ON position, the potential between pins A and B of J13, pin B being polarity, shall be variable between 140 and 270 volts d.c., with a maximum ripple content of 2 percent, when a 25 ma. load is connected between pins A and B of J13. Test as in 4.4.4.7.2 and 4.4.4.7.4.

3.3.6.3.1 Variable output indicator. - With the test set powered as in 3.3.6, the variable output indicator shall light when the J13 output circuit breaker is in its ON position, when tested as in 4.4.4.6.2.

3.3.6.3.2 J13 output circuit breaker. - With the test set powered as in 3.3.6, with the INCREASE knob in its extreme CW position, and with a 760 plus or minus 40 ohm load connected between pins A and B of J13, the J13 output circuit breaker shall trip within 50 seconds maximum after being placed in its ON position, when tested as in 4.4.4.8.4.

3.3.6.3.2.1 With the test set powered as in 3.3.6, with the INCREASE knob in its extreme CCW position, and with a 600 plus or minus 40 ohm load connected between pins A and B of J13, the J13 output circuit breaker shall not trip after it is placed in its ON position, when tested as in 4.4.4.8.5.4.

3.3.6.3.3 Variable output meters. - The variable output voltmeters shall be capable of measuring output voltages between pins A and B of J13 over the following ranges and with the following accuracies: 0 to 400 volts d.c., with an accuracy of 4 percent; 220 to 270 volts d.c., with mid-scale accuracy of 1 percent. Test as in 4.4.4.7.5 and 4.4.4.7.5.1.

3.3.7 High potential. - The insulation between the insulated circuits and the test set panel shall be capable of withstanding a test potential of 1000 volts d.c. plus or minus 10 percent, when tested according to OD-12301 and 4.4.4.9.

3.4 Environmental requirements. - The test set shall meet the other applicable requirements of this specification during or after tests defined or specified in 4.5.

3.4.1 Vibration, operating condition. - The test set shall withstand vibration through a total amplitude of 0.030 inch in the frequency range of 0 to 15 cycles per second (c.p.s) for a period of one hour, shall function during and after vibration tests, and thereafter shall show no damage and shall meet all the performance requirements and product characteristics of this specification. See 4.5.1.

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the currentversion before use.

TABLE I
CIRCUIT CONTINUITIES

From	To	Maximum Resistance in Ohms
A - J16	B - J12	0.1
	K - J14	0.1
	L - J14	0.1
	M - J14	0.1
	N - J14	0.1
	P - J14	0.1
	R - J14	0.1
B - J16	A - J12	*(a) 0.1
	B - J13	*(b) 0.1
	TP5	*(b) 0.1
	C - J14	*(c) 0.1
	D - J14	*(c) 0.1
	E - J14	*(c) 0.1
	F - J14	*(c) 0.1
	H - J14	*(c) 0.1
	J - J14	*(c) 0.1
A - J11	TP4	0.1
B - J11	TP3	0.1
A - J13	TP6	0.1
A - J15	TP2	*(d) 0.1
B - J15	TP1	*(d) 0.1

*(a) - Resistance measured with circuit breaker CB3 and switch S1 ON. With CB3 or S1 OFF, the resistance shall be greater than 10 x 10^6 ohms.

*(b) - Resistance measured with circuit breaker CB5 and switch S1 ON. With CB5 or S1 OFF, the resistance shall be greater than 10 x 10^6 ohms.

*(c) - Resistance measured with circuit breaker CB2 and switch S1 ON. With CB2 or S1 OFF, the resistance shall be greater than 10 x 10^6 ohms.

*(d) - Resistance measured with circuit breaker CB1 ON. With CB1 OFF, the resistance shall be greater than 10 x 10^6 ohms.

3.4.2 Vibration, shipping condition. - The test set, packed and packaged in accordance with section 5, shall withstand a peak vibration accelerations of 3 gravitational units (g's) at frequencies of from 10 to 100 c.p.s. for a period of an hour and thereafter shall show no damage and shall meet all the performance requirements and product characteristics of this specification. See 4.5.2.

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the current version before use.

3.4.3 Shock, shipping condition. - The test set, packed and packaged in accordance with section 5, shall withstand three 60 g., 8 ms. shock pulses parallel to each of the principal axes, and thereafter shall show no damage and shall meet all the performance requirements and product characteristics of this specification. See 4.5.3.

3.4.4 Temperature, operating. - The test set shall withstand temperatures from plus 32 to plus 125 degrees F., shall function during and after temperature tests, and thereafter shall show no corrosion or damage and shall meet all the performance requirements and product characteristics of this specification, except for circuit breaker trip time. See 4.5.4.

3.4.5 Temperature, storage. - The test set shall withstand temperatures from minus 65 to plus 160 degrees F., and thereafter shall show no corrosion or damage and shall meet all the performance requirements and product characteristics of this specification. See 4.5.5.

3.4.6 Humidity. - The test set shall withstand humidities up to 95 percent, shall function during and after humidity tests, and thereafter shall show no corrosion or damage and shall meet all the performance requirements and product characteristics of this specification. See 4.5.6.

3.4.7 Fungus. - The test set shall withstand the fungus conditions specified in MIL-E-22403, and thereafter shall show no fungus growth, corrosion, or other damage, and shall meet all the performance requirements and product characteristics of this specification. See 4.5.7.

3.5 Clean-up. - Prior to and after final assembly, all parts, components, and the assembly shall be thoroughly cleaned of loose, spattered, or excess solder, metal chips, and other foreign matter. Burrs and sharp edges, as well as rosin flash, shall be removed.

3.6 Workmanship. - The equipment, including all parts and accessories, shall be constructed and finished in a manner to assure compliance with all requirements of this specification. Particular attention shall be paid to neatness and thoroughness of soldering, wiring, impregnation of coils, marking of parts and assemblies, painting, machine screw assemblies, welding, brazing, and freedom of parts from burrs and sharp edges.

4. QUALITY ASSURANCE PROVISIONS

4.1 Government inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified, the supplier may utilize his own facilities or any commercial laboratory acceptable to the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the currentversion before use.

4.1.1 Sampling. - Unless otherwise specified by the contract or purchase order, and when applicable, the sampling plans and procedures used by the Government inspector in the determination of the acceptability of products submitted by a supplier for Government inspection shall be in accordance with 4.1.2 and 4.1.4.

4.1.2 Pre-production sample. - Unless otherwise specified for each contract or order, a representative sample of one test set shall be manufactured by the methods and procedures proposed for the production lot. This unit shall be submitted to the Government inspector for pre-production tests at an activity designated in the contract or by the Bureau of Naval Weapons for purposes of determining compliance with the requirements of the contract, specifications, and drawings. Further production of the item by the contractor prior to approval of the contracting activity or the completion of tests on the pre-production samples shall be at the contractor's risk. Pre-production samples accepted will be applied as part of the quantity specified by the contract or order, since, by definition of the term, "accepted" units will be operational and have suffered no damage or corrosion. Such units will be suitable tagged or identified as "test units".

4.1.3 Lot size. - As applied to Government inspection of units of product, the term "lot" shall mean "inspection lot"; i.e., a collection of units of product submitted by a supplier for Government inspection. Unless otherwise determined by the Government inspector, each shipment of units of product shall be a separate "inspection lot" and may differ from the quantity specified in the total order or contract. Where a shipment consists of less than 60 units, the Government inspector may select and combine several shipments into one "inspection lot". In any event, all units of a single "inspection lot" shall be made to the same design, with the same material and manufacturing techniques, and shall be part of one continuous production run.

4.1.4 Periodic production samples. - The Government inspector shall randomly select one test set from each lot. Unless otherwise specified in the contract or purchase order, this unit shall be submitted to a Bureau of Naval Weapons assigned activity to determine compliance of the sample with the requirements of the contract, specifications, and drawings. The test set shall be considered satisfactory if it meets all specifications and pertinent drawing requirements and withstands the tests specified in 4.4 and 4.5. Periodic production samples accepted will be applied as part of the quantity specified by the contract or order, but shall not be used for testing Torpedo Mark 45.

4.2 Classification of tests. - The inspection and testing of the test set shall be classified as follows:

Source: https://assist.dla.mil -- Downloaded: 202640-19T15:30Z
Check the source to verify that this is the currentversion before use.

4.2.1 Acceptance tests. - These tests are to be accomplished on each test set submitted for acceptance under contract. Acceptance tests shall either be performed by the manufacturer and witnessed by the Government inspector, or they may be conducted by the Government inspector. These tests are detailed in 4.4.

4.2.2 Pre-production and periodic production tests. - Pre-production and periodic production tests shall be accomplished on samples selected as specified in 4.1.2 and 4.1.4 which are representative of the production of the test set after the award of the contract, to determine that the production meets the requirements of this specification. These tests are detailed in 4.4 and 4.5. Acceptance shall be based on no defects in the samples. Failure of the samples to comply with these requirements will result in the rejection of the lot or the cessation of production, as determined by the procuring activity.

4.2.3 Tests after delivery. - Unless otherwise specified in the contract, the Government reserves the right to conduct any or all of the tests specified herein, as deemed necessary, after delivery of the test sets to Fleet activity. Any defects discovered during or after these tests due to the contractor's failure to comply with drawings or specifications for this equipment shall be corrected by the contractor at no expense to the Government, provided the contractor is notified of such defects within the guarantee period of the contract.

4.3 Test equipment. - The following items of test equipment are required to perform the acceptance tests set forth in this specification:

4.3.1 Ohmmeter. - Ohmmeter capable of indicating resistances of 0-1 and $0-(10)^8$ ohms, with a mid-range accuracy of 5 percent and a sensitivity of 20,000 ohms per volt.

4.3.2 Power supply. - Power supply variable from 20 to 35 volts d.c., 2 amperes, with a maximum ripple content of 5 percent.

4.3.3 Voltmeter. - Voltmeter capable of indicating voltages of 0 - 50 and 0 - 500 volts d.c., with an accuracy of 1/2 percent, and a minimum impedance of 1000 ohms per volt.

4.3.4 Power supply. - 28 volts d.c., 50 amperes, with minimum regulation of 90 percent and a maximum ripple content of 5 percent.

4.3.5 Ammeter. - Ammeter capable of indicating d.c. currents of 0 - 50 ma., 0 - 5 amperes, and 0 - 50 amperes, with an accuracy of 1/2 percent and a maximum voltage drop across the meter of 50 millivolts.

Source: https://assist.dla.mil -- Downloaded: 202640-19T15:30Z
Check the source to verify that this is the currentversion before use.

4.3.6 Resistance. - Resistance variable from 1 to 200 ohms, and capable of dissipating 1500 watts.

4.3.7 Resistance. - Resistance variable from 3 to 50 ohms, and capable of dissipating 500 watts.

4.3.8 Resistance. - Resistance of 6.0 plus or minus 0.5 ohms, and capable of dissipating 200 watts.

4.3.9 Resistance. - Resistance of 0.6 plus or minus 0.2 ohms, and capable of dissipating 2000 watts.

4.3.10 Resistance. - Resistance of 11.0 plus or minus 0.7 ohms and capable of dissipating 200 watts.

4.3.11 Resistance. - Resistance of 1.5 plus or minus 0.2 ohms and capable of dissipating 2000 watts.

4.3.12 Switch. - Switch, single-pole, single-throw, with a contact rating of 30 amperes.

4.3.13 Switch. - Switch, single-pole, single-throw, with a contact rating of 5 amperes.

4.3.14 Timer. - Timer capable of indicating time intervals of 200 seconds with an accuracy of 1 percent.

4.3.15 Power supply. - Power supply variable from 30 to 140 volts a.c., r.m.s., 60 cycles, with a minimum output of 15 amperes.

4.3.16 Voltmeter. - Voltmeter capable of indicating voltages of 0 to 200 volts a.c., r.m.s., at a frequency of 60 c.p.s., and an accuracy of 1 percent.

4.3.17 Oscilloscope. - Tektronix 532, or equivalent.

4.3.18 Resistance. - Resistance variable from 0 to 20,000 ohms, and capable of dissipating 12.5 watts.

4.3.19 Switch. - Switch, single-pole, double-throw, with a contact rating of 20 amperes.

4.3.20 Resistance. - Resistance of 6.7 plus or minus 0.5 ohms, and capable of dissipating 2000 watts.

4.3.21 Power supply. - Power supply, 120 volts a.c., 60 c.p.s., 20 amperes, with a minimum regulation of 90 percent.

Source: https://assist.dla.mil -- Downloaded: 202640-19T15:30Z
Check the source to verify that this is the currentversion before use.

4.3.22 Resistance. - Resistance of 38 plus or minus 2 ohms, and capable of dissipating 400 watts.

4.3.23 Resistance. - Resistance of 760 plus or minus 40 ohms, and capable of dissipating 100 watts.

4.3.24 High potential tester. - High potential tester of 1000 volts d.c. plus or minus 10 percent, 2 ma. maximum, non-destructive.

4.3.25 Resistance. - Resistance of 12 plus or minus 1 ohms, and capable of dissipating 2,500 watts.

4.3.26 Resistance. - Resistance of 82 plus or minus 5 ohms, and capable of dissipating 2,000 watts.

4.3.27 Resistance of 600 plus or minus 40 ohms, and capable of dissipating 100 watts.

4.4 Acceptance tests.

4.4.1 The contractor shall conduct acceptance tests as specified in 4.2.1 to assure that the test set is in compliance with the requirements of 3.1, 3.3, 3.5, and 3.6.

4.4.2 Test conditions. - Unless otherwise specified, the test set shall be subjected to acceptance tests under the following conditions:

4.4.2.1 Temperature: Room ambient 80 degrees Fahrenheit (F.) plus or minus 15 degrees F.

4.4.2.2 Altitude: Normal ground atmospheric pressure.

4.4.2.3 Vibration: None.

4.4.2.4 Humidity: From ambient to 95 percent relative maximum.

4.4.3 Test and inspection equipment and facilities. - The manufacturer shall furnish and maintain all necessary test equipment, facilities, and personnel for performing all acceptance tests. The test equipment shall be adequate in quantity and, unless definite requirements are specified, shall be of sufficient accuracy and quality to permit performance of the required acceptance tests.

4.4.4 Test procedure.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T15:30Z
Check the source to verify that this is the current version before use.

4.4.4.1 All component, pin, and plug numbers referred to herein are given on BUORD Dwg. 2412267.

4.4.4.2 Circuit continuities. - Using ohmmeter in 4.3.1, measure and verify the circuit continuities specified in 3.3.3.

4.4.4.3 28 volt input indicator. - Connect the test set as shown in Figure 1-a. Set the output voltage of power supply (4.3.2) at 25 plus 0.2 minus 0 volts d.c., using voltmeter 4.3.3. Place the 28 volt d.c. input switch in the ON position and verify that the 28 volt input indicator lights, as specified in 3.3.4.1.

4.4.4.3.1 28 volt torpedo output indicator. - Place the 28 volt torpedo output circuit breaker in its ON position and verify that the 28 volt torpedo output indicator lights, as specified in 3.3.4.3.

4.4.4.3.2 28 volt auxiliary output indicator. - Place the 28 volt auxiliary output circuit breaker in its ON position and verify that the 28 volt auxiliary output indicator lights, as specified in 3.3.4.5.

4.4.4.3.3 28 volt input meter. - Verify that the 28 volt input meter has a maximum error of 1.5 volts, as specified in 3.3.4, by comparing its reading with the voltage indicated on voltmeter (4.3.3).

4.4.4.3.4 Repeat 4.4.4.3.3 with the output voltage of power supply (4.3.2) set at 28 plus or minus 0.2 and 31 plus 0 minus 0.2 volts d.c.

4.4.4.4 Connect the test set as shown in Figure 1-b, with all the test set switches and circuit breakers in their OFF position. Set resistances 4.3.6 and 4.3.7 at their maximum value and place the 28 volt d.c. input switch and the 28 volt torpedo output circuit breaker in the ON position.

4.4.4.4.1 Output to torpedo meter. - Decrease resistance of 4.3.6 until ammeter 4.3.5 reads 2 amperes. Compare the reading of the ammeter (4.3.5) with the reading on the output-to-torpedo ammeter and verify that it meets the requirements specified in 3.3.5.

4.4.4.4.2 Repeat 4.4.4.4.1 with output currents of 12 and 25 amperes.

4.4.4.4.3 Decrease resistance of 4.3.7 until ammeter (4.3.5) reads 28 amperes. Compare the reading of ammeter (4.3.5) with the reading on the output-to-torpedo ammeter, and verify that it meets the requirements specified in 3.3.5.

4.4.4.4.4 Increase the resistance of 4.3.6 and 4.3.7 to their maximum values and switch off all the circuit breakers and switches on the test set.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T15:30Z
Check the source to verify that this is the current version before use.

4.4.4.4.1 Output to torpedo meter. - Decrease resistance of 4.3.6 until ammeter 4.3.5 reads 2 amperes. Compare the reading of the ammeter (4.3.5) with the reading on the output-to-torpedo ammeter and verify that it meets the requirements specified in 3.3.5.

4.4.4.4.2 Repeat 4.4.4.4.1 with output currents of 12 and 25 amperes.

4.4.4.4.3 Decrease resistance of 4.3.7 until ammeter (4.3.5) reads 28 amperes. Compare the reading of ammeter (4.3.5) with the reading on the output-to-torpedo ammeter, and verify that it meets the requirements specified in 3.3.5.

4.4.4.4.4 Increase the resistance of 4.3.6 and 4.3.7 to their maximum values and switch off all the circuit breakers and switches on the test set.

4.4.4.5 Current interruption tests. - Connect the test set as shown in Figure 1-c and place the 28 volt d.c. input switch, the 28 volt auxiliary-output circuit breaker, and the 28 volt torpedo output circuit breaker in their ON positions.

4.4.4.5.1 28 volt torpedo output circuit breaker. - Close switch A (4.3.13) and verify, using timer (4.3.14), that the 28 volt torpedo output circuit breaker trips in 40 seconds maximum, as specified in 3.3.4.2.

4.4.4.5.1.1 Open switch 4.3.13 and place the 28 volt torpedo output circuit breaker in its ON position.

4.4.4.5.1.2 Close switch 4.3.12 and verify, using timer 4.3.14, that the 28 volt torpedo output circuit breaker trips in 40 seconds maximum, as specified in 3.3.4.2.1.

4.4.4.5.2 28 volt auxiliary output circuit breaker. - Close switch B (4.3.13) and verify, using timer 4.3.14, that the 28 auxiliary output circuit breaker trips in 3 seconds maximum, as specified in 3.3.4.4.

4.4.4.5.3 Connect the test set as shown in Figure 1-d and place the 28 volt d.c. input switch in its ON position.

NOTE: Breakers should carry loads for a minimum of 5 minutes without tripping.

4.4.4.5.3.1 28 volt torpedo output circuit breaker. - Place the 28 volt torpedo output circuit breaker in its ON position and verify that it will not trip, as specified in 3.3.4.2.2 and 3.3.4.2.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T15:30Z
Check the source to verify that this is the current version before use.

4.4.4.5.3.2 28 volt auxiliary output circuit breaker. - Place the 28 volt auxiliary output circuit breaker in its ON position and verify that it will not trip, as specified in 3.3.4.4.1.

4.4.4.6 110 volt a.c. input indicator. - Connect the test set as shown in Figure 2-a. Set the output voltage of power supply 4.3.15 at 108 plus 2 minus 0 volts a.c., using voltmeter 4.3.16. Place the 110 volt a.c. input circuit breaker in its ON position and verify that the 110 volt a.c. input indicator lights, as specified in 3.3.6.

4.4.4.6.1 260 volt d.c. output indicator. - Place the 260 volt d.c. output circuit breaker in its ON position and verify that the 260 volt d.c. indicator lights, as specified in 3.3.6.2.1.

4.4.4.6.2 Variable output indicator. - Place the J13 output circuit breaker in its ON position and verify that the variable output indicator lights, as specified in 3.3.6.3.1.

4.4.4.6.3 260 volt d.c. output. - Adjust resistance 4.3.6 until ammeter 4.3.5 reads 2 plus or minus 0.1 amperes. Using oscilloscope 4.3.17 and voltmeter 4.3.3, measure and verify that the output between pins A and B of J11 meets the requirements specified in 3.3.6.2.

4.4.4.6.4 Repeat 4.4.4.6.3 with the output voltage of power supply 4.3.15 set at 132 plus 0 minus 2 volts a.c.

4.4.4.6.4.1 Remove load across output terminals A and B of J11 and measure the output voltage, using voltmeter 4.3.3. The voltage output at no load shall meet the requirements of 3.3.6.2.

4.4.4.7 Connect the test set as shown in Figure 2-b, with all the test set circuit breakers in their OFF position. Set the output voltage of power supply 4.3.15 at 108 plus 2 minus 0 volts a.c., using voltmeter 4.3.16, and place the 110 volt a.c. input circuit breaker in its ON position.

4.4.4.7.1 Set the test set's variable output INCREASE knob in its maximum CW position and place the J13 output circuit breaker in its ON position.

4.4.4.7.2 Variable output. - Adjust resistance 4.3.18 until ammeter 4.3.5 reads 25 plus or minus 2 ma. Using oscilloscope 4.3.17 and voltmeter 4.3.3, measure and verify that the output between pins A and B of J13, pin B being positive polarity, is greater than 270 volts d.c., with a maximum ripple content of 2 percent, as specified in 3.3.6.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T15:30Z
Check the source to verify that this is the current version before use.

4.4.4.7.3 Set the output voltage of power supply 4.3.15 at 132 plus 0 minus 2 volts a.c., using voltmeter 4.3.16. Set the test set variable output increase knob in its maximum CCW position, and adjust resistance 4.3.18 until ammeter 4.3.5 reads 25 plus or minus 2 ma.

4.4.4.7.4 Variable output. - Using oscilloscope 4.3.17 and voltmeter 4.3.3, measure and verify that the output between pins A and B of J13, pin B being positive polarity, is less than 140 volts d.c., with a maximum ripple content of 2 percent, as specified in 3.3.6.3.

4.4.4.7.5 Variable output meters. - Set the test set variable output knob in its maximum CW position. Adjust the output of power supply 4.3.15 until voltmeter 4.3.3 reads 75 volts. Verify that the variable output meters meet the requirements specified in 3.3.6.3.3, by comparing the reading of the meters with the reading on voltmeter 4.3.3.

4.4.4.7.5.1 Using voltmeter 4.3.3, repeat 4.4.4.7.5 with power supply output of 150, 220, 245, 270, 320, and 400 volts d.c.

4.4.4.8 Current interruption tests. - Connect the test set as shown in Figure 2-c, with the 110 volt a.c. input circuit breaker, the 260 volt d.c. circuit breaker, and the J13 output circuit breaker in their ON position.

4.4.4.8.1 110 volt a.c. input circuit breaker. - Throw switch 4.3.19 A and verify, using timer 4.3.14, that the 110 volt a.c. input circuit breaker trips in 65 seconds maximum, as specified in 3.3.6.1.

4.4.4.8.2 110 volt a.c. input circuit breaker. - Reset switch 4.3.19 A and the 110 volt a.c. input circuit breaker. Throw switch 4.3.19 B and verify, using timer 4.3.14, that the 110 volt a.c. input circuit breaker trips in 65 seconds maximum as specified in 3.3.6.1.1.

4.4.4.8.3 260 volts d.c. output circuit breaker. - Reset switch 4.3.19 B and the 110 volt a.c. input circuit breaker. Close switch 4.3.13 A and verify, using timer 4.3.14, that the 260 volt d.c. output circuit breaker trips in 50 seconds maximum, as specified in 3.3.6.2.2.

4.4.4.8.4 J13 output circuit breaker. - Set the test set INCREASE knob in its maximum CW position. Close switch 4.3.13 B and verify, using timer 4.3.14, that the J13 output circuit breaker trips in 50 seconds maximum, as specified in 3.3.6.3.2.

4.4.4.8.5 Current capacity tests. - Connect the test set as shown in Figure 2-d and place the 110 volt a.c. input circuit breaker in its ON position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T15:30Z
Check the source to verify that this is the current version before use.

NOTE: Breakers should carry loads for a minimum of 5 minutes without tripping.

4.4.4.8.5.1 110 volt a.c. input circuit breaker. - Throw switch 4.3.19 A and verify that the 110 volt a.c. input circuit breaker will not trip, as specified in 3.6.1.2.

4.4.4.8.5.2 110 volt a.c. input circuit breaker. - Reset switch 4.3.19 A. Throw switch 4.3.19 B and verify that the 110 volt a.c. input circuit breaker will not trip, as specified in 3.3.6.1.3.

4.4.4.8.5.3 260 volts d.c. output circuit breaker. - Reset switch 4.3.19 B. Place the 260 volts d.c. output circuit breaker in its ON position and verify that it will not trip, as specified in 3.3.6.2.3.

4.4.4.8.5.4 J13 output circuit breaker. - Place the 260 volts d.c. output circuit breaker in its OFF position and turn the INCREASE knob to its maximum CCW position. Place the J13 output breaker in its ON position and verify that it will not trip, as specified in 3.3.6.3.2.1.

4.4.4.9 Remove all test equipment from the test set and place all switches and circuit breakers in their ON position. Connect all test points and connector pins to a common point. Using high potential tester 4.3.24, verify that there is no puncturing or breakdown of insulation between the common connected pins and the panel of the test set when a potential of 1000 volts d.c. plus or minus 10 percent is applied as specified in 3.3.7. See NAVORD OD-12301 for acceptable procedure.


4.5 Pre-production and periodic production sample tests.

NOTE: During environmental tests that require the test set to be operated, its cover shall be removed; in all other tests, the cover shall be closed and secured.


4.5.1 Vibration, operating condition. - The test set, rigidly mounted in a suitable vibration device, shall be subjected to vibration in each of its mutually perpendicular axes with the time distributed evenly over the vibration frequency range, to meet the requirements specified in 3.4.1, and thereafter shall meet all the performance requirements and product characteristics of this specification.

4.5.2 Vibration, shipping condition. - The test set, packed and packaged in accordance with section 5, shall be subjected to vibration tests in each of its mutually perpendicular axes, with the time distributed evenly over the frequency range, so as to meet the requirements specified in 3.4.2, and thereafter shall meet all the performance requirements and product characteristics of this specification.

Source: https://assist.dla.mil -- Downloaded: 20261O-19T15:30Z
Check the source to verify that this is the current version before use.

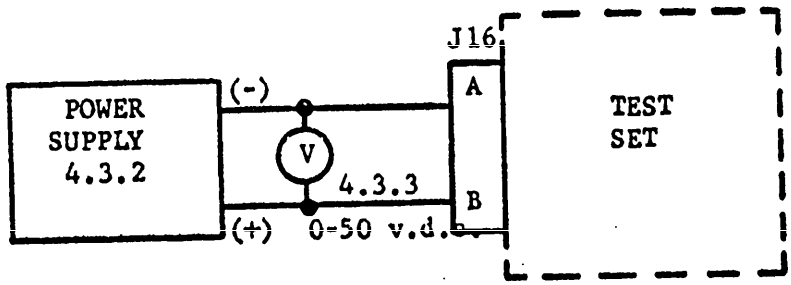

(a)

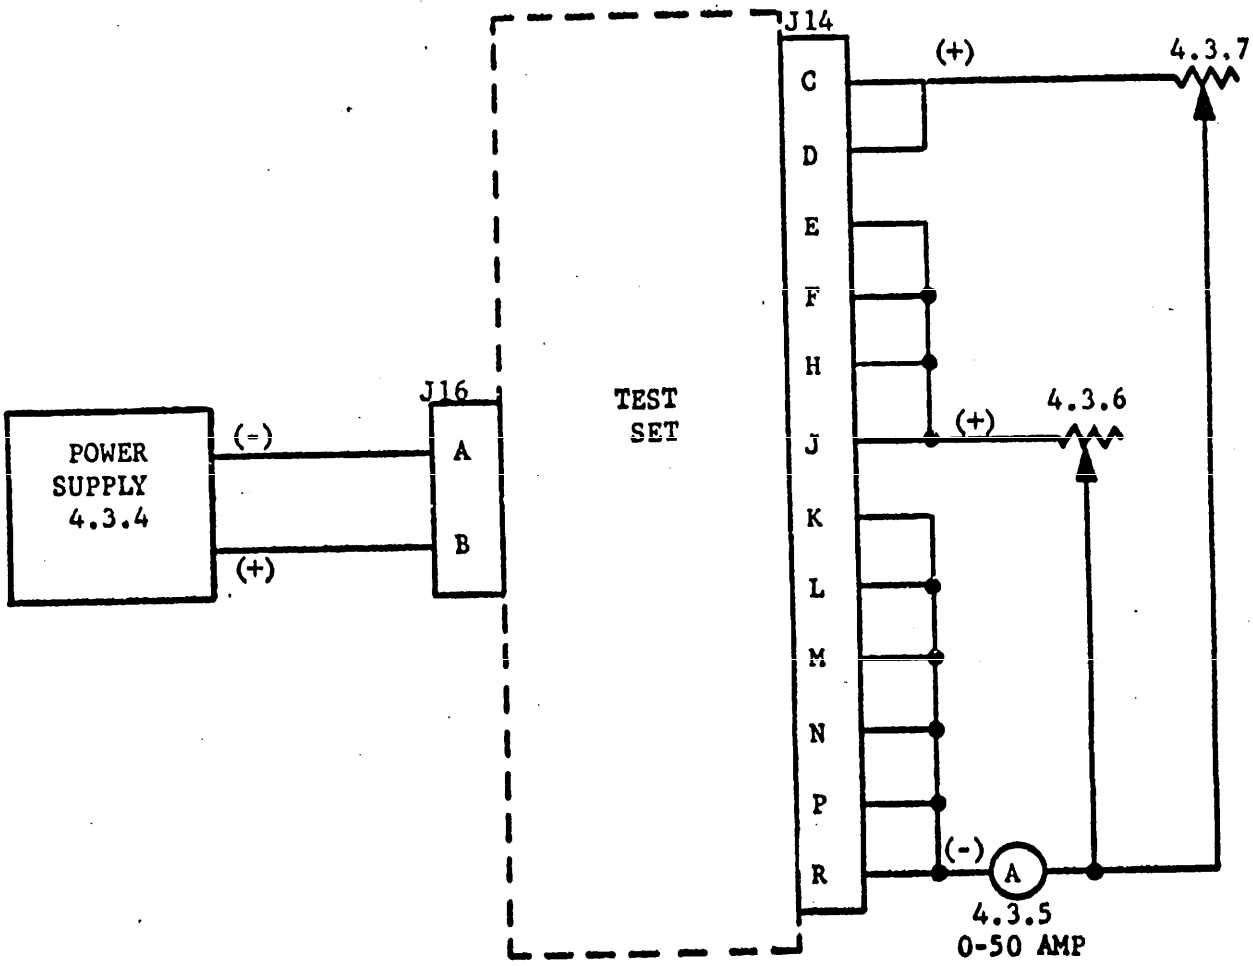

(b)

FIGURE 1 D.C. TEST SET UPS

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the current version before use.



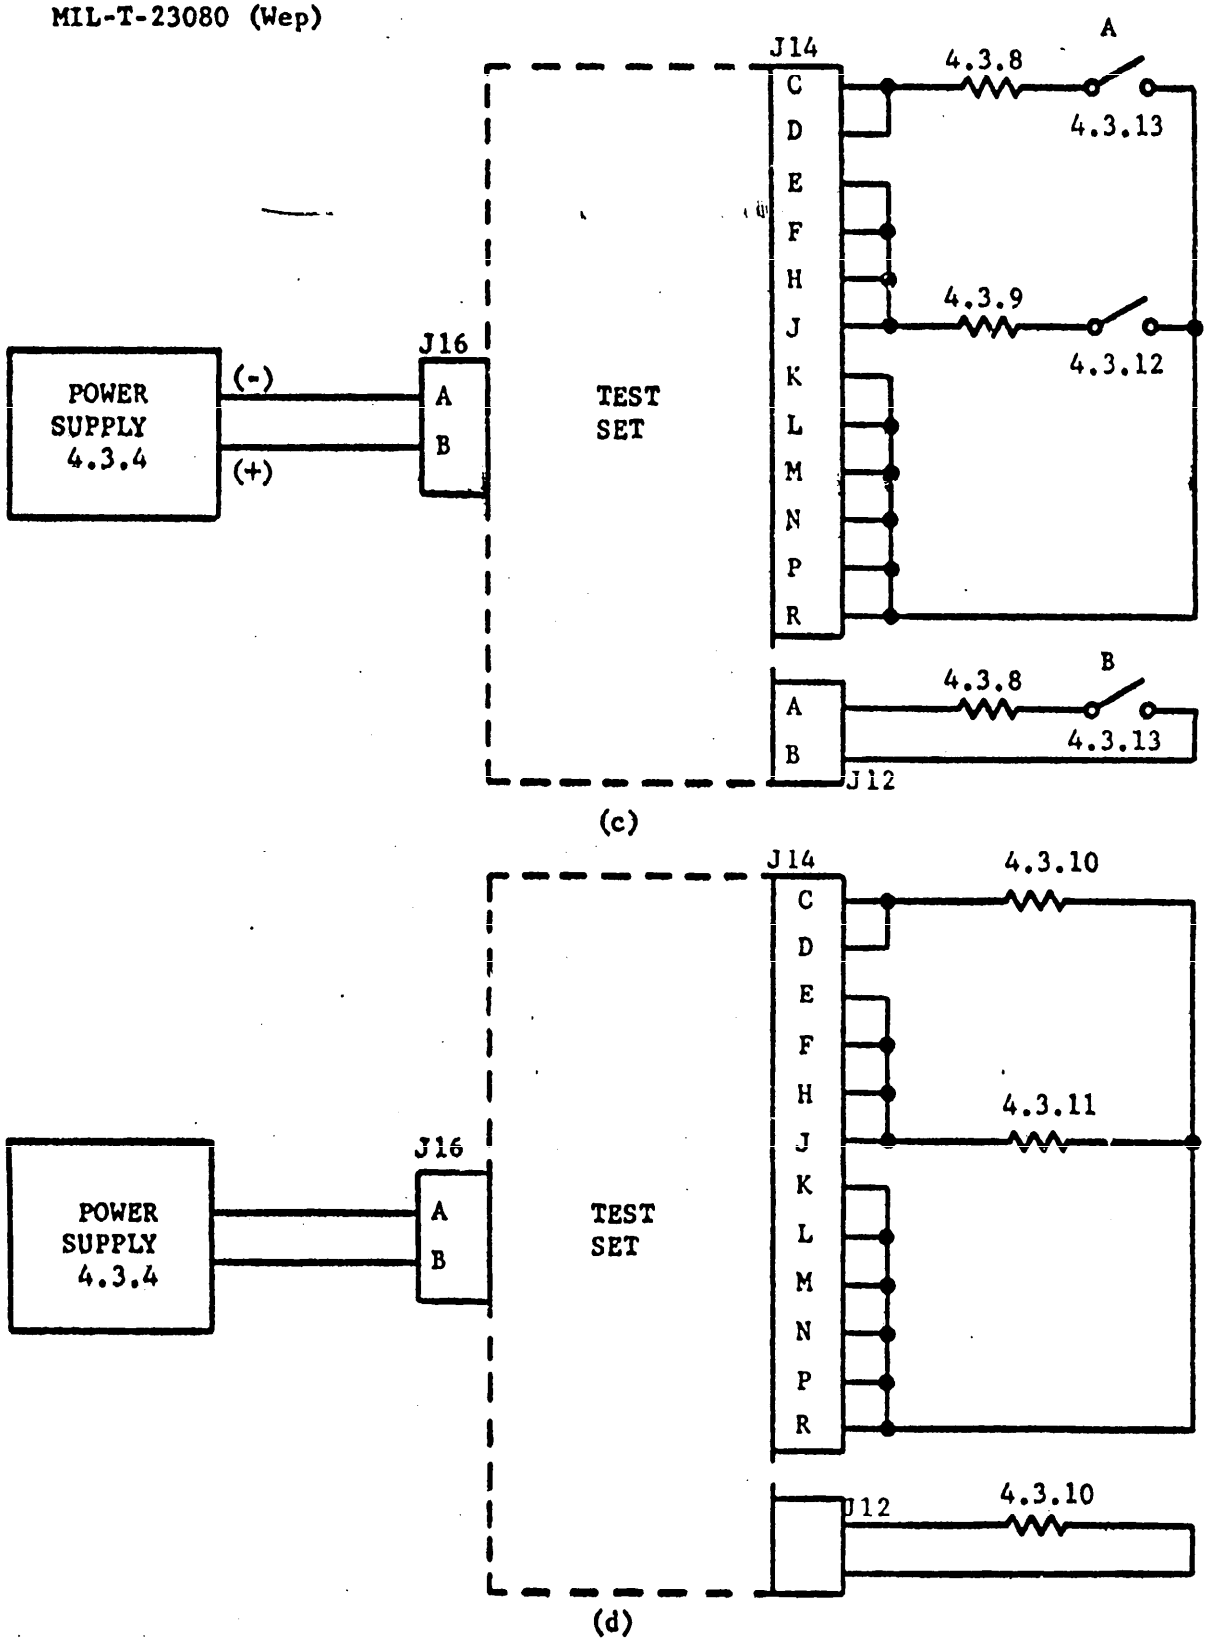


FIGURE 1 D.C. TEST SET UPS (CONTINUED)

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the current version before use.

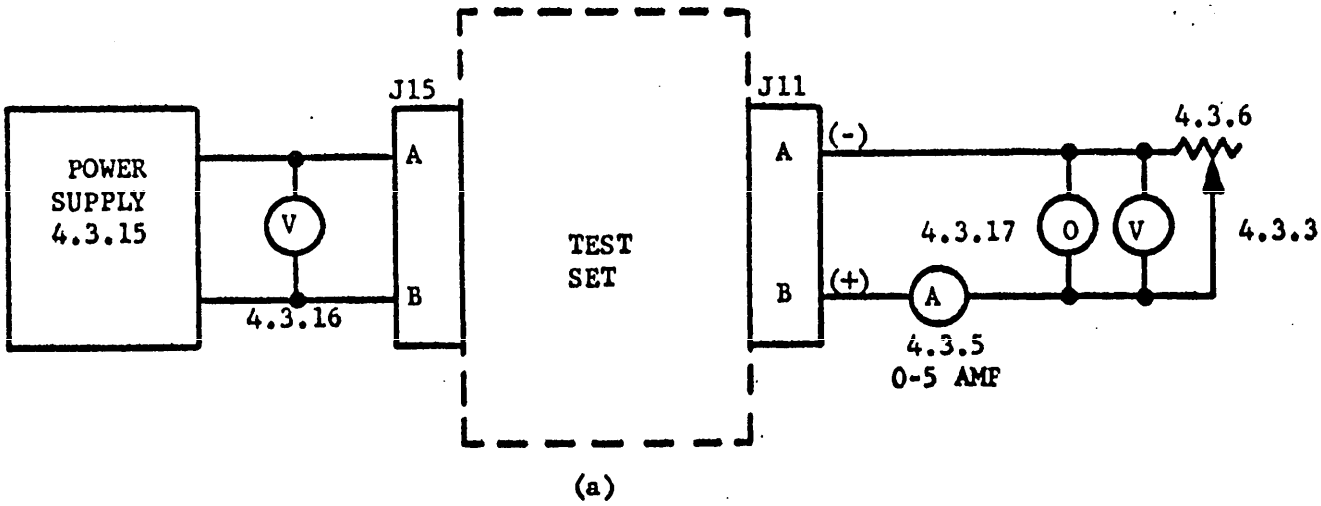


(a)

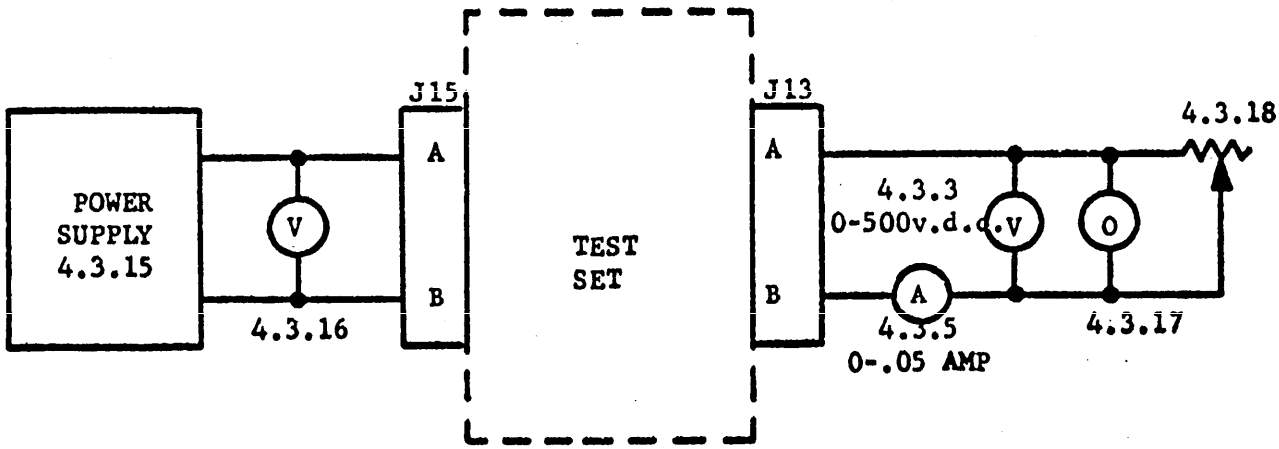


(b)

FIGURE 2 A.C. TEST SET UPS

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the current version before use.

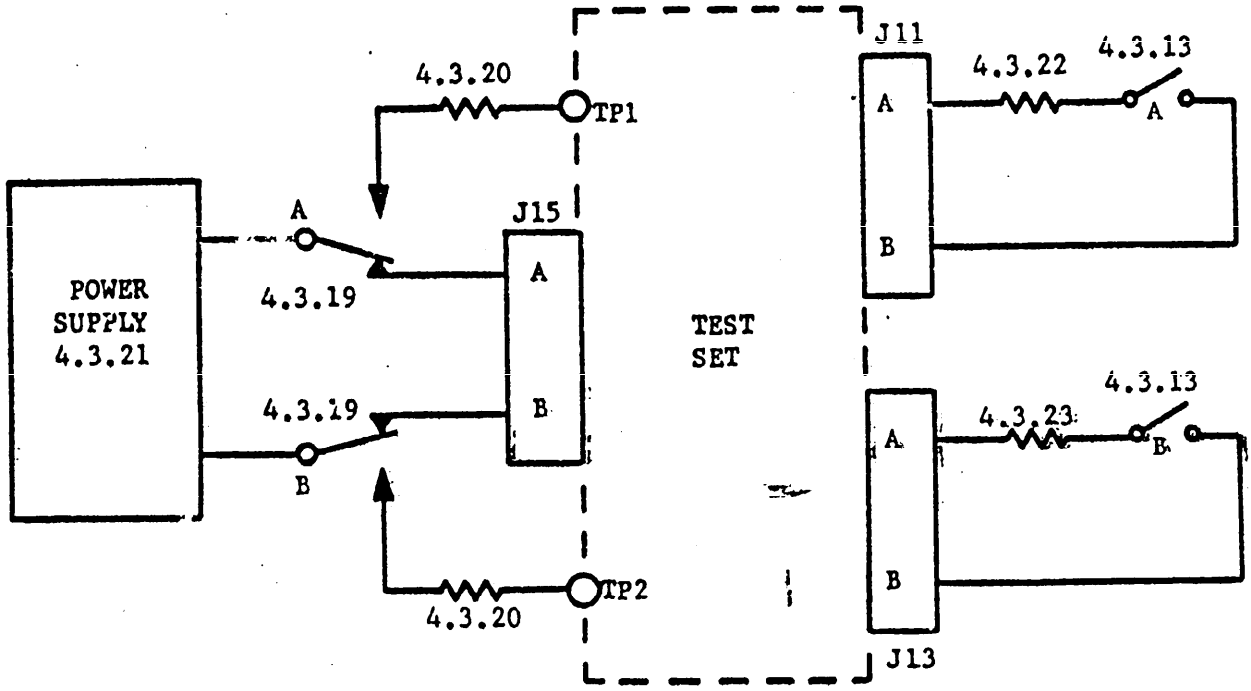

(c)

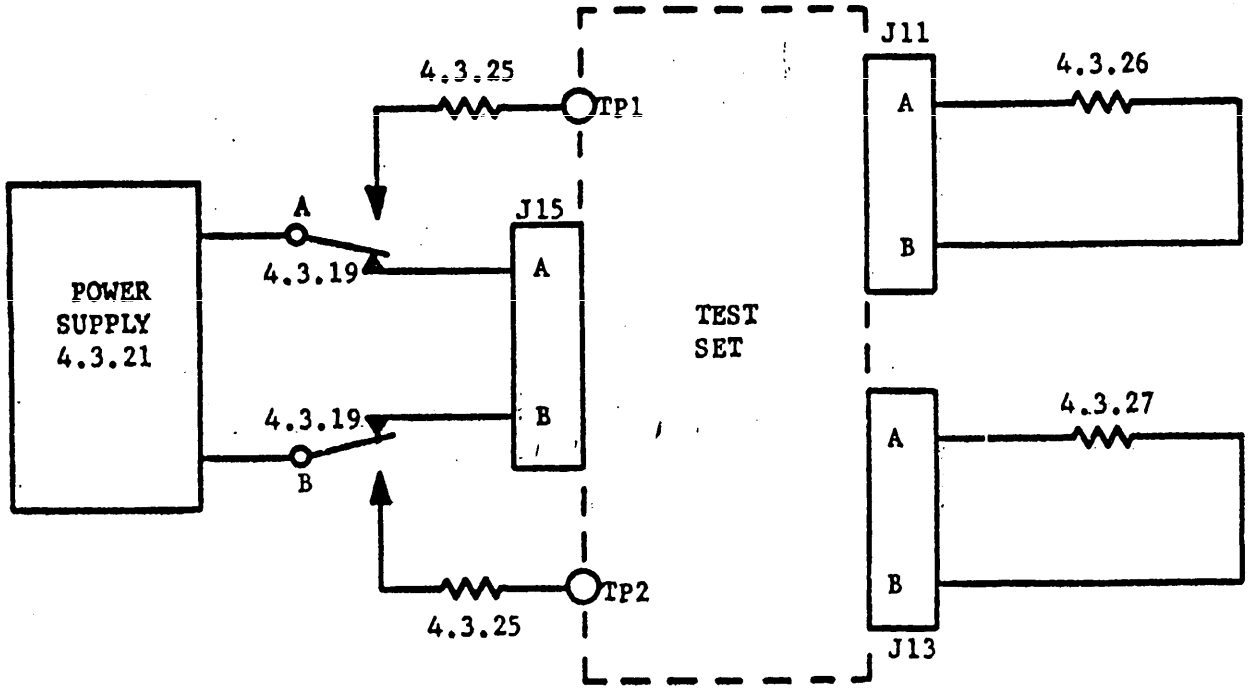

(d)

FIGURE 2 A.C. TEST SET UPS (CONTINUED)

Source: https://assist.dla.mil -- Downloaded: 202610-19T15:30Z
Check the source to verify that this is the current version before use.

4.5.3 Shock, shipping condition. - The test set, packed and packaged in accordance with section 5, and mounted in a suitable shock device shall be subjected to shock tests so as to meet the requirements specified in 3.4.3, and thereafter shall meet all the performance requirements and product characteristics of this specification.

4.5.4 Temperature, operating. - The test set shall be placed in a test chamber with an internal temperature of plus 32 plus 0 minus 10 degrees F., and shall be maintained at that temperature for a period of 4 hours plus or minus 30 minutes. The unit shall then be operated while the ambient temperature is maintained at 32 plus 0 minus 10 degrees F. The test results shall meet the requirements of 3.4.4. The unit shall then be placed in a test chamber with an internal temperature of plus 125 plus 10 minus 0 degrees F. and maintained at that temperature for a period of 4 hours plus or minus 30 minutes. The unit shall then be operated while the ambient temperature is maintained at 125 plus 10 minus 0 degrees F. The test results shall meet the requirements of 3.4.4.

4.5.5 Temperature, storage. - The test set shall be placed in a test chamber with an internal temperature of plus 160 plus or minus 5 degrees F. and maintained at that temperature for a period of 3 hours plus 5 minutes minus 0 minutes. The test set shall then be transferred to a test chamber having an internal temperature of minus 60 plus or minus 5 degrees F. and maintained at that temperature for 3 hours plus 5 minutes minus 0 minutes. The foregoing operation constitutes one complete cycle. At the conclusion of the third cycle, the unit shall be allowed to stabilize at room temperature. The test set shall then be operated, and shall meet the requirements of 3.4.5.

4.5.6 Humidity. - The test set shall be placed in a test chamber in such a manner that it is protected from condensation. The test chamber shall then be heated to 125 plus 5 minus 0 degrees F., at a relative humidity of 95 percent, within a period of 2 hours. This condition shall be maintained for a period of 6 hours, during which time the unit shall be operated. The test results shall meet the requirements of 3.4.6.

NOTE: In the above test, the unit shall be protected from the condensation of moisture on its panel and electronic parts. If there is evidence of moisture, the unit may be wiped dry with a clean, lint-free cloth before the operating tests are begun.

4.5.7 Fungus. - The test set shall be exposed to fungus tests so as to meet the requirements specified in 3.4.7, and thereafter shall meet all the performance requirements and product characteristics of this specification.

Source: https://assist.dla.mil -- Downloaded: 20261O-19T15:30Z
Check the source to verify that this is the currentversion before use.

4.6 Failure of the test set to meet any of the requirements and tests of this specification shall be considered cause for rejection.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging.

5.1.1 Level A

5.1.1.1 Cleaning. - Unless otherwise specified, the test set shall be cleaned in accordance with Method C-1 of Specification MIL-P-116.

5.1.1.2 Drying. - Unless otherwise specified, the test set shall be dried by either or both of Methods D-4 and D-1 of Specification MIL-P-116.

5.1.1.3 Preservation. - Unless otherwise specified, no preservation shall be applied to the test set.

5.1.1.4 Unit packaging. - The test set shall be individually packaged in accordance with Method IIc or IIe of Specification MIL-P-116.

5.1.2 Level B. Not applicable.

5.1.3 Level C.

5.1.3.1 Cleaning, drying, and preservation. - Cleaning, drying, and preservation of the test shall be in accordance with the manufacturer's commercial practice, when adequate.

5.1.3.2 Unit packaging. - The test shall be unit packaged in accordance with Method III of Specification MIL-P-116.

5.2 Packing

5.2.1 Number of packages per pack. - The number of packages per pack shall be as specified in the contract or purchase order.

5.2.2 Level A. - In addition to the following, Level A packing shall be in accordance with Specification MIL-E-17555.

5.2.2.1 Exterior container. - The test set, packaged as specified in 5.1.1, shall be packed in any overseas type container given in Table II constructed in accordance with its applicable specification, provided the gross weight or dimensions, as given for that container, are not exceeded.

Source: https://assist.dla.mil -- Downloaded: 20261O-19T15:30Z
Check the source to verify that this is the current version before use.

5.2.3 Level B. - Level B packing shall be the same as Level A, except that exterior containers shall conform to the domestic type containers given in Table II.

5.2.4 Level C. - The test set shall be packed to afford protection against damage direct shipment from the supply source to the first receiving activity for immediate use. Containers shall comply with Consolidated Freight Classification Rules or other common carrier regulations applicable to the mode of transportation.

5.3 Marking.

5.3.1 Normal marking. - In addition to the normal markings required in the contract or order, unit packages and shipping containers shall be marked in accordance with the requirements of Standard MIL-STD-129.

5.3.2 Serial numbers. - Unit packages and shipping containers shall be marked with the serial numbers of the units contained within.

6. NOTES

6.1 Intended use. - The test set is intended for use in a submarine tender torpedo workshop in deck-checking the Torpedo Mark 45 Mod 0 or Mod 1, or for other suitable applications.

6.2 Ordering data. - Procurement documents should specify the specific title, number, and date of this specification and exceptions to this specification; applicable drawings and other documents; selection of applicable levels of packing; and guarantee clause (see 6.5).

6.2.1 The attention of the contracting officer is called to paragraph 5.2.1.

6.3 Criteria for use of the proper level of packaging shall be as follows:

6.3.1 Level A. - This level shall be used for all items except those receiving Level C packaging in accordance with 6.3.2.

6.3.2 Level C. - This level shall be used for those items which are to be shipped to domestic installations for immediate use at the first receiving activity.

6.4 Criteria for use of the proper level of packing shall be as follows:

Source: https://assist.dla.mil -- Downloaded: 20261O-19T15:30Z
Check the source to verify that this is the currentversion before use.

TABLE II

(List of permissible shipping containers)

SPECIFICATION	DESCRIPTION	OVERSEAS MAX. WT. (LBS)	LEVEL A MAX.DIM. (INCHES)	DOMESTIC MAX.WT. (LBS)	LEVEL C MAX.DIM. (INCHES)
PPP-B-575	Box; Paper-Overlaid Veneer (Strap-Around Type)	200	L+W+D= 84	200	Same as Level A
PPP-B-585	Boxes; Wood, Wire-bound	200	any	500	any
PPP-B-591	Boxes; Fiberboard, Wood-Cleated	200	any	400	any
PPP-B-601	Boxes, Wood, Cleated-Plywood	200	any	1000	any
PPP-B-621	Boxes, Wood, Nailed and Lock-Corner	200	any	600	any
PPP-B-636	Boxes; Fiber	70	L+W+D= 70*	160	L+W+D= 120*
PPP-B-640	Boxes; Folding, Fiber-board, Corrugated, Triple Wall	---	-----	250	W+D=72 L+W=90
PPP-B-645	Boxes; Folding, Fiber-board, Heavy Duty	125	L+W+D= 60	125	Same as Level A
MIL-B-10377	Box; Wood, Cleated Veneer, Paper Over-laid	200	any	500	any

*This is maximum dimensions for maximum weight. Lower weights have lower dimensions maxima. See Specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T15:30Z
Check the source to verify that this is the current version before use.

6.4.1 Level A. - This level shall be used for those items which are to be shipped to indeterminate destinations or stored under indeterminate conditions for redistribution anywhere.

6.4.2 Level B. - This level shall be used for those items which will be subjected to multiple domestic shipments, handling, or covered storage.

6.4.3 Level C. - This level shall be used for those items which are to be shipped to domestic installations for immediate use or repacking at the first receiving activity.

6.5 Guarantee. - The contract or order shall include a requirement for a guarantee stating that any test set which fails to meet the requirements of this specification within one year after delivery because of a defect in material or workmanship or because of the vendor's failure to comply with the requirements of the applicable drawings and specifications shall be replaced by the vendor at no expense to the Government.

6.6 The contract or order shall include a sufficient number of extra items to cover production and pre-production testing samples.

NOTICE: When Government drawings, specifications, or other data are used for any purpose other than in connection with a definitely related Government procurement operation, the United States Government thereby incurs no responsibility nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use or sell any patented inventions that may in any way be related thereto.

Source: https://assist.dla.mil -- Downloaded: 20261O-19T15:30Z
Check the source to verify that this is the current version before use.

SPECIFICATION ANALYSIS SHEET
NAVWEPS FORM 4121/3 (8-62)

FORM APPROVED
BUDGET BUREAU NO. 48-R309

INSTRUCTIONS

This sheet is to be filled out by Government or contractor personnel involved in the use of this specification in procurement of products for ultimate use by the activity shown on the reverse of this sheet.

This sheet is provided for obtaining information which will aid the activity shown in insuring that through use of this specification suitable products can be procured with a minimum amount of delay and at the least cost.

Comments and the return of this sheet will be appreciated.

Fold on dotted lines on reverse side, staple in corner, and send to the activity shown.

SPECIFICATION *(No. and abbrev. title)*

ORGANIZATION	CITY	STATE

CONTRACT NUMBER	QUANTITY OF ITEMS PROCURED	DOLLAR AMOUNT
		$

MATERIAL PROCURED UNDER A DIRECT GOVERNMENT CONTRACT ☐ OR A SUBCONTRACT ☐

1. HAS ANY PART OF THIS SPECIFICATION CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?
(If so, give paragraph number and wording, and recommendations for correcting the deficiencies.)

2. COMMENTS ON ANY SPECIFICATION REQUIREMENT CONSIDERED TOO RIGID

3. IS THE SPECIFICATION RESTRICTIVE?
☐ YES ☐ NO IF YES, IN WHAT WAY?

4. REMARKS *(Attach any pertinent data which may be of use in improving this specification. If additional papers are attached, send this form and papers in an envelope. This form is addressed for use in window envelope when appropriate.)*

SUBMITTED BY *(Print name and title)*	DATE

Source: https://assist.dla.mil -- Downloaded: 202640-19T15:30Z
Check the source to verify that this is the current version before use.

Fold

DEPARTMENT OF THE NAVY
BUREAU OF NAVAL WEAPONS
WASHINGTON 25, D.C.

OFFICIAL BUSINESS

POSTAGE AND FEES PAID
NAVY DEPARTMENT

Chief, Bureau of Naval Weapons (RREN-5)

Navy Department

Washington 25, D. C.

Fold

3

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T15:30Z
Check the source to verify that this is the current version before use.