MIL-F-40054B
30 June 1978
Superseding
MIL-F-40054A
30 Sept 1968

MILITARY SPECIFICATION

FLAG SET, M-133

The specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the M-133 flag set.

1.2 Classification.- The M-133 flag set shall consist of the following components:

Component A - Flag, Signal MC-129
Component B - Flagstaff MC-130

2. APPLICABLE DOCUMENTS

2.1. The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS
FEDERAL
V-T-276 - Thread, Cotton
QQ-S-698 - Steel, Sheet and Strip, Low Carbon
QQ-T-830 - Tube, Steel (Carbon, Mechanical, Round; Seamless and Welded)
QQ-W-461 - Wire, Steel, Carbon, (Round, Bare and Coated)
QQ-Z-325 - Zinc Coating, Electrodeposited, Requirement For
TT-E-529 - Enamel, Alkyd, Semi-Gloss
TT-P-636 - Primer Coating, Alkyd, Wood and Ferrous Metal
TT-W-572 - Wood-Preservative, Water-Repellent
UU-P-268 - Paper, Kraft, Wrapping
CCC-C-419 - Cloth, Duck Cotton, Unbleached, Plied Yarns (Army and Numbered)
CCC-C-439 - Cloth Bunting, Cotton, Mercerized

/FSC 8345/

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be used in improving this document should be addressed to: Director, The Institute of Heraldry, US Army, Cameron Station, Alexandria, VA 22314, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

5/58

95

CCC-D-950 - Dyeing and Aftertreating Processes for Cotton Cloths
PPP-B-621 - Boxes, Wood, Nailed and Lock-Corner
PPP-B-636 - Box, Shipping, Fiberboard
MILITARY
MIL-T-3530 - Thread and Twine, Mildew-Resistant or Water-Repellant Treated
MIL-P-15328 - Primer (Wash) Pretreatment, Blue, (Formula No. 117-B for Metals)
MIL-G-16491 - Grommet, Metallic
STANDARDS
FEDERAL
FED-STD-191 - Textile; Test Methods
FED-STD-595 - Colors
FED-STD-751 - Stitch; Seam and Stitching
MILITARY
MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-1363 - Measurement of Wood Moisture Content
DRAWINGS
THE INSTITUTE OF HERALDRY
5-1-337 - Flag Set, M-133

(Figure 1 is a miniature copy of the referenced drawing and is attached for information only.)

(Copies of specifications, standards and drawings required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.2 Other publications.- The following publication forms a part of this specification. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.
THE COLOR ASSOCIATION OF THE UNITED STATES, INC.

U.S. Army Color Card, The Official Colors for Branches, Agencies, Etc.

(Applications for copies of the color card shall be addressed to The Color Association of the United States, Incorporated, 200 Madison Avenue, New York, New York 10016.)

3. REQUIREMENTS

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

3.1 Guide sample.- Unless otherwise specified (see 6.2), a sample of the finished flag set will be furnished as a guide for construction. Where variations appear between the requirements of this specification and the guide sample, the specification shall govern.

3.2 Standard sample.- Unless otherwise specified (see 6.2), a standard sample of the cotton bunting and thread shall be furnished by the contracting officer and shall be used for matching fastness to light, laundry, and chlorine bleaching.

3.3 First article.- Unless otherwise specified (see 6.2), before production is commenced, a sample of the completely finished flag set, flag, or flagstaff, as applicable, shall be submitted or made available to the contracting officer or his authorized representative for inspection and tests specified in 4.2. The approval of the first article authorizes the commencement of production but does not relieve the contractor of responsibility for compliance with all applicable provisions of this specification. The first article shall be manufactured in the same facilities to be used for the manufacture of the production items.

3.4 Materials.- Materials shall conform to the referenced specifications and to the requirements specified herein.

3.4.1 Cloth, cotton bunting.- The cotton bunting shall conform to CCC-C-439.

3.4.1.1 Color and treatment.- The cotton bunting shall be dyed orange to match Cable No. 65004 from the United States Army Color Card (see 2.2). The cotton bunting shall be treated in accordance with class B of CCC-D-950, using inhibitor (a) except the requirement for hydrostatic resistance shall not apply. When tested as specified in 4.3.1.1, the finished fabric shall show fastness to light, laundry, and bleaching equal to or better than the standard sample. When no standard sample is available, the finished fabric shall show good fastness to light, laundry, and bleaching.

3.4.2 Cloth, cotton duck.- The cotton duck for the headings, before finishing, shall conform to type III of CCC-C-419 having a minimum weight of 8.25 ounce per square yard.

3.4.2.1 Color and treatment.- The cotton duck shall be natural (unbleached) and shall be treated in accordance with class B of CCC-D-950 using inhibitor (h).

3.4.3 Thread, cotton.- The cotton thread shall conform to V-T-276. The thread type and sizes shall be as follows:

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

For sewing the cotton duck heading	- Ticket No. 24, 4 ply; type IB1 for needle and type IA1 for bobbin.
For hemming the flag	- Ticket No. 24, 4 ply; type IB3 for needle and type IA3 for bobbin.

3.4.3.1 Color and treatment.- The thread used for hemming the flag shall be dyed orange to match the color of the flag. When tested as specified in 4.3.1.1, the fastness to light, laundry, and bleaching shall be equal to, or better than, the standard. When no standard sample is available, the fastness to light, laundry, and bleaching shall be good. The thread for sewing the cotton duck heading shall be natural in color. All thread shall be mildew-resistant treated in accordance with type I, Class 1 or 2 of MIL-T-3530.

3.4.4 Color matching of textile material.- The dyed textile components shall be matched for color prior to the application of the mildew-resistant treatment. The color of the finished material resulting from the application of the mildew-resistant treatment shall be acceptable provided the color match is acceptable before treatment is applied.

3.4.5 Wood.- The wood for the flagstaff handles shall be thoroughly seasoned and kiln dried. When tested as specified in MIL-STD-1363, the moisture content of the wood shall be 8 to 12 percent. The wood shall be sound and free from surface defects except surface checks not exceeding 1/32 inch in width and sound pin knots not exceeding 1/8 inch in diameter. Any of the following species shall be acceptable.

Beach	Ash
Birch	Hickory
Maple	Walnut

3.4.6 Steel.-

3.4.6.1 Steel tubing.- The steel tubing for the staff shall conform to FS 1020, type I, cold drawn of QQ-T-830.

3.4.6.2 Steel, sheet and strip.- The steel for the clips shall conform to FS 1010 to 1020, half hard of QQ-S-698.

3.4.7 Wire.- The wire for the split rings shall conform to grade FS 1045 steel wire of QQ-W-461.

3.4.8 Grommet.- Grommets shall conform to type I, class 1, size 0 of MIL-G-16491.

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

3.4.9 Enamel.- The enamel for the staff shall be a semi-gloss, air drying enamel conforming to TT-E-529. The color shall be olive drab conforming to Color No. X24087 of FED-STD-595.

3.4.10 Primer.- Primer for the metal components shall conform to TT-P-636 and pretreatment primer shall conform to MIL-P-15328.

3.5 Components.- The flag set shall consist of two components, the MC-129 flag and the MC-130 flagstaff. Assembly shall be as shown on drawing 5-1-337.

3.6 Construction.- The flag set shall be constructed in accordance with the details and dimensions of drawing 5-1-337 and the requirements specified herein.

3.6.1 Stitching.- All stitching shall be accomplished using thread specified in 3.4.3. The stitching shall conform to FED-STD-751. All stitching shall be type 301 with 8 to 10 stitches to the inch on the flag hems and 6 to 8 stitches to the inch on the flag heading. All stitching ends not otherwise covered or locked shall be backstitched 1/2 inch. Stitching breaks shall be overstitched for a distance of 1 inch.

3.6.2 Welding.- The welds shall be sound, smooth and laid on in such a manner to insure the metal adjacent to the clips and plugs is not damaged.

3.6.3 Setting of grommets.- The grommets specified in 3.4.8, shall be set by punching a hole through the material which is smaller than the outside diameter of the grommet barrel and forcing the barrel through the hole. The grommets shall then be securely clinched without cutting or damaging the material.

3.7 Details of components.-

3.7.1 Component A (MC-129, flag).- The flag shall be fabricated from cotton bunting specified in 3.4.1. The fly end and sides shall be hemmed as shown using stitching type EFb-1. The heading shall be fabricated from cotton duck specified in 3.4.2. The cotton duck shall be cut 19-1/2 inches ± 1/4 inch long by 4-1/4 inches ± 1/8 inch wide. The long edges shall be folded in 13/16 inch ± 1/16 inch. The hoist end of the flag shall then be centered and lapped in a distance of 1-3/8 inches ± 1/8 inch. The raw ends of the duck shall be folded in over the flag and the duck folded to form a heading 1-3/8 inches ± 1/8 inch wide. The heading shall be stitched all around with two rows of stitching as shown on drawing 5-1-337. The two rows of stitching shall be 1/8 inch to 3/16 inch apart.

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

3.7.2 Component B (MC-130, flagstaff).- The flagstaff shall be constructed in accordance with the details and dimensions shown on drawing 5-1-337. Tubing specified in 3.4.6.1, shall be cut to the required length and two steel plugs shall be welded or driven in the ends of the shaft. Clips fabricated from steel specified in 3.4.6.2, and split rings fabricated from wire specified in 3.4.7, shall be located as shown on drawing 5-1-337. The wooden handle shall then be positioned and a steel pin forced through the handle and shaft to lock the handle in position.

3.7.2.1 Wooden handle.- The handle shall be machined from wood specified in 3.4.5. The finished handle shall have a smooth outer surface and shall be free from checks, splits, knots or any other defect which may effect appearance and serviceability.

3.8 Finish.-

3.8.1 Metal components.- Except for grommets, all metal components shall be finished as specified herein.

3.8.1.1 Plating.- After welding, the tubing, plugs and clips shall be zinc plated in accordance with class 2, type III of QQ-Z-325. The split rings and pin shall be zinc plated in accordance with class 2, type I of QQ-Z-325.

3.8.1.2 Painting.- After plating, all metal components shall be primed with primer specified in 3.4.10 and painted with enamel specified in 3.4.9.

3.8.2 Wooden handle.- After marking, the wooden handle shall be water-repellant treated in accordance with type I, composition A of TT-W-572, except the paintability requirement shall not apply.

3.9 Marking.-

3.9.1 Component A (MC-129 flag).- The flag shall be marked by stenciling or printing "MC-129" with black ink in the locations shown on drawing 5-1-337. The letters and numerals shall be block capitals 1/4 inch in height.

3.9.2 Component B (MC-130 flagstaff).- The flagstaff shall be marked "MC-130" in block letters and numerals by branding on the handle in the size and location shown on drawing 5-1-337.

3.10 Workmanship.- The flag set or components shall be clean, well made and shall meet the acceptable quality levels established by this specification.

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Inspection responsibility.- Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to the prescribed requirements.

4.2 First article inspection.- Inspection and testing of the first article shall be made on a completely finished item for all provisions applicable to the end product examination and tests.

4.3 Sampling for inspection and acceptance.- Sampling for inspection and acceptance shall be in accordance with the provisions set forth in MIL-STD-105, except where otherwise indicated.

4.3.1 Inspection of components.-

4.3.1.1 Testing of components.- In addition to the quality assurance provisions of the subsidiary specifications and standards, inspection shall be performed on components and materials listed in table I for the characteristics shown therein. The inspection level shall be S-1 and the AQL shall be 6.5 defects per hundred units. Requirements are applicable to the individual unit. Textile tests are specified in FED-STD-191.

TABLE I Component and material testing.-

Component and unit product	Characteristic	Rqm't para.	Test method	#determ per s/u	Results reported as	S/U
Dyed cloth, cotton bunting (1 linear yd.)	Colorfastness:					
	To light	3.4.1.1	5660	1	Satisfactory	3" X 4"
	To laundry and bleaching	3.4.1.1	5605	1	or unsatis-factory	piece
Thread (1 spool, cone or tube)	Colorfastness:					
	To light	3.4.3.1	5660	1	Satisfactory	1 spool,
	To laundry and bleaching	3.4.3.1	5605	1	or unsatis-factory	cone or tube
Wood	Moisture content	3.4.5	MIL-STD-1363	3	Average of 3 determ to nearest 1%	1 block prior to
	Species	3.4.5	Visual	1	Pass or fail	turning

5758

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

92-1.

4.3.2 In-process inspection.- Inspection of the subasemblies shall be made at any point of the manufacturing process to determine whether operations or assemblies are accomplished as specified on the applicable drawing. The Government reserves the right to exclude from consideration for acceptance any assembly for which in-process inspection has indicated nonconformance. In-process inspection shall be conducted as follows:

Required operation or assembly	Requirement paragraph
Zinc plating of tubing, plugs and clips	3.8.1.1
Zinc plating of split rings and pins	3.8.1.1
Application of primer and preprimer for metal components before enameling	3.8.1.2
Water-repellant treatment of handles	3.8.2
Welding operation	3.6.2

4.3.3 *Inspection of the end item.*-

4.3.3.1 Visual examination.- The defects found during examination shall be classified in accordance with 4.3.3.1.1 and 4.3.3.1.2. The lots shall be inspected in accordance with 4.3.3.1.3. The unit of product for these examinaitons shall be on flag set of component as applicable.

4.3.3.1.1 Examination of flag set or component as applicable for defects in design, material, construction, workmanship and marking.-

Examine	Defect	Classification Major	Minor
Complete assembly	Any component missing.....	x	-
	Flag not securely attached to flagstaff.....	x	-
Flag Fabric	A hole or any weakening defect, such as smash, float or loose and weakening slub, etc., expected to develop into a hole	x	-
	A needle chew which may develop into a hole.	x	-
	A scissor or knife cut, tear, mend or burn.....	x	-
	Shade bar, affecting appearance.....	-	x
	NOTE: Shade bars, slubs, etc., and needle holes (not chews) not expected to enlarge or		

5758

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

95°1.

Examine	Defect	Classification Major	Classification Minor
	weaken the fabric and not affecting appearance or serviceability shall not be classified as defects.		
	Ink spots or stains of an obvious permanent nature.....	x	-
	Removable spots or stains clearly noticeable.	-	x
	Thread ends not trimmed throughout.....	-	x
Color	Other than that specified.....	x	-
Seams and stitching	Ends of all stitching (except where ends are turned under in a hem or held down by other stitching) not securely backstitched.....	-	x
	Gage of stitching irregular, i.e., unevenly gaged or various stitching not uniform, noticeably affecting appearance.....	-	x
	Open seams on hems and heading 1/2 inch or more.....	x	-
	Open seam on hems and heading less than 1/2 inch or more at two or more places.....	-	x
	NOTE: *One or more broken or two or more continuous skipped or runoff stitches constitute an open seam. Double stitched seams are considered open when opening occurs on either or both stitchings.*		
	Any raw edge.....	x	-
	Wrong stitch type.....	-	x
	NOTE: Thread breaks not backstitched or overstitched shall be classified as open seams.		
	Loose tension resulting in loosely exposed bobbin or top thread.....	x	-
	Tight tension (stitches break when normal strain is applied to the stitching).....	x	-
	NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test stitching by exerting normal pull in the lengthwise direction of the stitching.		
	Two or three stitches per inch less than specified.....	-	x
	Four or more stitches per inch less than specified.....	x	-

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor
	Any row of required stitching missing.....	x	-
Heading	Heading not seamed as specified.....	x	-
	End and edge not closed with two rows of stitching.....	-	x
	Does not extend full length of the hoist end of flag.....	x	-
Grommets	One or both missing.....	x	-
	Insecurely clinched.....	x	-
	Broken, cracked or otherwise defective affecting function.....	x	-
	One or both clinched too tight cutting surrounding fabric.....	x	-
	Rough or sharp edge.....	-	x
Marking	Marking missing, incorrect or illegible.....	x	-
	Printed or stenciled in other than black ink.	-	x
Flagstaff)Handle	Outer surface not smooth.....	-	x
	Any large check, split, crack, torn or raised grain or other defects affecting service-ability or appearance.....	x	-
	Any rot, pith, shake, wane or decay.....	-	x
	Handle tacky to feel.....	-	x
	Any burr, sliver or splinter that can cause injury or damage fabric.....	x	-
	Pin missing or loose (not press fit).....	-	x
	Any crystalline, waxy or oily deposit.....	-	x
	Handle not securely attached to rod.....	x	-
	Edge of parallel groove not smooth.....	x	-
	Design of handle is not as specified.....	x	-
	Marking on handle not branded in the size and locations as shown in drawing.....	-	x
	Marking illegible.....	x	-
Steel tubing (clips and plugs in-cluded)	Color of film not as specified.....	x	-
	Scratch, cut, abrasion, etc., with exposure of base metal.....	-	x
	Gouge mark, check, pit, burn, with exposure of base metal.....	-	x
	Foreign debris removal of which would expose base metal.....	-	x

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor
	Blister, nodule, sag and wrinkle in the finished surface.....	-	x
	Any clip missing.....	x	-
	Any clip insecurely attached.....	x	-
	Any clip not in proper location.....	x	-
	Any clip distorted.....	-	x
	Clip not spot welded.....	x	-
	Each end of tube is not plugged.....	x	-
	Plug not securely inserted.....	x	-
Split rings	One or both missing.....	x	-
	Plating is not smooth, fine grained and adherent.....	x	-
	Not free from blister, pit, nodule and indication of burning.....	-	x
Welding	No spot weld where required or weld burning incomplete, not smooth, not fused or otherwise defective, affecting serviceability....	-	x

4.3.3.1.2 Dimensional examination.- Any dimension that is not within the specified tolerance shall be classified a defect.

4.3.3.1.3 Inspection levels and acceptance quality levels (AQL's).- Inspection levels and acceptable quality levels, expressed in defects per hundred units shall be as follows:

	Inspection level	AQL Major	AQL Total
For examinations applicable to 4.3.3.1.1	II	4.0	25.0
For examinations applicable to 4.3.3.1.2	S-4	(one class)	4.0

4.3.4 Examination of preparation for delivery requirements.- An examination shall be made to determine that packaging, packing, and marking comply with the requirements of section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully prepared for delivery with the exception that it need not be sealed. Shipping containers fully prepared for delivery shall be the number of shipping containers in the end item inspection lot. The inspection level shall be S-2 and the AQL shall be 2.5 defects per hundred units.

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

Examine	Defect
Markings (exterior and interior)	Omitted, incorrect, illegible, of improper size, location, sequence or method of application.
Materials	Any component missing, any component damaged, affecting serviceability.
Workmanship	Inadequate application of components such as incomplete closure of container flaps, inadequate stapling.
Content	Number per container is more or less than required.

4.4 Tests.- Testing shall be conducted in accordance with test methods prescribed in FED-STD-191 and as specified in subsidiary specifications and in table I. The sample size (number of units of product) shall be as shown below. The lots shall be unacceptable if one or more units of product fail to meet any test requirements specified.

Lot Size	Sample Size
800 or less	2
801 to 22,000	3
22,001 and up	5

5. PREPARATION FOR DELIVERY

5.1 Packaging.- Packaging shall be level A or C as specified (see 6.2).

5.1.1 Level A.-

5.1.1.1 Unit packaging.-

5.1.1.1.1 Flag set M-133.- Each flag set (flag and flagstaff) shall be furled and packaged in a snug-fitting transparent polyethylene bag. The polyethylene film shall be a minimum of 0.002 inch thick. All seams and closures shall be made by heat sealing. Prior to or during the heat sealing closure operation, excess air within the bag shall be expelled.

5.1.1.1.2 Component A (flag MC-129).- One flag shall be folded once in both the length and width direction and packed in a snug-fitting transparent polyethylene bag. The polyethylene film shall be a minimum of 0.002 inch thick. All seams and closures shall be made by heat sealing. Prior to or during the heat sealing closure operation, excess air within the bag shall be expelled.

5.1.1.1.3 Component B (MC-130 flagstaff).- Ten flagstaffs shall be stacked in a bundle, wrapped with kraft paper and securely tied with cotton twine approximately three inches from each end.

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

5.1.1.2 Intermediate packaging.-

5.1.1.2.1 Flag set M-133.- Six flag sets packaged as specified in 5.1.1.1.1 shall be packed in a snug-fitting setup paperboard box conforming to type I, variety 1, style 3 or 4, class C intermediate container conforming to PPP-B-636. Closure shall be in accordance with the container specifications.

5.1.1.2.2 Component A (MC-129 flag).- Sixty flags packaged as specified in 5.1.1.1.2 shall be packaged in a snug fitting intermediate fiberboard container conforming to class domestic grade 275 of PPP-B-636. Closure shall be in accordance with the container specification.

5.1.1.2.3 Component B (MC-130 flagstaff).- None.

5.1.2 Level C.- The flags, flagstaff or flag sets shall be packaged to afford adequate protection against damage and deterioration during shipment from the supply source to the first receiving activity. The contractor may use his standard practice when it meets these requirements.

5.2 Packing.- Packing shall be level A, B or C as specified (see 6.2).

5.2.1 Level A.-

5.2.1.1 Flag set M-133.- Thirty-six sets (six intermediate containers) packaged as specified in 5.1 shall be packed in a snug-fitting fiberboard shipping container conforming to class Weather - resistant, V3c or V3s, style RSC of PPP-B-636. Closure shall be in accordance with the appendix of the container specification. The contents in each shipping container shall not exceed the size and weight limitations of the container specification.

5.2.1.2 Component A (MC-129 flag).- Three hundred and sixty flags (six intermediate containers) packaged as specified in 5.1 shall be packed as specified in 5.2.1.1.

5.2.1.3 Component B (MC-130 flagstaff).- Two hundred flagstaffs packaged as specified in 5.1 shall be packed as specified in 5.2.1.1.

5.2.2 Level B.- M-133 flag set, MC-129 flag and MC-130 flagstaff shall be packed as specified in 5.2.1 in a snug-fitting fiberboard box conforming to class Domestic, grade 275 of PPP-B-636. Closure shall be in accordance with the appendix of the container specification. The weight of the contents of each shipping container shall not exceed the size and weight limitations of the container specification.

5758

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

5.2.3 Level C.- Flag sets, flags and flagstaffs packaged as specified in 5.1 shall be packed in such a manner to insure carrier acceptance and safe delivery at destination at the lowest transportation rates available for such supplies. Shipping containers shall be in accordance with the rules and regulations of carriers applicable to the mode of transportation.

5.3 Marking.- In addition to any special marking required by the contract or order, unit packages, interior packages and shipping containers shall be marked in accordance with MIL-STD-129.

5.4 Polyethylene bagged packages.- Polyethylene bagged packages shall have the required information legibly printed or stamped in black directly on the bag across the center face or on a white paper label inserted within the bag so as to permit ready identification. The white paper label shall contain the following information:

Stock Number
Nomenclature
Manufacturer's Name
Contract Number

6. NOTES

6.1 Intended use.- The flag set covered by this specification is intended to be used as signal equipment.

6.2 Ordering data.- Procurement documents should specify the following:

(a) Title, number and date of this specification.

(b) When only a component is required (see 1.2).

(c) When a guide sample will not be furnished (see 3.1).

(d) When standard samples will not be furnished (see 3.2).

(e) When a first article is not required (see 3.3).

(f) Selections of applicable levels of packaging and packing (see 5.1 and 5.2).

6.3 Samples.- Guide samples and standard samples required should be obtained from the procuring activity issuing the invitation for bid.

5758

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

Custodians:

Army - IH
Air Force - 11
Navy - SA

Review Activities:
Air Force - 99
Navy - MC
DLA - CT

Project No. 8345 - 0091

Preparing Activity:

The Institute of Heraldry,
United States Army

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

FLAG SET, M-133

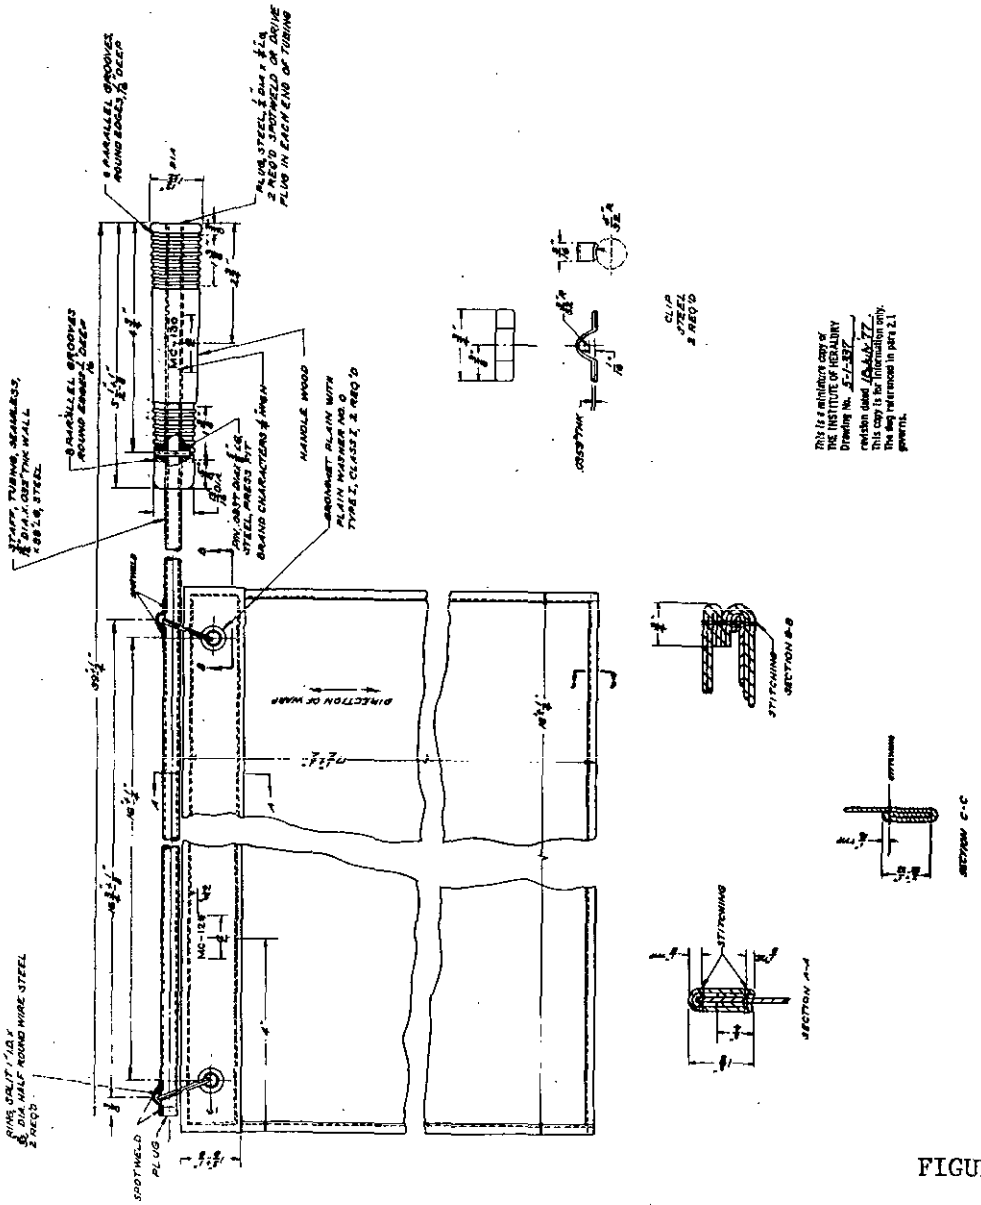


FIGURE 1

☆U.S. GOVERNMENT PRINTING OFFICE: 1978 — 603-022/5158

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.

NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-F-40054B Flag Set, M-133

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1426 1 OCT 76

EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED.

5158

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE ARMY
THE INSTITUTE OF HERALDRY, US ARMY
CAMERON STATION
ALEXANDRIA, VA 22314

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY
DOD 314



DIRECTOR
THE INSTITUTE OF HERALDRY, US ARMY
CAMERON STATION
ALEXANDRIA, VA 22314

FOLD

5158

18

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T19:06Z
Check the source to verify that this is the current version before use.