# MILITARY SPECIFICATION

## CONTROL, INDICATOR, FOR DISPENSER AND MINES: GROUND M131

This specification is approved for use within U.S. Army Armament, Munitions and Chemical Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification contains requirements not normally covered by drawings and provides Quality Assurance provisions for the fabrication of parts, assembly and packing of the Control Indicator for Dispenser and Mines, M131.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. Unless otherwise specified, the following specifications and standards of the issue listed in that issue of the Department of Defense Index of Specification and Standards (DoDISS) specified in the solicitation, form a part of this specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

PPP-B-621 - Box, Wood, Nailed and Lock-Corner.

MILITARY

MIL-B-117 - Bags, Sleeves and Tubing-Interior Packaging
MIL-C-3098 - Crystal Units, Quartz, General Specification For
MIL-L-7961 - Light Indicator, Press to Test
MIL-P-14232 - Parts, Equipment and Tools for Army Materiel, Packaging of
MIL-C-14409 - Capacitors, Variable, General Specification For

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, U.S. Army Armament, Munitions and Chemical Command, Attn: AMSMC-QA, Dover, New Jersey 07801-5001 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.


DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

MIL-E-17555 - Electronic and Electrical Equipment, Accessories, and Provisioned Items (Repair Parts) : Packaging of
MIL-F-18327 - Filters, High Pass, Low Pass, Band Pass, Band Suppression and Dual
MIL-S-19500 - Semiconductor Device, General Specification For
MIL-S-19500/108- Semiconductor Device, Thyristors (Controlled Rectifiers), Silicon Types 2N682, 2N683, 2N685, through 2N692, 2N5206, TX2N682, TX2N683, TX2N685 through TX2N692 and TX2N5206.
MIL-S-19500/117- Semiconductor Devices, Diode, Silicon Voltage Regulator Types 1N962B through 1N992B, 1B962B-1 through 1N992B-1, Jan, Jantx, Jantxv and Jans.
MIL-S-19500/255- Semiconductor Device, Transistor NPN, Silicon, Switching Types 2N2221, 2N2221A, 2N2222, and 2N2222A, Jan, Jantx, Jantxv and Jans.
MIL-S-19500\283- Semiconductor Device, Transistor, PNP, Silicon, Switching Types 2N69Aa and 24453 Jan, Jantx, Jantxv.
MIL-S-19500/356- Semiconductor Device, Diode, Silicon, Voltage Regulatro Types 1N4954 through 1N4996, 1N5968 and 1N5969 Jan, Jantx Jantxv, and Jans.
MIL-S-19500/420- Semiconductor Device, Diode, Silicon, Power Rectifier, General Purpose TX and NonTX Types 1N5550 through 1N5554.
MIL-S-19500/427- Semiconductor Device, Diode, Silicon, Power Rectifier Types 1N5614, 1N5616, 1N5618, 1N5620, 1N5622, Jan, Jantx, Jantxv and Jans.
MIL-S-19500/445- Semiconductor Device, Diode, Silicon, Switching Types 1N5712, TX 1N5712.
MIL-S-19500\477- Semiconductor Device, Diode, Silicon, Fast Recovery, Power Rectifier TX and Non-TX, Types 1N5802, 1N5804, 1N5806, 1N5807, 1N5809, and 1N5811.
MIL-C-39001/5 - Capacitor, Fixed, Mica Dielectric, Established Reliability Styles CMR04 to 08.
MIL-C-39003/1 - Capacitor, Fixed, Electrolytic (Solid Electrolyte), Tantalum, (Polarized, Sintered Slug), Established Reliability, Style CSR 13.
MIL-R-39008/1 - Resistor, Fixed, Composition (Insulated), Established Reliability, Style RCR07.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

MIL-R-39008/2 - Resistor, Fixed, Composition (Insulated), Established Reliability, Style RCR20.
MIL-C-39014/2 - Capacitor, Fixed, Ceramic Dielectric (General Purpose) Established Reliability, Style CKR06.
MIL-C-39014/5 - Capacitor, Fixed, Ceramic Dielectric (General Purpose) Established Reliability, Style CKR11, 12, 14 to 16.
MIL-C-39014/22 - Capacitor, Fixed, Ceramic Dielectric (General Purpose) Established Reliability, Style CKR22, CKR23, and CKR24.
MIL-R-39017/1 - Resistor, Fixed, Film (Insulated) Established Reliability, Style RLR07.
MIL-S-45743 - Soldering, Manual Type, High Reliability Electrical and Electronic Equipment.
MIL-S-46844 - Solder Both Soldering of Printed Wiring Assemblies
MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specifications For.
MIL-M-48646 - Microcircuit, Digital, SCO/DLA Multichip CMOS
MIL-M-48647 - Microcircuit, Digital, Decoder, Logic Array
MIL-M-64020 - Microcircuit, Amplifier, Bipolar, high frequency, Front End

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-129 - Marking for shipment and storage.
MIL-STD-202 - Test Methods for Electronic and Electrical Component Parts.
MIL-STD-331 - Fuze and Fuze Components, Environmental and Performance Test for.
MIL-STD-454 - Standard General requirements for Electronic Equipment.
MIL-STD-750 - Test Methods for Semiconductor Devices.
MIL-STD-810 - Environmental Test Method.
MIL-STD-883 - Test Methods and Procedures for Microelectronics.

DOD-STD-1686 - Electrostatic discharge Control Program for Protection of Electrical and Electronic Parts, Assemblies and Equipment.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

HANDBOOKS

DOD-HDBK-263 - EDC Handbook for Protection of Electrical and Electronics Parts, Assemblies and Equipment.

2.1.2 Other government documents, drawings, and publications. The following other government documents form part of this specification to the extent herein.

DRAWINGS

U.S. ARMY ARMAMENT RESEARCH, DEVELOPMENT AND ENGINEERING CENTER (ARDEC)

PRODUCT DRAWINGS

9333026 - Specification of MOPMS Classified Electrical characteristics.
9333036 - Control Indicator

PACKAGING PUBLICATIONS

PPP-B-621 Boxes, Wood, Nailed and Lock-Corner

(Copies of specifications, standards, drawings, and publications required by the suppliers in connection with specific procurement of functions should be obtained from the procuring activity or as directed by the contracting officer).

2.2 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

3. REQUIREMENTS

3.1 Materials. Materials shall be in accordance with applicable drawings and specifications.

3.2 Components and assemblies. The components and assemblies shall comply with all requirements specified on drawing 9333036 and associated drawing and with all requirements specified in applicable specifications and standards.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

3.3 Physical requirements.

3.3.1 Envelope and dimensions. The envelope and dimensions of the Control Indicator shall conform to the requirements of Drawing 9333036.

3.4 Environmental conditions.

3.4.1 Operating temperature. When power-up, the Control Indicator Assembly shall activate and perform as specified in Dwg. 9333026 over a temperature range given therein and when tested as specified in 3.5.

3.4.2 Transportation vibration. The Control Indicator shall show no evidence of internal or external damage that will affect the intended functions following Transportation Vibration Test No. 119, Procedure 2 of MIL-STD-331.

3.4.3 Shock. The Control Indicator shall be subject to mechanical = per MIL-STD-202, Method 213B, Condition E with a 5000 g peak and a duration of .05 ms minimum/ 2 ms maximum .

3.5 Electronic assemblies performance characteristics.

3.5.1 Radio frequency (RF) receiver. This section describes the performance characteristics of the Radio Frequency (RF) Receiver, assembly no. 9333040, a subassembly of-the Control Indicator.

3.5.1.1 Fast clock output. The signal at E7 (DLACK) shall be a 119.5 ± 1 % kHz square wave with a duty cycle of 50 ± 10 %, a logic zero level of 0.2 ± 0.2 volt and a logic one level of 5 ± 0.2 volts when tested as specified in 4.5.2.1.2.

3.5.1.2 Crystal clock. The signal at E5 (CLK) shall have a frequency of 478 kHz ± 1%, a duty cycle of 67 ± 10%, a logic zero level of 0.2 +0.2 volt and a logic one level of 5 ± 0.2 volts when tested as specified in 4.5.2.1.3.

3.5.1.3 MCD coil.

With 5 ± .1 volts applied to E15 (MCD1) and 4 + 0.2 volts to E16 (MCD2) , the outputs at E17 (L1) and E18 (L2~ shall be 5 ± .3 volts and 0 ± 0.2 volts respectively when tested as specified in 4.5.2.1.4.

b. With 5 ± .1 volts applied to E16 (MCD1) and 4 ± 0.2 volts to E15 (MCD1) , the outputs at E18 (L2) and E17 (L1) shall be 5 ± .3 volts and 0 ± 0.2 volts respectively when tested in 4.5.2.14.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

3.5.1.4 Address verify. The voltage at E4 (DA) shall be 5 ±0.2) volts when the E11 (-CLR) is a logic one (5 ± 0.2 volts) and valid field set data, as specified on Drawing 9333026, has been located when tested as specified in 4.5.2.1.5.

3.5.1.5 Hardware deploy with data transfer. When valid field set data, as specified on Drawing 9333026, has been loaded and a logic one is applied to E11 (-CLR) and E 9 (HWD) and a logic zero (0 ±0.2 volts) is applied to E8 (-HWD), the serial data pattern at E3 (DEP) and E6 (ADATA) shall comply with the requirements of Figure 7. The field set data portion of the pattern in Figure 7 shall match the field set data previously loaded when tested as specified on Drawing 9333026 when tested as specified in 4.5.2.1.6.

3.5.1.6 Hardwire deploy without data transfer. When no field set data has been loaded and logic one is applied to E11 (-CLR) and E9 (HWD) and a logic zero is applied to E8 (-HWD) , the serial data pattern at E3 (DEP) and E6 (ADATA) shall comply with the requirements of Figure 7. The field set data portion of the pattern in Figure 7 shall be a dummy address sequence as specified on Drawing 9333026 when tested as specified in 4.5.2.1.7.

3.5.1.7 RF link. When valid field set data has been loaded and an RF DEPLOY command is sent via the RF link (antenna input), as specified on Drawing 9333026, the serial data pattern at E3 (DEP) and E6 (ADATA) shall comply with the requirements of Figure 7. The field set data portion of the pattern in Figure 7 shall match the field set data previously loaded when tested as specified in 4.5.2.1.8.

3.5.2 Digital logic card (DLC) performance characteristics. This section describes the performance characteristics of the Digital Logic Card, assembly no. 9333560, a subassembly of the Control Indicator.

3.5.2.1 Circuit continuity. Prior to making any connections to the DLC, the DC resistance between the terminals listed below shall be a maximum of 1 ohm when tested as specified in 4.5.2.2.1.

| Signal | From | To | Signal | From | To |
|---|---|---|---|---|---|
| MCD1 | J1-1 | E53 | VHV | E10 | E7 |
| MCD2 | J1-14 | E54 | VBT | J1-02 | E9 |
| L1 | E55 | E25 | GND | E14 | E20,E40,E52 |
| L2 | E56 | E26 | GND | E14 | J1-10, J1-23 |
| DET1 | J1-12 | E1 | GND | E14 | J1-24, J1-25 |
| DET2 | J1-13 | E2 | GND | E14 | J1-15 |

3.5.2.2 Regulated logic voltage. With 10.4 to 14.4 volts applied at E9 (VBT) the output of the logic voltage regulator at E39 (+5V) shall be 5.25 ± 0.25 volts when tested as specified in 4.5.2.2.3.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

3.5.2.3 Battery low voltage detect (LVD) threshold. The LVD threshold shall be 10.7 ± 0.3 volts when tested as specified in 4.5.2.2.4.

3.5.2.4 Lamp driver output voltage. The "ON" and "OFF" voltages at the lamp driver outputs E12 (BTOK), E16 (CTOK), and E15 (DALT) when connected to E9 (VBT) through a 150 ohm ± 2 % 2W resistor when tested as specified in 4.5.2.2.5 shall be as listed below.

| Lamp Driver output | "ON" Voltage (Volts) | "OFF" Voltage (volts) |
|---|---|---|
| E12 (BTOK) | 1.3 max | Vbt ± 0.1 * |
| E16 (CTOK) | 0.3 max | Vbt + 0.1 |
| E15 (DALT) | 0.3 max | Vbt ± 0.1 |

* Vbt is the voltage on E9 (VBT).

3.5.2.5 Fast clock output (frame sync mode). The signal on the fast clock output, E50 (-FCL) , in the frame sync mode of operation shall have the same frequency as the input signal on E45 (DLACK) with a low level of 0.2 + 0.2 volt and a high level of 5 ± 0.5 volts when tested as specified in 4.5.2.2.6.

3.5.2.6 Fast clock output (deploy mode). The signal on the fast clock output, E50 (-FCL), in the deploy mode of operation shall be a 14.9 KHZ ± 10% square wave with a low level of 0.2 ± 0.2 volt and a high level of 5 ± 0.5 volts when tested as specified in 4.5.2.2.7.

3.5.2.7 Electric battery initiation (EBI) waveforms. In response to a deploy command, the tube drivers, when loaded as shown in figure 6 (EBI configuration), shall each generate the series of pulses shown in figure 1. The EBI waveforms shall occur in consecutive order as specified in figure 2. The energy transferred from the tube drivers to each 3.3 ohm EBI load resistor shall be 2500 ergs minimum when tested as specfied in 4.5.2.2.8.1.

3.5.2.8 High voltage supply. With the voltage on E9 (VBT) set to 13 ± 0.5 volts, the high voltage supply output voltage at E10 (VHV), when enabled, shall be 18.6 volts minimum and 19.5 volts maximum when tested as specified in 4.5.2.2.8.2.

3.5.2.9 Field set data (FSD) sequence. In response to a deploy command, the tube drivers, when loaded as shown in figure 6 (FSD configuration), shall each generate the FSD sequence shown in figure 3. The FSD sequences shall occur in consecutive order as specified in figure 4 when tested as specified in 4.5.2.2.8.3.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

3.5.2.10 Detonator driver pulses. In response to a deploy command, the detonator driver outputs J1-12 (DET1) with respect to J1-24 (DET1(R)) and J1-13 (DET2) with respect to J1-25 (DET2(R)) shall each generate exponentially decaying pulses which meet the requirements of figure 5 when tested as specified in 4.5.2.2.8.4.

3.5.2.11 Accelerated arm sequence. The DLC arming sequence can be accelerated when tested as specified in 4.5.2.2.9.

3.5.2.12 Hardwire input circuit reversed polarity. Voltage at E47 (HWD) shall be 5 ± 0.3 volts and the voltage at E46 (-HWD) is 0.2 ± 0.2 volts when tested as specified in 4.5.2.2.10.

3.5.3 Control indicator performance characteristics. This section describes the performance characteristics of the Control Indicator assembly no. 9333036.

3.5.3.1 Safe/arm switch resistance. The DC resistance of the Safe/Arm Switch circuits shall be as specified below when measured between the points listed in the table-for each of the four switch positions: SAFE, TEST, LOAD, and ARM when tested as specified in 4.5.2.3.1.

| Signal | From | To | SAFE | TEST | LOAD | ARM |
|---|---|---|---|---|---|---|
| DET1 | J1-12 | J1-24 | <1 | > 1K | <1 | > 1K |
| DET2 | J1-13 | J1-25 | <1 | > 1K | <1 | > 1K |
| VHV | J1-23 | A1A2E10 | 51 ± 5 | <1 | <1 | * |
| L1 | J1-23 | A1A2E25 | * | <1 | * | < 1 |
| L2 | J1-23 | A1A2E26 | * | <1 | * | <1 |
| GND | ** | A1A2E20 | <1 | * | * | * |

* Do not measure
** An exposed area of the control indicator casting

3.5.3.2 Quiescent current. With the voltage at E6 (+14.4 VDC) with respect to ES (COMMON) set to 13 ± 0.5 volts, the current flowing into E6 (+14.4 VDC) shall be 16 milliamperes maximum when tested as specified in 4.5.2.3.8.

3.5.3.3 Electric battery initiation (EBI) waveforms. In response to a HARDWIRE DEPLOY or RF DEPLOY command, the tube drivers shall each generate the series of pulses such as the EBI burst and sequence shown in figure 1 and 2. The total energy transferred from the tube drivers to each 3.3 ohm EBI load resistor, as the result of the series of pulses, shall be 2500 ergs minimum when tested as specified in 4.5.2.3.10.1.

3.5.3.4 Field set data (FSD) sequence. In response to a HARDWIRE DEPLOY or RF DEPLOY command, the tube drivers shall each generate the FSD sequence shown in figure 3. This sequence shall be generated at each of the tube driver outputs in consecutive order meeting the requirements of figure 4 when tested as



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

specified in 4.5.2.3.10.3.

3.5* 3.5 Detonator driver pulses. In response to a HARDWIRE DEPLOY or RF DEPLOY command, the detonator driver outputs J1-12 (DET1) with respect to J1-24 (DET1(R)) and J1-13 (DET2) with respect to J1-25 (DET2(R)) , shall meet the requirements of figure 5 when tested as specified in 4.5.2.3.10.4.

3.5.3.6 High voltage supply. With the voltage on Pi-RED (+14.4VDC) set to 13 + 0.5 volts, the high voltage supply output voltage at J1-2 (VHV), when enabled, shall be 18.6 volts minimum and 19.5 volts maximum when tested as specified in 4.5.2.3.10.2.

3.6 Soldering. All soldered electrical connections shall comply with MIL-S-46844, and MIL-S-45743 and the applicable drawing.

3.6.1 Solderability. Electronic assembly parts that are to be soldered shall comply with the solderability requirements of MIL-S-45743 and MIL-S-46844, except as noted otherwise.

3.7 Stress screening. Before potting, all circuit card assemblies shall have temperature stress screening performed prior to bonding and testing. Card assemblies are to be temperature cycled without power applied. The temperature range is -50 ± 10°F to 150 ± 10°F with a dwell time at temperature extremes of 15 ± 5 minutes. The rate of temperature change is 18 degrees F/minute minimum with 10 cycles minimum. Circuit card **assemblies** which have component failures at test representing more than 25% of the total board components shall have the stress screening operation repeated following replacement of defective components.

3.8 Inspection data. Data shall be recorded and retained for all First Article and Quality Conformance tests required by 4.4.2.32 (CI Perf. Char. at all temps.).

3.9 Variable data. The quiescent current, low voltage detection level and deploy command RF sensitivity shall be measured and recorded as variable data for the First Article samples and surveillance tests.

3.10 Surveillance units. The contractor shall provide for surveillance quantities of electronic assemblies from production. Units shall be evenly proportioned from production. Inspection data shall be recorded and retained for all surveillance units. Requirements, sample frequency and quantities for submission shall be as specified in the contract.

3.11 First article inspection. This specification contains provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

3.12 Electrostatic discharge control. All areas where electronic components or assembles are present shall comply with the ESD protection requirements of DOD-STD-1686 and DOD-HDBK-263. An ESD plan shall be prepared and submitted to the Government.

3.13 Safety. A safety plan shall be prepared and submitted to the Government for the storage, handling and disposal of lithium batteries.

3.14 Workmanship. All parts and assemblies shall be fabricated and assembled in a thorough, workmanlike manner. They shall be free of burrs, sharp edges, cracks, dirt, grease, rust and other foreign matter. The cleaning method used shall not be injurious to any parts, nor shall the parts be contaminated by the cleaning agents. Exterior surface coatings shall be continous; however, light scratches not exposing base material may be permitted. All required marking and stamping shall be neat and sharply defined.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibilities for inspection and standard quality assurance Provisions. Unless otherwise specified herein or in the contract, the provisions of MIL-S-48078 shall apply and are herein made a part of this detail specification.

4.2 Classification of inspection. The following types of inspection shall be conducted on this item.

a. First article inspection.

b. Quality conformance inspection

4.3 First article inspection.

4.3.1 Submission. The contractor shall submit a first article sample, as designated by the contracting officer, for evaluation in accordance with the provisions of 4.3.2 and 4.3.3. The first article sample shall consist of the items and sample quantities listed in Table I.

4.3.2 Inspections to be performed.

4.3.3 Rejection. See MIL-A-48078.

4.3.4 Requalification. The contractor shall be subjected to another first article for the component or assembly affected as stipulated in the contract, if any of the following occur:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

a. Manufacturing techniques or process controls which affect the form, fit, or function of the assembly are revised by either the contractor or one of his subcontractors supplying parts or assemblies or materials.

b. The contractor relocates his production facilities or portions thereof.

c. The contractor desires to use a new subcontractor (unqualified) for materials, parts or assemblies.

d. A change occurs in the design, material, performance or assembly of the control indicator.

e. A lapse in production for a period of 90 days or as stipulated in the contract.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE: Control Indicator | | SHEET 1 OF 2 | | DRAWING NUMBER: See below |
|---|---|---|---|---|---|
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Pin plate assembly<br>(Dwg. 9332936)<br>Examination for defects | 10 | | | |
| | Antenna, receiver-RF<br>(Dwg. 9332834)<br>Examination for defects | 10 | | | |
| | Housing, control indicator<br>(Dwg. 9333559)<br>Examination for defects | 10 | | | |
| | Shaft, rotary switch<br>(Dwg. 9333627)<br>Examination for defects | 10 | | | |
| | Printed wiring board<br>(Dwg. 9333042)<br>Examination for defects | 10 | | | |
| | Printed wiring board<br>(Dwg. 9333561)<br>Examination for defects | 10 | | | |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS** MIL-C-64030(AR)

| PARAGRAPH | TITLE: Control Indicator | | SHEET 2 OF 2 | | DRAWING NUMBER: See below |
|---|---|---|---|---|---|
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | CCA, digital logic (Dwg. 9333560) | | | | |
| | Examination for defects | 10 | | | |
| | Electrical performance characteristics | 10 | | | |
| | CCA, receiver, radio frequency (Dwg. 9333040) | | | | |
| | Examination for defects | 10 | | | |
| | Electrical performance characteristics | 10 | | | |
| | Control indicator (Dwg. 9333036) | | | | |
| | Examination for defect | | | | |
| | Performance characteristics | | | | |
| | A. Ambient | 10 | | | |
| | B. Cold (-35°F) | 10 | | | |
| | C. Hot (+145°F) | 10 | | | |
| NOTES: | | | | | |

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of electronic assemblies and sub-assemblies shall contain:

a. Crystal, quartz bearing the same lot interfix number from one manufacturer.

b. Filters, ladder bearing the same lot interfix number from one manufacturer.

c. Microcircuits, digital, 4096 bit (512x8) UV erasable PROM bearing the same lot interfix number from one manufacturer.

d. Microcircuits, digital, CMOS, 8 bit microprocessor bearing the same lot interfix number from one manufacturer.

e. Microcircuits, digital, CMOS, command output synchronizer bearing the same lot interfix number from one manufacturer.

f. Microcircuits, digital, CMOS, decoder logic array bearing the same lot interfix number from one manufacturer.

g. Microcircuits, linear, amplifier, bipolar HF front end bearing the same lot inter fix number from one manufacturer.

h. Circuit card assemblies, digital logic.

i. Circuit card assemblies, radio frequency receiver.

4.4.2 Examination. See MIL-A-48078.

a. Sampling plans. Unless otherwise specified in the Classification of Defects and Test Tables, sampling plans and procedures for major and minor defects shall be in accordance with MIL-STD-105, Normal Inspection Level II. (See Classification of Defects)



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.1 | Core, Antenna - Ferrite | 1 | 1 | 9332835 |
| | | | | NEXT HIGHER ASSEMBLY: 9332834 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Magnetic properties incorrect | | 100% | 3.2 | Certification |
| 102 | Core damaged | | 100% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Base, height (1.95) incorrect | | 0.65% | 3.2 | Gage |
| 202 | Thickness incorrect | | 0.65% | 3.2 | Gage |
| 203 | Width of legs (4 places) incorrect | | 0.65% | 3.2 | Gage |
| 204 | Overall height incorrect | | 0.65% | 3.2 | Gage |
| 205 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

# CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.2 | Antenna, Receiver - RF | 1 | 1 | 9332834 |
| | | | | NEXT HIGHER ASSEMBLY: 9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Wire material improper | | | | Certification |
| 102 | Lead tinned improper | | 100% | 3.2 | Visual |
| 103 | Minimum Q incorrect | | 100% | 3.2 | Certification/Test data |
| 104 | Resonant capacitance range of LA and LB incorrect | | 100% | 3.2 | Certification/Test data |
| Minor | | | | | |
| 201 | Coil winding, turns incorrect | | 0.65% | 3.2 | Visual |
| 202 | Coil winding, direction incorrect | | 0.65% | 3.2 | Visual |
| 203 | Color dot location incorrect | | 0.65% | 3.2 | Visual |
| 204 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH 4.4.2.3 | TITLE Capacitor, fixed, MICA dielectric | | SHEET 1 OF 1 | | DRAWING NUMBER MIL-C-39001/5 |
|---|---|---|---|---|---|
| | | | | | NEXT HIGHER ASSEMBLY 9333040 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | PART NUMBER CMR05E8820FPDM — PART VALUE 82 PF, 500 V | | | | |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Capacitance incorrect | | 0.40% | 3.2 | MIL-STD-202, Method 305 |
| 102 | Leakage current over max. | | 0.40% | 3.2 | MIL-STD-202, Method 302 |
| 103 | Dissipation factor | | 0.40% | 3.2 | MIL-STD-202 Method 306 |
| 104 | Leakage voltage | | 0.40% | 3.2 | MIL-STD-202 Method 208 |
| 105 | Solderability (2 leads) | | 10-0-1 | 3.6.1 | |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH 4.4.2.4 | TITLE Capacitor, Fixed | | SHEET 1 OF 1 | | DRAWING NUMBER MIL-C-39014/5 |
|---|---|---|---|---|---|
| | | | | | NEXT HIGHER ASSEMBLY 9333040 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | PART NUMBER / PART VALUE<br>M39014-05-2601 / 10 PF<br>M39014-05-2673 / .047 PF | | | | |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Capacitance incorrect | | 2.50% | 3.2 | MIL-STD-202 Method 305 |
| 102 | Leakage current | | 2.50% | 3.2 | MIL-STD-202 Method 302 |
| 103 | Dissipation factor | | 2.50% | 3.2 | MIL-STD-202 Method 208 |
| 104 | Solderability | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| Minor | | | | | |
| 201 | Identification and marking | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |
| NOTES: | | | | | |

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.5 | Capacitor, Fixed,ceramics, dielectric | | | | MIL-C-39014/22 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 9333560/9333040 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | PART NUMBER / PART VALUE<br>M39014-22-0195 / 1<br>M39014-22-0177 / .01 PF, 100 V | | | | |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Capacitance incorrect | | 0.40% | 3.2 | MIL-STD-202, Method 305 |
| 102 | Leakage current | | 0.40% | 3.2 | MIL-STD-202, Method 302 |
| 103 | Dissipation factor | | 0.40% | 3.2 | MIL-STD-202, Method 306 |
| 104 | Solderability | 10 | 10-0-1 | 3.6.1 | MIL-STD-202, Method 208 |
| 105 | Conformance to MIL-C-39014/22 | | | 3.2 | Certification |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.6 | Printed wiring board | 1 | 1 | 9333042 |
| | | | | NEXT HIGHER ASSEMBLY: 9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Circuits, discontinuous | | 100% | 3.2 | Tester |
| 102 | Conductor width, minimum | | 0.40% | 3.2 | Gage |
| 103 | Conductor spacing, minimum | | 0.40% | 3.2 | Gage |
| 104 | Solderability | | 10-0-1 | 3.6.1 | MIL-S-46844 |
| Minor | | | | | |
| 201 | Diameter of component holes incorrect | | 0.65% | 3.2 | Gage,Pin |
| 202 | Location of component holes incorrect | | 0.65% | 3.2 | Gage |
| 203 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.7 | Microcircuit, Linear, Amplifier | | 9333601(MIL-M-64020) |
| | | | NEXT HIGHER ASSEMBLY 9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Conformance to MIL-M-64020 | | | 3.2 | Certification |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.8 | Microcircuit, Digital, Decoder | 1 OF 1 | 9333602(MIL-M-48647) |
| | | | NEXT HIGHER ASSEMBLY: 9333040/9333746 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Conformance to MIL-M-48647 | | | 3.2 | Certification |
| Minor | | | | | |
| 201 | Poor workmanship | | | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.9 | Synchronizer, Command Output | | | | 9333603(MIL-M-48646) |
| | | | | | NEXT HIGHER ASSEMBLY 9333040 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Conformance to MIL-M-48646 | | | 3.2 | Certification |
| Minor | | | | | |
| 201 | Poor workmanship | | | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.10 | Filter, Band Pass | 1 OF 1 | 9333616 |
| | | | NEXT HIGHER ASSEMBLY: 9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Center frequency, incorrect | | 100% | 3.2 | MIL-F-18327 |
| 102 | Insertion loss incorrect | | 100% | 3.2 | MIL-F-18327 |
| 103 | 6DB bandwidth | | 100% | 3.2 | MIL-F-18327 |
| 104 | Reject band insertion loss | | 100% | 3.2 | MIL-F-18327 |
| 105 | Pass band ripple incorrect | | 100% | 3.2 | MIL-F-18327 |
| 106 | Input and output termination | | 100% | 3.2 | MIL-F-18327 |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.11 | Capacitor, Variable, Vertical Mount | 1 OF 1 | 9333620 |
| | | | NEXT HIGHER ASSEMBLY: 9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Solderability | | 10-0-1 | 3.6.1 | MIL-STD-202, Method 208 |
| 102 | Capacitance range incorrect | | | 3.2 | |
| 103 | Shock | | | 3.2 | MIL-STD-202, Method 213 |
| 104 | Vibration | | | 3.2 | MIL-STD-202, Method 204 |
| 105 | Compliance with MIL-C-14409 | | | 3.2 | Certification |
| 106 | Quality factor incorrect | | | | |
| Minor | | | | | |
| 201 | Insulation resistance | | 0.65% | 3.2 | MIL-STD-202 Method 302 Test condition B |
| 202 | Slot width incorrect | | 0.65% | 3.2 | Gage |
| 203 | Tab location incorrect | | 0.65% | 3.2 | Gage |
| 204 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.12 | Spacer, Insulator | | | | 9333652 |
| | | | | | NEXT HIGHER ASSEMBLY 9333040 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Outside diameter incorrect | | | | |
| Minor | | | | | |
| 201 | Clearance hole diameter incorrect | | 0.65% | 3.2 | Gage |
| 202 | Pin hole(s) diameter incorrect | | 0.65% | 3.2 | Gage |
| 203 | Location of pin hole(s) incorrect | | 0.65% | 3.2 | Gage |
| 204 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.13 | Terminal, Stud | 1 OF 1 | 9333655 |
| | | | NEXT HIGHER ASSEMBLY: 9333560/9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major 101 | Solderability | 20-0-1 | | 3.6.1 | MIL-STD-202, Method 208 |
| Minor 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.14 | Transistor (JAN 2N869A) | 1 OF 1 | MIL-S-19500/283 |
| | | | NEXT HIGHER ASSEMBLY: 9333040/9333560 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Wire material | 32 | Note 1 | 3.2 | Visual |
| 102 | Wire bond (see Note 2 of Dwg.) | 32 | Note 1 | 3.2 | Pull Tester (Note 2) |
| 103 | MIL-S-19500 Compliance | | | 3.2 | Note 3 |
| 104 | Solderability (3 leads) | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| 105 | Leakage current Ice | | 2.5% | 3.2 | MIL-STD-750, Method 3041.1 Cond. B |
| 106 | Internal visual | Note 4 | LTPD 10% | 3.2 | MIL-STD-750, Method 2072, Para. 3.2 only |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES: (1) Reject for three (3) or more defective. (2) Pull all wires on each device. (3) Visual evidence of JAN marking. (4) Sample per MIL-M-38510 Appendix B.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.15 | Semiconductor Device, Diode JAN IN5712 | 1 OF 1 | MIL-S-19500/445 |
| | | | NEXT HIGHER ASSEMBLY: 9333560/9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Forward voltage drop | | 0.40% | 3.2 | MIL-STD-750, Method 4016 |
| 102 | Reverse leakage current | | 0.40% | 3.2 | MIL-STD-750, Method 4016 |
| 103 | Solderability (all leads) | 20-0-1 | | 3.6.1 | MIL-STD-202 Method 208 |
| 104 | Evidence of JAN marking | | 0.65% | | Visual |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.16 | Resistor, Fixed, Composition | 1 OF 1 | MIL-R-39008/1 |
| | | | NEXT HIGHER ASSEMBLY: 9333560/9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| | Part Number — Part Value | | | | |
| | RCR07GI03JS — 10K | | | | |
| | RCR07G472JS — 4.7K | | | | |
| | RCR07G202JS — 2K | | | | |
| | RCR07G226JS — 22M | | | | |
| | RCR07G223JS — 22K | | | | |
| | RCR07G102JS — 1K | | | | |
| | RCR07G100JS — 10 | | | | |
| | RCR07G101JS — 100 | | | | |
| | RCR07G104JS — 100K | | | | |
| | RCR07G106JS — 10M | | | | |
| | RCR07G473JS — 47K | | | | |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Resistance incorrect | | 2.5% | 3.2 | MIL-R-39008/1 |
| 102 | Solderability, all leads | | 0.40% | 3.6.1 | MIL-STD-202. Method 208 |
| Minor | | | | | |
| 201 | Identification and marking | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH 4.4.2.17 | TITLE Capacitor, Fixed, Electrolytic Tantalum, Solid | | SHEET 1 OF 1 | | DRAWING NUMBER MIL-C-39003/1 |
|---|---|---|---|---|---|
| | | | | | NEXT HIGHER ASSEMBLY 9333560/9333040 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Part Number — Part Value | | | | |
| | M39003-01-2356 — 1.0 uf | | | | |
| | M39003-01-2257 — 33 uf/10V | | | | |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Capacitance incorrect | | 0.40% | 3.2 | MIL-STD-202, Method 305 1/ |
| 102 | Leakage current over max. | | 0.40% | 3.2 | MIL-STD-202, Method 302 |
| 103 | Dissipation factor | | 0.40% | 3.2 | MIL-STD-202, Method 306 |
| 104 | Leakage voltage | | 2.5% | | |
| 105 | Solderability (all leads) | 10-0-1 | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| 106 | Conformance to MIL-C-39003/1 | | | 3.2 | Certificate |
| Minor | | | | | |
| 201 | Identification and marking | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES: 1/ See applicable note of dwg.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.18 | Crystal, Quartz | 1 OF 1 | 9333668 |
| | | | NEXT HIGHER ASSEMBLY: 9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Frequency incorrect | | 100% | 3.2 | MIL-C-3098 |
| 102 | Frequency stability incorrect | | 100% | 3.2 | MIL-C-3098 |
| 103 | Capacitance, shunt incorrect | | 100% | 3.2 | MIL-C-3098 |
| 104 | Capacitance, motional | | 100% | 3.2 | Para. 4.2.3 (9333668) |
| 105 | Unwanted modes incorrect | | 100% | 3.2 | MIL-C-3098 |
| 106 | Seal | | 100% | 3.2 | MIL-STD-202, Method 112B |
| 107 | Conformance to MIL-C-3098 | | 100% | 3.2 | Certification |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.19 | Eyelet, Metallic | | 9355165 |
| | | | NEXT HIGHER ASSEMBLY 9333040 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Solderability | 20-0-1 | | 3.6.1 | MIL-STD-202, Method 208 |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.20 | Circuit Card Assembly, Receiver, Radio Frequency | 1 OF 1 | 9333040 |
| | | | NEXT HIGHER ASSEMBLY: 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Terminals, loos or bent | | 0.40% | 3.2 | Visual |
| 102 | Components damaged, missing or improperly assembled | | 0.40% | 3.2 | Visual |
| 103 | Soldering workmanship | | 0.40% | 3.6 | Visual |
| 104 | Bond, antenna | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Height, component, max. | | 0.65% | | Gage |
| 202 | Conformal coat, smooth, continuous | | 0.65% | | Visual |
| 203 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 3 | | DRAWING NUMBER 9333040 |
|---|---|---|---|---|---|
| 4.4.2.21 | CCA, Radio frequency (Performance Characteristics) (Ambient) | | | | NEXT HIGHER ASSEMBLY 9333036 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Hardwire deploy with FSD | | 100% | 3.5.1.5 | 4.5.2.1.6 |
| Major | | | | | |
| 101 | Fast clock | | 100% | 3.5.1.1 | 4.5.2.1.2 |
| 102 | Crystal clock | | 100% | 3.5.1.2 | 4.5.2.1.3 |
| 103 | Coil comparator | | 100% | 3.5.1.3 | 4.5.2.1.4 |
| 104 | Address verify function | | 100% | 3.5.1.4 | 4.5.2.1.5 |
| 105 | Hardwire deploy with no FSD | | 100% | 3.5.1.6 | 4.5.2.1.7 |
| 106 | RF link | | 100% | 3.5.1.7 | 4.5.2.1.8 |
| Minor | None defined | | | | |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 2 OF 3 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.21 | CCA, Radio frequency (Performance Characteristics (-35°F, +0/-5°F) | | | | 9333040 |
| | | | | | NEXT HIGHER ASSEMBLY 9333036 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | 1/ | | | |
| 1 | Hardwire deploy with FSD | | 0-1 | 3.5.1.5 | 4.5.2.1.6 |
| Major | | | | | |
| 101 | Fast clock | | 0.40% | 3.5.1.1 | 4.5.2.1.2 |
| 102 | Crystal clock | | 0.40% | 3.5.1.2 | 4.5.2.1.3 |
| 103 | Coil comparator | | 0.40% | 3.5.1.3 | 4.5.2.1.4 |
| 104 | Address verify function | | 0.40% | 3.5.1.4 | 4.5.2.1.5 |
| 105 | Hardwire deploy with no FSD | | 0.40% | 3.5.1.6 | 4.5.2.1.7 |
| 106 | RF link | | 0.40% | 3.5.1.7 | 4.5.2.1.8 |
| Minor | None defined | | | | |

NOTES: 1/ Sample size for critical characteristics to be the same as determined for major characteristics. No defects allowed for critical characteristics.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 3 OF 3 | | DRAWING NUMBER 9333040 |
|---|---|---|---|---|---|
| 4.4.2.21 | CCA, Radio frequency (Performance Characteristics) (145°F, +5/-0°F) | | | | NEXT HIGHER ASSEMBLY 9333036 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Hardwire deploy with FSD | 1/ | 0-1 | 3.5.1.5 | 4.5.2.1.6 |
| Major | | | | | |
| 101 | Fast clock | | 0.40% | 3.5.1.1 | 4.5.2.1.2 |
| 102 | Crystal clock | | 0.40% | 3.5.1.2 | 4.5.2.1.3 |
| 103 | Coil comparator | | 0.40% | 3.5.1.3 | 4.5.2.1.4 |
| 104 | Address verify function | | 0.40% | 3.5.1.4 | 4.5.2.1.5 |
| 105 | Hardwire deploy with no FSD | | 0.40% | 3.5.1.6 | 4.5.2.1.7 |
| 106 | RF link | | 0.40% | 3.5.1.7 | 4.5.2.1.8 |
| Minor | None defined | | | | |

NOTES: 1/ Sample size for critical characteristics to be the same as determined for major characteristics. No defects allowed for critical characteristics.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.22 | Insulator (Transitor) | | 9332969 |
| | | | NEXT HIGHER ASSEMBLY: 9333040/9333560/9333746 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | None defined. | | | | |
| Minor | | | | | |
| 201 | Marking improper | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.23 | Microcircuit, Linear, Bipolar Monolithic Micropower Voltage Detector | | | | 9333016 |
| | | | | | NEXT HIGHER ASSEMBLY 9333560 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Screening no performed | | 100% | 3.2 | MIL-STD-883, Method 5004, Class B |
| 102 | Conformance test | | 1/ | 3.2 | MIL-STD-883, Method 5005, Class B |
| 103 | Solderability | | 10-0-1 | 3.6.1 | MIL-STD-202, Method 208 |
| 104 | Electrical characteristics incorrect | | 100% | 3.2 | MIL-STD-883 |
| Minor | | | | | |
| 201 | Marking incorrect | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

1/ Sampling plan shall be per applicable paragraphs of MIL-M-38510, Appendix B.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

# CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.24 | Transistor, Field Effect | | 9333017 |
| | | | NEXT HIGHER ASSEMBLY 9333560 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Breakdown voltage, gate to source | | 0.40% | 3.2 | MIL-STD-750, Method 3401 |
| 102 | Breakdown voltage, drain to source | | 0.40% | 3.2 | MIL-STD-750, Method 3407 |
| 103 | Static drain to source "on-state" resistance | | 0.40% | 3.2 | MIL-STD-750, Method 3421 |
| 104 | Pulse response | | 0.40% | 3.2 | MIL-STD-750, Method 3459 |
| 105 | Solderability | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.25 | Microcircuit, Digital, CMOS, Quad | | | | 9333021 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 9333746/9333560 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Wire bond strength | 5 | Note 1 | 3.2 | Pull Tester |
| 102 | Wire material | 5 | 0-1 | 3.2 | Visual |
| 103 | Solderability | | 0.40% | 3.6.1 | MIL-STD-883, Method 2003 |
| 104 | Electrical characteristics (Note 3) | | | 3.2 | Note 2 |
| 105 | Screening (Note 3) | | | 3.2 | Note 2 |
| 106 | External visual (Note 3) | | | 3.2 | Note 2 |
| 107 | Approved part/vendor verification | | 0.65% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |
| | Item requires special handling - See 4.5.20 | | | | |

NOTES: (1) Pull all wires on each device - reject for two (2) or more bond failures. (2) Certification of conformance required (see 6.2). (3) Government sources inspection required.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026/0-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.26 | Printed Wiring Board | | | | 9333561 |
| | | | | | NEXT HIGHER ASSEMBLY 9333560 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Circuits, discontinuous | | 100% | 3.2 | Tester |
| 102 | Conductor width, minimum | | 0.40% | 3.2 | Gage |
| 103 | Conductor spacing, minimum | | 0.40% | 3.2 | Gage |
| 104 | Solderability | | 10-0-1 | 3.6.1 | MIL-S-46844 |
| Minor | | | | | |
| 201 | Diameter of component holes incorrect | | 0.65% | 3.2 | Gage, Pin |
| 202 | Location of holes incorrect | | 0.65% | 3.2 | Gage |
| 203 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.27 | Transformer, R.F. | 1 OF 1 | 9333568 |
| | | | NEXT HIGHER ASSEMBLY: 9333560 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Quality conformance inspection | | 1/ | | See Note 1/ |
| Minor | | | | | |
| 201 | Pin 1 locating dot incorrect | | 0.65% | 3.2 | Visual |
| 202 | Marking incorrect | | 0.65% | 3.2 | Visual |
| 203 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:
1/ Quality conformance inspections will be performed in accordance with Dwg. 9333035, Para. 24 and Table I, and shall use the AQL as specified therein.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH 4.4.2.28 | TITLE Microcircuit, CMOS Monolithic | | SHEET 1 OF 1 | | DRAWING NUMBER See Below |
|---|---|---|---|---|---|
| | | | | | NEXT HIGHER ASSEMBLY 9333560 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Part Number<br>9332989 9332991 9332996 9333000<br>9333001 9333002 9333018 9333019<br>9333020 9333021 9333622 9333686<br>9333745 | | | | |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Screening not performed | | 100% | | MIL-STD-883, Method 5004, Class B Certification |
| 102 | Conformance testing | | 1/ | | MIL-STD-883, Method 5005, Class B Certification |
| 103 | Solderability | | 10-0-1 | 3.6.1 | MIL-STD-202, Method 208 |
| 104 | Electrical characteristics incorrect | | 100% | 3.2 | MIL-STD-883 |
| Minor | | | | | |
| 201 | Marking incorrect | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

1/ Sampling plan shall be per applicable paragraphs of MIL-M-38510, Appendix B.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.29 | Thyristor(JAN2N682) | | MIL-S-19500/108 |
| | | | NEXT HIGHER ASSEMBLY 9333560 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Reverse current $I_R$ incorrect | | 0.40% | 3.2 | MIL-STD-750, Method 4211 |
| 102 | Holding current $I_W$ incorrect | | 0.40% | 3.2 | MIL-STD-750 Method 4201 |
| 103 | Solderability (one lead) | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.30 | Semiconductor Device, Diode JAN IN978B | 1 | 1 | MIL-S-19500/117 |
| | | | | NEXT HIGHER ASSEMBLY: 9333560 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Forward voltage drop | | 0.40% | 3.2 | MIL-STD-750 Method 4011 |
| 102 | Reverse leakage current | | 0.40% | 3.2 | MIL-StD-750 Method 4016 |
| 103 | Solderability (all leads) | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| 104 | Evidence of JAN marking | | 0.65% | 3.2 | Visual |
| 105 | Conformance to MIL-S-19560/117 | | | | Certification |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## QUALITY CONFORMANCE INSPECTION

### CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.31 | Transistor (JAN 2N2222A) | 1 OF 1 | MIL-S-19500/255 |
| | | | NEXT HIGHER ASSEMBLY: 9333560 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Wire material | 32-0-1 | | 3.2 | Visual |
| 102 | Wire bond | 32-0-1 | | 3.2 | Pull Tester |
| 103 | MIL-S-19500 Compliance | - | | 3.2 | Certification 2/ |
| 104 | Solderability (3 leads) | 20-0-1 | | 3.6.1 | MIL-STD-202, Method 208 |
| 105 | Leakage current | | 0.40% | 3.2 | MIL-STD-750, Method 3041.1 |
| 106 | Internal visual | 32-0-1 | | 3.2 | MIL-STD-750, Method 2072, Para. 3.2 only |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES: (1) Reject for three (3) or more defective. (2) Pull all wires on each device. (3) Visual evidence of JAN marking. (4) Sample per MIL-M-38510 Appendix B.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.32 | Resistor, Fixed | 1 OF 1 | MIL-R-39008/2 |
| | | | NEXT HIGHER ASSEMBLY: 9333560 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| | Part Number: RCR20G470JS — Part Value: 47, .5 Watt | | | | |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Resistance | | .40% | 3.2 | MIL-R-39008/2 |
| 102 | Solderability, all leads | 10 | 10-0-1 | 3.6.1 | MIL-STD-202. Method 208 |
| Minor | | | | | |
| 201 | Identification and marking | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.33 | Resistor, Fixed, Film | | MIL-R-39017/1 |
| | | | NEXT HIGHER ASSEMBLY: 9333560 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| | Part Number — Part Value | | | | |
| | RLR07C1003FM — 100 K | | | | |
| | RLR07C2612FM — 26.1 K | | | | |
| | RLR07C1152FM — 11.5 K | | | | |
| | RLR07C6191FM — 6.19 K | | | | |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Resistance incorrect | | 0.40% | 3.2 | MIL-R-39017/1 |
| 102 | Solderability, all leads | 10-0-1 | | 3.6.1 | MIL-STD-202. Method 208 |
| Minor | | | | | |
| 201 | Identification and marking | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.34 | Terminal, Feedthru, Insulated | | 1 OF 1 | | 9332908 |
| | | | | | NEXT HIGHER ASSEMBLY 9333036 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major 101 | Solderability | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| Minor 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.35 | Post, Binding, Electrical | | | | 9332930 |
| | | | | | NEXT HIGHER ASSEMBLY 9333036 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Solderability | 10 | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| Minor | | | | | |
| 201 | Identification and marking | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH 4.4.2.36 | TITLE Switch, Rotary | | SHEET 1 OF 1 | | DRAWING NUMBER 9333562 |
|---|---|---|---|---|---|
| | | | | | NEXT HIGHER ASSEMBLY 9333036 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Solderability | | 4.0% | 3.6.1 | MIL-STD-202, Method 208 |
| 102 | Electrical characteristics | | 2.50% | 3.2 | |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |
| NOTES: | | | | | |

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.37 | Light, Indicator | 1 OF 1 | 9333563 |
| | | | NEXT HIGHER ASSEMBLY: 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Solderability | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| 102 | Electrical characteristics | | 2.50% | 3.2 | MIL-L-7961 |
| 103 | Physical characteristics | | 2.50% | 3.2 | Dwg. 9333563 |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.38 | Coil, Magnetic Coupling | 1 OF 1 | 9332919-1 |
| | | | NEXT HIGHER ASSEMBLY 9333575 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | | | | | |
| 1 | Polarity incorrect, Note 5 of Dwg. | | 100% | 3.2 | Gage |
| 2 | White dot do not present at proper terminal | | 100% | 3.2 | Visual |
| Major | | | | | |
| 101 | Largest Outside Diameter incorrect | | 0.40% | 3.2 | Gage |
| 102 | Proper number of wire turns incorrect | | 0.40% | 3.2 | Visual |
| 103 | Smallest outside diameter incorrect | | 0.40% | 3.2 | Gage |
| 104 | Height to first shoulder incorrect | | 0.40% | 3.2 | Gage |
| 105 | Height to second shoulder incorrect | | 0.40% | 3.2 | Gage |
| 106 | Direction of winding and lead position incorrect | | 0.40% | 3.2 | Visual |
| 107 | Potting compound improper | | 0.40% | 3.2 | Certification |
| 108 | Soldering | | 0.40% | 3.2 | MIL-S-45743 |
| 109 | Wire improper | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Thickness of ridge incorrect | | 0.65% | 3.2 | Gage |
| 202 | Width of ridge incorrect | | 0.65% | 3.2 | Gage |
| 203 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.39 | Circuit Card Assembly, Digital Logic | 1 OF 1 | 9333560 |
| | | | NEXT HIGHER ASSEMBLY: 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Terminals, loose or bent | | 0.40% | 3.2 | Visual |
| 102 | Components, damaged, missing or improperly assembled | | 0.40% | 3.2 | Visual |
| 103 | Soldering workmanship | | 0.40% | 3.6 | Visual/MIL-S-45743 |
| Minor | | | | | |
| 201 | Height, component, max | | 0.65% | 3.2 | Gage |
| 202 | Hardware, missing or loose | | 0.65% | 3.2 | Visual |
| 203 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.40 | CCA, Digital logic (Performance characteristics) (Ambient) | 1 OF 3 | 9333560 |
| | | | NEXT HIGHER ASSEMBLY 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | | | | | |
| 1 | FSD pattern | | 100% | 3.5.2.9 | 4.5.2.2.8.3 |
| Major | | | | | |
| 101 | Circuit continuity | | 100% | 3.5.2.1 | 4.5.2.2.1 |
| 102 | Self test | | 100% | 3.5.2.4 | 4.5.2.2.9.1 |
| 103 | Logic voltage regulation | | 100% | 3.5.2.2 | 4.5.2.2.3 |
| 104 | Low voltage detect | | 100% | 3.5.2.3 | 4.5.2.2.4 |
| 105 | Data accept | | 100% | 3.5.2.4 | 4.5.2.2.5.1 |
| 106 | Arm | | 100% | 3.5.2.4 | 4.5.2.2.5.2 |
| 107 | Hardwire input circuit holdoff | | 100% | 3.5.2.5 | 4.5.2.2.6 |
| 108 | Hardwire input circuit deploy | | 100% | 3.5.2.6 | 4.5.2.2.7 |
| 109 | Deploy test | | 100% | | 4.5.2.2.8 |
| | EBI pulses | | 100% | 3.5.2.7 | 4.5.2.2.8.1 |
| | High voltage supply | | 100% | 3.5.2.8 | 4.5.2.2.8.2 |
| | Detonator driver pulse | | 100% | 3.5.2.10 | 4.5.2.2.8.4 |
| 110 | Accelerated arm sequence | | 100% | | 4.5.2.2.9 |
| | Safe test | | 100% | 3.5.2.4 | 4.5.2.2.9.1 |
| | Self test | | 100% | 3.5.2.4 | 4.5.2.2.9.2 |
| | Load and accelerated safe separation | | 100% | 3.5.2.4 | 4.5.2.2.9.3 |
| | Arm | | 100% | 3.5.2.4 | 4.5.2.2.9.4 |
| 111 | Hardwire input circuit reverse polarity | | 100% | - | 4.5.2.2.10 |
| Minor | None defined | | | | |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.40 | CCA, Digital logic (Performance characteristics) (-35°F, +0/-5°F) | 2 OF 3 | 9333560 |
| | | | NEXT HIGHER ASSEMBLY 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | | | | | |
| 1 | FSD pattern | 1/ | 0-1 | | |
| Major | | | | | |
| 101 | Circuit continuity | | 0.40% | 3.5.2.1 | 4.5.2.2.1 |
| 102 | Self test | | 0.40% | 3.5.2.4 | 4.5.2.2.9.1 |
| 103 | Logic voltage regulation | | 0.40% | 3.5.2.2 | 4.5.2.2.3 |
| 104 | Low voltage detect | | 0.40% | 3.5.2.3 | 4.5.2.2.4 |
| 105 | Data accept | | 0.40% | 3.5.2.4 | 4.5.2.2.5.1 |
| 106 | Arm | | 0.40% | 3.5.2.4 | 4.5.2.2.5.2 |
| 107 | Hardwire input circuit holdoff | | 0.40% | 3.5.2.5 | 4.5.2.2.6 |
| 108 | Hardwire input circuit deploy | | 0.40% | 3.5.2.6 | 4.5.2.2.7 |
| 109 | Deploy test | | 0.40% | | 4.5.2.2.8 |
| | EBI pulses | | 0.40% | 3.5.2.7 | 4.5.2.2.8.1 |
| | High voltage supply | | 0.40% | 3.5.2.8 | 4.5.2.2.8.2 |
| | Detonator driver pulse | | 0.40% | 3.5.2.10 | 4.5.2.2.8.4 |
| 110 | Accelerated arm sequence | | 0.40% | | 4.5.2.2.9 |
| | Safe test | | 0.40% | 3.5.2.4 | 4.5.2.2.9.1 |
| | Self test | | 0.40% | 3.5.2.4 | 4.5.2.2.9.2 |
| | Load and accelerated safe separation | | 0.40% | 3.5.2.4 | 4.5.2.2.9.3 |
| | Arm | | 0.40% | 3.5.2.4 | 4.5.2.2.9.4 |
| 111 | Hardwire input circuit reverse polarity | | 0.40% | - | 4.5.2.2.10 |
| Minor | None defined | | | | |

NOTE: 1/ Sample size for critical characteristics to be the same as determined for major characteristics. No defects allowed for critical characteristics.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.40 | CCA , Digital logic (Performance Characteristics) (145°F, +5/-0°F) | | 3 OF 3 | 9333560 |
| | | | | NEXT HIGHER ASSEMBLY 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | | 1/ | | | |
| 1 | FSD pattern | | 0-1 | | |
| Major | | | | | |
| 101 | Circuit continuity | | 0.40% | 3.5.2.1 | 4.5.2.2.1 |
| 102 | Self test | | 0.40% | 3.5.2.4 | 4.5.2.2.9.1 |
| 103 | Logic voltage regulation | | 0.40% | 3.5.2.2 | 4.5.2.2.3 |
| 104 | Low voltage detect | | 0.40% | 3.5.2.3 | 4.5.2.2.4 |
| 105 | Data accept | | 0.40% | 3.5.2.4 | 4.5.2.2.5.1 |
| 106 | Arm | | 0.40% | 3.5.2.4 | 4.5.2.2.5.2 |
| 107 | Hardwire input circuit holdoff | | 0.40% | 3.5.2.5 | 4.5.2.2.6 |
| 108 | Hardwire input circuit deploy | | 0.40% | 3.5.2.6 | 4.5.2.2.7 |
| 109 | Deploy test | | 0.40% | | 4.5.2.2.8 |
| | EBI pulses | | 0.40% | 3.5.2.7 | 4.5.2.2.8.1 |
| | High voltage supply | | 0.40% | 3.5.2.8 | 4.5.2.2.8.2 |
| | Detonator driver pulse | | 0.40% | 3.5.2.10 | 4.5.2.2.8.4 |
| 110 | Accelerated arm sequence | | 0.40% | | 4.5.2.2.9 |
| | Safe test | | 0.40% | 3.5.2.4 | 4.5.2.2.9.1 |
| | Self test | | 0.40% | 3.5.2.4 | 4.5.2.2.9.2 |
| | Load and accelerated safe separation | | 0.40% | 3.5.2.4 | 4.5.2.2.9.3 |
| | Arm | | 0.40% | 3.5.2.4 | 4.5.2.2.9.4 |
| 111 | Hardwire input circuit reverse polarity | | 0.40% | - | 4.5.2.2.10 |
| Minor | None defined | | | | |

NOTES/ Sample size for critical characteristics to be the same as determined for major characteristics. No defects allowed for critical characteristics.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.41 | Pin, Keying | | | | 9332916 |
| | | | | | NEXT HIGHER ASSEMBLY 9332915 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Location, flat incorrect | | 0.40% | 3.2 | Gage |
| 102 | Dia., keying incorrect | | 0.40% | 3.2 | Gage |
| 103 | Dia. of hole (-B-) incorrect | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Length, (-B-) incorrect | | 0.65% | 3.2 | Gage |
| 202 | Overall length incorrect | | 0.65% | 3.2 | Gage |
| 203 | Flange thickness incorrect | | 0.65% | 3.2 | Gage |
| 204 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.42 | Contact Battery | | | | 9332917 |
| | | | | | NEXT HIGHER ASSEMBLY 9333575 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Material improper | | 100% | 3.2 | Certification |
| Minor | | | | | |
| 201 | Contact dia. incorrect | | 0.65% | 3.2 | Gage |
| 202 | Diameter major outside incorrect | | 0.65% | 3.2 | Gage |
| 203 | Finish improper | | 0.65% | 3.2 | Visual |
| 204 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.43 | Plate, Electrical | | | | 9332915 |
| | | | | | NEXT HIGHER ASSEMBLY 9332914 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Dia., contact pin holes (2) (-1)incorrect | | 0.40% | 3.2 | Gage |
| 102 | Dia., keying pin hole (-1) incorrect | | 0.40% | 3.2 | Gage |
| 103 | Location, contact pin holes (-1) incorrect | | 0.40% | 3.2 | Gage |
| 104 | Location of battey pins incorrect | | 0.40% | 3.2 | Gage |
| 105 | Bonding improper | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.44 | Cable Assembly, Power, Electrical | 1 OF 1 | 9332914 |
| | | | NEXT HIGHER ASSEMBLY: 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Solder workmanship | | 0.40% | 3.2 | Visual |
| 102 | Overall length incorrect | | 0.40% | 3.2 | Gage |
| 103 | Wire improper | | 0.40% | 3.2 | Certification |
| 104 | Insulation improper | | 0.40% | 3.2 | Certification |
| Minor | | | | | |
| 201 | Thickness improper | | 0.65% | | Gage |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.45 | Bracket, Mounting - Rear | 1 | 1 | 9333557 |
| | | | | NEXT HIGHER ASSEMBLY: 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Loc. bind rivet nuts incorrect | | 0.65% | 3.2 | Gage |
| 202 | Location, slots (4) (.209) incorrect | | 0.65% | 3.2 | Gage |
| 203 | Location, slots (2) (.209) incorrect | | 0.65% | 3.2 | Gage |
| 204 | Length, slots (4) (.260) incorrect | | 0.65% | 3.2 | Gage |
| 205 | Loc., .127 holes incorrect | | 0.65% | 3.2 | Gage |
| 206 | Installation of clip incorrect | | 0.65% | 3.2 | Visual |
| 207 | Installation of rubber incorrect | | 0.65% | 3.2 | Visual |
| 208 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.46 | Bracket, Mounting - Front | | | | 9333558 |
| | | | | | NEXT HIGHER ASSEMBLY 9333036 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Dia., rotary switch hole incorrect | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Dia., min., bolt holes (2) incorrect | | 0.65% | 3.2 | Gage |
| 202 | Installation of floating nut incorrect | | 0.65% | 3.2 | Visual |
| 203 | Slot location incorrect | | 0.65% | 3.2 | Gage |
| 204 | Width, slot incorrect | | 0.65% | 3.2 | Gage |
| 205 | Length, slot incorrect | | 0.65% | 3.2 | Gage |
| 206 | Location, rot. switch hole incorrect | | 0.65% | 3.2 | Gage |
| 207 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.47 | Housing Control Indicator (machined part) | 1 OF 3 | 9333559 |
| | | | NEXT HIGHER ASSEMBLY: 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | .5640 hole dia. incorrect | | 0.40% | 3.2 | Gage |
| 102 | Loc. .5640 dia. hole incorrect | | 0.40% | 3.2 | Gage |
| 103 | Loc., .255 dia. holes (12) incorrect | | 0.40% | 3.2 | Gage |
| 104 | Dia., min., bolt holes (12) (.257) incorrect | | 0.40% | 3.2 | Gage |
| 105 | Dia., min., binding post holes (2)(.311) incorrect | | 0.40% | 3.2 | Gage |
| 106 | Dia., min., indicator lamp holes (3)(.499) incorrect | | 0.40% | 3.2 | Gage |
| 107 | Width, rotary switch key hole incorrect | | 0.40% | 3.2 | Gage |
| 108 | P.D. threads for MS12456, battery cover (4 plcs) incorrect | | 0.40% | 3.2 | Thd. gage |
| 109 | P.D. threads for bracket attach holes (2) MS2120914-106 incorrect | | 0.40% | 3.2 | Thd. gage |
| 110 | P.D. threads MS122079 (2) incorrect | | 0.40% | 3.2 | Thd. gage |
| 111 | Loc., thd. holes (4) battery cover incorrect | | 0.40% | 3.2 | Gage |
| 112 | Loc., thd. holes (2) bracket attach. incorrect | | 0.40% | 3.2 | Gage |
| 113 | Loc., thd holes MS122079 incorrect | | 0.40% | 3.2 | Gage |
| 114 | P.D. thds. for MS122119 board attach (4 plcs) incorrect | | 0.40% | 3.2 | Thd. gage |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.47 | Housing Control Indicator (machined part) | 2 OF 3 | 9333559 |
| | | | NEXT HIGHER ASSEMBLY: 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| 115 | Loc., board attach holes incorrect | | 0.40% | 3.2 | Gage |
| 116 | .140 dia. holes dia. (2) incorrect | | 0.40% | 3.2 | Gage |
| 117 | Loc., .140 dia. holes incorrect | | 0.40% | 3.2 | Gage |
| 118 | Loc., rotary key slot incorrect | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | .124/.129 dia. incorrect | | 0.65% | 3.2 | Gage |
| 202 | Perpendicualarity of base to back of face plate incorrect | | 0.65% | 3.2 | Gage |
| 203 | Identification and marking incorrect | | 0.65% | 3.2 | Visual |
| 204 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.47 | Housing Control Indicator (Casting) | 3 OF 3 | 9333559 |
| | | | NEXT HIGHER ASSEMBLY: 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Loc., true position of 3.90 slot incorrect | | 0.40% | 3.2 | Gage |
| 102 | Cracks, cold shuts, hot tears, porosity | | 100% | 3.2 | Penetrant, inspect 100% |
| Minor | | | | | |
| 201 | Material | | 100% | 3.2 | Certification |
| 202 | Heat treatment | | 100% | 3.2 | Certification |
| 203 | 125 surface finish | | 0.65% | 3.2 | Profilometer |
| 204 | Length, 5.51, battery cavity | | 0.65% | 3.2 | Gage |
| 205 | Width, 3.72, battery cavity | | 0.65% | 3.2 | Gage |
| 206 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.48 | Plunger, spring loaded | | | | 9333625 |
| | | | | | NEXT HIGHER ASSEMBLY 9333036 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Movement of plunger obstructed | | 0.40% | 3.2 | Visual |
| 102 | Plunger dia. incorrect | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | .315-18 UNC-2A thread | | 0.65% | 3.2 | Gage, thread |
| 202 | Plunger length incorrect | | 0.65% | 3.2 | Gage |
| 203 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET 1 OF 2 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.49 | Shaft, Rotary switch | | 9333627 |
| | | | NEXT HIGHER ASSEMBLY 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Dia., shaft, knob incorrect | | 0.40% | 3.2 | Gage |
| 102 | Flat, (.220), knob shaft incorrect | | 0.40% | 3.2 | Gage |
| 103 | Dia., bearing incorrect | | 0.40% | 3.2 | Gage |
| 104 | Loc., T.P. bearing dia. to rotary switch dia. incorrect | | 0.40% | 3.2 | Gage |
| 105 | O-ring groove dia. incorrect | | 0.40% | 3.2 | Gage |
| 106 | Length, o-ring groove incorrect | | 0.40% | 3.2 | Gage |
| 107 | Location, o-ring groove (T.P.) incorrect | | 0.40% | 3.2 | Gage |
| 108 | .312-18 UNC-2B incorrect | | 0.40% | 3.2 | Thd. gage |
| 109 | Thd. hole parallel to flange face incorrect | | 0.40% | 3.2 | Gage |
| 110 | Flange face perpendicular to bearing dia. incorrect | | 0.40% | 3.2 | Gage |
| 111 | Dia. Datun A incorrect | | 0.40% | 3.2 | Gage |
| 112 | Thickness (.058) incorrect | | 0.40% | 3.2 | Gage |
| 113 | Location of flat to Datum A & B (.058) incorrect | | 0.40% | 3.2 | Gage |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.49 | Shaft, Rotary switch | 2 OF 2 | 9333627 |
| | | | NEXT HIGHER ASSEMBLY 9333036 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Minor | | | | | |
| 201 | Location, angle, threaded hole incorrect | | 0.65% | 3.2 | Gage |
| 202 | Length, knob shaft incorrect | | 0.65% | 3.2 | Gage |
| 203 | Overall length incorrect | | 0.65% | 3.2 | Gage |
| 204 | Location (.250) thd. hole incorrect | | 0.65% | 3.2 | Gage |
| 205 | Dia., washer shaft incorrect | | 0.65% | 3.2 | Gage |
| 206 | Dia., plunger incorrect | | 0.65% | 3.2 | Gage |
| 207 | Concentricity, plunger dia. incorrect | | 0.65% | 3.2 | Gage |
| 208 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.50 | Ratchet, Detenting | | | | 9333728 |
| | | | | | NEXT HIGHER ASSEMBLY 9333036 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Location, detent stops (.072 dim.) (6 plcs) incorrect | | 0.40% | 3.2 | Gage |
| 102 | Diameter, locating pins incorrect | | 0.40% | 3.2 | Gage |
| 103 | Location, locating pins incorrect | | 0.40% | 3.2 | Gage |
| 104 | 1.00 Radius (4 plcs) incorrect | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Height, .39 dim. incorrect | | 0.65% | 3.2 | Gage |
| 202 | Height, .57 dim. incorrect | | 0.65% | 3.2 | Gage |
| 203 | Thickness, base incorrect | | 0.65% | 3.2 | Gage |
| 204 | Height, overall incorrect | | 0.65% | 3.2 | Gage |
| 205 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.51 | Valve, Pressure Relief | 1 | 1 | 9332904 |
| | | | | NEXT HIGHER ASSEMBLY: 9333640 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Cracking pressure incorrect | | 100% | 3.2 | Certification |
| 102 | Thread, major diameter incorrect | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Absence of o-ring and washer | | 0.65% | 3.2 | Visual |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.52 | Panel, Battery | | | | 9355147 |
| | | | | | NEXT HIGHER ASSEMBLY 9333640 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Loc. of captive screw holes | | 0.40% | 3.2 | Gage |
| 102 | Flatness of back face | | 0.40% | 3.2 | Gage |
| 103 | Dia., relief valve hole | | 0.40% | 3.2 | Gage |
| 104 | Complete assembly and installations | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | O-ring cavity width | | 0.65% | 3.2 | Gage |
| 202 | O-ring cavity depth | | 0.65% | 3.2 | Gage |
| 203 | Location, enclosure pad | | 0.65% | 3.2 | Gage |
| 204 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.53 | Terminal, Pin | | | | 9355155 |
| | | | | | NEXT HIGHER ASSEMBLY 9332936 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | .042 dia. | | 0.40% | 3.2 | Gage |
| 102 | .041 dia. | | 0.40% | 3.2 | Gage |
| 103 | Length, contact | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Diameter, flange | | 0.65% | 3.2 | Gage |
| 202 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.54 | Pin Plate Assembly, Coil - MCD | 1 | 1 | 9332936 |
| | | | | NEXT HIGHER ASSEMBLY: 9332919-1 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Pin hole location incorrect | | 0.40% | 3.2 | Gage |
| 102 | Thru hole dia., incorrect | | 0.40% | 3.2 | Gage |
| 103 | Perpendicularity of pins incorrect | | 0.40% | 3.2 | Gage |
| 104 | Swaze pins damage | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Pin hole dia. incorrect (before pin installation) | | 0.65% | 3.2 | Gage |
| 202 | Outside dia incorrect | | 0.65% | 3.2 | Gage |
| 203 | Material thickness incorrect | | 0.65% | 3.2 | Gage |
| 204 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.55 | Core, Ferrite | | 9332920 |
| | | | NEXT HIGHER ASSEMBLY 9332919-1 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Magnetic properties incorrect | | 100% | 3.2 | Certification |
| 102 | Terminal stud hole dia. incorrect | | 0.40% | 3.2 | Gage |
| 103 | Cavity depth incorrect | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Cavity dia. | | 0.65% | 3.2 | Gage |
| 202 | Cavity center dia. | | 0.65% | 3.2 | Gage |
| 203 | Width, clearance slots, min. | | 0.65% | 3.2 | Gage |
| 204 | Height, overall | | 0.65% | 3.2 | Gage |
| 205 | Outside dia. | | 0.65% | 3.2 | Gage |
| 206 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.56 | Coil, Magnetic Coupling | | | | 9332919-1 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined. | | | | |
| Major | | | | | |
| 101 | Inductance between terminals | | 100% | 3.2 | TEST |
| 102 | Polarity | | 100% | 3.2 | TEST |
| 103 | Solder workmanship | | 0.40% | 3.2 | Visual/MIL-STD-454 |
| 104 | Outside dia. | | 0.40% | 3.2 | Gage |
| 105 | Potting material on core, max. | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Location, polarity dot | | 0.65% | 3.2 | Visual |
| 202 | .925 dia. | | 0.65% | 3.2 | Gage |
| 203 | Width of pin potting compound | | 0.65% | 3.2 | Gage |
| 204 | Exposed wires, none permitted | | 0.65% | 3.2 | Visual |
| 205 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.57 | Control Indicator (Performance characteristics) (Ambient) | 1 OF 1 | 9333036 |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | | 1/ | | | |
| 1 | FSD pattern | | 0-1 | 3.5.3.4 | 4.5.2.3.10.3 |
| 2 | Premature hardwire deploy | | 100% | 3.6.3 | 4.5 |
| 3 | Premature RF deploy | | 100% | 3.6.3 | 4.5 |
| Major | | | | | |
| 101 | Safe/Arm switch resistance | | 100% | 3.5.3.1 | 4.5.2.3.1 |
| 102 | Lamp test | | 100% | | 4.5.2.3.3 |
| 103 | Self test | | 100% | | 4.5.2.3.4 |
| 104 | Low voltage detect | | 100% | | 4.5.2.3.5 |
| 105 | Load test | | 100% | | 4.5.2.3.6 |
| 106 | Arm test | | 100% | | 4.5.2.3.7 |
| 107 | Quiescent current | | 100% | 3.5.3.2 | 4.5.2.3.8 |
| 108 | Hardwire deploy test | | 100% | | 4.5.2.3.10 |
| | EBI pulses | | 100% | 3.5.3.3 | 4.5.2.3.10.1 |
| | High voltage supply | | 100% | 3.5.3.6 | 4.5.2.3.10.2 |
| | Detonator driver pulse | | 100% | 3.5.3.5 | 4.5.2.3.10.4 |
| 109 | Accelerated arm sequence | | 100% | | 4.5.2.3.11 |
| 110 | Hardwire deploy reverse polarity | | 100% | 3.5.3.6 | 4.5.2.3.12 |
| 111 | RF omnidirectional sensitivity | | 100% | | 4.5.2.3.13 |
| | Minimum reception orientation | | 100% | 3.5.3.6 | 4.5.2.3.13.1 |
| | Maximum reception orientation | | 100% | 3.5.3.6 | 4.5.2.3.13.2 |
| 112 | RF deploy with incorrect group ID | | 100% | 3.5.3.6 | 4.5.2.3.16 |
| 113 | RF deploy | | 100% | | |
| Minor | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH 4.4.2.57 | TITLE Control Indicator (Performance characteristics) (-35°F, +0/-5°F) | | SHEET 2 OF 3 | | DRAWING NUMBER 9333036 |
|---|---|---|---|---|---|
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | 1/ | | | |
| 1 | FSD pattern | | 0-1 | 3.5.3.4 | 4.5.2.3.10.3 |
| 2 | Premature hardwire deploy | | 0.40% | 3.6.3 | 4.5 |
| 3 | Premature RF deploy | | 0.40% | 3.6.3 | 4.5 |
| Major | | | | | |
| 101 | Safe/Arm switch resistance | | 0.40% | 3.5.3.1 | 4.5.2.3.1 |
| 102 | Lamp test | | 0.40% | | 4.5.2.3.3 |
| 103 | Self test | | 0.40% | | 4.5.2.3.4 |
| 104 | Low voltage detect | | 0.40% | | 4.5.2.3.5 |
| 105 | Load test | | 0.40% | | 4.5.2.3.6 |
| 106 | Arm test | | 0.40% | | 4.5.2.3.7 |
| 107 | Quiescent current | | 0.40% | 3.5.3.2 | 4.5.2.3.8 |
| 108 | Hardwire deploy test | | 0.40% | | 4.5.2.3.10 |
| | EBI pulses | | 0.40% | 3.5.3.3 | 4.5.2.3.10.1 |
| | High voltage supply | | 0.40% | 3.5.3.6 | 4.5.2.3.10.2 |
| | Detonator driver pulse | | 0.40% | 3.5.3.5 | 4.5.2.3.10.4 |
| 109 | Accelerated arm sequence | | 0.40% | | 4.5.2.3.11 |
| 110 | Hardwire deploy reverse polarity | | 0.40% | 3.5.3.6 | 4.5.2.3.12 |
| 111 | RF omnidirectional sensitivity | | 0.40% | | 4.5.2.3.13 |
| | Minimum reception orientation | | 0.40% | 3.5.3.6 | 4.5.2.3.13.1 |
| | Maximum reception orientation | | 0.40% | 3.5.3.6 | 4.5.2.3.13.2 |
| 112 | RF deploy with incorrect group ID | | 0.40% | 3.5.3.6 | 4.5.2.3.16 |
| 113 | RF deploy | | 0.40% | | |
| Minor | None defined | | | | |

NOTES/ Sample size for critical characteristics to be the same as determined for major characteristics. No defects allowed for critical characteristics.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.57 | Control Indicator (Performance Characteristics) (145°F, +5/-0°F) | 3 OF 3 | 9333036 |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | | 1/ | | | |
| 1 | FSD pattern | | 0-1 | 3.5.3.4 | 4.5.2.3.10.3 |
| 2 | Premature hardwire deploy | | 0.40% | | 4.5.2.3.9 |
| 3 | Premature RF deploy | | 0.40% | | 4.5.2.3.14 |
| Major | | | | | |
| 101 | Safe/Arm switch resistance | | 0.40% | 3.5.3.1 | 4.5.2.3.1 |
| 102 | Lamp test | | 0.40% | | 4.5.2.3.3 |
| 103 | Self test | | 0.40% | | 4.5.2.3.4 |
| 104 | Low voltage detect | | 0.40% | | 4.5.2.3.5 |
| 105 | Load test | | 0.40% | | 4.5.2.3.6 |
| 106 | Arm test | | 0.40% | | 4.5.2.3.7 |
| 107 | Quiescent current | | 0.40% | 3.5.3.2 | 4.5.2.3.8 |
| 108 | Hardwire deploy test | | 0.40% | | 4.5.2.3.10 |
| | EBI pulses | | 0.40% | 3.5.3.3 | 4.5.2.3.10.1 |
| | High voltage supply | | 0.40% | 3.5.3.6 | 4.5.2.3.10.2 |
| | Detonator driver pulse | | 0.40% | 3.5.3.5 | 4.5.2.3.10.4 |
| 109 | Accelerated arm sequence | | 0.40% | | 4.5.2.3.11 |
| 110 | Hardwire deploy reverse polarity | | 0.40% | 3.5.3.6 | 4.5.2.3.12 |
| 111 | RF omnidirectional sensitivity | | 0.40% | | 4.5.2.3.13 |
| | Minimum reception orientation | | 0.40% | 3.5.3.6 | 4.5.2.3.13.1 |
| | Maximum reception orientation | | 0.40% | 3.5.3.6 | 4.5.2.3.13.2 |
| 112 | RF deploy with incorrect group ID | | 0.40% | 3.5.3.6 | 4.5.2.3.16 |
| 113 | RF deploy | | 0.40% | | |
| Minor | None defined | | | | |

NOTES:
1/ Sample size for critical characteristics to be the same as determined for major characteristics. No defects allowed for critical characteristics.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH 4.4.2.58 | TITLE Semiconductor Device, Diode JAN IN5552 | | SHEET 1 OF 1 | | DRAWING NUMBER MIL-S-19500/420 |
|---|---|---|---|---|---|
| | | | | | NEXT HIGHER ASSEMBLY 9333560 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Forward voltage drop | | 0.40% | 3.2 | MIL-STD-750, Method 4011 |
| 102 | Reverse leakage current | | 0.40% | 3.2 | MIL-STD-750, Method 4016 |
| 103 | Solderability (all leads) | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| 104 | JAN marking missing | | 0.40% | 3.2 | Visual |
| 105 | Conformance to MIL-S-19500/420 | | 0.40% | 3.2 | Certification |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.59 | Semiconductor Device, Diode, JAN IN5614 | | | | MIL-S-19500/427 |
| | | | | | NEXT HIGHER ASSEMBLY 9333560 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Foward voltage drop | | 0.40% | 3.2 | MIL-STD-750, Method 4011 |
| 102 | Reverse leakage current | | 0.40% | 3.2 | MIL-STD-750, Method 4016 |
| 103 | Solderability (all leads) | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| 104 | JAN marking missing | | 0.40% | 3.2 | Visual |
| 105 | Conformance to MIL-S-19500/420 | | | 3.2 | Certification |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.60 | Semiconductor Device, Diode, JAN IN5806 | | | | MIL-S-19500/477 |
| | | | | | NEXT HIGHER ASSEMBLY 9333560 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Forward voltage drop | | 0.40% | 3.2 | MIL-STD-750, Method 4011 |
| 102 | Reverse leakage current | | 0.40% | 3.2 | MIL-STD-750, Method 4015 |
| 103 | Solderability (all leads) | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| 104 | JAN marking missing | | 0.40% | 3.2 | Visual |
| 105 | Conformance to MIL-S-19500/477 | | | 3.2 | Certification |
| Minor | | | | | |
| 101 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|---|
| 4.4.2.61 | Capacitor | | | | | MIL-C-39014/2 |
| | | | | | | NEXT HIGHER ASSEMBLY 9333560 |
| CATEGORY | EXAMINATION OR TEST | | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Part Number | Part Value | | | | |
| | M39014-02-1218 | .01 uf, 200V | | | | |
| Critical | None defined | | | | | |
| Major | | | | | | |
| 101 | Capacitance incorrect | | | 0.40% | 3.2 | MIL-STD-202, Method 305 |
| 102 | Leakage current | | | 0.40% | 3.2 | MIL-STD-202, Method 302 |
| 103 | Dissipation factor | | | 0.40% | 3.2 | MIL-STD-202, Method 306 |
| 104 | Leakage voltage | | | 0.40% | 3.2 | MIL-STD-202, Method 208 |
| 105 | Solderability | | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| Minor | | | | | | |
| 201 | Identification and marking | | | 0.65% | | Visual |
| 202 | Poor workmanship | | | 0.65% | 3.14 | Visual |

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-C-64030(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.62 | Resistor, Network | | | | MIL-C-39014/2 |
| | | | | | NEXT HIGHER ASSEMBLY 9333560 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Part Number Part Value | | | | |
| | M39014-02-1218 .01 uf, 200V | | | | |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Resistance (all) incorrect | | 0.40% | 3.2 | MIL-STD-202, Method 303 |
| 102 | Resistance-Temperature characteristic incorrect | | 0.40% | 3.2 | MIL-STD-202, Method 304 |
| 103 | Solderability (all leads) | | 0.40% | 3.6.1 | MIL-STD-202, Method 208 |
| 104 | Evidence of chips, cracks, lead fatigue or other physical damage | | 0.40% | 3.2 | Visual |
| 105 | Approved Part/Vendor verification | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Poor workmanship | | 0.65% | 3.14 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

4.4.3 Testing. Testing is described in the first article and quality conformation inspection "Classification of Defects and Tests" form and in 4.5.2.

4.4.4 Inspection equipment. The inspection equipment required to perform the examination and tests prescribed herein is described in the "paragraph/inspection method" column in the Classification of Defects and Tests forms beginning with paragraph 4.4.2.1. The contractor shall. submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and Section 6.2 herein.

4.5 Dimensional control of molded or plastic parts. In place of the normal sampling and inspections associated with the Classification of Defects, and after a curing time for the parts has been approved (See Note 1), a sample of three (3) parts (as molded) from each cavity shall be fully inspected dimensionally (all dimensions on drawing) to quality a new or reworked cavity for use in production. The molded parts shall carry the individual cavity identification. As a control of each cavity during production, the above quantity of parts from each cavit shall be inspected for at least the defects listed in 4.4.2.1 through 4.4.2.62 after continuous production of each 5,000 parts or at the end of each week, whichever occurs first. If any defective parts are found during qualification of the cavity, the cavity producing the defective part(s) will not be used in production. If any defective parts are found when inspection is performed for the control of the cavity, the cavity producing the defective part(s) shall be removed from production. Further, that portion of production since the last control check shall be returned to the contractor for inspection for each separate type of defect according to MIL-STD-105, using an AQL of 0.40 percent for each major defect and an AQL of 0.65 percent for each minor defect. All cavities removed from production because of some fault, may, after reworking, be returned to production providing they pass the qualification test above. The contractor may request a change of inspection frequency providing he presents objective evidence to the Contracting Officer to substantiate the request. Contractor designs of gages and test equipment required to perform the inspections listed herein shall be submitted in accordance with 4.4.4 and 6.2 herein, to Commander, ARDEC, Dover, New Jersey 07801-5001, ATTN: AMSMC-QAT-I(D) for approval prior to manufacture of equipment. The noted sub-paragraphs identify those items and minimum inspection subject to the requirements of this paragraph.

Note 1: In establishing a curing time, dimensionally check ten (10) parts from each cavity at periodic intervals (e.g. every 30, 60, etc. mins.) until dimensional stability is attained. The curing time will be from the time the part comes out of the mold until dimensional stability is attained. The inspection data used in determining the curing time shall be sent to ARDEC, Dover, New Jersey 07801-5001, ATTN: AMSMC-QAT-M(D). Whenever the following



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

events occur, a new cavity is substituted, an old cavity reworked, the material/cycle time changed, a new curing time shall be established and be approved by the Government.

Note 2: Those features of a part which are subsequently machined or otherwised worked upon to meet its drawing requirements shall be inspected in accordance with the classification of defects.

4.5.1 Test methods and procedures. Test methods used for performance testing parameters described in 4.5.2 including the radio frequency field generation technique, test vectors and test acceleration techniques shall be approved prior to use for product acceptance.

4.5.2 Electronic assembly performance tests. The following subparagraphs describe the performance tests for the MOPMS Control Indicator and its subassemblies, the Radio Frequency Receiver and the Digital Logic Card. Unless otherwise specified, all testing shall be performed at room ambient temperature? humidity and atmospheric pressure.

4.5.2.1 Radio frequency receiver performance tests. This section describes the performance test of the Radio Frequency Receiver, assembly no. 9333040, a subassembly of the Control Indicator.

4.5.2.1.1 Test connections. Unless otherwise specified herein, all test connections, adjustments and manipulations specified for a test shall be retained throughout subsequent tests.

4.5.2.1.1.1 Power source. Set the output of a 0 to 6 volt 100 millamp DC power supply to 0 ± 0.1 volts. Connect the negative terminal to E2 (GND) and E14 (BATGND). Connect the positive terminal to E1 (VRG). Set the output voltage to 5 ± 0.1 volts l

4.5.2.1.1.2 Initial input connections. The initial input connection shall be as listed below.

| INPUT TERMINAL | SIGNAL NAME | CONNECTED TO |
|---|---|---|
| E8 | -HWD | 5± 0.2 V |
| E9 | HWD | 0± 0.2 v |
| E11 | -CLR | 5± 0.2 V |
| E12 | FCL | E7 (DLACK) |
| E15 | MCD1 | open |
| E16 | MCD2 | open |



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:28Z
Check the source to verify that this is the current version before use.

4.5.2.1.2 Fast clock test. Use an oscilloscope to verify compliance of the signal at E7 (DLACK) with requirements specified in paragraph 3.5.1.1.

4.5.2.1.3 Crystal clock test. Use an oscilloscope to verify compliance of the signal at E5 (CLK) with the requirements specified in paragraph 3.5.1.2.

4.5.2.1.4 Coil comparator test. Use a multimeter to verify the outputs at E17 and E18 are as specified in 3.5.1.3.

4.5.2.1.5 Address verify functional test. Momentarily apply 0 ± 0.2 volts, then apply 5 + 0.2 volts at E11 (-CLR). Load a valid field set data (FSD) pattern, as defined on Drawing 9333026, to E15 (MCD1) with respect to E16 (MCD2) as shown in figure 8. Use a multimeter to verify that 5 ± 0.2 volts appears on E4 (DA) when tested as specified in 3.5.1.4.

4.5.2.1.6 Hardwire deploy with FSD test. Apply 0 ± 0.2 volts at E8 (-HWD) and 5 ± 0.2 volts at E9 (HWD). Observe E3 (DEP) and E6 (ADATA) and use a storage scope to verify compliance of the serial data pattern with the requirements specified in paragraph 3.5.1.5.

4.5.2.1.7 Hardwire deploy with no FSD test. Momentarily apply 0 ± 0.2 volts, then apply 5 ± 0.2 volts at E11 (-CLR). Observe E3 (DEP) and E6 (ADATA) and use a storage scope to verify compliance of the serial data pattern with the requirements specified in paragraph 3.5.1.6.

4.5.2.1.8 RF link test. Apply 5 ± 0.2 volts at E8 (-HWD). Apply 0 ± 0.2 volts at E9 (HWD). Momentarily apply 0 ± 0.2 volt, then apply 5 ± 0.2 volts at E11 (-CLR). Load a valid field set data (FSD) pattern, as specified on Drawing 9333026, to E15 (MCD1) with respect to E16 (MCD2) as shown in figure 8. Then, transmit an RF DEPLOY command through the RF link, as specified on Drawing 9333026, to the RF receiver. observe E3 (DEP) and E6 (ADATA) and use a storage scope to verify compliance of each serial data pattern with the requirements specified in paragraph 3.5.1.7.

4.5.2.2 Digital logic card (DLC) performance tests. This section describes the performance test of the DLC, assembly no. 9333560, a subassembly of the Control Indicator.

4.5.2.2.1 Circuit continuity test. Use a multimeter to measure the DC resistance between the terminals listed below and verify that the values are in compliance with the requirements specified in 3.5.2.1.



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:28Z
Check the source to verify that this is the current version before use.

| SIGNAL | FROM | TO |
|---|---|---|
| MCD1 | J1-1 | E53 |
| MCD2 | J1-14 | E54 |
| L1 | E55 | E25 |
| L2 | E56 | E26 |
| DET1 | J1-12 | E1 |
| DET2 | J1-13 | E2 |
| VHV | E10 | E7 |
| VBT | J1-2 | E9 |
| GND | E14 | E20, J1-10, J1-23, J1-15 |
| GND | E14 | J1-24, J1-25, E40, E52 |

4.5.2.2.2 Test connections. Unless otherwise specified herein, all test connections, adjustments and manipulations specified for a test shall be retained throughout subsequent tests.

4.5.2.2.2.1 Loads. Loads shall be connected as described below.

| LOAD | FROM | TO |
|---|---|---|
| 1.5 ohm 2% 1W | DET1 (J1-12) | DET1 (R) (J1-24) |
| 1.5 ohm 2% 1W | DET2 (J1-13) | DET2 (R) (J1-25) |
| See figure 6 | TUBE1 (J1-16) | TUBE1 (R) (J1-3) |
| See figure 6 | TUBE2 (J1-17) | TUBE2 (R) (J1-4) |
| See figure 6 | TUBE3 (J1-18) | TUBE3 (R) (J1-5) |
| See figure 6 | TUBE4 (J1-19) | TUBE4 (R) (J1-6) |
| See figure 6 | TUBE5 (J1-20) | TUBE5 (R) (J1-7) |
| See figure 6 | TUBE6 (J1-21) | TUBE6 (R) (J1-8) |
| See figure 6 | TUBE7 (J1-22) | TUBE7 (R) (J1-9) |
| 150 ohm 2% 2W | BTOK (E12) | VBT (E9) |
| 150 ohm 2% 2W | CTOK (E16) | VBT (E9) |
| 150 ohm 2% 2W | DALT (E15) | VBT (E9) |
| 4400 uf 20% 30 v | CAP+ (E7) | CAP- (E20) |

4.5.2.2.2.2 Power source. Set the output of a 0 to 15 volt 1A DC power source to 0 + 0.1 volt. Connect the negative terminal to E14 (GND) and the positive terminal to E9 (VBT). Then set the output voltage to 13 ± 0.5 volts.

4.5.2.2.2.3 Initial input conditions. The inputs shall initially be connected as described below:

| INPUT TERMINAL | SIGNAL NAME | CONNECTED TO |
|---|---|---|
| E10 | VHV | 0 ± 0.2 volt |
| E41 | DEP | 0 ± 0.2 volt |
| E42 | DA | 0 ± 0.2 volt |
| E43 | CLK | See 4.5.2.2.2.4 |
| E44 | ADATA | 0 ± 0.2 volt |
| E45 | DLACK | See 4.5.2.2.2.4 |
| All Others | | Open |



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:28Z
Check the source to verify that this is the current version before use.

4. 5.2.2.2.4 Clocks. Apply a square wave with a frequency of 478 Khz ± 10%, a logic zero level of 0 ± 0.2 volts and a logic one level of 5 ± 0.3 volts to E43 (CLK) and the E45 (DLACK).

4.5.2.2.3 Logic voltage regulation test. Set the voltage on E9 (VBT) from 10.4 ± 0.1 volts to 14.4 ± 0.1 volts. Use a multimeter to verify that the voltage in both cases on E39 (+5V) is in compliance with the requirements of 3.5.2.2.

4.5.2.2.4 Low voltage detect (LVD) test. Set the voltage on E9 (VBT) **to** 11 ± 0.5 volts, verify that E12 (BTOK) is "ON". Set the voltage on E9 (VBT) to 10.35 ± 0.05 volts. Verify that E12 (BTOK) is "OFF" as specified in 3.5.2.4. Set the voltage on E9 (VBT) to 13 ± 0.5 volts.

4.5.2.2.5 Lamp driver output voltage test.

4.5.2.2.5.1 Data accept test. Apply 5 ± 0.1 volts to E42 (DA). Use a multimeter to measure the "ON" voltage at E12 (BTOK), E16 (CTOK) and E15 (DALT) is "ON" as specified in 3.5.2.4.

4.5.2.2.5.2 Arm test. Remove the ground from E1O (VHV) and apply 0 ± 0.2 volts to E11 (S/A). Use a multimeter to verify that E12 (BTOK), E16 (CTOK) and E15 (DALT) are "OFF" as specified in 3.5.2.4.

4.5.2.2.6 Hardwire input circuit holdoff test. At 285 ± 2 seconds after applying O ± 0.2 volts to E11 (S/A) in 4.5.2.2.5.2, apply a storage scope triggers pulse with an amplitude of 8 ± 0.2 volts and a width of 1 ± 0.1 milliseconds to E18 (HW1) with respect to E17 (HW2). Use a multimeter to verify that the voltage at E47 (HWD) is 0 ± 0.2 volts and the voltage at E46 (-HWD) is 5.2 ± 0.3 volts. Use the storage scope to verify that the waveform at E50 (-FCL) meets the requirements specified in 3.5.2.8.

4.5.2.2.7 Hardware input circuit deploy test. At 315 ± 2 seconds after applying O + 0.2 volts to E11 (S/A) in 4.5.5.2.5.2, apply **a storage scope** triggers pulse with an amplitude of 8 ± 0.2 volts and a width of 1 ± 0.1 milliseconds to E18 (HW1) with respect to E17 (HW2). Use a multimeter to verify that the voltage at E47 (HWD) is 5.2 ± 0.3 volts and the voltage at E46 (-WD) is 0.2 ± 0.2 volts. Use the storage scope to verify that the waveform at E50 (-FCL) meets the requirements specified in 3.5.2.10. vertify the following responses.

4.5.2.2.8 Deploy test. Apply the ADATA/DEP waveform of figure 7 with a dummy address FSD pattern as described on Drawing 9333026 to E44 (ADATA) and E41 (DEP) simultaneously. Use a storage scope to verify the following responses.

4.5.2.2.8.1 EBI pulses. With the EBI test load specified in 4.5.2.2.2.1 applied, verify that the EBI waveforms specified in 3.5.2.7 appear at the tube driver outputs.



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:28Z
Check the source to verify that this is the current version before use.

4.5.2.2.8.2 High voltage supply test. At 20 ± 10 seconds after the ADATA/DEP waveform of figure 7 is applied, verify that the voltage on E10 (VHV) is in compliance with the requirements of 3.5.2.10.

4.5.2.2.8.3 FSD pattern. With the FSD test loads specified in 4.5.2.2.2.1 applied, verify that the FSD sequence specified in 3.5.2.8 appears at the tube driver outputs.

4.5.2.2.8.4 Detonator driver pulse. With the DET test loads specified in 4.5.2.2.2.1 applied, verify that the waveforms at J1-12 (DET1) with respect to J1-24 (DET1(R)) and J1-13 (DET2) with respect to J1-14 (DET2(R)) meet the requirements of 3.5.2.9.

4.5.2.2.9 Accelerated arm sequence test.

4.5.2.2. 9.1 Safe test. Apply O ± 0.2 volt to E44 (ADATA) and E41 (DEP). Momentarily apply O ± 0.2 volt, then apply 5 ± 0.2 volts to E11 (-CLR). Apply 0 ± 0.2 volt to E10 (VHV) through a 51 ohm ± 5% resistor. Apply O ± 0.2 volt to E42 (DA) and an open to E11 (S/A). Use a multimeter to verify that E12 (BTOK), E16 (CTOK) and E15 (DALT) are ‘OFF” as specified in 3.5.2.4.

4.5.2.2.9.2 Self test. Set the voltage on E9 (VBT) to 13 ± 0.5 volts. Use a multimeter to verify that E15 (DALT) is “OFF” and that E12 (BTOK) and E16 (CTOK) are “ON” as specified in 3.5.2.4.

4.5.2.2.9.3 Load and accelerated safe separation test. Apply O ± 0.2 volts to E3 (TP3). Then, apply 5 ± 0.1 volts to E42 (DA). Verify that E12 (BTOK), E15 (DALT) and E16 (CTOK) and E15 (DALT) are ‘OFF” as specified in 3.5.2.4.

4.5.2.2.9.4 Arm test. Remove the connection to E10 (VHV). Apply O + 0.2 volt to E11 (S/A). After 10 seconds, remove the connection to E3 (TP3). Verify that E12 (BTOK), E16 (CTOK) and E15 (DALT) are “OFF” as specified in 3.5.2.4.

4.5.2.2.10 Hardwire input circuit reverse polarity test. Apply a pulse with an amplitude of -8 ± 0.2 volts and a width of 1 + 0.1 milliseconds to E18 (HW1) with respect to E17 (HW2). Use a multimeter verify that the voltage at E47 (HWD) is 5 ± 0.3 volts and the voltage at E46 (-HWD) is 0.2 ± 0.2 volts as specified in 3.5.2.12.

4.5.2.3 Control indicator performance tests. This section describes the performance test of the Control Indicator, assembly no. 9333036.

4.5.2.3.1 SAFE/ARM Switch resistance test. With no other connections to the Control Indicator use a multimeter to measure the DC resistance between the points listed below with the SAFE/ARM switch in the positions specified in 3.5.3.1. Verify that the measured values are in compliance with the requirements specified in 3.5.3.1.



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:28Z
Check the source to verify that this is the current version before use.

| FROM | TO |
|---|---|
| J1-12 | J1-24 |
| J1-13 | J1-25 |
| J1-23 | A1A2E10 |
| J1-23 | A1A2E25 |
| J1-23 | A1A2E26 |
| Casting* | A1A2E20 |

4.5.2.3.2 Test Connections. Unless otherwise specified herein, all test connections, adjustments and manipulations specified for a test shall be retained throughout subsequent tests.

4.5.2.3.2.1 Loads. Connect loads as indicated below:

| LOAD | FROM | To |
|---|---|---|
| 1.5 ohm 2% 1W | DET1 (J1-12) | DET1 (R) (J1-14) |
| 1.5 ohm 2% 1W | DET2 (J1-13) | DET1 (R) (J1-15) |
| See figure 6 | TUBE1 (J1-16) | TUBE1 (R) (J1-3) |
| See figure 6 | TUBE2 (J1-17) | TUBE2 (R) (J1-4) |
| See figure 6 | TUBE3 (J1-18) | TUBE3 (R) (J1-5) |
| See figure 6 | TUBE4 (J1-19) | TUBE4 (R) (J1-6) |
| See figure 6 | TUBE5 (J1-20) | TUBE5 (R) (J1-7) |
| See figure 6 | TUBE6 (J1-21) | TUBE6 (R) (J1-8) |
| See figure 6 | TUBE7 (J1-22) | TUBE7 (R) (J1-9) |

4.5.2.3.2.2 Power source. Rotate the SAFE/ARM Switch clockwise to the SAFE position. Set the output of a 0 to 15 volt 1 amp DC power supply to 13 ± 0.5 volts. Connect the negative terminal to P1-BLK (COMMON) and then the positive terminal to Pi-RED (+14.4 VDC).

4.5.2.3.3 Lamp test. Press each of the three indicator lights on the Control Indicator front panel: BATT OK, CKT OK and DATA IN. Verify that each light is illuminated when depressed and not illuminated when released.

4.5.2.3.4 Self test. Rotate the SAFE/ARM switch clockwise to the TEST position. Verify that the BATT OK and CKT OK lights are on within 4 seconds.

4.5.2.3.5 Low voltage detect (LVD) test. Reduce the voltage at Pi-RED (+14.4 VDC) to 11.05 ± 0.05 volts. Verify that the BATT OK light is on. Reduce the voltage at Pi-RED (+14.4 VDC) to 10.35 ± 0.05 volts. Verify that the BATT OK light is off. Increase the voltage at Pi-RED (+14.4 VDC) to 13 ± 0.5 volts.

4.5.2.3.6 Load test. Rotate the SAFE/ARM Switch clockwise to the load position. Load a valid field set data (FSD) pattern, as defined on Drawing 9333026, into the Control Indicator by applying the pattern to J1-1 (MCD1) with respect to J1-14 (MCD2) as shown in figure 8. Verify that the DATA IN light turns on.



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:28Z
Check the source to verify that this is the current version before use.

4.5.2.3.7 Arm test. Depress and rotate the SAFE/ARM Switch clockwise to the ARM position. Verify that the BATT OK, CUT OK and DATA IN lights turn off. Use a multimeter to verify that the voltage on Q23 anode (VHV) is less than 0.5 volt.

4.5.2.3.8 Quiescent current test. Within 283 seconds after placing the SAFE/ARM Switch in the ARM position, use a multimeter. to measure the current flowing into P1-RED (+14.4 VDC) with the voltage set to 13 ± 0.5 V. Verify that the measured value is in compliance with the requirement specified in 3.5.3.2.

4.5.2.3.9 Premature hardwire deploy test. At 285 ± 2 seconds after placing the SAFE/ARM Switch in the ARM position, use a storage scope to apply a pulse with an amplitude of 8 ± 0.2 volts and a width of 1 ± 0.1 millisecond to E1 (HW1) with respect to E2 (HW2). After 7 seconds, use a multimeter verify that the voltage at Q23 anode (VHV) is less than 0.5 volt.

4.5.2.3.10 Hardwire deploy test. At 315 ± 2 seconds after placing the SAFE/ARM Switch in the ARM position, use a storage scope to apply a pulse with an amplitude of 8 ± 0.2 volts and a width of 1 + 0.1 millisecond to E1 (HW1) with respect to E2 (HW2) l Verify the following responses.

4.5.2.3.10.1 EBI pulses. Witht the EBI test loads specified in 4.5.2.3.2.1 applied, use a storage scope to verify that the EBI waveforms specified in 3.5.3.3 appear at the tube driver outputs.

4.5.2.3.10.2 High voltage supply test. At 20 + 10 seconds after the pulse of 4.5.2.3.10 is applied, use a multimeter to verify that the voltage on Q23 anode (VHV) is in compliance with the requirements of 3.5.3.6.

4.5.2.3.10.3 FSD patten. With the FSD test loads specified in 4. 5.2.3.2.1 applied, use a storage scope to verify that the FSD sequence specified in 3.5.3.4 appears at the tube driver outputs.

4.5.2.3.10.4 Detonator driver Pulse. With the DET test loads specified in 4.5.2.3.2.1 applied, verify that the waveforms at J1-12 (DET1) with the respect to J1-24 (DET (R)) and J1-13 (DET2) with respect to J1-25 (DET2(R)) meet the requirements of 3.5.3.5.

4.5.2.3.11 Accelerated arm sequence. Rotate the SAFE/ARM switch clockwise to the SAFE position. Afer 5 seconds, rotate the SAFE/ARM switch clockwise to the TEST position. Verify that the BATT OK and CKT OK lights turn on. Connect A2E3 (TP3 on the Digital Logic Card) to ground and rotate the SAFE/ARM switch clockwise to the LOAD position. Load a valid FSD pattern, as defined on Drawing 9333026, into the Control Indicator by applying the pattern to J1-1 (MCD1) with respect to J1-14 (MCD2) as shown in figure 8. Verify that the DATA IN light turns on. Depress and rotate the SAFE/ARM switch to the ARM position. After 10 seconds, remove the ground from A2E3 (TP3 on the DLC). Verify that the BATT OK, CKT OK and DATA In lights are off.



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:28Z
Check the source to verify that this is the current version before use.

4.5.2.3.12 Hardwire deploy reverse polarity test. Use a storage scope to apply a pulse with an amplitude of -8 + 0.2 volts and a width of 1 ± 0.1 millisecond to El (HW1) with respect to E2 (HW2). After 10 seconds, use a voltmeter verify that the voltage at Q23 anode (VHV) meets the requirements of 3.5.3.6.

4.5.2.3.13 RF omnidirectional sensitivity test. Rotate the SAFE/ARM switch clockwise to the SAFE position. Prior to performing the following tests, a battery having a minimum output voltage of 12 volts and a minimum output current capacity of 1 ampere may be substituted for the DC power supply specified in 4.5.2.3.2.2. If this substitution is desired, disconnect the external power source from Pi-RED (+14.4 VDC) , then P1-BLK (COMMON). Connect the battery negative terminal to P1-BLK (COMMON) and then the positive terminal to P1-RED (+14.4 VDC).

4.5.2.3.13.1 Minimum reception orientation test. Perform the accelerated arm sequence specified in 4.5.2.3.11. Use a multimeter to verify that the voltage on Q23 anode (VHV) is less than 0.5 volts. While transmitting a continuous biphase FSK signal to the Control Indicator via the RF link at the Maximum Field Strength as specified on Drawing 9333026, rotate the Control Indicator about its verical axis ( the line extending through the center of the top and bottom of the Control Indicator assembly) until the 455 kHz frequency component of the signal at A1-U3-10 (IFIN pin of the front end RF amplifier on the RF Receiver card) with respect to J1-23 (GND) is minimized. While maintaining this Control Indicator orientation, transmit an RF DEPLOY command at the Minimum Required Field Strength as specified on Drawing 9333026. Use a multimeter to verify that the voltage on Q23 anode (VHV) meets the requirements of 3.5.3.6.

4.5.2.3.13.2 Maximum reception orientation test. Perform the accelerated arm sequence specified in 4.5.2.3.11. Use a multimeter to verify that the voltage on Q23 anode (VHV) is less than 0.5 volt. While transmitting a continuous biphase FSK signal to the Control Indicator via the RF link at the Maximum Field Strength as specified on Drawing 9333026, rotate the Control Indicator about its verical axis until the 455 kHz frequency component of the signal at A2-U3-10 is maximized. While maintaining this Control Indicator orientation, transmit an RF DEPLOY command at the Minimum Required Field Strength as specified on Drawing 9333026. Use a multimeter to verify that the voltage on Q23 anode (VHV) meets the requirements of 3.5.3.6.

4.5.2.3.14 Premature RF deploy test. Rotate the SAFE/ARM switch clockwise to the SAFE position. After 5 seconds, rotate the SAFE/ARM switch clockwise to the TEST position. Verify that the BATT OK and CKT OK lights turn on. Rotate the SAFE/ARM switch clockwise to the LOAD position. Load a valid FSD pattern, as defined on Drawing 9333026, into the Control Indicator by applying the pattern to J1-1 (MCD1) with respect to J1-14 (MCD2) as shown in figure 8. Verify that the DATA IN lights turns on. Depress



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

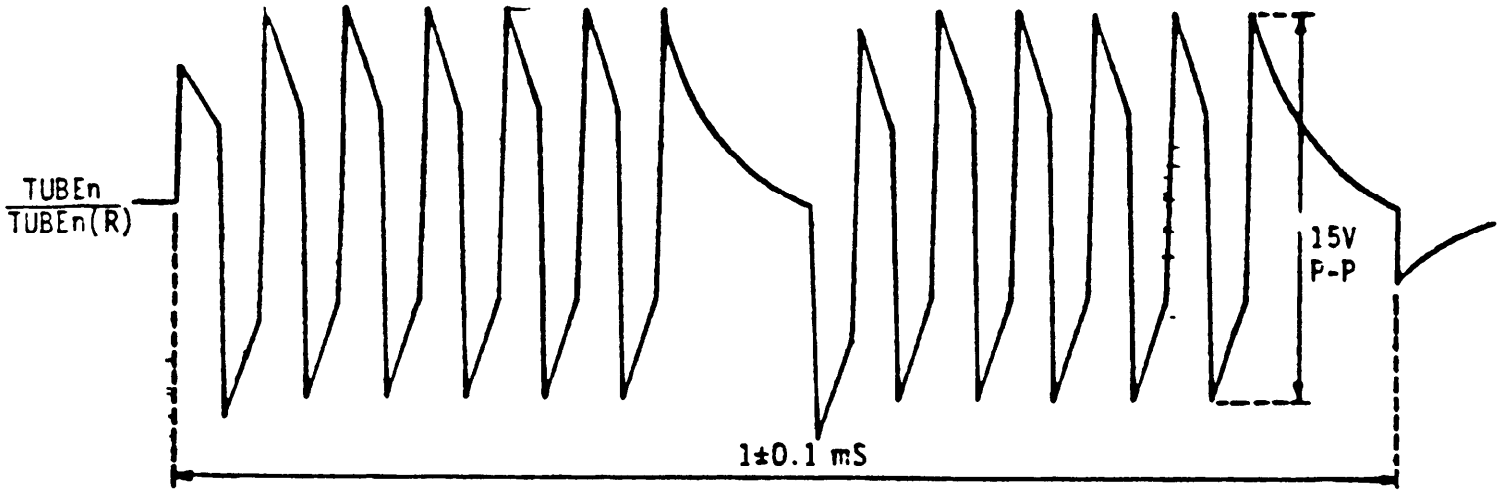



Figure 1. Typical EBI Burst Characteristics

Note: The energy transferred to the EBI load resistors during an EBI burst may be determined by application of the following equations:

$$W = \frac{k}{R_L}\int V^2\,dt \text{ or approximate } W = \frac{k\Delta t}{R_L}\sum_{n=1}^{m} V_n^2$$

where W is the energy in ergs, k is a unit conversion constant (1E7 ergs/joule), $\Delta t$ is the sample period in seconds, m is the total number of samples and V is the voltage in volts measured across $R_L$, the EBI load resistance in ohms


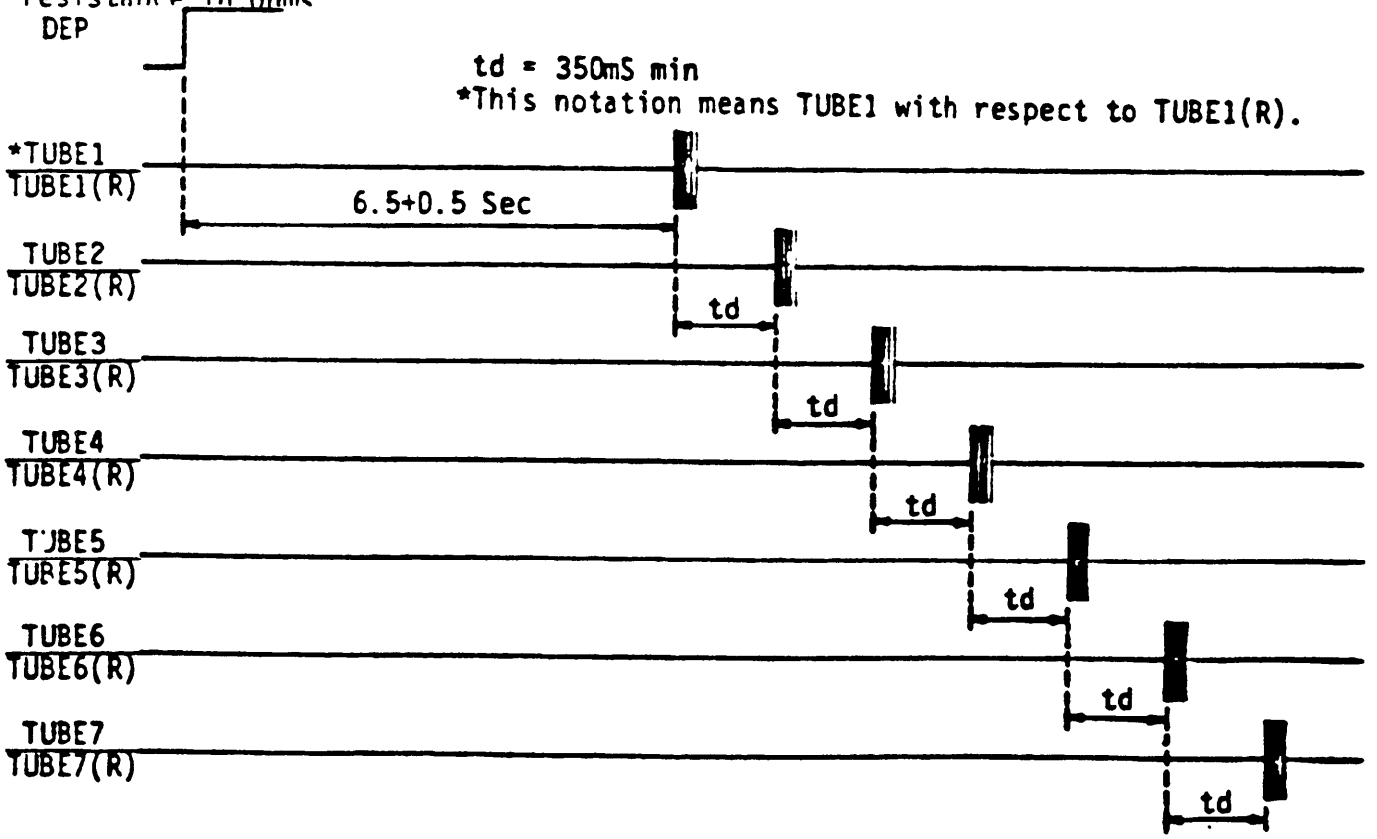



FIGURE 2. Typical EBI Sequence Timing




Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

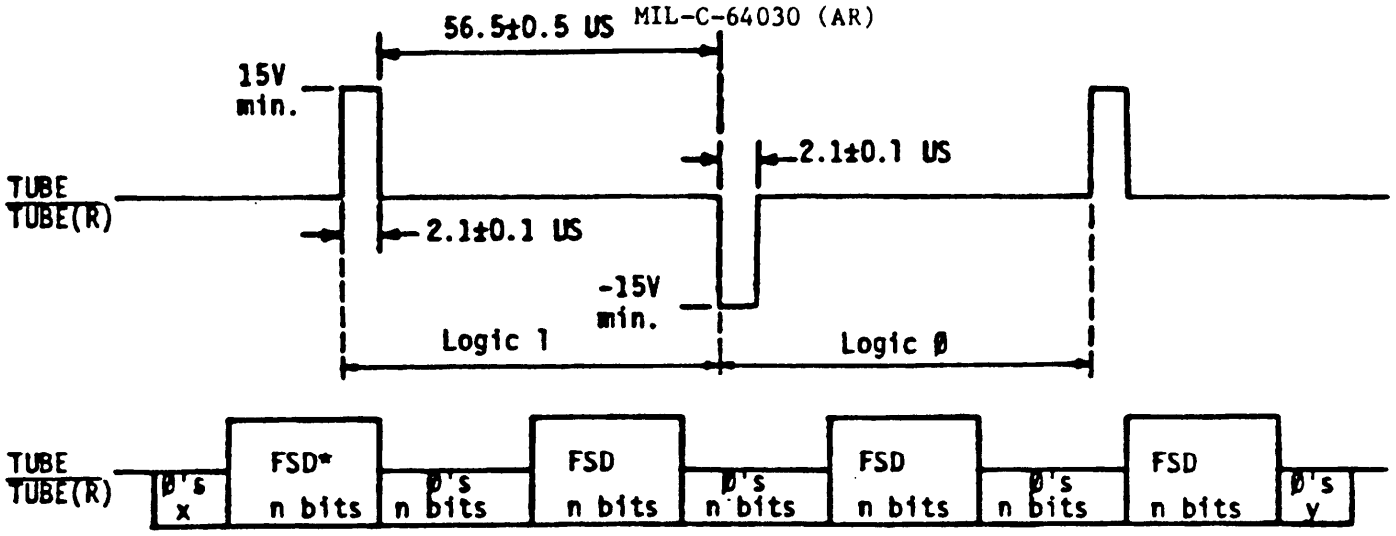


*The FSD sequence is composed of 4 repetitions of an n bit FSD pattern separated by n zeros. The FSD pattern may either be a valid field set data pattern or a dummy address pattern. The first FSD pattern is preceded by x zeros and the last FSD pattern is followed by y zeros. The value of x and y is 20 minimum. The value of n and a detailed description of FSD patterns is given on Drawing 9333026.

Figure 3. Tube Driver Output and FSD Sequence Characteristics

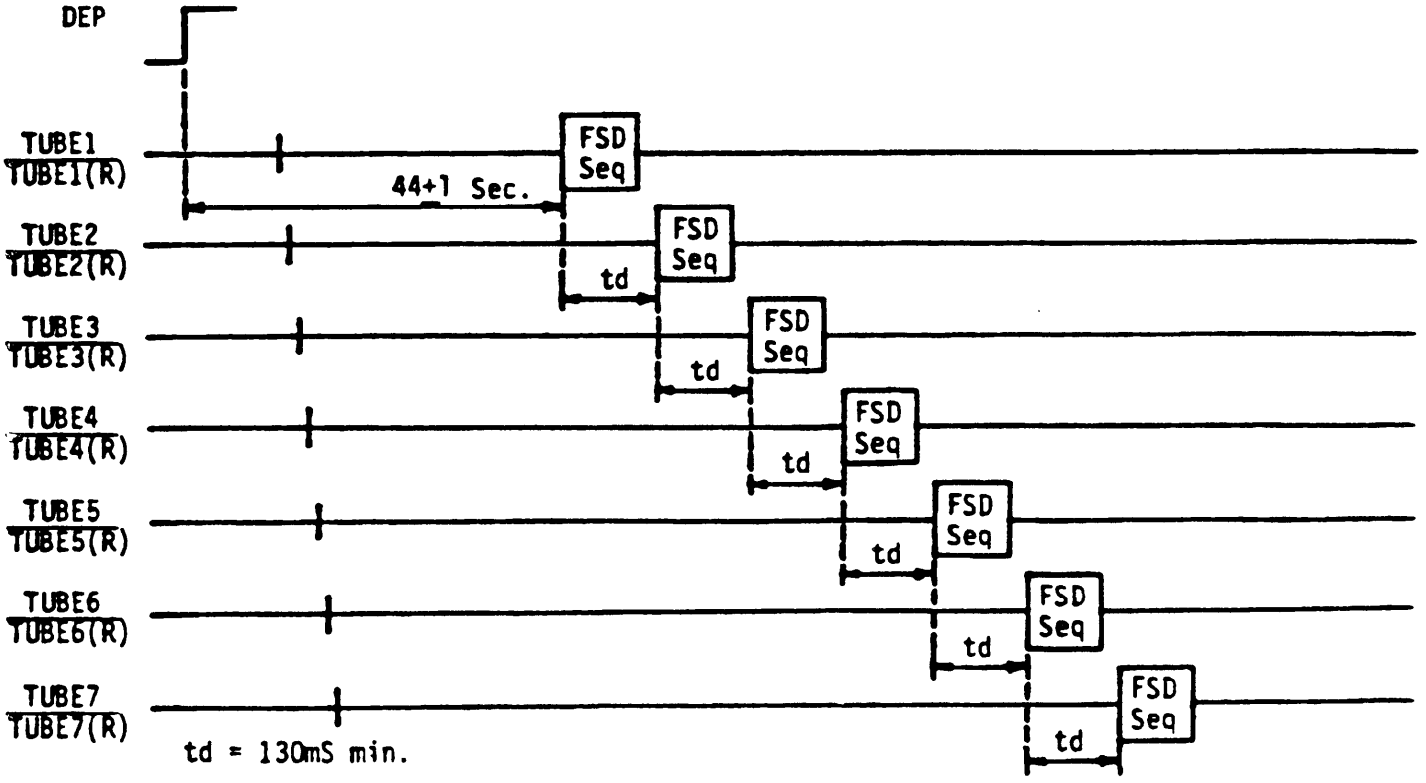


*Each FSD sequence consists of 4 FSD patterns separated by zeros as shown in Fig.3

Figure 4. FSD Sequence Timing



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

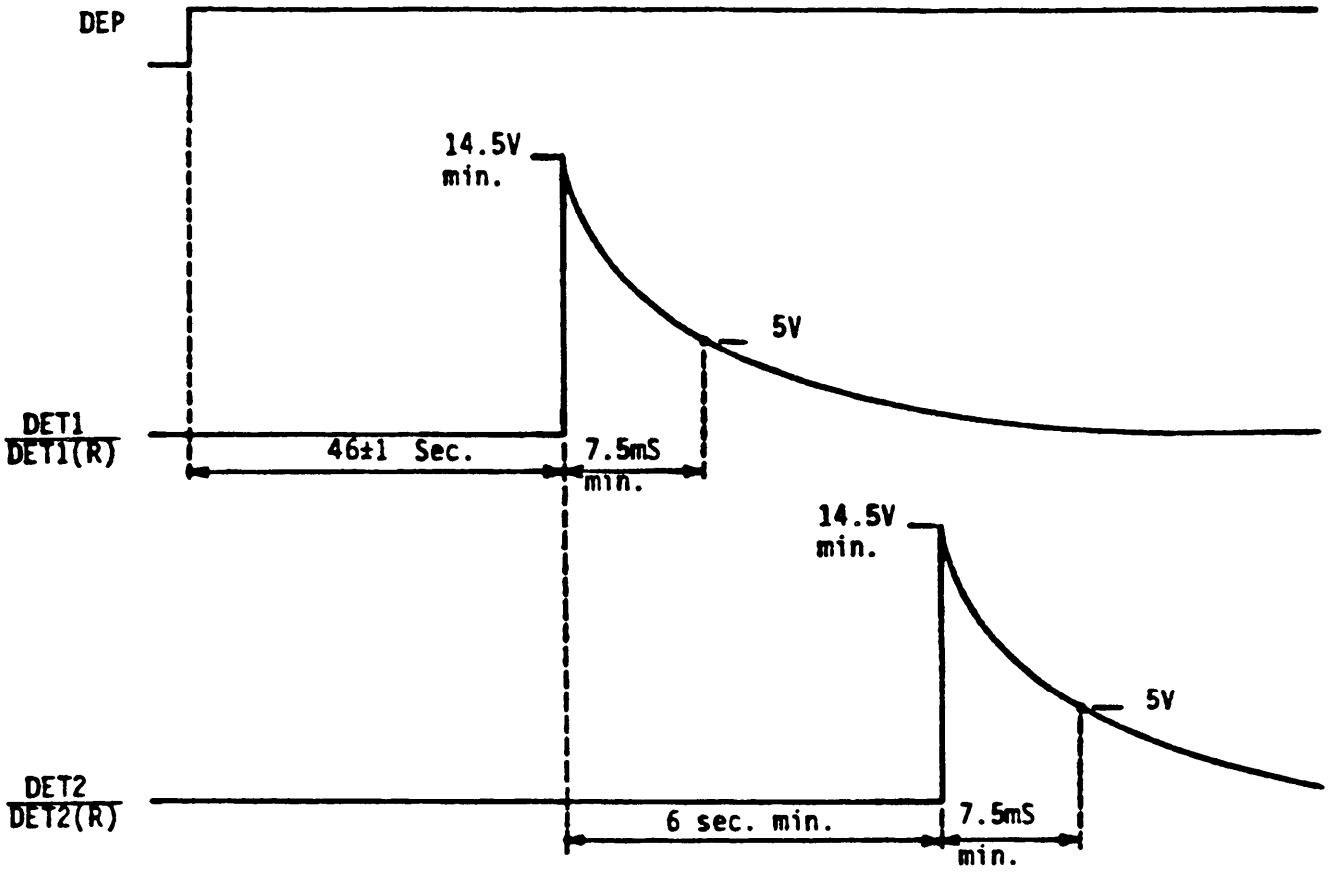



Figure 5. Detonator Pulse Characteristics



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:28Z
Check the source to verify that this is the current version before use.


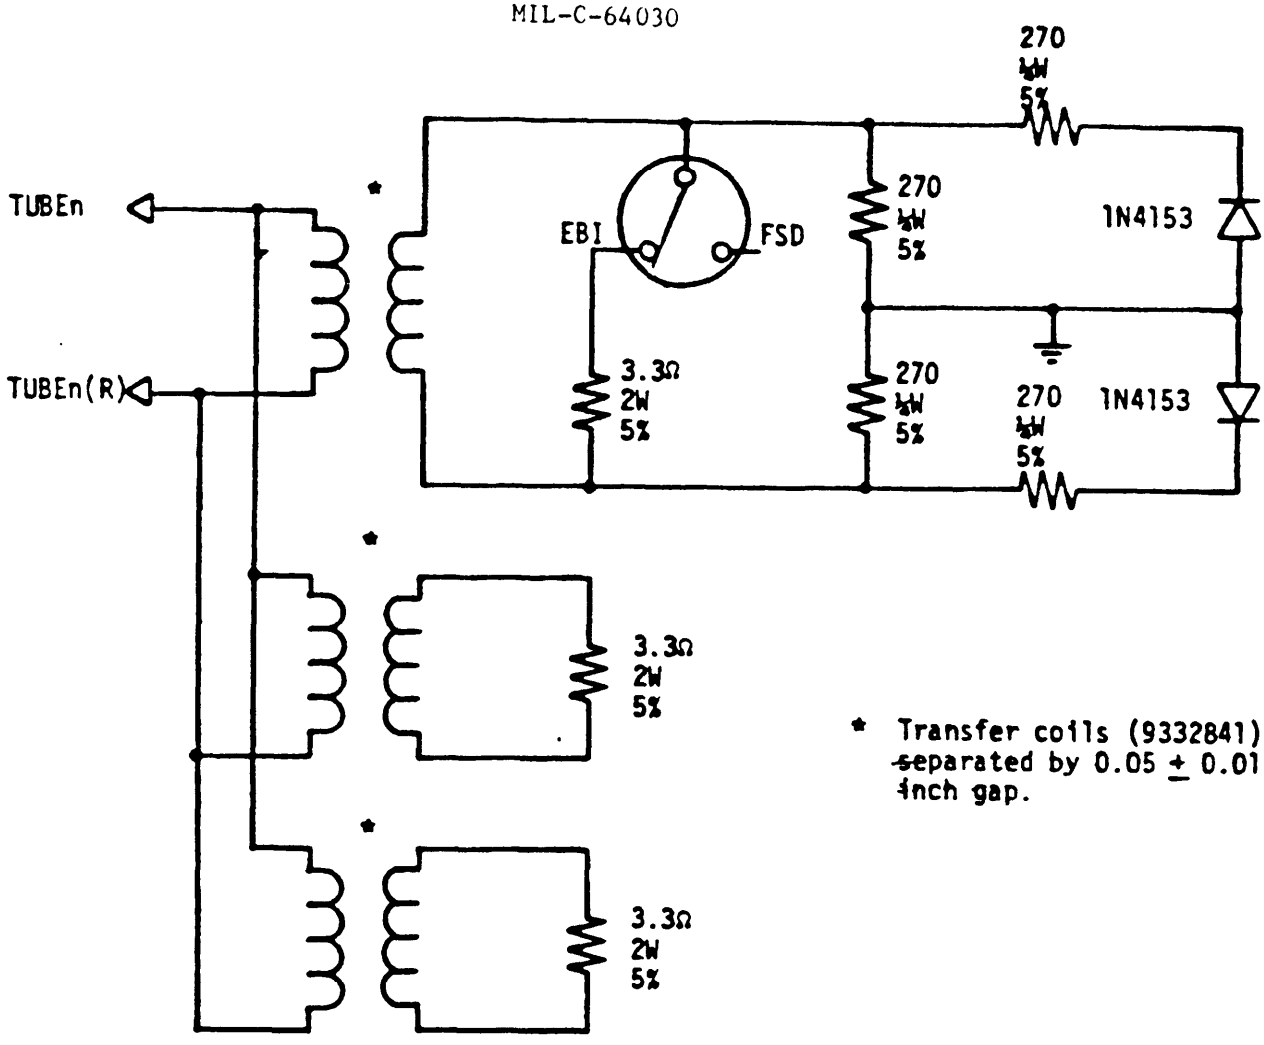



Figure 6. Tube Driver Output Load Circuit



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

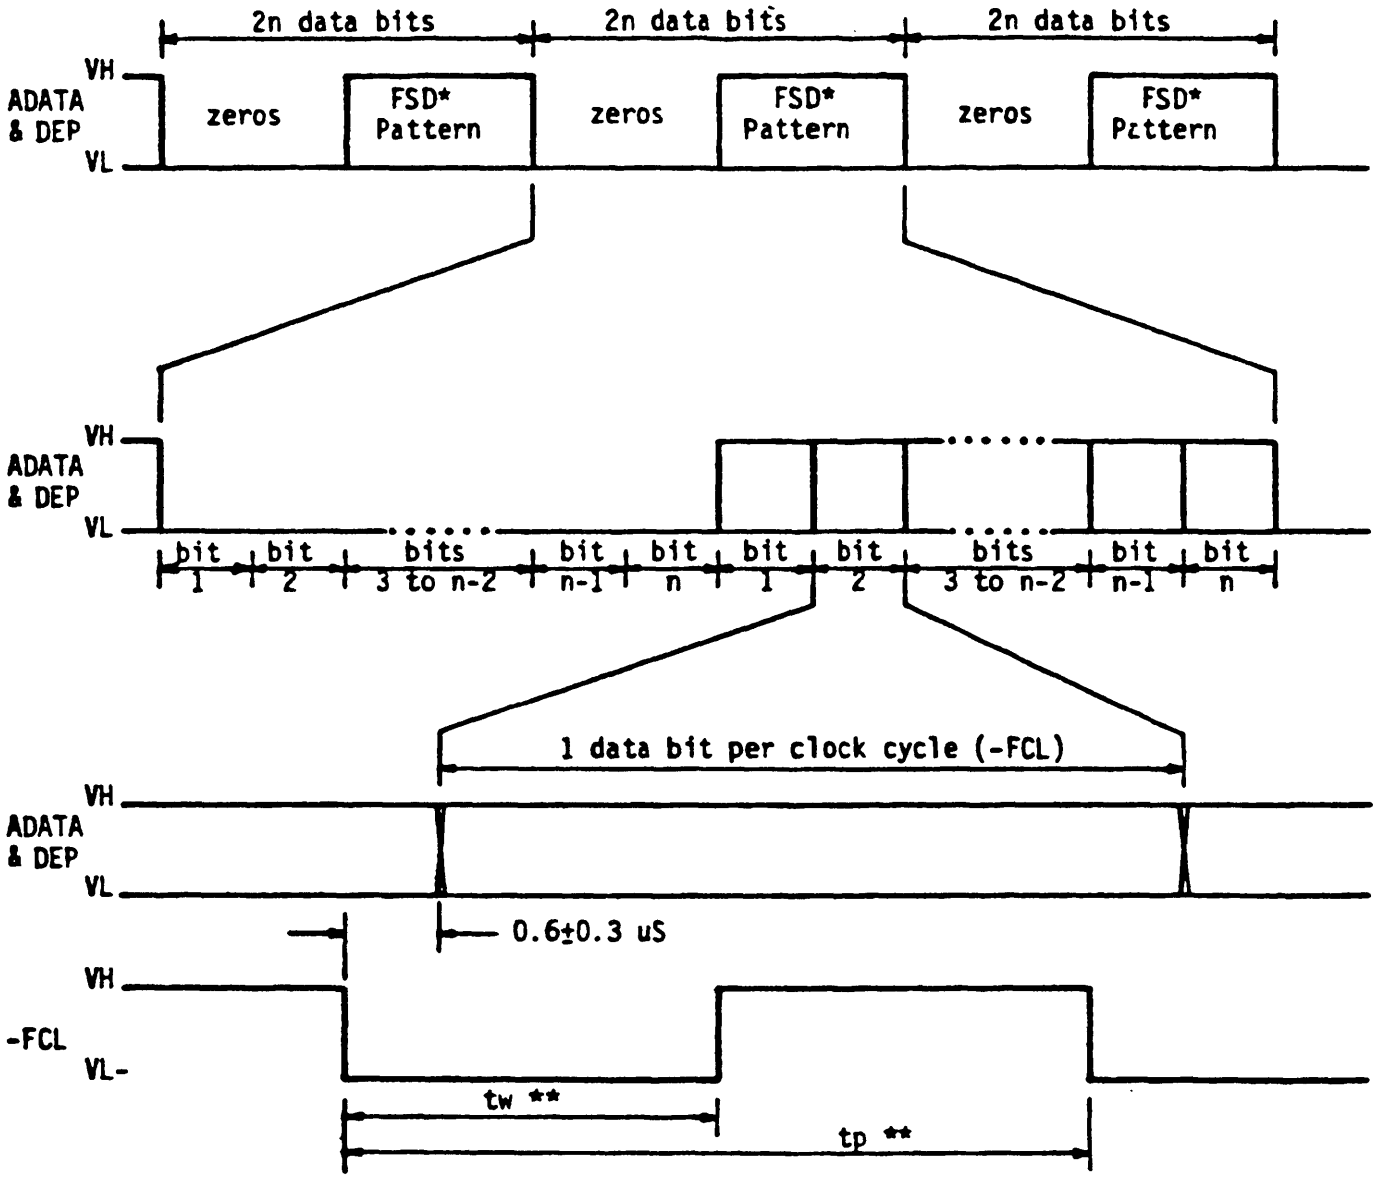


VH = 5+0.2/-1 VDC, VL = 0+1/-0.2 VDC

*A detailed description of FSD Patterns including the value of n is given on Drawing 9333026.


**Digital Logic Card: tp = 67±7 uS, tw = 33±8 uS

**RF Receiver Card: tp = 8.4±0.9 uS, tw = 4.2±1 uS

Figure 7. DEP, ADATA and -FCL waveforms



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:28Z
Check the source to verify that this is the current version before use.

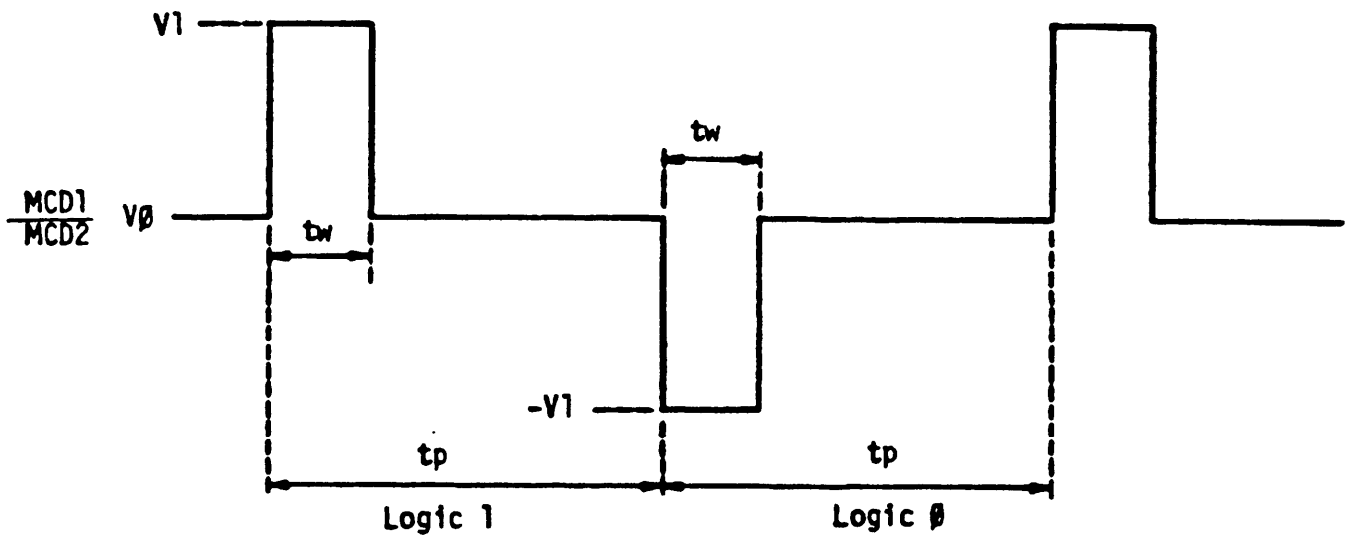


VØ = 0 ± 0.1V
V1 = 1 ± 0.3V
tw 5 ± 1 us
tp 1 ± 0.1 ms

Figure 8. MCD Waveform



Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

and rotate the SAFE/ARM switch clockwise to the ARM position. Verify that the BATT OK, CKT OK and DATA IN lights turn off. At 285 ± 2 seconds after placing the SAFE/ARM switch in the ARM position, transmit an RF DEPLOY command at the Maximum Field Strength via the RF link as specified on Drawing 9333026, to the Control Indicator. After 7 seconds, use a multimeter to verify that the voltage at Q23 anode (VHV) is less than 0.5 volt.

4.5.2.3.15 RF deploy with incorrect group ID. At 315 ± 2 seconds after placing the SAFE/ARM switch in the ARM position, transmit an RF-DEPLOY command at the Maximum Field Strength via the RF link as specified on Drawing 9333026 to the Control Indicator, with a group ID which does not match the one coded in the FSD pattern previously loaded into the Control Indicator. After 7 seconds, use a multimeter to verify that the voltage at Q23 anode (VHV) is less than 0.5 volt.

4.5.2.3.16 RF deploy test. Via the RF link to the Control Indicator, transmit an RF DEPLOY command with the same group ID as the one coded in the FSD pattern previously loaded into-the-Control Indicator. After 10 seconds, use a multimeter to verify that the voltage at Q23 anode (VHV) meets the requirements of 3.5.3.6.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1 Packaging. The Control Indicator shall be preserved and packaged in accordance with MIL-E-17555. The units shall be packed in a corrugated fiberboard tray or box fitted with partitions and separators as required to keep the unit separate. Cushioning as needed shall be used, the fiberboard trays or box shall be sealed in a barrier bag conforming to Type I or Class F', Style I, of MIL-B-117. Material used to fabricate the barrier bag must include metal foil. The packaging materials shall not contain silicones, sulphur compounds of polysulphides. The packaging requirements shall meet the ESD protection requirements of DOD-STD-16860

5.2 Packing. The Control Indicator in box and barrier bag shall be packaged in accordance with Level B of MIL-P-14232 and Code of Federal Regulations Title 49, with the following mandatory requirements: The outer packing box shall be wood conforming to class 1, Style 4 of PPP-B-621 or fiberboard conforming to Spec. 12H, 23F or 23H of Code of Federal Regulation Title 49. Sufficient cushioning and separator must be used between the barrier bag and outer box to prevent damage to the items or tearing of the barrier bag.

5.3 Marking. The marking of the outer box shall be in accordance with MIL-STD-129, and DOT marking per Code of Federal Regulation Title 49. Marking indicating the components are sensitive electronics devices and caution shall be employed.

5.4 Shipping. When Control Indicator assemblies from more than one lot are shipped at one time, each lot shall be kept separate and the division between lots clearly indicated to prevent mixing the lots in transit.

6. NOTES

6.1 Ordering data. See MIL-A-48078.

6.2 Submission of inspection equipment designs for approval. (See MIL-A-48078) Submit equipment designs as required to: Commander, U.S. Army Armament Research, Development and Engineering Center (ARDEC), ATTN: AMSMC-QAT-I(D), Dover, N.J. 07801-5001.

6.3 Distribution of ammunition data cards, inspection and test results. Distribution of ammunition data cards, inspection and test results shall include Commander: ARDEC, Dover, N.J. 07801-5001, ATTN: AMSMC-QAT-M(D).

6.4 Subject term (key words) listing
Circuit Cards
Control Indicators
Field Set Data
Radio frequency Receiver
Stress Screening


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

6.5 Drawings. Drawings listed in Section 2 of this specification under the heading U.S. Army Armament Research, Development and Engineering Center (ARDEC) may also include drawings prepared by and identified as U.S. Army Armament Research and Development Command (ARRADCOM), Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal, or Picatinny Arsenal drawings. Technical data originally prepared by these activities is now under the cognizance of ARDEC.

Custodians:
Army - AR

Preparing activity:
Army - AR

(Project 1345-A242)



Source: https://assist.dla.mil -- Downloaded: 202610-26T04:28Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

**INSTRUCTIONS:** In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

*NOTE:* This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

*(Fold along this line)*

*(Fold along this line)*

DEPARTMENT OF THE ARMY

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

**OFFICIAL BUSINESS**
PENALTY FOR PRIVATE USE $300

**BUSINESS REPLY MAIL**
FIRST CLASS PERMIT NO. 12062 WASHINGTON D C.
POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

COMMANDER
U S ARMY ARMAMENT MUNITIONS & CHEMICAL COMMAND
ATTN: AMSMC-QA
DOVER, NJ 07801 5001

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:28Z
Check the source to verify that this is the current version before use.

# STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

*(See Instructions – Reverse Side)*

| 1. DOCUMENT NUMBER | 2. DOCUMENT TITLE |
|---|---|
| MIL-C-64030 | CONTROL, INDICATOR, FOR DISPENSER AND MINES" GROUND M131 |

| 3a. NAME OF SUBMITTING ORGANIZATION | 4. TYPE OF ORGANIZATION *(Mark one)* |
|---|---|
| | ☐ VENDOR |
| b. ADDRESS *(Street, City, State, ZIP Code)* | ☐ USER |
| | ☐ MANUFACTURER |
| | ☐ OTHER *(Specify)*: _____ |

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

| 7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional | b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional |
|---|---|
| c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional | 8. DATE OF SUBMISSION *(YYMMDD)* |

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:28Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:28Z
Check the source to verify that this is the current version before use.