MILITARY SPECIFICATION

DISPENSER, MINE: M138 (FLIPPER)

This specification is approved for use within the U.S. Army Armament, Munitions and Chemical Command, and is available for use by all the Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification provides requirements and quality assurance provisions for fabrication of parts, and assembly of the M138, Mine Dispenser, used for dispensing M74 AP, M75 AT and M79 Practice Mines.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. The following specifications and standards form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDFERAL

TT-C-490	- Cleaning Methods and Pretreatment of Ferrous Surfaces for Organic Coatings

MILITARY

MIL-C-44223	- Cover, Protective, Mine Dispenser.
MIL-W-45205	- Welding, Gas Metal Arc and Gas Tungsten Arc, Aluminum Alloys, Readily Weldable for Structure, Excluding Armor.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, U.S. Army Armament Munitions and Chemical Command, Attn. AMSMC-QA, Picatinny Arsenal, New Jersey 07806-5000 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A
FSC 1345
DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

MIL-W-63150 - Weapons and Support Materiel, Standard Quality Assurance Provisions for.
MIL-P-70624 - Power Box Components Assembly, Electronics Box Components Assembly, Cable Assemblies and Transmitter Assembly for Mine Dispenser: M138 (FLIPPER).
MIL-C-70627 - Container, Shipping and Storage: PA122.

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes (ABC-STD-105).
MIL-STD-810 - Environmental Test Methods and Engineering Guidelines.

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

DRAWINGS (See 6.5)

U.S. ARMY ARMAMENT RESEARCH, DEVELOPMENT AND ENGINEERING CENTER (ARDEC)

9359799 - Dispenser, Mine: M138
9359924 - Test Mine Assembly
9317994 - Mine, Antitank, Practice: M79
9399999 - Chemical Agent Resistant Coatings (CARC)
9378330 - Packing and Marking for Shipping and Storage Container: PA122, for Dispenser, Mine: M138

TECHNICAL MANUALS

TM9-1095-201-10 - Dispenser, Mine, M138 (FLIPPER), Operators Manual for.

(Copies of specifications, standards, drawings, and publications required by contractors in connection with specific procurement functions should be obtained from the contracting activity or as directed by the contracting activity).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

2.2 Order of precedence. In the event of a conflict between the text of this standard and the references cited herein (except for associated detail specifications, specification sheets or MS standards), the text of this standard shall take precedence. Nothing in this specification, however, shall supersede shall supersede applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Material. Material shall be in accordance with applicable drawings and specifications.

3.2 Components and assemblies. The components and assemblies shall comply with all requirements specified on Drawing (Dwg) 9359799 and associated drawings.

3.3 Arming and dispensing. The M138 Mine Dispenser shall arm and dispense the M74 and M75 mines and dispense the M79 mine, when tested as specified in 4.5.1.

3.3.1 Light functions

3.3.1.1 Ready light function. The ready light shall come on when the switch is in the normal or extended mode. The light shall go off after each launching and shall come back on in less than ten (10) seconds after launch as specified in 4.5.1. The ready light shall alternately dim and brighten when the ready light is depressed. The light shall come on when the fail light is depressed for the self check. The light shall not come on when tested as specified in 4.5.1.1.1.

3.3.1.2 Fail light function. The fail light shall not come on when the dispenser is tested as specified in 4.5.1. The light shall come on when it is depressed for the self-check and when tested as specified in 4.5.1.1.2.

3.3.2 Ambient temperature ($75^{o}F \pm 10^{o}F$). After conditioning as specified in 4.5.1.2 the dispenser shall meet the requirements as specified in 3.3.

3.3.3 Cold temperature ($-25^{o}F - 5^{o}F$). After conditioning as specified in 4.5.1.3, the dispenser shall meet the requirements as specified in 3.3.

3.3.4 Hot temperature ($120^{o}F + 5^{o}F$). After conditioning as specified in 4.5.1.4, the dispenser shall meet the requirements as specified in 3.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

3.3.5 Transportation vibration. After the dispenser is subjected to vibration as specified in 4.5.1.5, the dispenser shall meet the requirements as specified in 3.3.

3.3.6 Distance launched. The dispenser shall launch the mine the minimum distance at impact of 80 feet when measured as specified in 4.5.1.6.

3.4 SD setting (Test Mine Ass'y. Dwg. 9359924).

3.4.1 Normal setting.

3.4.1.1 Pre-check (Will be performed prior to Static Test and prior to Dynamic Test.) Using "Normal" test mine, (Dwg. 9359924-1) short Pins 1 and C (Common) and Pins 2 and C. Check with voltmeter for 0 volt output.

3.4.1.2 Static test. When tested as specified in 4.5.2.2, output readings on normal test mine shall satisfy requirements shown on drawing 9359924.

3.4.1.3 Dynamic test. When tested as specified in 4.5.2.4, output at pins 1, C and 2, C shall satisfy requirements shown on drawing 9359924.

3.4.2 Extended setting.

3.4.2.1 Pre-check (Will be performed prior to Static Test and prior to Dynamic Test). Using "Extended" test mine, (Dwg. 9359924-2) short pin 1 and C (Common) and Pins 2 and C. Check with voltmeter for 0 volt output.

3.4.2.2 Static test. When tested as specified in 4.5.2.1, the voltage between common and each output jack (1 and 2) shall satisfy the requirements shown on drawing 9359924.

3.4.2.3 Dynamic test. When tested as specified in 4.5.2.3, output at pins 1, C and 2, C shall satisfy the requirements shown on drawing 9359924.

3.5 Major assemblies.

3.5.1 Major electrical component assemblies. The following major electrical components shall be inspected and tested in accordance with MIL-P-70624(AR).

a. Electronic Box Components Assembly
b. Power Box Components Assembly
c. Cable Assy's

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

3.5.2 Container assembly. The container assembly shall be inspected and tested in accordance with MIL-C-70627(AR).

3.5.3 Dust cover. The dispenser dust cover shall be inspected in accordance with MIL-C-44223(GL).

3.6 Procedures.

3.6.1 Welding. Welding of aluminum alloys, readily weldable for structures, shall be in accordance with MIL-W-45205. All welds shall be classified Class A. Prior to production fabrication of any weldment, the contractor shall submit in triplicate, the joint welding procedure and drawings to the contracting officer who will forward two copies to the procuring activity for certification.

3.6.1.1 Specimens. Prior to production fabrication of any welded joints, the contractor shall prepare workmanship specimens of all welded joints representing the acceptable weld quality to be used in production. These specimens shall also represent the minimum acceptable cleaning procedure. These specimens shall be prepared using the welding procedures to be used in production and may either be an actual part or sample simulating all of the proposed welds.

3.6.1.2 Capability of welder equipment and welder operators. The contractor shall perform all applicable welding as prescribed in the contractor's or manufacturer's welding procedure and meet the requirements established by the approved workmanship sample.

3.6.2 Tire and flywheel assembly alignment after assembly into launcher (Dwg. 9359983). After the tire and flywheel assembly has been assembled into the launcher, the assembly shall rotate freely one full revolution when a max torque of 4 in-lbs is applied as specified in 4.5.3.

3.7 Protective finish. The contractor shall prepare two (2) test panels of the same material as used in the components at the time of finishing the components or assemblies in accordance with Dwg. 9399999, subjected to the same finishing process and shall meet the requirements of TT-C-490 when tested as specified in 4.5.4.

3.8 Workmanship. All parts shall be fabricated and finished in a thorough workmanship manner, and all manufacturing, processing and assembly operations shall be correctly performed. They shall be clean and free of burrs, sharp edges, unblended radii, surface defects, chips, dirt, grease and oil corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part or assembly, nor shall they be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat, legible and sharply defined.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements. Unless otherwise specified herein or in the contract, the provisions of MIL-W-63150 shall apply and are hereby made a part of this specification.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.2 Classification of inspections. The following types of inspections shall be conducted on this item:

a. First Article Inspection.

b. Quality Conformance Inspection.

4.3 First article inspection.

4.3.1. Submission. The contractor shall submit a first article sample as designated by the contracting officer for evaluation in accordance with provisions of 4.3.2. The first article sample shall consist of one (1) M138 Mine Dispenser (Dwg. 9359799), one Test Mine, P/N 9399924-1 and one Test Mine, P/N 9359924-2.

4.3.2 Inspections to be performed. See MIL-W-63150 and Table I specified herein.

4.3.3 Rejection. If any assembly, component or test specimen fails to comply with any of the applicable requirements, the first article sample shall be rejected. The Government reserves the right to terminate its inspection upon any failure of an assembly, component or test specimen in the sample to comply with any of the stated requirements.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE: Dispenser, Mine: M138		SHEET 1 OF 1		DRAWING NUMBER: 9359799
					NEXT HIGHER ASSEMBLY: --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Dispenser, Mine: M138 (Dwg. 9359984) mounted into Clamp Assembly (Dwg. 9359850) and Connected to a Power Source using Cable Assembly (Dwg. 9360017)	1			
	Examination for defects		3.2	4.4.2	
	Arming and dispensing		3.3	4.5.1	
	Ambient temperature		3.3.2	4.5.1.2	
	Cold temperature		3.3.3	4.5.1.3	
	Hot temperature		3.3.4	4.5.1.4	
	Transportation vibration		3.3.5	4.5.1.5	
	Distance launched		3.3.6	4.5.1.6	
	Normal S.D. launching		3.4.1	4.5.2	
	Extended S.D. launching		3.4.2	4.5.2	
	Ready light function		3.3.1.1	4.5.1.1.1	
	Fail light function		3.3.1.2	4.5.1.1.2	

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. Inspection lots shall comply with the lot formation provisions of MIL-STD-105.

4.4.2 Examination - See MIL-W-63150.

a. Sampling plans. Unless otherwise specified in the Classification of Defects and Tests tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.1	Clamp, Machined				9359859
					NEXT HIGHER ASSEMBLY 9359850
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of hole(s) on top incorrect (6 places)		0.40%	3.2	Gage
102	Location of insert hole(s) on side incorrect (6 places)		0.40%	3.2	Gage
103	Location of pintle mount hole(s) incorrect (2 places)		0.40%	3.2	Gage
104	Diameter of pintle spacer hole(s) incorrect (2 places)		0.40%	3.2	Gage
105	Diameter of pintle through hole(s) incorrect (2 places)		0.40%	3.2	Gage
106	Depth of pintle spacer hole(s) incorrect (2 places)		0.40%	3.2	Gage
107	Diameter of pintle large bearing surface hole(s) incorrect (2 places)		0.40%	3.2	Gage
108	Depth of pintle large bearing surface hole(s) incorrect (2 places)		0.40%	3.2	Gage
109	Diameter of pintle small bearing surface hole(s) incorrect (2 places)		0.40%	3.2	Gage
110	Depth of pintle small bearing surface hole(s) incorrect (2 places)		0.40%	3.2	Gage
111	Location of chain and pin assembly hole(s) incorrect (2 places)		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET 2 OF 2	DRAWING NUMBER
4.4.2.1	Clamp, Machined		9359859
			NEXT HIGHER ASSEMBLY 9359850

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
112	Diameter of chain and pin assembly hole(s) incorrect (2 places)		0.40%	3.2	Gage
113	Location of threaded hole incorrect		0.40%	3.2	Gage
114	Pitch diameter of threaded hole incorrect		0.40%	3.2	Gage
115	Depth of threaded hole below min.		0.40%	3.2	Gage
116	Surface treatment incorrect, damaged or defective (prior to primer and top coat)		0.40%	3.2	Visual
117	Insert(s) incorrect or improperly assembled (6 places)		0.40%	3.2	Visual
118	Protective finish incorrect, damaged or defective	1/		3.7	4.5.4/Visual
119	Presence of protective finish in areas not permitted		0.40%	3.2	Visual
Minor					
201	Overall width incorrect		0.65%	3.2	Gage
202	Overall height incorrect		0.65%	3.2	Gage
203	Overall length incorrect		0.65%	3.2	Gage
204	Chamfer(s) incorrect (6 places)		0.65%	3.2	Gage
205	Width of leg(s) incorrect (2 places)		0.65%	3.2	Gage
206	Groove(s) location incorrect (2 places)		0.65%	3.2	Gage
207	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.2	Clamp, Front		9359852
			NEXT HIGHER ASSEMBLY 9359850

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of hole(s) incorrect (3 places)		0.40%	3.2	Gage
102	Diameter of hole(s) incorrect (3 places)		0.40%	3.2	Gage
103	Location of threaded hole incorrect		0.40%	3.2	Gage
104	Pitch diameter of threaded hole incorrect		0.40%	3.2	Gage
105	Diameter of large hole incorrect		0.40%	3.2	Gage
106	Depth of large hole incorrect		0.40%	3.2	Gage
107	Overall length incorrect		0.40%	3.2	Gage
108	Heat treatment incorrect in counterbore area only		0.40%	3.2	Test
109	Protective finish incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
Minor					
201	Overall height incorrect		0.65%	3.2	Gage
202	Overall width incorrect		0.65%	3.2	Gage
203	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.3	Clamp, Screw		9359854
			NEXT HIGHER ASSEMBLY 9359853

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Pitch diameter of screw clamp incorrect		0.40%	3.2	Gage
102	Heat treatment incorrect		0.40%	3.2	Test
Minor					
201	Length of threaded shaft incorrect		0.65%	3.2	Gage
202	Location of hole incorrect		0.65%	3.2	Gage
203	Overall length incorrect		0.65%	3.2	Gage
204	Hole diameter incorrect		0.65%	3.2	Gage
205	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.4	Clamp, Screw Assembly				9359853
					NEXT HIGHER ASSEMBLY 9359850
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Sealant missing from crank threads (2 places) (prior to assembly of crank balls)		0.40%	3.2	Visual
102	Components missing or improperly assembled		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.5	Clamp Assembly				9359850
					NEXT HIGHER ASSEMBLY 9359799
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Components missing or improperly assembled		0.40%	3.2	Visual
102	Adhesive missing from threads of screw(s) (7 places)		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.6	Hub				9359814
					NEXT HIGHER ASSEMBLY 9359813
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter of hole incorrect		0.40%	3.2	Gage
102	Major outside diameter of hub incorrect		0.40%	3.2	Gage
103	Minor outside diameter of hub incorrect		0.40%	3.2	Gage
104	Location of bolt hole(s) incorrect (6 places)		0.40%	3.2	Gage
105	Pitch diameter of thread of bolt hole(s) incorrect (6 places)		0.40%	3.2	Visual
106	Overall length of hub incorrect		0.40%	3.2	Gage
107	Length of lower hub on large diameter incorrect		0.40%	3.2	Gage
108	Protective finish incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
109	Protective finish in threads (6 places)		0.40%	3.2	Visual
Minor					
201	Chamfer(s) of hub incorrect (3 places)		0.65%	3.2	Gage
203	Poor workmanship		1.00%	3.8	Gage

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.7	Tire Assembly				9359813
					NEXT HIGHER ASSEMBLY 9359811
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Sealant on screw(s) threads missing (3 places) (prior to assembly)		0.40%	3.2	Visual
102	Specified assembly procedure not used		0.40%	3.2	Visual
103	Screw(s) missing, improperly assembled (3 places)		0.40%	3.2	Visual
104	Tire rotation arrow direction incorrect		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.8	Axle				9359812
					NEXT HIGHER ASSEMBLY
					9359811
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length of axle incorrect		0.40%	3.2	Gage
102	Length to lower thread diameter incorrect		0.40%	3.2	Gage
103	Length to bottom of flywheel retaining surface incorrect		0.40%	3.2	Gage
104	Length to top of flywheel retaining surface incorrect		0.40%	3.2	Gage
105	Length to start of flywheel keyway incorrect		0.40%	3.2	Gage
106	Upper bearing diameter incorrect		0.40%	3.2	Gage
107	Retaining ring groove width incorrect		0.40%	3.2	Gage
108	Retaining ring groove diameter incorrect		0.40%	3.2	Gage
109	Length from upper flywheel retaining surface to ring retaining groove incorrect		0.40%	3.2	Gage
110	Length to bottom of lower bearing surface incorrect		0.40%	3.2	Gage
111	Pitch diameter of thread incorrect (2 places)		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET 2 OF 2	DRAWING NUMBER
4.4.2.8	Axle		9359812
			NEXT HIGHER ASSEMBLY 9359811

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
112	Upper thread length exceeds maximum permitted		0.40%	3.2	Gage
113	Runout of major diameter to bearing surfaces exceeds max.		0.40%	3.2	Gage
114	Runout of upper flywheel retaining surface to bearing surfaces exceeds maximum permitted		0.40%	3.2	Gage
115	Major diameter of shaft incorrect		0.40%	3.2	Gage
116	Width of keyway incorrect		0.40%	3.2	Gage
117	Lower bearing surface diameter incorrect		0.40%	3.2	Gage
118	Width of coupling keyway incorrect		0.40%	3.2	Gage
119	Hardness incorrect		0.40%	3.2	Test
120	Length to bushing bearing incorrect		0.40%	3.2	Gage
121	Protective finish incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
Minor					
201	Chamfer dimension on axle incorrect (6 places)		0.65%	3.2	Gage
203	Poor workmanship		1.00%	3.8	Visual

NOTES:

1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.9	Flywheel				9359815
					NEXT HIGHER ASSEMBLY
					9359811
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter of flywheel incorrect		0.40%	3.2	Gage
102	Concentricity of flywheel diameter exceeds max. deviation permitted		0.40%	3.2	Gage
103	Hub diameter of flywheel incorrect		0.40%	3.2	Gage
104	Concentricity of hub diameter to hole diameter exceeds max. deviation permitted		0.40%	3.2	Gage
105	Diameter of bolt hole(s) incorrect (3 places)		0.40%	3.2	Gage
106	Concentricity of bolt hole(s) to datum A & B exceeds max. deviation permitted (3 places)		0.40%	3.2	Gage
107	Location of bolt hole(s) incorrect (3 places)		0.40%	3.2	Gage
108	Centerhole diameter incorrect		0.40%	3.2	Gage
109	Concentricity of centerhole to Datum A exceeds max. deviation permitted		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.9	Flywheel				9359815
					NEXT HIGHER ASSEMBLY 9359811
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
110	Keyway slot depth dimension incorrect		0.40%	3.2	Gage
111	Protective finish incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
112	Protective finish in centerhole, keyway and bolt hole(s) (3 places)		0.40%	3.2	Visual
113	Width of keyway incorrect		0.40%	3.2	Gage
Minor					
201	Chamfer of flywheel incorrect (3 places)		0.65%	3.2	Gage
202	Thickness of flywheel incorrect		0.65%	3.2	Gage
203	Height of rim of flywheel incorrect		0.65%	3.2	Gage
204	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.10	Wheel Half				9359883
					NEXT HIGHER ASSEMBLY
					9359882
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of bolt hole(s) incorrect (3 places)		100%	3.2	Gage
102	Diameter of bolt hole(s) incorrect (3 places)		100%	3.2	Gage
103	Location of alignment hole incorrect		100%	3.2	Gage
104	Location of pin hole incorrect		100%	3.2	Gage
105	Diameter of alignment hole incorrect		100%	3.2	Gage
106	Diameter of pin hole incorrect		100%	3.2	Gage
107	Depth of alignment and pin holes incorrect		100%	3.2	Gage
108	Diameter of center hole incorrect		100%	3.2	Gage
109	Location of slot incorrect		100%	3.2	Gage
110	Inner top rim diameter incorrect		100%	3.2	Gage
111	Depth of inner top rim incorrect		100%	3.2	Gage
112	Tire mounting diameter incorrect		100%	3.2	Gage
113	Surface treatment incorrect, incomplete or damaged		100%	3.2	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET 2 OF 2	DRAWING NUMBER
4.4.2.10	Wheel Half		9359883
			NEXT HIGHER ASSEMBLY 9359882

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Major					
114	Protective finish incorrect, incomplete or damaged		100%	3.7	Visual
115	Protective finish in area where not permitted		100%	3.7	Visual
116	Check for knurled edge.		100%	3.2	Visual
Minor					
201	Overall height incorrect		100%	3.2	Gage
202	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.11	Wheel and Tire Assembly				9359811
					NEXT HIGHER ASSEMBLY 9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Flywheel improperly assembled		0.40%	3.2	Visual
102	Key missing		0.40%	3.2	Visual
103	Sealant on screw(s) threads missing, (3 places) (prior to assembly)		0.40%	3.2	Visual
104	Screw(s) not fully seated		0.40%	3.2	Visual
105	Retaining ring missing or improperly assembled		0.40%	3.2	Visual
106	Wheel and tire assembly not balanced		0.40%	3.2	Certification
107	Protective finish not repaired after balancing		0.40%	3.2	Visual
108	Access to tube valve stem or screw heads blocked by balancing material		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.12	Lining Friction				9359807
					NEXT HIGHER ASSEMBLY
					9359982
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Overall length incorrect		0.65%	3.2	Gage
202	Overall width incorrect		0.65%	3.2	Gage
203	Thickness incorrect		0.65%	3.2	Gage
204	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9359806
4.4.2.13	Pad, Slide				NEXT HIGHER ASSEMBLY 9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of mounting hole(s) incorrect (16 places)		0.40%	3.2	Gage
102	Diameter of mounting hole(s) incorrect (16 places)		0.40%	3.2	Gage
103	Countersink of mounting hole(s) incorrect (16 places)		0.40%	3.2	Gage
104	Thickness of pad slide incorrect		0.40%	3.2	Gage
105	Radius of curvature incorrect (4 places)		0.40%	3.2	Gage
106	Protective finish incorrect, damage or defective	1/	0.40%	3.7	4.5.4/Visual
107	Internal width (Datum -A-) incorrect		0.40%	3.2	Gage
108	Outside width incorrect		0.40%	3.2	Gage
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.14	Spacer, Pintle	1 OF 1	9359849
			NEXT HIGHER ASSEMBLY 9359823

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Hole diameter incorrect		0.40%	3.2	Gage
102	Thickness incorrect		0.40%	3.2	Gage
103	Spacer diameter incorrect		0.40%	3.2	Gage
104	Protective finish incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
105	Heat treatment incorrect		0.40%	3.2	Test
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.15	Pintle				9359825
					NEXT HIGHER ASSEMBLY 9359823
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter of pintle spacer surface incorrect		0.40%	3.2	Gage
102	Diameter of largest bearing surface incorrect		0.40%	3.2	Gage
103	Diameter of smallest bearing surface incorrect		0.40%	3.2	Gage
104	Diameter of remaining bearing surface incorrect		0.40%	3.2	Gage
105	Length of pintle spacer surface incorrect		0.40%	3.2	Gage
106	Length from bottom of pintle spacer to bottom of taper on largest bearing surface incorrect		0.40%	3.2	Gage
107	Length from bottom of pintle spacer surface to bottom of taper of mid bearing surface incorrect		0.40%	3.2	Gage
108	Distance from bottom of pintle spacer surface to start of pintle cut out incorrect		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER 9359825
4.4.2.15	Pintle				NEXT HIGHER ASSEMBLY 9359823
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
109	Distance from bottom of pintle spacer surface to end of pintle cut out incorrect		0.40%	3.2	Gage
110	Distance from bottom of pintle spacer surface to bottom of pintle incorrect		0.40%	3.2	Gage
111	Angle of cut out incorrect		0.40%	3.2	Gage
112	Pitch diameter of threaded surface incorrect		0.40%	3.2	Gage
113	Length of threaded surface below min.		0.40%	3.2	Gage
114	Location of hole incorrect		0.40%	3.2	Gage
115	Diameter of hole incorrect		0.40%	3.2	Gage
116	Protective finish incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
117	Heat treatment incorrect		5-0-1	3.2	Test
Minor					
201	Distance from bottom of pintle spacer surface to top of pintle		0.65%	3.2	Gage
202	Chamfer incorrect (4 places)		0.65%	3.2	Gage
203	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9359823
4.4.2.16	Pintle Assembly				NEXT HIGHER ASSEMBLY 9359981
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Gap between pintle spacer and pintle in excess of max.		0.40%	3.2	Gage
102	Total runout between spacer and pintle in excess of max. permitted		0.40%	3.2	Gage
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.17	Washer, Flat: Pintle				9359822
					NEXT HIGHER ASSEMBLY
					9359981
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Thickness of washer incorrect		0.40%	3.2	Gage
102	Protective finish, incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
Minor					
201	Outside diameter incorrect		0.65%	3.2	Gage
202	Diameter of hole incorrect		0.65%	3.2	Gage
203	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.18	Bracket, Transmitter				9359862
					NEXT HIGHER ASSEMBLY 9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Bracket mounting hole(s) location incorrect (6 places)		100%	3.2	Gage
102	Transmitter threaded mounting hole(s) location incorrect (4 places)		100%	3.2	Gage
103	Sensor hole location incorrect		100%	3.2	Gage
104	Thickness of bracket incorrect		0.40%	3.2	Gage
105	Threads of transmitter mounting hole(s) incorrect (4 places)		0.40%	3.2	Gage
106	Diameter of bracket mounting hole(s) incorrect (6 places)		0.40%	3.2	Gage
107	Length of bracket incorrect		0.40%	3.2	Gage
108	Width of bracket incorrect		0.40%	3.2	Gage
109	Countersink on bracket mounting hole(s) incorrect (6 places)		0.40%	3.2	Gage
110	Protective finish, incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
111	Profile of transmitter cavity incorrect		0.40%	3.2	Gage
112	Location of transmitter cavity incorrect		0.40%	3.2	Gage
113	Thickness at transmitter mounting hole(s) incorrect (4 places)		0.40%	3.2	Gage
Minor					
201	Chamfer on end of bracket missing		0.65%	3.2	Visual
202	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.19	Protector, Switch, Proximity	1 OF 1	9359871
			NEXT HIGHER ASSEMBLY 9359983

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Inside diameter incorrect		0.40%	3.2	Gage
102	Thread dimension incorrect		0.40%	3.2	Gage
103	Minimum depth of thread incorrect		0.40%	3.2	Gage
104	Protective finish incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
Minor					
201	Overall length incorrect		0.65%	3.2	Gage
202	Outside diameter incorrect		0.65%	3.2	Gage
203	Poor workmanship		1.00%	3.8	Visual

NOTES:

1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.20	Mounting Plate, Switch, Proximity				9359872
					NEXT HIGHER ASSEMBLY 9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of sensor mounting hole incorrect		0.40%	3.2	Gage
102	Thread of sensor mounting hole incorrect		0.40%	3.2	Gage
103	Location of plate mounting hole(s) incorrect (4 places)		0.40%	3.2	Gage
104	Threads of plate mounting hole(s) incorrect (4 places)		0.40%	3.2	Gage
105	Outside threads of plate incorrect		0.40%	3.2	Gage
106	Length of plate incorrect		0.40%	3.2	Gage
107	Width of plate incorrect		0.40%	3.2	Gage
108	Overall height of plate incorrect		0.40%	3.2	Gage
109	Protective finish incorrect,damaged or defective .	1/	0.40%	3.7	4.5.4/Visual
110	Protective finish on threads		0.40%	3.2	Gage
111	Thickness of plate at mounting hole(s) area incorrect		0.40%	3.2	Gage
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 3		DRAWING NUMBER
4.4.2.21	Raceway				9359905
					NEXT HIGHER ASSEMBLY
					9359982
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Minor					
101	Flatness of datum C incorrect		0.40%	3.2	Gage
102	Location of sensor mounting cutout incorrect		0.40%	3.2	Gage
103	Location of transmitter cutout incorrect		0.40%	3.2	Gage
104	Location of bearing plate support incorrect		0.40%	3.2	Gage
105	Height of bearing plate support incorrect		0.40%	3.2	Gage
106	Bearing plate support not parallel to datum C		0.40%	3.2	Gage
107	Datum A diameter incorrect		0.40%	3.2	Gage
108	Location of transmitter mounting hole(s) incorrect (6 places)		0.40%	3.2	Gage
109	Diameter of transmitter mounting hole(s) incorrect (6 places)		0.40%	3.2	Gage
110	Location of pad slide mounting hole(s) incorrect (16 places) (prior to clinch nut assy)		0.40%	3.2	Gage
111	Diameter of pad slide mounting hole(s) incorrect (16 places) (prior to clinch nut assy)		0.40%	3.2	Gage
112	Surface treatment incorrect, damaged or defective (prior to assembly of inserts and clinch nuts)		0.40%	3.7	4.5.4/Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 2 OF 3		DRAWING NUMBER
4.4.2.21	Raceway				9359905
					NEXT HIGHER ASSEMBLY
					9359982
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
113	Location of bearing plate assembly mounting holes incorrect (6 places)		0.40%	3.2	Gage
114	Bearing plate assembly mounting insert missing or improperly assembled (6 places)		0.40%	3.2	Visual
115	Location of raceway top mounting hole(s) incorrect (8 places)		0.40%	3.2	Gage
116	Raceway top mounting insert(s) missing improper, or improperly assembled (8 places)		0.40%	3.2	Visual
117	Height of support shelf top incorrect (2 places)		0.40%	3.2	Gage
118	Height of side raceway incorrect		0.40%	3.2	Gage
119	Stud location(s) incorrect (2 places)		0.40%	3.2	Gage
120	Power box mounting hole(s) location incorrect (6 places)		0.40%	3.2	Gage
121	Power box mounting inserts missing or improperly assembled (6 places)		0.40%	3.2	Gage
122	Location of base plate assembly mounting holes incorrect (6 places)		0.40%	3.2	Gage
123	Base plate assembly mounting inserts missing or improperly assembly (6 places)		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 3 OF 3		DRAWING NUMBER
4.4.2.21	Raceway				9359905
					NEXT HIGHER ASSEMBLY 9359982
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
125	Handle insert (1) missing or improperly assembled		0.40%	3.2	Gage
126	Handle chain retaining insert (1) missing or improperly assembled		0.40%	3.2	Gage
127	Location of short and long support mounting holes (2 places)		0.40%	3.2	Gage
128	Short or long support mounting inserts missing or improperly assembled (2 places)		0.40%	3.2	Visual
129	Clinch nut(s) missing or improperly assembled (18 places)		0.40%	3.2	Visual
130	Stud lock-in missing or improperly assembled (2 places)		0.40%	3.2	Visual
131	Flywheel shield inner diameter incorrect		0.40%	3.2	Gage
132	Flywheel shield improperly located		0.40%	3.2	Visual
133	Chromate finish incorrect or defective		0.40%	3.2	Visual
Minor					
201	Length of guard incorrect		0.65%	3.2	Gage
202	Location of drain hole(s) incorrect (3 places)		0.65%	3.2	Visual
203	Diameter of drain hole(s) incorrect (3 places)		0.65%	3.2	Gage
204	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.22	Top, Raceway				9359906
					NEXT HIGHER ASSEMBLY
					9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of mounting hole(s) incorrect (8 places)		0.40%	3.2	Gage
102	Surface treatment incorrect, damaged or defective (prior to assembly of inserts)	1/	0.40%	3.7	4.5.4/Visual
103	Insert(s) missing, improperly assembled or incorrect (4 places)		0.40%	3.2	Visual
104	Location of insert(s) incorrect (4 places)		0.40%	3.2	Gage
105	Thickness of transmitter mounting tabs incorrect (4 places)		0.40%	3.2	Gage
106	Location of transmitter cavity incorrect		0.40%	3.2	Gage
107	Location of cable channel incorrect		0.40%	3.2	Gage
108	Width of cable channel incorrect		0.40%	3.2	Gage
109	Location of front bearing plate assy mount cutout incorrect (2 places)		0.40%	3.2	Gage
110	Length of mine lead-in chamfer incorrect		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.22	Top, Raceway				9359906
					NEXT HIGHER ASSEMBLY
					9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
111	Depth of front bearing plate assembly mount cutout incorrect (2 places)		0.40%	3.2	Gage
112	Width of front bearing plate assembly mount cutout incorrect (2 places)		0.40%	3.2	Gage
113	Protective finish incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
114	Profile of transmitter cavity incorrect		0.40%	3.2	Gage
115	Diameter of mounting hole(s) incorrect (8 places)		0.40%	3.2	Gage
116	Outside radius of curvature incorrect		0.40%	3.2	Gage
Minor					
201	Plate thickness incorrect		0.65%	3.2	Gage
202	Inside radius of curvature incorrect		0.65%	3.2	Gage
203	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.23	Raceway Assembly				9359982
					NEXT HIGHER ASSEMBLY 9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Friction lining improperly installed onto raceway		0.40%	3.2	Visual
102	Friction lining improperly installed with respect to top edge of raceway wall		0.40%	3.2	SMTE
103	Area at each of three drain holes not free of cement and friction lining after assembly		0.40%	3.2	Visual
104	Protective finish defective, damaged or improperly applied		0.40%	3.7	Visual
Minor					
201	Gap between end of friction liner and front of feed in area exceeds max. allowable		0.65%	3.2	SMTE
202	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.24	Bushing, Sleeve				9359842
					NEXT HIGHER ASSEMBLY 9359908
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Overall length of bushing incorrect		0.40%	3.2	Gage
102	Length from end to flange incorrect		0.40%	3.2	Gage
103	Outside flange diameter incorrect		0.40%	3.2	Gage
104	Outside diameter datum A incorrect		0.40%	3.2	Gage
105	Inside diameter incorrect		0.40%	3.2	Gage
106	True position of inside diameter incorrect		0.40%	3.2	Gage
107	Heat treatment incorrect		5-0-1	3.2	Test
108	Protective finish missing, damaged, or incorrect	1/	0.40%	3.7	4.5.4/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panels shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.25	Plate, Retaining, Bearing	1 OF 3	9359907
			NEXT HIGHER ASSEMBLY: 9359908

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Structural and welding incorrect damaged or defective		0.40%	3.6.1	Visual
102	Boss outside diameter incorrect		0.40%	3.2	Gage
103	Diameter of support mounting hole(s) (2 places) incorrect		0.40%	3.2	Gage
104	Location of support mounting hole(s) (2 places) incorrect		0.40%	3.2	Gage
105	Boss through hole diameter incorrect		0.40%	3.2	Gage
106	True position of through hole incorrect		0.40%	3.2	Gage
107	Bearing hole diameter incorrect		0.40%	3.2	Gage
108	Bearing hole depth incorrect		0.40%	3.2	Gage
109	Location of bearing hole projected length incorrect		0.40%	3.2	Gage
110	Location of bearing plate mounting hole(s) incorrect (4 places)		0.40%	3.2	Gage
111	Diameter of bearing plate mounting hole(s) incorrect (4 places)		0.40%	3.2	Gage
112	Location of electronics mounting hole(s) incorrect (4 places)		0.40%	3.2	Gage
113	Diameter of Electronics mounting hole(s) incorrect (4 places)		0.40%	3.2	Gage
114	Leg(s) angle incorrect (2 places)		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 2 OF 3		DRAWING NUMBER 9359907
4.4.2.25	Plate, Retaining, Bearing				NEXT HIGHER ASSEMBLY 9359908
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
115	Length of leg(s) incorrect (2 places)		0.40%	3.2	Gage
116	Location of bearing plate mounting hole(s) in legs incorrect (2 places)		0.40%	3.2	Gage
117	Diameter of bearing plate mounting hole(s) in legs incorrect (2 places)		0.40%	3.2	Gage
118	Countersink of bearing plate mounting hole(s) in legs incorrect (2 places)		0.40%	3.2	Gage
119	Location of stud hole(s) incorrect (2 places)		0.40%	3.2	Gage
120	Diameter of stud hole(s) incorrect (2 places)		0.40%	3.2	Gage
121	Protective finish incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
122	Paint or primer coating in bearing surfaces in plate		0.40%	3.2	Visual
Minor					
201	Thickness of boss incorrect		0.65%	3.2	Gage
202	Length of cutout incorrect		0.65%	3.2	Gage
203	Width of cutout incorrect		0.65%	3.2	Gage
204	Width of leg(s) incorrect (2 places)		0.65%	3.2	Gage
205	Location of wing(s) incorrect (2 places)		0.65%	3.2	Gage

NOTES: 1/ Test panels shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 3 OF 3		DRAWING NUMBER
4.4.2.25	Plate, Retaining, Bearing				9359907
					NEXT HIGHER ASSEMBLY
					9359908
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
206	Thickness of support(s) incorrect (2 places)		0.65%	3.2	Gage
207	Length of support(s) incorrect (2 places)		0.65%	3.2	Gage
208	Width of support(s) incorrect (2 places)		0.65%	3.2	Gage
209	Cutout of support on mine feed side incorrect		0.65%	3.2	Gage
210	Center of bearing hole to end of plate incorrect		0.65%	3.2	Gage
211	Overall width of plate incorrect		0.65%	3.2	Gage
212	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.26	Bearing Plate Assembly				9359908
					NEXT HIGHER ASSEMBLY 9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Bearing missing or improperly seated		0.40%	3.2	Visual
102	Bushing bearing missing or improperly seated		0.40%	3.2	Visual
103	Protective finish appears on roller bearing and bushing surfaces		0.40%	3.7	Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9359867
4.4.2.27	Pin, Dowel				NEXT HIGHER ASSEMBLY 9359980
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter incorrect		0.40%	3.2	Gage
102	Tapered diameter incorrect		0.40%	3.2	Gage
Minor					
201	Overall length incorrect		0.65%	3.2	Gage
202	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 3		DRAWING NUMBER 9359980
4.4.2.28	Base Assembly				NEXT HIGHER ASSEMBLY 9359981
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Direction of frame material grain incorrect		0.40%	3.2	Visual
102	Frame radius of bend incorrect		0.40%	3.2	Gage
103	Structural and welding defective, damaged or incorrect		0.40%	3.6.1	Visual
104	Location of motor mount assembly incorrect		0.40%	3.2	Gage
105	Location of motor mount hole(s) incorrect (4 places)		0.40%	3.2	Gage
106	Motor mount plate not parallel to base assembly mounting surface(s) (3 places)		0.40%	3.2	Gage
107	Location of base assembly mounting hole(s) incorrect (6 places)		0.40%	3.2	Gage
108	Diameter of base assembly mounting hole(s) incorrect (6 places)		0.40%	3.2	Gage
109	Thickness of base assembly mounting surface(s) incorrect (3 places)		0.40%	3.2	Gage
110	Dimension of base assembly mounting surface(s) incorrect (3 places)		0.40%	3.2	Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 2 OF 3		DRAWING NUMBER 9359980
4.4.2.28	Base Assembly				NEXT HIGHER ASSEMBLY 9359981
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
111	Diameter of bearing through hole incorrect		0.40%	3.2	Gage
112	Location of bearing through hole incorrect		0.40%	3.2	Gage
113	Diameter of bearing hole incorrect		0.40%	3.2	Gage
114	Depth of bearing hole incorrect		0.40%	3.2	Gage
115	Location of bearing hole at projected length incorrect		0.40%	3.2	Gage
116	Location of standoff(s) incorrect (4 places)		0.40%	3.2	Gage
117	Location of pintle hole incorrect		0.40%	3.2	Gage
118	Diameter of pintle hole incorrect		0.40%	3.2	Gage
119	Diameter of motor mount shaft hole incorrect		0.40%	3.2	Gage
120	Location of motor mount shaft hole incorrect		0.40%	3.2	Gage
121	Motor mount standoff distance incorrect		0.40%	3.2	Gage
122	Location of pin dowel hole incorrect		0.40%	3.2	Gage
123	Diameter of pin dowel hole incorrect		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 3 OF 3		DRAWING NUMBER
4.4.2.28	Base Assembly				9359980
					NEXT HIGHER ASSEMBLY 9359981
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
124	Dowel pin missing or improperly assembled		0.40%	3.2	Gage
125	Surface treatment missing, damaged or defective (prior to assembly of clinch nuts and inserts)		0.40%	3.7	Visual
126	Insert(s) missing or improperly assembled (4 places) (Prior to Protective finish)		0.40%	3.2	Visual
127	Protective finish; incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
128	Protective finish or primer on bearing insertion surfaces of base assembly		0.40%	3.2	Visual
Minor					
201	Width of pintle base incorrect		0.65	3.2	Gage
202	Angle of support(s) incorrect (2 places)		0.65%	3.2	Gage
203	Location of support(s) incorrect (2 places)		0.65%	3.2	Gage
204	Width of frame incorrect		0.65%	3.2	Gage
205	Poor workmanship		1.00%	3.8	Visual

NOTES: 1/ Test panels shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9359981
4.4.2.29	Base and Pintle Assembly				NEXT HIGHER ASSEMBLY 9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Components missing or improperly assembled		0.40%	3.2	Visual
Minor 201	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.30	Shelf Assembly				9359801
					NEXT HIGHER ASSEMBLY
					9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Structural and welding defective, damaged or incorrect		0.40%	3.6.1	Visual
102	Location of tab(s) incorrect (2 places)		0.40%	3.2	Gage
103	Location of hole(s) in tab incorrect (2 places)		0.40%	3.2	Gage
104	Diameter of hole(s) in tab incorrect (2 places)		0.40%	3.2	Gage
105	Location of handle mounting block(s) incorrect (2 places)		0.40%	3.2	Gage
106	Surface treatment incorrect, damaged or defective	1/	0.40%	3.7	4.5.4/Visual
107	Location of insert(s) incorrect (2 places)		0.40%	3.2	Gage
108	Location of bearing boss cover incorrect		0.40%	3.2	Gage
109	Diameter of bearing boss cover incorrect		0.40%	3.2	Gage
110	Protective finish incorrect, damaged or defective	1/	0.40%	3.2	4.5.4/Visual

NOTES: 1/ Test panels shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.30	Shelf Assembly	2 OF 2	9359801
			NEXT HIGHER ASSEMBLY: 9359983

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Minor					
201	Overall width incorrect		0.65%	3.2	Gage
202	Overall height incorrect		0.65%	3.2	Gage
203	Outside radius of curvature incorrect		0.65%	3.2	Gage
204	Width of tab(s) incorrect (2 places)		0.65%	3.2	Gage
205	Diameter of tab hole incorrect		0.65%	3.2	Gage
206	Width of flange incorrect		0.65%	3.2	Gage
207	Length from front edge to start of plate cut out incorrect		0.65%	3.2	Gage
208	Length from front edge to start of curvature incorrect		0.65%	3.2	Gage
209	Location of drain hole incorrect		0.65%	3.2	Gage
210	Diameter of drain hole incorrect		0.65%	3.2	Gage
211	Width of plate cut out incorrect		0.65%	3.2	Gage
212	Depth of cap incorrect		0.65%	3.2	Gage
213	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9359893
4.4.2.31	Support, Long				NEXT HIGHER ASSEMBLY 9359983
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length of straight portion incorrect		0.40%	3.2	SMTE
102	Flatness of straight portion incorrect		0.40%	3.2	SMTE
103	Hole diameter incorrect (2 places)		0.40%	3.2	SMTE
104	Hole location incorrect (2 places)		0.40%	3.2	SMTE
105	Angle of flange incorrect (2 places)		0.40%	3.2	SMTE
106	Welding defective, damaged or incorrect		0.40%	3.2	Visual
107	Protective finish incorrect, damaged, or defective		0.40%	3.7	4.5.4/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.32	Support, Short		9359892
			NEXT HIGHER ASSEMBLY 9359983

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length of straight portion incorrect		0.40%	3.2	SMTE
102	Flatness of straight portion incorrect		0.40%	3.2	SMTE
103	Hole diameter incorrect (2 places)		0.40%	3.2	SMTE
104	Hole location incorrect (2 places)		0.40%	3.2	SMTE
105	Angle of flange incorrect (2 places)		0.40%	3.2	SMTE
106	Welding defective, damaged or incorrect		0.40%	3.2	Visual
107	Protective finish incorrect, damaged or defective		0.40%	3.7	4.5.4/Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.33	Launcher Assembly				9359983
					NEXT HIGHER ASSEMBLY 9359984
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Sealant missing from threads of screw(s) prior to assembly of pad slide (16 places)		0.40%	3.2	Visual
102	Pad slide screw(s) above flush (16 places)		100%	3.2	Gage
103	Sealant missing from threads of protector sensor prior to assembly to plate sensor mounting		0.40%	3.2	Visual
104	Sealant missing from threads of proximity switch prior to assembly to plate sensor mounting		0.40%	3.2	Visual
105	Sealant missing from threads of screw(s) prior to assembly of bracket transmitter and switch mounting plate (6 places)		0.40%	3.2	Visual
106	Screw(s) above flush after assembly of bracket transmitter and sensor mounting plate (6 places)		100%	3.2	Gage
107	Sealant missing from threads of screw(s) prior to assembly of upper and lower transmitter assembly (8 places)		0.40%	3.2	Visual
108	Sealant missing from threads of screw(s) prior to assembly of Power Box to launcher (6 places)		0.40%	3.2	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 2 OF 3		DRAWING NUMBER
4.4.2.33	Launcher Assembly				9359983
					NEXT HIGHER ASSEMBLY
					9359984
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
109	Sealant missing from threads of screw(s) prior to assembly of bearing plate assembly to launcher (4 places)		0.40%	3.2	Visual
110	Sealant missing from threads of screw(s) prior to assembly of bearing plate legs to launcher (2 places)		0.40%	3.2	Visual
111	Screw(s) on bearing plate legs above flush (2 places)		100%	3.2	Gage
112	Sealant missing from threads of screw(s) prior to assembly of base assembly to launcher (6 places)		0.40%	3.2	Visual
113	Wheel and tire assembly does not rotate freely		100%	3.6.2	4.5.3
114	Components missing or improperly assembled		0.40%	3.2	Visual
115	Gage does not pass freely through entire raceway after assembly (Note 6)		100%	3.2	Gage/Manual
116	Damaged CARC coated surfaces not retouched		100%	3.2	Visual
Minor 201	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85 — Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER 9359984
4.4.2.34	Dispenser, Mine				NEXT HIGHER ASSEMBLY 9359799
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Sealant missing from threads of screw(s) prior to assembly of Electronics box to launcher (4 places)		0.40%	3.2	Visual
102	Sealant missing from threads of screw(s) prior to assembly of motor assembly to launcher (4 places)		0.40%	3.2	Visual
103	Key(s) missing prior to assembly of coupling to axle and motor shaft (2 places)		0.40%	3.2	Visual
104	Sealant missing from threads of screw(s) prior to assembly to coupling (2 places)		0.40%	3.2	Visual
105	Transmitter assembly not connected to Electronics Box		0.40%	3.2	Visual
106	Proximity switch assembly not connected to Electronics Box		0.40%	3.2	Visual
107	Power cable not connected to Electronics Box and Power Box		0.40%	3.2	Visual
108	Motor cable not connected to Power Box and motor		0.40%	3.2	Visual
109	Identification plate missing or improperly marked (after marking of acceptance date)		0.40%	3.2	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.34	Dispenser, Mine				9359984
					NEXT HIGHER ASSEMBLY 9359799
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
110	End of coupling flange touching end of motor		100%	3.2	Visual
111	Instruction plate missing or improperly assembled (2 places)		100%	3.2	Visual
112	Terminal strip missing or improperly assembled		0.40%	3.2	Visual
113	Damaged CARC coated surfaces not retouched (Just prior to packing in container)		100%	3.2	Visual
Critical	Functional None defined				
Major					
110	Does not arm or dispense mines properly	at:	100%	3.3	4.5.1
111	Ambient temperature		100%	3.3.2	4.5.1.2
112	Cold temperature		100%	3.3.3	4.5.1.3
113	Hot temperature		100%	3.3.4	4.5.1.4
114	Mine does not launch minimum distance	10-0-1		3.3.6	4.5.1.6
115	Ready light does not function properly		100%	3.3.1.1	4.5.1.1.1
116	Fail light does not function properly		100%	3.3.1.2	4.5.1.1.2
117	SD setting normal		100%	3.4.1	4.5.2.2
118	SD setting extended		100%	3.4.2	4.5.2.3
Minor					
201	Poor workmanship		1.00	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.35	Lock, Adapter				9360063
					NEXT HIGHER ASSEMBLY
					9359799
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length incorrect		0.40%	3.2	Gage
102	Thread incorrect		0.40%	3.2	Gage
103	Depth of threads below min		0.40%	3.2	Gage
104	Hole diameter incorrect		0.40%	3.2	Gage
105	Location of hole diameter incorrect		0.40%	3.2	Gage
106	Protective finish missing damaged or incorrect	1/	0.40%	3.7	4.5.4/Visual
107	Knurl missing		0.40%	3.2	Visual
108	Outside diameter incorrect		0.40%	3.2	Gage
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTE: 1/ Test panel shall be inspected in accordance with 4.5.4. Visual shall be performed on component.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1	DRAWING NUMBER
4.4.2.36	Micellaneous Components			See Below
				NEXT HIGHER ASSEMBLY
				--

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Component — Dwg. No				
	Crank — 9359855				
	Ball, Crank — 9359856				
	Pin,Quick Release Assy — 9359857				
	Handle,Manual — 9359841				
	Plate, Identification — 9359876				
	Plate, Instruction — 9359843				
Critical	None defined				
Major	None defined				
Minor					
201	Markings on identification and instruction plates incorrect or incomplete		1.00%	3.8	Visual
202	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.37	Container, Prior to Packing				9378330
					NEXT HIGHER ASSEMBLY --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Foreign matter in container		100%	3.2	Visual
102	Base pads missing		100%	3.2	Visual
103	Any container component missing or improper		100%	3.2	Visual
104	Inside damaged CARC coated surfaces not retouched		100%	3.2	Visual
Minor					
201	Damaged container (to include dents protruding greater than 1/4" into container)		0.65%	3.2	Visual/Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.38	Container, Prior to Sealing		9378330
			NEXT HIGHER ASSEMBLY --

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Desiccant missing or improperly placed		100%	3.2	Visual
102	Any component missing, improper or improperly packed		100%	3.2	Visual
103	Storage assembly latches not secured properly (2 places)		100%	3.2	Visual//Manual
104	Gasket missing		100%	3.2	Visual
105	Dispenser not seated properly		100%	3.2	Visual
106	Nuts on support, shipping and storage container, Mine Dispenser torqued improperly (2 places)		100%	3.2	Gage
Minor	None defined				

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.39	Container, Sealed		9378330
			NEXT HIGHER ASSEMBLY --

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Components missing or improperly placed		100%	3.2	Visual
102	Humidity indicator assembly torqued improperly		100%	3.2	Gage
103	Pressure relief valve assembly improperly torqued		100%	3.2	Gage
104	Cover latches not secured properly (14 places)		100%	3.2	Visual/Manual
105	Humidity indicator test (Pink to Blue)		100%	4.5.5	Visual
Minor					
201	Poor workmanship		1.00%	3.8	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-D-70631A(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9359799
4.4.2.40	Dispenser, Mine: M138				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Marking(s) missing, incorrect or illegible (Dwg.s 9378330 and 9378331)		100%	3.2	Visual
102	Bar coding(s) missing, incorrect or location incorrect (2 places) (Dwg. 9378330)		100%	3.2	Visual
103	Metallic seal missing or incorrectly applied (2 places)		100%	3.2	Visual
104	Outside damaged CARC coated surfaces not retouched		100%	3.2	Visual
Minor					
201	Poor workmanship		1.00	3.8	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

4.4.3 Testing. Testing is described in the First Article and Quality Conformance Inspection Tables.

4.4.4 Inspection equipment. The inspection equipment required to perform the examination and tests prescribed herein is described in the "Paragraph Reference/Inspection Method" column in the tables starting with 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-W-63150 and 6.3 herein.

4.5 Methods of inspection.

4.5.1 Arming and dispensing. The Clamp Assembly (Dwg. 9359850) shall be securely mounted to a test stand. The M138 Dispenser shall be assembled to the Clamp Assembly and locked into place with the pin & chain assembly. A 26 + 1 VDC power source shall be connected to the Dispenser using the dispenser cable assembly (Dwg. 9360017). After the normal SD setting has been selected, the motor shall operate for 1 hour prior to dispensing. The unit shall, after the 1 hour motor operation, dispense 1 Test Mine (P/N 9359924-1) at normal setting, 50 M79 mines and 1 test mine (P/N 9359924-2) at the extended setting. The test mines shall be launched into a drop cloth (erected for soft catch) and not be subjected to the test specified in 4.5.1.6. The mine shall be launched when the ready light comes on. The test mine shall be tested and inspected as specified in 4.5.2.

4.5.1.1 Light functions.

4.5.1.1.1 Ready light function. Turn the dispenser to the "OFF" position. Disconnect the Tachometer cable from the electronics box. Turn the dispenser to either extended or normal and check for the requirements specified in 3.3.1.1.

4.5.1.1.2 Fail light function. Turn the dispenser to the "OFF" position. Disconnect the transmitter assembly from the electronics box. Turn the dispenser to the extended or normal position. When the ready light comes on, use a metallic tool to activate the proximity sensor and check the fail light for the requirement specified in 3.3.1.2.

4.5.1.2 Ambient temperature ($75^{o}F \pm 10^{o}F$). The dispenser shall be conditioned at the specified temperature for a minimum of 24 hours prior to testing as specified in 4.5.1.

4.5.1.3 Cold temperature ($-25^{o}F$ - $5^{o}F$). The dispenser shall be conditioned in accordance with MIL-STD-810, Method 502.1, Table 502.2-I, Basic cold (C1) Procedure II. The dispenser shall be tested immediately after conditioning as specified in 4.5.1. The dispenser, test mines and M79 mines shall be protected from frost formation.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

4.5.1.4 Hot temperature (120°F + 5°F). The dispenser shall be conditioned in accordance with MIL-STD-810, Method 501.2, Table 501.2-III, Hot (A1) Procedure II, four (4) hour minimum soak after reaching temperature. The dispenser shall be tested immediately after conditioning as specified in 4.5.1.

4.5.1.5 Transportation vibration. The dispenser shall be conditioned in accordance with MIL-STD-810, Method 514.3, Category 8 Test Procedure I, Figure 514.3-7 thru 514.3-9 (500 miles) and Figure 514.3-10 thru 514.3-22 (50 miles). The dispenser shall be tested after conditioning as specified in 4.5.1.

4.5.1.6 Distance launched. During launching of the M79 mines in accordance with 4.5.1, observation shall be made to assure that the mines, prior to impact, clear a marker located 80 feet from the dispenser with the bottom edge of the dispenser exit port three feet, ± 1 inch, above the ground. This test will be performed at ambient temperature only.

4.5.2 SD setting. (Test Mine Assembly Dwg. 9359924).

4.5.2.1 Extended setting, static test. (P/N 9359924-2)


a. Required: one (1) 30 volt power supply, one (1) electronic box, one (1) set of transmitter coils and one (1) proximity switch with proper connecting cables.

b. Connect 26 VDC ± 0.5V to P7 Pins 5 (+) and 2 (-) and transmitter coils and proximity switch to electronic box.

c. Using "Extended" test mine short Pins 1 and C (Common) and Pins 2 and C (Common), check with voltmeter for 0 volt output.

d. Turn on power to electronic box and set mode switch to "extended".

e. Place test mine on top of one transmitter coil then place the other transmitter coil on top of test mine. The transmitter coils should be centered on the test mine in accordance with the following diagram.

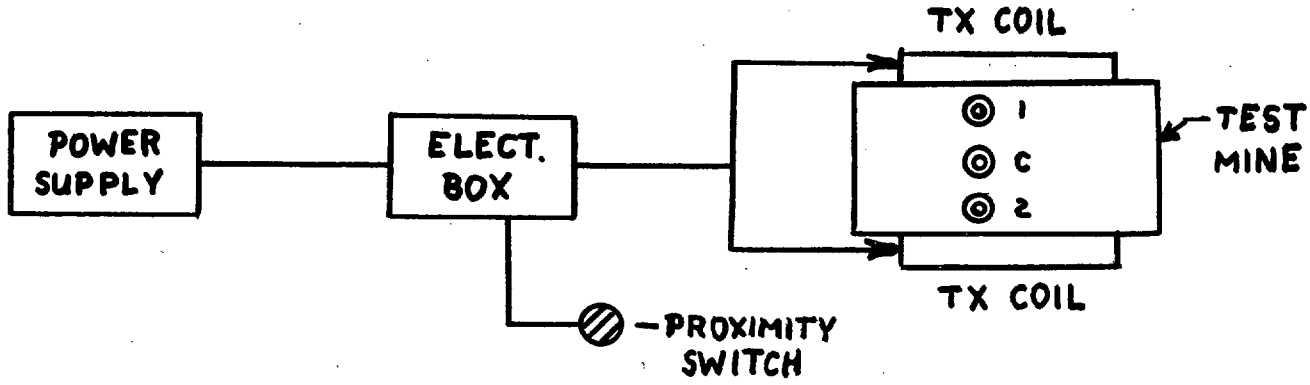

Source: https://assist.dla.mil Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

f. Using metal part (such as screwdriver) activate proximity switch by passing it no more than 1/8 of an inch, over the switch.

g. Using a digital voltmeter measure voltage between common and each output jack (1 and 2). Take measurement as quickly as possible due to rapid discharge of capacitor.

h. Reading shall be 35 volts ± 3. If reading is zero volts, prox. switch was not activated. Trigger prox. switch at closer distance.

i. Use a digital voltmeter to remeasure the requirements specified in 3.4.2.2.

4.5.2.2 Normal setting, static test (P/N 9359924-1).

a. Using "normal" test mine, repeat steps c through g as outlined in 4.5.2.1, substituting "normal" for "extended" in steps c and d.

b. Reading shall be 8 ± 1V. If reading is zero volts, proximity switch was not activated. Trigger prox. switch at a closer distance.

c. Use a digital voltmeter to remeasure the requirements specified in 3.4.1.2.

4.5.2.3 Extended setting, dynamic test (P/N 9359924-2).

a. Start dispenser in accordance with Operator's Manual, TM9-1095-209-10.

b. Mode switch on electronic box to be set at "extended".

c. Using "extended" test mine short pin #1 to common and pin #2 to common (center pin jack.) Check with voltmeter for zero volts.

d. Place test mine into loading chute with pin 2 down, pin 1 up and launch. Record orientation of mine before launch.

e. Retrieve test mine and measure output as pins 1, C and 2, C using digital voltmeter.

f. Use a digital voltmeter to measure the requirements specified in 3.4.2.3.

4.5.2.4 Normal setting, dynamic test (P/N 9359924-1).

a. Using "normal" test mine, repeat steps a through e as outlined in 4.5.2.3, substituting "normal" for "extended" in steps b and c.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

b. Use a digital voltmeter to measure the requirements specified in 3.4.1.3.

4.5.3 Tire and flywheel assembly alignment after assembly to launcher Dwg. 9359983. After assembly of the tire and flywheel assembly to the launcher, place an adapter onto the nut securing the axle into the bearing plate assembly. Insert the torque wrench and rotate the wrench clockwise for two full revolutions minimum. Check the torque needed to turn the tire and flywheel assembly for the requirement specified in 3.6.2.

4.5.4 Protective finish. The specimens shall be tested as specified in TT-C-490, 4.2.8 and 4.2.9 for the requirements in 3.7. The panel shall be exposed to salt spray for 48 hours minimum.

4.5.5 Humidity indicator test. The Humidity Indicator Test shall be performed. After the proper quantity of desiccant has been added to the container desiccant basket and all the fasteners and locking devices have been secured tightly, the humidity indicator shall be examined approximately twelve (12) hours after the container has been sealed. The thirty (30) percent portion of the indicator card must have turned blue in this timeframe for shipment to be allowed to proceed.

5. PACKAGING

5.1 Packaging and packing.

5.1.1 Level A. Packing for Dispenser, Mine: M138 and associated components shall be in accordance with Dwg. 9378330.

5.1.2 Level B. Same as Level A.

5.1.3 Level C. Same as Level A.

5.1.4 Repair parts. All items which are to be procured as repair parts shall be preserved and packaged in accordance with their applicable Special Packaging Instruction Sheet (SPI).

5.2 Marking.

5.2.1 Level A. Marking shall be in accordance with Dwg. 9378330.

5.2.2 Level B. Same as Level A.

5.2.3 Level C. Same as Level A.

5.2.4 Repair parts. Marking for repair parts shall be in accordance with the applicable SPI for each part.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

6. NOTES

6.1 Intended use. The M138, Mine Dispenser is intended to be used in support of the M128 GEMSS Dispenser in dispensing M74 AP, M75 AT and M79 Practice Mines.

6.2 Ordering data. See MIL-W-63150. The DC Motor (P/N 9359810) shall be inspected and tested in accordance with QAP 9359810.

6.3 Submission of inspection equipment designs for approval. See MIL-W-63150. Submit equipment designs as required to: Commander, US Army Armament Research, Development and Engineering Center (ARDEC), ATTN: AMSMC-QAT-I (D), Picatinny Arsenal, New Jersey 07806-5000.

6.4 Distribution of ammunition data cards and test data. Distribution of data cards and functioning test data shall include the following: Commander, US Army Armament Research, Development and Engineering Center, ATTN: AMSMC-QAT-M (D), Picatinny Arsenal, New Jersey 07806-5000.

6.5 Drawings. Drawings listed in Section 2 of this specification under the heading US Army Armament and Research, Development and Engineering Center (ARDEC) may also include drawings prepared by, and identified as US Army Armament Research and Development Command (ARRADCOM), Edgewood Arsenal, Frankford Arsenal or Picatinny Arsenal drawings. Technical data originally prepared by these activities is now under the cognizance of ARDEC.

6.6 Subject term (key word) listing.

Mine Dispenser
Flywheel Assembly
Launcher Assembly
Raceway

6.7 Changes from previous issue. The margins of this specification are marked with asterisks (or vertical lines) to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal rotations and relationship to the last previous issue.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1345-A457)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE ARMY

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12062 WASHINGTON D. C.
POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

COMMANDER
ARDEC
ATTN:AMSMC-QA
PICATINNY ARSENAL, NJ 07806-5000

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-D-70631A	DISPENSER, MINE: M138 (FLIPPER)

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

(TO DETACH THIS FORM, CUT ALONG THIS LINE.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.