MIL-L-1594L
22 March 1978
SUPERSEDING
MIL-L-1594J
21 September 1971 and
MIL-L-001594K(GL)
21 July 1977

MILITARY SPECIFICATION

LANTERN, GASOLINE, LEADED OR NONLEADED FUEL, WITH CASE

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers one type and size gasoline lantern for use with either leaded or nonleaded gasoline.

2. APPLICABLE DOCUMENTS

2.1 Issues of documents. The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

QQ-B-650	-	Brazing Alloy, Copper, Copper-Zinc, and Copper-Phosphorous
QQ-B-654	-	Brazing Alloys, Silver
QQ-N-290	-	Nickel Plating (Electrodeposited)
QQ-P-35	-	Passivation Treatments for Corrosion-Resisting Steel

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to US Army Natick Research and Development Command, ATTN: DRDNA-TDT, Natick, MA 01760 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 6260

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

QQ-S-571	-	Solder; Tin Alloy; Lead-Tin Alloy; and Lead Alloy
QQ-Z-325	-	Zinc Coating, Electrodeposited, Requirements For
TT-E-489	-	Enamel, Alkyd, Gloss (For Exterior and Interior Surfaces)
TT-P-636	-	Primer Coating, Alkyd, Wood and Ferrous Metal
PPP-B-566	-	Boxes, Folding, Paperboard
PPP-B-601	-	Boxes, Wood, Cleated-Plywood
PPP-B-636	-	Boxes, Shipping, Fiberboard
PPP-B-676	-	Boxes, Setup
PPP-C-843	-	Cushioning Material, Cellulosic
PPP-F-320	-	Fiberboard, Corrugated and Solid, Sheet Stock (Container Grade) and Cut Shapes
PPP-T-45	-	Tape, Gummed, Paper, Reinforced and Plain, for Sealing and Securing

MILITARY

MIL-P-116	-	Preservation-Packaging, Methods Of
MIL-B-121	-	Barrier Material, Greaseproofed, Waterproofed, Flexible
MIL-P-149	-	Plastic Coating Compound, Strippable (Hot Dipping)
MIL-S-7916	-	Sealing Compound, Thread and Gasket, Fuel, Oil, and Water Resistant
MIL-L-10547	-	Liners, Case, and Sheet, Overwrap; Water-Vaporproof or Waterproof, Flexible
MIL-T-10727	-	Tin Plating, Electrodeposited or Hot-Dipped, for Ferrous and Nonferrous Metal

STANDARDS

FEDERAL

FED-STD-151	-	Metals; Test Methods
FED-STD-406	-	Plastic: Methods of Testing
FED-STD-595	-	Colors
FED-STD-626	-	Glassware: Methods for Sampling and Testing

MILITARY

MIL-STD-105	-	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	-	Marking for Shipment and Storage

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

DRAWINGS

US ARMY NATICK RESEARCH AND DEVELOPMENT COMMAND

5-13-2581	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Assembly Complete
5-13-2582	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Fount and Spare Parts Container Assemblies
5-13-2583	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Air Pump Barrel and Check Valve Assemblies
5-13-2584	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Pump Plunger and Air Stem Assemblies
5-13-2585	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Frame Assembly
5-13-2586	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Ventilator and Wrench Assemblies
5-13-2587	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Generator Burner Assembly
5-13-2588	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Fuel Valve Assembly
5-13-2589	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Fuel Needle Assembly
5-13-2590	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Filler Cap and Funnel Assemblies
5-13-2591	-	Lantern, Gasoline, Leaded or Nonleaded Fuel, with Case; Case

(Miniature copy of Drawing 5-13-2581, identified as figure 1, is attached for information purposes only.)

(Copies of specifications, standards, drawings and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

AMERICAN WELDING SOCIETY

AWS A2.0 - Standard Welding Symbols

(Application for copies should be addressed to the American Welding Society, Inc., 2501 N.W., 7th Street, Miami, FL 33125.)

Source: https://assist.dla.mil -- Downloaded: 202640-16T13:32Z
Check the source to verify that this is the currentversion before use.

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Associations, Inc., Traffic Department, 1616 P Street, N.W., Washington DC 20036.)

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, IL 60606.)

NATIONAL BUREAU OF STANDARDS

Handbook H28 - Screw Threads for Federal Agencies

(Application for copies should be addressed to the Superintendent of Documents, U.S. Government Printing Office, Washington, DC 20402.)

(Technical society and technical association specifications and standards are generally available for reference from libraries. They are also distributed among technical groups and using Federal agencies.)

3. REQUIREMENTS

3.1 First article. When specified (see 6.2), the contractor shall furnish a sample for first article inspection and approval (see 4.3, 6.2 and 6.4).

3.2 Alternate components. Components offered as equivalent to components specified herein and on the referenced drawings as a specific manufacturer's part or model number or equal shall be functionally equal to the manufacturer's part or model number identified and of equal or better quality. The incorporation and inclusion of such a component in the end product shall not require modification or change to any other specified component, and shall not reduce ease of maintenance to it or any other component, unless such change is specifically approved by the contracting officer. Prior to manufacture of the first article, or, if none, the initial production unit, the contractor shall submit, for the contracting officer's approval, a list identifying each proposed alternate component, together with proof that each listed component complies with requirements specified herein. The contracting officer, at his option, may require a physical sample of the proposed substitution. Approval of the submitted listing, together with necessary supporting data, authorizes commencement of manufacture of the preproduction sample or initial production unit, as applicable, but does not relieve the contractor of the responsibility that these components perform in accordance with specified requirements when incorporated into the end product.

Source: https://assist.dla.mil -- Downloaded: 202640-16T13:32Z
Check the source to verify that this is the current version before use.

3.3 Materials (see 6.5). Materials shall conform to the requirements shown on the applicable drawings and as specified herein. Materials not definitely specified shall be of the quality normally used by the contractor for gasoline lanterns, provided the completed item complies with all provisions of this specification.

3.3.1 Vitreous enameling steel sheet. Vitreous enameling steel sheet used for the ventilator components shown on Drawing 5-13-2586 shall conform to commercial grade ingot iron of the chemical composition in table I when tested as specified in 4.4.1.1.

TABLE I. Chemical composition, vitreous enameling sheets

C (percent)	Mn (percent)	P (percent)	S (percent)	Si (percent)
0.03	0.04	0.10	0.030	TRACE

3.3.2 Brazing alloy, copper. Copper brazing alloy shall conform to composition FS-BCu, wire form of QQ-B-650.

3.3.3 Brazing alloy, silver Silver brazing alloy shall conform to grade IV of QQ-B-654.

3.3.4 Solder, soft. Filler metal used for soft soldered connections shall conform to QQ-S-571.

3.3.5 Plastic.

3.3.5.1 Plastic, fuel valve knob. Plastic for the knob shown on Drawing 5-13-2588 shall be a first grade, mineral filled, thermosetting, phenolformaldehyde, black color, molding compound. The material shall have an Izod impact strength of not less than 0.31 foot-pounds per inch (0.017 J/mm) of notch when tested in accordance with 4.4.1.2. After molding in the described shape, the knob shall withstand continuous heat of 400°F (204.4°C) for 4 hours without permanent deformation, when tested as specified in 4.4.2.3.1.

3.3.5.2 Plastic, generator tube ends. The plastic used as a protective shield for the ends of the spare generator tubes shall conform to type I or II of MIL-P-149.

3.3.6 Glass. The glass shall be capable of resisting thermal shock at a temperature of 160°C with no evidence of shattering, cracking, and deformation when tested as specified in 4.4.2.3.1.

3.3.7 Primer. Primer shall conform to composition G or L of TT-P-636.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

3.3.8 Enamel. Enamel shall conform to class B, composition G or L, olive drab color No. 14087 of TT-E-489.

3.3.9 Sealing compound. Thread sealing compound shall conform to MIL-S-7916 (see 6.3).

3.4 Design and construction. The design and construction of the lantern and case shall conform to the requirements specified herein and shown on Drawings 5-13-2581 through 5-13-2591. Threads shall conform to NBS Handbook H28.

3.4.1 Welding and brazing. Welding symbols shown on the drawings shall be interpreted in accordance with AWS A2.0. Filler metal for soldered and brazed connections shall conform to the applicable requirements in 3.3.2 through 3.3.4.

3.4.2 Sealing of threaded joints. Threaded joints between the fuel valve body and the outlet bushing, and the fuel valve body and the nipple, shall be sealed with compound specified in 3.3.9.

3.4.3 Fount and fuel valve assembly. The fount and fuel valve assembly shall be air tight when tested under 45 to 50 psig (310 to 345 kPa) air pressure as specified in 4.4.2.3.2.

3.4.4 Spring tension of bail. The spring tension of the bail, after installation on the frame assembly, shall be capable of retaining the bail in a position parallel to the axis of the lantern when the lantern is held at an angle of 45 degrees.

3.4.5 Generator tube assembly. When tested as specified in 4.4.2.3.3, the generator tube assembly shall be as shown on Drawing 5-13-2587. The screen cup shall be aligned and properly located. The fiber glass filter shall be extended from the screen cup to the flared end of the tube and be free from being bunched. The generator tube assembly shall be clean and free from grit, dirt, metal chips, and other foreign material.

3.4.5.1 Burner tip. Interior and exterior surfaces of the entire burner tip shall be free from stripped and deformed threads, loose particles, burrs, metal chips, dirt and foreign material when examined as specified in 4.4.2.3.4.

3.4.5.1.1 Orifice. The burner tip orifice shall conform to the size and concentricity with the threaded shank as shown on Drawing 5-13-2587 when examined as specified in 4.4.2.3.5.

Source: https://assist.dla.mil -- Downloaded: 202610-16T13:32Z
Check the source to verify that this is the currentversion before use.

3.4.5.2 Filter. The filter shall consist of fiber glass yarn as specified on Drawing 5-13-2587. When examined as specified in 4.4.2.3.6, the 43 inch (1219 mm) long fiber glass yarn with cut ends at one end shall be folded upon itself to an 8 inch (203 mm) ± 1/2 inch (13 mm) length. The folded yarn shall be installed into the generator tube with the cut ends at the flared end of the tube and with not less than two nor more than three 360 degree turns, end to end.

3.4.6 Air pump assembly. The air pump assembly shown on Drawings 5-13-2583 and 5-13-2584 shall have the plunger cup formed with the flesh side of the leather out, and treated with a commercial grade of silicone oil. The installed and spare plunger cups shall be free of folds, wrinkles and cuts. After assembly to the fount, the air pump shall be capable of raising the air pressure in the fount a minimum of 20 psig (135 kPa), after twenty-five complete downstrokes of the plunger, when tested in accordance with 4.5.4.

3.4.7 Assembled lantern. When the lantern is set on a smooth and level surface, the centerline of the ventilator nut shall be in vertical alignment, within 1/8 inch (3 mm), with the center of the fount bottom, and the fount bottom shall not rock more than 1/16 inch (2 mm), when tested in accordance with 4.5.5.

3.4.8 Case, carrying. The carrying case shown on Drawing 5-13-2591 shall be fabricated from solid fiberboard, weather-resistant, grade V3s, conforming to PPP-F-320. The staples shall be installed vertical, horizontal, or diagonal. The corner scores shall be reversed to reduct excessive wear. The case shall be labeled as specified in 3.7.2.

3.5 Finish.

3.5.1 Zinc plating. Zinc plating shall conform to type I or II, as applicable, class 2 of QQ-Z-325.

(a) The following shall be given the type I zinc plating: generation nut (6-3), air tube bracket (6-11), locking bracket (6-12), welded assembly of yoke (6-15), and weld screw (6-20), manifold block (6-16), manifold tube (6-17), pricker body (9-5), and the welded assembly of the pricker guard (9-2), pricker retaining clip (9-3), and wrench body (9-1).

(b) The following shall be given the type II zinc plating: container cap (13), handle (20-3), pump plunger cap (20-4), frame assembly (3), chain swivel link (7-4), and the body (8-1) and tube (8-2) of the funnel assembly.

3.5.2 Tin and nickel plating.

Source: https://assist.dla.mil -- Downloaded: 202640-16T13:32Z
Check the source to verify that this is the currentversion before use.

3.5.2.1 Tin plating. Prior to assembly, the following components shall be given tin plating conforming to type I of MIL-T-10727:

(a) Washer, support, cup (20-7)
(b) Washer, retainer, cup (20-8)
(c) Spacer, sleeve (20-6)
(d) Pump plunger tube locknuts (20-10)

3.5.2.2 Nickel plating. Prior to brazing and assembly, the following components shall be nickel plated in accordance with class 1, grade F of QQ-N-290:

(a) Shell, fount (2-1)
(b) Bottom, fount (2-2)
(c) Bushing, filler cap (2-4)
(d) Bushing, fuel valve (2-3)
(e) Body, container (2-6)
(f) End, body, container (2-7)
(g) Rings, locking, container (2-8)
(h) Rings, locking, pump (2-9)
(i) Base, pump (2-14)
(j) Barrel, pump (2-13)
(k) Tube, air, pump (2-15)
(l) Rings, retaining (7-6 and 8-4)

3.5.3 Enameling.

3.5.3.1 Vitreous enameling. The bottom (4-1), ring (4-2), and top (4-3) of the ventilator assembly shall be given a ground coat of commercial quality vitreous enamel. In addition, the exterior surfaces shall be given a finish coat of commercial quality vitreous enamel. The color of the finish coat shall be olive drab to approximate color No. 14087 of FED-STD-595. The vitreous enamel finish shall not crack or spall when tested in accordance with 4.5.6.

3.5.3.2 Priming and alkyd enameling. Following assembly of the fount and frame rest, all inside and outside surfaces shall be thoroughly cleaned to remove all grease, dirt, and other foreign matter. After cleaning, the outside surface of the fount and all surfaces of the frame rest shall be given one coat of primer specified in 3.3.7. After drying, primed surfaces shall be coated with enamel specified in 3.3.8.

3.5.4 Globe quadrant. The globe quadrants shall have a plain rolled glass finish and shall be free of cracks, chips, or sharp edges. Surface need not be polished.

Source: https://assist.dla.mil -- Downloaded: 202610-16T13:32Z
Check the source to verify that this is the currentversion before use.

3.5.5 Passivation. After fabrication, the following shall be passivated in accordance with QQ-P-35: fuel needle (5-19), mantle holder (6-18), generator tube support (6-19), and check ball (19-2) when fabricated of corrosion resisting steel.

3.6 Instructions.

3.6.1 Markers. One or more decals bearing the following information shall be located approximately as shown on Drawing 5-13-2581, and shall be applied in accordance with the marker supplier's instructions.

CAUTION: EXCESSIVE STARTING PRESSURE WILL BE BREAK NEWLY INSTALLED MANTLE

To Install New Mantle

1. Tie mantle firmly around mantle holder. Distribute fabric evenly around holder. Mantle must not touch generator.
2. Tighten drawstring. Make square knot. Cut off excess string.
3. Check to see if fuel valve is closed.
4. Pressurize fuel tank (see step 4 of lighting and operation instructions).
5. Light mantle evenly on bottom with match. Allow to burn out to complete ash.
6. Crack open fuel valve. Re-light mantle to form mantle to bulbous shape.

LIGHTING AND OPERATION

1. Be sure fuel valve is tightly closed. Remove filler cap slowly allowing air pressure to escape.
2. With lantern on a level surface, fill with any type clean gasoline.

CAUTION: Do not tip lantern while filling.

3. Replace filler cap and tighten firmly with fingers.
4. Open air check valve (turn pump plunger tube two turns to left while in full down position). Place thumb over hole on plunger handle and pump 15 to 25 complete down strokes. Close check valve (turn pump plunger tube to right while in full down position).

Source: https://assist.dla.mil -- Downloaded: 202610-16T13:32Z
Check the source to verify that this is the current version before use.

5. Place lighted match through lighter hole in frame base. Hold under mantle. Open fuel valve one quarter turn to left. CAUTION: Do not exceed this setting.

6. When mantle brightness becomes steady, turn fuel valve wide open.

7. Pump 15 to 25 more complete down strokes.

MAINTENANCE

1. In event of light failure or dimming not caused by lack of air pressure, remove generator tube. (May require replacement especially when generator tube has been used in excess of 300 hours.)

2. Unscrew burner tip.

3. Clean tiny hole in burner tip with pricker wire on wrench.

4. Blow out loose particles from burner tip and generator tube ends.

5. Reassemble.

6. Flush out fuel tank with gasoline when replacing generator tube.

7. Keep plunger cup leather soft with light silicone oil.

PRECAUTION

Provide good ventilation when using lantern.

3.7 Marking for identification.

3.7.1 Lantern. The letters "U.S.", manufacturer's name, trade name or trademark, and the year of contract shall be indented in the size characters and location shown on Drawing 5-13-2582. Other marking requirements shall be as shown on Drawings 5-13-2584, 5-13-2585, 5-13-2588, and 5-13-2590.

3.7.2 Case, carrying. Each carrying case shall have the following identification markings printed in the location shown on Drawing 5-13-2591.

STOCK NUMBER OF LANTERN
NOMENCLATURE
LISTING OF SPARE PARTS CONTAINED WITHIN, INCLUDING STOCK NUMBER
CONTRACTOR'S NAME AND ADDRESS

Source: https://assist.dla.mil -- Downloaded: 202610-16T13:32Z
Check the source to verify that this is the current version before use.

3.8 Spare parts. The spare parts and tools listed in table II shall be furnished with each lantern:

TABLE II. Spare parts and tools.

Quantity	Nomenclature	Detail Drawing
2	Generator tube assembly	5-13-2587
1	Plunger cup	5-13-2584
6	Mantle	5-13-2581
1	Pricker assembly	5-13-2586
1	Wrench assembly	5-13-2586

3.9 Repair parts and special tools list. Repair parts and special tools, including sub-assemblies and components of sub-assemblies, as specified (see 6.2) shall conform to all the provisions specified herein and on applicable drawings. In addition, a list of the repair parts and special tools with applicable information as shown herein on 8 by 10-1/2 inch (200 x 262 mm) white paper shall be furnished with each lantern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

REPAIR PARTS AND SPECIAL TOOLS LIST, MIL-L-1594 LANTERN, GASOLINE

National stock number	Description	Unit of issue	Quantity per lantern unit	Guide quantities per major equipments 15 days maintenance organization 1-5	6-10	DS (see note) 100 Equipments	GS (see note)
6260-00-284-0554	Burner & Generator Assy	EA	1	*	*	2	2
6260-00-161-1859	Locknut, Generator	EA	1	*	*	2	2
6260-00-270-4060	Mantle (6 per box)	box	1	2	4	30	30
6260-00-284-0549	Valve, Fuel Assy	EA	1	*	*	2	2
6260-00-270-4061	Cap, Filler	EA	1	*	*	2	2
6260-00-284-0555	Plunger Assy, Pump	EA	1	*	*	2	2
6260-00-624-4847	Valve & Stem Assy Pump	EA	1	*	*	2	2
6260-00-174-3873	Channel, Globe	EA	4	*	*	4	4
6260-00-174-3874	Quadrant, Globe	EA	4	*	*	8	8
6260-00-553-1090	Parts Kit, Repair	EA	1	2	2	16	16
6260-00-578-7162	Funnel, Filling	EA	1	*	*	2	2
5120-00-288-9687	Wrench Assy	EA	1	*	*	2	2
5120-00-646-7576	Tool, Check Valve	EA	0	*	*	*	*
6260-00-273-9219	Reflector, Accessory	EA	0	*	*	2	2

SAVE THIS LIST FOR ORDERING REPAIR PARTS

NOTE: T/M 10-6260-201-20P has been rescinded, use above list for ordering repair parts.

DS - Defense Nuclear Agency

GS - Defense General Supply Center

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

3.10 Performance. While burning leaded gasoline, the lantern shall be capable of burning steadily and bright without any flame failure, sputterig, dimming, or variation in light intensity when tested as specified in 4.5.7.

3.11 Workmanship. The lantern shall be fabricated of new parts, properly fastened and aligned, and completely assembled. The parts shall be well formed, free of dents, knicks, warpage, fractures, burrs, slivers, and unspecified bends. Threads shall not be stripped, crossed, broken or marred. All welded, brazed and soldered connections shall be sound, smooth, continuous, free of pits, excess filler metal, and flux deposits. All enameled and plated surfaces shall be covered completely, i.e., free from area of no coating. The enamel finish shall be smooth, adherent, free of sag, runs, peeling, chips, scratches, stains, blisters, fish scale, burn off, crazing, pin holes, wrinkles, embedded foreign matter, over-spray, and wet and tacky paint.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Certificate of compliance. Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.3).
b. Quality conformance inspection (see 4.4).

4.3 First article inspection. When a first article is required, whether the first article is a complete lantern, sub-assembly or component, it shall be examined for applicable defects listed in table III, dimensions specified, and the complete lantern shall be tested in accordance with 4.5.4, 4.5.5, 4.5.6, and 4.5.7. The presence of any visual defect, dimension not within specified limits, or failure to pass any test shall be cause to reject the first article.

4.4 Quality conformance inspection. Sampling for inspection shall be performed in accordance with MIL-STD-105, except where otherwise indicated herein.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

4.4.1 Component and material inspection. In accordance with 4.1, components and materials shall be inspected in accordance with all the requirements of referenced specifications, drawings, and standards unless otherwise excluded, amended, modified or qualified in this specification or applicable purchase document.

4.4.1.1 Chemical analysis of enameling steel sheet. The vitreous enameling steel sheets used for ventilator components shall conform to the requirements of 3.3.1 when tested in accordance with Method 111 or 112 of FED-STD-151. A certificate of compliance, verifying that these requirements have been met, shall be acceptable.

4.4.1.2 Impact strength of plastic knob material. The knob material shall be tested in accordance with Method 1071 of FED-STD-406, to determine compliance with the impact requirement in 3.3.5.1. The inspection lot shall be all material from an identifiable batch produced under the same conditions in one unchanged process, and offered for inspection at one time. The sample unit shall be one test specimen molded from material extracted from the approximate center of the packing container. Nonconformance to the impact requirement in 3.3.5.1 shall be cause to reject the lot represented by the sample unit.

4.4.2 In-process inspection. Inspection shall be made at any point or during any phase of the manufacturing process to determine whether operations or assemblies are accomplished as specified. The Government reserves the right to exclude from consideration for acceptance, any material or service for which in-process inspection has indicated nonconformance.

4.4.2.1 In-process visual examination. Visual examination shall be conducted to assure that accomplishment of the following operations are in accordance with specification requirements:

Operation	Requirement paragraph
Sealing of threaded joints, where applicable	3.4.2
Shaping and treatment of plunger cup	3.4.6
Zinc plating	3.5.1
Tin plating	3.5.2.1
Nickel plating	3.5.2.2
Vitreous enameling	3.5.3.1
Priming	3.5.3.2
Passivation	3.5.5

Whenever nonconformance is noted, correction shall be made to the items affected and the operation.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

4.4.2.1.1 Fuel valve assembly. Prior to assembly the fuel valve stem, threads, stem point, valve seat and packing shall be examined to check that:

(1) The threads shall not be stripped, crossed, broken or marred.

(2) The stem point shall not be broken or point surface scratched or marred.

(3) The valve seat shall not be scratched or marred.

(4) The packing shall not be frayed, cut, abraded, improperly formed, and shall be of uniform thickness.

When any nonconformance is noted, correction shall be made to the affected item and process.

4.4.2.2 In-process dimensional examination. Dimensional examination shall be conducted on all components or sub-assemblies which cannot be examined after final assembly with the exception of the burner tip orifice, whose dimensions are examined under 4.4.2.3.5. Inspection lots shall consist of all like components or sub-assemblies submitted for inspection at one time. The inspection level shall be II with an acceptable quality level (AQL) of 2.5, expressed in terms of defects per hundred units. Any dimension not within specified tolerance shall be classified as a defect.

4.4.2.3 In-process testing. Testing shall be performed on components and sub-assemblies which cannot be tested after assembly in the finished lantern. Specific components to be tested, methods of testing and criteria for rejection of lots or individual components as applicable, shall be as described in 4.4.2.3.1 through 4.4.2.3.6.

4.4.2.3.1 Plastic knobs and glass quadrants. Plastic knobs and glass quadrants shall be tested in accordance with 4.5.1 and 4.5.2 respectively. The inspection lot shall be either all plastic knobs or all glass quadrants, as applicable, submitted for inspection at one time. The sample unit shall be either one knob or one glass quadrant as required. Inspection level of S-2 with an AQL of 6.5 expressed in terms of defects per hundred units shall apply to either the plastic knob temperature test or the glass quadrant thermal shock test.

4.4.2.3.2 Fount and fuel valve assembly. Each fount and fuel valve assembly shall be tested in accordance with 4.5.3. Any failure of the test shall be cause to reject the affected items.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

4.4.2.3.3 Generator tube assembly. The generator tube assembly shall be analyzed by appropriate x-ray techniques to determine compliance with the requirements specified in 3.4.5. The inspection lot shall be all generator tube assemblies submitted for inspection at one time. The sample unit shall be one generator tube assembly. The inspection level shall be S-2 with an AQL of 1.5, expressed in terms of defects per hundred units. Any evidence of the following on the x-ray plates shall be classified as a defect:

(a) Screen cup missing, misaligned, or not properly located.

(b) Fiber glass filter missing, bunched, or not extended from the screen cup to the flared end of the tube.

(c) Component missing, i.e., burner tip.

(d) Grit, dirt, metal chips, or other foreign material.

4.4.2.3.4 Burner tip. Interior and exterior surfaces of the burner tip shall be microscopically examined under not less than 10 power magnification. The inspection lot shall be all of the burner tips submitted for inspection at one time. The sample unit shall be one burner tip. The inspection level shall be II with an AQL of 1.5, expressed in terms of defects per hundred units. Any evidence of stripped or deformed threads, loose particles, burrs, metal chips, dirt or foreign material on any surface as specified in 3.4.5.1 shall be classified as a defect.

4.4.2.3.5 Burner tip orifice. The burner tip orifice shall be examined for size and concentricity with the threaded shank as shown on Drawing 5-13-2587. The burner tip shall be jigged to rotate on the thread axis. The burner tip orifice shall be examined in an optical comparator or illuminated microscope having a reticle graduated in thousandths of an inch. The inspection lot shall be all the burner tips submitted for inspection at one time. The sample unit shall be one burner tip. The inspection level shall be II with an AQL of 1.5, expressed in terms of defects per hundred units. Any concentricity or size of orifice not within specified tolerance on Drawing 5-13-2587 shall be classified as a defect.

4.4.2.3.6 Installation of fiber glass yarn in generator tube. The installation of fiber glass yarn in the generator tube shall be examined to determine compliance with the requirements specified in 3.4.5.2. The fiber glass yarn shall be carefully removed from the generator tube without twisting. The inspection lot shall be all the generator tube and filter assemblies submitted for inspection at one time. The sample unit shall be one generator tube and filter assembly. The inspection level shall be S-3 with an AQL of 1.5, expressed in terms of defects per hundred units. Any evidence of the following shall be classified as a defect:

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

(a) Not folded to 8 inch (203 mm) lengths, ± 1/2 inch (13 mm).

(b) Less than two or more than three 360 degree turns.

(c) Cut ends not at flared end of tube.

(d) Unfolded fiber glass yarn not 48 inches (1219 mm), ± 1/2 inch (13 mm) in length.

4.4.3 End item inspection. The inspection lot shall be all complete lanterns offered for inspection at one time or all sub-assemblies or components as applicable, when ordered separately (see 6.2), offered for inspection at one time. The sample unit shall be one complete lantern, one sub-assembly or one component, as applicable.

4.4.3.1 End item visual examination. The completely assembled lantern or sub-assembly or particular component, as applicable, offered for inspection shall be examined for applicable defects listed in table III. The inspection level for the complete lantern shall be II with an AQL of 2.5 for major defects and 10 for total defects expressed in terms of defects per hundred units. The inspection level shall be II for the sub-assembly or particular component, as applicable with an AQL of 1.5 for major defects and 6.5 for total defects expressed in terms of defects per hundred units.

TABLE III. Classification of defect

Examine	Defect	Classification Major	Minor
Finish			
Enameled and metallic coating	Not specified type or color is not as specified.		X
	Not completely covered, i.e., no film.		X
	Not smooth or not adherent.		X
	Evidence of sag, runs, peeling, chips, scratches, stains, blisters, fish scale, burn off, crazing, pin holes, wrinkles, imbedded foreign matter, over-spray, wet or tacky paint.		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

TABLE III. Classification of defect (cont'd)

Examine	Defect	Classification Major	Minor
Construction and workmanship, general (applicable to all components and assemblies)	Burrs, slivers, splinters, chipped or sharp edges.	X	
	Any functioning component that requires abnormal force to operate.		X
	Component not clean.		X
	Component not fabricated of applicable referenced material	X	
	Component missing or not specified type.	X	
	Component fractured, broken, split, punctured, torn, cracked, bent, nicked, dented, warped, creased, deteriorated, bowed, unspecified bends, sprung, misplaced or malformed:		
	(a) affecting serviceability	X	
	(b) not affecting serviceability		X
	Component loose.		X
	Not properly assembled.		X
	Threads stripped, marred, broken or crossed.	X	
Globe quadrant	Broken or distorted.	X	
Mantle	Broken.	X	
	Tie-string missing or broken.	X	
Leather cup	Leather cup with folds, cuts or wrinkles. (Remove from lantern cylinder pump to examine).	X	
	Not formed with flesh side out.	X	
	Improperly formed.	X	
Bail	Bail loose.		X
	Will not remain in line with axis of lantern when lantern is held at 45° angle.		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

TABLE III. Classification of defect (cont'd)

Examine	Defect	Classification Major	Minor
Welding and brazing (where required)	Not type specified, missing, burn hole, cracked, fractured, not continuous, not adherent, or not fused.	X	
	Slag inclusion, not smooth and uniform, scale or flux deposits not removed.		X
Soldering (when applicable)	Missing, excess solder, not adherent, or incomplete.	X	
	Not clean, not smooth, or pin hole in solder.		X
Marking			
Instruction marking	Missing, illegible, or incorrect.	X	
	Incorrect color or faulty application.		X
Lantern identification marking	Missing; incomplete; incorrect, not legible; not size required; not in proper location; not affixed in prescribed manner.		X
Carrying case marking	Missing; incorrect; incomplete; not in proper location; not applied in prescribed manner.		X

4.4.3.2 End item dimensional examination. Inspection shall be made of the complete lantern, sub-assembly or particular component, as applicable, for compliance with dimensions specified. Any dimension not within specified tolerance shall be classified as a defect. The inspection level shall be S-2 for the complete lantern with an AQL of 6.5, expressed in terms of defects per hundred units. The inspection level for sub-assemblies or particular components, as applicable, when procured separately, shall be S-2 with an AQL of 2.5 expressed in terms of defects per hundred units.

4.4.3.3 End item testing. Assembled lanterns shall be tested as specified in 4.5.4, 4.5.5, 4.5.6 and 4.5.7. The inspection level shall be S-2. Failure to pass any test shall be cause to reject the lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

4.4.4 Packaging inspection. An examination shall be made to determine that preservation-packaging, packing, and marking comply with the section 5 requirements. Defects shall be as specified in table IV. The sample unit shall be one shipping container fully prepared for delivery. The lot shall be all shipping containers offered for inspection at one time. The inspection level shall be S-2 and the AQL shall be 4.0, expressed in terms of defects per hundred units.

TABLE IV. Packaging inspection

Examine	Defect
Markings (exterior and interior container)	Missing; incorrect; illegible; of improper size, location, sequence, or method of application.
Materials	Any nonconforming component. Component missing, damaged, or otherwise defective.
Workmanship	Inadequate application of components such as inadequate cushioning, inadequate sealing of interior wraps and boxes, incomplete closure of case liner, and bulged or distorted container.
Contents (exterior and interior container)	Number per container is more or less than required, including maintenance parts, tools, and repair parts and special tools list.

4.5 Test methods.

4.5.1 Knob temperature test. The knob shall be heated to 400°F (204.4°C) in a temperature controlled oven for a minimum period of 4 hours. The knob shall than be removed from the oven and examined. Any evidence of the knob being permanently deformed or not retaining its described shape as specified in 3.3.5.1 shall be classified as a defect.

4.5.2 Glass thermal shock test. Globe quadrants shall be heated to 160°C in a temperature controlled oven then tested in accordance with method 401 of FED-STD-626. Any evidence of shattering, cracking or deformation as specified in 3.3.6 shall be classified as a defect.

4.5.3 Leak test. The leak test shall be conducted in the following manner:

Source: https://assist.dla.mil -- Downloaded: 202610-16T13:32Z
Check the source to verify that this is the currentversion before use.

a. Assemble nipple adapter to fuel valve assembly.
b. Assemble fuel valve assembly to fount assembly.
c. Close fuel valve finger tight.
d. Attach an air pressure fitting with valve and gage to filler cap bushing.
e. Connect air pressure fitting to an air pressure supply.
f. Remove the tube assembly of the pump plunger but retain the air stem assembly. Keep the air stem assembly closed finger tight.

The empty fount shall be pressurized with air between 45 and 50 psig (310 and 345 kPa). The pressurized assembly shall be submerged in a clear liquid beyond the nipple adapter and observed for not less than 30 seconds. Any evidence of air bubbles, while submerged as specified in 3.4.3, shall constitute failure of the test.

4.5.4 Pump test. The fount shall be filled with 1-1/2 pints (0.71 liter) of fresh, clean, leaded gasoline, and a pressure gage attached to the filler cap bushing. The filled fount shall then be pressurized by twenty-five complete down strokes of the air pump, plunger assembly, the check valve closed by hand, and the pressure obtained shall be observed. Failure to obtain a minimum reading of 20 psig (138 kPa) as specified in 3.4.6 shall constitute failure of the test.

4.5.5 Vertical alignment and stability test. The lantern shall be placed on a smooth and level surface. The distance from the centerline of the ventilator nut to the vertical axis of the fount bottom shall be measured to determine compliance with 3.4.7. The base shall then be rocked and checked with a 1/16 feeler gage. Vertical centerline deviation exceeding 1/8 inch (3 mm), or base rock exceeding 1/16 inch (2 mm) shall constitute failure of the test (see 3.4.7).

4.5.6 Vitreous enamel test. The lantern shall be lighted and operated for not less than 30 minutes in an ambient temperature range of 60°F to 80°F (15.6°C to 26.7°C). The ventilator assembly shall be removed from the lantern and immediately quenched in water having a temperature of 60°F ± 2°F (15.6°C ± 1°C). Any evidence of spalling or cracking of the finish shall constitute failure of the test (see 3.5.3.1).

4.5.7 Lantern operational test. Using leaded gasoline, the lantern shall be started in accordance with the operating instructions and shall be operated for not less than 15 minutes. Any visible evidence of flame failure, sputtering dimming, or variation in light intensity as specified in 3.10, shall constitute failure of the test. After the test is completed, all unused gasoline shall be completely removed from the fount.

5. PACKAGING

5.1 Preservation-packaging. Preservation-packaging shall be level A.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

5.1.1 Level A.

5.1.1.1 Lantern, complete, with globe.

5.1.1.1.1 Globe, quadrant. The four globe quadrants shall be inserted in the globe channels. Cellulosic cushioning material of the proper thickness, conforming to type II, class A or B of PPP-C-843 shall be placed over the top circumference of the globe to prevent vibration and movement of each quadrant during transit and storage. The ventilator assembly shall then be replaced and the ventilator nut turned finger tight.

5.1.1.1.2 Spare parts and tools. The six mantles, stacked one on top of another, shall be tightly roll-wrapped in greaseproof barrier-material conforming to type II, grade A, class 1 or 2 of MIL-B-121. The plunger cup and pricker assembly shall be wrapped separately in the same type barrier-material. The pricker assembly, wrench assembly, together with the wrapped mantles and leather plunger cup, shall be carefully placed in the spare parts container of the lantern. The two generator tube assemblies, with plastic coated ends, shall be inclosed in a kraft paper envelope. The funnel shall be secured to the frame rest with minimum 0.035-inch (.9 mm) diameter annealed wire. The filler cap, spare parts container cap, and pump plunger cap shall be tightened sufficiently to prevent loosening due to vibration while in transit.

5.1.1.1.3 Lantern. The lantern, prepared as specified, shall be placed in the carrying case specified in 3.4.8, with the fount resting on the lower tray and the bail handle diagonally in the corners of the case. The opening in the upper tray shall extend over the top of the ventilator assembly as shown on Drawing 5-13-2591. The list of repair parts and special tools, and the envelope containing the two generators, shall be placed in the upper tray.

5.1.1.1.4 Closure. Sealing of the carrying case shall be effected by first folding the smaller top flaps, then the larger flaps, and securing in position with minimum 3-inch (75 mm) width gummed paper tape conforming to type III, grade B of PPP-T-45. The tape shall be of sufficient length to allow a 3-inch (75 mm) overlap on each side and shall cover the handle opening, but not the printing on the outer flap of the case.

5.1.1.2 Repair parts and special tools (when procured separately).

5.1.1.2.1 Quadrants. Four quadrants shall be nested alternately between five pieces of single-face, nontest, corrugated fiberboard, which extend 1/4 inch (6 mm) beyond all edges of the quadrants, and packaged in a nontest corrugated fiberboard box constructed to fit the contents in a compact manner conforming to style RSC of PPP-B-636. Closure of the box shall be effected by means of gummed paper tape, minimum 1-1/2 inches (38 mm) wide, conforming to type III, grade B of PPP-T-45.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

5.1.1.2.2 Channels. Four channels, interlocking to form a unit, shall be securely wrapped in minimum 60-pound basis weight (24 x 36-500) (100 g/m^2) kraft paper. The wrap shall be secured with tape specified in 5.1.1.2.1. The four channels shall then be packaged in a folding or setup paperboard box conforming to PPP-B-566 or PPP-B-676, respectively. Closure shall be as specified in 5.1.1.2.1.

5.1.1.2.3 Other repair parts. All other repair parts and special tools shall be prepared in accordance with Method III of MIL-P-116.

5.2 Packing. Packing shall be level A, B, or C, as specified (see 6.2).

5.2.1 Level A packing.

5.2.1.1 Lantern, complete with globe. Eight complete lanterns, preserved-packaged as specified in 5.1, shall be packed upright, four in length and two in width in a snug-fitting, cleated plywood shipping container conforming to overseas type of PPP-B-601. Each shipping container shall be provided with a type I or II, grade C case liner conforming to MIL-L-10547. Each shipping container shall be closed and strapped in accordance with the appendix of PPP-B-601.

5.2.1.2 Repair parts and special tools (when procured separately).

5.2.1.2.1 Globe, quadrants, and channels. One hundred globes, or 400 quadrants, or 1600 channels, preserved-packaged as specified in 5.1, shall be packed in snug-fitting shipping containers conforming to overseas type of PPP-B-601. Each shipping container shall be provided with a type I or II, grade C case liner conforming to MIL-L-10547. Each shipping container shall be closed and strapped in accordance with the appendix of PPP-B-601.

5.2.1.2.2 Other repair parts. All other repair parts and special tools, preserved-packaged as specified in 5.1, shall be packed as specified in 5.2.1.2.1, except that gross weight of each shipping container shall not exceed 200 pounds (90.7 kg).

5.2.2 Level B packing.

5.2.2.1 Lantern, complete, with globe. Eight complete lanterns, preserved-packaged as specified in 5.1, shall be packed upright, four in length and two in width, in a snug-fitting fiberboard shipping container conforming to style RSC, type CF, variety optional, or type SF, class domestic, grade 275 of PPP-B-636. Closure shall be in accordance with method II of the appendix of PPP-B-636.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.

5.2.2.2 Repair parts and special tools (when procured separately).

5.2.2.2.1 Globes, quadrants, and channels. One hundred globes, or 400 quadrants, or 1600 channels, preserved-packaged as specified in 5.1, shall be packed in a snug-fitting fiberboard shipping container conforming to style RSC, type CF, variety optional, or type SF, class domestic, grade 275 of PPP-B-636. Closure shall be in accordance with method II of the appendix of PPP-B-636.

5.2.2.2.1.1 Weather-resistant containers. When specified (see 6.2), the shipping container shall be a grade V3c, V3s, or V4s fiberboard box fabricated in accordance with PPP-B-636 and closed in accordance with method III as specified in the appendix of PPP-B-636.

5.2.2.2.2 Other repair parts. All other repair parts and special tools, preserved-packaged as specified in 5.1, shall be packed as specified in 5.2.2.2.1, except that gross weight of each shipping container shall not exceed 200 pounds (90.7 kg).

5.2.3 Level C packing. Lanterns with cases, globes, quadrants, and channels, preserved-packaged as specified in 5.1, shall be packed in a manner to insure carrier acceptance and safe delivery at destination at the lowest transportation rate for such supplies. The quantity per shipping container shall be the same as that normally used by the contractor for retail distribution. Containers shall comply with Uniform Freight Classification or National Motor Freight Classification, as applicable.

5.3 Marking. In addition to any special marking required by the contract, interior boxes, except lantern carrying cases, and shipping containers shall be marked in accordance with MIL-STD-129.

5.3.1 Special marking. Each shipping container, except those containing channels only or other repair parts and special tools (see 5.2.1.2 and 5.2.2.2), shall be marked with the word "GLASS" and the special handling marking requirements applicable to fragile items in accordance with MIL-STD-129.

6. NOTES

6.1 Intended use. The lantern covered by this specification is intended to furnish illumination in the field.

6.2 Ordering data. Procurement documents should specify the following:

(a) Title, number, and date of this specification.
(b) When a first article is required (see 3.1, 4.3, and 6.4).

Source: https://assist.dla.mil -- Downloaded: 202610-16T13:32Z
Check the source to verify that this is the current version before use.

(c) Sub-assemblies or components of sub-assemblies required (see 3.9).
(d) Selection of applicable level of packing (see 5.2).
(e) When weather-resistant grade fiberboard shipping containers are required for level B packing (see 5.2.2.2.1.1).

6.3 Source of supply. The following information is furnished only to indicate a possible source of supply. Permatex Sealant 572 by Woodhill/ Permatex, Inc., 18731 Cranwood Parkway, Cleveland, OH 44128, has proven to meet the requirements of MIL-S-7916 (see 3.3.9).

6.4 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of ASPR 7-104.55. The first article should be a preproduction sample consisting of a complete lantern or, when applicable, one each of the component parts, and sub-assemblies, including packaging. The contracting officer should include specific instructions in all procurement instruments regarding arrangements for examination, test, and approval of the first article.

6.5 Recycled material. It is encouraged that recycled material be used when practical as long as it meets the requirements of this specification (see 3.3).

6.6 Metric equivalents. Metric equivalents, indicated in parentheses throughout this document, are based on practices, conversion factors, and symbols specified in ASTM E 380 Standard for Metric Practice, and are for information only. In each instance, the value stated in US customary units shall be controlling.

6.7 Changes from previous issue. Asterisks are not used in this revision to identify changes with respect to the previous coordinated issue, due to the extensiveness of the changes.

Custodians:

Army - GL
Air Force - 99

Review activity:

DLA - GS

User activities:


Navy - MC, CG

Preparing activity:

Army - GL

Project No. 6260-0044

Source: https://assist.dla.mil -- Downloaded: 202610-16T13:32Z
Check the source to verify that this is the current version before use.

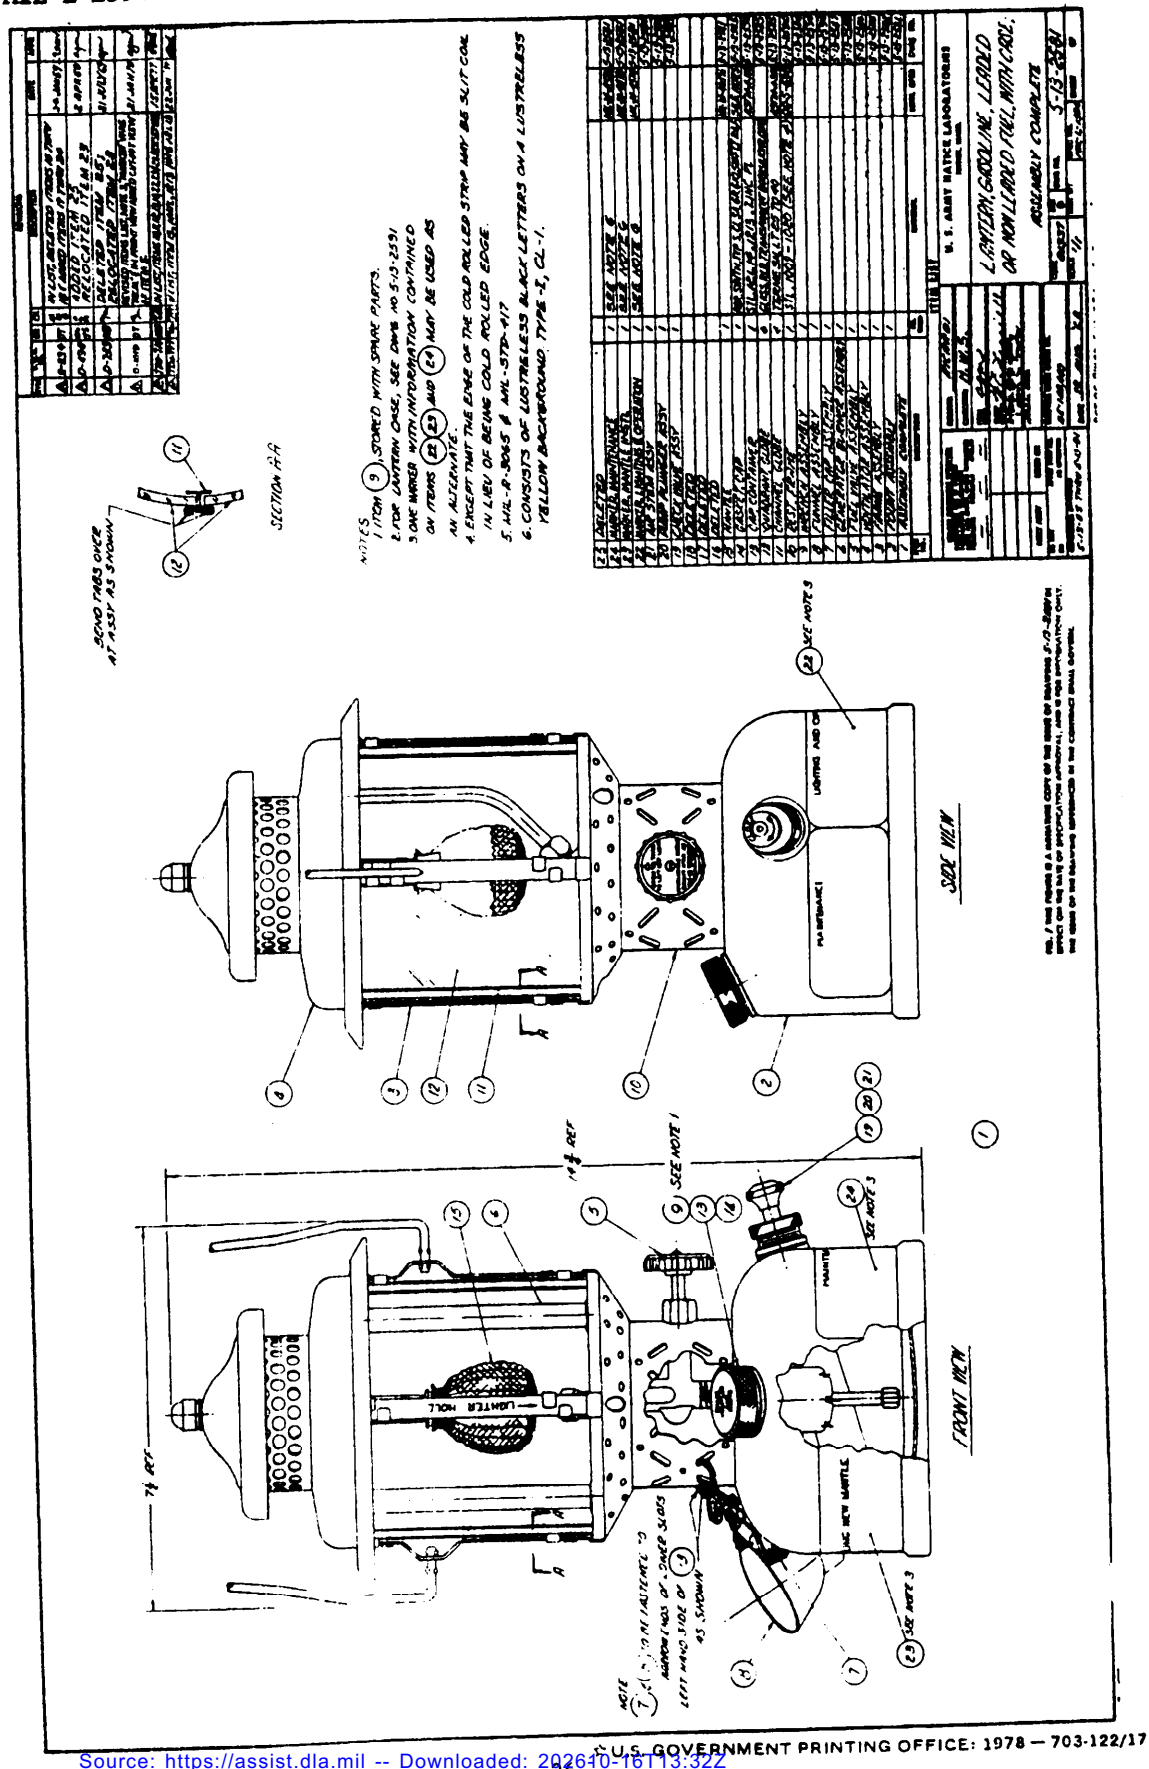

Source: https://assist.dla.mil -- Downloaded: 2026-01-16 13:32
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.

NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-L-1594L; LANTERN, GASOLINE, LEADED OR NONLEADED FUEL, WITH CASE

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO

DATE

DD FORM 1 OCT 76 1426

EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED

Source: https://assist.dla.mil -- Downloaded: 202610-16T13:32Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE ARMY
US ARMY NATICK RESEARCH and DEVELOPMENT COMMAND
NATICK, MASSACHUSETTS 01760

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300
DRXNM-TDT

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY
DOD-314

U.S. MAIL

Commander
US Army Natick Research and Development Command
ATTN: DRXNM-TDT
Natick, MA 01760

NATICK OP 1 JUL 77
FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T13:32Z
Check the source to verify that this is the current version before use.