MIL-S-55528A(EL)
27 October 1971
Superseding
MIL-S-55528(EL)
25 November 1966

MILITARY SPECIFICATION

SHELTER, ELECTRICAL EQUIPMENT S-298( )/TRC-110(V)

1. SCOPE

1.1 Scope. - This specification covers an air or vehicular transportable shelter facility which is part of the 12 or 24 channel pulse code modulation systems radio Repeater Set, Radio AN/TRC-110( ), for use between Corps and Army within the Army Area Communication System (See 6.1 and 6.2).

1.2 Description. - Shelter, Electrical Equipment S-298( )/TRC-110(V) hereinafter called the shelter facility, includes a modified S-280( )/G shelter and all racks, brackets, shelves, tie-downs, electrical components and wiring to enable installation and operation of the assemblage components of the AN/TRC-152( )(V).

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this document to the extent specified herein:

SPECIFICATIONS

MILITARY

MIL-P-116	Preservation, Methods of
MIL-C-3885	Cable Assemblies and Cord Assemblies (for use in Electronic and Associated Electrical Equipment)

FSC 5820

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

MIL-W-6858	Welding, Resistance, Aluminum Magnesium, Non-Hardening Steels or Alloys, Nickel Alloys, Heat-Resisting Alloys and Titanium, Spot and Seam
MIL-T-7928	Terminals, Lug and Splice, Crimp Style Copper
MIL-M-13231	Marking of Electronic Items
MIL-F-14072	Finishes for Ground Signal Equipment
MIL-W-45205	Welding, Gas, Metal-Arc and Gas, Tungsten-Arc, Aluminum Alloys, Readily Weldable, for Structures, Excluding Armor
MIL-S-55505	Shelter, Electrical Equipment (Containing Equipment) Packaging and Packing of

STANDARDS

MILITARY

MIL-STD-105	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-252	Wired Equipment, Classification of Visual and Mechanical Defects
MIL-STD-461	Electromagnetic Interference Characteristics Requirements for Equipment
MIL-STD-1235	Single and Multilevel Continuous Sampling Procedures & Tables for Inspection by Attributes

DRAWINGS

ELECTRONICS COMMAND

SC-A-46691	RF Cable Assembly Tests
SC-C-532288	Schematic Diagram Voltage Cut-out Protector

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

The [illegible] of the RVS-7 and its components

SC-DL-546977	Shelter, Electrical Equipment, S-298( )/TRC-110(V)
SC-D-547008	Power Schematic
SC-D-547288	Power Wiring Diagram (Signal Entrance Box)

(Copies of specifications, standards, drawings, and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer. Both the title and number or symbol should be stipulated when requesting copies).

3. REQUIREMENTS

3.1 Preproduction Sample.- Unless otherwise specified in the invitation for bids and contract, the contractor shall furnish one preproduction sample of the shelter facility for approval. (See 4.3)

3.2 Construction.- The shelter facility shall be constructed in accordance with drawings as listed on DL-SC-B-546977. (See 4.6)

3.3 Electrical installation.-

3.3.1 Power system wiring and components.- Installation of power wires and components (including cable assemblies, receptacles, switches, meters, circuit breakers, neon lamps, fluorescent lamps, incandescent lamps, lighting fixtures, distribution assembly system, and wiring components) constituting a three wire electrical power distribution system, shall be installed and wired in accordance with the drawings. The complete in-place power distribution system shall meet the following requirements:

3.3.1.1 Continuity of conductors.- The point-to-point resistance of all power-line conductors shall be less than 3 ohms when tested in accordance with 4.7.1.1.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the currentversion before use.

3.3.1.2 Dielectric strength of insulation.- The insulation of all power-line wires, cables, and components shall withstand a potential of 500 volts DC applied continuously for not less than 30 seconds when tested in accordance with 4.7.1.2.

3.3.1.3 Insulation resistance.- The resistance of insulation between any two of the three power-line conductors and also between each of the two ungrounded power-line conductors and shelter facility ground terminal shall not be less than 100 megohms when tested in accordance with 4.7.1.3.

3.3.2 Overvoltage control.- The overvoltage control shall be fabricated and wired in accordance with the drawings and meet the following requirements:

3.3.2.1 Dielectric strength of insulation.- The dielectric strength of insulation of each overvoltage control power wire shall withstand a potential of 500 volts DC continuously applied for not less than 30 seconds when tested in accordance with 4.7.2.1.

3.3.2.2 Insulation resistance.- The resistance of insulation between each of the overvoltage control power wire shall not be less than 100 megohms when tested in accordance with 4.7.2.2.

3.3.2.3 Voltage drop.- A voltage drop of less than 250 millivolts shall exist between the respective input and output pins of the overvoltage control unit when the circuit current is 50 amps. (See 4.7.2.3).

3.3.3 Power distributional and operational functions.- Main power branch distribution and circuit switching functions thereof shall meet the operational requirements as shown by Power Schematic Drawing SC-D-547008, when tested in accordance with 4.7.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

3.3.4 Signal (audio) system wiring and components.- Installation of signal (audio) wires, cables and wiring components (including binding posts, connectors, plugs, jacks, receptacles, and wiring devices) shall be installed and wired in accordance with the drawings. The completed in-place signal system installation shall meet the following requirements.

3.3.4.1 Continuity of conductors.- The resistance between both end terminations of all signal-line conductors shall not exceed 5 ohms when tested in accordance with 4.7.4.1.

3.3.4.2 Dielectric breakdown voltage.- The dielectric strength of insulation of all signal wires, spiral-four cables, and components shall withstand a potential of 500 volts DC applied continuously for not less than 5 seconds when tested in accordance with 4.7.4.2.

3.3.4.3 Insulation resistance.- The resistance of insulation between each signal conductor and all other conductors connected to ground shall not be less than 100 megohms when tested in accordance with 4.7.4.3.

3.3.5 Video and frequency (RF), system wiring and components.- Installation of video and RF cable assemblies and connecting components (including plugs, connectors, adapters, fittings, receptacles, and lightning protectors) shall be in accordance with the drawings. The completed in-place video and RF system installation shall meet the following requirements:

3.3.5.1 Continuity of conductors.- The point-to-point resistance between the following video and RF cable terminations shall not exceed 3 ohms when tested in accordance with 4.7.5.1:

a. Both end terminations of the inner conductor.

b. Both end terminations of the outer conductor (shield).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

3.3.5.2 Dielectric and insulation resistance tests.- The insulation of all video and RF cables, components and lightning protectors shall withstand the following potentials with the insulation resistance not less than 100 megohms when tested in accordance with 4.7.5.2:

a. 1500 volts DC applied continuously for not less than 30 seconds to all video cable assemblies terminated at the video entrance box with lightning protector elements removed.

b. 1100 volts DC applied continuously for not less than 30 seconds to all video cable assemblies terminated at the video entrance box with lightning protector elements in place.

c. 1700 volts RMS, 25-100 cycles, applied continuously for not less than 30 seconds to all RF transmission line terminated at the antenna entrance box.

3.3.5.3 Voltage standing wave ration (VSWR), RF transmission lines.- The VSWR of all completed RF transmission lines shall not exceed 1.20 at transmission frequencies of 600 megahertz, 1000 megahertz, 1350 megahertz and 1850 megahertz when tested in accordance with 4.7.5.3.

3.3.6 Cable assemblies.- (See 4.4)

3.3.6.1 Cable assemblies, power and audio frequency.- All power and audio frequency cable and cord assemblies shall be fabricated in accordance with the drawings unless otherwise stated and shall meet the requirements and tests of MIL-C-3885.

3.3.6.2 Cable assemblies, radio frequency.- Radio frequency cable assemblies required for operation of major items of equipment in 6.1 shall be fabricated in accordance with the drawings unless otherwise stated and shall meet the requirements and tests as indicated in Drawing SC-A-46691.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

3.3.7 Suppression of electromagnetic interference.- The motors in the ventilating equipment and heaters used in the shelter facility shall meet the emanation limits of MIL-STD-461 for tactical equipment, if other than those items defined by the drawings (See 4.4).

3.4 System operation.- With all operational equipments of the AN/TRC-152( ) assemblage installed, the operational requirements of all power, audio and radio frequency cable assemblies, switches, connectors, and patch panels, shall be met when tested in accordance with 4.8.

3.5 Vehicular transportation.- The shelter facility shall be capable of being transported over cross-country terrain by military vehicles without sustaining any permanent damage such as buckling, cracking, delamination, or other permanent deformation. (See 4.9).

3.6 Railroad transportation.- The shelter facility shall be capable of being loaded, blocked, and braced on a flatcar for shipment by rail. When so loaded, the shelter facility shall be subjected to and withstand the test of Paragraph 4.10 without sustaining any damage as mentioned in Paragraph 3.5.

3.7 Drops, flat and rotational.- The shelter facility shall be capable of withstanding drops of 18 inches onto concrete. The shelter facility shall be subjected to and withstand the tests of 4.11.1 and 4.11.2 without any damage as mentioned in Paragraph 3.5.

3.8 Watertightness.- The shelter facility shall be capable of withstanding the test of 4.12 without any leakage into the facility.

3.9 Fording.- The shelter facility shall be capable of being immersed in water to a depth of 21 inches, measured from the bottom of the skids, for 1 hour without any leakage of water into the facility. (See 4.13).

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:17Z
Check the source to verify that this is the currentversion before use.

3.10 Mounting inserts.- All mounting inserts shall be installed without the use of any auxiliary materials such as adhesive, and when installed, each insert shall be capable of withstanding the tensile load and the torque load referenced in 4.14. There shall be no damage to the insert threads or heads, the insert shall not have rotated from its original position, and there shall be no permanent distortion of the shelter facility mounting surface or insert head or threads. The insert head (if any) shall be properly seated and tight against its bearing surface. Insert threads and outer face of the insert head, shall be free of paint.

3.11 Cleaning.- After fabrication, parts shall be cleaned in accordance with good commercial practice or as specified in the applicable portions of Specification MIL-F-14072. Cleaning processes shall have no deleterious effect. Corrosive material shall be removed completely before the parts are assembled. After assembly, units shall be cleaned thoroughly and shall be free from particles of solder, flux, scale, and any other foreign material. In addition, when necessary, such cleaning shall also be performed before and after final assembly of the units.

3.12 Finish.- The shelter facility shall be finished in accordance with Specification MIL-F-14072 and the drawings. (See 4.4).

3.13 Marking.-

3.13.1 General.- Marking shall conform to Specification MIL-M-13231 and the drawings. (See 4.4).

3.13.2 Nameplate.- Each shelter facility shall be provided with a nameplate in accordance with the drawings. Each nameplate shall be imprinted with a sequential serial number.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:17Z
Check the source to verify that this is the current version before use.

3.13.3 Aircraft loading data plate.- The shelter facility shall be provided with data plates in accordance with the drawings, imprinted with the dimensions which locate the centers-of-gravity of the shelter facility and the assemblage in the three reference planes; the gross weight of the shelter facility and assemblage; and the bearing pressure on the bottom of the skids. The shelter assemblage is the shelter facility with operational equipments or dummy loads in place. The locations of the centers-of-gravity shall be determined by the contractor using the preproduction sample.

3.13.4 Interior and exterior marking.- All interior and exterior marking of the shelter facility shall be as depicted on the drawings.

3.14 Riveting.- Riveted joints shall be tight, the joined parts shall be undamaged, and the rivet heads shall be properly seated and tight against their bearing surfaces.

3.15 Seal, moisture.- All joints and raw edges of the framing for the power, signal, video, and antenna entrance boxes, air-conditioner, and exhaust blowers shall be sealed to prevent entrance of moisture to the core material of the shelter panels and to the interior of the shelter. All joints shall be assembled and sealed in a manner to prevent collection and retention of moisture. All exterior rivets, screws, and fasteners shall be dipped in sealer prior to installation. unless otherwise specified in the invitation for bids and contract, the sealer, if other than specified on the drawings, shall be one part Silicone Construction Sealant SE1204 as made by General Electric Company or shall be determined equal when tested to assure the following properties. (See 4.17).

3.15.1 Sealer shear at temperature.- The minimum shear strength of the fully cured sealer and its bond to the aluminum shall be as follows:

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:17Z
Check the source to verify that this is the currentversion before use.

a. 200 psi at ambient (80°F ±15°)

b. 200 psi at -65°F ±5°

c. 75 psi at 200°F ±5°

3.15.2 Sealer shear after humidity exposure.- The sealer shall withstand exposure to 100 per cent relative humidity at 160°F ±5° for 2 weeks and have a shear strength of 75 psi minimum at 160°F.

3.15.3 Sealer shear after spray exposure.- After 2 weeks exposure to 20 per cent NaCL solution at 95°F, the sealer shall have a shear strength of 75 psi minimum.

3.16 Securing of parts.- Brackets, lugs, flanges, inserts, bolts, and other mounting arrangements shall retain components of the facility securely so that loosening, wear of mounting arrangements, or permanent separation of parts or components will not occur when the equipment is subjected to the specified drop and transport tests.

3.16.1 Screws, threaded devices, and related parts.- Screws, threaded devices and related parts shall be as defined by the drawings. Thread forming screws shall not be used.

3.17 Soldering.-

3.17.1 Solder and flux.- Solder and flux shall be as defined on the drawings.

3.17.2 Acid or acid salts.- No acid or acid salts shall be used in preparation for or during soldering; however, exception is permitted for preliminary tinning of electrical connections and for tinning or soldering of mechanical joints not used to complete electrical circuits, but in no case shall acid or acid salts be used where they can come in contact with insulation material. Where acid or acid salts are used, as permitted above, they shall be completely neutralized and removed immediately after use.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the currentversion before use.

3.17.3 Process.- There shall be no sharp points or rough surfaces resulting from insufficient heating. The solder shall feather out to a thin edge, indicating proper flowing and wetting actions, and shall not be crystallized, over heated or under heated. The minimum necessary amount of flux and solder shall be used for electrical connections. Any means employed to remove an unavoidable excess of flux shall not incur the risk of loose particles of flux, brush bristles, or other foreign material remaining in the equipment; flux being spread over a larger area; or damage to the equipment. Insulation material that has been subjected to heating during the soldering operation shall be undamaged and parts fastened thereto shall not have become loosened.

3.18 Tropicalization of material.- Canvas, webbing, wood, etc., shall be treated to be resistant to moisture and fungi as indicated on the drawings and as follows:

3.18.1 Treating materials.- Treating materials containing a mercury-bearing fungicide shall not be used. The contractor shall determine that the treating material is compatible with the material or surface to be treated. Selection of treating materials shall be such that any increase in flammability of treated material will be held to the practical minimum.

3.18.2 Toxicity.- Treating materials shall cause no skin irritation or other injury to personnel handling the treated material during fabrication, transportation, operation, or maintenance of the equipment, or during use of the finished items when used for the purpose intended.

3.18.3 Flexibility.- Treatment shall not affect the flexibility of treated materials, to the extent that the equipment may fail to meet specified requirements when subjected to specified service conditions.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:17Z
Check the source to verify that this is the current version before use.

3.18.4 Statement of treatment.- The contractor shall submit for approval, to the contracting officer, a statement describing in detail the materials to be treated and the treating materials and processes that he proposes to use. (See 6.2e).

3.19 Welding.- Welded joints shall be as defined by the drawings and shall be such that grinding on the finish weld will be unnecessary except where grinding is specified on the drawings. Inert-gas-shielded arc welding (MIG) using helium, argon, or a mixture of the two shall be used for arc welding of aluminum. Welds shall conform to MIL-W-6858 Class B and MIL-W-45205 Class B as applicable; surfaces to be welded shall be cleaned in accordance with good commercial practice and shall be free of scale, paint, grease, and other foreign materials. Welds shall have thorough penetration and good fusion and shall be free of scabs, blisters, adnormal pock marks, cracks, voids, slag inclusions, and other harmful defects. Inert-gas-shielded arc welding shall be used for welding of aluminum except where spot welds are used. Welded assemblies shall be cleaned to remove any scale, oxidation products, and excess flux. Any acid used in cleaning shall be completely neutralized and removed. (See 4.4).

3.20 Wiring and cabling.- Wiring and cabling shall be in accordance with the drawings and shall be neat and sturdy.

3.20.1 Slack.- Wires and cables shall be as short as practical except that sufficient slack shall be provided:

a. To prevent undue stress on cable forms, wires, and connections.

b. To facilitate field repair of broken or cut wires.

c. To prevent chafing or breaking of wires due to repeated flexing of hinged parts.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

3.20.2 Protection.- Wires and cables shall be so placed and protected as to avoid contact with rough or irregular surfaces or sharp edges. Wires shall not be bent sharply where they enter insulation material.

3.20.3 Splicing.- Wires in a continuous run between two terminals shall not be spliced during the wiring operation unless specifically indicated by the drawings.

3.20.4 Crimping of solderless terminal lugs.- Crimping of solderless terminal lugs shall be so accomplished that the connections will meet the resistance (voltage drop) and tensile strength requirements and tests of Specification MIL-T-7928. (See 4.15).

3.20.5 Identification of wiring.- Wiring shall be identified by color-coding and wire pair marking, as indicated on the drawings.

3.21 Interchangeability.- Like units, assemblies, subassemblies, and replaceable parts shall be physically and functionally interchangeable without modification of such items or of the equipment. (See 4.16). Individual items shall not be hand-picked for fit or performance. Reliance shall not be placed on any unspecified dimension, rating, characteristic, etc.

3.22 Workmanship.- The equipment shall be manufactured and assembled in accordance with the applicable portions of the following paragraphs: (See 4.17).

3.2 Construction
3.3 Electrical installation
3.10 Mounting inserts
3.11 Cleaning
3.12 Finish
3.13 Marking
3.14 Riveting
3.15 Seal, vapor

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

3.16 Securing of parts
3.17 Soldering
3.18 Tropicalization
3.19 Welding
3.20 Wiring and cabling
3.21 Interchangeability

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection.- Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified the supplier may utilize his own facilities or any commercial laboratory acceptable to the government. The government reserves the right to perform any of the inspections set forth in the specification where such inspection are deemed necessary to assure that supplies and services conform to prescribed requirements.

4.2 Classification of inspection.- Inspection shall be classified as follows:

a. Preproduction inspection (does not include preparation for delivery). (See 4.3).

b. Inspection covered by subsidiary documents. (See 4.4).

c. Quality conformance inspection.

(1) Quality conformance inspection of equipment before preparation for delivery. (See 4.5).

(2) Quality conformance inspection of preparation for delivery. (See 4.18).

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the currentversion before use.

4.3 Preproduction inspection.- This inspection shall be performed by the contractor on the preproduction unit unless otherwise specified in the contract. (See 3.1). It shall consist of the preproduction inspection specified in the subsidiary documents covering the items listed in 4.4, and the inspection specified for Group A, Group B and Group C (except EVR) (See Inspection Tables I, II and III respectively). Preproduction inspection shall be performed in the following order, unless otherwise specified.

a. Mounting inserts
b. Electrical installation
c. System operation
d. Truck Transportability
e. Railroad transportability
f. Flat drop
g. Rotational drops
h. Watertightness
i. Fording

The last tests performed shall be a repeat of the Electrical installation tests and System tests. Remaining preproduction tests specified for Groups A, B and C inspections but not included in the above list shall be performed in any order satisfactory to the contracting officer.

4.4 Inspection covered by subsidiary documents.- The following shall be inspected under the applicable subsidiary documents as part of preproduction inspection and inspection of equipment before preparation for delivery:

Item	Where required
Cable assemblies	3.3.6
Suppression, EMI	3.3.7
Finish	3.12
Marking	3.13
Welding	3.19
Terminals	3.20.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

used in low level circuits, shall be a minimum

4.5 Quality conformance inspection of equipment before preparation for delivery.- The contractor shall perform the inspection specified in 4.4 and 4.5.1 through 4.5.4. This does not relieve the contractor of his responsibility for performing any additional inspection which is necessary to control the quality of the product and to assure compliance with all specification requirements. The Government will review and evaluate the contractor's inspection procedures and examine the contractor's inspection records. In addition, the Government - at its discretion - may perform all or any part of the specified inspection, to verify the contractor's compliance with specified requirements. (See 6.6). Test equipment for Government verification shall be made available by the contractor.

4.5.1 Group A inspection.- Each unit of equipment shall be inspected for conformance to all inspection and test requirements of Table I of this specification. In addition, equipment conforming to the above requirements shall be verified by a quality audit. The following procedure shall be used for the quality audit:

At the start of this plan 100% of the units shall be inspected until five consecutive units are found free of defects. At that time inspection shall be reduced to one out of five of the units presented. Whenever a defective unit is found, the contractor shall immediately revert to 100% inspection, which shall then be continued until five consecutive units are found free of defects. At that time inspection shall again be reduced to one out of five of the units presented. Samples shall be selected on a random basis.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

Table I - Group A Inspection

Inspection	Rqr Para	Insp Para	
Visual and Mechanical	3.22	4.17	
Electrical			
Power wiring			
Continuity	3.3.1.1	4.7.1.1	
Dielectric strength	3.3.1.2	4.7.1.2	
Insulation resistance	3.3.1.3	4.7.1.3	
Overvoltage control			
Dielectric strength	3.3.2.1	4.7.2.1	
Insulation resistance	3.3.2.2	4.7.2.2	
Voltage drop	3.3.2.3	4.7.2.3	
Power distribution	3.3.3	4.7.3 thru 4.7.3.3	All defects are major
Signal wiring			
Continuity & Circuit resistance	3.3.4.1	4.7.4.1	
Dielectric strength	3.3.4.2	4.7.4.2	
Insulation resistance	3.3.4.3	4.7.4.3	
Video wiring			
Continuity & circuit resistance	3.3.5.1	4.7.5.1	
Dielectric strength and insulation resistance	3.3.5.2	4.7.5.2	
Voltage standing wave ratio	3.3.5.3	4.7.5.3	

NOTE: The order of inspection of Group A with respect to Groups B and C shall conform to the order specified in 4.3.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the currentversion before use.

4.5.1.1 Nonconformance Group A.- A defect of unit of product is any nonconformance with the specified requirement. Any unit of product found defective during inspection shall be rejected. Rejected units may be repaired or corrected and then resubmitted for inspection. The contractor shall simultaneously notify the Procuring Contracting Officer, the government technical activity designated in the contract, and the quality assurance representative and include proposed corrective action whenever the following condition occurs: the contractor's Group A audit fails to clear for sampling, i.e. remains on 100% inspection, for 25 consecutive units. Notification is applicable only to units with major defects.

4.5.2 Group B inspections.- Equipment shall be assembled in discrete lots for quality conformance inspection, utilizing the procedures of MIL-STD-105 for lot formation. Each lot shall consist of units produced within a calendar month. This inspection, including sampling, shall conform to Table II and to the procedures for small-sample inspection of Standard MIL-STD-105, using the special inspection levels. Group B inspection shall be performed on units of production that have passed Group A inspection except for Mounting Inserts and Interchangeability Inspection which are performed prior. The government reserves the right to require complete retest of any sample which is reworked aft r failing Group B inspection.

4.5.2.1 Group B sampling plans.- The Group B sampling plans, for the AQL's listed in Table II shall be as follows:

AQL	Inspection level
4.0%	S-4
2.5%	S-4

4.5.2.2 Order of inspection within Group B.- Group B inspection shall be performed on the same equipment in the order in which they appear.

be supplied
Source: https://assist.dla.mil -- Downloaded: 202640-26T04:17Z
Check the source to verify that this is the currentversion before use.

Table II - Group B Inspection

Inspection	Rqr Para	Insp Para	AQL % Def (See 4.5.2.1)
Mounting inserts	3.10	4.14.2	4.0 (AOQL-5.0)
Interchangeability	3.21	4.16	4.0 (AOQL-5.0)
Watertightness	3.8	4.12	2.5 (AOQL-3.0)
Fording	3.9	4.13	2.5 (AOQL-3.0)

NOTE: The order of inspection of Group B with respect to Groups A and C shall conform to the order specified in 4.3. The order of inspection within Group B shall be as in Table II.

4.5.2.3 Alternate Group B inspection procedures.- Contractor may elect to use a continuous sampling and inspection plan instead of the lot inspection plan stated above. If this alternate is selected the procedure of implementation must be in accordance with MIL-STD-1235, "Single and Multi-level Continuous Sampling Procedures and Tables for Inspection by Attributes" and the Group B sampling plans for the AOQL's listed in Table II of this specification shall be selected from Tables VIII, IX and X of MIL-STD-1235 which are for f=½. The number of units in the Production Interval shall be the entire production quantity unless otherwise specified in the contract. Before starting production Contractor shall notify the contracting officer in writing which method he intends to use. The method may not be changed during production without written approval of the government.

4.5.3 Group C inspection.- This inspection shall be as listed in Table III

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:17Z
Check the source to verify that this is the current version before use.

Table III - Group C Inspection

Inspection	Rqr Para	Insp Para
Solderless-terminal-lug connection	3.20.4	4.15
Construction verification	3.2	4.6
Mounting inserts	3.10	4.14.1
System operation	3.4	4.8
Truck Transportability	3.5	4.9
Railroad transportability	3.6	4.10
Drops, Flat and Rotational	3.7	4.11

NOTE: The order of inspection of Group C with respect to Groups A and B shall conform to the order specified in 4.3. The order of inspection within Group C for all inspections listed shall be as listed in Table III. Units subjected to Group C Drop Tests shall subsequently by subjected to and meet the watertightness and fording tests of 4.12 and 4.13.

4.5.3.1 Sampling for inspection of construction evaluation.- The Equipment Verification Review, in accordance with paragraph 4.6 shall be performed once on each part and assembly, randomly selected, and on their installation into one of first 10 shelter facilities produced. This inspection shall not be performed on the preproduction unit. This inspection shall be performed as the selected shelter is being assembled.

4.5.3.2 Sampling for inspection of solderless-terminal-lug connections.- Five specimens of each combination of wire and terminal produced each week shall be prepared for inspection. A specimen is a 1 foot length of wire on which a terminal lug has been applied, using the same tools and procedures used in crimping the terminal lugs in production.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

4.5.3.3 Sampling for inspection of Drop Tests.- One sample, representative of the first 50 units or fraction thereof produced, shall be subjected to the drop tests. This sample shall be the same unit previously subjected to the truck and railroad transportation tests of 4.5.3.4. Thereafter, one sample from each additional 150 units or fraction thereof produced shall be subjected to the drop tests.

4.5.3.4 Sampling for other inspection.- For inspection tests listed below, one unit shall be selected at random from the first 10 units of fraction thereof which have been produced, unless otherwise specified in the contract. Selection of the unit will be made by the government.

a. Mounting inserts
b. System operation
c. Truck transportability
d. Railroad transportability

4.5.3.5 Noncompliance.- All quality conformance inspection shall be halted, including Group A and Group B inspections, upon the occurrence of any Group C failure. The contractor shall immediately report in writing each Group C failure occurrence, including details of the failure and characteristics affected. The contractor shall immediately investigate the cause of failure and further report the results of investigation and details of the proposed corrective action on the processes and materials, as applicable, and on all units of product which are manufactured under the same conditions and which the Government considers subject to the same failure. Reports shall be forwarded to the responsible technical activity designated in the contract with a copy to the Government procurement quality assurance representative. After corrective action has been taken, additional sample units shall be subjected to Group C inspection (all inspections, or the inspections which the sample failed, at the option of the technical activity) and Group A and

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

Group B inspections may be reinstituted. However, final acceptance and shipment will be withheld until Group C re-inspection results have shown that the corrective action was effective and approved by the technical activity. (See "Delivery and Conditional Acceptance of Contract Items Subject to Group C Inspection" provisions elsewhere in the contract.

4.5.4 Reinspection of conforming Group B and Group C sample units.- Unless otherwise specified, sample units which have been subjected to and pass Group B or Group C inspection, or both, may be accepted on contract, provided that they are resubjected to and pass Group A inspection after repair of all visible damage (See 6.4).

4.6 Construction verification.- The contractor shall perform an Equipment Verification Review (EVR), consisting of a complete technical audit of the equipment on order against the drawings (See 3.2) cited in the Technical Data Package (as supplemented by all approved engineering changes). EVR shall consists of the following:

a. An audit to establish that "as-built" shelter facilities, including individual parts, their use in sub-assemblies, and assemblies (components), and their final installation into the shelter forming the shelter facility, are in accordance with the end product drawings.

b. An audit to establish that "as-built" shelter facilities, including parts, components and their installation, meet the acceptance requirements specified in the Technical Data Package for each shelter part, components, and shelter facility. The audit shall record all acceptance test methods used together with resulting verification test data.

c. Preparation of EVR report(s) containing the following information:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

(1) Identification of parts, components, shelter facilities and details proving compliance with 4.6a and b above.

(2) Discrepancies noted.

(3) Corrective action taken.

d. Two (2) copies of the EVR report shall be submitted no later than 15 days prior to the submission of the first production unit or lot to the government technical organization cited in the contract. The results of the EVR shall be subject to verification by authorized government personnel at the time for first unit or production lot is offered for acceptance. Government verification will be to the depth and extent necessary to demonstrate that the "as-built" hardware is in accordance with the cited drawings. Copies of the EVR reports shall be made available to government personnel during the verification. The contractor shall provide the following:

(1) Segregation of parts, components of shelter facilities, to permit reviewing government personnel access for detailed inspection. The contractor shall also provide personnel to disassemble any parts of the shelter facility, its components and their installation, and to reassemble parts after inspection.

(2) Have as required, responsible personnel from each functional department available for discussion in their respective areas.

(3) Adequate administrative support for the EVR.

4.7 Electrical installation tests.- The test of 4.7.1 through 4.7.5.3 shall be performed on each shelter facility prior to installation of other major components comprising the AN/TRC-110(V). Before applying power to the shelter facility, an electrical ground at the power entrance box

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:17Z
Check the source to verify that this is the current version before use.

shall be made. Power to the shelter facility shall be 115 volts AC, 60 cycles, single phase.

4.7.1 Power system and components installation tests.- Prior to conducting power wiring and components tests of 4.7.1.1, 4.7.1.2 and 4.7.1.3 the following shall be accomplished: (Refer to drawing SC-D-547288).

a. Remove or disconnect the following electrical loads:

(1) All fluorescent, incandescent, and neon (power indicator and power distribution box) lamps.

(2) All fluorescent lamp starters.

(3) Blowers and heaters.

b. Remove power distribution box cover panel and disconnect both conductors from the voltmeter terminals. Position or isolate disconnected leads so that they do not short to each other or to shelter facility ground.


c. Fabricate test cable assembly shown in Figure 1. Connect test cable between power cable connector marked "Input to CN-514" and cable connector marked "To Overvoltage Control".

4.7.1.1 Continuity of conductors.- Continuity resistance which meets the requirements of 3.3.1.1 shall be performed on each power circuit in accordance with the following paragraphs. A calibrated low resistance reading ohmmeter or equivalent shall be used in performing the test. Extend all power receptacles as shown in Figure No. 1.

a. Place the following circuits in the ON position:

(1) Fluorescent lights switch

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

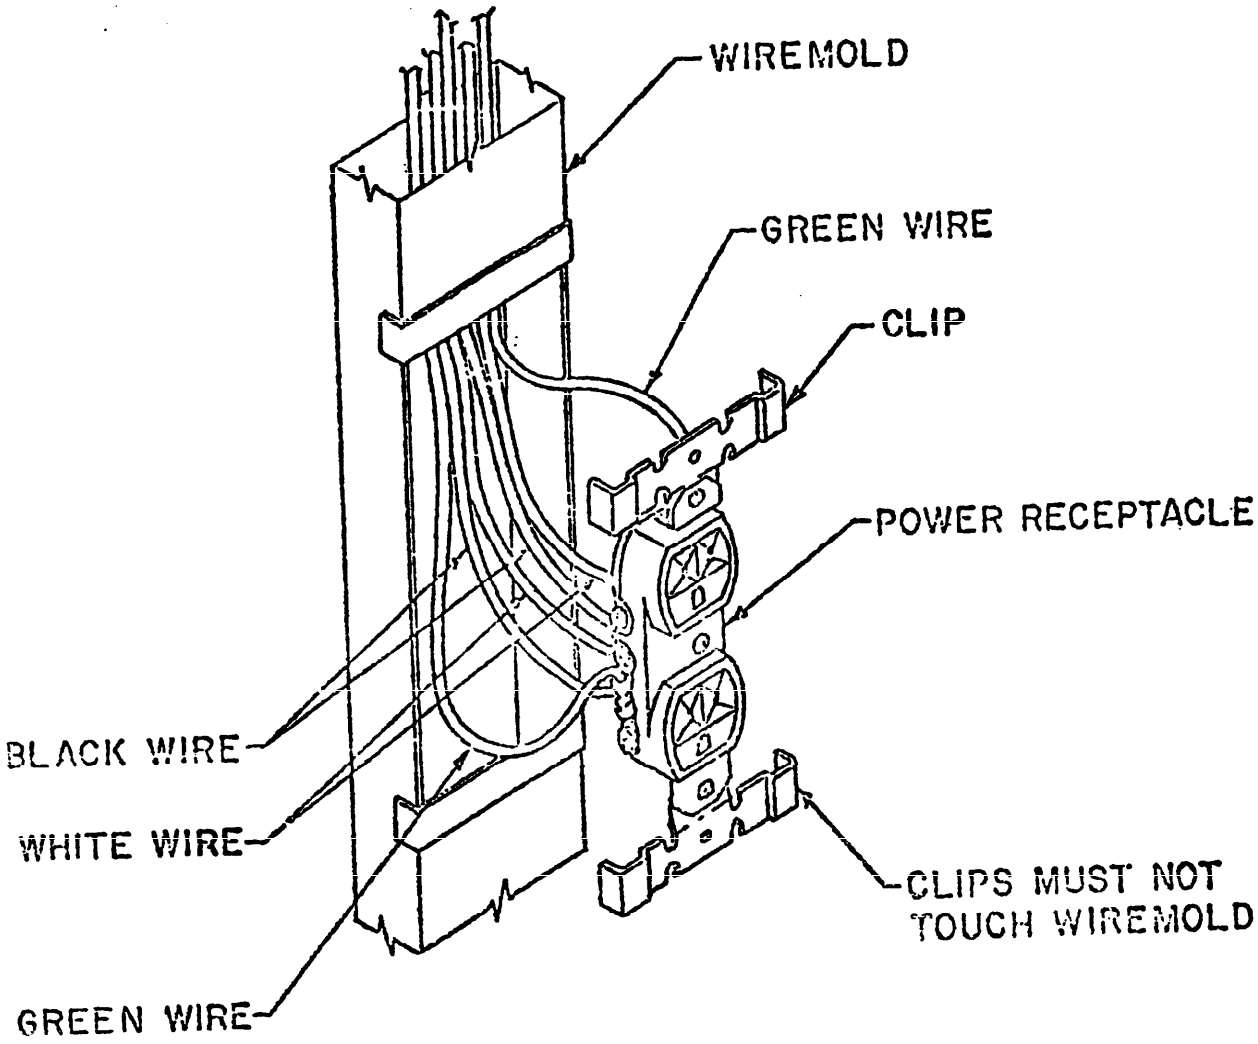

POWER RECEPTACLE REMOVED & EXTENDED FROM WIREMOLD

FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

(2) Incandescent cold start lights switch

(3) Blower-1 switch

(4) Blower-2 switch

(5) Main circuit breaker CB7

(6) Branch circuit breakers CB1 thru CB6

(7) System circuit breakers CB8 thru CB9

b. Place BLACKOUT/BYPASS switch to the BYPASS position.

c. Measure continuity resistance from pin 1 of power connector IN located at power entrance box to the following: brass (hot) contacts of outside power receptacle J1, Convenience power receptacles J2 and J3, Intercom power receptacle J4, Blowers power receptacles J5 and J6, Heaters power receptacles J7 and J8, and Equipment Systems power receptacles J9 thru J14; black wire termination at each fluorescent lamp; black wire termination at each incandescent lamp; and pin 1 of power OUT connector at power entrance box.

d. Place all controls listed under a above in the OFF position except main circuit breaker.

e. Measure continuity resistance from pin 2 of power connector IN to the following: silver (neutral) contacts of outside power receptacle J1, convenience power receptacles J2 and J3, Intercom power receptacle J4, Blowers power receptacles J5 and J6, Heaters power receptacles J7 and J8, and Equipment Systems power receptacles J9 thru J16; white wire termination at each fluorescent lamp; white wire termination at each incandescent lamp; and pin 2 of power OUT connector.

f. Place main circuit breaker in the OFF position.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

g. Measure continuity resistance from pin 4 of power connector IN to the following: green (ground) contacts of outside power receptacle J1, Convenience power receptacles J2 and J3, Intercom power receptacle J4, Blowers power receptacles J5 and J6, Heaters power receptacles J7 and J8, and Equipment Systems power receptacles J9 thru J14; all ground terminals located at the power entrance box, power distribution box, video entrance box, and raceway; and pin 4 of power OUT connector.

h. Resistance measurements made in steps c, e and g above, shall meet the requirements of 3.3.1.1.

4.7.1.2 Dielectric breakdown voltage.- Dielectric strength tests which meet the requirements of 3.3.1.2 shall be performed on each power circuit in accordance with the following paragraphs. A non-destructive DC dielectric tester shall be used in performing the test.

NOTE: Take preventive measures that will preclude personnel from coming into contact with conductors under test during performance of ALL dielectric and insulation resistance test. Discharge each conductor to ground following each test, to eliminate danger of shock.

a. Place all circuit controls listed under 4.7.1.1a in the ON position except FLUORESCENT lights switch.

b. Place BLACKOUT/BYPASS switch to the BYPASS position, and lock shelter faciiity door securely.

c. Test between pins 1 and 4 of power connector IN. Adjust tester for a value of not less than 500 volts DC output and maintain this potential for 30 seconds. The requirements of 3.3.1.2 shall be met.

d. Place FLUORESCENT LIGHTS switch to the ON position, and lock shelter facility door securely.

shown in Figure 5. The number of cycles [illegible] to cycles. The temperature [illegible]

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:19Z
Check the source to verify that this is the current version before use.

e. Repeat step c above with tester connected first across pins 1 and 2, and then across pins 2 and 4.

4.7.1.3 Insulation resistance.- Insulation resistance which meets the requirement of 3.3.1.3 shall be made on each power circuit in accordance with the following paragraphs. A megohmmeter or equivalent shall be used in performing the test.

a. Repeat steps 4.7.1.2a thru e above except step 4.7.1.2c which shall be replaced by step b below.

b. Test between pins 1 and 4 of power connector IN. The output test voltage shall not be less than 100 volts DC nor more than 500 volts DC. Maintain this potential until the indicating meter has ceased fluctuating and indicates a steady or increasing insulation resistance. The requirements of 3.3.1.3 shall be met. (See Note under 4.7.1.2).

4.7.2 Overvoltage control tests.- Verification of the electrical requirements of 3.3.2 shall be made on each overvoltage power circuit as indicated by the following paragraphs: (Refer to drawing SC-C-532288). (See Figure 2)

4.7.2.1 Dielectric strength of insulation.-

a. Using a non-destructive DC dielectric tester, test between pins A and C of connector J1. Adjust tester for a value of not less than 500 volts DC output and maintain this potential for a period of 30 seconds. The requirements of 3.3.2.1 shall be met.

b. Repeat step a above with tester connected first across pins A and B and then across pins B and C of connector J1.

c. Repeat steps a and b above substituting connector J2 for connector J1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

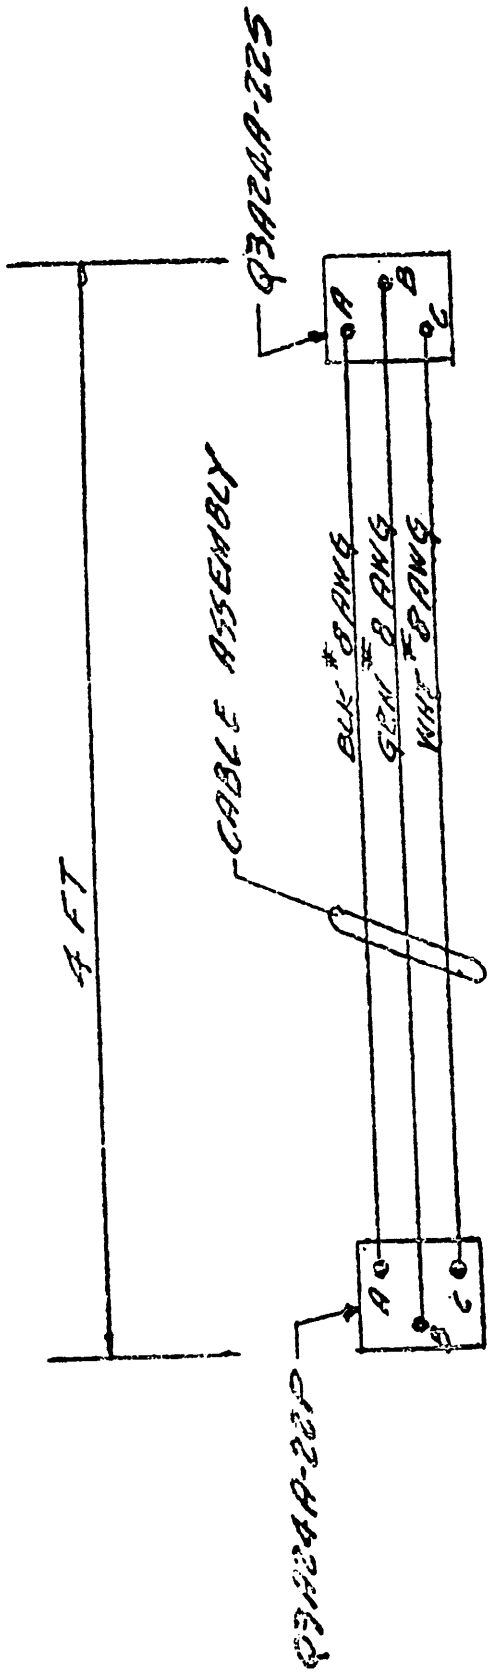


FIGURE 2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

4.7.2.2 Resistance of insulation.-

a. Using a megohmmeter or equivalent, test between pins A and C of connector J1. Adjust for a value of not less than 100 volts DC nor more than 500 volts DC and maintain this potential until the indicating meter has ceased fluctuating and indicates a steady or increasing insulation resistance reading. The requirements of 3.3.2.2 shall be met.

b. Repeat step a above with tester connected first across pins A and B and then across pins B and C of connector J1.

c. Repeat steps a and b above substituting connector J2 for connector J1.

4.7.2.3 Voltage drop.-

a. Connect a resistive load to produce a current of approximately 50 amps ±5 at connector J2, pins A and C.

b. Connect a 115 volt AC (nominal), 60 cycle supply across pins A and C of connector J1.

c. Turn unit switch to ON position. Neon lamp on unit shall light.

d. Measure voltage drop between pin A of J1 and Pin A of J2. The requirements of 3.3.2.3 shall be met.

e. Repeat step d above substituting pin C for pin A.

4.7.3 Power distributional and operational function tests which meet the requirements of 3.3.3 shall be performed on each power circuit in accordance with the following paragraphs: (Refer to Drawing SC-D-547008).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

4.7.3.1 Test preparation.-

a. Replace or reconnect all electrical loads and line voltmeter removed or disconnected by 4.7.1 a and b.

b. Replace power distribution box cover.

c. Remove test cable assembly installed by 4.7.1c. Connect cable assembly marked "Input to CN-514" to input connector J1 of overvoltage control; and cable assembly marked "To Overvoltage Control" to output connector J2 of overvoltage control.

d. Place all circuit breakers and switches in the OFF position.

e. Place BLACKOUT/BYPASS switch to the BYPASS position.

f. Open outer exhaust port covers of both blowers.

g. Insert AC line plugs of both blowers into their respective receptacles.

h. Place a 115 volt AC test lamp with grounding plug into all convenience, equipment, intercom, and heater receptacles.

4.7.3.2 Test of line voltmeter and indicator lamp.-

a. Apply 115 volts AC (nominal), 60 cycles, single phase power to shelter facility at power connector IN. Power indicator neon lamp shall light and facility voltmeter at power distribution panel shall indicate power to the shelter.

b. Measure specific line voltage by connecting a calibrated AC voltmeter (0-150 volt scale) between pin 1 and pin 2 of power connector OUT.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the current version before use.

c. Read voltage indicated on shelter facility voltmeter. The voltage read shall be within ±2% of the voltage measured by step b above.

d. Place main circuit breaker in the ON position.

4.7.3.3 Test of circuit breakers and switches.-

Circuit #1.- (Lights circuit breaker CB1)

a. Place lights circuit breaker CB1 in the ON position. Neon lamp above CB1 shall light.

b. Place FLUORESCENT LIGHTS switch in the ON position. All fluorescent lamps shall light.

c. Place INCANDESCENT COLD START LIGHTS switch in the ON position. All incandescent lamps shall light.

d. Place circuit breaker CB1 in the OFF position. All lamps mentioned in a thru c above shall go out.

e. Replace circuit breaker CB1 in the ON position to restore lights.

f. With shelter facility door open, place BLACKOUT/BYPASS switch to the BLACKOUT position. All fluorescent and incandescent lamps shall go out.

g. Close shelter facility door. All fluorescent and incandescent lamps shall light.

h. Place FLUORESCENT LIGHTS switch in the OFF position. All fluorescent lamps shall go out.

i. Place INCANDESCENT COLD START LIGHTS switch in the OFF position. All incandescent lamps shall go out.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the current version before use.

j. Open door and restore lights by placing BLACKOUT/BYPASS switch to BYPASS and FLUORESCENT LIGHTS switch to the ON position.

Circuit #2.- (Blowers circuit breaker CB2)

(Blowers/Heater - 2 circuit breaker CB2)

a. Place Blowers circuit breaker CB2 in the ON position. Neon lamp above CB2 shall light.

b. Place Blowers/Heaters switch in the BLOWERS position.

c. Place roadside blower switch in the ON position. Roadside blower shall operate and shall exhaust air from shelter. The spring loaded, exhaust port cover shall open by the force of the exhaust blower.

d. Repeat step b above for curbside switch and blower.

e. Place circuit breaker CB2 in the OFF position. Neon lamp above CB2 shall go out; both blowers shall cease to operate; and the spring loaded port covers shall close.

f. Place Blowers/Heater switch in the Heaters position.

g. Place circuit breaker CB2 in the ON position. Neon lamp above CB2 and test lamp in the heater-2 receptacle shall light.

h. Place circuit breaker CB2 in the OFF position. All lamps mentioned in step g above shall go out.

Circuit #3.- (Heater-1 circuit breaker CB3)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T04:17Z
Check the source to verify that this is the current version before use.

a. Place Heater-1 circuit breaker CB3 in the ON position. Neon lamp above CB3 shall light and test lamp in heater-1 receptacle shall light.

b. Place circuit breaker CB3 in the OFF position. All lamps mentioned in step a above shall go out.

Circuit #4.- (Convenience and Intercom circuit breaker CB4)

a. Place convenience and intercom circuit breaker CB4 in the ON position. Neon lamp above CB4 and test lamps in each convenience and intercom receptacle shall light.

b. Place circuit breaker CB4 in the OFF position. All lamps mentioned in step a above shall go out.

Circuit #5.- (Voltage Regulator circuit breaker CB5)

a. Place voltage regulator circuit breaker in the ON position. Neon lamp above CB5 shall light. Neon lamp on overvoltage control shall not light.

b. Place switch of overvoltage control in the ON position. Neon lamp on this unit shall light.

c. Place circuit breaker CB5 in the OFF position. Neon lamp on overvoltage control shall go out.

Circuit #6.- (Main circuit breaker CB6)

a. Place all circuit breakers, except main circuit breaker in the ON position. Place all switches in the ON position. Place BLACKOUT/BYPASS switch in the BYPASS position.

b. Place main circuit breaker CB6 in the ON position. All neon lamps above circuit breakers shall light. All fluorescent and incandescent lamps shall light. Test lamps in all convenience, intercom and heater, receptacles

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

shall light. Both blowers shall operate. Test lamps in all equipment receptacles shall not light.

c. Place switch on overvoltage control unit in the ON position. Neon lamp on this unit shall light and test lamps in all equipment receptacles shall light.

d. Place main circuit breaker in the OFF position. All lamps and blowers mentioned in b and c above shall go out.

e. Place main circuit breaker in the ON position. Condition of step b above shall exist only.

f. Place all circuit breakers in the OFF position except the main, light, and voltage regulator circuit breakers. Place overvoltage control switch to the ON position.

Circuit #7.- (Radio system 1 circuit breaker CB7)

a. Place TO SYS-1 circuit breaker CB7in the ON position. Test lamp in radio system 1 receptacle shall light.

b. Place circuit breaker CB7 in the OFF position. Test lamp mentioned in step a above shall go out.

Circuit #8.- (Radio system 2 circuit breaker CB8)

a. Place TO SYS-2 circuit breaker CB8 in the ON position. Test lamp in radio system 2 receptacle shall light.

b. Place circuit breaker CB8 in the OFF position. Test lamp mentioned in step a above shall go out.

Circuit #9.- (Radio system 3 circuit CB9)

a. Place TO SYS-3 circuit breaker CB9 in the ON position. Test lamp in radio system 2 receptacle shall light.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

b. Place circuit breaker CB9 in the OFF position. Test lamp mentioned in step a above shall go out.

4.7.4 Signal system wiring tests.-

4.7.4.1 Continuity of conductors.- Continuity resistance which meets the requirements of 3.3.4.1 shall be performed on each audio line circuit in accordance with the following paragraphs. A low resistance continuity tester or equivalent shall be used. (An automatic tester may be used, subject to government approval).

a. Connect tester between one of the male lugs on spiral 4 connector at Power End Box and one black wire of the SEND cable at sys 1 at the equipment rack. Continuity shall exist and meet the requirements of 3.3.4.1.

b. With one side of the tester connected to the black wire connect the other end to each of the other contacts on the spiral-4 connector, each of the order wire binding posts, the phone, intercom binding posts and shelter ground. No continuity shall exist.

c. Repeat a and b for the following:

(1) The other male contact on the spiral-4 connecter and the other black colored wire tinned lead.

(2) Each of the female contacts of the spiral-4 connector and their respective neutral wire tinned leads at the equipment rack.

(3) Each of the order wire binding posts and their respective tinned wire leads at the equipment rack.

(4) Phone binding post A to tip of wiremold phone jack.

(5) Phone binding post B to sleeve of wiremold phone jack.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:17Z
Check the source to verify that this is the currentversion before use.

(6) Intercom binding post A to tip of wore-mold intercom jack.

(7) Intercom binding post B to sleeve of wiremold intercom jack.

4.7.4.2 Dielectric breakdown voltage.- Dielectric strength tests which meet the requirements of 3.3.4.2 shall be performed on each audio-line circuit in accordance with the following paragraphs. A non-destructive DC dielectric test instrument shall be used in performing the test.

a. Using appropriate test jigs or test fixtures, connect the following to shelter facility ground terminal:

(1) All conductors of all three FDM systems.

(2) All binding posts located at power entrance box

(3) All shields of the spiral-4 connectors

b. Connect tester between shelter facility ground terminal and the one of the black colored conducting wires of the spiral four cables. Remove ground connection from the black conducting wire.

c. Adjust tester to 500 volts DC output and maintain this potential for a continuous period of not less than 5 seconds. The requirements of 3.3.4.2 shall be met. Re-establish ground connection(s) to the contact(s) or binding post(s) under test.

d. Repeat steps b and c for the other black colored, neutral colored wires of the spiral four cables, the order, phone and intercom wires.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

4.7.4.3 Insulation resistance.- Insulation resistance which meets the requirements of 3.3.4.3 shall be performed on each audio-line circuit in accordance with the following paragraphs. A megohmeter tester or equivalent shall be used in performing the test. (An automatic tester may be used, subject to government approval).

a. Repeat steps 4.7.4.2a thru d above, except 4.7.4.2c, which shall be replace by step b below.

b. Adjust tester to a value of not less than 100 nor more than 500 volts DC output. Maintain this potential for one minute or until the indicating meter has ceased fluctuating and indicates steady or increasing insulation resistance. The requirements of 3.3.4.3 shall be met. Re-establish ground connection(s), binding post(s) or pin(s) under test.

4.7.5 Video and radio frequency system wiring and components installatic".-

4.7.5.1 Continuity and circuit resistance: Continuity resistance which verify the requirements of 3.3.5.2 shall be made on each Video and R.F. circuit indicated by the following paragraphs using a low resistance continuity tester.

a. Connect tester between female contact of VIDEO SYS-1 hermorphadite Connector at Video Entrance Box and inner conductor of CONN, VIDEO, SYS-1, OUT cable assembly at multiplexers rack. Note the continuity resistance indicated by the tester. The requirements of 3.3.5.1 shall be met.

b. Repeat step a for male contact of SYS-1, hermorphadite and CONN, VIDEO, SYS-1, IN cable at multiplexers rack.

c. Connect tester between shields of circuit under test. The continuity resistance shall meet the requirements of 3.3.5.1.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the currentversion before use.

d. Connect tester between shield of circuit under test and shelter ground. The requirements of 3.3.5.1 shall be met.

e. Repeat procedures 4.6.5.3a, b, c for systems 2 and 3.

f. Repeat procedures 4.6.5.3d and e for systems 2 and 3.

g. Connect tester between inner conductor of Antenna connector, system 1, and inner conductor of cable assembly, CG-718/U, system 1 at AN/GRC-50 rack. Note the continuity resistance indicated by the tester.

h. Repeat procedures 4.6.5b and c.

i. Repeat procedures 4.6.5h and i for systems 2 and 3.

j. The resistance readings noted by 4.6.5.3a, b, c, d and h shall meet the requirements of 3.4.5.3.

4.7.5.2 Dielectric and insulation resistance tests.- Dielectric and insulation resistance tests which meets the requirements of 3.3.5.2 shall be performed on each video and RF circuit in accordance with the following paragraphs. A non-destructive dielectric and insulation resistance tester shall be used in performing the test.

a. Remove all lightning protector elements at video entrance box.

b. Apply test potential of 1500 volts DC for not less than 30 seconds between the following pin connections and terminal ground located at video entrance box. The requirements of 3.3.5.2 shall be met.

(1) System 1 male

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

(2) System 1 female
(3) System 2 male
(4) System 2 female
(5) System 3 male
(6) System 3 female

c. Replace lightning protector elements removed by step b above.

d. Repeat step b above applying test potential of 1100 volts DC.

e. Connect tester between inner conductor of antenna connector, system 1, and shelter facility ground terminal.

f. Adjust tester to 1700RMS output and maintain this potential for a continuous period of not less than 30 seconds. The requirements of 3.3.5.2 shall be met.

g. Repeat steps e and f above for systems 2 and 3.

4.7.5.3 Voltage standing wave ratio (VSWR).- VSWR, which meets the requirements of 3.3.5.3 shall be made on each RF circuit in accordance with the following paragraphs. The VSWR measuring set shall consist of the following calibrated test equipment, or equal.

Hewlett-Packard Signal Generator HP-612A
Hewlett-Packard Signal Generator HP-614A
Hewlett-Packard Square Wave Generator HP-211A
Hewlett-Packard SWR Meter HP-415D
Hewlett-Packard Slotted Line HP-805C
Weinschel Model 535-FC 50 ohm coaxial termination, Female Type "C" connector
Cable Assembly Adapter, Female Type "C" to Male "QL" connector

Ancillary items, including interconnecting cables, adapters, and any additional equipment needed.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

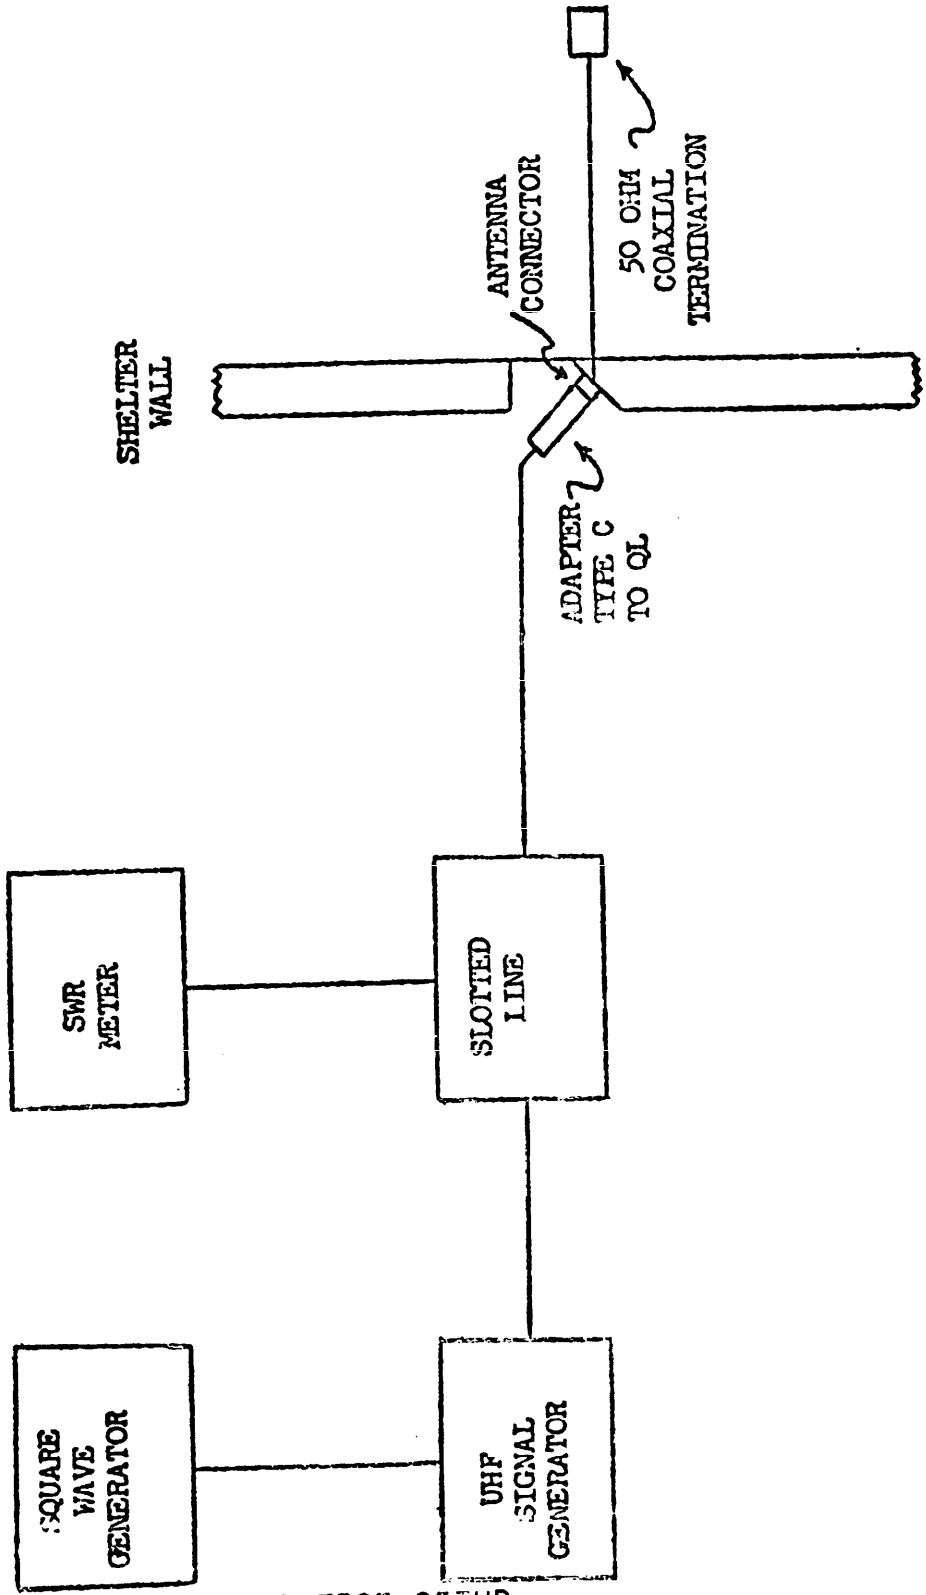


FIGURE 3 - VSWR TEST SETUP.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

a. Connect the test equipment using appropriate interconnecting cables and adapters as shown in Figure 3 to system 1 antenna circuit.

b. Set signal generator to a frequency of 600 megahertz.

c. Set the square wave generator for square wave output.

d. Set all test equipment for proper operation and obtain a VSWR reading on the SWR meter.

e. The VSWR reading obtained shall meet the requirements of 3.3.5.3.

f. Repeat steps b thru e above for signal generator frequencies of 1000 megahertz, 1350 megahertz, and 1850 megahertz respectively.

g. Repeat steps a thru f above for system 2 and system 3 antenna circuits.

4.8 System test.- (Refer to Figure 4) Install operational equipment in their respective rack locations and connect all power, signal, and radio frequency (RF) cables to designated receptacles and connectors. (See 3.4) (Refer to signal schematic plate).

4.8.1 Radio/Cable Terminal Systems Test.- (See Figure 4)

a. At the equipment, make the following connections:

AN/GRC-50, sys-1	TD-202( )/U sys-1
PCM IN	TO RADIO XMTR
PCM OUT	FROM RADIO RCVR
PCM ORDER WIRE	ORDER WIRE

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

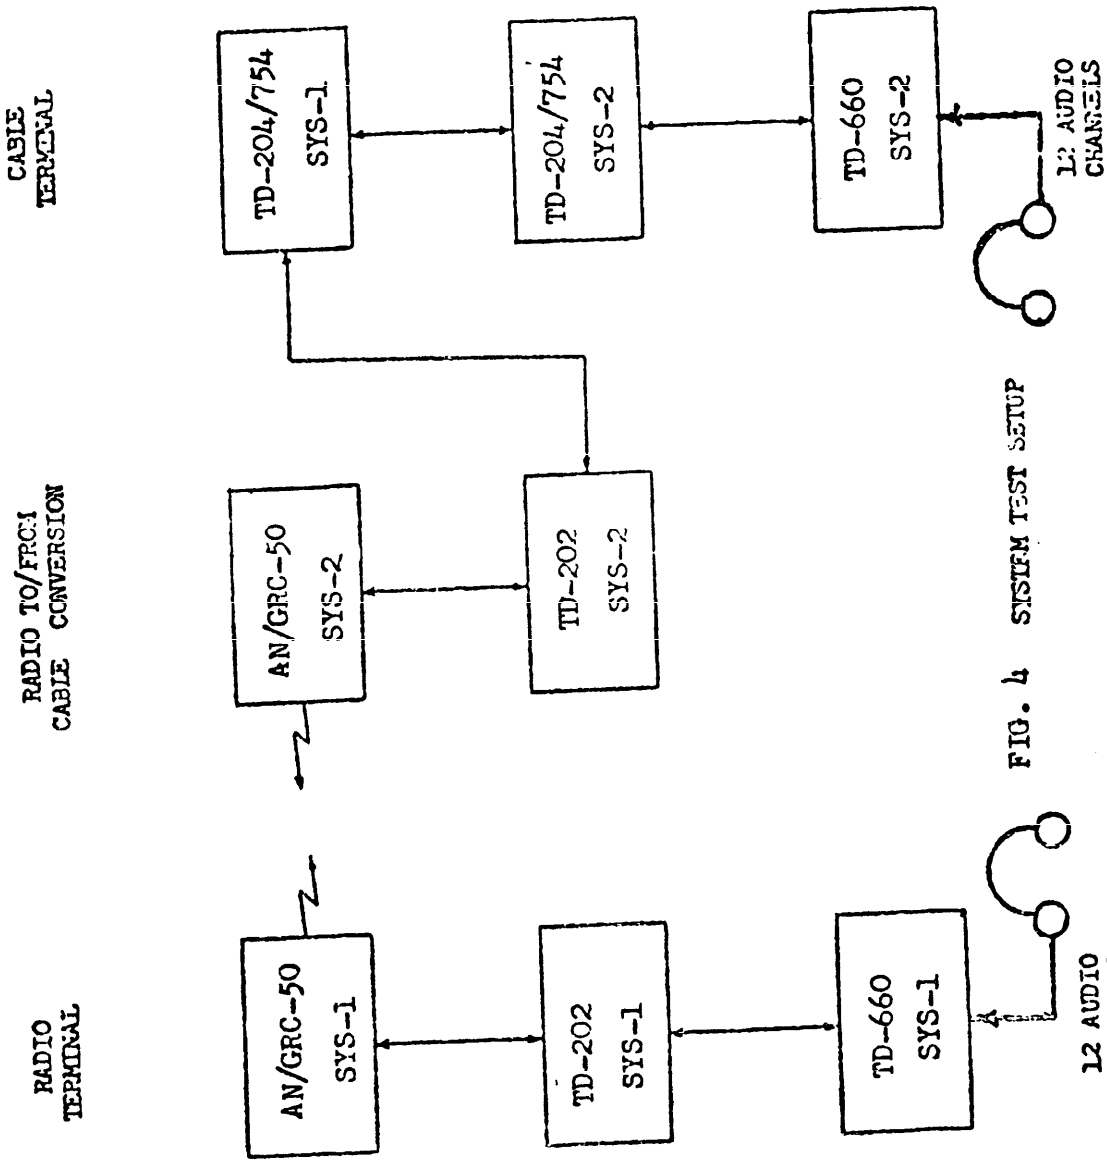


FIG. 4 SYSTEM TEST SETUP

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the currentversion before use.

AN/GRC-50, sys-2	TD-202( )/U, sys-2
PCM IN	TO RADIO XMTR
PCM OUT	FROM RADIO RCVR
PCM ORDER WIRE	ORDER WIRE
TD-202( )/U, sys-1	TD-660( )/G, sys-1
PCM OUT	PCM IN
PCM IN	PCM OUT
TIM OUT	TIM IN
TIM IN	TIM OUT
TD-202( )/U, sys-2	TD-204( )/G, sys-2 or TD-754( )/G
PCM IN-1	PCM OUT-1
PCM OUT-1	PCM IN-1
TIM IN	TIM OUT-1
TIM OUT-1	TIM IN
TD-204( )/G, sys-1 or TD-754( )/G	TD-660( )/G, sys-2
PCM IN	PCM OUT
PCM OUT	PCM IN
TIM IN	TIM OUT
TIM OUT	TIM IN
AN/GRC-50, sys-2	TD-204( )/G, sys-2 or TD-754( )/G
HANDSET	PATCH THRU

b. Interconnect system 1 and system 2 video connectors at video entrance box using cable assembly CX-11230/G.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the currentversion before use.

c. Set Multiplexers TD-660( )/G Combiners TD-202 and Radio Sets AN/GRC-50 for proper operations in accordance with the provided instructions. The dummy loads may be moved accordingly to receive a good signal strength.

d. Tune both radio sets according tc the instructions in the technical manual using the following channels:

Receiver SYS-1	100
Transmitter SYS-1	180
Receiver SYS-2	180
Transmitter SYS-2	100

NOTE: The transmit and receiver frequencies of the AN/GRC-50 must be separated by at least 15 channels. Otherwise, signals developed by cross modulation may cause damage to the receiver crystal.

e. Connect Handset H-156/u to each radio receiver. Ring radio system 1 from radio system 2; ring radio system 2 from radio system 1; establish communications.

f. Connect Headsets H-91A/u to both TD-204's or TD-754's (combiners). Ring combiner system 1 from combiner system 2; ring combiner system 2 from combiner system 1; ring radio order wire system 1 from radio order wire system 2; ring radio order wire system 2 from radio order wire system 1. Establish communications on all 4 phones.

g. Connect the headsets (H-91( )/u) to the TALK MONITOR receptacle of the TD-660/G's.

h. Operate MODE switch of each TD-660/G to 12 CH; 2-wire-4 wire switch to 2-wire; and master/slave switch to master.

i. Operate selector switch I of each TD-660( )/G to SW III.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the currentversion before use.

j. Operate selector switch III of each TD-660( )/G to talk.

k. Operate selector switch IV of each TD-660( )/G to channel 1.

l. Establish communications between headsets.

m. Repeat k and l above for each remaining channels 2 through 12.


n. Repeat a thru l above substituting system 3 for system 1.

4.9 Vehicular transportation test.- The facility shall be secured (and blocked to prevent shifting) to a government furnished 2½ ton, M-35 truck and transported over the specially prepared course described in 4.9.1 for 10 laps at a speed of 5 mph, 10 laps at a speed of 10 mph, 10 laps at a speed of 15 mph and 10 laps at a speed of 18-20 mph. A lap is defined as traversing the course in one direction. The facility shall meet the requirements of paragraph 3.5 after completion of the test.

NOTE: The facility shall be loaded to simulate the AN/TRC-152( ) (V) using live and dummy loads. (See 6.2b for this test).

4.9.1 Vehicular transportation course.- The course for the military truck transportation shall have twelve (12) 4-inch by 8-inch timbers placed 25 feet apart on the 8-inch face and with the 4-inch face fully above ground. The top edges shall have a 1 x 1-inch chamfer. The sixth and twelfth timbers shall be placed at 45 degrees to the direction of travel, and all other timbers shall be placed perpendicular to the direction of travel. The timbers shall be anchored securely by any convenient means. The ground on which the timbers are placed shall be hard and level.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

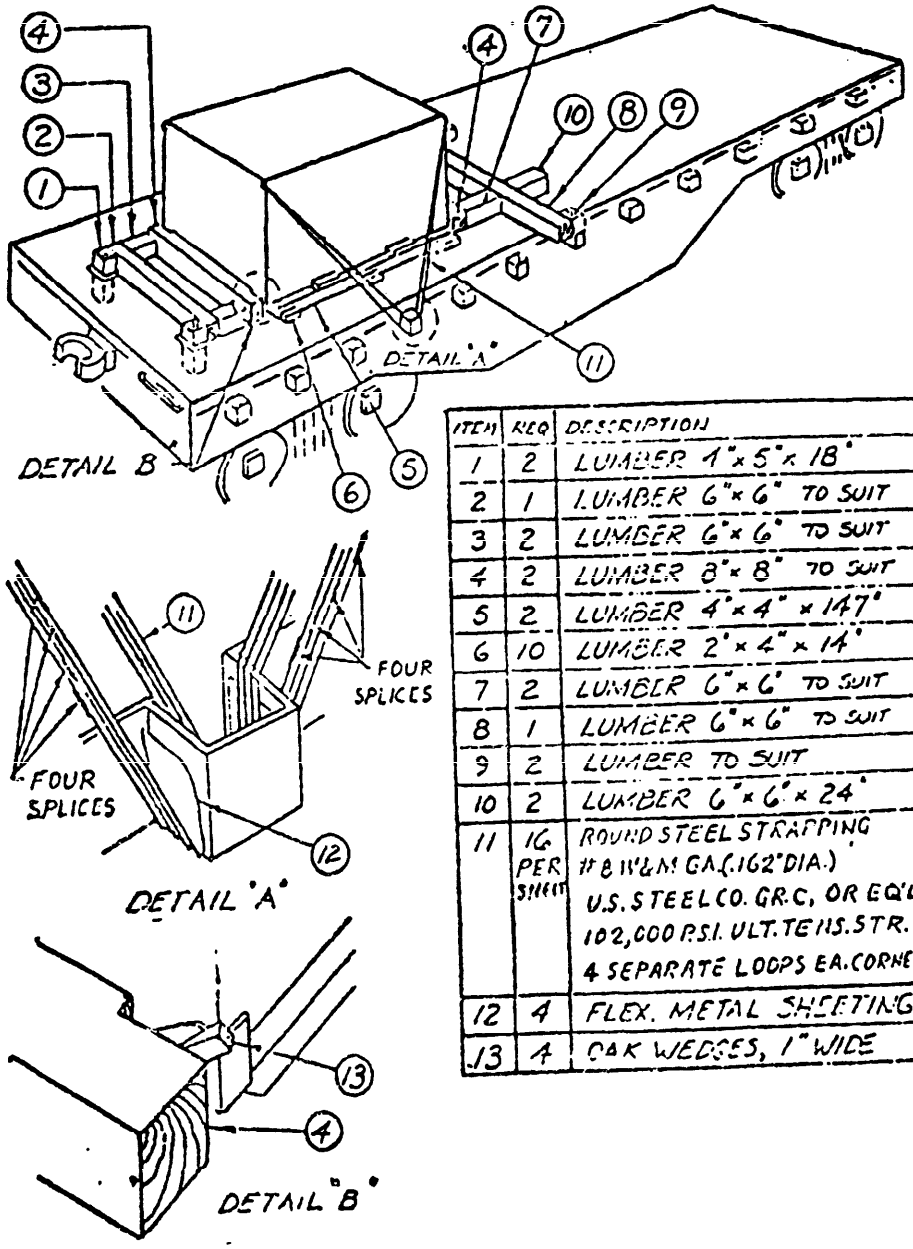

ITEM	REQ	DESCRIPTION
1	2	LUMBER 1"×5"×18"
2	1	LUMBER 6"×6" TO SUIT
3	2	LUMBER 6"×6" TO SUIT
4	2	LUMBER 8"×8" TO SUIT
5	2	LUMBER 4"×4"×147"
6	10	LUMBER 2"×4"×14"
7	2	LUMBER 6"×6" TO SUIT
8	1	LUMBER 6"×6" TO SUIT
9	2	LUMBER TO SUIT
10	2	LUMBER 6"×6"×24"
11	16 PER SHEET	ROUND STEEL STRAPPING #8 W&M GA.(.162"DIA.) U.S. STEEL CO. GR.C, OR EQ'L. 102,000 P.S.I. ULT. TENS. STR. 4 SEPARATE LOOPS EA. CORNER
12	4	FLEX. METAL SHEETING
13	4	OAK WEDGES, 1" WIDE

FIGURE 5 - SHELTER SECURED ON FLATCAR

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

4.10 Rail transport, impact test.- This test shall be performed on a level stretch of track in the manner described in this paragraph. The test flatcar, timber blocking, and shelter facility tiedown strapping shall be as specified in Figure 5 and shall meet the provisions of the test as specified in 4.10.1; the test flatcar, less the shelter facility, and the two empty flatcars coupled to it shall each weigh 45,000 to 55,000 pounds. The loaded gondola car shall meet the provisions of the test as specified in 4.10.2 and shall have a total weight of 165,000 pounds. The loaded gondola car totaling 165,000 pounds traveling at 9 miles per hour (or equivalent energy conditions acceptable to the government) shall be impacted against the stationary loaded testcat coupled to the two empty flatcars, all with brakes off. This test shall be conducted four times; the first two runs shall be with the door-end of the shelter facility facing the loaded gondola car; the second two runs shall be with the door end of the shelter facility facing the opposite direction from the loaded gondola car. The lashing, blocking, and wedges holding the shelter facility in place shall be tight at the start of each run. If the blocking is torn loose or the lashing is broken during the impact, the run shall be repeated. After each impact, the shelter facility shall meet the requirements of 3.6.

4.10.1 Test flatcar.- The wooden planking of the test flatcar bed shall be in good condition. All 6 x 6 inch and 8 x 8 inch blocking shall be secured to the bed of the flatcar using 10 inch spikes on 12 inch centers. The 8 x 8 inch blocking shall be notched to provide ½ inch clearance around the towing eye castings of the shelter; an oak wedge shall be installed into this clearance as shown in the figure referred to above at each of four corners of the shelter. The 4 x 4 inch and 2 x 4 inch blocking shall be nailed to the bed of the flatcar as shown in the figure referred to above. All blocking around the shelter facility shall be snugly against the shelter. (All other blocking shall be snugly abutting as shown in the figure.) The tiedown strapping shall be installed

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

using a strapping machine U.S. Steel Corp., Model GT, or equal. If any tiedown strapping loosens or breaks during any run, it shall be replaced before the next run using new wire and a strapping machine as specified above.

4.10.2 Loaded gondola car.- The load in the loaded gondola car shall be one of the following:

a. A coarse size of either coal, crushed concrete, metal scrap other than sheet metal or metal shavings or other springy forms of metal.

b. Chunks, slab, block, or plate form of the preceding acceptable materials, constrained to prevent shifting during impact.


4.11 Drop tests.-

4.11.1 Flat drop.- The shelter facility loaded as in 4.9 shall be lifted 18 inches from the ground and allowed to fall freely with the skids impacting onto a hard substantial concrete surface. The test shall be performed once. Upon completion of this drop, the facility shall meet the requirements of 3.7.

4.11.2 Rotational drop.- The shelter facility loaded as in 4.9 shall have one skid resting on a nominal 4 inch high timber. The outer edge of the opposite skid shall be raised 18 inches and the shelter facility shall be allowed to fall freely onto a hard substantial concrete surface. This impact shall be performed four (4) times, once for each bottom edge of the shelter facility. On completion of these drops, the shelter facility shall meet the requirements of 3.7.

4.12 Watertightness test.- The shelter facility, without the use of any additional external sealing, caulking, taping, etc. shall be subjected to the following two part test: (Note. Perform tests with inside covers of entrance boxes removed).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

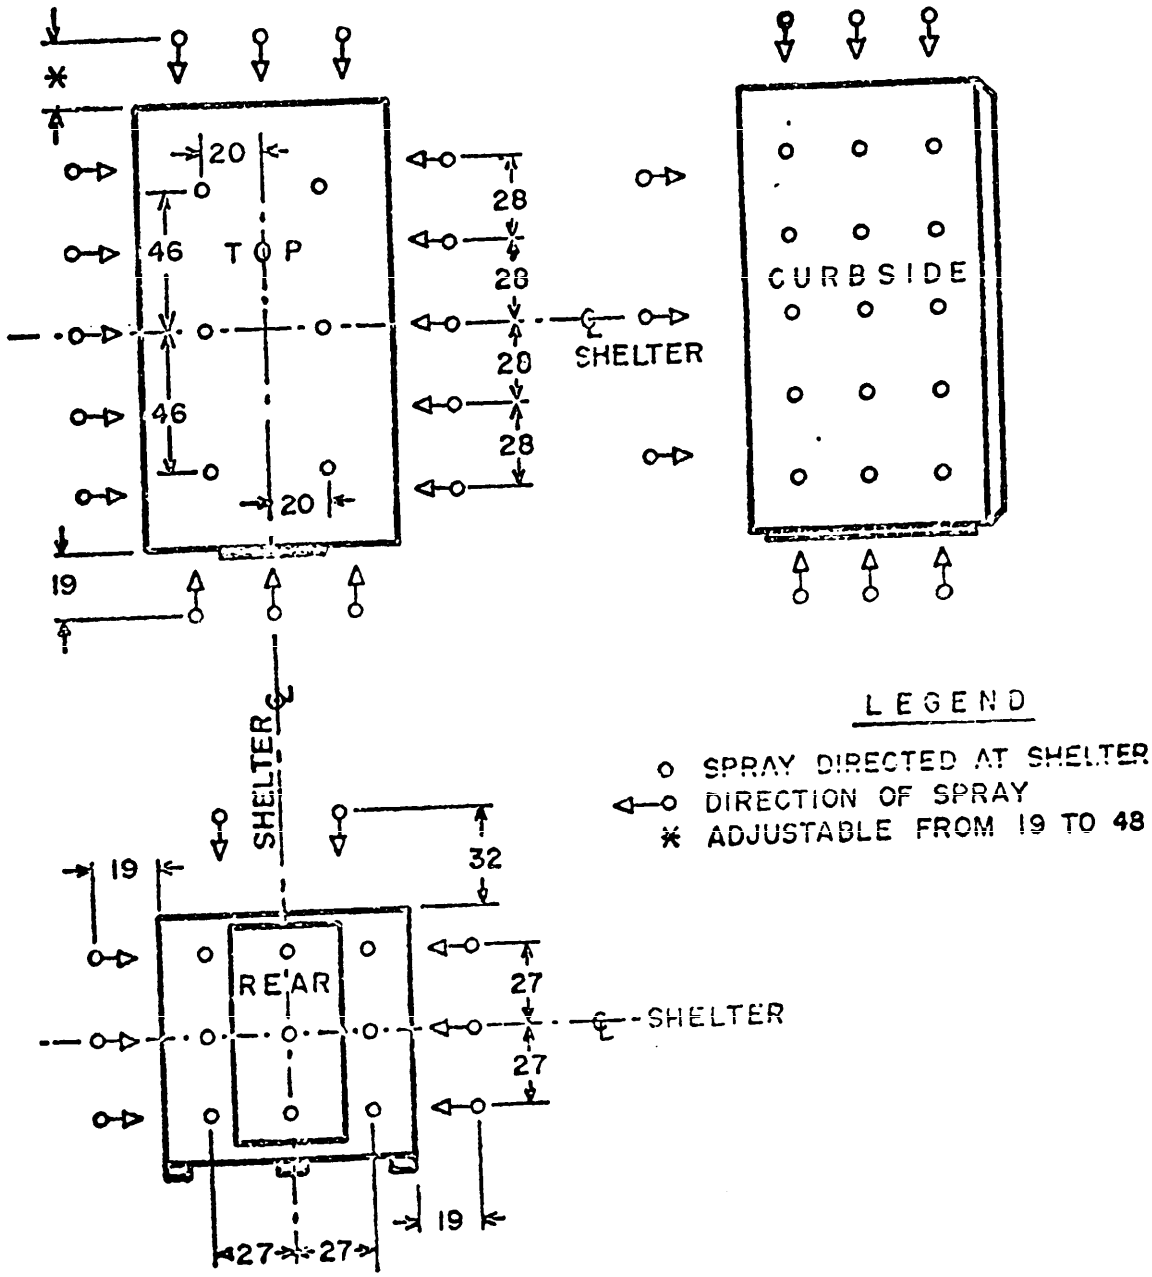

NOTES

1 NOZZLES SHALL BE PERPENDICULAR TO SHELTER.
2 UNLESS OTHERWISE SHOWN ALL DIMENSIONS SHALL BE TAKEN FROM INDICATED CENTER LINES
3 GAGES SHALL BE PERMANENTLY INSTALLED IN PIPING TO INDICATE PRESSURE AT REMOTE NOZZLES.
4 ROADSIDE NOZZLE LOCATIONS SAME AS CURBSIDE.
5 FRONT NOZZLE LOCATIONS SAME AS REAR.
6 DIMENSIONS ARE IN INCHES.

NOZZLE LOCATIONS

FIGURE 6

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

a. Each of the five exposed surfaces of the shelter facility, with covers closed, shall be sprayed with water from nozzles, model G29SQ (or GG29SQ) as made by Spraying Systems Company, Bellwood, Illinois, or equal, pointing directly at the surface and arranged to provide uniform coverage of the surface. Each end panel shall be tested using nine nozzles, each side using fifteen nozzles, and the roof using six nozzles. Each nozzle shall operate at a pressure of forty psig at the nozzle, and shall be located nineteen inches from the panel with the exception of the roof nozzles which shall be at a distance of thirty-two inches. All of the five surfaces shall be simultaneously subjected to the test of this paragraph unless otherwise specified by the contracting Officer. (See Figure 6 for nozzle location). Each panel shall be sprayed for a period of 20 minutes. (If the watertightness test is to be followed by the fording test of 4.13, the bottom row of nozzles may be eliminated with the exception of the nozzles facing the door-end panel). Upon completion of the above test, the shelter facility shall meet the requirements of 3.8. To determine that no water has entered the shelter panels, holes shall be made at points to be determined by the government at the time of testing. After this determination, the holes shall be sealed with rivets and sealer.

b. Open all covers to operating position (with exception of the door vent panel at the rear of the shelter) and repeat a above.

4.13 Fording test.- The shelter facility shall be immersed in water for 1 hour to a depth of 21 inches (measured from the bottom of the skids) and meet the requirements of 3.9. No special fording kits shall be used. The shelter shall be restrained from floating by external tiedowns. To determine that no water has entered the shelter panels, holes shall be made at points to be determined by the government at the time of testing. After this determination, the holes shall be sealed with rivets and sealer.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

4.14 Mounting insert tests.-

4.14.1 Preproduction and Group C insert test.- Four of each size insert shall be randomly selected for test. Each selected insert shall be tested with an axial load followed by a torque load in accordance with Table V. After test, the requirements of 3.10 shall be met. Failure of any insert shall be cause for rejection of the sample shelter facility. This test shall be conducted prior to installation of brackets, racks, etc.

4.14.2 Production Group B insert test.- Five of each size insert (if the total quantity of any size is less than five, all of that size shall be tested) shall be randomly selected for test in each sample shelter facility. Each selected insert shall be tested in accordance with Table V. After test, the requirements of 3.10 shall be met. Failure of any insert shall be cause for rejection of the sample shelter facility. This test shall be conducted prior to installation of brackets, racks, etc.

Table V - Mounting inserts loads

Insert	Group C and Preproduction test		Group B Production Test	
	Axial(lbs)	Torque(in-lbs)	Axial(lbs)	Torque(in-lbs)
5/16-18	2000	100	1000	100
1/4-20	1300	60	650	60
#10-32	600	23	300	23

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

4.15 Testing of solderless terminal-lug connections.- Connections made with solderless terminal-lugs shall be tested for conformance to 3.20.4.

4.16 Inspection for interchangeability.- The dimensions listed below shall be gaged or measured to determine compliance with the physical interchangeability requirements of 3.21. When a dimension is not within specified or design limits, it shall be considered a defect.

a. Size and mounting dimensions of brackets and mounting plates.

b. Size and mounting dimensions of racks, patch panels, and cabinets.

4.17 Visual and mechanical inspection.- The shelter facility shall be examined for the defects listed in Standard MIL-STD-252, the requirements of 3.22 and Table VI.

Table VI - Classification of Visual and Mechanical Defects

Classification	Defects
Major	1. Mounting plates missing or mislocated. 2. Aircraft loading data plate, instruction or nameplate omitted, incorrect or illegible. 3. Welds - cracked or porous. 4. Sealer improperly applied (holes, separations, or lack of adhesion). 5. Mounting inserts missing or mislocated. 6. Burrs or sharp edges in wire duct not removed. 7. Equipments or bracketry loose or missing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

Table VI - Classification of Visual and Mechanical Defects (cont'd)

Classification	Defects
	8. Doors, etc. inoperative. 9. Electrical receptacles, switches, jacks, connections, wire ducts or other electrical components loose, improperly located or inoperative. 10. Locking or holding devices missing or inoperative. 11. Gaps between sections of wire duct exceed 1/16".
Minor	1. Doors not easily operable. 2. Fastening devices difficult to operate. 3. Finish - abrasions or scratches.

4.18 Quality conformance inspection of preparation for delivery.- Preparation for delivery shall be inspected in accordance with Specification MIL-P-116 to determine conformance to the requirements of Section 5.

4.19 Rough handling test (preparation for delivery).- When rough handling test in accordance with Specification MIL-P-116 is required by the contract, the following functional tests shall be conducted to determine freedom from operational malfunction caused by rough handling:

Paragraph 4.7 Electrical installation

Paragraph 4.17 Visual and mechanical

5. PREPARATION FOR DELIVERY

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

5.1 Preservation and packaging.- Preservation, packaging, and packing of the shelter facility shall be in accordance with the applicable requirements of Specification MIL-S-55505.

6. NOTES

6.1 Intended use.- The Shelter, Electrical Equipment S-298( )/TRC-110(V) is the shelter facility portion of the AN/TRC-152( )(V) and it is used to house the operational equipments including:

a. 3 each AN/GRC-50 Radio Set

b. 3 each TD-202( )/U Multiplexer

c. 3 each TD-204( )/G Multiplexer or TD-754( )/G Multiplexer

d. 1 each CN-514( )/GRC Voltage Regulator

e. 1 each TA-312( )/PT Telephone

f. 1 each LS-147( )/FI Intercom

forming the Radio Terminal Set.

6.2 Ordering data.- Procurement documents should specify the following:

a. Title, number and date of this specification and any amendment thereto.

b. Preproduction and Group C inspection of the shelter facility requires use of contractor fabricated dummy loads for the government furnished live loads (radio components) unless otherwise specified in the bid request and contract.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the current version before use.

c. A list of government furnished equipments required as part of the S-298( )/TRC-110(V).

d. A list of equipments to be government loaned for testing purposes.

e. Submission of the statement referenced in 3.18.4 as soon as possible after award of contract. This statement should be submitted to the contracting officer.

6.3 Inspection.- Inspection is the examination or testing, or both, of supplies to determine compliance with applicable requirements. Sampling is an element of inspection.

6.3.1 Examination.- Examination consists of simple, generally non-destructive determinations of compliance, without use of special testing equipment.

6.3.2 Testing.- Testing consists of determinations of compliance, using technical means.

6.4 Group C inspection.- Approval to ship may be withheld, at the discretion of the government, pending the decision from the contracting officer on the adequacy of corrective action. (See 4.5.3.4)

6.5 Nomenclature.- The parentnesis in the nomenclature will be deleted or replaced by a letter identifying the particular design, for example: S-298( )/TRC-110( ). The contractor should apply for nomenclature in accordance with the applicable clause in the contract.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:17Z
Check the source to verify that this is the currentversion before use.

6.6 Verification inspection.- Verification by the government will be limited to the amount deemed necessary to determine compliance with the contract and will be limited in severity to the definitive quality assurance provisions established in this specification and the contract. The amount of verification inspection by the government will be adjusted to make maximum utilization of the contractor's quality control system and the quality history of the product.

Custodian:
Army (EL)

Preparing Activity:
Army - EL

Project No. 5820-A-533

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

SPECIFICATION ANALYSIS SHEET

Form Approved
Budget Bureau No. 22-R255

INSTRUCTIONS: This sheet is to be filled out by personnel, either Government or contractor, involved in the use of the specification in procurement of products for ultimate use by the Department of Defense. This sheet is provided for obtaining information on the use of this specification which will insure that suitable products can be procured with a minimum amount of delay and at the least cost. Comments and the return of this form will be appreciated. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments and suggestions submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or serve to amend contractual requirements.

SPECIFICATION MIL-S-55528A(EL) SHELTER, ELECTRICAL EQUIPMENT S-298( ) TRC-110(V)

ORGANIZATION

CITY AND STATE

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE SPECIFICATION CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY SPECIFICATION REQUIREMENT CONSIDERED TOO RIGID

3. IS THE SPECIFICATION RESTRICTIVE?

☐ YES ☐ NO *(If "yes", in what way?)*

4. REMARKS *(Attach any pertinent data which may be of use in improving this specification. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity)*

SUBMITTED BY *(Printed or typed name and activity - Optional)*

DATE

DD FORM 1 JAN 66 1426

REPLACES EDITION OF 1 OCT 64 WHICH MAY BE USED.

ESC-PM 1068-68

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:17Z
Check the source to verify that this is the current version before use.

FOLD

Department of the Army
Headquarters
U.S.Army Electronics Command
Fort Monmouth, New Jersey 07703

POSTAGE AND FEES I

OFFICIAL BUSINESS

Commanding General
U.S.Army Electronics Command
ATTN: AMSEL- PP-ED
Fort Monmouth, New Jersey 07703

FOLD

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:17Z
Check the source to verify that this is the current version before use.