MIL-S-55589A(EL)
~~9 September 1970~~
Superseding
MIL-S-55589(EL)
19 January 1968

MILITARY SPECIFICATION

SHELTER, ELECTRICAL EQUIPMENT
S-335()/TRC-113

1. SCOPE

1.1 Scope.- This specification covers the air or vehicular transportable shelter facility part of the Repeater Set, Radio AN/TRC-113() which is capable of providing multiplex repeater facilities for 6 or 12 channels of voice frequency communications for radio or cable transmission or is capable of providing radio terminal facilities for a radio terminal of 3 circuits.

1.2 Description.- Shelter, Electrical Equipment S-335()/TRC-113 hereinafter called the shelter facility, includes a modified S-250()/G Shelter and all racks, brackets, shelves, tie-downs, electrical components and wiring to enable installation and operation of the assemblage components of the AN/TRC-113().

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this document to the extent specified herein:

SPECIFICATIONS

MILITARY

MIL-P-116	Preservation, Methods of
MIL-C-3885	Cable Assemblies and Cord Assemblies (for use in Electronic and Associated Electrical Equipment)
MIL-W-6858	Welding, Aluminum, Magnesium, Non-Hardening Steels or Alloys and Titanium, Spot, Seam and Stitch

FSC -5820

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

MIL-T-7928	Terminals, Lug and Splice, Crimp Style, Copper
MIL-M-13231	Marking of Electronic Items
MIL-F-14072	Finishes for Ground Signal Equipment
MIL-W-45205	Welding, Gas,Metal-Arc & Gas,Tungsten-arc, Aluminum Alloys, Readily Weldable, for Structures, Excluding Armor
MIL-S-55505	Shelter, Electrical Equipment (Containing Equipment) Packaging and Packing of

STANDARDS

MIL-STD-252	Wired Equipment,Classification of Visual and Mechanical Defects
MIL-STD-461	Electromagnetic Interference Characteristics Requirements for Equipment
MIL-STD-1235	Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes.

DRAWINGS

ELECTRONICS COMMAND

SC-A-46691	RF Cable Assembly Test
DL-SC-A-627002	Shelter, Electrical Equipment S-335()/TRC-113
SC-D-627056	Power Schematic
SC-D-627057	Power Wiring Diagram AN/TRC-113
SC-D-627083	Order Wire Assembly
SC-F-627089	Signal Schematic
SC-D-627092	Repeater Cable Assembly
SC-D-627148	Order Wire Assembly

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

(Copies of specifications, standards, drawings, and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer. Both the title and number or symbol should be stipulated when requesting copies).

3. REQUIREMENTS

3.1 Preproduction sample.- Unless otherwise specified in the invitation for bids and contract, the contractor shall furnish one preproduction sample of the shelter facility for approval. (See 4.3)

3.2 Construction.- The shelter facility shall be constructed in accordance with drawings as listed on DL-SC-A-627002. (see 4.6)

3.3 Electrical installation.-

3.3.1 Power system wiring and components.- Installation of power wires and components (including cable assemblies, receptacles, switches, meters, circuit breakers, neon lamps, fluorescent lamps, incandescent lamps, lighting fixtures, distribution assembly system, and wiring components) constituting a three wire electrical power distribution system, shall be installed and wired in accordance with the drawings. The completed in-place power distribution system shall meet the following requirements:

3.3.1.1 Continuity of conductors.- The point-to-point resistance of all power-line conductors shall be less than 3 ohms when tested in accordance with 4.7.1 and 4.7.1.1.

3.3.1.2 Dielectric strength of insulation.- The insulation of all power-line wires,cables, and components shall withstand a potential of 500 volts DC applied continuously for not less than 30 seconds when tested in accordance with 4.7.1 and 4.7.1.2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

3.3.1.3 Insulation resistance.- The resistance of insulation between any two of the three power-line conductors and also between each of the two ungrounded power-line conductors and shelter facility ground terminal shall not be less than 100 megohms when tested in accordance with 4.7.1 and 4.7.1.3.

3.3.2 Power distributional and operational functions.- Main power branch distribution and circuit functions thereof shall meet the operational requirements as shown by Power Schematic Drawing SC-D-627056, when tested in accordance with 4.7.2.

3.3.3Signal (audio) system wiring and components.- Installation of signal (audio) wires, cables, and wiring components (including binding posts, connectors, plugs, jacks, receptacles, and wiring devices) shall be installed and wired in accordance with the drawings. The completed in-place signal system installation shall meet the following requirements.

3.3.3.1 Continuity of conductors.- The resistance between both end terminations of all signal-line conductors shall not exceed 5 ohms when tested in accordance with 4.7.3.1.

3.3.3.2 Dielectric and insulation resistance tests.- The insulation of all signal wires,cables, and components shall withstand a potential of 500 volts DC applied continuously for not less than 5 seconds and the insulation resistance shall not be less than 100 megohms when tested in accordance with 4.7.3.2.

3.3.4 Video and radio frequency (RF), system wiring and components. Installation of video and RF cable assemblies and connecting components (including plugs, connectors, adapters, fittings, receptacles, and lightning protectors) shall be in accordance with the drawings. The completed in-place video and RF system installation shall meet the following requirements:

3.3.4.1 Continuity of conductors.- The point-to-point resistance between the following video and RF cable terminations shall not exceed 3 ohms when tested in accordance with 4.7.4.1.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

a. Both end terminations of the inner conductor.

b. Both end terminations of the outer conductor (shield).

3.3.4.2 Dielectric and insulation resistance tests.- The insulation of all video and RF cables, components and lightning arrestors shall withstand the following potentials with the insulation resistance not less than 100 megohms when tested in accordance with 4.7.4.2.

a. 1500 volts DC applied continuously for not less than 30 seconds to all video cable assemblies terminated at the video and antenna entrance boxes with lightning protectors removed.

b. 1100 volts DC applied continuously for not less than 30 seconds to all video cable assemblies terminated at the video and antenna entrance boxes with lightning protectors elements in place.

c. 1500 volts DC applied continuously for not less than 30 seconds to all antenna cable assemblies terminated at the video and antenna entrance boxes.

d. 1500 volts DC applied continuously for not less than 5 seconds to all RF cable assemblies terminated at the Video Patch Panel.

3.3.4.3 Voltage standing wave ratio (VSWR), RF transmission lines.- The VSWR of all antenna cable assemblies shall not exceed 1.20 at transmission frequencies of 220 megahertz, 400 megahertz, 700 megahertz and 1000 megahertz, when tested in accordance with paragraph 4.7.4.3.

3.3.5 Cable assemblies.- (See 4.4)

3.3.5.1 Cable assemblies, power and audio frequency.- All power and audio frequency cable and cord assemblies shall be fabricated in accordance with the drawings and meet the requirements of MIL-C-3885.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

3.3.5.2 Cable assemblies, radio frequency.- Radio frequency cable assemblies required for operation of major items of equipment in 6.1 shall be fabricated in accordance with the drawings and meet the requirements and tests as indicated in Drawing SC-A-46691.

3.3.6 Suppression of electromagnetic interference.- The motors in the ventilating equipment of the shelter facility shall meet the emanation limits of MIL-STD-461 if other than those items specified on the drawings. (See 4.4)

3.4 System operation.- With all the equipment in the AN/TRC-113() assemblage installed and with the multiplexers and combiners positioned so as to facilitate testing, the operational requirements of all audio and RF cable assemblies, patch panel and electric heaters shall be met when tested in accordance with paragraph 4.8.

3.5 Vehicular transportation.- The shelter facility shall be capable of being transported over cross-country terrain by military vehicles without sustaining any damage such as buckling, cracking, delamination, or other permanent deformation. (See 4.9)

3.6 Railroad transportation.- The shelter facility shall be capable of being loaded, blocked, and braced on a flatcar for shipment by rail. When so loaded, the shelter facility shall be subjected to and withstand the test of paragraph 4.10 without sustaining any damage as mentioned in paragraph 3.5.

3.7 Drops, flat and rotational.- The shelter facility shall be capable of withstanding drops of 18 inches onto concrete. The shelter facility shall be subjected to and withstand the tests of 4.11.1 and 4.11.2 without sustaining any damage as mentioned in paragraph 3.5.

3.8 Watertightness.- The shelter facility shall be capable of withstanding the test of 4.12 without leakage of water into the shelter facility.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

3.9 Fording.- The shelter facility shall be capable of being immersed in water to a depth of 26 inches, measured from the bottom of the skids, for 1 hour without any leakage of water into the shelter facility. (See 4.13)

3.10 Mounting inserts.- All mounting inserts shall be installed without the use of any auxiliary materials such as adhesive and, when installed, each insert shall be capable of withstanding the tensile load and the torque load referenced in (4.14). The insert shall not have rotated from its original position, and there shall be no permanent distortion of the shelter mounting surface or insert head or threads. The insert head shall be properly seated and tight against its bearing surface. Insert threads shall be free of paint.

3.11 Cleaning.- After fabrication, parts shall be cleaned in accordance with good commercial practice or as specified in the applicable portions of Specification MIL-F-14072. Cleaning processes shall have no deleterious effect. Corrosive material shall be removed completely before the parts are assembled. After assembly, units shall be cleaned thoroughly and shall be free from particles of solder, flux, scale, and any other foreign material. In addition, when necessary, such cleaning shall also be performed before and after final assembly of the units.

3.12 Finish.- The shelter facility shall be finished in accordance with Specification MIL-P-14072 and the drawings.

3.13 Marking.-

3.13.1 General.- Marking shall conform to Specification MIL-M-13231 and the drawings.

3.13.2 Nameplates.- Shelter facility shall be provided with a nameplate in accordance with the drawings. Each nameplate shall be imprinted with a sequential serial number.

3.13.3 Aircraft loading data plate.- The shelter facility shall be provided with data plates in accordance with the drawings, imprinted with the dimensions which locate the center-of-gravity of the shelter facility and the assemblage in the three reference planes;the gross weight of the shelter facility and assemblage;

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

and the bearing pressure on the bottom of the skids. The shelter assemblage is the shelter facility with operational equipments or dummy loads in place. The locations of the centers-of-gravity shall be determined by the contractor using the preproduction sample.

3.13.4 Interior and exterior marking.- All interior and exterior markings shall be as defined on the drawings.

3.14 Riveting.- Riveted joints shall be tight, the joined parts shall be undamaged, and the rivet heads shall be properly seated and tight against their bearing surfaces.

3.15 Seal,water vapor.- All joints of the framing for the exhaust blowers, power, signal, and video entrance boxes, and any other framed openings shall be sealed to provide a barrier against the entrance of water vapor to the core material of the shelter panels and to the interior of the shelter. All joints and edges shall be assembled and sealed in a manner to prevent collection and retention of moisture. All exterior rivets, screws, and fasteners shall be dipped in sealer prior to installation. The sealer shall be a one-part sealant, Silicone Construction Sealant SE-1204, as made by General Electric Corp., or equal.

3.16 Securing of parts.- Brackets,lugs, flanges, inserts, bolts, and other mounting arrangements shall retain components of the facility securely so that loosening, wear of mounting arrangements, or permanent separation of parts or components will not occur when the equipment is subjected to the specified drop and transport tests.

3.16.1 Screws, threaded devices, and related parts.- Screws, threaded devices and related parts shall be as defined by the drawings. Thread forming screws shall not be used.

3.17 Soldering.-

3.17.1 Solder and flux.- Solder and flux shall be as defined on the drawings.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

3.17.2 Acid or acid salts.- No acid or acid salts shall be used in preparation for or during soldering; however, exception is permitted for preliminary tinning of electrical connections and for tinning of electrical connections and for tinning or soldering of mechanical joints not used to complete electrical circuits, but in no case shall acid or acid salts be used where they can come in contact with insulation material. Where acid or acid salts are used, as permitted above, they shall be completely neutralized and removed immediately after use.

3.17.3 Process.- There shall be no sharp points or rough surfaces resulting from insufficient heating. The solder shall feather out to a thin edge, indicating proper flowing and wetting actions, and shall not be crystallized, over-heated, or under heated. The minimum necessary amount of flux and solder shall be used for electrical connections. Any means employed to remove an unavoidable excess of flux shall not incur the risk of loose particles of flux, brush bristles, or other foreign material remaining in the equipment; flux being spread over a larger area; or damage to the equipment. Insulation material that has been subjected to heating during the soldering operation shall be undamaged and parts fastened thereto shall not have become loosened.

3.18 Tropicalization of material.- Canvas,webbing,wood,etc shall be treated to be resistant to moisture and fungi as on the drawings and as follows:

3.18.1 Treating materials.- Treating materials containing a mercury-bearing fungicide shall not be used. The contractor shall determine that the treating material is compatible with the material or surface to be treated. Selection of treating materials shall be such that any increase in flammability of treated material be held to the practical minimum.

3.18.2 Toxicity.- Treating materials shall cause no skin irritation or other injury to personnel handling the treated material during fabrication, transportation, operation, or maintenance of the equipment, or during use of the finished items when used for the purpose intended.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

3.18.3 Flexibility.- Treatment shall not affect the flexibility of treated materials, to the extent that the equipment may fail to meet specified requirements when subjected to specified service conditions.

3.18.4 Statement of treatment.- The contractor shall submit for approval, to the contracting officer, a statement describing in detail the materials to be treated and the treating materials and processes that he proposes to use. (See 6.2e)

3.19 Welding.- Welded joints shall be as defined by the drawings and shall be such that grinding on the finished weld will be unnecessary except where grinding is specified on the drawings. Inert gas-shielded arc welding (MIG) using helium, argon, or a mixture of the two shall be used for arc welding of aluminum. Welds shall conform to MIL-W-6858 CL.B and MIL-W-45205 CL.B as applicable; surfaces to be welded shall be cleaned in accordance with good commercial practice and shall be free of scale, paint, grease, and other foreign materials. Welds shall have thorough penetration and good fusion and shall be free of scabs, blisters, abnormal pock marks, cracks, voids, slag inclusions, and other harmful defects. Inert-gas-shielded arc welding shall be used for welding of aluminum except where spot welds are used. Welded assemblies shall be cleaned to remove any scale, oxidation products, and excess flux. Any acid used in cleaning shall be completely neutralized and removed. (See 4.4)

3.20 Wiring and cabling.- Wiring and cabling shall be accordance with the drawings and shall be neat and sturdy.

3.20.1 Slack.- Wires and cables shall be as short as practical except that sufficient slack shall be provided:

a. To prevent undue stress on cable forms, wires, and connections.

b. To permit removal from rack of operational equipments having wiring or cables to connectors at back of equipment so that cable may be connected or disconnected.

c. To facilitate field repair of broken or cut wires.

d. To prevent chafing or breaking or wires due to repeated flexing of hinged parts.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

3.20.2 Protection.- Wires and cables shall be so placed and protected as to avoid contact with rough or irregular surfaces or sharp edges. Wires shall not be bent sharply where they enter insulation material.

3.20.3 Splicing.- Wires in a continuous run between two terminals shall not be spliced during the wiring operation unless specifically indicated by the drawings.

3.20.4 Crimping of solderless terminal lugs.- Crimping of solderless terminal lugs shall be so accomplished that the connections will meet the resistance (voltage drop) and tensile strength requirements and tests of Specification MIL-T-7928. (See 4.4 and 4.15)

3.20.5 Identification of wiring.- Wiring shall be identified by color-coding and wire pair marking, as indicated on the drawings.

3.21 Interchangeability.- Like units, assemblies, sub-assemblies, and replaceable parts shall be physically and functionally interchangeable without modification of such items or of the equipment, (See 4.16). Individual items shall not be hand-picked for fit or performance. Reliance shall not be placed on any unspecified dimension, rating, characteristic, etc.

3.22 Workmanship.- The equipment shall be manufactured and assembled in accordance with the applicable portions of the following paragraphs: (See 4.17)

3.2	Construction
3.3	Electrical installation
3.10	Mounting inserts
3.11	Cleaning
3.12	Finish
3.13	Marking
3.14	Riveting
3.15	Seal,water vapor
3.16	Securing of parts
3.17	Soldering
3.18	Tropicalization
3.19	Welding
3.20	Wiring and cabling
3.21	Interchangeability

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection.- Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified the supplier may utilize his own facilities, including test meters and instruments, or those of any commercial laboratory acceptable to the government. The government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure that supplies and services conform to prescribed requirements.

4.2 Classification of inspection.- Inspection shall be classified as follows:

a. Preproduction inspection (does not include preparation for delivery). (See 4.3)

b. Inspection covered by subsidiary documents. (See 4.4)

c. Quality conformance inspection.

(1) Quality conformance inspection of equipment before preparation for delivery. (See 4.5)

(2) Quality conformance inspection of preparation for delivery. (See 4.18)

4.3 Preproduction inspection.- This inspection shall be performed by the contractor on the preproduction unit unless otherwise specified in the contract. (See 3.1) It shall consist of the inspection specified in Table I, the inspection specified in the subsidiary documents covering the items listed in 4.4, and the inspection specified for Group A, Group B, and Group C (see Inspection Tables II,III, and IV, respectively). The preproduction inspection shall be performed in this order, unless otherwise specified:

a. Mounting inserts
b. Power wiring
c. Signal wiring
d. Video & RF wiring
e. System operation
f. Vehicular transportation
g. Rail transportation
h. Flat drop
i. Rotational drops
j. Watertightness
k. Fording

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

The last tests performed shall be a repeat of the power, signal, and video wiring; and system operation tests. Remaining preproduction tests specified for Groups A,B and C inspections but not included in the above list shall be performed in any order satisfactory to the contracting officer.

Table I - Preproduction Inspection

Inspection (For additional preproduction Inspection see 4.3)	Req Para	Insp Para
System operation	3.4	4.8
Vehicular transportation	3.5	4.9
Rail transportation	3.6	4.10
Mounting inserts	3.10	4.14.1

4.4 Inspection covered by subsidiary documents.- The following shall be inspected under the applicable subsidiary documents as part of the inspection of equipment before preparation for delivery:

Item	Where required
Cable assemblies	3.3.5
Suppression, EMI	3.3.6
Finish	3.12
Marking	3.13
Welding	3.19
Terminals	3.20.4

4.5 Quality conformance inspection of equipment before preparation for delivery.- The contractor shall perform the inspection specified in 4.4 and 4.5.1 through 4.5.4. This does not relieve the contractor of his responsibility for performing any additional inspection which is necessary to control the quality of the product and to assure compliance with all specification requirements. The government will review and evaluate the contractor's inspection procedures and examine the contractor's inspection records. In addition, the government - at its discretion - may perform all or any part of the specified inspection to verify the contractor's compliance with specified requirements.(See 6.6) Test equipment for government verification inspection shall be made available by the contractor.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

4.5.1 Group A inspection.- Each unit of equipment shall be inspected for conformance to all the inspection and test requirements of Table II of this specification. Equipment conforming to the above requirements shall be verified by the contractor, utilizing the procedures for the multilevel continuous sampling plan (CSP-M) of MIL-STD-1235, unless otherwise specified.

Table II - Group A Inspection

Inspection	Rqr Para	Insp Para	AOQL % Def Major	AOQL % Def Minor
Visual and Mechanical	3.22	4.17	1.5 (AQL 1.0%)	5.0 (AQL 4.0%) **
Electrical				
Power wiring			1.5 (AQL 1.0%) for the entire group of power signal and video wiring	
Continuity	3.3.1.1	4.7.1.1		
Dielectric strength	3.3.1.2	4.7.1.2		
Insulation resistance	3.3.1.3	4.7.1.3		
Power distribution	3.3.2	4.7.2 thru 4.7.2.3		
Signal wiring				
Continuity & circuit resistance	3.3.3.1	4.7.3.1		
Dielectric strength	3.3.3.2	4.7.3.2		
Insulation resistance	3.3.3.2	4.7.3.2		
Video wiring				
Continuity & circuit resistance	3.3.4.1	4.7.4.1		
Dielectric strength	3.3.4.2	4.7.4.2		
Insulation resistance	3.3.4.2	4.7.4.2		
"VSWR"	3.3.4.3	4.7.4.3		

** All defects are major

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

4.5.1.1 Group A Verification sampling plan.- The Group A Verification Sampling plans for the AOQL's listed in Table II of this specification shall be selected from Tables VIII,IX and X of MIL-STD-1235 which are for f=½. The number of units in the Production Interval shall be the entire production quantity unless otherwise specified in the contract.

4.5.2 Group B inspection.- This inspection, including sampling, shall conform to Table III and to the procedures for multi-level continuous sampling plan (CSP-M) of Standard MIL-STD-1235, unless otherwise specified. Group B inspection shall be performed on units of production that have passed Group A inspection, except for Mounting Insert and Interchangeability Inspections which are performed prior. The government reserves the right to require complete retest of any sample which is reworked after failing Group Binspection.

Table III - Group B Inspection

Inspection	Rqr Para	Insp Para	AOQL % Def (see 4.5.2.1)
Mounting insert	3.10	4.14.2	5.0(AQL 4.0%)
Watertightness	3.8	4.12	3.0(AQL 2.5%)
Fording	3.9	4.13	3.0(AQL 2.5%)
Interchangeability	3.21	4.16	5.0(AQL 4.0%)

4.5.2.1 Group B sampling plans.- The Group B sampling plans for the AOQL's listed in Table II of this specification shall be selected from Tables VIII,IX and X of MIL-STD-1235 which are for f=½. The number of units in the Production Interval shall be the entire production quantity unless otherwise specified in the contract.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

4.5.3 Group C inspection.- This inspection shall be as listed in Table IV, and shall normally be performed on sample units that have been subjected to and met Group A and Group B inspection.

Table IV - Group C Inspection

Inspection	Rqr Para	Insp Para
Construction verification	3.2	4.6
Drops, flat and rotational	3.7	4.11
Solderless-terminal-lug-connection	3.20.4	4.15

4.5.3.1 Sampling for inspection of construction evaluation.- The Equipment Verification Review, in accordance with paragraph 4.6 shall be performed once on each part and assembly, randomly selected, and their installation into one of first 10 shelter facilities produced.

4.5.3.2 Sampling for inspection of drop tests.- One sample shall be selected at random from the first 50 units or fraction thereof, and one sample from each additional 150 units or fraction thereof, produced and subjected to the drop tests.

4.5.3.3 Sampling for inspection of solderless-terminal-lug connections. Five specimens of each combination of wire and terminal shall be prepared each week for inspection. A specimen is a 1 foot length of wire on which a terminal lug has been applied, using the same tools and procedures used in crimping the terminal lugs in production.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

4.5.3.4 Noncompliance.- The contractor shall immediately report in writing each Group C failure occurrence, including details of the failure and characteristics affected. The contractor shall immediately investigate the cause of failure and further report the results of investigation and details of the proposed corrective action on (i) the process and materials, as applicable, and, (ii) all units or product which were manufactured under the same conditions and which the government considers subject to the same failure. Reports shall be forwarded to the responsible technical activity designated in the contract through the Quality Assurance Representative. After corrective action has been taken, additional sample units shall be subjected to Group C inspection (all inspections, or the inspections which the sample failed; at the option of the government) and Groups A and B inspection may be reinstituted; final acceptance and shipment will be withheld until the Group C reinspection results have shown that the corrective action was effective.

4.5.4 Reinspection of conforming Group B and Group C sample units.- Unless otherwise specified, sample units which have been subjected to and passed Group B or Group C inspection, or both, may be accepted on contract, provided that they are resubjected to and pass Group A inspection after repair of all visible damage (See 6.4)

4.6 Construction verification.- The contractor shall perform an Equipment Verification Review (EVR), consisting of a complete technical audit of the equipment on order against the drawings (see 3.2) cited in the Technical Data Package (as supplemented by all approved engineering changes). EVR shall consist of the following:

a. An audit to establish that "as-built" shelter facilities, including individual parts, their use in subassemblies and assemblies (components), and their final installation into the shelter forming the shelter facility, are in accordance with the end product drawings.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

b. An audit to establish that "as-built" shelter facilities, including parts, components and their installation, meet the acceptance requirements specified in the Technical Data Package for each shelter part, component, and shelter facility. The audit shall record all acceptance test methods used together with resulting verification test data.

c. Preparation of EVR report(s) containing the following information:

(1) Identification of parts, components, shelter facilities and details proving compliance with 4.6 a and b above.

(2) Discrepancies noted.

(3) Corrective action taken.

d. Two (2) copies of the EVR report shall be submitted no later than 15 days prior to the submission of the first production unit or lot to the government technical organization cited in the contract. The results of the EVR shall be subject to verification by authorized government personnel at the time the first unit or production lot is offered for acceptance. Government verification will be to the depth and extent necessary to demonstrate that the "as-built" hardware is in accordance with the cited drawings. Copies of the EVR reports shall be made available to government personnel during the verification. The contractor shall provide the following:

(1) Segregation of parts, components of shelter facilities, to permit reviewing government personnel access for detailed inspection. The contractor shall also provide personnel to disassemble any parts of the shelter facility necessary to permit government review of the shelter facility, its components and their installation, and to reassemble parts after inspection.

(2) Have as required, responsible personnel from each functional department available for discussions in their respective areas.

(3) Adequate administrative support for the EVR.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:18Z
Check the source to verify that this is the current version before use.

4.7 Electrical installation tests.- The test of 4.7.1 through 4.7.4 shall be performed on each shelter facility prior to installation of other major components comprising the AN/TRC-113. Before applying power to the shelter facility, an electrical ground at the power entrance box shall be made. Power to the shelter facility shall be 115 volts AC, 60 cycles, single phase.

4.7.1 Power system and components installation tests.- Prior to conducting power wiring and components tests of 4.7.1.1, 4.7.1.2, and 4.7.1.3, the following shall be accomplished: (Refer to drawings SC-D-627056 and SC-D-627057)

a. Remove or disconnect the following electrical loads:

(1) All fluorescent, incandescent, and neon (power indicator and power distribution box) lamps.

(2) All fluorescent lamp starters.

(3) Blowers and heaters.

b. Remove power distribution box cover panel and disconnect both conductors from the voltmeter terminals. Position or isolate disconnected leads so that they do not short to each other or to shelter facility ground.

4.7.1.1 Continuity of conductors.- Continuity resistance which meets the requirements of 3.3.1.1 shall be performed on each power circuit in accordance with the following paragraphs. A calibrated low resistance reading ohmmeter or equivalent shall be used in performing the test.

a. Place the following circuits in the ON position:

(1) Fluorescent Lights switch
(2) Incandescent co[illegible] start lights switch
(3) Blower-1 switch
(4) Blower-2 switch
(5) Main circuit breaker CB8
(6) Branch circuit breakers CB1 thru CB7 and CB9

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

b. Place BLACKOUT/BYPASS switch to the BYPASS position.

c. Place EQUIPMENT/HEATER-2 switch to the HEATER-2 position.

d. Measure continuity resistance from pin 1 of power connector IN located at power entrance box to the following: brass (hot) contacts of outside power receptacle J3, Convenience power receptacles J4, J6, and J16, Heater-2 power receptacle J5, Blowers-1 and -2 power receptacles J7 and J8, Heater-1 power receptacle J9, and Intercom power receptacle J17; black wire termination at each fluorescent lamp DS10 thru DS12, DS17 and DS18; black wire termination at each incandescent lamp DS13 thru DS16; and pin 1 of power OUT connector at power entrance box.

e. Measure continuity from pin 1 of power connector IN to the brass (hot) contact of each Equipment receptacle J10 thru J15. No continuity shall exist.

f. Place EQUIPMENT/HEATER-2 switch to the EQUIPMENT position.

g. Measure continuity resistance from pin 1 of power connector IN to the brass (hot) contact of each Equipment receptacle J10 thru J15.

h. Measure continuity from pin 1 of power connector IN to the brass (hot) contact of Heater-2 receptacle. No continuity shall exist.

i. Place all controls listed under a above in the OFF position except main circuit breaker.

j. Place BLACKOUT/BYPASS switch to the BLACKOUT position.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

k. Measure continuity resistance from pin 2 of power connector IN to the following: silver (neutral) contacts of outside power receptacle J3, Convenience power receptacles J4,J6, and J16, Blowers-1 and -2 power receptacles J7 and J8, Heater-1 power receptacle J9, Equipment power receptacles J10 thru J15, and Intercom power receptacle J17; white wire termination at each fluorescent lamp DS10 thru DS12, DS17 and DS18; white wire termination at each incandescent lamp DS13 thru DS16; and pin 2 of power OUT connector.

l. Measure continuity from pin 2 of power IN connector to the silver (neutral) contact of Heater-2 receptacle. No continuity shall exist.

m. Place EQUIPMENT/HEATER-2 to the HEATER-2 position.

n. Measure continuity resistance from pin 2 of power connector IN to the silver (neutral) contact of Heater-2 receptacle.

o. Measure continuity from pin 2 of power OUT connector to the silver (neutral) contact of each Equipment receptacle J10 thru J15. No continuity shall exist.

p. Place main circuit breaker in the OFF position.

q. Measure continuity resistance from pin 4 of power connector IN to the following: green (ground) contacts of outside power receptacle J3, Convenience power receptacles J4,J6, and J16, Heater-2 power receptacle J5, Blowers-1 and -2 power receptacles J7 and J8, Heater-1 power receptacle J9, Equipment power receptacles J10 thru J15, and Intercom power receptacle J17; all ground terminals located at the power entrance box, power distribution box, video entrance box,and raceway; and pin 4 of power OUT connector.

r. Resistance measurements made in steps d,g,k,n, and q above, shall meet the requirements of 3.3.1.1.

4.7.1.2 Dielectric breakdown voltage.- Dielectric strength tests which meet the requirements of 3.3.1.2 shall be performed on each power circuit in accordance with the following paragraphs. A non-destructive DC dielectric tester shall be used in performing the test.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

NOTE: Take preventive measures that will preclude personnel from coming into contact with conductors under test during performance of ALL dielectric and insulation resistance test. Discharge each conductor to ground following each test, to eliminate danger of shock.

a. Place all circuit controls listed under 4.7.1.1a in the ON position except FLUORESCENT Lights switch.

b. Place EQUIPMENT/HEATER-2 switch to the EQUIPMENT position.

c. Place BLACKOUT/BYPASS switch to the BYPASS position, and lock shelter facility door securely.

d. Test between pins 1 and 4 of power connector IN. Adjust tester for a value of not less than 500 volts DC output and maintain this potential for 30 seconds. The requirements of 3.3.1.2 shall be met.

e. Repeat step c above with EQUIPMENT/HEATER-2 switch to the HEATER-2 position.

f. Place FLUORESCENT LIGHTS switch to the ON position, and lock shelter facility door securely.

g. Repeat step c above with tester connected first across pins 1 and 2, and then across pins 2 and 4.

h. Place EQUIPMENT/HEATER-2 switch to the EQUIPMENT position.

i. Repeat step c above with tester connected first across pins 1 and 2, and then across pins 2 and 4.

4.7.1.3 Insulation resistance.- Insulation resistance which meets the requirement of 3.3.1.3 shall be made on each power circuit in accordance with the following paragraphs. A megohmmeter or equivalent shall be used in performing the test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

a. Repeat steps 4.7.1.2 a thru i above except step 4.7.1.2b which shall be replaced by step b below.

b. Test between pins 1 and 4 of power connector IN. The output test voltage shall not be less than 100 volts DC nor more than 500 volts DC. Maintain this potential until the indicating meter has ceased fluctuating and indicates a steady or increasing insulation resistance. The requirements of 3.3.1.3 shall be met. (See Note under 4.7.1.2)

4.7.2 Power distributional and operational function tests.- Power distributional and operational function tests which meet the requirements of 3.3.2 shall be performed on each power circuit in accordance with the following paragraphs: (Refer to Drawings SC-D-627056 and SC-F-627057).

4.7.2.1 Test preparation.-

a. Replace or reconnect all electrical loads and line voltmeter removed or disconnected by 4.7.1a and b.

b. Replace power distribution box cover.

c. Place all circuit breakers and switches in the OFF position.

d. Place BLACKOUT/BYPASS switch to the BYPASS position.

e. Open outer exhaust port covers of both blowers.

f. Insert AC line plugs of both blowers into their respective receptacles.

g. Place a 115 volt AC test lamp with grounding plug into all convenience, equipment, intercom, and heater receptacles.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

4.7.2.2 Test of line voltmeter and indicator lamp.-

a. Apply 115 volts AC (nominal), 60 cycles, single phase power to shelter facility at power connector IN. Power indicator neon lamp shall light and facility voltmeter at power distribution panel shall indicate power to the shelter.

b. Measure specific line voltage by connecting a calibrated AC voltmeter (0-150 volt scale) between pin 1 and pin 2 of power connector OUT.

c. Read voltage indicated on shelter facility voltmeter. The voltage read shall be within ±2% of the voltage measured by step b above.

d. Place main circuit breaker in the ON position.

4.7.2.3 Test of circuit breakers and switches.-

Circuit #1.- (Lights circuit breaker CB1)

a. Place lights circuit breaker CB1 in the ON position. Neon lamp above CB1 shall light.

b. Place FLUORESCENT LIGHTS switch in the ON position. All fluorescent lamps shall light.

c. Place INCANDESCENT COLD START LIGHTS switch in the ON position. All incandescent lamps shall light.

d. Place circuit breaker CB1 in the OFF position. All lamps mentioned in a thru c above shall go out.

e. Replace circuit breaker CB1 in the ON position to restore lights.

f. With shelter facility door open, place BLACKOUT/BYPASS switch to the BLACKOUT position. All fluorescent and incandescent lamps shall go out.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

g. Close shelter facility door. All fluorescent and incandescent lamps shall light.

h. Place FLUORESCENT LIGHTS switch in the OFF position. All fluorescent lamps shall go out.

i. Place INCANDESCENT COLD START LIGHTS switch in the OFF position. All incandescent lamps shall go out.

j. Open door and restore lights by placing BLACKOUT/BYPASS switch to BYPASS and FLUORESCENT LIGHTS switch to the ON position.

Circuit #2.- (Blowers circuit breaker CB2)

a. Place blowers circuit breaker CB2 in the ON position. Neon lamp above CB2 shall light.

b. Place roadside blower switch in the ON position. Roadside blower shall operate and shall exhaust air from shelter. The spring loaded exhaust port cover shall open by the force of the exhaust blower.

c. Repeat step b above for curbside switch and blower.

d. Place circuit breaker CB2 in the OFF position. Neon lamp above CB2 shall go out; both blowers shall cease to operate; and the spring loaded port covers shall close.

Circuit #3.- (Heater-1 circuit breaker CB3)

a. Place Heater-1 circuit breaker CB3 (bottom breaker of tandem) in the ON position. Neon lamp #3 above CB3 shall light and test lamp in heater-1 receptacle shall light.

b. Place circuit breaker CB3 in the OFF position. All lamps mentioned in step a above shall go out.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

Circuit #4.- (Intercom circuit breaker CB4)

a. Place intercom circuit breaker CB4 in the ON position. Neon lamp above CB4 and test lamp in intercom receptacle shall light.

b. Place circuit breaker CB4 in the OFF position. All lamps mentioned in step a above shall go out.

Circuit #5.- (Spare circuit breaker CB5)

a. Place spare circuit breaker CB5 in the ON position. Neon lamp above CB5 shall light.

b. Place circuit breaker CB5 in the OFF position. Neon lamp above CB5 shall go out.

Circuit #6.- (Equipment/Heater-2 circuit breaker CB6)

a. Place EQUIPMENT/HEATER-2 switch to the HEATER-2 position.

b. Place equipment/heater-2 circuit breaker CB6 in the ON position. Neon lamp above CB6 and test lamp in heater-2 receptacle shall light. Test lamps in equipment receptacles shall not light.

c. Place EQUIPMENT/HEATER-2 switch to the EQUIPMENT position. Test lamps in equipment receptacles shall light and test lamp in heater-2 receptacle shall go out.

d. Place circuit breaker CB6 in the OFF position. Neon lamp above CB6 and test lamps in equipment receptacles shall go out.

Circuit #7.- (Convenience circuit breaker CB7)

a. Place convenience circuit breaker CB7 (top breaker of tandem) in the ON position. Neon lamp #7 above CB7 and test lamps in convenience receptacles(3) shall light.

b. Place circuit breaker CB7 in the OFF position. All lamps mentioned in a above shall go out.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

Circuit #8.- (Main circuit breaker CB8)

a. Place circuit breakers CB1 through CB8 and all switches in the ON position. All neon lamps above circuit breaker shall light. All fluorescent and incandescent lamps shall light. Test lamps in all convenience, intercom,heater-1, and equipment receptacles shall light. Both blowers shall operate.

b. Place main circuit breaker CB8 in the OFF position. All lamps and blowers mentioned in a above shall go out.

Circuit #9.- (Outside convenience circuit breaker CB9)

a. Reset outside convenience circuit breaker CB9 in the ON position. Test lamp in outside convenience shall light.

b. For remainder of tests, place main circuit breaker and lights circuit breaker in the ON position and all other circuit breakers in the OFF position.

4.7.3 Signal(audio) system wiring and components installation tests.- (Refer to audio cable assemblies Drawings SC-D-627083, SC-D-627092, and SC-D-627148.)

4.7.3.1 Continuity of conductors.- Continuity resistance which meets the requirements of 3.3.3.1 shall be performed on each audio circuit in accordance with the following paragraphs. A low resistance reading ohmmeter or equivalent shall be used in performing the test.

a. Using RADIO-TO-CABLE REPEATER patch cable connect between COMB PATCH THRU of system1and RADIO PATCH THRU of system 1 at Order Wire Patch Panel.

b. Measure continuity resistance between the following pins of cable assemblies marked TD-204/754 PATCH THRU SYS-1 and O.W. PATCH THRU SYS-1: E to E, F to D, G to K, and H to J.

c. Repeat steps a and b above for system 2 and system 3 respectively.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

d. Using CABLE REPEATER patch cable connect between COMB PATCH THRU of system 1 and COMB PATCH THRU of system 2 at Order Wire Patch panel.

e. Measure continuity resistance between the following pins of cable assemblies marked TD-204/754 PATCH THRU SYS-1 and TD-204/754PATCH THRU SYS-2: A to E,B to F, E to A, and F to B. Measure continuity resistance between pins C and D of cable assembly TD-204/754 PATCH THRU SYS-1 and then the same pins of cable assembly TD-204/754 PATCH THRU SYS-2.

f. Repeat steps d and e above substituting system 3 for system 2.

g. Using RADIO REPEATER patch cable connect between RADIO PATCH THRU of system 1 and RADIO PATCH THRU of system 2 at Order Wire Patch Panel.

h. Measure continuity resistance between the following pins of cable assemblies marked O.W. PATCH THRU SYS-1 and O.W. PATCH THRU SYS-2: D to D, E to G, G to E, and J to J..

i. Repeat steps g and h above substituting system 3 for system 2.

j. Measure continuity resistance between the Phone/ Intercom binding posts and Phone/Intercom inside shelter facility as follows:

(1) Phone A binding post at power entrance box to red phone conductor.

(2) Phone B binding posts to black phone conductor.

(3) Intercom A binding post to red intercom conductor.

(4) Intercom B binding post to black intercom conductor.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

k. Continuity resistance measurements made in steps b,e,h, and j above shall meet the requirements of 3.3.3.1.

4.7.3.2 Dielectric and insulation resistance tests.- Dielectric and insulation resistance tests which meet the requirements of 3.3.3.2 shall be performed on each audio circuit in accordance with the following paragraphs. A non-destructive dielectric and insulation resistance tester shall be used in performing the test.

a. Connect all pins of cable assembly marked TD-204/754 PATCH THRU SYS-1 to shelter facility ground using appropriate test jigs. Repeat for systems 2 and 3.

b. Using RADIO-TO-CABLE REPEATER patch cable connect between COMB PATCH THRU of system 1 and RADIO PATCH THRU of system 1 at Order Wire Patch Panel.

c. Place tester between pin E of Cable Assembly marked O.W. PATCH THRU SYS-1 and shelter facility ground terminal. Remove ground connection from pin E of TD-204/754 PATCH THRU sys-1.

d. Adjust tester to 500 volts DC output and maintain this potential for a continuous period of not less than 5 seconds. The requirements of 3.3.3.2 shall be met. Re-establish ground connection to the conductor under test.

e. Repeat steps c and d above for the following pins of cable assembly O.W. PATCH THRU SYS-1: D,K, and J; each time ungrounding the pin of cable assembly TD-204/754 PATCH THRU SYS-1 correlating with the circuit being tested as follows: F,G, and H respectively. After each test reconnect the pin being tested to shelter facility ground terminal. (Refer to Drawing SC-D-627148).

f. Repeat steps b thru e above for systems 2 and 3 respectively.

g. Remove ground connections from cable assembly TD-204/754 PATCH THRU of systems 2 and 3 only.

h. Using CABLE REPEATER patch cable connect between COMB PATCH THRU of system 1 and COMB PATCH THRU of system 2 at Order Wire Patch Panel.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

i. Place tester between pin A of cable assembly TD-204/754 PATCH THRU SYS-2 and shelter facility ground terminal. Remove ground connection from pin E of TD-204/754 PATCH THRU SYS-1.

j. Adjust tester to 500 volts DC output and maintain this potential for a continuous period of not less than 5 seconds. The requirements of 3.3.3.2 shall be met. Re-establish ground connection to the conductor under test.

k. Repeat steps i and j above for the following pins of cable assembly TD-204/754 PATCH THRU SYS-2: B,E and F; each time ungrounding the pin of cable assembly TD-204/754 PATCH THRU SYS-1 correlating with the circuit being tested as follows: F,A, and B respectively. After each test reconnect the pin being tested to shelter facility ground terminal. (Refer to Drawing SC-D-627092)

l. Repeat steps h thru k above substituting system 3 for system 2.

m. Connect all pins of cable assembly O.W. PATCH THRU SYS-1 to shelter facility ground using appropriate test jigs.

n. Using RADIO REPEATER patch cable connect between RADIO PATCH THRU of system 1 and RADIO PATCH THRU of system 2 at Order Wire Patch Panel.

o. Place tester between pin D of cable assembly O.W. PATCH THRU SYS-2 and shelter facility ground terminal. Remove ground connection from pin D of O.W. PATCH THRU SYS-1.

p. Adjust tester to 500 volts DC output and maintain this potential for not less than 5 seconds. The requirements of 3.3.3.2 shall be met. Re-establish ground connection to the conductor under test.

q. Repeat steps o and p above for the following pins of cable assembly O.W. PATCH THRU SYS-2: E,G, and J; each time ungrounding the pin of cable assembly O.W. PATCH THRU SYS-1 correlating with the circuit being tested as follows: G,E, and J. After each test reconnect the pin tested to shelter facility ground terminal. (Refer to Drawing SC-D-627083)

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:18Z
Check the source to verify that this is the currentversion before use.

r. Repeat steps n thru q above substituting system 3 for system 2.

s. Connect all phone and intercom binding posts to shelter facility ground terminal.

t. Position or isolate unterminated phone and intercom conductors inside shelter facility so as not to short to each other or to shelter facility ground.

u. Remove ground connection from phone A binding post. Place tester between phone A binding post and shelter facility ground terminal.

v. Adjust tester to 500 volts DC output and maintain this potential for a continuous period of not less than 5 seconds. The requirements of 3.3.3.2 shall be met. Re-establish ground connection to the binding post under test.

w. Repeat steps u and v above for each remaining binding post, each time ungrounding the binding correlating with the circuit being tested and reconnecting to shelter facility ground terminal following completion of test.

4.7.4 Video system wiring and components installation.- (Refer to Signal Schematic Drawing SC-F-627089)

4.7.4.1 Continuity of conductors.- Continuity resistance which meets the requirements of 3.3.4.1 shall be performed on each video and RF circuit in accordance with the following paragraphs. A calibrated low resistance reading ohmmeter or equivalent shall be used in performing the test.

Source: https://assist.dla.mil -- Downloaded: 2026-04-26T04:18Z
Check the source to verify that this is the current version before use.

a. At Cable Patch Panel make the following cable connections using cable patch cords:

VID ENT SYS-1	COMB SYS-1
TO CABLE	TO CABLE
FROM CABLE	FROM CABLE
VID ENT SYS-2	**COMB SYS-2**
TO CABLE	TO CABLE
FROM CABLE	FROM CABLE
VID ENT SYS-3	**COMB SYS-3**
TO CABLE	TO CABLE
FROM CABLE	FROM CABLE

b. At Video Patch Panel make the following cable connections using video patch cords:

RADIO SYS-1	RAD SYS-2
RCVR PCM OUT	XMTR PCM IN
XMTR PCM IN	RCVR PCM OUT
RCVR TIM OUT	RCVR TIM OUT
COMB SYS-1	**COMB SYS-2**
PCM IN	PCM OUT
PCM OUT	PCM IN
TIM IN	TIM OUT
TIM OUT	TIM IN
RADIO SYS-3	**COMB SYS-3**
RCVR PCM OUT	PCM IN
XMTR PCM IN	PCM OUT
RCVR TIM OUT	TIM IN

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

c. Circuit continuity resistance which meets the requirements of 3.3.4.1 shall exist when tested in accordance with Table V. The method of testing shall be inner conductor to inner conductor and outer conductor (shield) to outer conductor (shield).

TABLE V - Continuity Measurements

FROM	TO
VID ENT BOX SYSTEM-1(Male)	TD-754 or TD-204 from CABLE SYS-1
VID ENT BOX SYSTEM-1(Female)	TD-754 or TD-204 to CABLE SYS-1
VID ENT BOX SYSTEM-2(Male)	TD-754 or TD-204 from CABLE SYS-2
VID ENT BOX SYSTEM-2(Female)	TD-754 or TD-204 to CABLE SYS-2
VID ENT BOX SYSTEM-3(Male)	TD-754 or TD-204 from CABLE SYS-3
VID ENT BOX SYSTEM-3(Female)	TD-754 or TD-204 to CABLE SYS-3
PCM RCVR SYS-1	VID TN XMTR SYS-2
TMG RCVR SYS-1	TMG RCVR SYS-2
VID TN XMTR SYS-1	PCM RCVR SYS-2
PCM IN COMB SYS-1	PCM OUT COMB SYS-2
PCM OUT COMB SYS-1	PCM IN COMB SYS-2
TMG IN COMB SYS-1	TMG OUT COMB SYS-2
TMG OUT COMB SYS-1	TMG IN COMB SYS-2
PCM IN COMB SYS-3	PCM RCVR SYS-3
PCM OUT COMB SYS-3	VID TN XMTR SYS-3
TMG IN COMB SYS-3	TMG RCVR SYS-3
Patch Panel TIM OUT COMB SYS-3	TMG OUT COMB SYS-3
ANT ENT BOX SYS-1	RCVR SYS-1
ANT ENT BOX SYS-2	RCVR SYS-2
ANT ENT BOX SYS-3	RCVR SYS-3

4.7.4.2 Dielectric and insulation resistance tests.- Dielectric and insulation resistance tests which meet the requirements of 3.3.4.2 shall be performed on each video and RF circuit in accordance with the following paragraphs. A non-destructive dielectric and insulation resistance tester shall be used in performing the test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

a. Repeat cable connections under 4.7.4.1a.

b. Remove all lightning protector elements at video entrance box.

c. Apply test potential of 1500 volts DC for not less than 30 seconds between the following pin connections and terminal ground at video and antenna entrance box. The requirements of 3.3.4.2 shall be met.

(1) System-1 male
(2) System-1 female
(3) System-2 male
(4) System-2 female
(5) System-3 male
(6) System-3 female
(7) System-1 Antenna connector
(8) System-2 Antenna connector
(9) System-3 Antenna connector

d. Replace lightning protector elements.

e. Repeat step c(1) through C(6) above applying a potential of 1100 volts DC.

f. Apply test potential of 1500 volts DC for not less than 5 seconds between inner conductor and outer conductor (shield) of each RF connector at the Video Patch Panel. The requirements of 3.3.4.2 shall be met.

4.7.4.3 Voltage standing wave ratio (VSWR).- VSWR,which meets the requirements of 3.3.4.3 shall be made on each RF circuit in accordance with the following paragraphs. The VSWR measuring set shall consist of the following calibrated test equipment,or equal.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

Hewlett-Packard Signal Generator HP-608C
Hewlett-Packard Signal Generator HP-612A
Hewlett-Packard Square Wave Generator HP-211A
Hewlett-Packard SWR Meter HP-415D
Hewlett-Packard Slotted Line HP-805C
Weinschel Model 535-FC 50 ohm coaxial termination, Female Type "C" connector
Cable Assembly Adapter, Female Type "C" to Male "QL" connector.
Ancillary items, including interconnecting cables, adapters, and any additional equipment needed.

a. Connect the test equipment using appropriate interconnecting cables and adapters as shown in Figure 1, to system 1 antenna circuit.

b. Set signal generator to a frequency of 220 megahertz.

c. Set the square wave generator for square wave output.

d. Set all test equipment for proper operation and obtain a VSWR reading on the SWR meter.

e. The VSWR reading obtained shall meet the requirements of 3.3.4.3.

f. Repeat steps b thru e above for signal generator frequencies of 400 megahertz, 700 megahertz, and 1000 megahertz respectively.

g. Repeat steps a thru f above for system 2 antenna circuit.

4.8 Systems operational tests.- Install all operational equipments in their respective locations and connect power, signal and RF cable assemblies to their designated receptacles and connectors. (see 3.4)

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

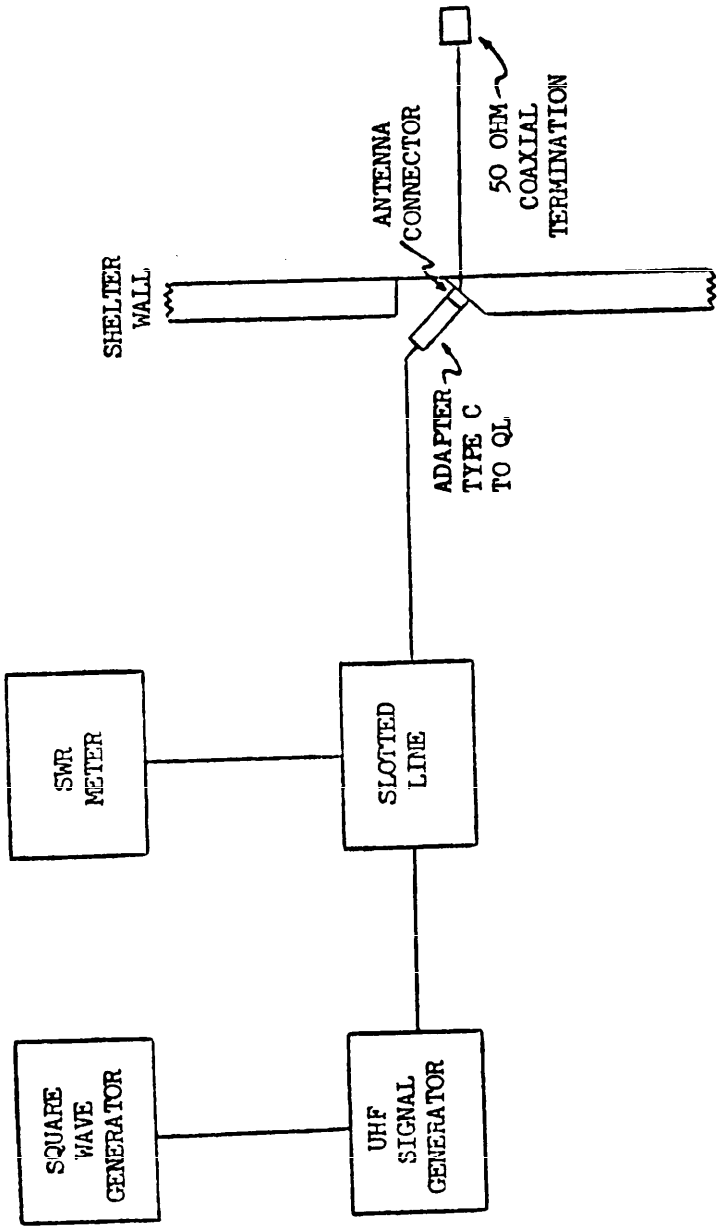


FIG. 1 VSWR TEST SETUP

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

4.8.1 Electric heaters operational tests.-

a. Place heater-1 in the FAN position.

b. Place heater-1 circuit breaker CB3 in the ON position. Heater-1 shall operate and blow air out through louvers.

c. Place thermostat control on heater-1 to a high heating position. Place heater-1 in the HEAT position. Shelter facility ammeter shall indicate approximately 15 amps. After a few minutes the heater shall blow warm air. Check that the thermostat controls heater operation by turning thermostat to a lower temperature until a click is heard. The ammeter shall show a drop of about 13 amps. The heater's fan shall continue to operate. Place the heater in the OFF position. The heater's fan shall cease to operate.

d. Repeat steps a through c above for heater-2 and circuit breaker CB6 with EQUIPMENT/HEATER-2 switch to the HEATER-2 position.

4.8.2 Equipment operational tests.-

4.8.2.1 Radio terminal set.- (See Figure 2 for block diagram)

a. At cable patch panel make the following cable connections using cable patch cords:

VID ENT SYS-1	COMB SYS-1
TO CABLE	TO CABLE
FROM CABLE	FROM CABLE
VID ENT SYS-2	COMB SYS-2
TO CABLE	TO CABLE
FROM CABLE	FROM CABLE

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

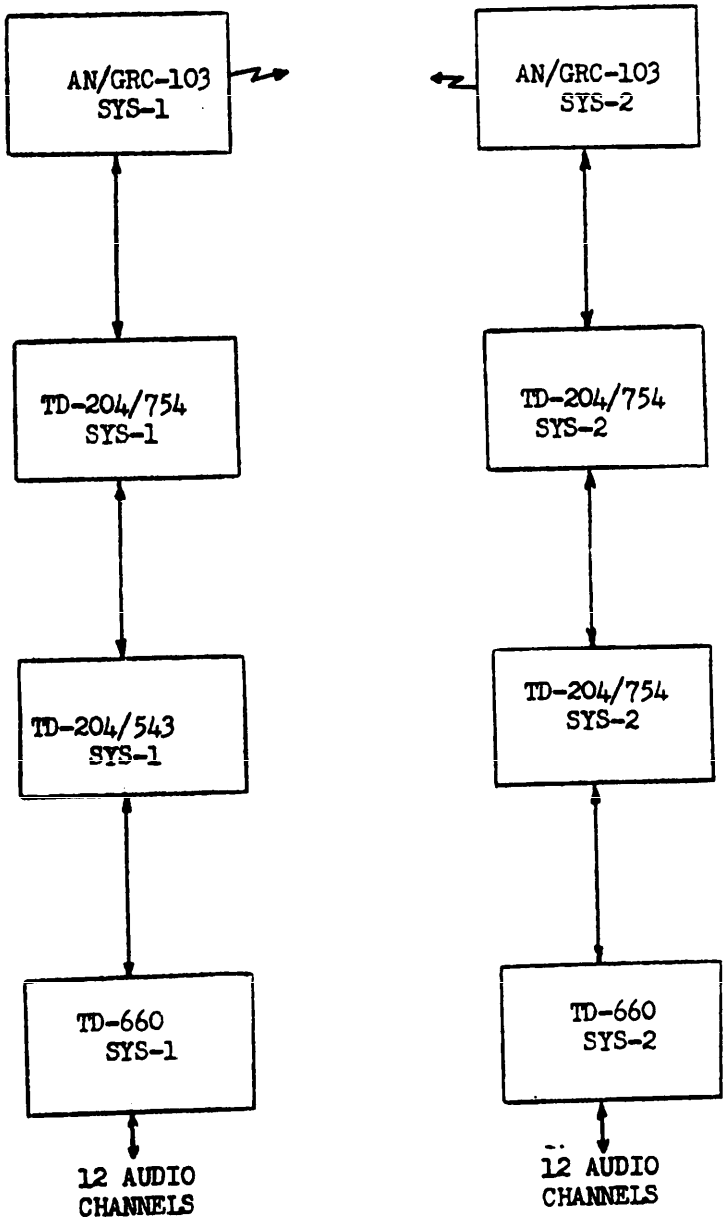


Figure 2. SYSTEMS TEST SETUP

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

b. At Video Patch Panel make the following cable connections using video patch cords:

RADIO SYS-1	COMB SYS-1
RCVR PCM OUT	PCM IN
XMTR PCM IN	PCM OUT
RCVR TIM OUT	TIM IN
RADIO SYS-2	**COMB SYS-2**
RCVR PCM OUT	PCM IN
XMTR PCM IN	PCM OUT
RCVR TIM OUT	TIM IN

c. Using RADIO-TO-CABLE REPEATER patch cable connect between COMB PATCH THRU of system 1 and RADIO PATCH THRU of system 1 at Order Wire Patch Panel. Repeat for system 2.

d. At radio sets make the following cable connections using cable assemblies CG-3444/U (1½ft)

RECEIVER SYS-1	TRANSMITTER SYS-1
FROM XMTR	PWR OUT
RECEIVER SYS-2	**TRANSMITTER SYS-2**
FROM XMTR	PWR OUT

e. Connect cable assemblies CG-3443/U (50 ft) to systems 1 and 2 antenna connectors. Connect other ends to cable assemblies CG-3444/U (3½ ft) using adapters UG-1375/U, Connect other ends of cable assemblies CG-3444/U to Dummy Loads DA-437/GRC-103. Separate the dummy loads to a distance of about 4 feet.

f. Position multiplexers TD-660/U and TD-204/U or TD-754/U outside shelter to facilitate connections to system 1 video connector at video and ant entrance box.

g. Make the following cable connections between the positioned multiplexers using cable assemblies CG-1040B/U (5 ft).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

TD-660/U	TD-204/U or TD-754/U
PCM IN	PCM OUT
PCM OUT	PCM IN
TIM IN	TIM OUT
TIM OUT	TIM IN

h. Connect one end of cable assemblies CG-2437/TCC (15 ft) and CG-2438/TCC(15 ft) to the FROM CABLE and TO CABLE connectors of the TD-204/U or TD-754/U respectively.

i. Connect other end of cable assemblies CG-2437/TCC and CG-2438/TCC to cable assembly CX-10734()/G.

j. Connect the remaining end of cable assembly CX-10734()/G to SYSTEM-1 video connector at video and antenna entrance box.

k. Repeat steps f thru j above for system 2 video connector.

l. Set 2 wire/4 wire switch of each TD-660/U to 2 wire; Master/Slave switch to Master; and 6 CH/12 CH Mode to 12 CH.

m. Set Traffic Sel switch of each TD-204/U or TD-754/U to 12; READ/ZERO SET/NORM OPR switch to NORM OPR; and the MILE switches to ½.

n. Tune systems 1 and 2 radio sets according to the provided instructions. Transmission frequencies shall be as follows:

Transmit frequency,	system 1	250 megahertz
Transmit frequency,	system 2	375 megahertz
Receive frequency,	system 1	375 megahertz
Receive frequency,	system 2	250 megahertz

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

o. The dummy loads may be moved according to receive a good signal strength.

p. Set multiplexers for proper operations in accordance with the provided instructions.

q. Connect Headsets H-91A/U to each external TD-204/U or TD-754/U (combiners). Ring external combiner system 1 from external combiner system 2; ring external combiner system 2 from external combiner system 1; ring radio order wire system 1 from radio order wire system 2; ring radio order wire system 2 from radio order wire system 1; establish communications on all 4 phones.

r. Connect Headsets H-91A/U to each multiplexer TD-660/U.

s. Operate selector switch IV on each TD-660/G to channel 1; establish communications between the headsets.

t. Repeat step s above for each remaining channel 2 thru 12.

u. Repeat steps a thru t above substituting system 3 for system 2.

4.8.2.2 Cable terminal set.- (See Figure 3 for block diagram)

a. Disconnect all patch cables at Order Wire Patch Panel and Video Patch Panel; Cable Patch Panel shall be under condition a of 4.8.2.1.

b. At Video Patch Panel make the following cable connections using video patch cords:

COMB SYS-1	COMB SYS-2
PCM IN	PCM OUT
PCM OUT	PCM IN
TIM IN	TIM OUT
TIM OUT	TIM IN

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

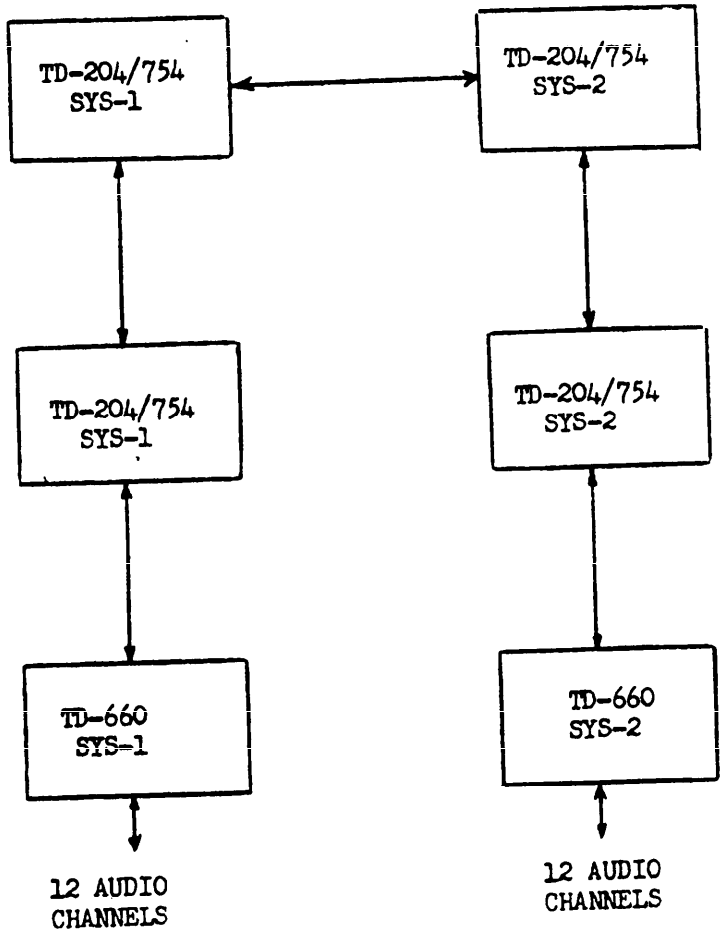


Figure 3. SYSTEMS TEST SETUP

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

c. Using CABLE REPEATER patch cable connect between COMB PATCH THRU of system 1 and COMB PATCH THRU of system 2 at Order Wire Patch Panel.

d. Repeat steps 4.8.2.1 f thru 1 for external multiplexers.

e. Set READ/ZERO SET/NORM OPR switch of each TD-204/U or TD-754/U to NORM OPR, and the MILE switches to ½.

f. Set Traffic Sel switch of each external TD-204/U or TD-754 to 12; and of each internal TD-204/U or TD-754 to 48-AR.

g. Set multiplexers for proper operations in accordance with the provided instructions.

h. Connect Headsets H-91A/U to each external TD-204/U or TD-754/U (combiners). Ring external Combiner System 1 from external combiner system 2; ring external combiner system 2 from external combiner system 1; establish communications between the headsets.

i. Connect Headsets H-91 A/U to each multiplexer TD-660/U.

j. Operate selector switch IV on each TD-660/U to channel 1; establish communications between the heads.

k. Repeat step j above for each remaining channel 2 thru 12.

l. Repeat steps a thru k above substituting system 3 for system 2.

4.9 Vehicular transportation test.- The facility shall be secured (and blocked to prevent shifting) to a government furnished 1¼ ton, M-715, truck and transported over the specially prepared course described in 4.9.1 for 10 laps at a speed of 5 mph, 10 laps at a speed of 10 mph, 10 laps at a speed of 15 mph, and 10 laps at a speed of 18-20 mph. A lap is defined as traversing the course in one direction. The shelter facility shall meet the requirements of paragraph 3.5 after completion of the test. Note: The facility shall be loaded to simulate the AN/TRC-113() using live and dummy loads (See 6.2b)

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

4.9.1 Vehicular transportation course.- The course for the military truck transportation shall have twelve(12) 4-inch by 8-inch timbers placed 25 feet apart on the 8-inch face and with the 4-inch face fully above ground. The long top edges shall have 1 x 1-inch chamfers. The sixth and twelfth timbers shall be placed at 45 degrees to the direction of travel, and all other timbers shall be placed perpendicular to the direction of travel. The timbers shall be at least 16 feet long and the anchors shall be only near the ends of each timber. The timbers shall be anchored down securely by any convenient means. The ground on which the timbers are placed shall be hard and level.

4.10 Rail transport,impact test.- This test shall be performed on a level stretch of track in the manner described in this paragraph. The test flatcar, timber blocking, and shelter facility tiedown slings shall be as specified in Figure 4 and shall meet the provisions of the test as specified in 4.10.1; the test flatcar, less the shelter,and the two empty flatcars coupled to it shall each weigh 45000 to 55000 pounds. The loaded gondola car shall meet the provisions of the test as specified in 4.10.2 and shall have a total weight of 165,000 pounds. The loaded gondola car totaling 165,000 pounds traveling at 9 miles per hour (or equivalent energy conditions acceptable to the government) shall be impacted against the stationary loaded testcar coupled to the two empty flatcars, all with brakes off. Four (4) impacts shall be performed as follows: With the shelter facility positioned longitudinally on the flatcar, two impacts, one from each end of the shelter facility; with the shelter facility positioned transversely on the flatcar, two impacts, one from each side of the shelter facility. The lashing and blocking holding the shelter facility in place shall be tight at the start of each run. If the blocking is torn loose or the lashing is broken during the impact, the run shall be repeated. After each impact, the shelter facility shall meet the requirements of 3.6.

4.10.1 Test flatcar.- The wooden planking of the test flatcar bed shall be in good condition. All 6 x 6 inch blocking shall be secured to the bed of the flatcar using 10 inch spikes on 12 inch centers. The blocking along the door end and opposite end of the shelter shall abutt the corner castings along the full length of the castings except as necessary to clear the towing shackles; this shall be accomplished by means of power sawed notches. The blocking along the other two sides of the shelter shall abutt only the corner castings, along the full length of the castings.These four blocking members shall not be notched or shimmed to contact the trim along the sides of the shelter.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

The 4 x 4 inch and 2 x 4 inch blocking shall be nailed to the bed of the flatcar as shown in the figure referred to above. All other blocking shall be snugly abutting as shown in the figures. Lashing shall consist of four wire rope slings; each including 3/8 inch diameter, 6 x 19, flexible, steel, preformed-wire rope (having a breaking strength of 10,600 pounds minimum), a turnbuckle, two hooks, with thimbles and fasteners as required; the breaking strength of the sling shall be 9000 pounds minimum. Before each impact, each sling shall be taut (600-800 pounds tension).

4.10.2 Loaded gondola car.- The load in the loaded gondola car shall be one of the following:

a. A coarse size of either coal,crushed stone, gravel, crushed concrete, metal scrap (other than sheet metal or metal shavings or other springy forms of metal).

b. Chunk,slab,block, or plate form of the preceding acceptable materials, constrained to prevent shifting during impact.


4.11 Drop tests.-

4.11.1 Flat drop.- The shelter facility loaded as in 4.8 shall be lifted 18 inches from the ground and allowed to fall freely with the skids impacting onto a hard substantial concrete surface. The test shall be performed once. Upon completion of this drop, the facility shall meet the requirements of 3.7.

4.11.2 Rotational drop.- The shelter facility loaded as in 4.8 shall have one skid (or the knuckles of the skids) resting on a nominal 4 inch high timber. The outer edge of the opposite skid (or the opposite knuckles of the skids) shall be raised 18 inches and the shelter facility shall be allowed to fall freely onto a hard substantial concrete surface. This impact shall be performed four times, once for each bottom edge of the shelter facility. On completion of these drops, the shelter facility shall meet the requirements of 3.7.


4.12 Watertightness test.- The shelter facility, without the use of any additional external sealing, caulking, taping, etc. shall be subjected to the following two part test (Note: Perform tests with inside covers of entrance boxes removed).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

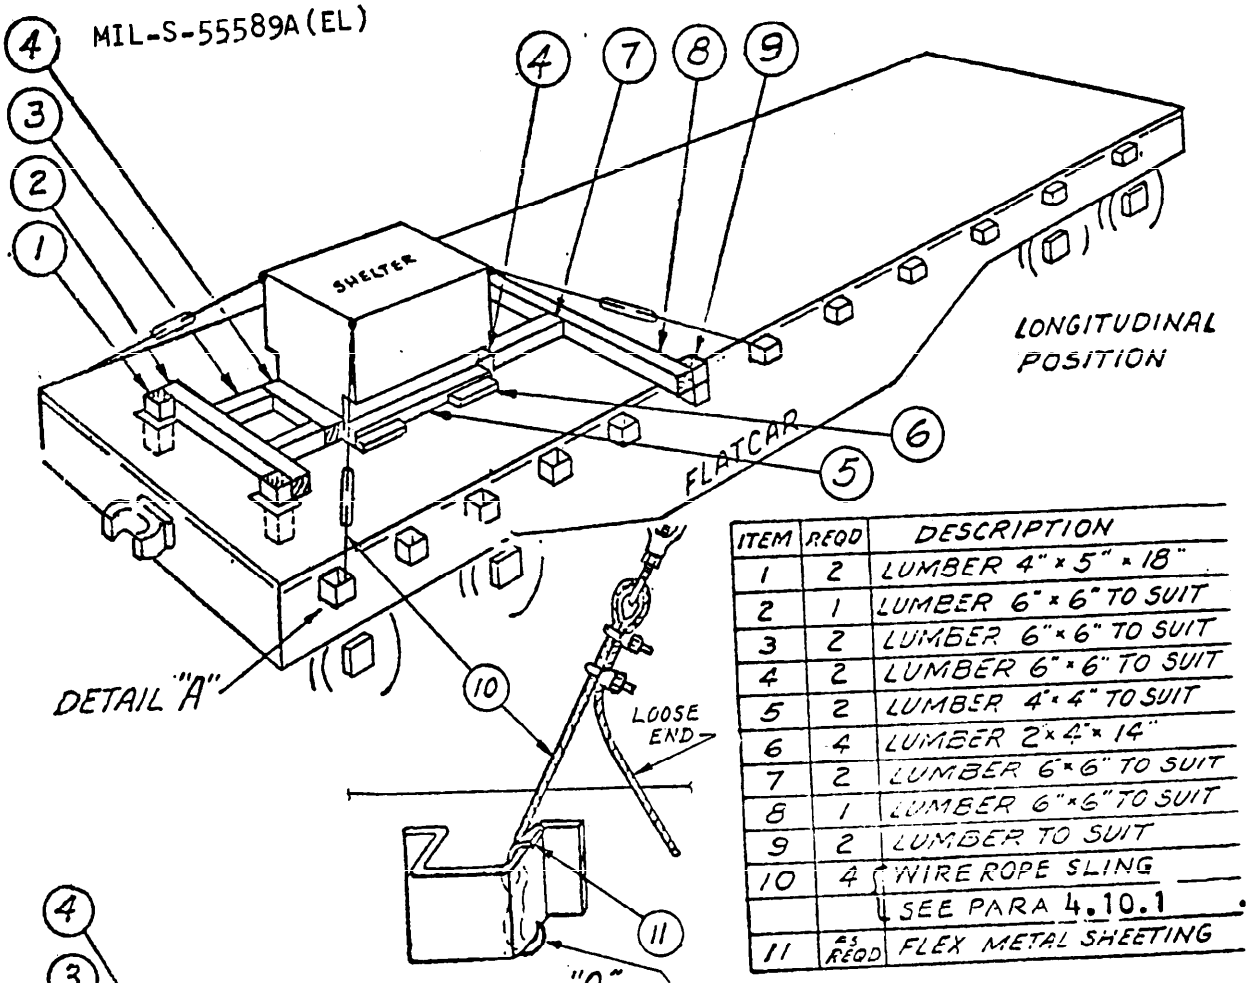

ITEM	REQD	DESCRIPTION
1	2	LUMBER 4" x 5" x 18"
2	1	LUMBER 6" x 6" TO SUIT
3	2	LUMBER 6" x 6" TO SUIT
4	2	LUMBER 6" x 6" TO SUIT
5	2	LUMBER 4" x 4" TO SUIT
6	4	LUMBER 2" x 4" x 14"
7	2	LUMBER 6" x 6" TO SUIT
8	1	LUMBER 6" x 6" TO SUIT
9	2	LUMBER TO SUIT
10	4	WIRE ROPE SLING SEE PARA 4.10.1
11	AS REQD	FLEX METAL SHEETING

DETAIL "A" TYPICAL

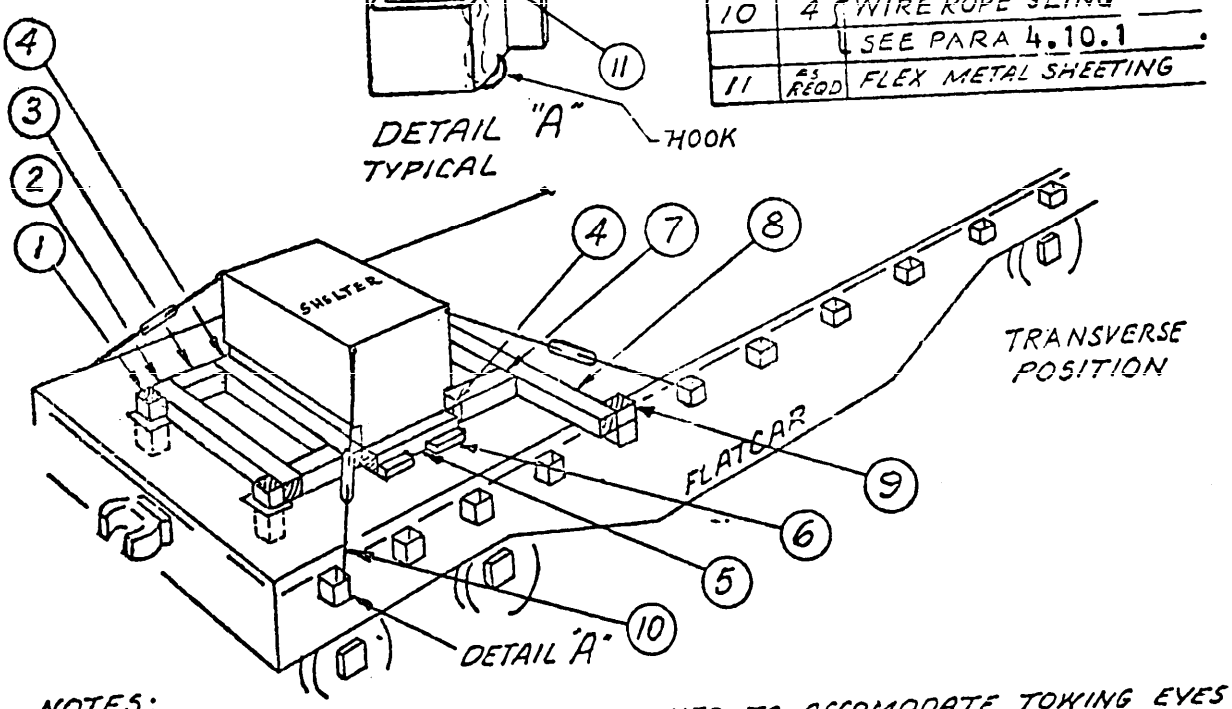

NOTES:
1- THE BLOCKING LUMBER SHALL BE NOTCHED TO ACCOMODATE TOWING EYES & BOLTS
2- THE BLOCKING LUMBER SHALL BE RIGIDLY FASTENED TO THE FLOOR OF THE FLATCAR

FIG. 4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

a. Each of the five exposed surfaces of the shelter facility, with covers closed, shall be sprayed with water from nozzles, model G29SQ (GG29SQ) as made by Spraying Systems Co., Bellwood,Illinois, or equal, pointing directly at the surface and arranged to provide uniform coverage of the surface. Each end panel shall be tested using nine nozzles, each side using nine nozzles, and the roof using four nozzles. Each nozzle shall operate at a pressure of forty psig at the nozzle, and shall be located nineteen inches from the panel with the exception of the roof nozzles which shall be at a distance of thirty-two inches. All of the five surfaces shall be simultaneously subjected to the test of this paragraph unless otherwise specified by the contracting officer. (See Figure 5 ..for nozzle location). Each panel shall be sprayed for a period of 20 minutes. (If the watertightness test is to be followed by the fording test of 4.13 the bottom row of nozzles may be eliminated with the exception of the nozzles facing the door-end panel). Upon completion of the above test, the shelter facility shall meet the requirements of 3.8 To determine that no water has entered the shelter panels, holes shall be made at points to be determined by the government at the time of testing. After this determination , the holes shall be sealed with rivets and sealer.


b. Open all covers to operating position (with exception of the exhaust blower vent covers at the front of the shelter, the door vent panel at the rear of the shelter and the air conditioning duct port covers on the curbside wall) and repeat a above.

4.13 Fording test.- The shelter facility shall be immersed in water for 1 hour to a depth of 26 inches (measured from the bottom of the skids) and meet the requirements of 3.9. No special fording kits shall be used. The shelter shall be restrained from floating by external tiedowns. To determine that no water has entered the shelter panels, holes shall be made at points to be determined by the government at the time of testing. After this determination, the holes shall be sealed with rivets and sealer.

4.14 Mounting insert tests.-

4.14.1 Preproduction insert test.- Four of each size insert shall be randomly selected for test. Each selected insert shall be tested with an axial load followed by a torque load in accordance with Table VII. After test, the requirements of 3.10 shall be met. Failure of any insert shall be cause for rejection of the sample shelter facility. This test shall be conducted prior to installation of brackets, racks, etc.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

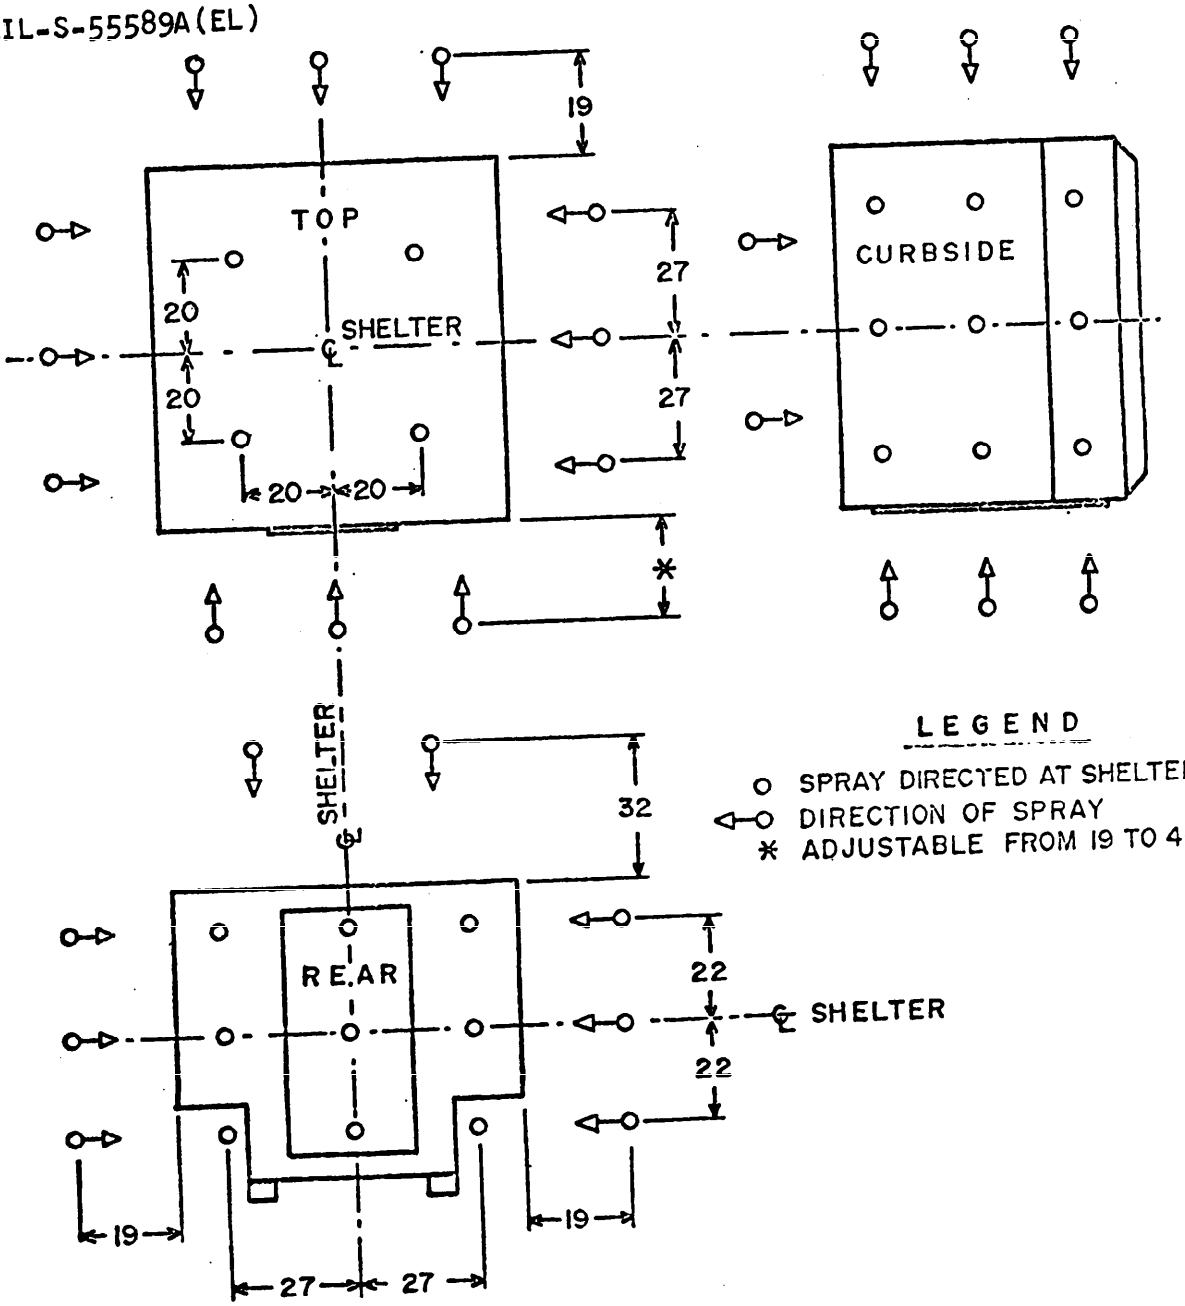

NOTES

1 NOZZLES SHALL BE PERPENDICULAR TO SHELTER SURFACE.
2 UNLESS OTHERWISE SHOWN ALL DIMENSIONS SHALL BE TAKEN FROM INDICATED CENTER LINES.
3 GAGES SHALL BE PERMANENTLY INSTALLED IN PIPING TO INDICATE PRESSURE AT REMOTE NOZZLES.
4 ROADSIDE NOZZLE LOCATIONS SAME AS CURBSIDE.
5 FRONT NOZZLE LOCATIONS SAME AS REAR.
6 DIMENSIONS ARE IN INCHES.

NOZZLE LOCATIONS

FIGURE 5
PAGE 48

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the current version before use.

4.14.2 Production insert test.- Five of each size insert (if the total quantity of any size is less than five, all of that size shall be tested) shall be randomly selected for test in each sample shelter facility. Each selected insert shall be tested in accordance with Table VI . After test, the requirements of 3.10 shall be met. Failure of any insert shall be cause for rejection of the sample shelter facility. This test shall be conducted prior to installation of brackets, racks, etc.

Table VI - Mounting Inserts Loads

Insert size	Preproduction Test		Production Test	
	Axial(Lbs)	Torque(in-lbs)	Axial(lbs)	Torque(in-lbs)
5/16-18	2000	100	1000	100
1/4-20	1300	60	650	60
#10-32	600	23	300	23

4.15 Testing of solderless terminal-lug connections.- Connections made with solderless terminal-lugs shall be tested for conformance to 3.20.4.

4.16 Inspection for interchangeability.- The dimensions listed below shall be gaged or measured to determine compliance with the physical interchangeability requirements of 3.21. When a dimension is not within specified or design limits, it shall be considered a defect.

a. Size and mounting dimensions of brackets and mounting plates.

b. Size and mounting dimensions of racks, patch panels and cabinets.

4.17 Visual and mechanical inspection.- The shelter facility shall be examined for the defects listed in Standard MIL-STD-252, the requirements of 3.22 and Table VII .

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

Table VII -Classification of Visual & Mechanical Defects

Classification	Defects
Major	1. Mounting plates missing or mislocated 2. Aircraft loading data plate,instruction or nameplate omitted,incorrect or illegible. 3. Welds - cracked or porous. 4. Sealer improperly applied (holes, separations,or lack of adhesion). 5. Mounting inserts missing or mislocated. 6. Burrs or sharp edges in wire duct not removed. 7. Equipments or bracketry loose or missing. 8. Doors, etc inoperative. 9. Electrical receptacles,switches, connectors,wire ducts or other electrical components loose, improperly located or inoperative. 10. Locking or holding devices missing or inoperative. 11. Gaps between sections of wire duct exceed 1/16".
Minor	1. Doors,not easily operable. 2. Fastening devices difficult to operate. 3. Finish - abrasions or scratches. 4. Burrs and sharp edges or brackets not removed. 5. Screws loose.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

4.18 Quality conformance inspection of preparation for delivery.- Preparation for delivery shall be inspected in accordance with Specification MIL-P-116 to determine conformance to the requirements of Section 5.

4.19 Rough handling test (preparation for delivery).- When rough handling test in accordance with Specification MIL-P-116 is required by the contract, the following functional tests shall be conducted to determine freedom from operational malfunction caused by rough handling:

Paragraph 4. 7.1	Power and Signal wiring
Paragraph 4.17	Visual and mechanical

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging.- Preservation, packaging, and packing of the shelter facility shall be in accordance with applicable requirements of Specification MIL-S-55505.

6. NOTES

6.1 Intended use.- The Shelter, Electrical Equipment S-335()/TRC-113 is the shelter facility portion of the AN/TRC-113() and it is used to house the operational equipments including:

a. 3 ea AN/GRC-103 Radio Set

b. 3 ea TD-204()/U Multiplexer/TD-754()/G Multiplexer

c. 1 ea TA-312()/PT Telephone

d. 2 ea H-91()/U Headset-Microphone

e. 2 ea H-156()/U Handset

f. 1 ea LS-147()/F1 Intercommunication Station

forming the Radio Repeater Set.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

6.2 Ordering data.- Procurement documents should specify the following:

a. Title,number, and date of this specification and any amendment thereto.

b. Preproduction and Group C inspection of the shelter facility requires use of government furnished live loads (converter, radio and telephone components) unless otherwise specified in the bid request and contract.

c. A list of government furnished equipments required as part of the S-335()/TRC-113 on order.

d. A list of equipments to be government loaned for testing purposes.

e. Submission of the statement referenced in 3.18.4 as soon as possible after award of contract. This statement should be submitted to the contracting officer.

6.3 Inspection.- Inspection is the examination or testing, or both, of supplies to determine compliance with applicable requirements. Sampling is an element of inspection.

6.3.1 Examination.- Examination consists of simple, generally nondestructive determinations of compliance, without use of special testing equipment.

6.3.2 Testing.- Testing consists of determinations of compliance, using technical means.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

6.4 Group C inspection.- Approval to ship may be withheld, at the discretion of the government, pending the decision from the contracting officer on the adequacy of corrective action.(See 4.5.3.4)

6.5 Nomenclature.- The parenthesis in the nomenclature will be deleted or replaced by a letter identifying the particular design, for example: S-335R/TRC-113. The contractor should apply for nomenclature in accordance with the applicable clause in the contract.

6.6 Verification inspection.- Verification by the government will be limited to the amount deemed necessary to determine compliance with the contract and will be limited in severity to the definitive quality assurance provisions established in this specification and the contract. The amount of verification inspection by the government will be adjusted to make maximum utilization of the contractor's quality control system and the quality history of the product.

Custodian:
Army - EL

Preparing Activity:
Army - EL

Project No. 5820-A515

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:18Z
Check the source to verify that this is the currentversion before use.

To detach this sheet, cut along this line

SPECIFICATION ANALYSIS SHEET

Form Approved
Budget Bureau No. 22-R255

INSTRUCTIONS: This sheet is to be filled out by personnel, either Government or contractor, involved in the use of the specification in procurement of products for ultimate use by the Department of Defense. This sheet is provided for obtaining information on the use of this specification which will insure that suitable products can be procured with a minimum amount of delay and at the least cost. Comments and the return of this form will be appreciated. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments and suggestions submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or serve to amend contractual requirements.

SPECIFICATION

MIL-S-55589A(EL), SHELTER, ELECTRICAL EQUIPMENT S-335( )/TRC-113

ORGANIZATION

CITY AND STATE

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE SPECIFICATION CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY SPECIFICATION REQUIREMENT CONSIDERED TOO RIGID

3. IS THE SPECIFICATION RESTRICTIVE?

☐ YES ☐ NO *(If "yes", in what way?)*

4. REMARKS *(Attach any pertinent data which may be of use in improving this specification. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity)*

SUBMITTED BY *(Printed or typed name and activity - Optional)*

DATE

DD FORM 1 JAN 66 1426

REPLACES EDITION OF 1 OCT 64 WHICH MAY BE USED.

ESC-FM 1068-68

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.

FOLD

Department of the Army
Headquarters
U.S.Army Electronics Command
Fort Monmouth, New Jersey 07703

POSTAGE AND FEES PAID

OFFICIAL BUSINESS

Commanding General
U.S.Army Electronics Command
ATTN: AMSEL-TD-SS
Fort Monmouth, New Jersey 07703

To detach this form, cut along this line

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:18Z
Check the source to verify that this is the current version before use.