MIL-A-45897(AR)
7 July 1977
SUPERSEDING
See Section 6

MILITARY SPECIFICATION

ARM-SAFE DEVICE, ATOMIC WEAPON: XM134E1

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers requirements, quality assurance provisions, and the preparation for delivery criteria for one type of arm-safe device entitled Arm-Safe Device, Atomic Weapon: XM134E1 used to sense missile acceleration in the Sprint Atomic warhead section.

2. APPLICABLE DOCUMENTS

2.1 The following documents, of the issue in effect on date of invitation for bids or request for proposals, form a part of this specification to the extent specified herein:

SPECIFICATIONS

MILITARY

MIL-S-6872	- Soldering Process, General Specification For.

STANDARDS

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-202	- Test Methods for Electronic and Electrical Component Parts.
MIL-STD-1168	- Lot Numbering of Ammunition.
MIL-STD-1460	- Soldering of Electrical Connections and Printed Wiring Assemblies, Procedure For.

Beneficial comments (recommendations, additions, deletions), and any pertinent data which may be of use in improving this document, should be addressed to: Commander, US Army Armament Research and Development Command, ATTN: DRDAR-QAN-Q, Dover, New Jersey 07801, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426), appearing at the end of this document, or by letter.

FSC 1135

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

DRAWINGS

ORDNANCE CORPS

9287237 - Arm Safe Device, Atomic Weapon: XM134E1.
9287238 - Schematic (XM134E1).
9287239 - Wiring, Printed No. 1.
9287240 - Wiring, Printed No. 2.
9287241 - Wiring, Printed No. 3.
9287242 - Wiring, Printed No. 4.
9287243 - Wiring, Printed No. 5.
9287246 - Housing.
9287251 - Cover Assembly.
9287252 - Cover.
9287255 - Module Assembly.
9287280 - Reset Rod Assembly.
9287290 - Roller Assembly.
9287292 - Pawl Plate and Gear Assembly.
9287297 - Shaft and Rachet Wheel Assembly.
9287300 - "G" Weight and Gear L.H. Assembly.
9287304 - Shaft Bias Gear L.H. Assembly.
9287308 - "G" Weight Bias Assembly.
9287309 - "G" Weight, Segment Driver Assembly.
9287310 - "G" Weight and Gear R.H. Assembly.
9287313 - Shaft Gear Driver R.H. Assembly.
9287324 - Escape Wheel and Gearshaft Assembly.
9287327 - Pallet Assembly.
9287331 - Upper Clock Plate Assembly.
9287335 - Plate Intermediate Assembly.
9287345 - Plate, Switch Mounting Assembly.
9287349 - Switch Plate Assembly.
9287358 - Harness Assembly.
9287366 - Contact Plate Assembly.
9287373 - Contact Plate Assembly.
9287375 - Contact Plate Assembly.
9287380 - Plate Assembly.
9287381 - Wiring, Printed No. 6.
9287384 - Packing and Marking For Box, Fiberboard, Packing, Outer for Arm Safe Device: XM134E1.
9275835 - Packing and Marking For Box, Fiberboard, Packing, Outer, Pack 2 of 3 for Adaption Kit, Atomic Weapon to Guided Missile.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

EL-9287237 - Equipment List.
EL-9287246 - Equipment List.
EL-9287251 - Equipment List.
EL-9287252 - Equipment List.
EL-9287255 - Equipment List.
EL-9287280 - Equipment List.
EL-9287290 - Equipment List.
EL-9287292 - Equipment List.
EL-9287297 - Equipment List.
EL-9287300 - Equipment List.
EL-9287304 - Equipment List.
EL-9287308 - Equipment List.
EL-9287309 - Equipment List.
EL-9287310 - Equipment List.
EL-9287313 - Equipment List.
EL-9287324 - Equipment List.
EL-9287327 - Equipment List.
EL-9287331 - Equipment List.
EL-9287335 - Equipment List.
EL-9287345 - Equipment List.
EL-9287349 - Equipment List.
EL-9287358 - Equipment List.
EL-9287366 - Equipment List.
EL-9287373 - Equipment List.
EL-9287375 - Equipment List.
EL-9287380 - Equipment List.

PUBLICATIONS

PICATINNY ARSENAL

QAI-PA-1 - Quality Assurance Instructions for Reporting Data on Nuclear Weapons.

(Copies of specifications, standards, drawings, and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

3. REQUIREMENTS

3.1 Materials. The contractor shall furnish objective evidence (see 6.2) that the material complies with the specifications listed on the applicable drawing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

3.2 Assembly. The arm-safe device shall comply with all requirements specified on the drawing (dwg) 9287237, with all requirements specified herein, and with the requirements of all applicable specifications to the extent specified on the drawing and herein.

3.3 First article testing. Requirements for the submission of first article samples by the contractor shall be as specified in the contract (see 4.2).

3.4 Serialization. A serial number shall be assigned to the item. Serial numbers required on these items shall be obtained by means of a letter addressed to: Commander, Picatinny Arsenal, Dover, New Jersey 07801, ATTENTION: SARPA-QA-T-M. The letter of request shall include:

a. Exact nomenclature of the item as specified on the applicable drawing.
b. Name of the contractor.
c. Contract number or procurement request order number.
d. Number of serial numbers required.

3.5 Coded serialization requirements (see 6.1.2). The contractor shall supply feedback data on punch cards for any item for which coding is required in section 3. The feedback data shall be in accordance with QAI-PA-1.

3.6 Circuit resistance. The circuit resistance between the points specified in paragraphs 3.6.1, 3.6.2, 3.6.3, 3.6.4 and 3.6.5 shall be within ± 3% of the indicated value (unless otherwise specified) when tested as specified in 4.4.1.

3.6.1 Board and Terminal Assembly (see dwg 9287358 and Fig. 1).

Table I

Item	From	To	Ohms Resistance
1	1	2	1K
2	3	4	1K
3	5	15	8.25K
4	6	16	1K
5	7	8	1K
6	9	10	1K
7	11	12	1K
8	13	14	1K
9	17	18	1K
10	19	20	18.2K

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

3.6.2 Harness Assembly (see dwg 9287358).

Table II

Item	From	To	Ohms Resistance
1	J1-F	J1-G	0.050 max.
2	J1-C	J1-B	0.050 max.
3	J1-T	J1-N	0.050 max.
4	J1-J	J1-V	0.050 max.
5	J1-U	J2-Y	0.050 max.
6	J1-Y	J2-V	0.050 max.
7	J1-F	J3-9	1K
8	J1-B	J3-10	1K
9	J1-R	J3-11	1K
10	J1-N	J3-14	1K
11	J1-J	J3-12	1K
12	J1-L	J3-13	1K
13	J2-P	J2-R	0.050 max.
14	J2-K	J2-L	0.050 max.
15	J2-X	J2-F	0.050 max.
16	J2-B	J2-T	0.050 max.

3.6.3 Arm-Safe Device (Prior to installing into housing assembly) (see dwg 9287237 and 9287238).

Table III

Module 1 Armed - Module 2 Safe

Item	From	To	Ohms Resistance
1	J3-16	J3-21	18.2K
2	J1-B	J2-K	0.1 max.
3	J1-F	J2-P	0.1 max.
4	J1-J	J2-B	0.1 max.
5	J1-L	J2-D	0.1 max.
6	J1-N	J2-F	0.1 max.
7	J1-R	J2-H	0.1 max.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Table IV

Module 1 Safe		Module 2 Armed	
Item	From	To	Ohms Resistance
1	J3-16	J3-21	8.25K
2	J1-B	J2-K	0.1 max.
3	J1-F	J2-P	0.1 max.
4	J1-J	J2-B	0.1 max.
5	J1-L	J2-D	0.1 max.
6	J1-N	J2-F	0.1 max.
7	J1-R	J2-H	0.1 max.

3.6.4 Arm-Safe Device: XM134E1 (SAFE)(see dwg 9287237).

Table V

Item	From	To	Ohms Resistance	*Test Code See 3.5 and Table VII
1	J1-B	J1-C	0.50 max	0601--
2	J1-F	J1-G	0.50 max	0602--
3	J1-J	J1-V	0.50 max	0603--
4	J1-N	J1-T	0.50 max	0604--
5	J1-U	J2-Y	0.50 max	0605--
6	J1-Y	J2-V	0.50 max	0606--
7	J2-B	J2-T	0.50 max	0607--
8	J2-F	J2-X	0.50 max	0608--
9	J2-K	J2-L	0.50 max	0609--
10	J2-P	J2-R	0.50 max	0610--
11	J3-4	J3-5	2K	0611--
12	J3-9	J1-F	1K	0612--
13	J3-10	J1-B	1K	0613--
14	J3-11	J1-R	1K	0614--
15	J3-12	J1-J	1K	0615--
16	J3-13	J1-L	1K	0616--
17	J3-14	J1-N	1K	0617--

*The last two digits of the test code numbers are derived from the test condition and associated digits shown in Table VII.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

3.6.5 Arm-Safe Device: XM134E1 (ARMED) (see dwg 9287237).

Table VI

Item	From	To	Ohms Resistance	*Test Code See 3.5 and Table VII
1	J3-16	J3-21	5.68K	0618--
2	J1-B	J2-K	0.100 max.	0619--
3	J1-F	J2-P	0.100 max.	0620--
4	J1-J	J2-B	0.100 max.	0621--
5	J1-L	J2-D	0.100 max.	0622--
6	J1-N	J2-F	0.100 max.	0623--
7	J1-R	J2-H	0.100 max.	0624--

*The last two digits of the test code numbers are derived from the test condition and associated ditits shown in Table VII.

Table VII

Test Condition	Last Two Digits
Ambient	00
Life Cycle After 5th Cycle	01
Life Cycle After 10th Cycle	02
Life Cycle After 15th Cycle	03
Life Cycle After 20th Cycle	04
Life Cycle After 25th Cycle	05
Life Cycle After 30th Cycle	06
Test 12, Table XV	08

3.7 Insulation resistance. The insulation resistance between each pin and all other pins shorted together, as shown in Tables VIII, IX and X shall not be less than 100 meghoms when tested as specified in 4.4.2. Test voltage shall be 500 ± 50 volts direct current, with current limited to a maximum of 10 milliamperes.

3.7.1 Harness Assembly (see dwg 9287358).

Table VIII

J1-F, B, R, N, J, L, U, Y,
J2-P, K, H, B, D,
J3-21, 16, 4, 5

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

3.7.2 Arm-Safe Device: XM134E1 (SAFE).

Table IX

J1-B, F, J, L, N, R, U, Y,
J2-B, D, F, H, K, P,
J3-4, 16, 21,
case
unused pins tied together

3.7.3 Arm-Safe Device: XM134E1 (ARMED).

Table X

J1-B, F, J, L, N, R, U, Y,
J3-4, 5, 16,
case
unused pins tied together

3.8 Operation.

3.8.1 Arm. The circuits specified in Table XI shall activate (transfer from safe to arm position) within 210 milliseconds when subjected to a linear acceleration of 90 ± 2 gravity units (g) and within 100 to 160 milliseconds when subjected to a linear acceleration of 100 ± 2 g's. G forces shall be applied in the flight +XX direction (see Figure 2). Testing shall be as specified in 4.4.3.1.

Table XI

Function Circuits

Item	From	To	Switch Position
1	J1-F	J2-P	Normally Open (N.O.)
2	J1-C	J2-K	N.O.
3	J1-R	J2-H	N.O.
4	J1-T	J2-X	N.O.
5	J1-J	J2-B	N.O.
6	J1-L	J2-D	N.O.

3.8.2 Non-Arm. The circuits specified in Table XI shall not activate when subjected to a linear acceleration of 40 +0, -2 g's, in the forward + XX (see Figure 2) direction, for a minimum of 3.0 seconds. Testing shall be as specified in 4.4.3.2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

3.9 Acceleration.

3.9.1 Acceleration (ARMED-AMBIENT). The device shall remain in the armed condition when subjected to an acceleration of 180 ± 5 g's in the flight +XX (see Figure 2) direction for 5 seconds minimum followed by a deceleration of 50 ± 5 g's in the -XX direction for a minimum of 2 seconds. Testing shall be as specified in 4.4.4.1.

3.9.2 Acceleration (ARMED-HIGH TEMPERATURE). The device, stabilized at 200°F, shall remain in the armed condition when subjected to an acceleration of 80 ± 5 g's for a minimum of 30 seconds in each direction of the YY and ZZ axes (see Figure 2). Testing shall be as specified in 4.4.4.2.

3.10 Function circuits (ARMED CONDITION). The circuits listed in Table XI shall be capable of carrying 2.5 amperes min at 13 ± 1 volts Direct Current (DC) for a minimum of 50 milliseconds at a temperature of 150 ± 5°F. Testing shall be as specified in 4.4.5.

3.11 Temperature shock. The device in the SAFE position shall withstand a temperature shock of 125 + 5°F to -40 + 5°F to 125°F without evidence of physical damage (see 6.5) when tested as specified in 4.4.6.

3.12 Low temperature. The device in the SAFE position shall withstand exposure to a temperature of -40 ± 5°F for 10 hours minimum without physical damage (see 6.5) when tested as specified in 4.4.7.

3.13 High temperature. The device, in the SAFE position, shall withstand exposure to a temperature of 165 ± 5°F for 10 hours minimum without physical damage (see 6.5) when tested as specified in 4.4.8.

3.14 Mechanical shock.

3.14.1 Transportation shock (High temperature). The device stabilized at 165 ± 5°F and in the SAFE position shall be subjected to a total of 6 shocks (one in each direction along each of three mutually perpendicular axes) and shall not ARM when tested as specified in 4.4.9.1. A half sine wave form of 30 g's ± 2 g's with an 11 ± 2 millisecond duration shall be used.

3.14.2 Transportation shock (Low temperature). The device stabilized at -40 ± 5°F and in the SAFE position shall be subjected to a total of 6 shocks (one in each direction along each of three mutually perpendicular axes) and shall not ARM when tested as specified in 4.4.9.2. A half sine wave form of 30 g's ± 2 g's with an 11 ± 2 millisecond duration shall be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

3.14.3 Operational shock. The device in the ARM position shall be subjected to a total of 6 shocks (one in each direction along each of three mutually perpendicular axes) and shall not change position when tested as specified in 4.4.9.3. A sawtooth shock pulse having an amplitude of 200 ± 30 g's with a 6 ± 1 millisecond duration shall be used. During this test contact chatter of functional circuits (see Table XIV) shall be monitored per 3.18.

3.15 Vibration.

3.15.1 Transportation (High temperature). The device stabilized (see 6.4) and maintained at 165 ± 5°F and in the SAFE position shall not change state when vibrated at the frequencies shown in Table XII, sweeping logarithmic from 5 to 500 to 5 Hertz in 15 ± 1 minutes, in each of three mutually perpendicular axes. Testing shall be as specified in 4.4.10.1.

Table XII

Frequency (Hertz)	Magnitude
5-11	0.75 inch DA
11-100	5.0 G
100-500	1.0 G

3.15.2 Transportation (Low temperature). The device stabilized (see 6.4) and maintained at -40 ± 5°F and in the SAFE position shall not change state when vibrated at the frequencies shown in Table XII, sweeping logarithmic from 5 to 500 to 5 Hertz in 15 ± 1 minutes, in each of three mutually perpendicular axes. Testing shall be as specified in 4.4.10.2.

3.15.3 Random vibration. The device in the ARM position shall be subjected to the vibrations specified in Table XIII for one minute in each of three mutually perpendicular axes without evidence of physical damage (see 6.5) and shall not change position. During this test, contact chatter of functional circuits shall be monitored per 4.4.10.3.

Table XIII

Frequency (Hertz	Power Spectral Density
50-180	.9 G^2/Hz
180-400	-3 DB/Oct
400-1100	.44 G^2/Hz
1100-3000	1 DB/Oct

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

3.16 Seal integrity. The device shall be subjected to a helium leak test. The total leak rate shall not exceed 5×10^{-5} atm cc He/sec when tested as specified in 4.4.11.

3.17 Life cycle. The device shall be capable of at least 30 operations, and function within 210 ms at 100 ± 2 g when tested as specified in 4.4.12. After every 5th arm cycle the device shall be tested for compliance with 3.6.5 and 3.7.3.

3.18 Contact chatter. Contact chatter is the unwanted momentary interruption of contact continuity resulting from shock or vibration environments. The chatter requirements shall apply to the interruption of the circuits listed in Table XIV. Any single chatter event shall not exceed 10 microseconds. In addition, the accumulated time for chatter events which are greater than 5 microseconds but less than 10 microseconds shall not exceed 50 microseconds per millisecond. Chatter monitoring shall be performed as specified in 4.4.14.

Table XIV

Item	Circuit
1	J1-F and G to J2-P and R in series with J2-B and T to J1-J and V
2	J1-B and C to J2-K and L in series with J2-F and X to J1-N and T
3	J1-R to J2-H in series with J2-D to J1-L

3.19 Reset. The manual reset shall return the device from the armed to the safe position with a force less than 10 lbs when tested as specified in 4.4.13.

3.20 Soldering. All soldering shall comply with the requirements specified in MIL-STD-1460 or MIL-S-6872.

3.21 Workmanship.

3.21.1 Plastic and metal characteristics. All components shall be free from cracks, splits, cold flow, shrinkage, cold shuts, inclusions, porosity, or any similar characteristic.

3.21.2 Threads. Threads shall be full and undamaged for the entire minimum length or depth as required on the applicable drawing.

3.21.3 Burrs. Parts shall be free from burrs.

3.21.4 Foreign matter. Parts shall be free from chips, dirt, grease, rust, corrosion, or any embedded foreign material.

3.21.5 Cleaning. The cleaning method shall not be injurious to any of the parts, nor shall the parts be contaminated by the cleaning agent.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

3.21.6 Electrical. Cable assemblies and wires shall be dressed in such a manner as to prevent pinching or chafing of the wire insulation. Ends of wires shall be free from burrs, sharp edges, or points. All parts shall be free from flux, chips, dirt, grease, rust or foreign material.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.2 First article inspection.

4.2.1 Quantity to be submitted. When the contract requires first article inspection, the contractor shall submit twenty-five sets of parts to the defect inspections listed in 4.3.2.1. Upon acceptance, these parts shall be built-up into (25) complete devices and submitted for first article testing to the testing facility designated in the invitation for bids or request for proposals.

4.2.2 Inspection and testing to be performed. The first article inspection sample shall be subjected to the inspections and test specified in Table XV. Tests shall be conducted in the order specified in Table XV except as noted. Units tested per Table XV shall be considered to be destructively tested.

Table XV

First Article Inspection And Tests

Examination or Test	Contractors Inspection Before Submission	Unit/Sub-assemblies Numbers
1. Classification of Defects (see 4.3.2.1)	X	All Units and Subassemblies
2. Insulation Resistance (see 3.7.1)	X	All Subassemblies
3. Circuit Resistance (see 3.6.1, 3.6.2 and 3.6.3)	X	All Subassemblies
4. Insulation resistance-Safe (see 3.7.2)	X	All Units

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Table XV (Cont.)

Examination or Test	Contractors Inspection Before Submission	Unit/Sub-Assemblies Numbers
5. Circuit Resistance-safe (see 3.6.4)	X	All Units
6. Operation Non-Arm (see 3.8.2)	X	All Units
7. Operation Arm (see 3.8.1)	X	All units
8. Insulation Resistance-Armed (see 3.7.3)	X	All Units
9. Circuit Resistance-Armed (see 3.6.5)	X	All Units
10. Reset (see 3.19)	X	All Units
11. Seal Integrity (see 3.16)	X	All Units
12. Circuit Resistance (see 3.6.4)	X	All Units
13. Insulation Resistance (see 3.7.2)	X	All Units
14. Temperature shock (see 3.11)		Units 1 through 22
15.**High temperature (see 3.13)		Units 1 through 22
16. Trans. shock 165°F Group I (see 3.14.1)		Units 1 through 22
17. Trans. vibr. 165°F (see 3.15.1)		Units 1 through 22
18.**Trans. vibr. -40°F (see 3.15.2)		Units 1 through 22
19. Trans. shock -40°F Group II (see 3.14.2)		Units 1 through 22
20. Low temperature (see 3.12)		Units 1 through 22
21. Operation Arm(100g condition only within 210 ms max.) (see 3.8.1)		Units 1 through 11 and 23 through 25
21a.*Operation at 140g (see 3.8.1 140g only)		Units 12 through 22
22. Life Cycle (see 3.17)		Units 1 through 22
23. ***Acceleration (Armed) at 100G 210 ms max. (see 3.8.1) and 180g (see 3.9.1)		Units 1 through 11
23a.****Acceleration (Armed at 140 and 180g (see 3.9)		Units 12 through 22
23b.Operation Arm (100g condition only) (see 3.8.1)		Units 23 through 25
24. **Random vibr. (see 3.15.3) Group III		Units 1 through 22
25. Operational shock (see 3.14.3)		Units 1 through 22

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Table XV (Cont.)

Examination or Test	Contractors Inspection Before Submission	Unit/Sub-Assemblies Numbers
26. Acceleration (Armed-high Temp) (see 3.9.2)		Units 1 through 22
27. Current carrying capacity (see 3.10)		Units 1 through 22

*Operate time for information only.
**Sequence within groups not mandatory, however all units must maintain same sequence.
***After arming according to 3.8.1 at 100g.
****After arming according to 3.8.1 at 140g.

4.2.3 Inspection equipment. The inspection and testing specified in 4.2.2 shall be accomplished by using the gages and test equipment specified in 4.3.4.1.

4.2.4 Rejection. If any arm-safe device fails to comply with any of the applicable requirements, the first article sample shall be rejected.

4.3 Quality conformance inspection.

4.3.1 Lot formation.

4.3.1.1 Production lot. A lot shall consist of parts and assemblies produced by one manufacturer in one unchanged process, in accordance with the same drawing, same drawing revision, same specification and same specification revision. Drawing, specification and process changes not affecting safety, performance, storage, or interchangeability, as determined by the Government, shall not necessitate changing the lot interfix number. The criteria and procedures for the assignment of lot numbers shall be in accordance with MIL-STD-1168.

4.3.1.2 Inspection lot. A lot or batch and its formation, size, and presentation is described in MIL-STD-105, Section 5. Accordingly, a lot shall mean an inspection lot and a batch shall mean an inspection batch for the purpose of this specification. The manner in which each inspection lot or batch is to be presented and identified by the contractor, shall be designated or approved by the Government representative.

4.3.2 Product inspection examination. A sample shall be selected at random from each inspection lot in accordance with the applicable major or minor defects/characteristics table (see Table XVI and Table XVII), and inspected for all defects/characteristics in the applicable classification. Any defects/characteristics in the sample found to be defective shall reject the inspection lot. Sequence for the inspection of defects/characteristics in each classification need not be followed as long as all defects/characteristics inspections are performed.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Table XVI
Major Defects/Characteristics

Lot Size	Sample Size	Lot Size	Sample Size	Lot Size	Sample Size	Lot Size	Sample Size
1-72	all	140-141	124	256-259	177	541-549	230
73	72	142	125	260-262	178	550-559	231
74	73	143-144	126	263-265	179	560-569	232
75	74	145	127	266-268	180	570-579	233
76	75	146-147	128	269-271	181	580-590	234
77	76	148-149	129	272-275	182	591-601	235
78	77	150	130	276-278	183	602-613	236
79	78	151-152	131	279-282	184	614-625	237
80	79	153-154	132	283-285	185	626-637	238
81-82	80	155-156	133	286-289	186	638-649	239
83	81	157	134	290-293	187	650-662	240
84	82	158-159	135	294-296	188	663-676	241
85	83	160-161	136	297-300	189	677-690	242
86	84	162-163	137	301-304	190	691-704	243
87	85	164-165	138	305-308	191	705-719	244
88-89	86	166-167	139	309-312	192	720-735	245
90	87	168	140	313-316	193	736-751	246
91	88	169-170	141	317-320	194	752-768	247
92	89	171-172	142	321-324	195	769-785	248
93	90	173-174	143	325-329	196	786-804	249
94-95	91	175-176	144	330-333	197	805-823	250
96	92	177-178	145	334-338	198	824-842	251
97	93	179-180	146	339-342	199	843-863	252
98	94	181-182	147	343-347	200	864-884	253
99-100	95	183-184	148	348-352	201	885-907	254
101	96	185-187	149	353-356	202	908-930	255
102	97	188-189	150	357-361	203	931-955	256
103	98	190-191	151	362-366	204	956-981	257
104-105	99	192-193	152	367-372	205	982-1008	258
106	100	194-195	153	373-377	206	1009-1036	259
107	101	196-197	154	378-382	207	1037-1066	260
108-109	102	198-200	155	383-388	208	1067-1098	261
110	103	201-202	156	389-393	209	1099-1131	262
111	104	203-204	157	394-399	210	1132-1166	263
112-113	105	205-207	158	400-405	211	1167-1204	264
114	106	208-209	159	406-411	212	1205-1243	265
115	107	210-212	160	412-417	213	1244-1285	266
116-117	108	213-214	161	418-424	214	1286-1330	267
118	109	215-217	162	425-430	215	1331-1378	268
119	110	218-219	163	431-437	216	1379-1429	269
120-121	111	220-222	164	438-443	217	1430-1483	270
122	112	223-224	165	444-450	218	1484-1542	271
123-124	113	225-227	166	451-457	219	1543-1605	272
125	114	228-230	167	458-465	220	1606-1673	273
126-127	115	231-232	168	466-472	221	1674-1747	274
128	116	233-235	169	473-480	222	1748-1827	275
129-130	117	236-238	170	481-488	223	1828-1914	276
131	118	239-241	171	489-496	224	1915-2010	277
132-133	119	242-243	172	497-504	225	2011-2115	278
134	120	244-246	173	505-513	226	2116-2232	279
135-136	121	247-249	174	514-521	227	2233-2361	280
137	122	250-252	175	522-530	228	over 2361	298
138-139	123	253-255	176	531-540	229		

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Table XVII
Minor Defects/Characteristics

Lot Size	Sample Size	Lot Size	Sample Size	Lot Size	Sample Size	Lot Size	Sample Size
1-16	all	28-29	23	52-56	31	132-156	39
17	16	30-31	24	57-62	32	157-191	40
18	17	32-34	25	63-69	33	192-244	41
19-20	18	35-36	26	70-76	34	245-334	42
21	19	37-40	27	77-86	35	335-519	43
22-23	20	41-43	28	87-97	36	520-1120	44
24-25	21	44-47	29	98-112	37	over 1120	45
26-27	22	48-51	30	113-131	38		

4.3.2.1 Classification of defects/characteristics (see 3.2). Critical, major and minor defects/characteristics are defined in MIL-STD-105. Inspection shall be conducted as follows:

4.3.2.1.1 Arm safe device atomic weapon: XM134E1 (Prior to lockwiring) (see dwg 9287237).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Insufficient screw torque per drawing notes 6, 7, 8, 9, and 10	Gage
	102. Insufficient connector nut torque per drawing notes 11 and 12	Gage
	103. Objective evidence relative to material missing or improper (see 3.1)	Visual
Minor:		
	201. Evidence of poor workmanship (see 3.21)	Visual

4.3.2.1.2 Arm safe device atomic weapon: XM134E1 (see dwg 9287237).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Plate identification missing or incorrectly installed	Visual
	102. Connector protective caps missing	Visual
	103. Lockwire missing (3 places)	Visual

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

104. Evidence of poor workmanship (see 3.21).....Visual
105. Objective evidence relative to material missing or improper (see 3.1).....Visual

Minor: None defined.

4.3.2.1.3 Wiring, printed, flexible, No's 1, 2, 3, 4, 5, and 6. (see dwg's 9287239, 9287240, 9287241, 9287242, 9287243 or 9287381 as applicable).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Conductor width incorrect	Visual/Gage
	102. Less than 0.005 inch of exposed conductive pad between edge of hole in pad and cover layer	Visual/Gage
	103. Diameter of holes incorrect	Gage
	104. Profile of cable incorrect	Visual
	105. Separation between cover layer and base material or cover layer and copper	Visual
	106. Exposed pad area not completely tinned	Visual
	107. Any cable damaged (creased, gouged, cut, cracked or torn)	Visual
	108. Objective evidence relative to material missing or improper (see 3.1)	Visual
	109. Pins missing or loose where applicable	Visual
	110. Evidence of poor workmanship (see 3.21)	Visual
Minor:	None defined.	

4.3.2.1.4 Housing (see dwg 9287246).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Location of holes incorrect (6 holes)	Gage

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Major: (Cont.)

102.	Diameter of holes incorrect (6 holes)	Gage
103.	Outside length and width and height incorrect	Gage
104.	Sharp edges not broken in notes areas	Visual
105.	Surface finish incorrect	Visual
106.	Protective finish incorrect	Visual
107.	Protective finish in threaded holes	Visual
108.	Protective finish damaged or marred exposing base material	Visual
109.	Evidence of poor workmanship (see 3.21)	Visual
110.	Objective evidence relative to material missing or improper (see 3.1)	Visual

Minor: None defined.

4.3.2.1.5 Cover assembly (see dwg 9287251).

Categories	Defect/Characteristics	Method of Inspection

Critical: None defined.

Major:

101.	Incorrect pin height (2 places)	Gage
102.	Markings missing, incorrect or incorrectly located	Visual
103.	Evidence of poor workmanship (see 3.21)	Visual
104.	Insert missing or improperly installed	Visual
105.	Objective evidence relative to material missing or improper (see 3.1)	Visual

Minor: None defined.

4.3.2.1.6 Cover (after installing seal) (See dwg 9287252).

Categories	Defect/Characteristics	Method of Inspection

Critical: None defined.

Major:

101.	Diameter of holes incorrect (2 holes)	Gage
102.	Dimension of holes across flat incorrect (2 holes)	Gage

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

103. Diameter of counterbore (2 holes).....Gage
104. Diameter of hole incorrect (1 hole).....Gage
105. Dimension of hole across flat incorrect (1 hole).....Gage
106. Diameter of counterbore (1 hole).....Gage
107. Overall length, width and height incorrect.....Gage
108. Seal missing or damaged.....Visual
109. Surface finish not as specified.....Visual
110. Sharp edges not broken in noted areas.....Visual
111. Protective finish incorrect.....Visual
112. Protective finish in threaded holes.....Visual
113. Protective finish damaged or marred exposing base material.....Visual
114. Evidence of poor workmanship (see 3.21).....Visual
115. Objective evidence relative to material missing or improper (see 3.1).....Visual

Minor: None defined.

4.3.2.1.7 Module assembly (See dwg 9287255).

Categories	Defect/Characteristics	Method of Inspection

Critical: None defined.

Major:
101. Objective evidence that all screws have been epoxied and sufficiently torqued (See Dwg Notes 2, 3 and 4).....Visual
102. Torot shaft end play incorrect (2 shafts) (See Dwg Note 5).....Gage
103. Spacer shaft end play incorrect (4 shafts) (See Dwg Note 6).....Gage
104. Incorrect gap (2) (See Dwg Note 7).....Gage
105. Shaft and rachet wheel end play incorrect (2 shafts) (See Dwg Note 8).....Gage
106. Evidence of poor workmanship (see 3.21).....Visual
107. Objective evidence relative to material missing or improper (see 3.1).....Visual

Minor: None defined.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

4.3.2.1.8 Reset rod assembly (see dwg 9287280).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Pins do not comply with drawing note 2 (3 pins)	Gage
	102. Evidence of poor workmanship (see 3.21)	Visual
	103. Objective evidence relative to material missing or improper (see 3.1)	Visual
Minor:	None defined.	

4.3.2.1.9 Roller assembly (See dwg 9287290).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Diameter of hole incorrect	Gage
	102. Incorrect width	Gage
	103. Outside diameter of roller incorrect (see dwg 9287291)	Gage
	104. Width of roller incorrect (See dwg 9287291)	Gage
	105. Objective evidence relative to material missing or improper (see 3.1)	Visual
	106. Gate vestige exceeds maximum specified on drawing	Gage
	107. Evidence of poor workmanship (see 3.21)	Visual
Minor:	None defined.	

4.3.2.1.10 Pawl plate and gear assembly (See dwg 9287292).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Gear staking missing or incorrect	Visual
	102. Rivets do not comply with drawing note 2 after staking (4 places)	Gage
	103. Incorrect diameter of hole after staking	Gage

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

104. Orientation of pawl bevels incorrect (4 places).....Visual
105. Gear rotational torque does not comply with drawing note 2.....Gage
106. Evidence of poor workmanship (see 3.21).....Visual
107. Objective evidence relative to material missing or improper (see 3.1)...Visual

Minor: None defined.

4.3.2.1.11 Shaft and rachet wheel assembly (see dwg 9287297).

Categories	Defect/Characteristics	Method of Inspection

Critical: None defined.

Major:
101. Staking missing or incorrect.....Visual
102. Rachet wheel rotational torque does not comply with drawing note 2.....Gage
103. Direction of teeth incorrect.....Visual
104. Evidence of poor workmanship (see 3.21).....Visual
105. Objective evidence relative to material missing or improper (see 3.1).....Visual

Minor: None defined.

4.3.2.1.12 "G" weight and gear 1/h assembly (see dwg 9287300).

Categories	Defect/Characteristics	Method of Inspection

Critical: None defined.

Major:
101. Straight pin not flush to below surface.....Gage
102. Evidence of poor workmanship (see 3.21).....Visual
103. Objective evidence relative to material missing or improper (see 3.1).....Visual

Minor: None define.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

4.3.2.1.13 Shaft bias gear l/h assembly (see swg 9287304).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Staking missing	Visual
	102. Gear does not comply with drawing note 5	Gage
	103. Lubrication missing	Visual
	104. Evidence of poor workmanship (see 3.21)	Visual
	105. Objective evidence relative to material missing or improper (see 3.1)	Visual
Minor:	None defined.	

4.3.2.1.14 "G" weight bias assembly (see dwg 9287308).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Stud does not comply with drawing note 2	Gage
	102. Evidence of poor workmanship (see 3.21)	Visual
	103. Objective evidence relative to material missing or improper (see 3.1)	Visual
Minor:	None defined.	

4.3.2.1.15 "G" weight segment driver assembly (see dwg 9287309).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Stud does not comply with drawing note 2	Gage
	102. Evidence of poor workmanship (see 3.21)	Visual
	103. Objective evidence relative to material missing or improper (see 3.1)	Visual
Minor:	None defined.	

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

4.3.2.1.16 "G" weight and gear r.h. assembly (see dwg 9287310).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
101.	Straight pin not flush to below surface	Gage
102.	Evidence of poor workmanship (see 3.21)	Visual
103.	Objective evidence relative to material missing or improper (see 3.1)	Visual
Minor:	None defined.	

4.3.2.1.17 Shaft gear driver r.h. assembly (see dwg 9287313).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
101.	Gear does not comply with drawing note 4	Gage
102.	Stud not flared on both ends	Visual
103.	Staking missing	Visual
104.	Lubrication missing	Visual
105.	Evidence of poor workmanship (see 3.21)	Visual
106.	Objective evidence relative to material missing or improper (see 3.1)	Visual
Minor:	None defined.	

4.3.2.1.18 Escape wheel and gearshaft assembly (see dwg 9287324).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
101.	Staking missing or incorrect	Visual
102.	Staking does not comply with drawing note 2	Gage

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Major: (Cont.)

103. Evidence of poor workmanship (see 3.21).....Visual
104. Objective evidence relative to material missing or improper (see 3.1).....Visual

Minor: None defined.

4.3.2.1.19 Pallet assembly (see dwg 9287327).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
101.	Pallet and pallet weight do not comply with drawing note 3.....	Gage
102.	Evidence of poor workmanship (see 3.21).....	Visual
Minor:	None defined.	

4.3.2.1.20 Upper clock plate assembly (see dwg 9287331).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
101.	Gear does not comply with drawing note 2.....	Gage
102.	Gear assembly does not comply with drawing note 3.....	Gage
103.	Evidence of poor workmanship (see 3.21).....	Visual
104.	Objective evidence relative to material missing or improper (see 3.1).....	Visual

4.3.2.1.21 Plate intermediate assembly (see dwg 9287335).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
101.	Pin not flush to below surface (2 places.....	Gage
102.	Bushings missing (2 places).....	Visual

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Major: (Cont.)

103. Evidence of poor workmanship (see 3.21).....Visual
104. Objective evidence relative to material missing or improper (see 3.1).....Visual

Minor: None defined.

4.3.2.1.22 Plate, switch mounting assembly (See dwg 9287345).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Bushings missing (2 places)	Visual
	102. Thread inserts missing	Visual
	103. Evidence of poor workmanship (see 3.21)	Visual
	104. Objective evidence relative to material missing or improper (see 3.1)	Visual
Minor:	None defined.	

4.3.2.1.23 Switch plate assembly (see dwg 9287349).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Pins do not comply with drawing note 2 (2 places)	Gage
	102. Evidence of poor workmanship (see 3.21)	Visual
	103. Objective evidence relative to material missing or improper (see 3.1)	Visual

4.3.2.1.24 Contact plate assembly (see dwg 9287366, 9287373 or 9287375 as applicable).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Assembly does not comply with drawing note 2	Gage

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Major: (Cont.)

102. Welds missing.....Visual
103. Evidence of poor workmanship (see 3.21).....Visual
104. Objective evidence relative to material missing or improper (see 3.1).....Visual

Minor: None defined.

4.3.2.1.25 Plate assembly (See dwg 9287380).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Stop does not comply with drawing note 2 (4 places)	Gage
	102. Evidence of poor workmanship (see 3.21)	Visual
	103. Objective evidence relative to material missing or improper (see 3.1)	Visual
Minor:	None defined.	

4.3.2.1.26 Preparation for delivery (See Section 5).

Categories	Defect/Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
	101. Packing and marking not in accordance with Dwg 9287384 or 9275835 as applicable	Visual
Minor:		
	201. Evidence of poor workmanship (see 3.21)	Visual

4.3.3 Testing. The contractor shall perform all the tests specified in this paragraph on each subassembly or device. Tests shall be performed in the order specified. None of the tests are considered destructive and samples so tested may be returned to the lot. Each subassembly or device shall be tested in accordance with the applicable test method. If any item fails to comply with the applicable requirements, the item shall be rejected and removed from the lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

Test	Test Classification	Test Method	Requirement
a. Insulation resistance-harness assembly	Major	4.4.2	3.7.1
b. Circuit resistance-board and terminal assembly	Major	4.4.1	3.6.1
Harness assembly	Major	4.4.1	3.6.2
Arm-safe device	Major	4.4.1	3.6.3
c. Insualtion resistance-safe	Major	4.4.2	3.7.2
d. Circuit resistance safe	Major	4.4.1	3.6.4
e. Operation non-arm	Major	4.4.3.1	3.8.2
f. Operation arm	Major	4.4.3.2	3.8.1
g. Insulation resistance-armed	Major	4.4.2	3.7.3
h. Circuit resistance-armed	Major	4.4.1	3.6.5
i. Reset	Major	4.4.13	3.19
j. Seal integrity	Major	4.4.11	3.16

4.3.4 Acceptance inspection equipment.

4.3.4.1 Major defects/characteristics and tests. Inspection and testing shall be performed with the acceptance inspection equipment, operating instructions, and calibration instructions specified on the Equipment Lists (EL) (see EL-listed in 2.1). When either of the conditions listed below exist, the contractor shall design required equipment or specify suitable commercial equipment and obtain approval prior to use on the contract.

a. Any deviation from equipment or procedures specified on the EL is desired (see 6.3).
b. The code "CD" is listed in the "Part or Identifying Number" column on the EL (see 6.1.2).

4.3.4.2 Minor defects/characteristics and tests. Acceptance inspection equipment for minor defects/characteristics is not specified on ELs. The acceptance inspection equipment, operating instructions and calibration instructions used by the contractor for minor classification inspection shall be approved by the Government representative authorized by the procuring agency.

4.4 Test methods. The tolerances specified herein are absolute with no allowance for test equipment inaccuracy. The tolerances used by the manufacturer shall be equal to the absolute tolerances less the accuracy tolerances of the test equipment used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

4.4.1 Circuit resistance. The circuit resistance shall be within the values specified in 3.6. Values less then 0.1 ohms shall be measured with 100 ± 2 milliamperes from a source whose open circuit voltage is 6 ± 1 vdc. Kilohm values shall be measured with less than 50 milliwatts dissipation. Testing shall be performed per MIL-STD-202, Method 307 with approved measuring equipment.

4.4.2 Insualtion resistance. The insulation resistance shall be measured with approved insulation measuring equipment in accordance with 3.7. Insulation resistance testing shall be performed per MIL-STD-202, Method 302, Cond. B.

4.4.3 Operation.

4.4.3.1 Arming. The device, in the safe position, shall be mounted in a centrifuge utilizing an approved fixture and oriented as shown in Figure 2. The device shall then be subjected to 90 ± 2 gravity units and it shall arm within 210 milliseconds. (Timing to start at 45° swing position of centrifuge fixture). Upon completion of the above, reset the device to the safe position and subject the device to 100 ± 2 gravity units. Arming time at this level shall be as specified in 3.8.1 or 3.17. Function circuits 1 thru 6 as specifeid in 3.8.1 shall be connected in series to monitor operate time.

4.4.2.3 Non-arm. The device in the safe position shall be mounted in a centrifuge, utilizing an approved fixture, and subjected to the requirements of 3.8.2. Acceleration shall be applied to the device in the +XX axis (see Figure 2).

4.4.4 Acceleration.

4.4.4.1 Armed-ambient. The device in the armed position shall be mounted in a centrifuge, utilizing an approved fixture, and subjected to the requirements of 3.9.1.

4.4.4.2 Armed-high temperature. The device in the armed position shall be placed in an approved temperature chamber and stabilized at 200 ± 5°. (The device shall be considered stabilized after temperature soaking for a minimum of 4 hours.) The device shall be removed from the chamber and mounted in a centrifuge, utilizing an approved fixture. Within a 10 minute period following removal from the temperature chamber the device shall be subjected to the requirements of 3.9.2.

4.4.5 Current carrying capability. The device in the armed position and stabilized at 150 ± 5°F in an approved temperature chamber (The device shall be considered stabilized after temperature soaking for 4 hours minimum) shall be subjected to the requirements of 3.10.

4.4.6 Temperature shock. The device, in the safe position, shall be placed in a chamber at ambient condition. The chamber temperature shall be raised to 125 ± 5°F in a

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

period of no more than one hour at a rate of approximately 45 degrees per hour. Maintain the device at a temperature of 125 ± 5°F for a minimum of four hours. During this period, obtain a temperature vs. time recording of the chamber temperature. After the four hour exposure time at 125°F, reduce the chamber temperature to -40 ± 5°F in a time period of not more than four hours at a rate of approximately 41° per hour. Maintain the devices at a temperature of -40 ± 5°F for a minimum of four hours. During this period, obtain a temperature vs. time recording of the chamber temperature. After the four hour exposure at -40°F, raise the chamber temperature to 125 ± 5°F in a time period of not more than four hours at a rate of approximately 41° per hour. This sequence constitutes one cycle. Three consecutive cycles shall be executed. At the conclusion of the third cycle, the device shall be at 125°F. Remove the device from the test chamber and allow to return to ambient conditions without forced cooling or continue with Group 1 tests per Table XV.

4.4.7 Low temperature. The device in the safe position shall be placed in an approved test chamber and the temperature lowered to -40 ± 5°F and stabilized (see 6.4). This temperature shall be maintained for 10 hours minimum. Remove the device from the test chamber and allow to return to room temperature without forced heating or continue with Group 11 tests per Table XV.

4.4.8 High temperature. The device in the safe position shall be placed in an approved test chamber and the temperature raised to 165 ± 5°F and stabilized (see 6.4). This temperature shall be maintained for 10 hours minimum. After removing the device from the test chamber and allow to return to room temperature without forced cooling or continue with Group 1 tests per Table XV.

4.4.9 Mechanical shock.

4.4.9.1 Transportation shock (high temperature). The device in the safe position shall be placed in an approved temperature chamber and stabilized at +165 ± 5°F. (The device is considered stabilized after temperature soaking for a minimum of 4 hours.) The device shall be removed from the chamber and rigidly mounted to a fixture capable of readily orientating the device along each of three mutually perpendicular axes relative to the shock source. Utilizing an approved shock machine the device and fixture shall be subjected to the requirements of 3.14.1. The device shall not be outside the temperature chamber for a period of greater then 15 minutes per hour once testing beginss. After this test the device and fixture shall be inspected for damage (see 6.5).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

4.4.9.2 Transportation shock (low temperature). Test method same as 4.4.9.1 except temperature shall be lowered to -40 + 5°F and device shall be subjected to the requirements of 3.14.2.

4.4.9.3 Operation shock. The device in the armed position shall be rigidly mounted to fixture which is capable of readily orienting the device along each of three mutually perpendicular axes relative to the shock source. The device and fixture shall then be secured to an approved shock machine and subjected to the requirements of 3.14.3.

4.4.10 Vibration.

4.4.10.1 Transportation (high temperature). The device in the safe position shall be rigidly mounted to a fixture which is capable of readily orientating the device in each of three mutually perpendicular axes. The device and fixture shall be secured to an approved vibration machine and subjected to the requirements of 3.15.1. During this test the device shall be maintained at 165 ± 5°F.

4.4.10.2 Transportation (low temperature). The device in the safe position shall be tested in accordance with the procedure of 4.4.10.1 except that the device shall be maintained at -40 ± 5°F.

4.4.10.3 Random vibration. The device in the armed position shall be rigidly mounted to a fixture which is capable of readily orientating the device in each of three mutually perpendicular axes. The device and fixture shall be secured to an approved vibration machine and subjected to the requirements of 3.15.3.

4.4.11 Seal integrity. Using a mass spectrometer helium leak detector, the unit shall be tested at an absolute pressure of one torr or less for leakage in excess of 5X 10-5 atm cc/sec total gas leakage.

4.4.12 Life cycle. Using the procedures specified in 4.4.3.1 (210 millisecond operate time at 100 ± 2 g's only) the device shall be armed and reset total of 30 times. Reset to arm shall be considered one cycle. After each fifth cycle the device shall be tested in accordance with 4.4.1 Table X, 4.4.2 Table XIV and 4.4.13.

4.4.13 Reset. The device in the armed position shall be reset using an approved force measuring gage. After reset the resistance between J3-4 and J3-5 shall be 2K ± 3% ohms.

4.4.14 Contact chatter. Chatter shall be monitored by measuring the voltage drop produced by 100 ± 2 milliamperes passing through each of the three functional circuits specified in 3.18. The voltage drop per 100 milliamperes ratio above which the circuit shall be considered open shall be 5 ± .05 ohms. The open circuit voltage of the current source shall not exceed 8 vdc. Time measurements shall be ± 5% accurate.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging. The Arm-Safe Device shall be preserved, packed and marked in accordance with Dwg 9275835 or when shipped as a spare part with Dwg 9287384.

6. NOTES

6.1 Ordering data. Procurement documents should specify the following:

6.1.1 Procurement requirements.

a. Title, number, and date of this specification.

b. Selection of applicable level of packaging and packing required (see 3.5 and 4.3.4.1).

6.1.2 Contract data requirements (see 3.5 and 4.3.4.1). Data specified in 3.5 and 4.3.4.1 will be delivered as identified in a numbered DD Form 1664 when required on a DD Form 1423 incorporated in the contract.

6.2 Objective evidence. Records of contractor quality control and inspections which can be verified.

6.3 Acceptance inspection equipment (see 4.3.4.1). The contractor shall obtain approval from the Commander, US Army Armament Research and Development Command, ATTN: DRDAR-QAN-I, Dover, New Jersey 07801.

6.4 Temperature stabilization. The temperature is considered stabilized when the greatest peaks (both highest and lowest) continually observed over 5 minutes min. do not exceed the nominal temperature plus tolerance specified.

6.5 Physical damage. Physical damage shall include bent or loose connector pins or sockets, damaged seal interfaces or cracks in housing.

6.6 Destructive testing. Each sample unit subjected to destructive testing shall be identified for first article and lot acceptance traceability as delineated in QAI-PA-1.


6.7 Supersession data. This specification supersedes the requirements of Purchase Description PA-PD-2238A dated 5 March 1975 and SCN #1 dated 5 March 1975.

Custodian:
Army - AR

Preparing activity:
Army - AR

Project No. 1135-A219

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

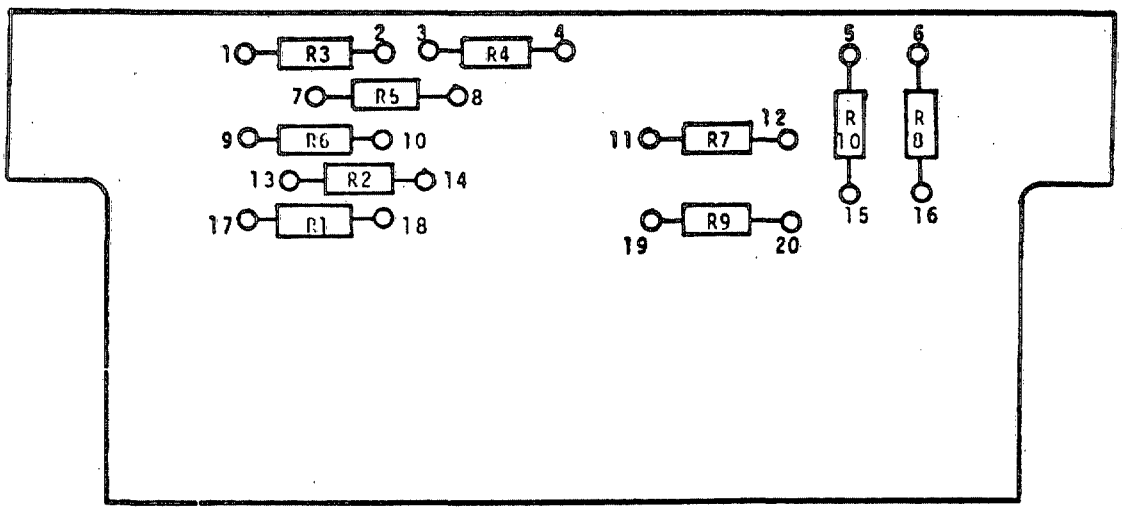

See Dwg 9287358

Figure 1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

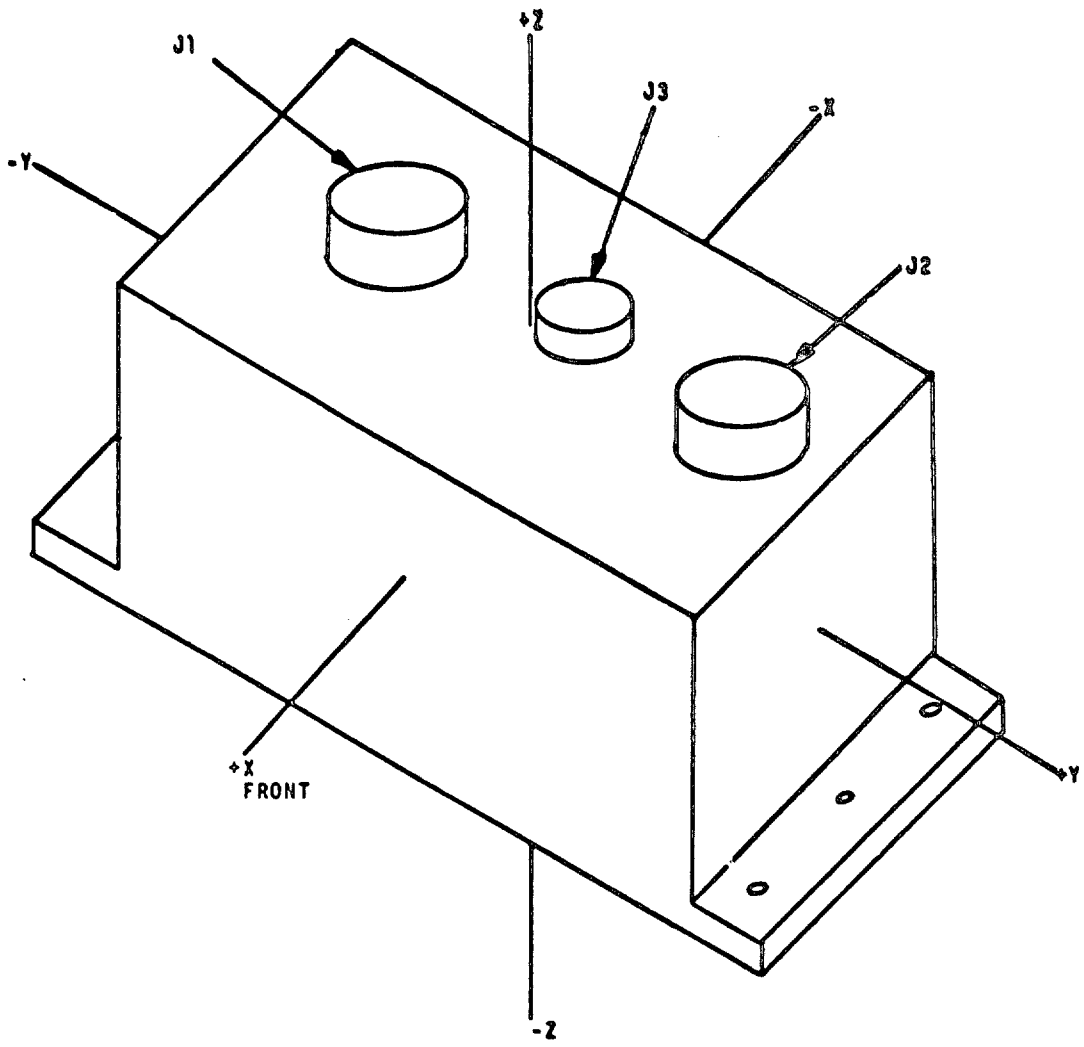


Figure 2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?
   A. GIVE PARAGRAPH NUMBER AND WORDING.

   B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

   ☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 68 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T04:07Z
Check the source to verify that this is the current version before use.