MIL-F-13424K(PA)
16 April 1976
Superseding
MIL-F-13424J
7 July 1974

MILITARY SPECIFICATION

FUZES, HAND GRENADE, M204A2, M206A2 AND PRACTICE M205A2 PARTS FOR, LOADING, ASSEMBLING AND PACKING

This specification is approved for use by Picatinny Arsenal, Department of the Army and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the parts and loading, assembling and packing for three types of hand grenade fuzes designated as Fuzes, Hand Grenade, M204A2, M206A2 and Practice, M205A2.

2. APPLICABLE DOCUMENTS

* 2.1 The following documents, of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-P-116	- Preservation, Method of
MIL-P-223	- Powder, Black
MIL-A-2550	- Ammunition and Special Weapons; General Specification for
MIL-C-13739	- Composition, Delay
MIL-P-20444	- Primer, Percussion, M42, Loading, Assembling and Packing
MIL-A-48078	- Ammunition, Standard Quality Assurance Provisons, General Specification for

FSC: 1330

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-109 - Quality Assurance Terms and Definitions
MIL-STD-171 - Finishing of Metal and Wood Surfaces
MIL-STD-1235- Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes

DRAWINGS

U.S. ARMY PICATINNY ARSENAL

PRODUCT AND PACKAGING DRAWINGS

7548570 - Fuze, Grenade, Hand, M204A2, M206A2 and Fuze, Grenade, Hand, Practice, M205A2 Assembly.
8848621 - Box, Set-up, Packing, Ammunition, for Hand Grenade Fuzes.
8848622 - Box, Packing, Ammunition, For Hand Grenade Fuzes

INSPECTION EQUIPMENT DRAWINGS

9200888 - Adapter Drop Test
9278658 - Training Manual For Radioisotopic Automatic Hand Grenade Fuze Checker
9200887 - Holder, Fuze, Hand Grenade

(Copies of specifications, standards, drawings and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer.)

*(For Meaning of Asterisk See Paragraph 6.10)

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 Material. - Materials shall be in accordance with applicable drawings and specifications.

3.2 Fuze. - The fuze shall comply with all requirements specified on drawing (dwg.) 7548570, all associated drawings, and with all requirements specified in applicable specifications.

*3.3 Fuze body. - There shall be no evidence of cracks or porosity in the fuze body after consolidation of the delay column when inspected as specified.

*3.4 Functioning. - The fuze shall not dud (see 6.6) nor fail to function because of a "hung" striker (see 6.7). It shall function high order (see 6.8), and shall comply with the following delay time requirements.

3.4.1 Premature delay. - No fuze shall have a functioning delay time of less than three (3) seconds.

3.4.2 Normal delay. - The fuze shall function in not less than four (4) nor more than five (5) seconds.

3.4.3 Excessive delay. - No fuze shall have a functioning delay time greater than ten (10) seconds.

*3.5 Embrittlement. - The spring shall not break when tested as specified.

*3.6 Delay composition

*3.6.1 Consolidation of delay composition. - The loading equipment shall include consolidating punches which shall reach the required consolidation pressure before stopping. The punch travel and method of actuation of any punch shall not be dependent on the punch travel or method of actuation of any other punch. A pressure gage shall be incorporated as an integral part of each consolidation station to measure directly the pressure of each consolidating punch. The overall height of the delay column shall be gaged automatically by the loading machine. In the event any punch does not reach the required consolidating pressure or the overall height of the delay column does not meet the requirement specified, the loading machine shall automatically reject the fuze or fuzes in question.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

*3.6.2 Contamination control. - There shall be no contamination including lubricating oil, hydraulic fluids etc., in the delay composition.

*3.6.3 Adherence of delay composition . - No delay composition shall be allowed to adhere to the devices used to feed the delay composition to the processing equipment which includes mixing and loading machines. The devices used to feed delay composition to the processing equipment shall be disassembled and cleaned periodically to insure that delay composition shall not be allowed to build up on these devices. The devices shall be seamless and of such a design as to minimize adherence of delay composition.

*3.7 Workmanship. - All parts and assemblies shall be fabricated and loaded in a thorough workmanlike manner, and all manufacturing, processing, and assembly operations shall be correctly performed. They shall be clean and free of burrs, sharp edges, unblended radii, surface defects, chips, dirt, grease and oil (except where specifically required), corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part or assembly nor shall they be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined. Required packing shall be dry.

3.8 First article inspection. - This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

4. QUALITY ASSURANCE PROVISIONS

*4.1 Responsibility for inspection and standard quality assurance provisions. - Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

*4.1.1 Submission of product. - In addition, inspection lots of fuzes shall contain with each lot submitted for acceptance:

a. Certificates of conformance denoting body aging as per dwg. 7548590 and primer holder aging per dwg. 7548591.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

b. Statement of findings denoting primer composition as per dwg. 8799925.

c. Certificate of conformance denoting the drying procedures as per dwg. 7548576.

d. Certificate of conformance denoting drying procedure of the body in the event of excess exposure as per dwg. 7548570.

e. Statement of findings denoting diecast material composition as per dwg. 7548590 or 7548591 with each lot of bodies or primer holders.

f. A statement of findings for each lot of composition, per MIL-C-13739.

*4.2 Classification of inspections. - The following types of inspection shall be conducted on this item.

a. First Article Inspection

b. Quality Conformance Inspection

*4.3 First article

*4.3.1 Submission. - The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2 and 4.3.3. The first article sample shall consist of: set of parts, every subassembly, completely loaded fuze assemblies and loaded fuze assemblies less detonator or igniter case assembly as specified in Table 1.

*4.3.2 Inspections to be performed. - See MIL-A-48078 and Table I specified herein.

*4.3.3 Rejection. - The first article sample of loaded fuze assemblies shall be rejected (see MIL-A-48078) and if any of the following test results occur:

a. Any primer or primer holder blows out.

b. The number of defectives exceeds the limits of 4.4.3.2.1 a, b, or c (also see Table II).

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

*TABLE 1 - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
	Fuzes, Hand Grenade, M204A2, M206A2 and Practice M205A2	1 OF 3	See Below
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Detonator Assembly and Igniter Case Assembly (Dwg. 7548573 or 7548575) Examination for Defects	25	100%	3.2	4.4.2.1
	Body (Dwg. 7548590) Examination for Defects	25	100%	3.2	4.4.2.2
	Lever (Dwg. 7548587, or 8836380 as applicable Examination for Defects	25	100%	3.2	4.4.2.3
	Holder, Primer (Dwg. 7548591) Examination for Defects	25	100%	3.2	4.4.2.4
	Spring (Dwg. 7548585) Examination for Defects	30	100%	3.2	4.4.2.5
	Striker, Assembly (Dwg. 7548578) Examination for Defects	25	100%	3.2	4.4.2.6

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

*TABLE 1 - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 2 OF 3		DRAWING NUMBER
	Fuzes, Hand Grenade, M204A2, M206A2 and Practice M205A2				See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Fuze Assembly (Prior to Assembly of Primer Holder) (Dwg. 7548570) Examination for Defects	25	100%	3.2	4.4.2.7
	Fuze Assembly (Prior to Assembly of Striker and Detonator or Igniter Case Assembly (Dwg. 7548570) Examination for Defects	25	100%	3.2	4.4.2.8
	Fuze Assembly (Dwg. 7548570) Examination for Defects	25	100%	3.2	4.4.2.9
	Functioning	500	(d)	3.2	4.4.3.2.2
	Spring Embrittlement	30 ea.	100%	3.2	4.4.3.3
	Spring Torque Under Load (See dwg. 7548585)	50	(d)	3.2	4.4.3.4.1
	Spring Torque after Assembly (See dwg. 7548585)(a)	50	(d)	3.2	4.4.3.4.2
	Automatic Inspection of Delay Column (b)	500	100%	3.2	4.4.3.5
	Safety Pin Withdrawal (Lower Limit)	500	100%	3.2	4.4.3.6.1
	(Upper Limit) (c)	500	100%	3.2	4.4.3.6.2

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

*TABLE 1 FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 3 OF 3		DRAWING NUMBER
	Fuzes, Hand Grenade, M204A2, M206A2 and Practice M205A2				See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Primer Holder Assembly Push Out Resistance	100	(d)	3.2	4.4.3.7
	Security of Primer & Primer Holder after Environmental Test (Fuze assembly less igniter case assembly)	50	(d)	3.2	4.4.3.8
	Salt Spray (Spring, Pull Ring Assembly Striker Assembly, Pin Hinge and Lever	As Per Spec	100%	3.2	4.4.3.13
	(a) Spring Torque after assembly shall use the same 50 samples as used in Test No. 4.4.3.4.1.				
	(b) Prior to performing the functioning test, the five-hundred samples shall be subjected to the testing prescribed in 4.4.3.5, 4.4.3.6.1 and 4.4.3.6.2.				
	(c) Upper limit to be performed in conjunction with the functioning test specified in 4.4.3.2.2.				
	(d) Acceptance criteria shall be as specified in applicable test paragraph.				

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

*4.4.1 Inspection lot formation. - Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of fuzes shall contain:

a. Metal parts or metal parts assemblies of one lot interfix number from one manufacturer.
b. Loaded primer assemblies of one lot interfix number from one manufacturer.
c. Delay composition from not more than two consecutive lots from one manufacturer.
d. Detonator assemblies from not more than one manufacturer containing the following:

(1) RDX from not more than one lot from one manufacturer.
(2) Lead azide from not more than one lot from one manufacturer.
(3) Lead styphnate from not more than one lot from one manufacturer.
e Black powder from one lot from one manufacturer.

*4.4.2 Examination. - (See MIL-A-48078). Unless otherwise specified in the classification of defects and test tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
*4.4.2.1	Detonator Assembly and Igniter Case Assembly		7548573 or 7548575
			NEXT HIGHER ASSEMBLY 7548570

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Loose or caked powder on either inside or outside wall of case (Dwg. 7548573 only)		100%	3.2	Visual
Major					
101	Black Powder weight incorrect		.50%	3.2	Balance/7548575
102	Incorrect charge (Detonator Assembly)		.40%	3.2	Visual/7548573
103	Charge Missing		.40%	3.2	Visual
104	Incorrect charge(Igniter Assembly)		.40%	3.2	Visual/7548575
Minor					
201	Outside diameter		0.65%	3.2	Gage
202	Evidence of poor workmanship		100%	3.7	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 7548590
*4.4.2.2	Body				NEXT HIGHER ASSEMBLY 7548570
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Burr or flash on pivot pin or safety pin hole		100%	3.2	Visual/Manual
2	Foreign material in delay cavity		100%	3.2	Gage
Major					
101	Width of striker cavity		100%	3.2	Gage
102	Foreign material in delay cavity		100%	3.2	Gage
103	Location of large datum diameter in primer holder cavity, maximum (max)		0.40%	3.2	Gage
104	Location of small datum diameter in primer holder cavity, max.		0.40%	3.2	Gage
105	Pitch diameter of thread		0.40%	3.2	Gage
106	Outside diameter of body below thread pilot, min.		0.40%	3.2	Gage
107	Malformed or incomplete casting		0.40%	3.2	Visual
Minor					
201	Major diameter of thread, min.		0.65%	3.2	Gage
202	Protective finish missing or base metal exposed		0.65%	3.2	Visual
203	Evidence of poor workmanship		100%	3.7	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 7548587, 7548588 or 8836380
*4.4.2.3	Lever				NEXT HIGHER ASSEMBLY 7548570
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Formed edge missing		100%	3.2	Visual
2	Crack in hinge pin ear or any formed edge radius		100%	3.2	Visual
Major					
101	Length from hinge pin ears to safety pin hole		0.40%	3.2	Gage
102	Height of formed edge below min.		0.40%	3.2	Gage
103	Length of large formed edge from top surface		0.40%	3.2	Gage
104	Metal thickness below min.		0.40%	3.2	Gage
Minor					
201	Protective coating missing or base metal exposed		0.65%	3.2	Visual
202	Evidence of poor workmanship		100%	3.7	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
*4.4.2.4	Holder, Primer				7548591
					NEXT HIGHER ASSEMBLY 7548570
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter at datum length		0.40%	3.2	Gage
102	Diameter of counterbore, max.		0.40%	3.2	Gage
103	Malformed or incomplete casting		0.40%	3.2	Visual
104	Chamfer missing		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
*4.4.2.5	Spring		7548585
			NEXT HIGHER ASSEMBLY 7548570

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Angle between legs		0.40%	3.2	Gage
102	Length of straight leg		0.40%	3.2	Gage
Minor					
201	Protective coating missing or base metal exposed		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 7548578
*4.4.2.6	Striker Assembly				NEXT HIGHER ASSEMBLY 7548570
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Burr on outside of striker ear		100%	3.2	Visual
102	Striker damaged or malformed		100%	3.2	Visual
103	Width of striker		100%	3.2	Gage
104	Length from point to pivot pin hole		0.40%	3.2	Gage
105	Striker point missing or damaged to extent that function may be impaired		0.40%	3.2	Visual
Minor					
201	Striker point insecure (can be moved by hand)		0.65%	3.2	Manual
202	Protective finish missing or base metal exposed		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 7548570
#4.4.2.7	Fuze Assembly, Prior to Assembly of Primer Holder				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Length of delay column height below min.		100%	3.2	Gage
Minor					
201	Evidence of poor workmanship		100%	3.7	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
*4.4.2.8	Fuze Assembly, Prior to Assembly of Striker and Detonator or Igniter Case Assembly	1 OF 1	7548570
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of delay charge from bottom of delay cavity		100%	3.2	Gage
102	Depth to top of primer holder assembly		0.40%	3.2	Gage
103	Primer assembly above flush		0.40%	3.2	Gage/7548576
104	Primer assembly crimp missing, incomplete or off-center		0.40%	3.2	Visual/7548576
105	Primer holder assembly crimp missing, incomplete or off-center		0.40%	3.2	Visual
106	Varnish coating of joint and crimp missing or incomplete		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES

SARPA-QA FORM 2567 FEB 74 4010

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS


MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
*4.4.2.9	Fuze Assembly				7548570
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Crack in detonator or igniter case		100%	3.2	Visual
2	Safety pin ends incorrectly formed or cracked		100%	3.2	Visual
3	Automatic inspection mark missing		100%	3.2	Visual
4	Detonator or igniter crimp incomplete, non-uniform or contains cusps		100%	3.2	Visual
5	Either or both lever hinge ears missing		100%	3.2	Visual
6	Both lever hinge ears not bent away from the body past the vertical centerline of the body hinge bosses		100%	3.2	Visual/Figure 1B
7	Ends of both lever hinge ears not bent upwards		100%	3.2	Visual/Figure 1A
8	Length from flat on body to end of detonator		100%	3.2	Gage
9	Fuze designation marking incorrect		100%	3.2	Visual
Major					
101	Either lever hinge ear not bent away from the body past the vertical centerline of the body hinge bosses		0.40%	3.2	Visual/Figure 1B
102	End of either hinge ear not bent upwards		0.40%	3.2	Visual/Figure 1A

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

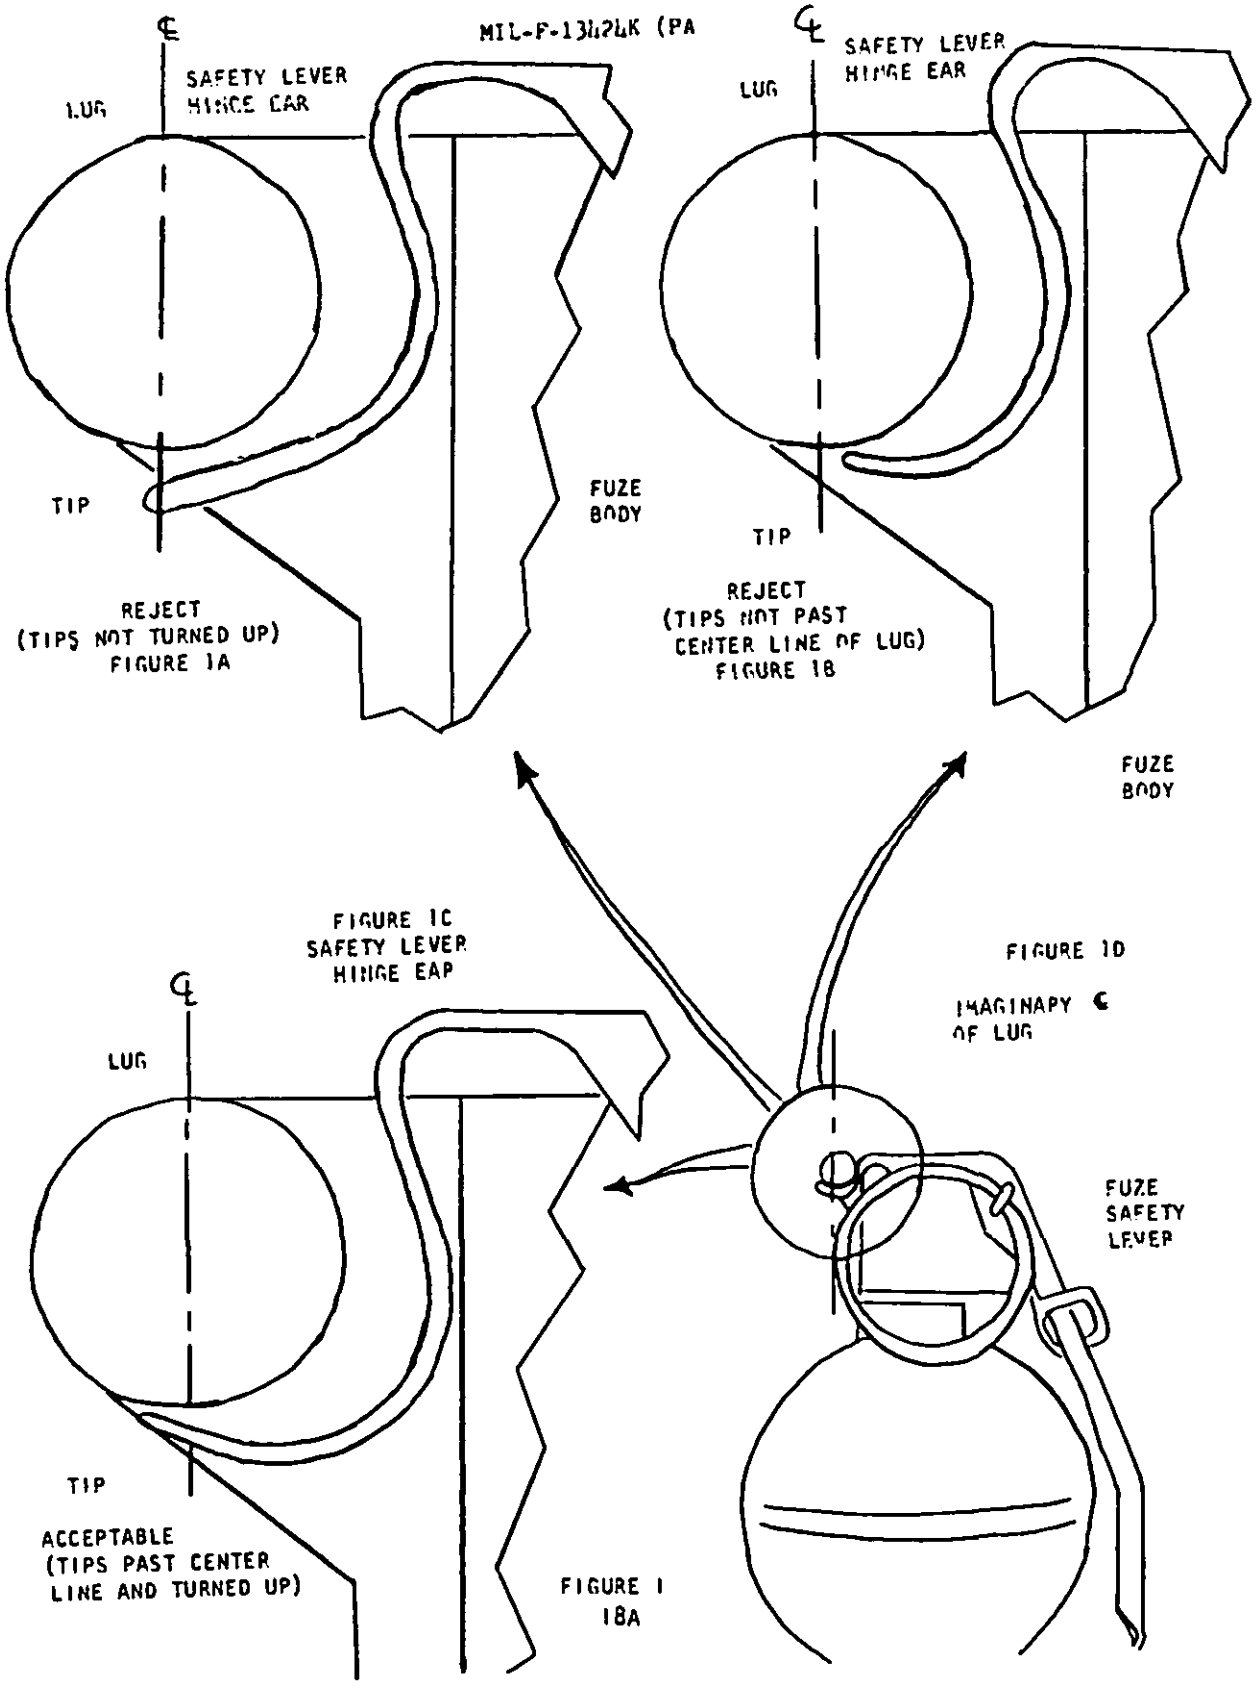

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
*4.4.2.9	Fuze Assembly				7548570
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Major (Cont.)					
103	Concentricity of detonator assembly with thread		0.40%	3.2	Gage
104	Diameter of detonator or igniter crimps		0.40%	3.2	Visual
105	Sealing compound missing or incomplete		0.40%	3.2	Visual
106	Distance from flat on body to bottom of igniter case assembly		0.40%	3.2	Gage
Minor					
201	Protective coating damaged to extent that base metal is exposed		0.65%	3.2	Visual
202	Marking missing, incorrect or illegible		0.65%	3.2	Visual
203	Gasket missing		0.65%	3.2	Visual
204	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET	OF	DRAWING NUMBER
4.4.2.10	Unsealed Set-Up Box		1	1	8848621
					NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Incorrect number of fuzes		0.40%	3.2	Visual
102	Pad missing		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 8848621
*4.4.2.11	Sealed Carton				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Carton punctured, cut or torn		0.40%	3.2	Visual
102	Sealing strip incomplete or badly wrinkled		0.40%	3.2	Visual
Minor					
201	Contents move when shaken		0.65%	3.2	Manual
202	Marking missing, misleading or unidentifiable		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-13424K(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 8848621
*4.4.2.12	Sealed Barrier Bag				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Seal improper or incomplete		0.40%	3.2	Visual
102	Bag punctured, torn or cut		0.40%	3.2	Visual
Minor					
201	Marking missing, misleading or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-13424K(PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 8848622
*4.4.2..13	Sealed Wooden Packing Box				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Box damaged exposing contents		0.40%	3.2	Visual
102	DOD symbol misleading or unidentifiable		0.40%	3.2	Visual
103	Wire missing, broken or loose		0.40%	3.2	Visual/Manual
104	Strapping missing or loose		0.40%	3.2	Visual
Minor					
201	Car seal missing, unsealed or improperly positioned		0.65%	3.2	Visual
202	Strapping incorrectly assembled		0.65%	3.2	Visual
203	Marking misleading or unidentifiable		0.65%	3.2	Visual
204	Hardware incorrectly engaged		0.65%	3.2	Visual
205	Evidence of poor workmanship		1.00%	3.7	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

*4.4.3.1 Fuze body (see 3.3). - Critical Defect. - Each fuze body after consolidation of the delay column shall be examined as specified in 4.5.1 for evidence of a crack or porosity. Any fuze body that fails to comply with the requirement shall be classed defective and removed from the lot.

*4.4.3.2 Functioning (see 3.4). - The fuzes shall be observed for any failure to comply with the requirements as classified in Table II when tested as specified in 4.5.2, using equipment in accordance with 4.4.4.

TABLE II

Defect		Classification
Premature delay failure	(see 3.4.1)	Critical
Excessive delay failure	(see 3.4.3)	Critical
"Hung" striker failure	(see 3.4)	Critical
Normal delay failure	(see 3.4.2)	Major
Dud or low order	(see 3.4)	Major

*4.4.3.2.1 Beginning with the first lot produced and continuing until three consecutive lots have complied with the acceptance criteria specified, a sample of 800 fuze assemblies shall be taken from each lot and divided into two equally sized groups. One group shall be subjected to the static functioning test as specified in 4.5.2.1 and the other group to the dynamic functioning test as specified in 4.5.2.2. The lot shall be rejected if any of the following test results occur:

a. A critical defective is found (see Table II).
b. If four (4) or more fuzes dud or function low order (see 6.8).
c. If six (6) or more normal delay failures occur in either group, or if the combined number of normal delay failures in both groups equals or exceeds ten (10).

*4.4.3.2.2 After three consecutive lots have met the criteria of 4.4.3.2.1 and lot quantitites are less than seventy-five thousand (75,000), five hundred (500) assemblies shall be selected from each lot for static and dynamic tests using two hundred fifty (250) assemblies for each test phase.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

The lot shall be rejected if any of the following test results occur.

a. A critical defect is found (see Table II)
b. Four (4) or more fuzes dud or function low order.
c. Five (5) or more normal delay failures occur in either group or the combined number of normal delay failures in both groups equals or exceeds eight (8).

After three consecutive lots have met the criteria of 4.4.3.2.1 and lot quantities are 75,000 or greater, eight hundred (800) assemblies shall be selected from each lot for static and dynamic tests using four hundred (400) assemblies for each test phase. The lot shall be rejected if any of the following test results occur:

a. A critical defect is found (see Table II). .
b. Six (6) or more fuzes dud or function low order.
c. Seven (7) or more normal delay failures occur in either group or the combined number of normal delay failures equals or exceeds thirteen (13).

*4.4.3.3 Embrittlement (see 3.5). - Major defect - The sampling plan for this test shall be in accordance with MIL-STD-105 using Code Letter G and an AQL of 0.40 percent. The sample springs shall be selected from each lot and tested as specified in 4.5.3 using equipment in accordance with 4.4.4 (Destructive test).

*4.4.3.4 Spring torque

*4.4.3.4.1 Spring torque under load (see dwg. 7548585) - Major Defect. - A sample of fifty (50) springs shall be selected from each spring lot for test. If two (2) or more springs fail to comply with the requirement, the lot shall be rejected. The test shall be as specified in 4.5.4., using equipment in accordance with 4.4.4.

*4.4.3.4.2 Spring torque after assembly (see dwg. 7548585) - Major Defect. - This test shall be performed with the spring sample that has complied with 4.4.3.4.1. If a defective spring was found during the 4.4.3.4.1 test, it shall be replaced prior to performing this test. If two (2) or more springs fail to comply with the requirement, the lot shall be rejected. The test shall be performed as specified in 4.5.4 using equipment in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

*4.4.3.5 Automatic inspection of delay column (see dwg. 7548570)

TABLE III

Characteristics	Classification
Delay column missing, less than 0.7 inch in height, or inadequately consolidated	Critical
Detonator charge missing or inadequate	Major

This inspection shall be conducted 100 percent using the specified automatic radioisotopic inspection equipment as per dwg. 9278658 to assure that the fuze assembly does not contain the defects listed in Table III. The inspection shall be performed in accordance with the procedures specified in 4.5.5 (see 6.9). Fuzes rejected by the equipment may be re-inspected one time. Fuzes which are not accepted by the equipment on re-inspection shall be classed defective and removed from the lot.

*4.4.3.5.1 Verification inspection of delay column (see dwg. 9235210). - A sample of three-hundred (300) fuze assemblies shall be selected from each four hours of production and subjected to reinspection with the automatic radioisotopic inspection equipment for the defect listed in 4.4.3.5, Table III. The sample fuzes shall be selected from production just prior to insertion into the packing container. If any fuzes are found to be defective, all production represented by the sample shall be rejected.

4.4.3.6 Safety pin withdrawal (see dwg. 7548570) - Major defects.

4.4.3.6.1 Lower limit.

*4.4.3.6.1.1 Beginning with the first lot produced and continuing until three consecutive lots have complied with the acceptance criteria specified, the sampling plan for this test shall be in accordance with MIL-STD-1235, CSP-1 and an AQL of 0.25 percent, wherein i = 790 and F = 1/100. Any fuze assembly with a safety pin that is withdrawn with a pull force less than specified shall be classed defective and removed from the lot. The test shall be as specified in 4.5.6 using equipment in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

*4.4.3.6.1.2 After three consecutive lots have met the criteria of 4.4.3.6.1.1, the sampling plan for this test shall be in accordance with MIL-STD-1235, CSP-1 and AQL of 0.40 percent, wherein i = 500 and F= 1/100. Any fuze assembly with a safety pin that fails to comply with the requirements shall be classed defective and removed from the lot. The test procedures and equipment shall be as specified in 4.5.6.

*4.4.3.6.2 Upper limit. - (Pins subjected to this test shall not be returned to the lot).

*4.4.3.6.2.1 Beginning with the first lot produced and continuing until three consecutive lots have complied with the acceptance criteria specified, the sampling plan for this test shall be in accordance with MIL-STD-105 using code letter M and an AQL of 2.50 percent. Any fuze assembly that fails to withdraw when the specified force is applied, shall be classed defective and removed from the lot. The test shall be performed as specified in 4.5.6 using equipment in accordance with 4.4.4.

*4.4.3.6.2.2 After three consecutive lots have complied with the criteria of 4.4.3.6.2.1, the sampling plan for this test shall be in accordance with MIL-STD-105 using Code Letter K and an AQL of 2.50 percent. Any fuze assembly with a safety pin that fails to comply with the requirement shall be classed defective and removed from the lot. The test procedure and equipment shall be as specified in 4.5.6.

*4.4.3.7 Primer Holder Assembly Push out Resistance (see dwg. 7548570) - Major Defect - A sample of 100 fuzes with primer holder assemblies and delay columns, but less igniter case or detonator assemblies and striker assemblies, shall be selected at random from each lot for this test. The lot shall be rejected if two or more primer holder assemblies are pushed out with a force of less than specified or if the pushout force sample average fails to comply with the requirement. The test shall be performed as specified in 4.5.7 using test equipment specified in 4.4.4 (Destructive Test).

*4.4.3.8 Security of primer and primer holder after environmental tests (see dwg. 7548570) - Major Defect. - A sample of 50 fuzes less detonators shall be selected at random from each lot. The test shall be performed as specified in 4.5.8 using test equipment as specified in 4.4.4. The lot shall be rejected if any of the following

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

test results occur:

a. A critical defect is found (see Table II)
b. One (1) or more fuzes dud or function low order
c. Two (2) or more normal delay failures occur
d. One (1) or more fuzes fail to comply with the drawing requirement specified.

*4.4.3.9 Heat seal test of sealed bag (see dwg.8848621) - Major Defect. - Sampling and rejection shall be in accordance with MIL-P-116. The test shall be performed as specified in 4.5.9.

*4.4.3.10 Check test for deterioration of primer (see MIL-P-20444) - Major Defect. - If the total time between original acceptance of any lot and the assembly of that lot into the fuze exceeds two years, or if the primers have been subjected to adverse conditions, however brief, at any time since previous test, the primer lot shall be subjected to and must satisfactorily pass, the check test for deterioration specified in MIL-P-20444 immediately before the primer lot is assembled into the fuze. This test shall be performed by the contractor on primers selected by the Government Inspector at the facility assembling the primers into the fuze (see 6.5).

*4.4.3.11 Delay composition

*4.4.3.11.1 Consolidation of delay column (see 3.6.1 and dwg. 7548570) - Major Defect. - The contractor shall provide and maintain adequate controls to assure uniformity of delay column consolidation as specified. At the start of every shift and immediately upon restarting any loading machine after a shut down period for a repair or adjustment, each loading machine shall be qualified prior to use in production by observing a sample run of 25 fuzes for compliance with requirements. Consolidation pressures for each increment shall be recorded. Further, a sample of 10 consecutive fuzes from each machine shall be observed and the consolidation pressures recorded at least once every two (2) hours of production. In the event the observed consolidation pressure for any fuze fails to comply with the applicable requirement, the portion of production since the last control check was made shall be rejected, and the loading machine shall be repaired or adjusted and shall be requalified prior to use in production. Fuzes which are rejected by the loading machine for non-compliance

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

with the minimum delay column height shall be re-examined to determine the actual height of the delay column. Fuzes which are found to have a delay column height of less than seven-tenth (0.7) of an inch shall be reported as critical defects and corrective action shall be taken to prevent recurrence.

*4.4.3.11.2 Contamination control (see 3.6.2) Major Defect. - The contractor shall provide adequate controls to prevent contaminants of any kind from getting into the delay composition. Machinery, environments and operations utilized to load or otherwise handle delay composition shall be visually inspected at least once every two hours of operation to determine that the delay composition does not contain or is not likely to contain lubricating oil, hydraulic oil or other contaminants. Any evidence of contamination which is found in the delay composition shall cause rejection of all production since the last previous inspection. If any evidence is found of conditions that have caused or are likely to cause contamination of the delay composition, such conditions shall be corrected before production may continue.

*4.4.3.11.3 Adherence of delay composition (see 3.6.3) Major Defect. - The contractor shall provide adequate controls to prevent delay composition from adhering to the processing equipment which includes mixing and loading machines including tubing and ancillary devices. Such equipment shall be cleaned at least once every four (4) hours of operation to prevent adherence of delay composition. Any evidence of delay composition adhering to the feeding devices shall cause rejection of all production until the equipment is cleaned to the satisfaction of the Government.

*4.4.3.12 Moisture Content of Black Powder (see dwg. 7548575) Major Defect - The contractor shall provide adequate controls to assure compliance with the requirements and shall test for verification a minimum of one sample of black powder selected at the loading station at the time of loading from each eight hours production of igniter case assemblies. A composite sample shall not be used. Failure of the sample to comply with the requirement shall cause the black powder represented by the sample, including any igniter case assemblies loaded with the non-conforming powder to be rejected. The contractor shall maintain adequate records to provide identification of the powder used in the loaded ingiter case assemblies. Test shall be performed as specified in 4.5.10 using equipment in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

*4.4.3.13 Salt-spray test of component parts - Major Defect. - Each lot of the following component parts shall be subjected to salt-spray testing to determine compliance with the applicable drawing requirements. Sampling, acceptance and rejection criteria, and testing procedures shall be in accordance with the applicable coating or plating specification. (Destructive Test)

Component

Spring (dwg. 7548585)
Pull ring assembly (dwg. 7548577)
Striker assembly (dwg. 7548578)
Pin, hinge (dwg. 7548579)
Lever (dwgs. 7548587, 7548588 or 8836380)

*4.4.4 Inspection equipment. - The inspection equipment required to perform the inspections and tests prescribed in this specification is identified in the 'Paragraph Reference/ Inspection Method' column in the tables starting with paragraph 4.4.2.1, and the test method paragraphs (see 4.5). The contractor shall submit for approval, inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and section 6.3 herein.

4.5 Test methods and procedures.

4.5.1 Fuze body. - The fuze body after the delay column is consolidated shall be visually examined with four power magnification to determine compliance with the requirement.

4.5.2 Functioning and delay time. - The fuzes shall be immersed in water maintained at a temperature of seventy (70) degrees Fahrenheit (F.) plus or minus ten (10) degrees Fahrenheit (F.) for a period of twenty-five (25) plus or minus five (5) minutes. The water shall contain a wetting agent. The fuzes shall be positioned vertically with the top of the fuze approximately six (6) inches below the surface of the water. After removal from the water, the fuzes shall be maintained at a temperature of seventy (70) degrees F. plus or minus ten (10) degrees F. and tested within fifteen (15) minutes by each of the following methods:

*4.5.2.1 Static. - The fuze assembly shall be assembled to the fuze holder, 9200887, and this assembly shall be assembled in the approved fixture. The safety pin shall be pulled and the

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

fuze allowed to function. The functioning order and the recorded delay time shall be observed to determine compliance with the requirements.

4.5.2.2 Dynamic. - The fuze assembly shall be assembled to the fuze holder, 9200887 and this assembly shall be assembled in a fixture as per dwg. 9200888. The safety pin shall be pulled out and the fuze released to fall four (4) feet to impact on a two (2) inch minimum thick steel plate placed with the impact surface perpendicular to the drop axis. The functioning order and delay time shall be observed to determine compliance with the requirements.

4.5.3 Spring embrittlement. - The spring shall be pulled to the minimum point of permanent distortion by any approved method. Springs so tested shall be scrapped.

*4.5.4 Spring torque under load and after assembly. - The sample springs shall be individually identified and the torque determined and recorded for the specified angular displacement. Observation shall be made for compliance with the applicable drawing requirement. The springs, including any replacement spring shall then be assembled for twenty-four (24) hours min, then removed from the test fixture and the torque retested to determine possible torque loss.

*4.5.5 Automatic inspection of delay column. - The automatic radioisotopic inspection equipment, its operation, calibration, and maintenance shall be in accordance with dwg. 9278658. As a minimum, the inspection equipment shall be checked at each inspection station with the specially designated accept-reject standards, for each hour of production, immediately after each down period, and prior to starting daily production. In addition, whenever a power failure occurs the criteria for calibrating and stabilizing the inspection equipment shall be in accordance with dwg. 9278658. If, at any time the testing operation is found to be improper, the testing device shall be declared inoperative until repaired and all assemblies tested since the last satisfactory check shall be rejected subject to retest. Whenever a defective assembly is found, positive action shall be taken to determine the specific cause of the defect and corrective measures instituted to prevent recurrence. The action taken shall be stated on the Critical Defect Report. The Government representative will examine the testing device, test method, records of inspection and handling, and identification of material undergoing test at regular but unscheduled

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

intervals to determine that the test is being carried out in accordance with these provisons. The inspection equipment shall be in accordance with drawing 9278658.

*4.5.6 Safety pin withdrawal (upper and lower limits). - The fuze assembly shall be assembled in a fixture, and the required withdrawal force applied to the safety pin.

4.5.7 Primer holder assembly push out resistance. - The sample fuze bodies shall be cut at the intersection of the bouchon and the threaded portion of the fuze body and the delay cavity hole reamed to 5/16 inch diameter, min. The bouchon shall be placed in a holding fixture and a punch inserted through the delay cavity hole to make contact with the primer holder assembly. A force shall be applied at a rate not to exceed 1/4 inch per minute until the primer holder assembly shows evidence of moving. The force required to move the primer holder assembly shall be recorded to determine compliance with the applicable requirement.

*4.5.8 Security of primer and primer holder after environmental tests. - Prior to performing any test, the sample fuzes shall have the lever, hinge pin, striker assembly, and spring removed. Care shall be exercised to prevent accidental firing of the primer. In the event a primer is accidentally fired, the fired sample shall be replaced. A maximum of seven sample fuzes may be tested in one jumble box providing adequate protection is provided to prevent primer firing or damage to the sample fuze. Upon completion of all tests, the fuze samples shall be completely reassembled with those parts previously removed together with a detonator assembly, and then be functioned in accordance with 4.5.2.2. All functioning times shall be recorded and made a part of the inspection record.

4.5.9 Heat seal test of sealed bag. - This test shall be performed as specified in MIL-P-116.

4.5.10 Moisture content of black powder. - The moisture content of the black powder shall be determined in accordance with the procedure specified in MIL-P-223.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging

5.1.1 Level A. - The fuzes shall be preserved and packaged in accordance with dwg. 8848621.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

5.1.2 Level C. - The fuzes shall be preserved and packaged as specified in 5.1.1.

5.2 Packing

5.2.1 Level A. - The cartons shall be packed in accordance with dwg. 8848622.

5.2.2 Level C. - The cartons shall be packed as specified in 5.2.1.

5.3 Marking. - Marking shall be in accordance with dwg. 8848621 and 8848622.

6. NOTES

*6.1 Intended use. - The M204A2 fuze is intended for use with the M61 grenade; the M205A2 fuze is intended for use with the M62 practice grenade and the M206A2 fuze is intended for use with the MK3A2 grenade.

*6.2 Ordering data. - Procurement documents shall specify the following:

a. Title, number and date of this specification.
b. Provisions for submission of first article samples.
c. Provisions of MIL-A-48078.
d. Prior to shipment of any HE fuzes directly into field service stocks, or loading of any HE fuzes into grenades, provisions shall be made to have 100 percent radiographic inspection conducted at a GOGO or GOCO facility as determined by the Government. This inspection shall be in addition to the inspection requirements of this specification and is to be performed in accordance with procedures and criteria to be furnished by the technical agency.

*6.3 Submission of inspection equipment designs for approval (See MIL-A-48078). - Submit equipment designs as required, to Commander: Picatinny Arsenal, ATTN: SARPA-QA-T-T, Dover, New Jersey 07801.

*6.4 Distribution of ammunition data cards. - Distribution of data cards shall include the following: Commander, Picatinny Arsenal, ATTN: SARPA-QA-A-M, Dover, New Jersey 07801.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

6.5 Cost of check test. - The contracting officer will arrange for the contractor to be reimbursed for the expense incurred in the performance of the check test for deterioration of the primer assemblies. The tests shall be conducted at Government expense without cost to the contractor assembling the primer assemblies into the fuze; and shall not constitute a basis for rejection against either contractor except where deterioration has occurred as a direct result of carelessness in handling, storage, etc., permitted while the primer assembly lot was under the jurisdiction of either contractor.

6.6 Dud. - A dud is defined as a fuze failure caused by non-initiation of the primer assembly when impacted by the striker assembly on the first attempt.

*6.7 "Hung" striker. - A hung striker is defined as a striker assembly that fails to rotate and impact the primer assembly due to a burr (including flash) or other cause which results in sufficient restraint to prevent rotation of the striker assembly upon release of the lever.

*6.8 High and low order functioning. - High order functions are characterized by a complete and instantaneous explosion accompanied by a loud sharp report. Low order functions are characterized by an abnormally low level of explosive sound.

6.9 The automatic equipment designated for the delay column inspection is specifically designed to positively screen out fuzes with delay columns less than 0.7 inch in height or delay columns which have not been consolidated at the required minimum pressure. Fuzes with properly consolidated delay columns having the required height of 0.8 inch, minimum, will be accepted. The equipment may occasionally accept fuzes with delay columns between 0.7 inch and 0.8 inch depending on the specific combination of column length and column density contained in a particular fuze.

6.10 Asterisks. - The margins of this specification are marked with an asterisk to indicate where changes (addition, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

Custodian:
Army-PA

Preparing Activity:
Army-PA

Project Number: 1330-A-090

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD, FORM 1 JAN 72 1426

REPLACES EDITION OF 1 JAN 68 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T00:31Z
Check the source to verify that this is the current version before use.