MIL-H-43088E
26 December 1984
SUPERSEDING
MIL-H-43088D(GL)
18 March 1977

MILITARY SPECIFICATION

HOOD, ROCKET FUEL HANDLER'S: IMPERMEABLE, FULL PROTECTION

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This document covers a one type and size one piece hood to be worn over the Mask, Gas, Rocket Propellant M21 to provide protection against fuels and oxidizers. The hood is used in conjunction with the Coverall, Rocket Fuel Handler's, Impermeable, Full Protection.

2. APPLICABLE DOCUMENTS

* 2.1 Government documents. Unless otherwise specified, the following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this document to the extent specified herein:

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: U.S. Army Natick Research and Development Center, Natick, MA 01760-5014 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8415

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

O-C-105	-	Calcium Chloride, Dihydrate and Calcium Chloride, Anhydrous: Technical
DDD-L-20	-	Label: For Clothing, Equipage and Tentage (General Use)
PPP-B-636	-	Boxes, Shipping, Fiberboard
PPP-T-45	-	Tape, Gummed, Paper, Reinforced and Plain, for Sealing and Securing

MILITARY

MIL-L-396	-	Laces, Leggings
MIL-F-495	-	Finish, Chemical, Black, for Copper Alloys
MIL-T-5624	-	Turbine Fuel, Aviation, Grades JP-4 and JP-5
MIL-P-7254	-	Propellant, Nitric Acid
MIL-F-10884	-	Fasteners, Snap
MIL-C-43062	-	Cloth, Coated, Nylon, Resin Modified Butyl-Coated Acid and Fuel Resistant
MIL-P-51493	-	Paper, Chemical Agents Detector, M9

STANDARDS

FEDERAL

FED-STD-191	-	Textile Test Methods
FED-STD-406	-	Plastics: Methods of Testing
FED-STD-601	-	Rubber: Sampling and Testing

MILITARY

MIL-STD-105	-	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	-	Marking for Shipment and Storage
MIL-STD-147	-	Palletized Unit Loads

DRAWINGS

U.S. ARMY NATICK RESEARCH AND DEVELOPMENT CENTER

8-1-3	-	Jig, Acid Testing, No. 2

(Copies of documents required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

OTHER GOVERNMENT DOCUMENTS

JOINT COMMITTEE ON PRINTING (JCP) PUBLICATIONS

JCP-F-10-Manifold Paper, White and Colored

(Copies may be obtained from the Superintendent of Documents, US Government Printing Office, Washington, D.C. 20402.)

* 2.2 Other publications. Unless otherwise specified, the following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this document to the extent specified herein.

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

D 3951 - Standard Practice for Commercial Packaging

(Application for copies should be addressed to the American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103.)

(Technical society and technical association documents are generally available for reference from libraries. They are also distributed among technical groups and using Federal agencies.)

* 2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document shall take precedence.

3. REQUIREMENTS

3.1 Guide samples. Samples, when furnished, are solely for guidance and information to the contractor (see 6.3). Variation from the document may appear in the sample in which case the document shall govern.

3.2 First article. When specified, a sample shall be subjected to first article inspection (see 4.3, 6.2, and 6.4).

* 3.3 Materials and components (see 6.5).

* 3.3.1 Basic material. The basic material shall be resin-modified butyl coated nylon, acid and fuel resistant, conforming to MIL-C-43062.

3.3.2 Strapping. The gum strapping used to seal the seams shall be made from an unsupported film of the uncured coating compound used to coat the fabric. The gum strapping shall be 0.012 to 0.025 inch thick and thoroughly cleaned before application (see 4.4.1). The gum strapping for seams shall be 3/4 ± 1/8 inch wide.

3.3.3 Cement. The cement used to seal the seams and the strapping over the seams shall be a curing modified butyl base cement and shall meet the performance requirements specified in 3.3.10. The color of the cement, when dry shall approximate that of the coated fabric otherwise a clear cement shall be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

3.3.4 Loops and straps. The loops and straps shall be made from the basic coated fabric specified in 3.3.1, 1-3/8 ± 1/16 inches wide, cut to proper length. The straps and loops shall be coated on the lightly coated side with cement specified in 3.3.3, folded evenly lengthwise, and rolled to insure good adhesion.

3.3.5 Braid. The braid for snout and eye-pieces shall be made from laces conforming to MIL-L-396, except that color, colorfastness and tipping requirements shall not apply. The braid for the snout shall be 20 ± 1 inches long and for the eye-pieces shall be 11-1/2 ± 1/2 inches long. The braid (laces) shall be thoroughly impregnated with a solution of the coating compound and vulcanized during assembly.

* 3.3.6 Labels. Each hood shall have a combination identification and instruction label conforming to type IV, class 15 of DDD-L-20. The marking medium shall be white, yellow, or light grey. The instruction label shall be placed below the identification label. The label may be marked on a piece of the uncured fabric specified in 3.3.1, then cemented on the hood and cured with the hood after assembly. The printed label shall be well defined and clearly legible after being tested for crocking, both wet and dry when tested as specified in 4.4.6. The format and contents of the instructions shall be as follows:

INSTRUCTION FOR USE

1. Wear for protection against injury from dangerous liquid fuels and oxidizers.
2. DO NOT USE the same hood for fuels and oxidizers without washing the hood between usage.
3. Always wear hood with the proper breathing apparatus - NEVER ALONE.
4. Always keep adjustment straps snug and properly adjusted.

3.3.7 Snap fasteners. Snap fastener shall consist of a size 1 or 2, 24 line size button with socket for the female half and a size 1 or 2 eyelet with stud for the male half conforming to style 2, finish 2 of MIL-F-10884.

3.3.8 Slides. The slides for adjustment straps shall be 3/4 inch (similar to North and Judd #02300), conforming to commercial standards made from commercial brass, 14 or 16 gage, American Standard, with a black chemical finish conforming to requirements of MIL-F-495 (see 4.4.1.1).

3.3.9 Dusting powder. The dusting powder shall be whiting, talc or other finely divided mineral material which does not support mildew growth (see 4.4.1.1).

3.3.10 Performance. The completed hood shall meet the following requirements after vulcanizing as specified in operation 11, table II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

3.3.10.1 Fuel resistance. The completed seams and surrounding area shall show no evidence of cracking, stiffening, flaking, swelling, separation of the strapping from the seam, separation of the coating from the fabric, or surface tack rating greater than II, when tested as specified in 4.4.6.

3.3.10.2 Acid resistance. The completed seams and surrounding area shall show no penetration as indicated by change of color of the detector paper and no evidence of cracking, stiffening, flaking, separation of the strapping from the seam, separation of the coating from the fabric, or surface tack rating greater than II when tested as specified in 4.4.6 (see 6.6).

3.3.10.3 Seam and seam strapping adhesion. Adhesion of the seam and seam strapping for all seams shall conform to requirements of table I when tested as specified in 4.4.6.

TABLE I. Requirements for seam and seam strapping adhesion

Test	Minimum requirement
Seam gum strapping adhesion.	3.5 lbs/inch
Seam gum strapping adhesion after immersion.	3.0 lbs/inch
Seam gum strapping after heat aging.	3.0 lbs/inch
Cemented seam adhesion.	3.5 lbs/inch
Cemented seam adhesion after immersion.	3.0 lbs/inch
Cemented seam adhesion after heat aging.	3.0 lbs/inch
Resistance to cold crack of finished cemented and strapped seam.	1/
Seam hydrostatic resistance of finished cemented and strapped seam.	70 psi

1/ The seam shall show no signs of cracking, flaking, separation, stiffening, delamination, or tackiness after test has been performed.

3.4 Design. The design of the hood shall be as shown in figure 1. The hood shall be constructed and assembled with the heavily coated side of the cloth facing to the outside.

3.5 Patterns. Standard patterns which provide the proper allowance for all seams will be furnished by the Government to the contractor for cutting the working patterns. The Government patterns shall not be altered in any way and are to be used as a guide for cutting contractors working patterns. The working patterns shall be identical to the Government patterns.

* 3.5.1 List of pattern parts. The hood shall be cut from material as specified in accordance with the pattern parts indicated.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

Material	Nomenclature of parts	Cut parts
Cloth, coated, nylon resin modified, butyl coated, acid and fuel resistant	Right front	1
	Left front	1
	Back part	2
	Snout piece	1
	Exhaust outlet shield	1
	Exhaust outlet reinforcement	2
	Adjustment strap reinforcement piece	2
	Snout loop reinforcement piece	2
	Snout loop	2
	Adjustment strap	2
	Adjustment strap socket tab	2

3.6 Construction. The construction shall conform to table II and as specified herein.

3.6.1 Strapping of seams. All seams on the outer surface of the hood shall be sealed with the strapping specified in 3.3.2. After seam has been cemented, the strapping shall be centered and cemented over the raw edge of the seam on the outer surface of the hood.

3.6.2 Setting of snap fasteners. A hole shall be prepunched to receive the button and eyelet components of the snap fasteners. The hole shall be smaller than the outside diameter of the button and eyelet barrels so that the barrel must be forced through the hole. The hole shall not be punched in the setting operation with the button or eyelet barrel. The fasteners shall be securely clinched without cutting the adjacent materials and no more than two splits shall occur in the button or eyelet barrel.

3.6.3 Repairs in coating on finished hood. Areas containing coating defects may be repaired by application of a round patch 1-1/2 ± 1/4 inches in diameter using the strapping and flap reinforcement gum strapping specified in 3.3.2 and the cement specified in 3.3.3 applied and cured as specified for the sealed seams in operation 11, table II. The finished patch shall meet the fuel and acid resistance requirements specified in 3.3.10.1 and 3.3.10.2 respectively. The patch shall be cemented to the hood and the patch shall extend a minimum of 1/2 inch beyond all edges of the damaged area. The patch shall be smoothly and evenly adhered over its entire area, and shall be well adhered to the coated

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

cloth so that, when subjected to flexing action between hands, will show no lifting of the edge, and no cracking, flaking or removal of the cement or patch. The repaired area shall show no stiffening or tackiness which would affect the serviceability. Repairing of fabric coating defects by methods other than patching are not authorized.

3.6.3.1 Location and number of repairs. Patches not exceeding six in number may be made to each hood, provided not more than two patches are made on any one of the four major pattern parts of the hood.

3.7 Manufacturing operations requirements. The hood shall be manufactured in accordance with operation requirements specified in table II. The contractor is not required to follow the exact sequence of operations.

TABLE II. Manufacturing operations requirements

1. Cutting.

a. Cut the material for the hood in strict accordance with patterns furnished which show notches for proper assembling of all parts.

b. Cut each part from one piece of material. The front and back parts of the hood shall be cut in the length direction of the material.

c. Cut the butyl rubber coated cloth so that the heavier coated side of the fabric shall form the outer surface of the hood.

d. Cut the braid for snout 20 ± 1 inches in length and for the eye-pieces, 11-1/2 ± 1/2 inches.

2. Replacement of damaged parts.

a. Replace at time of cutting, any part containing a hole, cut, abraded area, tear, rip, area without coating, brittle area which when bent results in a crack, imbedded foreign material which when removed, leaves exposed basic fabric or a through hole.

b. Replace any part damaged during the manufacturing process, such as a cut, tear, hole, mend, or drill hole.

3. Make loops and straps.

a. Fold raw edges of cut pieces for loops and straps to center, lengthwise, overlapping one ply on the other, not less than 1/16 inch and cement all plies together.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

TABLE II. Manufacturing operations requirements (cont'd)

3. Make loops and straps. (cont'd)

b. The finished straps and loops shall measure as follows: two each:

(1) Adjustment strap; 26 ± 1/8 inches by 11/16 ± 1/16 inches.
(2) Attachment straps; 4-1/2 ± 1/8 inches by 11/16 ± 1/16 inches.
(3) Snout loops; 2 ± 1/8 inches by 3/8 ± 1/16 inches.

4. Make snout.

a. Cement and overlap the seams 1/2 ± 1/8 inch, cement the overlapped seam, and strap the outside with gum strapping centered on raw edge of seams.

b. Hem end of snout by turning the edge under 1/2 ± 1/8 inch and cement to snout.

c. Insert snout loops through cut opening in reinforcement patches with the ends spread open and cement in position. The loops shall protrude to the outside not less than 1/2 inch.

d. Cement the two reinforcement patches with loops to snout as indicated by marks on pattern.

5. Assemble hood parts.

a. In assembling the hood parts, overlap the seams 1/2 ± 1/8 inch (unless otherwise indicated), cement and completely strap on the outside with gum strapping centered (unless otherwise indicated) on raw edge of seam.

b. Overlap back parts of hood, cement and strap.

c. Overlap front parts of hood from top to exhaust outlet; cement and strap.

d. Overlap front parts of hood from exhaust outlet to bottom edge, cement and strap.

e. Overlap snout to front side opening not less than 1/4 inch, cement and strap. The strapping may be off center of raw edge of seam so it will not interfere with eyeholes.

f. Cement exhaust outlet reinforcement piece around exhaust outlet on inside of hood.

g. Hem bottom of exhaust outlet shield by turning the edge under 3/8 ± 1/8 inch as indicated by marks on pattern, and cement to shield.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

TABLE II. Manufacturing operations requirements (cont'd)

5. Assemble hood parts. (cont'd)

h. Attach exhaust outlet shield to front, positioned as indicated by marks on pattern; cement to hood. Lap of exhaust outlet attaching shield to hood shall be not less than 1/4 inch.

i. Join front and back parts of hood at top and sides by overlapping the seams; cement and strap.

j. Hem bottom of hood by turning the edge 3/8 ± 1/8 inch and cement to hood.

k. Cement a 3/4 ± 1/16 inch by 3/4 inch ± 1/16 inch circular or oblong stay piece of the coated fabric at bottom edge of hood, as indicated by marks on pattern to reinforce stud parts of snap fastener.

6. Attach shoulder and slide straps.

a. Position free end of the shoulder strap 1 ± 1/8 inch under a reinforcement patch and cement to inside of hood at each side of back as indicated by patterns.

b. Thread free end of strap over the center bar of slide, with the end, in turn, threaded through the top opening of a second slide and drawn under the center bar of the first slide under the strap with the free end inserted between the straps 1 ± 1/8 inch and cement on itself.

c. Thread the attachment end of strap through bottom opening of the second slide, with ends even; cement the top and bottom plies of the strap together.

7. Attach snap fasteners.

a. Attach female snap fastener on each attachment strap with button component on outside surface and with center of fastener located 5/8 ± 1/8 inch from end of strap.

b. Attach male snap fastener at bottom front of hood on each side, in location indicated on pattern, through hood and reinforcement piece with stud components of fasteners on outside surface of hood (see operation 5k.).

8. Attach label.

Stamp or cement the label on the inside back of hood to the right of center back seam, not less than 1 inch from bottom edge.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

TABLE II. Manufacturing operations requirements (cont'd)

9. Reinforce eye openings.

a. Cement braid to inside around eye openings by rolling the edges of openings 3/16 to 1/4 inch completely covering braid. The ends of braid shall overlap at top of opening. Any required slashing of seam allowance shall be held to a minimum and shall not be exposed on outside.

b. Cement eyetabs to inside of hood over ends of braid.

c. The eye openings shall finish not more than 2-5/8 inches high (at center) and 2-7/8 inches wide across top (widest dimension).

10. Attach snout drawcord and check hood.

a. Insert snout braid through loops.

b. Check all outside seams for security of strapping and seam coverage.

11. Dust and vulcanize hood. The hood shall be dusted with an inert dusting powder as specified in 3.3.9 and then shall be vulcanized.

3.8 Finished measurements. The finished measurements for the hood shall conform to table III.

TABLE III. Finished measurements (inches)

		Tolerance
Length of snout 1/	6-1/2	± 1/2
Front length 2/	14	± 3/4
Back length 3/	23-1/2	± 3/4
1/2 Bottom width 4/	25-1/2	± 3/4

1/ Measure from lapped edge to bottom edge of snout.

2/ Measure from edge of exhaust opening to bottom of hood along front joining seam.

3/ Measure from lapped edge of crown joining seam to bottom of hood along back joining seam.

4/ Measure along bottom edge, with the hood laid flat, from folded edge to folded edge.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

3.9 Workmanship. The finished hood shall conform to the quality of product established by this document. The occurrence of defects shall not exceed the applicable acceptable quality levels.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the document where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Certificate of compliance. When certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.3).
b. Quality conformance inspection (see 4.4).

4.3 First article inspection. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.4.3 and 4.4.4. The presence of any defect shall be cause for rejection of the first article.

4.4 Quality conformance inspection. Unless otherwise specified, sampling for inspection shall be in accordance with MIL-STD-105.

4.4.1 Component and material inspection. In accordance with 4.1, components and materials shall be inspected in accordance with all the requirements of referenced documents unless otherwise excluded, amended, modified, or qualified in this document or applicable purchase document.

4.4.1.1 Certification. The contractor shall furnish, to the contracting officer, a certificate of compliance stating that the gum strapping conforms to the requirements of 3.3.2, that the slide conforms to the requirements of 3.3.8, and that the dusting powder conforms to the requirements of 3.3.9.

4.4.2 In-process inspection. Inspection of the hood and its components shall be made during the manufacturing operations to ascertain that construction details which can not be examined on the finished product are in accordance with

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

specified requirements. The in-process inspection shall include inspection of working patterns to assure that they conform to the standard patterns, inspection of the cut parts covered by patterns to ascertain that the parts are cut properly with respect to size and that the diameter of the holes for the snap fasteners is smaller than the outside diameter of the button and eyelet barrels. Whenever nonconformance is noted, corrections shall be made to the components affected and lot in-process. Parts which can not be corrected shall be removed from production.

* 4.4.3 End item visual examination. The end item shall be examined for the defects listed below. The lot size shall be expressed in units of one hood. The sample unit shall be one hood. The inspection level shall be II and the acceptable quality level (AQL), expressed in terms of defects per hundred units, shall be 2.5 for major defects and 15.0 for total (major and minor combined) defects. The finding of one or more critical defects shall be cause for rejection of the lot.

Defects	Classification		
	Critical	Major	Minor
Finish (applicable to all components)			
Not as specified.			X
Cleanness			
a. Not clean (excessive adhesive adjacent to edge of seams not applicable).			X
b. Any spot, stain, or foreign matter, clearly noticeable.			X
Material (general)			
Any component not fabricated of the specified material.		X	
Coated fabric			
a. Hole, cut, abraded area, tear, or rip through material or exposing base fabric.	X		
b. Area of no coating.	X		
c. Blister, tunnel, or delamination of coating.	X		
d. Brittle area which when bent results in a crack.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

Defects	Classification Critical	Major	Minor
Coated fabric (cont'd)			
(NOTE: If any of the above four conditions occur on a reinforcement patch, hem, or adjustment strap, it shall be classified as a minor defect).			
e. Area of excessive coating, i.e., solid runs, ridges or lumps.			X
f. Patches or repairs in basic material:			
(1) Patch diameter less than 1-1/4 inches.		X	
(2) Patch diameter greater than 1-3/4 inches.			X
(3) More than two patches per pattern part.			X
(4) More than six patches per hood.		X	
(5) Edge of patch lifting, cracking, flaking or removal of the cement or patch when hand flexed as specified in 3.6.3.	X		
(6) Patch not smoothly and evenly adhered.		X	
(7) Patch area excessively stiff or tacky affecting serviceability.	X		
(8) Patch extends less than 1/2 inch beyond all edges of damaged area.		X	
(9) Any unauthorized repair, i.e., cement applied to defect on fabric coating in lieu of patching.		X	
g. Pit or abraded area but not through material or not to a degree where base fabric is exposed.			X
h. Tacky, i.e., improper vulcanization.		X	
i. Imbedded foreign material which when removed will expose base fabric or leave a through hole.	X		
j. Foreign material which cannot be readily removed or if removable, does not expose base fabric.		X	
NOTE: A pick glass may be used to determine the degree of the deficiency.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

Defects	Classification Critical	Major	Minor
Construction and workmanship (general)			
a. Any component omitted.		X	
b. Any component damaged, not as specified, or otherwise defective.		X	
c. Heavy coated side not on exterior of hood.	X		
d. Any component misplaced, not serving intended purpose.	X		
e. Any part twisted or distorted.		X	
f. Any component insecurely attached or affixed.	X		
g. Any exposed drill hole.	X		
h. Any part not cut in accordance with directional lines on patterns.		X	
i. Not dusted with powder.			X
Assembly of vulcanized and cemented parts			
a. Open seam completely through hood.	X		
b. Area of delamination other than on strapping, but does not constitute an opening completely through hood.			X
c. Area of delamination at edge of strapping 1/16 inch or more, but does not extend to the raw edge of the seam.			X
d. Area of delamination of strapping extending to the raw edge of the seam.	X		
e. Seam strapping off center on outer edge of seam lap by more than 1/4 inch.			X
f. Seam strapping not covering raw edge of seam.	X		
g. Any blister in the strapping.		X	
h. Any hole, cut, tear, or rip in the seam strapping exposing base fabric.	X		

NOTE: Extent of delamination (or tunnel) may be determined by insertion of any blunt end instrument suitable for this purpose. Penetration of the instrument shall cease immediately if resistance is met.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

Defects	Classification Critical	Major	Minor
Workmanship and construction (in detail)			
Eye holes			
a. Holes not in alignment, malformed or puckered.		X	
b. Edges of eye opening not completely rolled over braid.			X
c. Slashes of seam allowance exposed on outside of opening.			X
d. Ends of braid not finishing at top of opening or not covered by eyetab.			X
e. Eye opening finishing more than 2-5/8 inches high or more than 2-7/8 inches wide.	X		
Loops			
a. One or more omitted or inadequately affixed where it may become detached.		X	
b. Misaligned, impairing proper function of drawcord.		X	
c. Loop hole too small for insertion of cord.		X	
d. One loop reinforcement patch omitted or inadequately affixed where it may become detached.			X
e. Two or more loop reinforcement patches omitted or inadequately affixed where it may become detached.		X	
Exhaust opening			
a. Exhaust opening reinforcement omitted.		X	
b. Exhaust shield hem omitted.			X
c. Exhaust shield misplaced, not completely covering exhaust opening.		X	
Shoulder and buckle strap			
a. Any strap omitted.		X	
b. Opening or delamination in fold.			X
c. Not attached at location specified on pattern.		X	
d. Any strap not securely attached.		X	
e. Attachment reinforcement pieces omitted.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

Defects	Classification Critical	Major	Minor
Hardware			
a. Any sharp burrs.		X	
b. Slide malformed, broken, distorted, or otherwise defective to a degree that it does not perform intended function.		X	
c. Any part of snap fastener missing.		X	
d. Any part of snap fastener reversed.			X
e. Any fastener not functioning properly, i.e., fails to snap closed, to provide a secure closure, or to open freely.		X	
f. Any fastener clinched excessively tight cutting adjacent material.		X	
g. Any fastener clinched loosely, permitting either component to rotate freely.		X	
h. Incorrect style fastener.		X	
i. Three or more splits in eyelet or button barrel.			X
NOTE: The fasteners shall be snapped and unsnapped twice to determine whether parts of fastener separate freely and also effect a secure closure.			
Marking: (label)			
Missing, incomplete, incorrect, not legible, not specified type or size, not in proper location, or not accomplished in the specified manner.		X	

* 4.4.4 End item dimensional examination. The end item shall be examined for conformance to all dimensions specified in table II and III that can be examined on the end item. Any dimension not within the specified tolerance shall be classified as a defect. The lot size shall be expressed in units of one hood. The sample unit shall be one hood. The inspection level shall be S-3 and the AQL, expressed in terms of defects per hundred units, shall be 4.0.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

* 4.4.5 End item critical defect examination. Every end item in lots found acceptable under the visual and dimensional examinations in 4.4.3 and 4.4.4 shall be examined for the critical defects in 4.4.3. Any end item found to contain one or more critical defects shall be rejected.

4.4.6 End item testing. The method of testing specified in FED-STD-191 wherever applicable and as listed in table IV shall be followed, except that the results of the physical testing of the coated materials, obtained under testing conditions defined in FED-STD-406, FED-STD-601 or FED-STD-191 will be acceptable, except in dispute cases, tests shall be conducted with both the specimen and test apparatus under standard conditions as defined in FED-STD-191. Except for the adhesion of gum strapping and cemented seams and the hydrostatic resistance of cemented seams, all the physical and chemical values specified in section 3 apply to results of each individual determination. The adhesion of gum strapping and cemented seams and the hydrostatic resistance of cemented seams value specified in section 3 apply to lot average of all determinations. The sample unit shall be two finished hoods. In addition, for each sample unit, a specially prepared panel 6 yards long and 8 inches wide finished with the sealed seam centered and running parallel to the long dimension shall be submitted. The specially prepared test piece shall be made up of the same material and fabricated in the same manner as the end item. The sample size shall be as follows:

Lot size (hoods)	Sample size (sample units)
280 or less	1
281 to 500	2

NOTE: No lot shall exceed 500 hoods.

The lot shall be unacceptable if any individual determination or the lot average of all determinations as applicable, fail to meet any requirements specified. All test reports shall contain the individual values utilized in expressing the final result.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

TABLE IV. End item tests

Component	Characteristic	Requirement paragraph	Test procedure	No. of determinations	Results reported as
Labels	Crocking	3.3.6	5651 1/		
	Dry			1	Pass or fail
	Wet			1	Pass or fail
Gum strapping	Adhesion	3.3.10.3	4.5.1	3	Numerically to nearest 0.1 lb/in.
	Adhesion after immersion	3.3.10.3	4.5.1.1	3	Numerically to nearest 0.1 lb/in.
	Adhesion after heat aging	3.3.10.3	4.5.1.2	3	Numerically to nearest 0.1 lb/in.
Seams 2/	Adhesion	3.3.10.3	4.5.2	3	Numerically to nearest 0.1 lb/in.
	Adhesion after immersion	3.3.10.3	4.5.2.1	3	Numerically to nearest 0.1 lb/in.
	Adhesion after heat aging	3.3.10.3	4.5.2.2	3	Numerically to nearest 0.1 lb/in.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

TABLE IV. End item tests (cont'd)

Component	Characteristic	Requirement paragraph	Test procedure	No. of determinations	Results reported as
	Resistance to cold crack	3.3.10.3	4.5.3	1	Pass or fail
	Acid resistance 3/	3.3.10.2	4.5.4.3	2	Pass of fail
	Fuel resistance	3.3.10.1	4.5.4.4	2	Pass or fail
	Surface tack after fuel exposure	3.3.10.1	4.5.4.5	2	Pass or fail
	Surface tack after acid exposure 3/	3.3.10.2	4.5.4.5	2	Pass or fail
	Hydrostatic resistance	3.3.10.3	5512 4/	5	Numerically to nearest 1.0 psi

1/ The label shall be cut from the hood to give a test specimen 4 by 8 inches with the legend centrally located and with the printing perpendicular to the lengthwise direction, and so positioned within the specimen as to be encompassed in the test area.

2/ At least one specimen shall be taken from the end item for initial adhesion tests (see 4.5.1 and 4.5.2) and acid and fuel resistance tests (see 4.5.4.3 and 4.5.4.4). Test specimens for other characteristics will be taken from the end items as available. Other specimens may be taken from the specially prepared seam strip (see 4.4.6). If test piece and results indicate a significant difference between the test piece and the end item then on subsequent lots the sample unit size shall consist of five end items only.

3/ The acid resistance and surface tack after acid exposure tests shall be performed by the Government (see 6.6).

4/ Hydrostatic pressure shall be applied to the outside of the seam with seam centered directly over the opening.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

* 4.4.7 Packaging inspection. An examination shall be made to determine that the preservation, packing, and marking comply with the section 5 requirements. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully packaged. The lot size shall be the number of shipping containers in the inspection lot. The inspection level shall be S-2 and the AQL, expressed in terms of defects per hundred units, shall be 2.5.

Examine	Defect
Marking (exterior and interior)	Omitted; incorrect; illegible; of improper size, location, sequence, or method of application.
Materials	Any component missing, damaged, or not as specified.
Workmanship	Inadequate application of components, such as: incomplete closure of container flaps, loose strapping, improper taping, inadequate stapling. Bulged or distorted container.
Content	Number of unit packs is more or less than required. Number of hoods per unit pack is more or less than required. 1/

1/ For this defect, one container in the sample shall be examined.

* 4.4.8 Palletization examination. An examination shall be made to determine that the palletization complies with the section 5 requirements. Defects shall be scored in accordance with the list below. The sample unit shall be one palletized unit load fully packaged. The lot size shall be the number of palletized unit loads in the inspection lot. The inspection level shall be S-1 and the AQL, expressed in terms of defects per hundred units, shall be 6.5.

Examine	Defect
Finished dimensions	Length, width, or height exceeds specified maximum requirements.
Palletization	Pallet pattern not as specified. Interlocking of loads not as specified. Load not bonded with required straps as specified.
Weight	Exceeds maximum load limits.
Marking	Omitted; incorrect; illegible; of improper size, location, sequence, or method of application.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

4.5 Methods of inspection.

4.5.1 Seam gum strapping adhesion test. The adhesion of the gum strapping to the seam shall be determined as specified in Method 5962 of FED-STD-191 except as follows: The test sample shall age at least 48 hours after application of the strapping and vulcanization of the assembly before testing. Only straight seamed and strapped sections shall be tested. The test specimen shall have the gum strapping peeled back from the seam for a distance of 2-1/2 to 3 inches. The end of the separated gum strapping shall be clamped in the upper jaw and the lapped seam, with strapping removed, clamped in the lower jaw. The results shall be calculated to the nearest 0.1 pound per inch of width.

4.5.1.1 Seam strapping adhesion after immersion. The strapping shall be immersed for 2 hours in boiling water, removed, immersed for 15 minutes in water at 80° ± 9°F, removed from the water, and while still dripping wet, tested for seam strapping adhesion as outlined in 4.5.1.

4.5.1.2 Seam strapping adhesion after heat aging. Samples shall be exposed for 7 days in a circulating air oven at 158° ± 2°F, removed from the oven, conditioned for 24 hours at standard conditions and then tested for seam strapping adhesion as outlined in 4.5.1.

4.5.2 Cemented seam adhesion test. The samples used in the performance of the tests specified in 4.5.1 (with gum strapping removed) shall be used as the test samples for this test. The adhesion of the cemented seam shall be determined as specified in Method 5960 of FED-STD-191. The results shall be calculated to the nearest 0.1 pound per inch of width.

4.5.2.1 Seam adhesion after immersion. The seam shall be immersed for two hours in boiling water, removed, immersed for 15 minutes in water at 80° ± 9°F, removed from the water, tested immediately for seam adhesion as outlined in 4.5.2.

4.5.2.2 Seam adhesion after heat aging. Samples shall be exposed for 7 days in a circulating air oven at 158° ± 2°F, removed from the oven, conditioned for 24 hours at standard conditions, and then tested for seam adhesion as outlined in 4.5.2.

4.5.3 Resistance of finished seams to cold crack test. The test shall be performed as specified in Method 5874 of FED-STD-191, with the following exceptions. Test temperature shall be -40° ± 2°F. Test specimens shall be conditioned for not less than 4 hours at test temperature prior to testing. Test specimens shall be prepared by folding so that two seam surfaces are superimposed. The roller weight shall be passed along the fold and across the seam. The test specimens shall be visually examined for failure after test. No hydrostatic test shall be performed after cold test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

4.5.4 Chemical resistance of finished seam test.

* 4.5.4.1 Apparatus and chemicals.

(a) Test jig No. 2 conforming to Drawing 8-1-3.
(b) Wax-paraffin wax or a mixture of paraffin and beeswax containing not more than one-third beeswax.
(c) Petroleum jelly.
(d) Aluminum block-dimensions approximately 4 by 2-7/16 by 1/2 inches.
(e) Chemical agents detector paper (M-9) conforming to MIL-P-51493.
(f) Propellant nitric acid types IIIA or IIIB conforming to MIL-P-7254 (see 6.6).
(g) Glass supporting and cover plates measuring 8 by 8 inches.
(h) Distilled water.
(i) Manifold paper conforming to JCP-F-10 (see 2.1).
(j) Roller-approximately 5-1/2 inches in diameter, 2 inches wide, and 10 pounds in weight.
(k) Calcium chloride, anhydrous, conforming to type II, grade A of O-C-105.

4.5.4.2 Preparation of test specimens. The test specimen shall be a section, 6 inches in diameter, including a length of finished strapped seam equal to the specimen diameter. The test specimen shall be placed in the test jig in the following manner:

(a) Place the test specimen between the spacer inserts and seal with melted wax. The wax shall form a continuous bead covering the outer circumference of the insert assembly.

(b) Place the insert assembly in the test jig sleeve and fill the cavity between the insert assembly and the sleeve wall with melted wax. Mate the jig sleeve and jig collar and screw hand tight.

(c) Seal the inside of the sleeve collar assembly with melted wax. The wax seal shall be continuous and shall extend around and out onto the test specimen approximately 1/8 inch, and up the inside of test jig, to a point approximately 1/8 inch above the top of the spacer insert. Turn the jig assembly over and seal the bottom cavity with melted wax in similar fashion.

(d) During the chemical exposure, the top of the test apparatus shall be covered with a glass plate.

* 4.5.4.3 Acid resistance of the finished seam and surrounding area (see 6.6).

(a) Prepare test specimen as specified in 4.5.4.2.

(b) Place test assembly in desiccator over calcium chloride conforming to type II, grade A of O-C-105 and condition at 70° ± 2°F, for a minimum of 16 hours.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

(c) After conditioning, remove from desiccator and immediately perform acid exposure tests as follows:

(1) Coat bottom and top edges of the test jig with 1/32 inch of petroleum jelly.

(2) Place aluminum block in the center of a glass supporting plate with a piece of chemical agents detector paper, coated side up, on top of the block. Place the test assembly over the block with the heavily coated side of the test specimen up.

(3) Cover the test specimen with 50 milliliters of propellant nitric acid and cover the top of the test jig with glass cover plate.

(d) After 2 hours acid exposure at 70° ± 2°F, and 65 ± 2 percent relative humidity, remove the test specimen from the test jig, rinse in distilled water, dry at stated conditions for approximately 4 hours and examine for requirements in 3.3.10.2.

4.5.4.4 Fuel resistance of the finished seam. The test specimen, prepared as specified in 4.5.4.2 and conditioned as specified in 4.5.4.3 shall be covered with 50 milliliters of JP-4 of MIL-T-5624 for 15 minutes at conditions of 70° ± 2°F, and 65 ± 2 percent relative humidity. After fuel exposure, the test specimen shall be removed from the test jig, rinsed in distilled water, dried for approximately 4 hours at the stated conditions and examined for requirements in 3.3.10.1.

4.5.4.5 Surface tack rating of the finished seam (see 6.6). The surface tack test shall be conducted, under conditions of 70° ± 2°F, and 65 ± 2 percent relative humidity, as follows:

(a) The test specimen, prepared as specified in 4.5.4.2 and conditioned as specified in 4.5.4.3 shall be covered with 50 milliliters of the specified acid or fuel.

(b) After 15 minutes exposure, under conditions of 70° ± 2°F, and 65 ± 2 percent relative humidity, the specimen shall be removed from the test jig, rinsed in distilled water, and dried for approximately 4 hours at stated conditions.

(c) Surface tack rating shall be determined as follows:

(1) The specimen, with wax line removed by cutting or scraping, shall be placed exposed side up on a smooth hard surface, and covered with a 2-by 4-inch piece of manifold paper.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

(2) The roller shall be passed along the full length of the manifold paper covered seam twice in each direction (four passes) with pressure applied by the weight of the roller only.

(3) After rolling, the manifold paper shall be peeled from the test specimen and the surface tack rating determined by comparison with figure 2 and rating standards.

Rating Standards: 1/

Rating I - A rating of I shall be equivalent to no trace 2/ of coating material retained on the test paper or no trace of paper fiber adhering to test specimen surface.

Rating II - A rating of II shall be equivalent to a trace 2/ of coating material retained on the test paper or a trace of paper fiber adhering to the test specimen surface.

Rating III - A rating of III shall be equivalent to any degree of coating material or paper fiber transfer in excess of rating II.

1/ Figure 2 pictorially represents the Rating Standards.

2/ A trace is defined as coating material or paper fiber transfer covering 25 percent of test specimen area.

5. PACKAGING

* 5.1 Preservation. Preservation shall be level A or Commercial as specified (see 6.2).

* 5.1.1 Level A. Each hood shall be laid flat face up with bottom edges aligned and straps folded over the hood. Fifteen hoods, alternately reversed bottom to crown, shall be placed one on top of another and unit packed in a fiberboard box conforming to style RSC, type CF, class domestic, variety SW, grade 175 of PPP-B-636. Inside dimensions of each box shall approximate 22-1/4 inches in length, 21 inches in width, and 10 inches in depth. Approximate dimensions are furnished as a guide only. Box closure shall be secured with 2-inch minimum width gummed paper tape conforming to type III, grade B of PPP-T-45.

* 5.1.2 Commercial. Hoods shall be preserved in accordance with ASTM D 3951.

5.2 Packing. Packing shall be level A, B or Commercial as specified (see 6.2).

* 5.2.1 Level A packing. Thirty hoods, preserved as specified in 5.1, shall be packed in a fiberboard shipping container conforming to style RSC, grade V2s of PPP-B-636. Level A unit packs shall be packed flat two in depth within a shipping container. Inside dimensions of the shipping container shall approxi-

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

mate 23 inches in length, 21-3/4 inches in width, and 21-3/4 inches in depth. Approximate dimensions are furnished as a guide only. Each shipping container shall be closed in accordance with method III, waterproofed in accordance with method V, and reinforced as specified in the appendix of PPP-B-636, except that the inspection shall be in accordance with 4.4.6.

* 5.2.2 Level B packing. Thirty hoods, preserved as specified in 5.1, shall be packed in a fiberboard shipping container conforming to style RSC, type CF, (variety SW) or SF, class domestic, grade 275 of PPP-B-636. Level A packages shall be packed flat two in depth within a shipping container. Inside dimensions of each shipping container shall approximate 23 inches in length, 21-3/4 inches in width and 21-3/4 inches in depth. Approximate dimensions are furnished as a guide only. Each shipping container shall be closed in accordance with method II as specified in the appendix of PPP-B-636, except that the inspection shall be in accordance with 4.4.6.

5.2.2.1 Weather-resistant fiberboard containers. When specified (see 6.2), the shipping container shall be a grade V3c, V3s, V4s fiberboard box fabricated in accordance with PPP-B-636 and closed in accordance with method III as specified in the appendix of PPP-B-636, except that the inspection shall be in accordance with 4.4.6.

* 5.2.3 Commercial packing. Hoods, preserved as specified in 5.1, shall be packed in accordance with ASTM D 3951.

5.3 Palletization. When specified (see 6.2), hoods, packed as specified in 5.2, shall be palletized in accordance with load type Ia and pattern number 90 of MIL-STD-147. Each prepared load shall be secured by bonding means K and L, or O or P, as specified in MIL-STD-147.

5.4 Marking. In addition to any special marking required by the contract or purchase order, unit packs, shipping containers and palletized unit loads shall be marked in accordance with MIL-STD-129 or ASTM D 3951, as applicable.

6. NOTES

6.1 Intended use. The hood is intended for wear by military personnel engaged in handling acid and fuel propellants as a component of the Coverall, Rocket Fuel Handler's, Impermeable, Full Protection.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

* 6.2 Ordering data. Acquisition documents should specify the following:

a. Title, date, and number of this document.
b. When a first article sample is required (see 3.2, 4.3, and 6.4).
c. Selection of applicable levels of preservation and packing (see 5.1 and 5.2).
d. When weather-resistant grade fiberboard shipping containers are required for level B packing (see 5.2.2.1).
e. When palletization is required (see 5.3).

6.3 Sample. For access to sample of the end item address the contracting office issuing the invitation for bids.

* 6.4 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a preproduction sample consisting of at least one completely finished hood assembly. The contracting officer should include specific instructions in all acquisition documents regarding arrangements for inspection and approval of the first article.

* 6.5 Recycled material. It is encouraged that recycled material be used when practical as long as it meets the requirements of the document (see 3.3).

* 6.6 Conductance of acid resistance and surface tack after acid exposure tests. Because of the danger involved in handling and shipping of propellant nitric acid, the acid resistance test specified in 4.5.4.3 and surface tack after acid exposure test specified in 4.5.4.5 will be performed by the government. The samples to be tested for acid resistance should be forwarded to the following address:

Commander
Defense Personnel Support Center
Clothing and Textile Laboratory Branch
ATTN: DPSC-TTL
2800 South 20th Street
Philadelphia, PA 19101

6.7 Changes from previous issue. The margins of this document are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

Custodians:

Army - GL
Navy - NU
Air Force - 82

Review activities:

Army - MD
DLA - CT

Preparing activity:

Army - GL

Project No. 8415-A136

☆ U.S. GOVERNMENT PRINTING OFFICE: 1985—505-038/20448

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

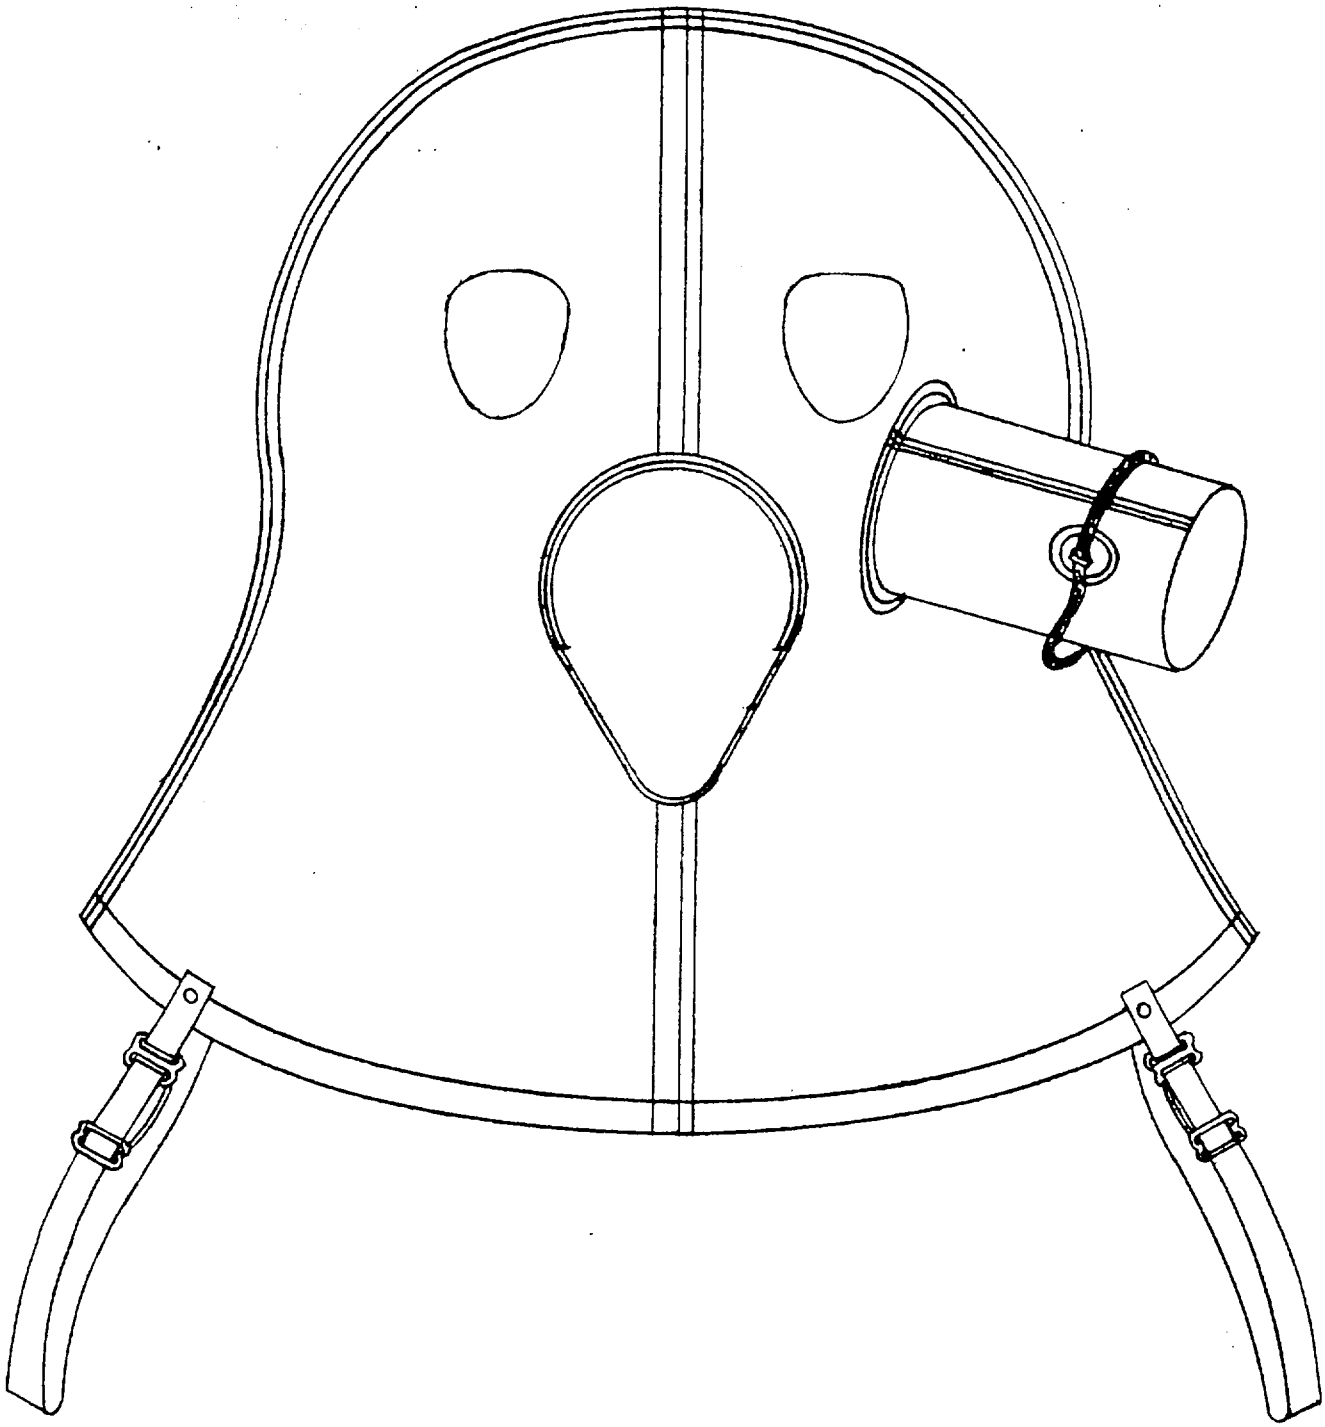


FIGURE 1.-HOOD, ROCKET FUEL HANDLER'S, IMPERMEABLE, FULL PROTECTION

8-1-98

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

RATINGS

I II III

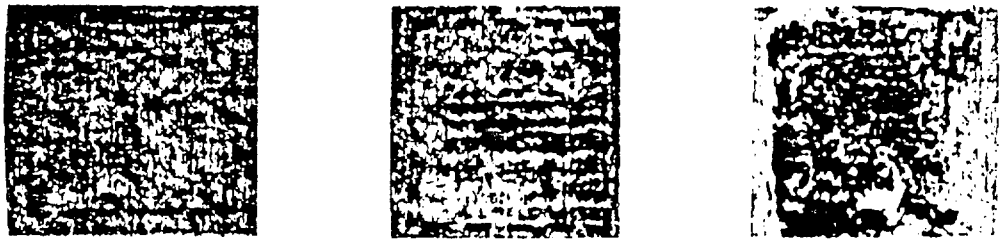


FIGURE 2 SURFACE TACK STANDARDS

NITRIC ACID TEST

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE ARMY

US ARMY NATICK RESEARCH
and DEVELOPMENT CENTER
ATTN: STRNC-ES
Natick, MA 01760-5014

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12062 WASHINGTON D. C.
POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

Commander
US Army Natick Research
and Development Center
ATTN: STRNC-ES
Natick, MA 01760-5014

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-H-43088E	Hood, Rocket Fuel Handler's: Impermeable, Full Protection

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

NATICK OP, 20 Nov 84

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T20:30Z
Check the source to verify that this is the current version before use.