MIL-S-6904/1
19 April 1965

MILITARY SPECIFICATION SHEET

SIGNAL, EMERGENCY WARNING
(BELL)

The complete requirements for procuring the signal described herein shall consist of this document and the issue in effect of MIL-S-6904.

FSC 6340

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T07:41Z
Check the source to verify that this is the current version before use.

REQUIREMENTS:

Dimensions and Configuration: See Figure 1.

Design and Construction:

The signal gong striker shall be of the straight-line plunger type arranged to move along its longitudinal axis only. The gong striker shall be constructed to prevent movement in any direction at right angles to the longitudinal axis or shall be supported by a clearance hole in the magnet keeper assembly near the striking end, and hinged at right angles to the armature spring.

Magnets - Magnets shall be properly wound and protected with a good commercial grade of insulating varnish to exclude moisture.

Termination - Terminals of the energizing coil shall be terminated at a location readily accessible from the back portion or side of the signal assembly, and shall be insulated from the signal assembly. Terminal posts shall be No. 6, threaded with No. 6-32 NC-3A threads in accordance with MIL-S-7742, and shall be of such length that a minimum clearance of 1/16 inch be provided between the ends of the posts and the mounting surface of the bell housing.

Operation:

Operating Voltage - The signal assembly shall be designed to operate on any direct current voltage between 16 and 29V and shall withstand continuous operation for a period of 15 minutes at 24V at an ambient temperature of between 20 and 25° C without causing the vibrator contacts to stick in the closed position or causing other damage.


Temperatures - The signal shall operate at any temperature between -54 ±2° C and 71 ±2° C and shall not be damaged when exposed to temperatures of -60 ±2° C and 94 ±2° C for a minimum period of 48 hours.

Current Consumption - The current consumption shall not exceed 0.6 amp when adjusted to produce the "sound intensity" as specified at 24VDC operation.

Sound Intensity - The signal assembly shall provide a sound intensity of not less than 100 decibels as measured from a distance of 3 feet from the edge of the gong nearest the mounting flange, when operated at 24VDC under conditions encountered in a soundproof room.

Sound Frequency - The signal assembly shall provide sound at frequencies within ±100 cps of those shown below with an amplitude within ±5 decibels of that shown below, when measured at a distance of 3 feet from the edge of the gong nearest the mounting flange:

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T07:41Z
Check the source to verify that this is the current version before use.

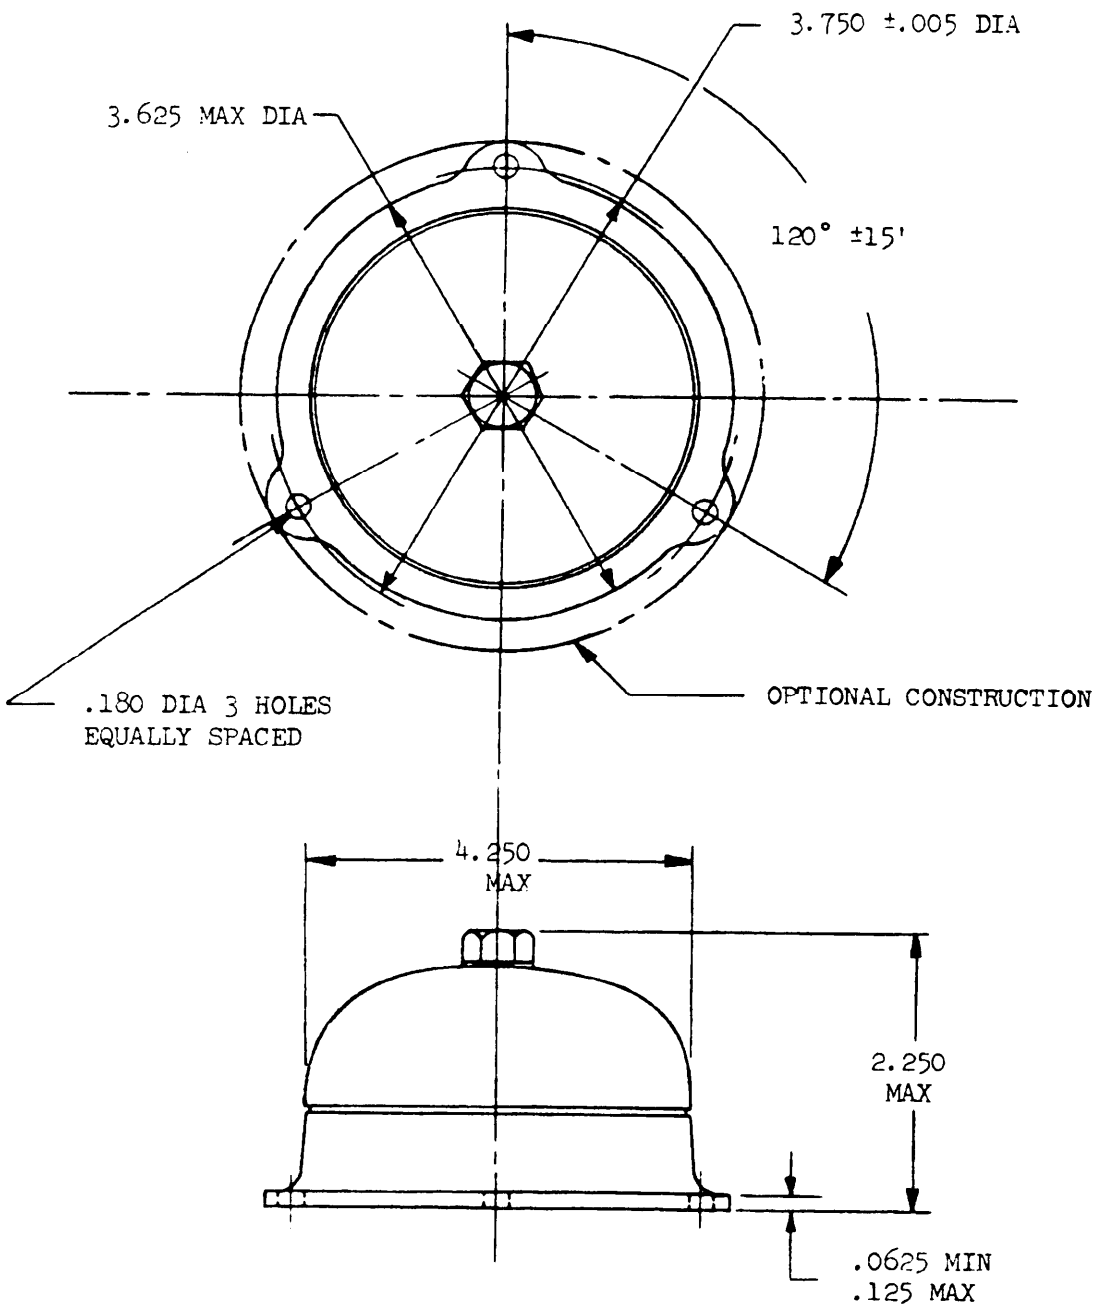

DIMENSIONS IN INCHES. UNLESS OTHERWISE SPECIFIED,
TOLERANCES: DECIMALS ±.016.

Figure 1. Emergency Warning Signal, Type J3 Bell, Part No. M6904/1-1

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T07:41Z
Check the source to verify that this is the current version before use.

Frequency (Cycles Per Second)	Noise Level Decibels
1200	85
3000	92
5200	80
7700	92

Altitude - The signal shall operate at a pressure altitude from sea level to 50,000 feet.

Sand and Dust - Immediately following the sand and dust test the bell shall be tested for operation. A deposit of sand and dust on or within the signal assembly shall not be removed by blowing or shaking prior to operation tests.

Vibration - Provisions shall be made to prevent the turning of the gong shell as the result of vibration.

Weight: 1.2 pounds maximum.

Type Number: J3.

Military Part Number: M6904/1-1.

Supersession Data: This specification sheet in conjunction with MIL-S-6904B supersedes MIL-S-8372 (USAF).

Custodians:
Army - MO
Navy - WP
Air Force - 82

Preparing activity:
Navy - WP

(Project No. 6340-0019)

Review activities:
Army - MO
Navy - WP
Air Force - 82

User activities:
Army -
Navy - CG
Air Force -

NOTE: Review/user information is current as of date of this document. Future coordination of changes to this document, draft circulation should be based on the information in the current DODISS.

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T07:41Z
Check the source to verify that this is the current version before use.