MIL-C-44030B(GL)
7 October 1988
SUPERSEDING
MIL-C-44030A(GL)
18 September 1984

MILITARY SPECIFICATION

COAT, ALL-WEATHER, MAN'S, BLACK, WITH REMOVABLE LINER

This specification is approved for use by the Natick Research, Development, and Engineering Center, Department of the Army, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This document covers a man's all weather coat.

1.2 Classification. The coat shall be of one type in the following sizes (see 6.2).

Schedule of sizes

X-Short	Short	Regular	Long	X-Long
--	30	30	--	--
32	32	32	32	--
34	34	34	34	34
36	36	36	36	36
38	38	38	38	38
40	40	40	40	40
42	42	42	42	42
--	44	44	44	44
--	46	46	46	46
--	--	48	48	48

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: U.S. Army Natick Research, Development, and Engineering Center, Natick, MA 01760-5014 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

A-A-50083	-	Bag, Plastic, Folded Garment
V-B-871	-	Button, Sewing Hole, and Button, Staple (Plastic)
V-F-106	-	Fasteners, Slide, Interlocking
V-T-280	-	Thread, Gimp, Cotton, Buttonhole
DDD-L-20	-	Label: For Clothing, Equipage, and Tentage (General Use)
PPP-B-636	-	Boxes, Shipping, Fiberboard

MILITARY

MIL-B-371	-	Braid, Textile, Tubular
MIL-T-3530	-	Thread and Twine; Mildew Resistant or Water Repellent Treated
MIL-C-21852	-	Cloth, Taffeta, Nylon
MIL-C-29365	-	Cloth, Nonwoven, Interlining, Fusible, Nylon and Polyester, Polyamid
MIL-L-35078	-	Loads, Unit: Preparation of Semiperishable Subsistence Items; Clothing, Personal Equipment and Equipage; General Specification For
MIL-C-43251	-	Cloth, Pile, Acrylic Fiber Pile
MIL-C-43482	-	Cloth, Poplin, Cotton and Polyester (Water Repellent)
MIL-C-43525	-	Cloth, Satin, Acetate or Rayon Face and Rayon or Cotton Back
MIL-T-43548	-	Thread, Polyester Core: Cotton-, Rayon-, or Polyester-Covered
MIL-C-43836	-	Cloth, Interlining, Non-Woven

STANDARDS

FEDERAL

FED-STD-191	-	Textile Test Methods
FED-STD-751	-	Stitches, Seams, and Stitchings

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-147 - Palletized Unit Loads
MIL-STD-731 - Quality of Wood Members for Containers and Pallets
MIL-STD-1494 - Provisions for Evaluating Quality of Raincoats

(Copies of specifications, standards, and handbooks required by contractors in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting activity.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of the documents which are DOD adopted shall be those listed in the issue of the DODISS specified in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS shall be the issues of the nongovernment documents which are current on the date of the solicitation.

AMERICAN ASSOCIATION OF TEXTILE CHEMISTS AND COLORISTS (AATCC)

Chromatic Transference Scale

(Copies should be obtained from the American Association of Textile Chemists and Colorists, Research Triangle Park, P.O. Box 12215, Durham, NC 27709.)

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

D 3951 - Standard Practice for Commercial Packaging

(Copies should be obtained from the American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103.)

(Nongovernment standards and other publications are normally available from the organizations which prepare or which distribute the documents. These documents also may be available in or through libraries or other informational services.)

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Guide sample. Samples, when furnished, are solely for guidance and information to the contractor (see 6.3). Variation from this document may appear in the sample, in which case this document shall govern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

3.2 First article. When specified in the contract or purchase order, a sample shall be subjected to first article inspection (see 4.3, 6.2, and 6.4).

3.3 Materials (see 6.7).

3.3.1 Basic material. The basic material shall be cotton and polyester water repellent poplin cloth, Black 385, conforming to class 2 of MIL-C-43482. At the option of the contractor, the basic material may be used for the hanger loop (see 3.3.15 and table II operation 1.c). In addition, the basic material may be used as alternate interlining material for the fusible interlinings as specified in 3.3.9.1.

3.3.2 Liner material. The material for the liner shall be acrylic fiber pile and acrylic or polyester back cloth conforming to class 2 of MIL-C-43251.

3.3.3 Sleeve lining and bindings. The material for the sleeve lining and for binding the back of the shell facings shall be black nylon taffeta cloth and conform to types III or IV of MIL-C-21852.

3.3.4 Sleeve hem interlining. The interlining for the sleeve hem shall be non-woven cloth conforming to type II, class 1 of MIL-C-43836 with the following exceptions: staple polyester may be substituted for the staple nylon, the weight shall be 2.3 to 2.7 ounces per square yard, and the thickness at 0.6 psi shall be 0.010 to 0.016 inch. As an alternate, fusible material as specified in 3.3.9.1 may be used in lieu of non-woven cloth for interlining the bottom of sleeves and fused as specified in 3.3.9.4.

3.3.5 Undercollar stand interlining. The material for the undercollar stand interlining shall be white or natural color nylon, marquisette leno weave cloth conforming to the following requirements, when tested as specified in 4.4.1:

Weight, ounces per square yard		2.6 to 3.0
Yarns per inch (min):	warp	48
	filling	24
Thickness at 0.6 psi, inches		0.012 to 0.016
Breaking strength, pounds (min):	warp	110
	filling	48
Stiffness, inch-pounds (min), warp		0.008

As an alternate, fusible material specified in 3.3.9.1 may be used for interlining the undercollar stand.

3.3.6 Neck tape. The tape for reinforcing the neckline shall be black polyester tape, plain weave, 3/16 ± 1/32 inch wide, with a minimum texture of 16 total warp yarns and 36 picks per inch when tested as specified in 4.4.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

3.3.7 Liner sleeves. The material for the sleeves of the liner shall be black and shall conform to type I or II of MIL-C-43525.

3.3.8 Liner binding. The material for binding the edges of the liner and the liner pass-through slit, shall be black nylon taffeta cloth as specified in 3.3.3; or a black 100-percent rayon twill cloth conforming to the following requirements, when tested as specified in 4.4.1:

Width		1-5/16 ± 1/16
Weight, ounces per square yard (min)		2.6
Yarns per inch (min):	warp	82
	filling	54
Weave		2/1 twill
Yarns, denier (nominal)		180

3.3.8.1 Colorfastness. The finished cloth shall show fastness to laundering (after 3 cycles), drycleaning, and crocking, equal to or better than the standard sample. When no standard sample is available, the finished cloth shall show "good" fastness to laundering (after 3 cycles) and drycleaning and shall have an AATCC Chromatic Transference Scale rating for crocking not lower than 3.5 when tested as specified in 4.4.1.

3.3.9 Fusible materials.

3.3.9.1 Fusible interlining. The fusible interlinings for the top collar, pocket welt, facing, front fly, undercollar stand, and alternate method for interlining sleeve bottoms shall be either black, preshrunk, 100-percent cotton, plain weave cloth, black, spunlaced, binder free, 100-percent polyester, non-woven fabric or cotton and polyester water repellent poplin cloth, Black 385. The interlining shall have a uniformly distributed dot system of polyvinyl chloride/polyvinyl acetate type fusible adhesive applied to one side in accordance with good commercial practice. The fusible interlining shall meet the following requirements when tested as specified in 4.4.1.

	Cotton, plain weave	Polyester, spunlaced non-woven
Weight, oz/yd ^{2}	3.3 - 4.1	2.7 - 3.2
Yarns per inch (min):		
Warp	60	--
Filling	52	--
Breaking strength, lbs. (min):		
Warp (machine direction)	36	25
Filling (cross machine direction)	14	10

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

As an alternate, the fusible interlining may be non-woven fusible cloth conforming to class 3 of MIL-C-29365, except that colorfastness, fusing conditions, bond strength, and skrinkage shall conform to the requirements specified in 3.3.9.3 through 3.3.9.6.

3.3.9.2 Colorfastness. All dyed finished fusible interlining materials shall show fastness to laundering (after 3 cycles), equal to or better than the standard sample when tested as specified in 4.4.1. When no standard sample is available, the finished fusible materials shall show "fair" fastness to laundering (after 3 cycles).

3.3.9.3 Fusing conditions. The interlining shall be fused to the basic material on a fusing press. For optimum results with the particular fusible style and press used, specific settings should be obtained from the manufacturer of the fusible interlining. See 6.5 for recommended fusing conditions.

3.3.9.4 Bond strength.

3.3.9.4.1 Interlining. The interlining after fusing to basic cloth, as specified in 3.3.9.4, shall meet the following bond strength requirements when tested as specified in 4.4.1:

Bond strength (min), ounces per inch width:	
- initial	20
- after 3 launderings	17
- after 3 dry cleanings	17

3.3.9.4.2 End item. The end item shall meet a minimum bond strength of 17 ounces per inch in the fused areas when tested as specified in 4.4.4. There shall be no "strike through" of the adhesive after fusing.

3.3.9.5 Shrinkage. The interlining, after fusing to the basic cloth as specified in 3.3.9.4, shall not exceed 1.0 percent shrinkage and shall meet the following shrinkage requirements when tested as specified in 4.4.1:

Shrinkage, percent (max):	
- warp (machine direction)	3.0
- filling (cross machine direction)	2.0

Shrinkage, percent (max):	
- warp	3.0
- filling	2.0

3.3.9.6 Seam web. The material for fusing the center back, side, and sleeve outseams shall be a polyamide fusible web, 3/8 ± 1/16 inch in width and weighing 1.0 ± 0.2 ounce per square yard when tested as specified in 4.4.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

3.3.10 Labels. Each coat and each liner shall have a class 14 combination size, identification, and instruction label or separate class 2 size label, class 1 identification label, and class 3 instruction label conforming to type VI of DDD-L-20. The labels shall show fastness to laundering and drycleaning. The instruction label shall contain the following information:

For coat:

Laundering (preferred method)

Spot wash badly soiled areas.
Wash in warm water (115° ± 5°F) using mild detergent.
Rinse at least 3 times.
Machine spin dry and then dry at highest temperature setting on home dryer for 60 minutes (min).
Touch up with moderately hot iron (synthetic setting).

Dry clean (alternate method)

Drycleaning in pure solvent will not reduce water resistance nor will drycleaning with detergent, providing the detergent is removed by rinsing.
If poor water resistance is noted after cleaning, rinsing in water followed by drying and pressing will renew water resistance.

For liner:

DRY CLEAN ONLY
DO NOT STEAM OR PRESS

3.3.11 Thread. The thread for all seaming and stitching shall be cotton-, rayon-, or polyester-covered polyester core thread, ticket nos. 30 - 2 or 3 ply, 50 -2 or 3 ply and 70 - 2 ply conforming to MIL-T-43548. The color shall be Black AA, C.A. 66043. The thread for the outer shell (coat) shall be water repellent treated in accordance with type II, class 3 of MIL-T-3530.

3.3.12 Gimp. The gimp for reinforcing buttonholes shall be cotton, Black AA, C.A. 66043, conforming to size No. 8, type I or II of V-T-280.

3.3.13 Buttons. The buttons shall be type II, class D, style 20 or 21, 40 line for front fly; 30 line for lapel, shoulder loops and storm tab; 24 line for sleeve liner, throat tab and back vent; and style 15, 18 line for stay buttons conforming to V-B-871. The color of the buttons shall be Black BT, Cable 62001.

3.3.14 Slide fastener. The slide fastener for the coat and liner shall be type IV, style 1, size L, with short tab pull and brass or aluminum chain, conforming to V-F-106, except that the width of the tape shall measure no less than 7/16 of an inch or more than 19/32 of an inch. The length of the fastener shall be 74 inches for size X-Short and Short, and 80 inches for Regular, Long, and X-Long.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

3.3.14.1 Tape for slide fastener. The slide fastener tape shall be dyed black. The dyed tapes shall show fastness to laundering (after 3 cycles) and drycleaning equal to or better than the standard sample.

3.3.15 Braid-hanger loop. The braid for the hanger loop shall be either cotton or rayon, Black 385, conforming to type IX, class 1 of MIL-B-371 (see 3.3.1 and table II, operation 1.c for alternate).

3.4 Design. The coat is a single-breasted, four button fly front, split shoulder (set-in front, raglan back) with a front and back yoke lining. The coat has slash pockets with inside hanging bellows which are two-way access (pass through pockets). The back has a center vent with button and buttonhole. The collar is convertible with a half stand and has a throat tab for collar closure. The shoulder loops are detachable. The coat has a detachable single ply liner with bound edges, raglan sleeves, button and loop at the sleeve bottom, a slide fastener for attaching to coat, and a pass through pocket slit (opening).

3.4.1 Figures. Figures 1 and 2 are furnished for information purposes only. If there are any inconsistencies between the written document and the figures, the written document shall govern.

3.5 Patterns. Standard patterns which show size, directional lines, placement marks, and notches for assembly will be furnished by the Government. The Government patterns shall not be altered in any way and shall be used as a guide for cutting the working patterns. Unless otherwise indicated in table II, the seam allowances shall be 1/2 inch for joining front sleeve to armhole down to step, joining back sleeve to armhole down to step, and top arm seam; 1/4 inch for joining front sleeve to armhole below step, joining back sleeve to armhole below step, yoke to facing, making collar, attaching collar, facing to undercollar, making pockets, shoulder loops and storm tab; and 3/8 inch for all other seams.

3.5.1 List of pattern parts. The component parts of the coat shall be cut from materials specified in accordance with the number of parts indicated in table I.

TABLE I. List of pattern parts

Material	Nomenclature	Cut parts
Cloth, cotton and polyester poplin, water repellent	Back	2
	Front	2
	Storm tab	2
	Shoulder loop	4
	Collar	2
	Collar stand	2
	Pocket welt	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE I. List of pattern parts (cont'd)

Material	Nomenclature	Cut parts
Cloth, cotton and polyester poplin, water repellent (cont'd)	Cape	2
	Under pocket	2
	Top pocket	2
	Fly lining	1
	Top fly front	1
	Front lining (yoke)	2
	Back lining (yoke)	1
	Back sleeve	2
	Front sleeve	2
	Front facing	2
Nylon taffeta	Front sleeve lining	2
	Back sleeve lining	2
Cloth, acrylic fiber pile	Liner front 1/	2
	Liner back1/	1
Cloth, satin, acetate or rayon face and rayon or cotton back	Liner front sleeve	2
	Liner back sleeve	2
Cloth, plain weave fusible or non-woven fusible	Collar interlining	1
	Collar stand interlining	1
	Pocket welt interlining	2
	Front sleeve interlining	2
	Front facing interlining	2
	Front facing interlining (alternate)	2
	Back sleeve interlining	2
	Top fly front interlining	1
Cloth, nylon, Marquisette leno weave non-fusible	Collar stand interlining	1 2/
Cloth, interlining, non-woven	Sleeve hem interlining	2 2/
Shapers:	Bottom coat shaper	
	Finished fly front shaper (stitch line)	

1/ These parts are marked "cut one way only" so that on both pieces the pile of the liner fabric will fall in the same direction - preferably with the nap running down as you go from top to bottom.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

2/ Use only when bottom of sleeve and collar stand are not fused.

3.6 Construction.

3.6.1 Stitches, seams, and stitchings. Stitch, seam, and stitching types specified in table II shall conform to FED-STD-751. Whenever two or more seam or stitch types are given for the same part of the operation, any one of them may be used. When stitch type 401 is used, the looper thread shall be on the inside of the coat and on the coat side of the liner. Seam allowances shall be maintained with seams sewn so that no raw edges, runoffs, twists, pleats, puckers, or open seams will result. All seams shall start and finish evenly. Thread tension shall be maintained so that there is no tight or loose stitching. Unless otherwise specified, raise stitching or edge stitching shall be 1/4 to 5/16 inch gage from the edge. The gage of stitching for safety stitch construction shall be 3/8 inch. The guides and knives on the safety stitch machines shall be set to trim only the ravelled ends of the fabric. All seams shall start and finish evenly. Seams required to be worked out having a depth between the fold of 1/16 inch or more shall be considered a defect. The fusible tapes for seams shall not be exposed in the seam construction.

3.6.1.1 Type 301 stitching. Ends of all stitching shall be backstitched or overstitched not less than 1/4 inch except where ends are turned under or caught in other seams or stitching. Ends of continuous line of stitching shall be overlapped not less than 1/2 inch except on labels where a minimum three stitch overlap is required. Thread tensions shall be maintained so that there will be no loose stitching resulting in loose bobbin or top thread or excessively tight stitching resulting in puckering of the materials sewn. The lock shall be imbedded in the materials sewn.

3.6.1.1.1 Repairs of type 301 stitching. Repairs of type 301 stitching shall be as follows:

a. When thread breaks or bobbin run-outs occur during stitching, the stitching shall be repaired by restarting the stitching a minimum of 1/2 inch back of the end of the stitching. 1/

b. Thread breaks or two or more consecutive skipped or runoff stitches noted during inspection of the item shall be repaired by overstitching. The stitching shall start a minimum of 1/2 inch in back of the defective area and continue over the defective area a minimum of 1/2 inch beyond the defective area onto the existing stitching. Loose or excessively tight stitching shall be repaired by removing the defective stitching without damaging the materials and restitching in the required manner. 1/

1/ When making the above repairs, the ends of the stitching are not required to be backstitched.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

3.6.1.2 Types 101, 401, 503, 504, 515, 516, and 519 stitching. Thread tension shall be maintained so that there will be no loose stitching. All repairs shall be in accordance with 3.6.1.1.1a and 3.6.1.1.1b. Repairs to stitch type 401 may be accomplished by use of stitch type 301.

3.6.2 Stitches per inch. The minimum and maximum number of stitches per inch shall be as specified in table II.

3.6.3 Buttonholes. The buttonholes for the front fly, storm tab and throat tab shall be cut-after, eyelet-end taper bar type or square bar type worked over gimp with ends of gimp pulled through to the underside and bartacked. The buttonholes for the shoulder loops and lapel shall be cut-first, eyelet-end square bar type worked over gimp with the ends pulled through to the underside and bartacked. The buttonhole on the vent shall be a straight cut type, tacked at both ends. The size location, and number of buttonholes shall be as follows:

Location	Number	Size
Front fly	4	1-1/8 + 1/8 inches
Lapel	1	7/8 + 1/8 inch
Storm tab	1	7/8 + 1/8 inch
Shoulder loops	2 each	7/8 + 1/8 inch
Throat tab	1	5/8 + 1/8, -0 inch
Back vent	1	1/2 + 1/8, -0 inch

3.6.4 Bartacks. Bartacks shall measure 1/2 ± 1/16 inch long, and be free from thread breaks and loose stitching.

3.7 Manufacturing operations requirements. The coat and liner shall be manufactured in accordance with operation requirements specified in table II. The contractor is not required to follow the exact sequence of operations listed. Any additional basting or holding stitching to facilitate manufacture is permissible, provided that the thread is removed or does not show in the finished coat or liner.

3.7.1 Pressing. Unless otherwise specified, all pressing specified in table II shall be performed with a heated pressing iron or machine.

3.7.2 Use of automated apparel equipment. Automated apparel equipment may be used to perform any of the operations specified in table II provided the seam and stitch type are as specified and the finished component conforms to the required configurations. When a Government finished shaper pattern is furnished, caution shall be taken to assure the component conforms to that pattern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II.

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
1.	Cutting. a. Cut the coat in strict accordance with patterns furnished which show size, directional lines, marks for placement of component parts, and notches for proper assembly. Directional lines shall be placed in the warp direction unless otherwise specified. b. Cut the basic material parts for coat from the same piece of material except, storm tab, under-collar, underside of shoulder loop, capes, under pocket, top pocket, front lining (yoke), back lining (yoke), fly lining, top fly front, undercollar stand, keeper loop and hanger loop (see 3.3.1 for optional braid and operation 1.c. for finished width and length of loops) which may be cut from ends. Except for parts identified above, all parts cut from the basic material shall be cut with the glossy side of the material to the outside. Parts cut from ends shall approximate the shade of the coat. When front and back yoke linings are cut from ends, they shall be shade marked and match each other. c. Cut stripping for hanger loop and keeper loop from basic material (when option is utilized) of sufficient width to finish 3/8 $\pm$ 1/8 inch wide and 3 $\pm$ 1/8 inches in length. d. Cut liner fronts and backs from the same piece of material, and in a manner so that on the finished liner the back and front pile pieces fall in the same direction preferably with the nap running down from top to bottom. e. Cut the liner sleeves from the same piece of material.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
1.	Cutting. (cont'd)						
	f. Cut all interlining materials in accordance with patterns furnished.						
	g. Cut the binding material for both the coat and liner on the bias 1-1/8 to 1-5/16 inches wide.						
	h. Cut facings for pocket hand openings (one each opening) 1-1/2 to 1-5/8 inches wide by 9-1/2 to 9-3/4 inches long.						
2.	Replacement of defective components.						
	During the spreading, cutting, and manufacturing process, components having material defects or damages that are classified as defects in MIL-STD-1491 shall be removed from production and replaced with non-defective and properly matched components.						
3.	Marking.						
	a. Mark, ticket, or bundle cut parts to insure a uniform shade throughout the coat and liner.						
	b. Any method of marking may be used except:						
	(1) Metal fastening devices. (2) Sew-on tickets. (3) Adhesive type tickets which leave traces of adhesive on the material after removal of the tickets.						
	NOTE: The use of non-corrosive metal fastening devices is permitted for the liner only.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
4.	Assembling of components cut from basic material. During the fabrication of the coat, the parts required to be cut with the glossy side to the outside (see operation 1.b.) shall be assembled with the glossy side to the outside.						
	MAKE COAT						
5.	Make shoulder loops.						
	a. Stitch two shoulder loop pieces together around all sides, leaving an opening along the back end for turning. Trim points, turn and force out edges and points, and stitch 1/4 to 5/16 inch from edges around the entire loop except the square end, which shall be stitched 1/16 to 1/8 inch from edge.	301 or 401 and 301	SSe-2(a) SSe-2(b)	10-12 10-12 10-12	50 50 50	50 70 50	
	b. Make two 7/8 inch finished cut length buttonholes in each shoulder loop positioned as indicated by marks on pattern. The inside edge of eyelet shall be 7/8 to 1 inch from pointed end and 1/4 to 3/8 inch from straight end. The buttonholes shall not be off center by more than 1/8 inch (see 3.6.3). The purling shall be on the under side of loop at straight end and face side of loop at the pointed end.	Buttonhole		50-54 per buttonhole	30	50	
	c. Tack ends of buttonhole stitching and gimp by machine.	Bartack		21 per bartack	50	50	
6.	Make storm tab.						
	a. Position the tabs face to face and stitch along sides and pointed edges. Trim, turn, and work out	301 or 401 and	SSe-2(a)	10-12 10-12	50 50	50 70	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
6.	Make storm tab. (cont'd)						
	edges. Stitch sides and point 1/4 to 5/16 inch from edges.	301	SSe-2(b) and OSf-1	10-12	50	50	
	b. Make a 7/8 inch finished cut length buttonhole in the storm tab positioned as indicated on pattern. The inside edge of eyelet shall be 3/4 to 7/8 inch from pointed end. The buttonhole shall not be off center by more than 1/8 inch (see 3.6.3). The purling shall be on the outside of the storm tab (when not in use).	Buttonhole		50-54 per buttonhole	30	50	
	c. When applicable, tack ends of buttonhole stitching and gimp by machine.	Bartack		21 per bartack	50	50	
7.	Make collar.						
	a. Position fusible interlining to top collar and press. Stitch undercollar to top collar around the side and top edges. When alternate interlining is used, position interlining on undercollar, and with undercollar and top collar face to face, stitch through all plies around side and top edges.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70	
	b. Trim, turn, and force out edges and points, and stitch 1/4 to 5/16 inch from edges.	301	SSe-2(b)	10-12	50	50	
8.	Make collar stand and attach collar.						
	a. Quilt the marquisette leno weave interlining to the undercollar stand with four or five rows of stitching approximately 1/4 inch apart or position fusible interlining to undercollar stand and press.	301	LSbj-4 or LSbj-5	10-12	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
8.	Make collar stand and attach collar. (cont'd)						
	b. Position collar between top and undercollar stand, as indicated by marks on pattern, and with raw edges even stitch along side and top edge of collar stand and around throat tab.	301 or 401	SSe-2(a)	10-12	50	70	
	c. Turn collar stand to finished position forcing out points and edges of throat tab and stitch 1/16 to 3/32 inch from turned edges.	301	SSe-2(b)	10-12	50	50	
	d. Position hanger loop on center of top collar stand. Turn ends under 3/8 inch and bartack each end (see 3.3.15 and operation 12).	Bartack		28 per bartack	50	50	
	e. Make a 5/8 inch finish cut length buttonhole centered on throat tab positioned with inside edge of eyelet 1/4 to 3/8 inch from front edge of throat tab.	Buttonhole		36-40 per buttonhole	50	50	
	f. Tack ends of buttonhole stitching and gimp by machine. The purling shall be on outside of throat tab.	Bartack		21 per bartack	50	50	
9.	Make pocket welt.						
	a. Position fusible interlining to underside of top portion of welt piece and fuse.						
	b. Fold welt in half lengthwise, face to face and stitch side edges.	301 or 401	SSe-2(a)	10-12	50	50	
	c. Trim, turn, force out edges and points, and stitch 1/4 to 5/16 inch from side and folded edges.	301	SSe-2(b) and OSf-1	10-12	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
10.	Make pockets.						
	a. Slash under pocket opening, superimpose pocket pieces and stitch together around all edges.	301 or 401	SSe-2(a)	10-12	50 50	50 70	
	b. Turn pocket inside out, and edge stitch 1/16 to 1/8 inch from edge.	301	SSe-2(b	10-12	50	50	
	c. Turn under raw edge of under pocket and stitch to top pocket 1/16 to 3/32 inch from turned edge forming facing.	301	LSd-1	10-12	50	50	
11.	Set pockets.						
	Finished appearance. The pockets and welts shall be uniform in appearance and placement and shall lie flat and smooth, without twisting, pleating, or puckering. The stitching shall be uniform in width.						
	a. Set pocket welt on front as indicated by marks on pattern. Seam welts to fronts 1/4 inch from raw edge. The stitching shall not extend beyond the pocket line.	301 or 401	SSa-1	10-12	50 50	50 70	
	b. Fold facing for hand opening (see operation 1.h) in half lengthwise and position raw edges of facing on opposite side of pocket opening mark with raw edges abutting raw edges of welt. Stitch facing to front along pocket opening mark from top to bottom of opening 1/4 inch from raw edges.	301 or 401	SSe-2(b)	10-12	50 50	50 70	
	c. Slash pocket opening and tongue notch ends.						
	NOTE: Cuts shall not be visible on finished coat.						

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
11.	Set pockets. (cont'd)						
	d. Turn facing to inside of coat, and raise stitch to coat from top to bottom of opening 1/16 to 3/32 inch from folded edge.	301	SSe-2(b)	10-12	50	50	
	e. Seam unfinished side of under pocket to welt-to-front joining seam (this may be performed as part of operation 10.a).	301	SSa-1	10-12	50	50	
	f. Turn pocket to inside and raise stitch through welt and pocket 1/16 to 3/32 inch from turned edge.	301	SSe-2(b)	10-12	50	50	
	g. With pocket in a flat position, stitch down top and bottom edges of welt, through front and hanging pocket, with two rows of stitching. The inner row shall superimpose the 1/4 to 5/16 inch stitching on welt; the outer row shall be 1/16 to 3/32 inch from edge and the stitching at ends of hand opening shall be diagonal to the corners of the hand opening.	301	LSq-3(b)	10-12	50	50	
	h. Stitch front edge of top pocket to coat fronts.	301	SSa-1	6-12	50	50	
12.	Make keeper loop and hanger loop (when applicable).						
	a. Turn the edges of the loops to the center and stitch the abutted edges with a row of stitches (3/16 to 5/16 gage) extending across and covering the edges of the material (see operation 1.c).	406	EFh-1	10-12	50	50	
	- or -						
	b. Fold loops with the raw edges turned in and stitch 1/16 to 1/8 inch from each edge.	301	EFp-2	10-12	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
13.	Make facings.						
	a. Position fusible interlining to front facing and press.						
	- or -						
	When alternate interlining (basic material) is used, position interlining to front facings and stitch 1/16 to 1/8 inch around all edges.	301	SSa-1	6-12	50	50	
	b. Bind back raw edge of facings. Binding shall finish 3/16 to 1/4 inch wide (see 3.3.3).	301	BSc-1	10-12	50	50	
14.	Make left fly front.						
	a. Position fly lining piece on left front facing, as indicated by notches on pattern and stitch inward at top notch parallel to front edge and outward at bottom notch. The joining seam shall be 3/4 ± 1/8 inch from front edge of facing.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70	
	b. Cut facing and fly piece diagonally at each corner to line of stitching.						
	c. Turn fly piece to inside and stitch the length of the fly piece 1/4 to 5/16 inch from turned edge, backtacking each end or stitch the three edges of fly piece 1/4 to 5/16 inch from turned edge.	301	SSe-2(b)	10-12	50	50	
	d. Make four 1-1/8 inches finish cut length buttonholes on fly piece as indicated by marks on pattern. The inside edge eyelet shall be 1/2 to 5/8 inch from front edge of fly lining.	Buttonhole		70-74 per buttonhole	30	50	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
14.	Make left fly front. (cont'd)						
	e. Position fusible interlining to top fly as indicated by marks on pattern and fuse. If alternate interlining (basic material) is used, it shall be stitched to top fly 1/16 to 1/8 inch from all edges.	301	SSa-1	10-12	50	50	
	f. Position buttonhole fly to top fly piece with raw edges above and below notches, even and front edge of buttonhole fly 3/4 inch back of top fly piece raw edge. Make three vertical tacks or bartacks centered between the four buttonholes and superimposed on fly facing edge stitching.	Bartack or 301	 LSbj-1	28 per bartack 10-12	50 50	50 50	
15.	Attach labels and storm tab.						
	a. Stitch size label to right front facing approximately one inch below bottom front body button.	301	LSbj-1	8-12	50	50	
	b. Position identification label under the size label. The top edge of identification label may be caught in the bottom row of stitching of the size label.	301	LSbj-1	8-12	50	50	
	c. Position the instruction label under the identification label. The top edge of instruction label may be caught in the bottom row of stitching of identification label.	301	LSbj-1	8-12	50	50	
	d. When combination label is used it shall be positioned as in a. above. The label shall be stitched on all four sides, and the stitching shall not be through the printing.	301	LSbj-1	8-12	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

NO.	TABLE II. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
15.	Attach labels and storm tab. (cont'd)						
	e. Position storm tab on left front facing at marks indicated on pattern, with raw edge of tab parallel to front edge of facing. Stitch to facing 1/4 inch from raw edge. Turn tab to finished position (point of tab toward front of facing) and stitch enclosing the raw edge. Continue stitching across the top of tab with stitching superimposed on the horizontal edge stitching of the tab. The purling of the button-hole shall face the wearer on the finished coat.	301 or 401 and 301	LSs-2(a) LSs-2(a) LSs-2(b)	10-12 10-12 10-12	50 50 50	50 70 50	
16.	Make lining (yoke).						
	a. Join front lining to front sleeve lining at arm-hole with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50 70 (overedge stitching)	70 70 (chain stitching)	
	b. Position front edge of back sleeve lining and front edge of cape to shoulder edge of front lining and safety stitch with stitching continued the entire length of sleeve.	515 or 516 or 519	SSa-2	10-12	50 70 (overedge stitching)	70 70 (chain stitching)	
	c. Position back edge of cape and back edge of back sleeve lining to front edge of back lining and safety stitch to bottom of armhole.	515 or 516 or 519	SSa-2	10-12	50 70 (overedge stitching)	70 70 (chain stitching)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

NO.	TABLE II. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
16.	Make lining (yoke). (cont'd)						
	d. Close side seam of front and back lining and underarm seam of sleeve in one operation with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50 (chain stitching) 70 (overedge stitching)	70 70	
	e. Hem bottom of lining with raw edge turned under. Hem shall finish 3/8 to 5/8 inch in width.	301	EFb-1	10-12	50	50	
17.	Make back and vent.						
	a. Position the back parts together face to face with the edge of the right back folded over the left back. Insert the seam web against the left back under the folded edge of the right back. The seam web shall extend from the top of the vent to the neck of the coat.						
	b. Stitch back pieces together (1/2 inch below top of vent to neckline) 1/16 to 3/32 inch from raw edge, catching the seam web in the stitching.	301 or 401	SSw-2(a) SSw-2(a)	10-12 10-12	50 50	50 70	
	c. Press the seam, fusing the seam web and also forming left vent edge.						
	d. Turn seam toward left back and raise stitch 1/4 to 5/16 inch from fold of seam. Fold left vent in accordance with marks on pattern and continue the stitching to the bottom of the vent, catching the raw edge of the first fold of the vent in the stitching.	301	SSw-2(b)	10-12	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
17.	Make back and vent. (cont'd)						
	e. Fold right side of vent as indicated by marks on pattern and, with raw edge turned under, stitch 1/16 to 3/32 inch from back turned edge.	301	EFb-1	10-12	50	50	
	f. With right side of vent overlapping left side, box stitch top of vent through all plies. The box stitching shall be diagonal to the center seam (approximately 45°) and shall measure 1-1/4 ± 1/4 inches long and 3/8 ± 1/8 inch wide.	301		10-12	50	50	
	g. Make a 1/2 inch straight cut buttonhole in right side of vent, positioned as indicated by marks on pattern.	Buttonhole or 101		44-48 per buttonhole	30 50	50	
18.	Join sleeves to body.						
	a. Stitch front sleeve to front armhole from shoulder 3 ± 1/2 inches below the step on front.	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12	50 50	50 70	
	b. Turn and raise stitch seam 1/4 to 5/16 inch with stitching on front to step as marked on pattern. At step, turn and stitch to joining seamline.	301	LSq-2(b)	10-12	50	50	
	c Stitch back sleeve to back armhole from neckline 3 ± 1/2 inches below the step on back.	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12	50 50	50 70	
	d. Turn and raise stitch seam 1/4 to 5/16 inch with stitching on back to step as marked on pattern. At step, turn and stitch to joining seamline.	301	LSq-2(b)	10-12	50	50	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
19.	Close sides.						
	a. Position fronts to back, face to face with edge of front folded over edge of back. Insert seam web on back under the folded edge of front, and stitch sides together 1/16 to 3/32 inch from raw edge, catching the seam web in the stitching.	301 or 401	SSw-2(a) SSw-2(a)	10-12 10-12	50 50	50 70	
	b. Press the seam, fusing the seam web.						
	c. Turn seam toward back, and raise stitch 1/4 to 5/16 inch from folded edge of seam.	301	SSw-2(b)	10-12	50	50	
20.	Close sleeves.						
	a. Join top arm seam from neckline to bottom of sleeve simultaneously stitching fusible tape to back edge of front sleeve.	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12	50 50	50 70	
	b. Turn seam toward front and raise stitch 1/4 to 5/16 inch from folded edge.	301	LSq-2(b)	10-12	50	50	
	c. Press the seam, fusing the seam web.						
	d. Stitch sleeve hem interlining to bottom of sleeve as indicated by marks on pattern. When alternate fusible is used for sleeve hem interlining, it shall be fused to sleeve prior to joining.	301	LSbj-1	6-12	50	50	
	e. Stitch underarm seam.	301	SSa-1	10-12	50	50	
	f. Complete the stitching of sleeve to armhole.	301	SSa-1	10-12	50	50	
	g. Press underarm seam open and flat.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
21.	Attach collar to coat.						
	a. Stitch a 3/16 inch reinforcement tape (see 3.3.6) to inside of neck edge from lapel notch to shoulder seam.	301	LSbj-1	8-12	50	50	
	b. Stitch collar to coat with notches matching. Slash front neckline seam allowance, as necessary.	301 or 401	SSa-1	10-12 10-12	50 50	50 70	
22.	Attach lining to facing.						
	a. Mark facing 1-1/4 inches from bound back edge for position of lining.						
	b. Position raw edge of lining to marks on facings and stitch lining to facing forming a 1 inch pleat at center back. The fold of the pleat shall be toward the left of the face side of the lining.	301	LSa-1	10-12	50	50	
23.	Attach facing assembly to shell.						
	a. Position facings to front and neckline with raw edges even and stitch across neckline through coat, collar stand and collar. Continue stitching across lapels, down fronts and across bottom of facing. The left facing shall lap the right facing at center back. The lapel shall be uniform in size and shape.	301 301	SSe-2(a) and LSq-2(a)	10-12 10-12	50 50	50 50	
	b. Turn neck facing and raise stitch across neckline 1/16 to 3/32 inch from edge, the length of the collar stand. The stitching shall not be visible on outside of coat.	301	LSq-2(b)	10-12	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
23.	Attach facing assembly to shell. (cont'd)						
	c. Safety stitch bottom raw edge of sleeve lining to bottom of sleeve catching interlining with not less than 3/8 inch seam.	515 or 516 or 519	SSa-2	10-12	50 70	70 70	
	d. Turn up bottom of sleeve at hem notch; align underarm seams of lining and shell with the bottom of sleeve lining extending down 3/8 ± 1/8 inch (total circumference) from the sleeve lining to bottom of sleeve joining seam, and stitch together for a distance of 6-1/2 ± 1/2 inches, beginning 3 ± 1/2 inches from folded edge.	301		10-12	50	50	
	- or -						
	e. In lieu of operations 23.c and 23.d, overedge stitch together bottom raw edges of sleeve lining and bottom of sleeve catching interlining.	502 or 503 or 504	EFd-1	6-12	70	70	
	f. Stitch sleeve lining to sleeve 1 inch from bottom of overedged seam of lining and shell.	301	SSa-1	10-12	50	50	
	g. Turn up bottom of sleeve at hem notch; align underarm seam of lining and shell and stitch together for a distance of 6-1/2 ± 1/2 inches, beginning 3 ± 1/2 inches from folded edge.	301		10-12	50	50	
24.	Attach keeper loops.						
	With ends of keeper loop turned under 3/8 inch, position loop on shoulder centered at junction of sleeve outseam and front armhole joining seam. Bartack each end 1/8 to 3/16 inch from turned ends (see operation 1.c.).	Bartack		28 per bartack	50	50	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
25.	Anchor lining to side seams.						
	Tack lining side seams with 3/8 to 1/2 inch vertical bartack or 1/2 inch automatic straight tack 2 to 3 inches below the sleeve setting seam.	Bartack or 301		28 per bartack 28 per bartack	50 50	50 50	
26.	Hem bottom of coat.						
	Turn in raw edge and hem bottom of coat. The hem shall finish 1 + 1/8 inches wide. The turned in raw edge may be stitched prior to hemming.	301	EFb-1	10-12	50	50	
27.	Finish coat and tack sleeve hem.						
	a. Turn facing; force out edges and edge stitch fronts 1/4 to 5/16 inch from edge across top of lapels, down fronts and across bottoms to back edge of facings.	301	SSe-2(b)	10-12	50	50	
	b. With sleeve turned to outside, place a vertical 1/2 to 3/4 inch line tack no less than 1/2 inch from bottom of sleeve. The line tack shall be placed in the turned in side of the lap seam from the outside of the finished sleeve.	301	EFa-1	10-12	50	50	
28.	Top stitch fly front.						
	Position fly front shaper on front and mark, extending the mark 1 + 1/8 inch below fly opening. Top stitch on mark line through all plies.	301	LSbj-1	10-12	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

NO.	TABLE II. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
29.	Make buttonhole.						
	a. Make a 7/8 inch cut length buttonhole on left lapel with inside edge of eyelet 1/2 to 5/8 inch from front edge and 3/4 ± 1/8 inch from top edge.	Buttonhole		50-54 per buttonhole	30	50	
	b. Tack ends of buttonhole stitching and gimp by machine. The purling of the buttonhole shall be on the facing side of coat.	Bartack		21 per bartack	50	50	
30.	Tack pocket to facing.						
	Tack back edge of facing to bottom of pocket with a 1/2 to 3/4 inch vertical tack. The tack shall not be more than 1/2 inch from bottom edge of pocket and approximately 1 inch from the edge of the binding.	Bartack		28 per bartack	50	50	
31.	Set slide fastener on coat.						
	a. Position the slide fastener on the coat facings so that the ends of the fastener are equidistant from bottom edge of the coat. The separating pin of the slide fastener shall be on the right facing (as worn).						
	b. Position the slide fastener on the underside of coat facings with the front edge of the chain 1/8 to 3/16 inch from the bound edge.						
	c. Turn in the end of the tape 1/2 to 3/4 inch and stitch the length of tape 3/16 to 5/16 inch from back edge of chain.	301	SSa-1	10-12	50	50	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
32.	Clean coats.						
	a. Trim thread ends and remove loose threads.						
	b. Remove spots, stains, and markings.						
	c. Remove shade tickets.						
33.	Press coat.						
	Press collar, fronts, backs, pockets, sleeves, and hems with steam pressing machine or hand pressing iron. Place coat on hanger after first pressing operation, until completion of assembly operations.						
34.	Sew on buttons.						
	a. Mark or gage buttons to correspond to buttonholes and marks on patterns.						
	b. Sew four 40-line buttons on right front 2 inches from front edge to correspond with buttonholes on left fly, with stitching through coat, facing, and an 18-line stay button. Buttons shall be shank wrapped.	101 or		14-16 per button	30		
		301 or		14-16 per button	30	30	
		Hand		4-6 double thread	30		
	c. Sew a 30-line button on right front lapel 7/8 inch from collar seam 3-1/2 inches from front edge, button shall be shank wrapped with stitching through coat, facing and an 18-line stay button.	101 or		14-16 per button	30		
		301 or		14-16 per button	30	30	
		Hand		4-6 double thread	30		

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
34.	Sew on buttons. (cont'd)						
	d. Sew a 30-line button on right front to correspond with buttonhole in storm tab, with stitching through coat, facing and an 18-line stay button shank wrap.	101 or		14-16 per button	30		
		301 or		14-16 per button	30	30	
		Hand		4-6 double thread	30		
	e. Sew a 30-line button on each shoulder 1-1/4 ± 1/8 inches from collar joining seam with the button positioned on the top arm seam shank wrap.	101 or		14-16 per button	30		
		301 or		14-16 per button	30	30	
		Hand		4-6 double thread	30		
	f. Sew a 24-line button on left side of vent on the inside to correspond to buttonhole on right side.	101 or		14-16 per button	30		
		301 or		14-16 per button	30	30	
		Hand		4-6 double thread	30		
	g. Sew two 24-line buttons, one on each side of the collar stand shall be positioned to align with tab buttonhole when tab is in either the stay or closed position.	101 or		14-16 per button	30		
		301 or		14-16 per button	30	30	
		Hand		4-6 double thread	30		

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
34.	Sew on buttons. (cont'd)						
	h. Sew a 24-line button to the underarm seam of each sleeve corresponding to loops on liner. The stitch shall be through seam and coat.	101 or		14-16 per button	30		
		301 or		14-16 per button	30	30	
		Hand		4-6 double thread	30		
35.	Attach shoulder loops.						
	Slide shoulder loops through keeper loop and fasten both ends to button on shoulder. The pointed end of the epaulets shall be on top.						
	MAKE LINER						
36.	Attach sleeves to liner body.						
	a. Position front sleeve to front of liner as indicated by marks on pattern and safety stitch around armhole.	515 or	SSa-2	10-12	50	70	
					(chain stitching)		
		516 or 519			70 (overedge stitching)	70	
	b. Position front edge of back sleeve to shoulder edge of front of liner and safety stitch with stitching continued the entire length of sleeve.	515 or	SSa-2	10-12	50	70	
					(chain stitching)		
		516 or 519			70 (overedge stitching)	70	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

NO.	TABLE II. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
36.	Attach sleeves to liner body. (cont'd)						
	c. Position back edge of back sleeve to front edge of back liner and safety stitch to bottom of armhole.	515 or	SSa-2	10-12	50 (chain stitching)	70	
		516 or 519			70 (overedge stitching)	70	
	d. Close side seams of front and back of liner and underarm seam of sleeve in one operation with a safety stitch.	515 or	SSa-2	10-12	50 (chain stitching)	70	
		516 or 519			70 (overedge stitching)	70	
37.	Bind edges of liner.						
	Finished appearance. The binding shall be uniformly stitched with no raw edges showing. The fabric shall be caught in the stitching. The binding shall finish 1/4 ± 1/16 inch wide.						
	a. Bind edges of vent, bottom fronts and neck of liner in one operation. The binding shall start and finish other than at the top of vent and the end shall be turned in and caught in the stitching. The ends of the binding shall overlap not less than 1/2 inch with the end of the binding turned over on itself and securely stitched or bartacked.	301 or	BSc-1	10-12	50	50	
		401 or	BSc-1	10-12	50	70	
		Bartack		28 per bartack	50	50	
	b. Bind sleeve bottoms with binding starting and finishing at underarm seam. The end of the binding shall be formed into a loop to accommodate the 24-line button on coat lining. The end of binding shall be bartacked or securely stitched.	301 or	BSc-1	10-12	50	50	
		401 or	BSc-1	10-12	50	70	
		Bartack		28 per bartack	50	50	

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

NO.	TABLE II. (cont'd) MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
37.	Bind edges of liner. (cont'd)						
	c. Bind pocket pass-through opening. The ends of binding shall start and finish at other than the top and bottom of opening and shall overlap not less than 1/2 inch. The end of the binding shall be turned over onto itself and securely stitched or bartacked.	301	BSc-1	10-12	50	50	
38.	Attach size, identification, and instruction labels.						
	a. Position the size label on the center back on the pile side of liner so that the top edge of label shall be 1-1/4 to 1-3/4 inches from the bottom of the binding. Stitch label on all four sides.	301	LSbj-1	10-12	50	50	
	b. Center identification label under the size label. The top edge of the identification label may be caugh in the bottom row of stitching of the size label.	301	LSbj-1	10-12	50	50	
	c. Position the instruction label under the identification label. The top edge of instruction label may be caught in the bottom row of stitching of identification label.	301	LSbj-1	10-12	50	50	
	d. When combination label is used, it shall be positioned as in a. above. The label shall be stitched on all four sides and the stitching shall not be through the printing.	301	LSbj-1	10-12	50	50	
39.	Set slide fastener on liner.						
	a. Position the slide fastener on the underside of liner with the back edge of the chain immediately adjacent to bound edge of liner.						

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE II. (cont'd)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM AND STITCHING TYPE	STITCHES PER INCH	THREAD		
					NEEDLE	BOBBIN/ LOOPER	COVER
39.	Set slide fastener on liner. (cont'd)						
	b. Turn in the raw edge of the slide fastener tape 1/2 to 3/4 inch, and stitch the length of the tape with the stitching superimposed on the binding stitching.	301	LSa-1	10-12	50	50	
	c. The slider shall be positioned on right side of liner (as worn).						
40.	Clean liners.						
	Trim all thread ends and remove loose thread. Remove all spots, stains, and shade tickets.						
41.	Attach liner to coat.						
	Attach liner to coat by means of the slide fastener, checking the finished operation to insure free and easy manipulation of the slider. There shall be no bulging or distortion of the coat or liner when fastener is engaged. The liner shall match the coat in size.						

NATICK Form 903
1 Dec 76 EDITION OF 1 OCT 76 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

3.8 Measurements. The finished coats shall conform to measurements shown in tables III and IV.

TABLE III. Coat measurements (in inches)

Size	30	32	34	36	38	40	42	44	46	48	Tolerance
1/2 Breast 1/:											
X-Short	-	21-5/8	22-5/8	23-5/8	24-5/8	25-5/8	26-5/8	-	-	-	± 1/2
Short	20-5/8	21-5/8	22-5/8	23-5/8	24-5/8	25-5/8	26-5/8	27-5/8	28-5/8	-	± 1/2
Regular	20-5/8	21-5/8	22-5/8	23-5/8	24-5/8	25-5/8	26-5/8	27-5/8	28-5/8	29-5/8	± 1/2
Long	-	21-5/8	22-5/8	23-5/8	24-5/8	25-5/8	26-5/8	27-5/8	28-5/8	29-5/8	± 1/2
X-Long	-	-	22-5/8	23-5/8	24-5/8	25-5/8	26-5/8	27-5/8	28-5/8	29-5/8	± 1/2
Sleeve Length 2/:											
X-Short	-	15-1/2	15-1/2	15-1/2	15-1/2	15-1/2	15-1/2	-	-	-	± 1/2
Short	16-1/2	16-1/2	16-1/2	16-1/2	16-1/2	16-1/2	16-1/2	16-1/2	16-1/2	-	± 1/2
Regular	17-1/2	17-1/2	17-1/2	17-1/2	17-1/2	17-1/2	17-1/2	17-1/2	17-1/2	17-1/2	± 1/2
Long	-	18-1/2	18-1/2	18-1/2	18-1/2	18-1/2	18-1/2	18-1/2	18-1/2	18-1/2	± 1/2
X-Long	-	-	19-1/2	19-1/2	19-1/2	19-1/2	19-1/2	19-1/2	19-1/2	19-1/2	± 1/2
Back Length 3/:											
X-Short	-	39-1/8	39-3/8	39-5/8	39-7/8	40-1/8	40-3/8	-	-	-	+ 1/2, -3/4
Short	40-3/8	40-5/8	40-7/8	41-1/8	41-3/8	41-5/8	41-7/8	42-1/8	42-3/8	-	+ 1/2, -3/4
Regular	42-3/8	42-5/8	42-7/8	43-1/8	43-3/8	43-5/8	43-7/8	44-1/8	44-3/8	44-5/8	+ 1/2, -3/4
Long	-	44-5/8	44-7/8	45-1/8	45-3/8	45-5/8	45-7/8	46-1/8	46-3/8	46-5/8	+ 1/2, -3/4
X-Long	-	-	46-7/8	47-1/8	47-3/8	47-5/8	47-7/8	48-1/8	48-3/8	48-5/8	+ 1/2, -3/4

The coat shall be buttoned without liner, placed flat on a table and measured as follows:

1/ 1/2 Breast - Measure from folded edge to folded edge at base of armhole across the front.

2/ Sleeve length - Measure underarm seam from armhole seam to bottom of sleeve.

3/ Back length - Measure from undercollar seam down center back to bottom of coat.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE IV. Liner measurements (in inches)

Size	30	32	34	36	38	40	42	44	46	48	Tolerance
1/2 Breast 1/:											
X-Short	-	18	19	20	21	22	23	-	-	-	± 1/2
Short	17	18	19	20	21	22	23	24	25	-	± 1/2
Regular	17	18	19	20	21	22	23	24	25	26	± 1/2
Long	-	18	19	20	21	22	23	24	25	26	± 1/2
X-Long	-	-	19	20	21	22	23	24	25	26	± 1/2
Sleeve length 2/:											
X-Short	-	15	15	15	15	15	15	-	-	-	± 1/2
Short	16	16	16	16	16	16	16	16	16	-	± 1/2
Regular	17	17	17	17	17	17	17	17	17	17	± 1/2
Long	-	18	18	18	18	18	18	18	18	18	± 1/2
X-Long	-	-	19	19	19	19	19	19	19	19	± 1/2
Back length 3/:											
X-Short	-	32-1/4	32-1/2	32-3/4	33	33-1/4	33-1/2	-	-	-	+ 1/2, - 1
Short	33-1/2	33-3/4	34	34-1/4	34-1/2	34-3/4	35	35-1/4	35-1/2	-	+ 1/2, - 1
Regular	35-1/2	35-3/4	36	36-1/4	36-1/2	36-3/4	37	37-1/4	37-1/2	37-3/4	+ 1/2, - 1
Long	-	37-3/4	38	38-1/4	38-1/2	38-3/4	39	39-1/4.	39-1/2	39-3/4	+ 1/2, - 1
X-Long	-	-	40	40-1/4	40-1/2	40-3/4	41	41-1/4	41-1/2	41-3/4	+ 1/2, - 1

The liner shall be placed flat on a table and measured as follows:

1/ 1/2 Breast - Fold liner in half (down center back) and measure from front edge to back folded edge at base of armhole.

2/ Sleeve length - Measure underarm seam from sleeve joining seam to bottom of sleeve.

3/ Back length - Measure from neck edge to bottom of liner.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

3.9 Workmanship. The finished coats and liners shall conform to the quality of product established by this document. The occurrence of defects shall not exceed the applicable acceptable point values.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in this document where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this document shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the document shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.1.2 Responsibility for dimensional requirements. Unless otherwise specified in the contract or purchase order, the contractor is responsible for assuring that all specified dimensions have been met. When dimensions cannot be examined on the end item, inspection shall be made at any point, or at all points in the manufacturing process necessary to assure compliance with all dimensional requirements.

4.1.3 Certificate of compliance. Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.3).
b. Quality conformance inspection (see 4.4).

4.3 First article inspection. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.4.3, and tested for the characteristics specified in 4.4.4.

4.4 Quality conformance inspection. Unless otherwise specified, sampling for inspection shall be performed in accordance with MIL-STD-105.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

4.4.1 Component and material inspection. In accordance with 4.1, components and materials shall be inspected in accordance with all requirements of referenced documents unless otherwise excluded, amended, modified, or qualified in this document or applicable purchase document. In addition, testing shall be performed on components listed in table V for characteristics noted. The methods of testing specified in FED-STD-191 wherever applicable and as listed in table V shall be followed. All requirements are applicable to the sample unit. All test reports shall contain the individual values used in expressing the final result. The component lot shall be unacceptable if one or more sample units fail to meet any of the test requirements specified. The lot size and sample size shall be in accordance with the following:

Lot size	Sample size (sample units)
800 or less	2
801 to 22,000 inclusive	3
22,001 and over	5

The basis for lot size and sample units for testing shall be as follows:

Component	Lot size expressed in	Sample unit for testing
Cloth, nylon, Marquisette	Yards	1 yard full width
Tape, polyester, for neck edge	Yards	1/2 linear yard
Cloth, rayon, twill	Yards	1/2 yard full width
Cloth, black, cotton, plain weave or polyester spunlaced nonwoven (fusible)	Yards	1 yard full width
Tape, non-woven polyamide fusible web for seams	Yards	1/2 linear yard
Fusible interlining fused to basic cloth	Yards	two 24 by 24 inch specimens 1/

1/ Prepared by the contractor during the same period and under the same conditions as for the fusing of the end item.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

TABLE V. Component and material tests

Component	Characteristic	Requirement paragraph	Test method
Cloth, nylon, Marquisette	Weave	3.3.5	Visual
	Weight	3.3.5	5041
	Yarns per inch	3.3.5	5050
	Thickness	3.3.5	5030
	Breaking strength	3.3.5	5100
	Stiffness	3.3.5	5202
Tape, polyester for neck edge	Weave	3.3.6	Visual
	Width	3.3.6	5020
	Yarns per inch	3.3.6	5050
Cloth, rayon, twill (when applicable)	Width	3.3.8	5020
	Weight	3.3.8	5041
	Yarns per inch	3.3.8	5050
	Weave	3.3.8	Visual
	Yarn size	3.3.8	1/
	Colorfastness to:		
	- laundering	3.3.8.1	5610
	- drycleaning	3.3.8.1	5622
	- crocking	3.3.8.1	5651
Cloth, black, cotton, plain weave or polyester spunlaced nonwoven (fusible)	Weight	3.3.9.1	5041
	Yarns per inch	3.3.9.1	5050
	Breaking strength	3.3.9.1	5100
Polyamide fusible web for seams	Width	3.3.9.2	5020
	Weight	3.3.9.2	5041
All dyed fusible interlinings	Colorfastness:		
	- laundering	3.3.9.3	5610
Interlining fused to basic cloth	Bond strength:		
	- initial	3.3.9.5.1	5951
	- after 3 launderings	3.3.9.5.1	4.5.1 and 5951
	- after 3 drycleanings	3.3.9.5.1	5580 2/ and 5951
	Shrinkage		
	- after 1 laundering	3.3.9.6	3/

1/ A certificate of compliance will be acceptable for this requirement.

2/ Pressing and shrinkage requirements shall not apply.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

3/ The specimens shall be prepared in accordance with Method 5556 and subjected to one wash and dry cycle as specified in 4.5.1. The shrinkage of the specimens shall then be calculated in accordance with Method 5556. The specimens may then be subjected to two additional wash and dry cycles and used for determination of the bond strength after 3 launderings.

4.4.2 In-process inspection. During the cutting of the parts from the basic material (see table II operation 1.b.) and also during the fabrication of the coat, in-process inspection shall be performed to assure that the parts, where required, are cut and assembled with the glossy side to the outside. Whenever nonconformance is noted, corrections shall be made to the parts affected and lot in-process. Parts which cannot be corrected shall be removed from production.

4.4.3 Point count inspection. Sampling and inspection provisions for end item examination, dimensional examination, and packaging examination shall be performed in accordance with MIL-STD-1494 except that for end item examination, the slider location on liner defect shall be as follows:

Defect	Point value
Slider positioned on left side of liner	3

4.4.4 End item testing. The end items shall be tested as specified in table VI. The sample unit shall be one coat. The lot shall be unacceptable if any sample unit fails one or more tests. The sample size shall be as follows:

Lot size (coats)	Sample size (sample units)
800 or less	2
801 to 22,000 inclusive	3
22,001 and over	5

TABLE VI. End item tests

Characteristic	Requirement paragraph	Test method
Bond strength of fused areas - after 3 launderings	3.3.9.5.2	4.5.1 and 5951 1/
Strike through of adhesive	3.3.9.5.2	Visual

1/ Method 5951 shall be followed except that the bond strength shall be based on the average of four specimens. The specimens shall be taken from the front facings and/or fly areas. It will be necessary to remove buttons and/or stitching to obtain the required number of specimens. When four fully laminated specimens cannot be obtained, partially or fully delaminated specimens shall be included in the average.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

4.4.5 Palletization examination. The fully packaged and palletized end items shall be examined for the defects listed below. The lot size shall be expressed in units of palletized unit loads. The sample unit shall be one palletized unit load, fully packaged. The inspection level shall be S-1 and the AQL, expressed in terms of defects per hundred units, shall be 6.5.

Examine	Defect
Finished dimensions	Length, width, or height exceeds specified maximum requirement.
Palletization	Pallet pattern not as specified. Interlocking of loads not as specified. Load not bonded with required straps as specified.
Weight	Exceeds maximum load limits.
Marking	Omitted; incorrect; illegible; of improper size, location, sequence, or method of application.

4.5 Methods of inspection.

4.5.1 Laundering procedure.

4.5.1.1 Apparatus and material used for laundering. The following apparatus and material are required for laundering:

a. Automatic washing machine (see 6.6).
b. Automatic dryer (see 6.6).
c. AATCC Standard Detergent 124 or equivalent.
d. Dummy pieces for ballast, 3 feet by 3 feet hemmed pieces of the basic material to be added to test coats or fused specimens to make a 4-pound load.

4.5.1.2 Procedure. If the coats or fused specimens weigh less than 4 pounds, ballast to make up a standard 4-pound load shall be added to the test coats or fused specimens. The ballast shall consist of pieces of the basic fabric. The pieces shall be hemmed and measure 3 feet by 3 feet. The washer shall be set for high water level, warm water temperature, and a 12-minute wash on the wash and wear cycle. The water used shall have a hardness not greater than 50 parts per million (PPM). The wash temperature shall be 140° ± 5°F. When the washer has filled, add 140 g of detergent. Allow the washer to proceed automatically through the final spin cycle. Remove the coats or fused specimens immediately at the completion of the final spin and separate the coats or fused specimens and dummy pieces, when required, if tangled. Place the complete washed load in the dryer and dry at the normal cycle and at a setting which generates an exhaust temperature range of 140° to 160°F. Operate the dryer until the load is dry and continue tumbling 5 minutes with the heat turned off (cool-down cycle). Remove the load immediately after the machine stops. Repeat the wash and dry cycle until the load has completed three cycles.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1 Preservation. Preservation shall be level A or Commercial, as specified (see 6.2).

5.1.1 Level A. Each coat shall be buttoned at the top front, and then folded to measure approximately 23 by 15 inches. Each folded coat shall be inserted into a close-fitting flat style clear polyethylene film bag conforming to A-A-50083.

5.1.2 Commercial. Each coat shall be preserved in accordance with ASTM D 3951.

5.2 Packing. Packing shall be level A, B, or Commercial as specified (see 6.2).

5.2.1 Level A packing. Eight coats of one size only, preserved as specified in 5.1, shall be packed in a fiberboard shipping container conforming to style RSC-L, grade V2s of PPP-B-636. The inside of each shipping container shall be fitted with a box liner conforming to type CF, class weather-resistant, variety DW, grade V15c of PPP-B-636. Level A unit packs shall be packed flat, eight in depth, and alternately reversed top to bottom within a shipping container. Inside dimensions of each shipping container shall approximate 24 inches in length, 16 inches in width, and 16 inches in depth. Approximate dimensions are furnished as a guide only. Each shipping container shall be closed in accordance with method III, waterproofed in accordance with method V, and reinforced as specified in the appendix of PPP-B-636, except that the inspection shall be in accordance with 4.4.3. Shipping containers shall be arranged in unit loads in accordance with MIL-L-35078 for the type and class of load specified (see 6.2). Strapping shall be limited to nonmetallic strapping, except for type II, class F loads.

5.2.2 Level B packing. Eight coats of one size only, preserved as specified in 5.1, shall be packed in a fiberboard shipping container conforming to style RSC-L, type CF (variety SW) or SF, class domestic, grade 275 of PPP-B-636. The inside of each shipping container shall be fitted with a box liner conforming to type CF, class domestic, variety DW, grade 275 of PPP-B-636. Level A unit packs shall be packed flat, eight in depth, and alternately reversed top to bottom within a shipping container. Inside dimensions of each shipping container shall approximate 24 inches in length, 16 inches in width, and 16 inches in depth. Approximate dimensions are furnished as a guide only. Each shipping container shall be closed in accordance with method II as specified in the appendix of PPP-B-636, except that the inspection shall be in accordance with 4.4.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

5.2.2.1 Weather-resistant fiberboard containers. When specified (see 6.2), the shipping container shall be a grade V3c, V3s or V4s fiberboard box fabricated in accordance with PPP-B-636 and closed in accordance with method III as specified in the appendix of PPP-B-636, except that the inspection shall be in accordance with 4.4.3.

5.2.3 Commercial. Coats, preserved as specified in 5.1, shall be packed in accordance with ASTM D 3951.

5.3 Palletization. When specified (see 6.2), coats, packed as specified in 5.2.2 and 5.2.3 shall be palletized on a 4-way entry pallet in accordance with load type Ia of MIL-STD-147. Pallet type shall be type I (4-way entry), type IV, or type V in accordance with MIL-STD-147. Pallets shall be fabricated from wood groups I, II, III, or IV of MIL-STD-731. Each prepared load shall be bonded with primary and secondary straps in accordance with bonding means K and L or bonding means O or P. Pallet pattern shall be number 3 in accordance with the appendix of MIL-STD-147. Interlocking of loads shall be effected by reversing the pattern of each course.

5.4 Marking. In addition to any special marking required by the contract or purchase order, shipping containers and palletized unit loads shall be marked in accordance with MIL-STD-129 or ASTM D 3951, as applicable.

5.4.1 Polyethylene bagged unit packs. Polyethylene bagged unit packs shall have the required identification information legibly printed or stamped in black directly on the bag across the center face or on a white paper label inserted within the bag so as to permit ready identification.

6. NOTES

6.1 Intended use. The coats are intended for wear by male personnel of the Department of the Army.

6.2 Ordering data. Acquisition documents should specify the following:

a. Title, number, and date of this document.
b. Size required (see 1.2).
c. When a first article sample is required (see 3.2, 4.3 and 6.4).
d. Selection of applicable levels of preparation and packing (see 5.1 and 5.2).
e. Type and class of unit load required (see 5.2.1).
f. When weather-resistant grade fiberboard shipping containers are required for level B packing (see 5.2.2.1).
g. When palletization is required (see 5.3).

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

6.3 Samples. For access to samples, address the contracting activity issuing the invitation for bids.

6.4 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a preproduction sample. The contracting officer should specify the appropriate type of first article and the number of units to be furnished. The contracting officer should include specific instructions in all acquisition instruments regarding arrangements for selection, inspection, and approval of the first article.

6.5 Fusing conditions. The following fusing conditions were established to include recommended requirements of several fusible contractors. These limits are furnished for guidance only. For optimum results with the particular fusible used, specific machine setting should be obtained from the contractor furnishing the fusible material.

Cotton plain weave fusible

	Min.	Max.
Temperature (between pressing surfaces)	275°F	320°F
Pressure (between pressing surfaces) Bar (psi)	2 (29.4)	4 (58.8)
Pressing dwell time, seconds	8	12

100% polyester spunlaced non-woven fusible

	Min.	Max.
Temperature (between pressing surfaces)	347°F	365°F
Pressure (between pressing surfaces) Bar (psi)	5 (73.5)	6 (88.2)
Pressing, dwell time, seconds	8.0	9.0

6.6 Recommended apparatus. The recommended apparatus for 4.5.1.1.a and b are:

a. Kenmore Automatic Washer Model 600 or similar machine. In case of dispute the Kenmore Model 600 shall be used.
b. Kenmore Automatic Dryer Model 600 or equivalent.

6.7 Recycled material. It is encouraged that recycled material be used when practical as long as it meets the requirements of the document (see 3.3).

6.8 Subject term (key word) listing.

Coat, all weather
Liner, removable
Man's clothing

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

6.9 Changes from previous issue. Asterisks are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

Custodian:

Army - GL

Review activities:


Army - MD
DLA - CT

Preparing activity:


Army - GL

Project No. 8405-A040

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

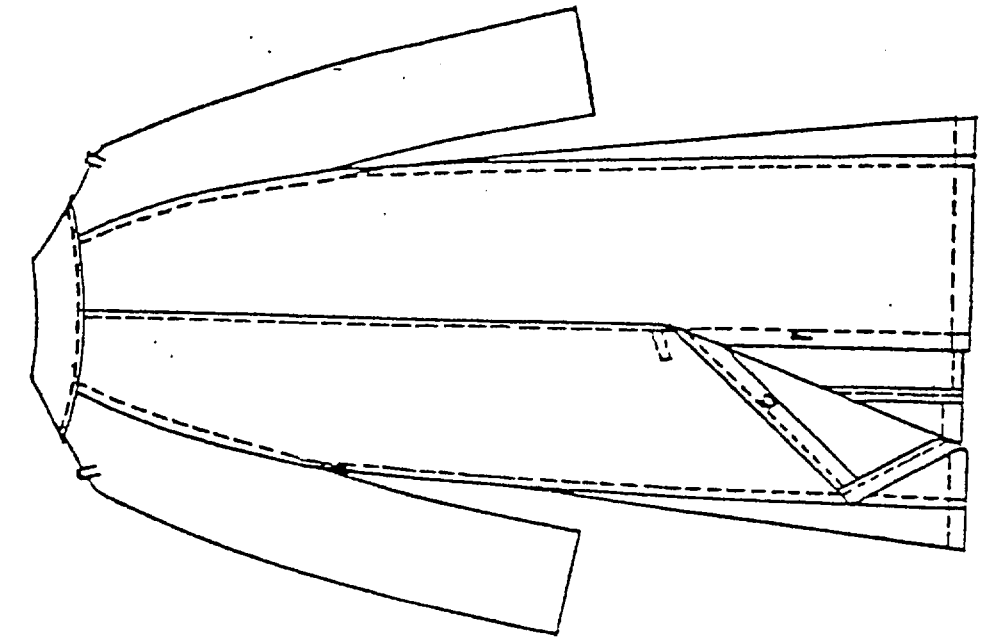


BACK

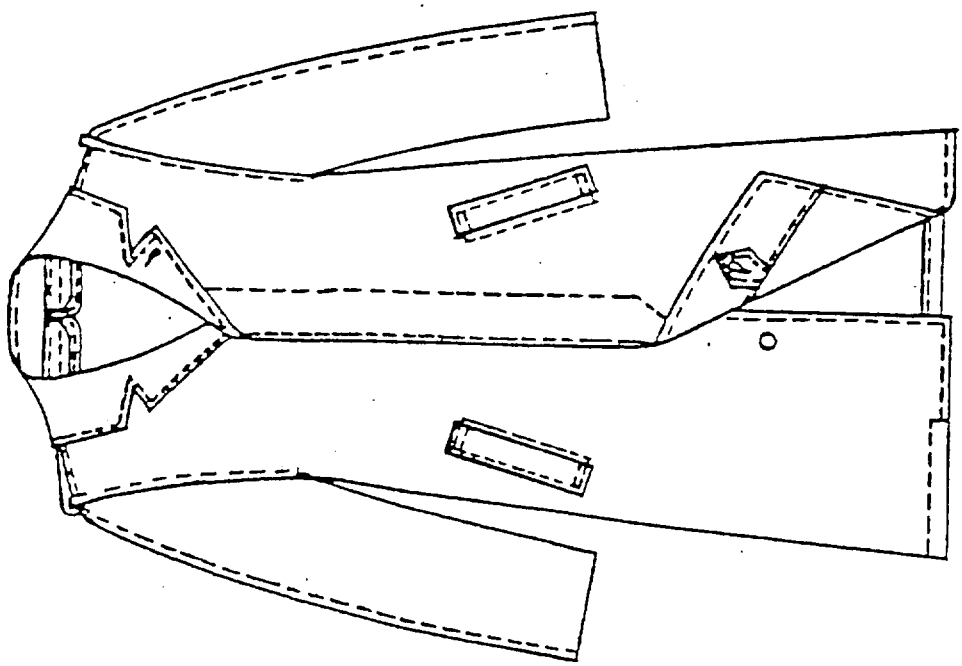


FRONT

FIG. 1 COAT, ALL WEATHER, MAN'S, BLACK, WITH REMOVABLE LINER

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

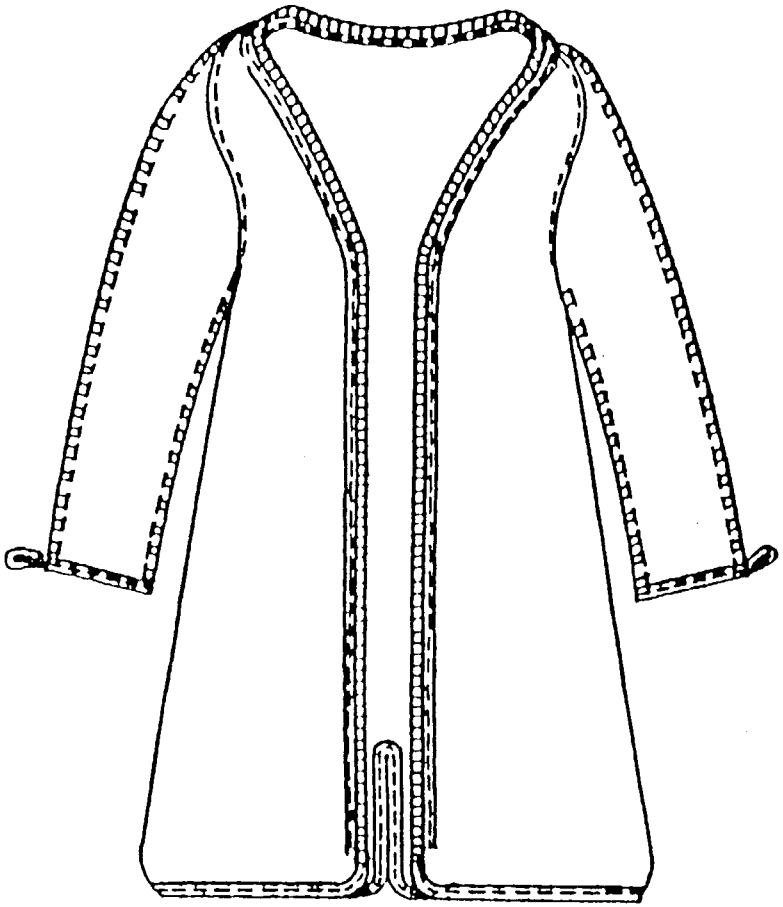

FRONT

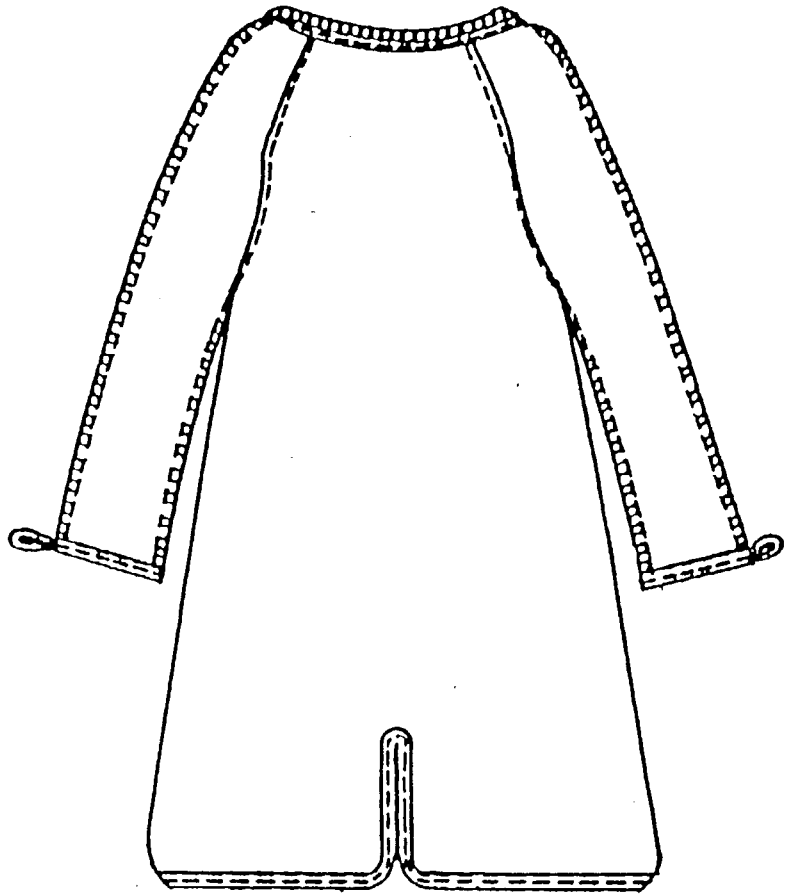

BACK

FIG. 2 REMOVABLE LINER FOR COAT, ALL WEATHER, MAN'S, BLACK

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-C-44030B(GL)	Coat, All-Weather, Man's, Black, With Removable Liner

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE. NATICK/DP1 Feb 86

Source: https://assist.dla.mil – Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE ARMY

U.S. ARMY NATICK RESEARCH, DEVELOPMENT
and ENGINEERING CENTER
ATTN: STRNC-ES
Natick, MA 01760-5014

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12062 WASHINGTON D. C.

POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

Commander
U.S. Army Natick Research, Development
and Engineering Center
ATTN: STRNC-ES
Natick, MA 01760-5014

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T23:26Z
Check the source to verify that this is the current version before use.