MIL-C-87110A(USAF)
4 February 1988
SUPERSEDING
MIL-R-87110 (USAF)
5 May 1977

MILITARY SPECIFICATION

COAT, ALL-WEATHER: MAN'S, BLUE, WITH REMOVABLE LINER

This specification is approved for use within the Department of the Air Force, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirement for a man's all-weather coat with a removable synthetic fiber pile liner.

1.2 Classification. The all-weather coat shall be of one type furnished in the following lengths and sizes, as specified (see 6.2):

Schedule of lengths and sizes.

Extra short	34	36	38	40	42	44			
Short	34	36	38	40	42	44	46	48	
Regular	34	36	38	40	42	44	46	48	50
Long	34	36	38	40	42	44	46	48	50
Extra long	34	36	38	40	42	44	46		

2. APPLICABLE DOCUMENTS

2.1 Government documents

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: ASD/ENES, Wright-Patterson AFB OH 45433-6503 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

2.1.1 Specifications and standards. The following specifications and standards form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

A-A-50128	Cloth, Interlining, Nonwoven
V-B-871	Button, Sewing Hole, and Button, Staple, (Plastic)
V-F-106	Fasteners, Slide, Interlocking
V-T-280	Thread, Gimp, Cotton, Buttonhole
NN-P-71	Pallets, Material Handling, Wood, Stringer Construction, 2-Way and 4-Way (Partial)
UU-P-268	Paper, Kraft, Wrapping
DDD-L-20	Label: For Clothing, Equipage, and Tentage, (General Use)

MILITARY

MIL-B-371	Braid, Textile, Tubular
MIL-T-3530	Thread and Twine: Mildew Resistant or Water Repellent Treated
MIL-F-10884	Fasteners, Snap
MIL-P-15011	Pallets, Material Handling, Wood Post Construction, 4-Way Entry
MIL-B-17757	Boxes, Shipping, Fiberboard (Modular Sizes)
MIL-C-21852	Cloth, Taffeta, Nylon
MIL-C-29363	Cloth, Poplin: Polyester and Cotton (Water Repellent)
MIL-C-29365	Cloth, Nonwoven: Interlining, Fusible, Nylon and Polyester, Polyamid
MIL-C-43251	Cloth, Pile, Synthetic Fiber Pile
MIL-C-43525	Cloth, Satin, Acetate or Rayon Face and Rayon or Cotton Back
MIL-T-43548	Thread, Polyester Core: Cotton-, Rayon-, or Polyester-Covered
MIL-C-44192	Container, Shipping and Storage, Coat (Hanger Pack)

STANDARDS

FEDERAL

FED-STD-191	Textile Test Methods
FED-STD-751	Stitches, Seams, and Stitchings

MILITARY

MIL-STD-105	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	Marking for Shipment and Storage
MIL-STD-147	Palletized Unit Loads
MIL-STD-1494	Provisions for Evaluating Quality of Raincoats

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

2.1.2 Other Government document. The following other Government document forms a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

LAWS AND REGULATIONS

Rules and Regulations Under the Textile Fiber Products Identification Act

(Application for copies should be addressed to the Federal Trade Commission, Washington DC 20508-0001.)

(Copies of specifications, standards, and other Government documents required by contractors in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting activity.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted shall be those listed in the issue of the DoDISS specified in the solicitation. Unless otherwise specified, the issues of documents not listed in the DoDISS shall be the issue of the nongovernment documents which is current on the date of the solicitation.

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

ASTM D 3951 Standard Practice for Commercial Packaging

(Application for copies should be addressed to the American Society for Testing and Materials, 1916 Race St., Philadelphia PA 19103-1187.)

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense (DoD) Standard Color Card of Official Standardized Shades for Sewing Threads

Department of Defense (DoD) Standard Shades for Buttons

(Application for copies should be addressed to The Color Association of the United States, 343 Lexington Ave., New York NY 10016-0927.)

(Nongovernment standards and other publications are normally available from the organizations which prepare or which distribute the documents. These documents also may be available in or through libraries or other informational services.)

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 Standard samples. Standard samples, when furnished (see 6.3), are solely for guidance and information to the contractor. Variations from the document may appear in the samples, in which case the document shall govern.

3.2 First article. When specified in the contract or purchase order, a sample shall be subjected to first article inspection (see 4.4 and 6.2).

3.3 Materials (see 6.5)

3.3.1 Basic material. The basic material for the all-weather coat outer shell shall be a polyester and cotton, water repellent poplin cloth, USN Color Blue, Shade No. 3376, conforming to MIL-C-29363.

3.3.2 Liner material. The material for the removable liner shall be a synthetic fiber pile cloth conforming to class 2 of MIL-C-43251, except that the pH shall not apply.

3.3.3 Liner sleeves. The material for the sleeves of the liner shall conform to type I or II of MIL-C-43525, except that the color shall be black.

3.3.4 Sleeve hem interlining. The interlining for the sleeve hem of the outer shell shall be nonwoven cloth conforming to type I of A-A-50128 with the following exceptions: Staple polyester may be substituted for the staple nylon; the cloth shall weigh 2.3 to 2.7 ounces per square yard; and the thickness, at 0.6 pound per square inch (psi), shall be 0.010 to 0.016 inch.

3.3.5 Nylon taffeta cloth. The lining for the sleeves of the outer shell, the binding for the edge of the liner, and the binding for the back edge of the facings of the outer shell shall be nylon taffeta cloth, USN Color Blue, Shade No. 3376, conforming to type IV of MIL-C-21852.

3.3.6 Nylon cloth. The collar stand interlining shall be black color nylon, marquisette leno weave cloth conforming to the requirements of table I when tested as specified in 4.5.1. As an alternate, fusible material specified in 3.3.9.1 may be used for interlining the collar stand.

3.3.7 Material for hanger loop and sleeve liner button loop. The hanger loop and sleeve liner button loop shall be cotton or rayon braid, USN Color Black, Shade No. 385, conforming to type IX, class 1 of MIL-B-371 or the hanger loop shall be made of the basic material specified in 3.3.1.

3.3.8 Tape for reinforcing neckline. The tape for reinforcing the neckline of the outer shell and the liner shall be any fiber content 3/16-inch-wide stay tape that is commercially available and suitable for the purpose.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.3.9 Fusible materials

3.3.9.1 Fusible interlining. The fusible interlining for the front facings, the top collar, the under collar, the pocket welts, the fly piece and the shoulder loops shall be black conforming to class 3 of MIL-C-29365, except the fiber content shall be polyester and the minimum weight shall be 1.6 ounces per square yard. As an alternate, a spun laced 100 percent poly nonwoven black cloth which has a uniformly distributed dot system of polyvinyl chloride-polyvinyl acetate type fusible adhesive applied to one side in accordance with good commerical practice may be used as a fusible interlining and shall meet the requirements specified in table II when tested (see 4.5.1).

TABLE I. Nylon cloth.

Characteristics	Requirements
Weight	2.6 to 3.0 ounces per square yard
Threads:	
Warp	48 per inch (minimum)
Filling	24 per inch (minimum)
Thickness at 0.6 psi	0.012 to 0.016 inch
Breaking strength:	
Warp	110 pounds (minimum)
Filling	48 pounds (minimum)
Stiffness (warp)	0.008 inch-pound (minimum)

3.3.9.1.1 Interlining fused to basic cloth. The interlining, after fusing to the basic cloth, shall meet the bond strength and shrinkage requirements specified in table II when tested (see 4.5.1). The coat shall show no evidence of bubbling or delamination of the fused area and there shall be no "strike through" of the adhesive after fusing.

3.3.9.2 Seam tape. The material for fusing the center back, side, and sleeve out seams of the outer shell shall be a white, nonwoven polyamide fusible web, 3/8 ±1/16 inch wide and shall weigh 0.885 ounce per square yard (see 4.5.1).

3.3.9.3 Fusing conditions. The interlining shall be fused to the basic material on a fusing press. For optimum results with the particular fusible material and press used, specific settings should be obtained from the contractor of the fusible interlining (see 6.6).

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the currentversion before use.

TABLE II. Fusible nonwoven cloth.

Characteristics	Requirements
Weight	2.7 to 3.2 ounces per square yard
Breaking strength (machine direction):	
Warp	25 pounds per inch
Filling	10 pounds per inch
Shrinkage:	
After fusing to basic cloth	1 percent (maximum)
After 5 dry cleanings	2 percent (maximum)
Adhesion (bond strength per inch):	
Initial	22 ounces (minimum)
After 5 dry cleanings	18 ounces (minimum)

3.3.10 Labels. The outer shell and liner shall have a combination personal identification, identification and instruction label, and a size label conforming to DDD-L-20. The colorfastness to dry cleaning requirements of DDD-L-20 shall apply.

3.3.10.1 Combination personal identification, identification, and instruction label. The combination personal identification, identification, and instruction label for the outer shell and liner shall conform to type VI, classes 10 and 15 and shall include the following information:

Name
Service No.
Coat, All-Weather: Man's, Blue, with Removable Liner
8405-00-000-0000 (Example) 1/
DLA-100-00-0-0000 (Example) 1/
Fiber Products Act (information as applicable) 1/
Contractor: 1/

CLEANING INSTRUCTIONS
DRY CLEAN ONLY

1/ The contractor shall include the applicable information.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

3.3.10.2 Size label. The size label for the outer shell and liner shall conform to type VI, class 2. The sizes and lengths (extra short, short, regular, long, and extra long), may be abbreviated as follows: 34XS, 34S, 34R, 34L, and 34XL.

3.3.10.3 Combination personal identification, size, identification, and instruction label. As an option to 3.3.10.1, a combination personal identification, size, identification, and instruction label for the liner may be used. The combination label shall conform to type VI, classes 10 and 14 and shall include the following information:

Name
Service No.
34XS
8405-00-000-0000 (Example) 1/
Coat, All-Weather: Man's, Blue, with Removable Liner
DLA-100-00-0-0000 (Example) 1/
Fiber Products Act (information as applicable) 1/
Contractor: 1/

CLEANING INSTRUCTIONS
DRY CLEAN ONLY

1/ The contractor shall include the applicable information.

3.3.11 Thread. The thread for all seaming and stitching shall be shade Blue AB, C.A. 66044 (see DoD Standard Color Card) conforming to Ticket No. 30, 3 ply; Ticket No. 50, 2 or 3 ply; and Ticket No. 70, 2 ply of MIL-T-43548. The thread for seaming and stitching the outer shell shall be water repellent treated in accordance with type II, class 3 of MIL-T-3530. As an alternate, cotton thread, size 00/3 for stitching and 1A3 for buttonholes may be used.

3.3.11.1 Colorfastness. The dyed thread shall show fastness to light, perspiration, and wet drycleaning equal to or better than the standard sample (see 6.3). When no standard sample is available, the dyed thread shall show "good" fastness to light, perspiration, and wet drycleaning.

3.3.12 Gimp. The gimp for reinforcing buttonholes shall be shade Blue AB, C.A. 66044 (see DoD Standard Color Card) conforming to size no. 8, type I or II, of V-T-280.

3.3.13 Buttons. The buttons shall be shade Blue BU, C.A. 62002 (see DoD Standard Shades for Buttons). Except for the stay buttons, the buttons shall conform to type II, class D, style 20 or 21, size 40 lines (front fly); 30 lines (lapel and storm tab); 24 lines (sleeve tabs, collar tab, and liner sleeves); and 24 lines (back vent) of V-B-871. The stay buttons shall conform to type II, class D, style 15, size 18 lines of V-B-871. As an alternate to the 24-line button for the back vent, a 19-line button that is commercially available and that meets the requirements for type II, class D, style 20 or 21 of V-B-871 may be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.3.14 Slide fastener. The slide fastener shall conform to type IV, style 1, size L, short tab pull, aluminum or brass chain of V-F-106. The length of the slide fastener shall conform to the requirements specified in table III.

3.3.14.1 Tape for slide fastener. The slide fastener tape shall be dyed black and shall show colorfastness to dry cleaning equal to or better than the standard sample (see 6.3). When a standard sample is not available, the slide fastener tape shall show "good" fastness to dry cleaning.

TABLE III. Length of slide fasteners (inches).

Size of Coat	Extra Short	Short	Regular	Long	Extra Long
34	73	73	78	83	88
36	73	78	78	83	88
38	73	78	83	83	88
40	73	78	83	88	88
42	73	78	83	88	92
44	73	78	83	88	92
46		78	83	88	92
48		83	83	88	
50			88	88	

3.3.15 Snap fasteners. The snap fasteners shall be round or square, rolled edge, sew-on type, size 3, brass, black commercial finish in accordance with MIL-S-10884.

3.4 Design. The all-weather coat shall be a single breasted fly front model having a convertible collar, two inside hanging pockets with diagonal welts, shoulder loops, split shoulder (raglan back and set-in front sleeves), a vent back, a yoke lining, and a detachable single ply liner. The liner shall have bound edges, raglan sleeves, and a button loop at the bottom of each sleeve. The liner shall be attached to the all-weather coat by a slide fastener and the button loops.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the currentversion before use.

3.5 Patterns. Standard patterns shall be furnished by the Government. The standard patterns shall not be altered in any way, and are to be used as a guide for cutting the contractor's working patterns. The standard patterns show size, seam allowances, shape and placement of pockets, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts. The working patterns shall be identical to the Government patterns.

3.5.1 Pattern parts. The component parts of the all-weather coat and removable liner shall be cut from the materials specified in accordance with the number of parts indicated in table IV.

TABLE IV. List of pattern parts.

Material	Pattern nomenclature	Cut parts
Basic material (see 3.3.1)	Fly pieces	2
	Front	2
	Storm tab	1
	Shoulder loop	4
	Collar (one top collar and one under collar)	2
	Collar stand (one top collar stand and one under collar stand)	2
	Pocket welt	2
	Shoulder piece	2
	Under pocket	2
	Top pocket	2
	Left back	1
	Right back	1
	Front lining (yoke)	2
	Back lining (yoke)	1
	Back sleeve	2
	Front sleeve	2
	Front facing	2
	Sleeve tab	4
	Pocket pass-through binding	2
Liner material (see 3.3.2)	Front liner	2
	Back liner	1
Sleeve lining (see 3.3.3)	Front sleeve liner lining	2
	Back sleeve liner lining	2

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. List of pattern parts. - Continued

Material	Pattern nomenclature	Cut parts
Nonwoven interlining (see 3.3.4)	Sleeve hem interlining	2
Nylon taffeta cloth (see 3.3.5)	Front sleeve lining	2
	Back sleeve lining	2
Nylon cloth (see 3.3.6)	Collar stand interlining	1
Fusible interlining (see 3.3.9.1)	Front facing interlining	2
	Collar interlining (one for top collar and one for under collar)	2
	Pocket welt interlining	2
	Fly piece interlining	1
	Shoulder loop interlining	2
Marker	Finished fly front (stitch line)	

3.6 Construction. The construction of the all-weather coat and removable liner shall conform in all respects to the requirements specified in table V and herein. Figures are furnished for guidance and information only. If there are any inconsistencies between the specification and the figures, the specification shall govern.

3.6.1 Stitches, seams, and stitchings. All stitches, seams, and stitching types specified in table V shall conform to FED-STD-751. The type of stitches, seams, stitchings, and the minimum and maximum number of stitches per inch shall be as specified in table V. Whenever two or more seam or stitch types are specified for the same part of the operation, any one may be used. The looper (underthread) of stitch type 401 shall be on the inside of the outer shell and on the side of the liner that will face the outer shell in the finished raincoat. Seam allowances shall be maintained with seams properly sewn so that no raw edges, run offs, twists, pleats, puckers, or open seams will result. All seams shall start and finish evenly. Thread tension shall be maintained so that the stitching will not be tight or loose. Unless otherwise specified herein, raise stitching or edge stitching shall be 1/4- to 5/16-inch gage from the edge. The seam allowance for the safety stitch construction for the lining joining seams indicates 1/2 inch on the patterns. The guides and the knives on the

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

safety stitch machine shall be set to trim 1/8 inch off to finish with a 3/8-inch gage. All joining seams on the liner indicate 1/4-inch seams on the patterns. All liner joining seams shall be safety stitched with a 1/4- to 3/8-inch gage with no allowance for knife trimming. The cutting knives shall not be used when joining liner seams. The seam allowance for the collar, the collarstand, the collar-neck opening joining seam, the shoulder loops, the storm tab, and the sleeve tabs shall be 1/4 to 5/16 inch. The fusible seam tape shall not be exposed in the seam construction. Seams required to be worked out having a depth between the fold of 1/16 inch or more shall not be acceptable.

3.6.1.1 Thread breaks and ends of seams and stitchings. The ends of all seams and stitchings produced with stitch type 301, when not caught in other seams or stitchings, shall be backstitched not less than 1/4 inch. The ends of continuous lines of stitching, except on labels, shall be overlapped not less than 1/2 inch. The ends of continuous lines of stitching on labels shall be overlapped not less than three stitches. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch. Skipped stitches or thread breaks of stitch type 401 may be repaired using stitch type 301.

3.6.1.2 Repair of type 301 stitching. Repairs of type 301 stitching shall be as follows:

a. When thread breaks, skipped stitches, run-offs, or bobbin runouts occur during sewing, the stitching shall be repaired by superimposing and restarting the stitching a minimum of 1/4 inch back of the end of the stitching (see NOTE).

b. Except for prestitching, thread breaks, or two or more consecutive skipped or run-off stitches noted during inspection of the item shall be repaired by overstitching. The stitching shall start a minimum of 1/4 inch in back of the defective area, continue over the defective area, and continue a minimum of 1/4 inch beyond the defective area onto the existing stitching. Loose or excessively tight stitching shall be repaired by removing the defective stitching without damaging the materials, and restitching in the required manner (see NOTE).

NOTE: When making the above repairs, the ends of the repairing stitch must be backstitched and thread ends trimmed close to the coat or liner.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations.

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
1.	Cut parts. a. Cut the parts of the coat in accordance with the patterns which show size, seam allowance, directional lines, and marks for the placement of parts and notches for proper assembly. Unless otherwise specified, place the directional lines of the patterns in the warp direction of the material. b. Unless otherwise specified herein, cut all parts that are made of the basic material (see 3.3.1) from the same piece of material. The storm tab, the under collar, the underside of the shoulder loops, the under pockets, the top pockets, the front lining (yoke), the back lining (yoke), the fly pieces, the under collar stand, and the hanger loop (if not made of braid) may be cut from ends. The parts cut from ends shall approximate the shade of the other parts of the outer shell. The front lining (yoke) and the back lining (yoke) shall match each other. c. If the hanger loop is not made of braid, cut the stripping for the hanger loop of sufficient width so that the finished hanger loop will be 3/8 ±1/8 inch wide (see Op No. 7). d. Cut the parts of the liner (see 3.3.2) from the same piece of material. The pile liner may be					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
1.	Cut parts.- Contd cut in either of the warp directions (nap running up or down) provided that the three parts used for each unit run in the same direction. e. Cut all interlining parts in accordance with the patterns; approximately 1/8 inch may be trimmed from all sides of the fusible interlining pieces to facilitate the fusing operations. f. Cut the binding for both the outer shell and the liner on the bias 1-1/8 ±1/8 inches wide.					
2.	Replace defective parts. Remove any parts containing material defects or workmanship damages that are classified as defects in MIL-STD-1494 from production during the spreading, cutting, and manufacturing process and replace with nondefective and properly matched parts.					
3.	Mark parts. Mark, ticket, or bundle the cut parts to insure a uniform shade and size throughout the outer shell and the liner (see 3.7.1). Noncorrosive metal fastening devices may be used to mark the cut parts of the liner.					
4.	Make shoulder loops. a. Position the shoulder loop interlining on the top ply of each shoulder loop and fuse.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
4.	Make shoulder loops. - Contd					
	b. Join the top ply of each shoulder loop (with interlining) to the underply of the shoulder loop along the sides and across the neck end. Trim the corners, and force out the edges and the corners. Stitch each shoulder loop 1/4 to 5/16 inch from the edge.	301 or 401 and 301	SSe-2(a) SSe-2(a) SSe-2(b)	10-12 10-12 10-12	50 50 50	50 70 50
5.	Make storm tab.					
	a. Fold the storm tab in half lengthwise. Stitch the storm tab along the side raw edge and the point. Trim, turn, and work out the edges of the storm tab. Stitch the sides and the point of the storm tab 1/4 to 5/16 inch from the edges.	301 or 401 and 301	SSe-2(a) SSe-2(a) SSe-2(b) and OSf-1	10-12 10-12 10-12 10-12	50 50 50 50	50 70 50 50
	b. Make a buttonhole in the storm tab (facing). The buttonhole shall be positioned as indicated on the patterns. The inside edge of the eyelet shall be 3/4 to 7/8 inch from the pointed end of the storm tab. The buttonhole shall not be off center more than 1/8 inch. The buttonhole shall be a cut-after, eyelet-end, taper-bar or square-bar type worked over gimp. The finished cut length of the buttonhole shall be 7/8 ±1/8 inch.	Button-hole		50-54 stitches per button-hole	30	50
6.	Make collar.					
	a. Position the top collar interlining on the top collar and the under collar interlining on the under collar and fuse.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
6.	Make collar. - Contd					
	b. Stitch the under collar to the top collar around the side and the top edges.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70
	c. Trim, turn, and force out the edges and the points of the collar. Stitch the collar 1/4 to 5/16 inch from the edges.	301	SSe-2(b)	10-12	50	50
7.	Make hanger loop (if braid is not used).					
	a. Turn the edges of the hanger loop to the center. Stitch the abutted edges with a row of stitching, extending across and covering the edges of the material, 3/16- to 5/16-inch gage.	406	EFh-1	10-12	50	50
	OR					
	b. Fold the hanger loop with the raw edges turned in. Stitch the hanger loop 1/16 to 1/8 inch from each edge.	301	EFp-2	10-12	50	50
8.	Make collar stand and attach collar.					
	a. Quilt the collar stand interlining to the under collar stand with four or five rows of stitching approximately 1/4 inch apart. NOTE: This operation shall be deleted when fusible interlining is used.	301	SSv	10-12	50	50
	b. Position the collar between the top collar stand and the under collar stand, as indicated by the marks on the patterns, with	301 or 401	SSe-2(a) SSe-2(a).	10-12 10-12	50 50	50 70

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
8.	Make collar stand and attach collar. - Contd					
	the raw edges even, and stitch along the top edge of the collar stand. Continue stitching the tab on the left side of the collar stand, in accordance with the notches, 1/4-inch gage.					
	c. Close the right side of the collar stand. Trim the corner.	301 or 401	SSe-2(a)	10-12	50	50
	d. Turn the collar stand and the tab to the face side with the seam allowance against the collar stand. Raise stitch the collar stand through the collar and around the outer edge of the tab 1/16-inch gage.	301	SSe-2(b)	10-12	50	50
	e. Stitch the bottom edge of the top collar stand and the under collar stand together. The finished collar shall be 2-3/8 ±1/8 inches wide at the center back.	301	SSa-1	10-12	50	50
	f. Position the hanger loop on the center of the top collar stand. Turn the ends of the hanger loop under. Bartack each end of the hanger loop. The bartack shall be 1/2 ±1/16 inch long. The length of the finished hanger loop between the bartacks shall be 2-3/8 ±1/8 inches.	Bartack		28 stitches per bartack	50	50
	g. Make a horizontal, cut-after, eyelet-end, taper-bar, or square-bar type of buttonhole, worked over gimp, in the center of the collar stand. The buttonhole shall be not more than 1/8 inch off center. The inside edge of	Buttonhole		50-54 stitches per buttonhole	30	50

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
8.	Make collar stand and attach collar. - Contd					
	the eyelet shall be 1/2 ±1/8 inch from the front edge of the collar stand tab. The purling may be on either side. The finished cut length of the buttonhole shall be 5/8 ±1/8 inch.					
9.	Make pocket welts.					
	a. Position the pocket welt interlining on the pocket welts, and fuse each pocket welt. The finished pocket welts shall be 1-7/8 to 2 inches wide and 8 to 8-1/4 inches long.					
	b. Fold each pocket welt in half lengthwise and stitch the side edges.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70
	c. Trim, turn, and force out the edges and the point of each pocket welt. Stitch each pocket welt 1/4 to 5/16 inch from the side and the folded edges.	301	SSe-2(b) and OSf-1	10-12	50	50
10.	Make pockets.					
	a. Slash each under pocket as indicated by the pattern mark and tongue notch the ends.					
	b. Position each top pocket to an under pocket, with the edges even; stitch around the top, the back, and the bottom edges.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70
	c. Trim, turn, and force out the edges and the point of each pocket. Stitch each pocket 1/16 to 1/8 inch from the top, the back, and the bottom edges.	301	SSe-2(b)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
10.	Make pockets. - Contd					
	d. Fold under the back raw edge (opposite the edge sewn to the welt) of each under pocket opening and top stitch 1/16 to 3/16 inch from the folded edge with the stitching through the pocket and extending to the top edge of the pocket.	301	LSd-1	10-12	50	50
11.	Attach welts and pockets to fronts.					
	a. Position the raw edge of each welt to a front as indicated by the pattern mark, and stitch the length of the raw edge.	301 or 401	LSbj-1 LSbj-1	10-12 10-12	50 50	50 70
	b. Fold pass-through binding for hand opening in half lengthwise with raw edges abutting the raw edge of the welt. Stitch to front along pocket opening from top to bottom of opening 1/4 inch from raw edge.	301 or 401	SSa-1 SSa-1	10-12 10-12	50 50	50 70
	OR					
	c. Pocket pass-through binding may be folded lengthwise and stitched 1/2 to 5/8 inch from pocket welt stitching.					
	d. Cut the front between the two lines of stitching (welt and pocket pass-through binding piece), cutting a triangular tongue at each end.					
	NOTE: Care shall be taken so that the ends of the tongue notch in the fronts will not be deeper than the ends of the two rows of stitching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
11.	Attach welts and pockets to fronts. - Contd					
	e. Turn binding to inside of coat and raise stitch to coat from top to bottom of opening enclosing the edges of pass-through binding. When alternate operation is used, turn pocket pass-through binding to underside and stitch 3/8 ±1/16 inch from edge.	301	LScf-2(b)	10-12	50	50
	f. Turn each welt to the finished position, and raise stitch 1/16 to 3/32 inch from the joining seam.	301	LSq-2(b)	10-12	50	50
	g. Turn each welt back so that the raw edges will be exposed. Position the raw edge of the opening of the under pocket (edge toward the open end of the pocket) on the raw edge of the welt, and stitch through the seam allowance.	301 or 401	SSa-1 SSa-1	10-12 10-12	50 50	50 70
	h. Turn the pockets through the front openings with the welt in the finished position smooth and flat. Close the ends of each welt with box stitching through the welt, the outer shell, and the pocket. The inner row of stitching shall be superimposed on the edge stitching of the welt. The outer row of stitching shall be 1/16 to 3/32 inch from the edge of the welt, and the pointed ends at the hand opening shall be diagonally stitched.	301	LSbj-1	10-12	50	50
	i. Stitch the front edge of each under pocket to the fronts of the outer shell.	301	SSa-1	6-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the currentversion before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
12.	Make facings.					
	a. Position the front facing interlining on the front facings and fuse. Mark a line 1-1/2 inches from the back edge of the facing on the fused side for positioning the lining.					
	b. Bind the raw edge of the facings. The finished binding shall be 3/16 to 1/4 inch wide.	301 or 401	BSc-1	10-12	50	50
13.	Make fly piece.					
	a. Position the fly piece on the left front facing, as indicated by the pattern notches, and stitch in accordance with the seam allowance on the pattern. The front raw edge of the fly piece shall be positioned 1/2 ±1/8 inch back of the front raw edge of the facing. The joining seam shall be 3/4 ±1/8 inch from the front edge of the facing.	301 or 401	LSbj-1 LSbj-1	10-12 10-12	50 50	50 70
	b. Cut the facing and the fly piece diagonally at each corner to the line of stitching.					
	c. Turn the fly piece to the inside; stitch the length of the fly piece 1/4 to 5/16 inch from the turned edge, backtacking each end, or make a 90-degree sew out to the front raw edge of the facing.	301	SSe-2(b)	10-12	50	50
14.	Attach labels to outer shell.					
	Position the combination personal identification, identification and instruction label on the right	301	LSbj-1	8-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
14.	Attach labels to outer shell. - Contd facing not less than 1-1/2 ±1/2 inches below the lower fly front button. Position the size label below the combination personal identification, identification and instruction label. Stitch the two labels on all four sides to the right facing. The stitching shall not be through the printing on the labels. The top edge of the size label may be caught in the bottom row of stitching of the combination personal identification, identification, and instruction label.					
15.	Attach storm tab. Position the storm tab on the left facing, at the pattern marks, with the raw edge of the storm tab parallel to the front edge of the left facing. Stitch the storm tab to the left facing 1/4 inch from the raw edge. Turn the storm tab to the finished position (point of storm tab toward the front of the left facing), and stitch enclosing the raw edge. Continue stitching across the top of the storm tab with the stitching superimposed on the horizontal edge stitching of the storm tab. The purling of the buttonhole in the storm tab shall face the wearer of the finished coat.	301 or 401 and 301	LSs-2(a) LSs-2(a) LSs-2(b)	10-12 10-12 10-12	50 50 50	50 70 50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
16.	Make lining (yoke).					
	a. Join the front lining to the front sleeve lining at each armhole with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50 Chain 70 and Overedge	70
	b. Position the front edge of the back sleeve lining, and stitch the front edge of each shoulder piece to the shoulder edge of the front lining with a safety stitch. Continue stitching the entire length of each sleeve.	515 or 516 or 519	SSa-2	10-12	50 Chain 70 and Overedge	70
	c. Position the back edge of each shoulder piece and the back edge of each back sleeve lining to the front edge of the back lining, and stitch to the bottom of each armhole with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50 Chain 70 and Overedge	70
	d. Overedge stitch the bottom raw edge of each sleeve lining.	502 or 503 or 504	EFd-1	6-12	70	70
	e. Close the side seam of the front and back lining and the underarm seam of the sleeve lining in one operation with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50 Chain 70 and Overedge	70
	f. Hem the bottom of the lining with the raw edges turned in. The finished hem in the bottom of the liner shall be 3/8 to 1/2 inch wide.	301	EFb-1	10-12	50	50
17.	Make back and vent.					
	a. Position the back parts of the outer shell together face to	301 or 401	SSw-2(a) SSw-2(a)	10-12 10-12	50 50	50 70

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. *Manufacturing operations.* - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
17.	Make back and vent. - Contd					
	face with the edge of the right back folded over the left back. Insert the seam tape against the left back under the folded edge of the right back. The seam tape shall extend from the top of the vent to the neck of the outer shell. Stitch the back parts of the outer shell together (from 1/4 to 3/8 inch below the top of the vent to the neckline), 1/16 to 3/32 inch from the raw edge, catching the seam tape in the stitching.					
	b. Press the seam, with a heated pressing iron or machine, fusing the seam and also forming the left vent edge.					
	c. Turn back the seam toward the left side and fold the left side of the vent, as indicated by the pattern marks; raise stitch 1/4 to 5/16 inch from the fold of the seam, with the stitching continued down the vent.	301	SSw-2(b) and EFb-1	10-12	50	50
	d. Fold the right side of the vent as indicated by the pattern marks, with the raw edge turned under; stitch 1/16 to 3/32 inch from the back turned edge.	301	EFb-1	10-12	50	50
	e. Trim the left side of the vent at the top; and with the left side of the vent overlapping the right side of the vent, box stitch the top of the vent through all plies. The box stitching shall be diagonal	301		10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
17.	Make back and vent. - Contd					
	(approximately 45 degrees) to the center seam and shall be 1-1/4 ±1/4 inches long and 3/8 ±1/8 inch wide.					
	f. Make a buttonhole in the right side of the vent, positioned 8 to 9 inches below the top of the vent opening. The buttonhole shall be a straight cut type, tacked at both ends. The finished cut length of the buttonhole shall be 1/2 ±1/8 inch.	Button-hole		44-48 stitches per button-hole	30	50
18.	Join sleeves to outer shell.					
	a. Stitch the front sleeves to the front armholes from the shoulder to 3 ±1/2 inches below the step on the front.	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12	50 50	50 70
	b. Turn and raise stitch the seams 1/4 to 5/16 inch with stitching on the front to the step as marked on the pattern. Turn at the step and stitch to the joining seam line.	301	LSq-2(b)	10-12	50	50
	c. Stitch a back sleeve to each back armhole from the neckline to 3 ±1/2 inches below the step on the back.	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12	50 50	50 70
	d. Turn and raise stitch the seams 1/4 to 5/16 inch with stitching on the back to the step as marked on the pattern. Turn at the step and stitch to the joining seam line.	301	LSq-2(b)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
19.	Close sides of outer shell.					
	a. Position the fronts to the backs, face to face, with the edge of the fronts folded over the edge of the backs. Insert the seam tape on the backs under the folded edge of the fronts; stitch the side seams of the outer shell, 1/16 to 3/32 inch from the raw edge, catching the seam tape in the stitching.	301 or 401	SSw-2(a) SSw-2(a)	10-12 10-12	50 50	50 70
	b. Press the side seams of the outer shell, with a heated pressing iron or machine, fusing the seam tape.					
	c. Turn each side seam toward the back, and raise stitch 1/4 to 5/16 inch from the folded edge of the seam.	301	SSw-2(b)	10-12	50	50
20.	Make and attach sleeve tabs.					
	a. Position the sleeve tab interlining to the top ply of each sleeve tab and fuse.					
	b. Stitch the top and the bottom plies of each sleeve tab around the sides and the pointed end.	301 or 401	SSe-2(a)	10-12	50 70	50 50
	c. Trim, turn, and force out the edges and the pointed end of each sleeve tab. Stitch each sleeve tab 1/4 to 5/16 inch from the edge.	301	SSe-2(b)	10-12	50	50
	d. Make a horizontal, cut-first, eyelet-end, square-bar type of buttonhole, worked over gimp, with the ends of the gimp	Button-hole		50-54 stitches per button-	30	50

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:53Z
Check the source to verify that this is the currentversion before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
20.	Make and attach sleeve tabs. - Contd					
	pulled through to the underside and bartacked in a separate operation, in the center of each sleeve tab. The buttonholes shall not be more than 1/8 inch off center. The inside edge of the eyelet shall be 3/4 to 7/8 inch from the pointed end. The finished cut length of the buttonholes shall be 5/8 ±1/8 inch. The purling of the buttonhole shall be on the outside of the sleeve tabs.	Bartack		hole 21 stitches per bartack	50	50
	e. Position a sleeve tab on each back sleeve, in accordance with the notches, and stitch 1/8 inch from the edge.	301	SSa-1	10-12	50	50
21.	Close sleeves of outer shell.					
	a. Join each top arm seam from the neckline to the bottom of the sleeve simultaneously stitching the seam tape to the back edge of the front sleeve.	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12	50 50	50 70
	b. Turn each seam toward the front, and raise stitch 1/4 to 5/16 inch from the folded edge.	301	LSq-2(b)	10-12	50	50
	c. Press the seams, with a heated pressing iron or machine, fusing the seam tape.					
	d. Stitch the sleeve hem interlining to the bottom of each sleeve as indicated by the pattern marks.	301		10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
21.	Close sleeves of outer shell. - Contd					
	e. Stitch each underarm seam of the outer shell.	301	SSa-1	10-12	50	50
	f. Press each underarm sleeve seam of the outer shell open and flat with a heated pressing iron or machine.					
	g. Complete the stitching of the sleeves to the armholes of the outer shell.	301	SSa-1	10-12	50	50
22.	Attach shoulder loops.					
	a. Fit the shoulder loops to the shoulders and trim, leaving a 1/4 inch seam allowance at the sleeve end.					
	b. Position each shoulder loop on a shoulder seam with the raw edge end facing the neck opening, and stitch with the stitching in line with the armhole seam.	301	LSb1-2(a)	10-12	50	50
	c. Fold each shoulder loop toward the neck opening, and raise stitch 1/4 to 5/16 inch from the folded edge and in line with the raise stitching on the fronts.	301	LSb1-2(b)	10-12	50	50
	d. Sew the stud of a snap fastener to the underside of each shoulder loop centered with a tolerance of 1/8 inch off center on the neck end 1/2 inch from the edge and completely hidden from the outside view. Sew the	Hand or		12-16 double thread stitches per stud or socket	50	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
22.	Attach shoulder loops. - Contd					
	socket of a snap fastener to each shoulder to correspond with the stud on the shoulder loop. If the snap fasteners are hand sewn, tack off the hand sewing with not less than two stitches. The snap fasteners shall be securely sewn and shall be positioned so that the closure will be flat and smooth and the stitching willnot show on the outside of the shoulder loops.	101 or		21-22 stitches per stud or socket	50	50
		301		14-16 stitches per stud or socket	50	50
	OR					
	e. As an option to Op No. 22d, tack both corners of each shoulder loop at the neck end with a minimum of five stitches at each corner by blind tacking by hand or machine.				50	
	NOTE: The shoulder loops shall be positioned so that a finished shoulder loop will be centered on each shoulder seam with the sleeve end of the shoulder loop even with the front armhole seam and with the neck end of the shoulder loop extending to within 1/8 inch of the collar joining seam line. The shoulder loop may be stitched by superimposing a stitch completely across the loop.	301				
23.	Attach collar to outer shell.					
	a. Stitch the tape for reinforcing the neckline to the inside of the neck edge from the lapel notch to the shoulder seam.	301	LSbj-1	8-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the currentversion before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
23.	Attach collar to outer shell. - Contd					
	b. Stitch the collar to the outer shell, with the notches matching. Slash the front neckline seam allowance, as necessary.	301 or 401	SSa-1 SSa-1	10-12 10-12	50 50	50 70
24.	Attach facings.					
	a. Position the fly piece interlining on the fly piece (to be applied to the left front) with the front edges even and fuse.					
	b. Position the fly piece to the left front edge of the outer shell as indicated by the pattern marks and stitch. The fly lining shall not be caught in the stitching.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70
	c. Position the facings to the fronts (face to face) with the raw edges even. Stitch the length of the facings catching the raw edges of the collar. The right facing shall lap the left facing at the center back.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70
25.	Make buttonholes on the left front.					
	a. Make four buttonholes on the fly piece as indicated by the pattern marks. The buttonholes shall be cut-first, eyelet-end, taper-bar, or square-bar type, worked over gimp. The taper bar shall be finished with not less than four stitches at the bar end (excluding the crossover stitch). The square	Buttonhole Bartack		70-74 stitches per buttonhole 21 stitches per bartack	30 50	50 50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
25.	Make buttonholes on the left front. - Contd					
	bar shall have the ends of the gimp pulled through the underside and bartacked in a separate operation. The finished cut buttonholes shall be 1-1/8 ±1/8 inches long. The inside edge of the eyelet of each buttonhole shall be 1/2 to 5/8 inch from the front edge of the fly lining. The buttonholes shall not be off center more than 1/8 inch. The purling of the buttonholes shall be on the outside of the fly.					
	b. Make a buttonhole in the left lapel 1 ±1/16 inches from the top of the lapel step, with the inside edge of the eyelet 3/4 to 7/8 inch from the front edge. The buttonhole shall be a cut-first, eyelet-end, square-bar type worked over gimp with the ends pulled through to the underside and bartack in a separate operation. The finished cut buttonhole shall be 7/8 ±1/8 inch long. The purling shall be on the facing side.	Buttonhole Bartack		50-54 stitches per buttonhole 21 stitches per bartack	30 50	50 50
26.	Finish fly piece.					
	a. With the back raw edges of the top fly and the fly piece even, stitch the flies together, with the stitching centered between the buttonholes and perpendicular to the front edge.	301	LSbj-1	10-12	50	50
	OR					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
26.	Finish fly piece. - Contd					
	b. As an option to Op No. 26a, place a bartack centered between each buttonhole superimposed on the fly piece edge stitching. The bartacks shall be caught through the facing and the fly piece only.	Bar-tack		28 stitches per bartack	50	50
	c. Tack back edge of facing to bottom of pocket with a 1/2 to 3/4 inch vertical tack. The tack shall not be more than 1/2 inch from bottom edge of pocket and approximately 1 inch from the edge of binding.					
	d. Position the fly front stitch marker (stitch line) on the left front 1/2 ±1/8 inch below the bottom of the fly opening and mark. Stitch on the marked line through all plies, continuing the stitch to the collar joining seam line maintaining the stitch 2-1/2 ±1/16 inches from and parallel to the front edge.	301	LSbj-1	10-12	50	50
27.	Attach lining (yoke) to outer shell.					
	a. Stitch the lining (yoke) to the outer shell along the neckline, forming a 3/8 inch pleat at the center back. The pleat shall be folded toward the left side.	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12	50 50	50 70
	b. Continue to stitch the lining (yoke) to the facing, with the raw edge of the lining (yoke) positioned on the mark on the facing; continue the stitching to the bottom of the yoke.	301 or 401	LSbj-1 LSbj-1	10-12 10-12	50 50	50 70

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:53Z
Check the source to verify that this is the currentversion before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
27.	Attach lining (yoke) to outer shell. - Contd					
	c. Turn the lining (yoke) and raise stitch the seam across the neck of the lining (yoke) 1/16 to 3/32 inch from the edge. The raised stitching shall not be visible on the outside of the finished coat.	301	LSq-2(b)	10-12	50	50
28.	Stitch lining to sleeves.					
	a. Stitch the sleeve lining to each sleeve at the wrist with two rows of stitching. The first row of stitching shall be 1/4 to 3/8 inch from the sleeve bottom. The second row of stitching shall be parallel to and 1 inch above the first row of stitching.	301	SSa-2	10-12	50	50
	b. Sew a 24-line button on each sleeve lining, 1/2 ±1/16 inch from the bottom turned edge of the lining. The buttons shall be positioned so that stitching will be through the top sleeve seam of both the lining and the outer shell bottom turn-up only.	101 or		14-16 stitches per button	30	
		301 or		14-16 stitches per button	30	30
		Hand		4-6 stitches double thread per button	30	
	c. Stitch the sleeve lining to the outer shell at the underarm seam 2-1/2 to 3 inches from the bottom of each sleeve for a distance of 6 to 6-1/2 inches.	301	SSa-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
29.	Anchor lining to side seams.					
	With the sleeve setting seams of the lining aligned with the sleeve setting seams of the outer shell, tack each lining side seam to an outer shell side seam 2 to 3 inches below the sleeve setting seam. The tacks shall be automatic straight tacks that are 1/2 inch long or vertical bartacks that are 3/8 to 1/2 inch long.	301 or Bar-tack		28 stitches per bartack 28 stitches per bartack	50 50	50 50
30.	Hem bottom of outer shell.					
	Turn in the raw edge of the bottom of the outer shell and hem. The finished bottom hem shall be 1 ±1/8 inch wide. The turned in raw edge may be stitched prior to hemming.	301	EFb-1	10-12	50	50
31.	Finish fronts.					
	Turn the facings; force out the edges. Edge stitch the fronts 1/4 to 5/16 inch from the edge across the top of the lapels, down the fronts, and across the bottoms to the back edge of the facings and sew out at 90 degrees and up to the bottom hem stitching catching the edge of the facing.	301	SSe-2(b)	10-12	50	50
32.	Set slide fastener on outer shell.					
	a. Prior to assembly of the slide fastener to the facing, permanently mark the center of the slide fastener. Make sure that the center as marked falls in line with the notches of the overlapped yoke neck facings.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
32.	Set slide fastener on outer shell. - Contd					
	b. Position the slide fastener on the outer shell facings so that the ends of the slide fastener will be equidistant from the bottom edge of the outer shell and the separating pin of the slide fastener will be on the right facing. Position the slide fastener on the underside of the outer shell facings with the front edge of the chain 1/8 to 3/16 inch from the bound edge. Turn in the end of the slide fastener tape 1/2 to 3/4 inch. When ends of slide fastener tape are finished, they need not be turned under. Stitch the length of the slide fastener tape 3/16 to 5/16 inch from the back edge of the chain.	301	SSa-1	10-12	50	50
	Secure each end of the slide fastener tape with a bartack superimposed on the binding stitching. The bartack shall be 3/8 to 1/2 inch long.	Bar-tack		28 stitches per bartack	50	50
33.	Clean outer shell.					
	a. Trim thread ends.					
	b. Remove loose threads from the outer shell.					
	c. Remove spots, stains, and markings from the outer shell.					
	d. Remove shade tickets from the outer shell.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
34.	Press outer shell.					
	Press the collar, the fronts, the backs, the pockets, the sleeves, and the hems with a steam pressing machine or a hand pressing iron.					
35.	Sew buttons on outer shell.					
	Mark or gage the position of the buttons, where applicable, as indicated by the pattern marks. The right front lapel button and the collar tab button shall be located and marked with the coat fronts buttoned or simulated buttoned. The lapels and the collar, when buttoned, shall finish smooth and flat without distortion, and the collar shall be abutted with a tolerance up to 1/2 inch spread opening. Sew the buttons to the coat as follows:	101 or 301 or Hand		14-16 stitches per button 14-16 stitches per button 4-6 stitches double thread per button	30 30 30	 30
	a. Sew four 40-line buttons on the right front 2-1/8 to 2-1/4 inches from the edge, to correspond with the buttonholes in the right fly, with the stitching of each button through the coat, the facing, and an 18-line stay button. The buttons shall be shank wrapped.					
	b. Sew a 30-line button on the right front lapel to correspond with the buttonhole in the left front lapel, with the stitching through the coat, the facing, and an 18-line stay button. The button may be shank wrapped.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
35.	Sew buttons on outer shell. - Contd c. Sew a 30-line button on the right front, to correspond with the buttonhole in the storm tab, with the stitching through the coat and the facing. An 18-line stay button may be used. The 30-line button may be shank wrapped. d. Sew a 19-line or 24-line button on the left back vent to correspond with the buttonhole in the right vent. e. Sew two 24-line buttons on each back sleeve to correspond with the buttonnoles in the sleeve tab. The center of the second button shall be 3 inches from the center of the first button. f. Sew one 24-line button on the right side of the undercollar stand to correspond with the buttonhole in the collar stand tab when the collar stand tab is closed. Sew one 24-line button on the left side of the undercollar stand to secure the undercollar tab when it is not in use. The buttons shall be sewn to the undercollar and the interlining only. NOTE: Caution shall be taken in fabricating the liner so that, when the liner is attached to the coat, all neck seams on the liner will be lined up to correspond with all counterpart seams of the					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
35.	Sew buttons on outer shell. - Contd outer shell components. No seam on the liner shall be staggered more than 3/8 inch from the corresponding seam of the outer shell components. The center back of the liner shall match the back center seam of the outer shell. The shoulder seams of the liner shall match the shoulder seams of the outer shell. The sleeve seams of the liner shall match the sleeve seams of the outer shell.					
36.	Attach liner sleeves to liner.					
	a. Position the front liner sleeves to the fronts of the liner, as indicated by the pattern marks, and safety stitch around each armhole.	515 or 516 or 519	SSa-2	10-12	50 | 70 Chain 70 and Overedge	
	b. Position the front edge of the back liner sleeves to the shoulder edge of the fronts of the liner, and safety stitch. Continue the stitching the entire length of each liner sleeve.	515 or 516 or 519	SSa-2	10-12	50 | 70 Chain 70 and Overedge	
	c. Position the back edge of the back liner sleeves to the front edge of the back of the liner, and safety stitch to the bottom of each armhole.	515 or 516 or 519	SSa-2	10-12	50 | 70 Chain 70 and Overedge	
	d. Overedge the bottom edge of the liner sleeves.	502 503		6-10		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread Top	Thread Lower
37.	Close side seams of liner.					
	Close the side seams of the liner and the underarm seam of the liner sleeves with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50 Chain 70 and Over-edge	70
38.	Bind edges of liner.					
	To preclude stretching of the back neck area of the liner, sew a stay tape to the back of the neck from shoulder point to shoulder point.					
	Bind the edges of the liner as specified herein. The binding shall be uniformly stitched with no raw edges showing. The fabric shall be caught in the stitching. The finished binding shall be 3/16 to 1/4 inch wide except that the binding at the bottom of the sleeves may finish up to 5/16 inch wide.	301 or 401 or Bar-tack	BSc-1 BSc-1	10-12 10-12 28 stitches per bartack	50 50 50	50 70 50
	a. Bind the edges of the vent, the bottom, the fronts, and the neck in one operation. The binding shall not be started or finished at the top of the vent. The ends of the binding shall be turned in and caught in the stitching. The ends of the binding shall overlap not less than 1/2 inch. The end of the binding shall be turned on itself and securely stitched or bartacked. The bartack shall be 1/2 ±1/16 inch long.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
38.	Bind edges of liner. - Contd					
	b. Bind the bottom of each sleeve. The binding shall be started and finished at the top sleeve seam. The end of the binding of each sleeve shall be formed into a loop that will accommodate the 24-line button on the top of the sleeve lining. The end of the binding shall be bartacked or securely stitched. The bartack shall be 1/2 ±1/16 inch long.					
	c. Bind the edges of each pocket pass through. The binding shall not be started or finished at the top or the bottom of the pocket pass throughs. The ends of the binding shall be turned in and caught in the stitching. The ends of the binding shall overlap not less than 1/2 inch with the end of the binding turned over on itself and securely stitched or bartacked. The bartack shall be 1/2 ±1/16 inch long.					
39.	Attach labels to liner.					
	a. Position the combination personal identification, identification and instruction label on the right front pile side of the liner. Stitch the combination label on all four sides. Position the size label below the combination label. Stitch the two labels on all four sides to the right front. The stitching shall not be through the printing on the labels.	301	LSbj-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
39.	Attach labels to liner.- Contd The top edge of the size label may be caught in the bottom row of stitching of the combination label. OR b. As an option to Op No. 39a position the combination personal identification, size, identification and instruction label on the center back pile side of the liner so that the top edge of the combination label will be 1-1/4 to 1-3/4 inches from the bottom of the binding. Stitch the combination personal identification, size, identification, and instruction label on all four sides.	301	LSbj-1	10-12	50	50
40.	Set slide fastener on liner. Prior to the assembly of the slide fastener to the liner make sure the permanently marked center of the slide fastener tape that is applied to the liner corresponds with the center of the slide fastener tape that is sewn to the facings of the outer shell. The center mark shall match the back center notch at the neck of the back liner. Position the slide fastener on the underside of the liner, as indicated by the pattern marks, with the back edge of the chain immediately adjacent to the bound edge of the liner. Turn in the raw edge of the slide fastener	301	LSa-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
40.	Set slide fastener on liner. - Contd tape 1/2 to 3/4 inch. Stitch the length of the slide fastener tape with the stitching superimposed on the binding stitching. The slider shall be on the left side of the finished liner. Secure each end of the slide fastener tape with a bartack superimposed on the binding stitching. The bartack shall be 3/8 to 1/2 inch long. When ends of slide fastener tape are finished, they need not be turned under.	Bar-tack		28 stitches per bartack	50	50
41.	Clean liner. a. Trim all thread ends. b. Remove all loose threads from the liner. c. Remove all spots and stains from the liner. d. Remove all shade tickets from the liner.					
42.	Attach liner to outer shell. Attach the liner to the outer shell by means of the slide fastener, checking the operation of the slide fastener to insure free and easy manipulation of the slider. When the slide fastener is closed, the outer shell and the liner shall not show any evidence of bulging or distortion. The liner shall match the outer shell in size.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.7 Manufacturing operations requirements. The all-weather coat with removable liner shall be manufactured in accordance with operation requirements specified in table V. The contractor is not required to follow the exact sequence of operations listed unless otherwise specified. Any additional basting or holding stitches used to facilitate manufacture are permissible provided the thread is removed or does not show in the finished outer shell or liner.

3.7.1 Shade and size marking. The component parts of the all-weather coat and liner shall be marked, ticketed, or bundled to insure a uniform shade and size. Any method may be used except:

a. Corrosive metal fastening devices.

b. Sew-on shade tickets.

c. Adhesive type tickets which discolor or adhere to the material upon removal of tickets.

NOTE: The use of an ink pad numbering machine, rubber stamp, or pencil is allowed, provided the numbering does not show on the outside of the raincoat or liner and wherever possible, is covered by the seam allowance.

3.8 Finished measurements. The measurements of the finished outer shell shall conform to the requirements specified in table VI and the measurements of the finished liner shall conform to the requirements specified in table VII.

3.9 Workmanship. The finished all-weather coat and the removable liner shall conform to the quality of product established by this document and the occurrence of defects shall not exceed the acceptable quality levels.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facility suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VI. Finished measurements (inches) of outer shell. 1/

Sizes	1/2 Chest 2/	Back Length 3/	Sleeve Inseam Length 4/
Extra Short			
34	22	37-1/4	15
36	23	37-1/2	15
38	24	37-3/4	15
40	24-3/4	38	15
42	25-3/4	38-1/4	15
44	26-3/4	38-1/2	15
Short			
34	22	39-1/4	16
36	23	39-1/2	16
38	24	39-3/4	16
40	24-3/4	40	16
42	25-3/4	40-1/4	16
44	26-3/4	40-1/2	16
46	27-1/2	40-3/4	16
48	28-1/2	41	16
Regular			
34	22	41-1/4	17
36	23	41-1/2	17
38	24	41-3/4	17
40	24-3/4	42	17
42	25-3/4	42-1/4	17
44	26-3/4	42-1/2	17
46	27-1/2	42-3/4	17
48	28-1/2	43	17
50	29-1/2	43-1/4	17
Long			
34	22	43-3/4	18
36	23	44	18
38	24	44-1/4	18
40	24-3/4	44-1/2	18
42	25-3/4	44-3/4	18
44	26-3/4	45	18
46	27-1/2	45-1/4	18
48	28-1/2	45-1/2	18
50	29-1/2	45-3/4	18

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VI. Finished measurements (inches) of outer shell. 1/ - Continued

Sizes	1/2 Chest 2/	Back Length 3/	Sleeve Inseam Length 4/
Extra Long			
34	22	45-3/4	19
36	23	46	19
38	24	46-1/4	19
40	24-3/4	46-1/2	19
42	25-3/4	46-3/4	19
44	26-3/4	47	19
46	27-1/2	47-1/4	19
Tolerance	±1/2	±1/2	±1/4

1/ The finished measurements of the outer shell shall be taken with the coat flat, smooth, and buttoned.
2/ The 1/2 chest shall be measured across the chest, from armhole seam to armhole seam.
3/ The back length shall be measured on the center back seam, from the lower edge of the collar stand to the bottom of the coat.
4/ The sleeve inseam length shall be measured at the inseam, from the base of the armhole to the bottom of the sleeve.

4.1.2 Certificate of compliance. Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.4).

b. Quality conformance inspection (see 4.5).

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in FED-STD-191 or MIL-STD-1494, as applicable.

4.4 First article inspections. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.5.3. The presence of any defect shall be cause for rejection of the first article.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VII. Finished measurements (inches) of liner. 1/

Sizes	1/2 Chest 2/	Back Length 3/	Sleeve Length 4/
Extra Short			
34	18	31	13-3/4
36	19	31-1/4	13-3/4
38	20	31-1/2	13-3/4
40	21	31-3/4	13-3/4
42	22	32	13-3/4
44	23	32-1/4	13-3/4
Short			
34	18	33	14-3/4
36	19	33-1/4	14-3/4
38	20	33-1/2	14-3/4
40	21	33-3/4	14-3/4
42	22	34	14-3/4
44	23	34-1/4	14-3/4
46	24	34-1/2	14-3/4
48	25	34-3/4	14-3/4
Regular			
34	18	35	15-3/4
36	19	35-1/4	15-3/4
38	20	35-1/2	15-3/4
40	21	35-3/4	15-3/4
42	22	36	15-3/4
44	23	36-1/4	15-3/4
46	24	36-1/2	15-3/4
48	25	36-3/4	15-3/4
50	26	37	15-3/4
Long			
34	18	37-1/2	16-3/4
36	19	37-3/4	16-3/4
38	20	38	16-3/4
40	21	38-1/4	16-3/4
42	22	38-1/2	16-3/4
44	23	38-3/4	16-3/4
46	24	39	16-3/4
48	25	39-1/4	16-3/4
50	26	39-1/2	16-3/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VII. Finished measurements (inches) of liner. 1/ - Continued

Sizes	1/2 Chest 2/	Back Length 3/	Sleeve Length 4/
Extra Long			
34	18	39-1/2	17-3/4
36	19	39-3/4	17-3/4
38	20	40	17-3/4
40	21	40-1/4	17-3/4
42	22	40-1/2	17-3/4
44	23	40-3/4	17-3/4
46	24	41	17-3/4
Tolerance	±3/4	±3/4	±3/4

1/ The finished measurements of the liner shall be taken with the liner flat on a table.

2/ The 1/2 chest shall be measured, with the liner folded in half (down the center back), at the base of the armhole, from the edge to the back folded edge.

3/ The back length shall be measured, at the center back, from the neck to the bottom of the liner.

4/ The sleeve length shall be measured, along the underarm seam, from the sleeve joining seam to the bottom of the sleeve.

4.5 Quality conformance inspection. Unless otherwise specified, sampling for inspection shall be in accordance with MIL-STD-1494.

4.5.1 Components and material inspection. In accordance with 4.1, components and materials shall be inspected in accordance with all the requirements of referenced documents unless otherwise excluded, amended, modified, or qualified in this document or applicable purchase document.

4.5.1.1 Component testing. In addition to any testing required by 4.5.1, components listed in table VIII shall be tested for the characteristics noted. The methods of testing specified in table VIII shall be followed. All test reports shall contain the individual values used in expressing the final results. The lot size and sample size shall be as follows:

Lot size	Sample size
800 or less	2
801 up to and including 22,000	3
22,001 and over	5

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

The lot shall be unacceptable if one or more sample units fail to meet any test requirement specified. The lot size units and the sample units shall be as follows:

Component	Lot size unit	Sample unit
Nylon cloth	Yard	1 yard full width
Fusible interlining	Yard	1 yard full width
Interlining fused to basic cloth	Yard	1/2 yard full width
Fusible seam tape	Yard	1/2 linear yard
Snap fasteners	Sets	10 sets

TABLE VIII. Component tests.

Component	Characteristic	Requirement paragraph	Test method
Nylon cloth	Material identification	3.3.6	1/
	Weave	3.3.6	Visual 2/
	Weight	3.3.6	5041
	Threads per inch	3.3.6	5050
	Thickness	3.3.6	5030
	Breaking strength	3.3.6	5100
	Stiffness	3.3.6	5202
	Color	3.3.6	Visual 1/
Fusible interlining	Material identification	3.3.9.1	1/
	Adhesive	3.3.9.1	1/
	Weight	3.3.9.1	5041
	Breaking strength	3.3.9.1	5100
	Shrinkage after 5 dry cleanings	3.3.9.1	5556
	Color	3.3.9.1	2/
Interlining fused to basic cloth	Shrinkage	3.3.9.1.1	5556
	Bond strength: Initial	3.3.9.1.1	5951
	After 5 dry cleanings	3.3.9.1.1	5580 3/ and 5951
Fusible seam tape	Material identification	3.3.9.2	1/
	Width	3.3.9.2	5010
	Weight	3.3.9.2	5041
	Color	3.3.9.2	Visual 2/

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VIII. Component tests. - Continued

Component	Characteristic	Requirement paragraph	Test method
Snap fasteners	Material identification	3.3.15	1/
	Type	3.3.15	1/
	Size	3.3.15	1/
	Finish	3.3.15	1/

1/ A certificate of compliance is acceptable for this requirement.
2/ One determination per sample unit shall be made.
3/ The pressing and the shrinkage requirements specified in 5580 of FED-STD-191 shall not apply.

4.5.2 In-process inspection. Inspection shall be made at any point or during any phase of manufacturing to determine whether operations or assemblies are accomplished as specified and to verify that the working patterns conform to the Government patterns in all respects. The Government shall reserve the right to exclude from consideration for acceptance any material or service for which in-process inspection has indicated nonconformance.

4.5.2.1 Bond strength of fusible interlining. The strength of the bond of the fusbile interlining to the outer shell shall be tested twice a day, at the fusing press location, to determine that adequate fusing is being obtained as follows: Prepare a test sample by fusing the fusible interlining specified in 3.3.9.1 to the basic fabric of the outer shell specified in 3.3.1 under the same fusing conditions to be used in the manufacture of the coat. Determine the bond strength of the test sample with a commercial spring scale (see 6.7). If the bond strength of any test sample is less than 22 ounces per inch of width, the fusing conditions shall be corrected and the bond strength test shall be repeated.

4.5.3 End item examination.

4.5.3.1 Individual examination. As a final step in the contractor's production control plan and before formation of a lot, each coat and liner shall be buttoned on a model form and then examined for the selected defects listed in MIL-STD-1494 and 4.5.3.1.1. The occurrence of defects during this examination for selected defects shall not exceed the applicable point or defect limit specified in MIL-STD-1494. Any coat and liner that contains a selected defect shall not be included in an end item lot.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

4.5.3.1.1 Exceptions to MIL-STD-1494. The following exceptions to MIL-STD-1494 shall apply to the examinations specified in 4.5.3.1:

a. The terms "outside" and "inside" shall be defined as follows:

Outside - Any part of all-weather coat (including undersleeve) that is visible when the completely buttoned coat is observed on the model form with collar in both the up and down position. When applicable, shoulder loops, and the area on the all-weather coat covered by overlap of back vent are considered part of the outside.

Inside - Any part of all-weather coat that is not visible when the completely buttoned raincoat is observed on the model form with collar in both the up and down positions.

b. Identify the following defects in table II as selected defects:

XXVIII.	LINER	
	b. Liner tight or short causing puckering of all-weather coat.	*
XXIX.	SLIDE FASTENER	
	k. All-weather coat or liner twisted or distorted when slide fastener is engaged.	*

c. Add the following selected * defects to table III:

LINER

Liner tight or short, causing puckering of raincoat.

SLIDE FASTENERS

All-weather coat or liner twisted or distorted when fastener is engaged.

4.5.3.2 Dimensional examination. The number of coats and liners, as specified in MIL-STD-1494, shall be examined for conformance to the dimensional requirements specified in tables VI and VII. The lot shall be unacceptable if the total point value resulting from the examination exceeds the maximum acceptable point value specified in MIL-STD-1494.

4.5.3.3 Packaging examination. Shipping containers fully prepared for delivery with the exception that they need not be closed shall be examined as specified in MIL-STD-1494. Hanger packs shall be examined in accordance with MIL-C-44192. The occurrence of defects during this examination shall not exceed the applicable point value or defect limit specified.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

4.5.4 Fused coat testing. The fused coats shall be tested as specified in table IX. The lost size shall be expressed in units of one coat. The sample unit shall be one fused coat. The lot shall be unacceptable if one or more sample units fail to meet the requirements specified. The lot size and sample size shall be as specified in 4.5.1.1.

TABLE IX. Fused coat tests.

Characteristic	Requirement Paragraph	Test Method
Bubbling or delamination of fused area after one dry cleaning.	3.3.9.1.1	Dry cleaning and Visual 1/
Strike through of adhesive.	3.3.9.1.1	Visual

1/ The finished coat shall be dry cleaned one time in a single unit, coin-operated cycle capable of providing a complete automatic dry to dry cycle, using perchloroethylene and then shall be visually examined for bubbling and delamination of the fused areas.

4.5.5 Palletization examination. An examination shall be made to determine that the palletization complies with the requirements of section 5. Defects shall be scored in accordance with the list below. The sample unit shall be one palletized unit load fully packaged. The lot size shall be the number of palletized unit loads in the inspection lot. The inspection level shall be S-1 and the AQL, expressed in terms of defects per hundred units, shall be 6.5 as specified in MIL-STD-105.

Examine	Defects
Finished dimensions	Length, width, or height exceeds specified maximum requirements.
Palletization	Pallet pattern not as specified. Interlocking of loads not as specified. Load not bonded with required straps or film as specified.
Weight	Exceeds maximum load limits.
Marking	Omitted; incorrect; illegible; of improper size, location, sequence, or method of application.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1 Preservation. Preservation shall be level A or Commercial, as specified (see 6.2).

5.1.1 Level A. Each coat shall be buttoned and then folded to approximately 15 inches by 11-1/2 inches. Each folded coat shall be inserted in a close fitting, flat style, clear polyethylene bag that is 0.00125 ±25 percent inch thick. The bag shall be formed with heat-sealed seams that are straight, continuous, and parallel to each other and the formed edges of the bag. The bag may be fabricated from either film tubing or sheeting. The bag shall be at least 1 inch longer than the folded coat. The unsealed opening of the bag shall be at the smaller dimension of the bag.

5.1.2 Commercial. Each coat shall be preserved in accordance with ASTM D 3951.

5.1.3 Hanger pack. Each coat shall be preserved as specified in the appendix of MIL-C-44192.

5.2 Packing. Packing shall be level A, B, or commercial, as specified (see 6.2).

5.2.1 Level A. Eight coats, of one size only, preserved as specified in 5.1, shall be packed in a fiberboard shipping container that is assembled, closed, and reinforced in accordance with style RSC-L, grade V2s, size 3A of MIL-B-17757. Level A packages shall be packed flat with every other coat reversed top to bottom and shall be packed two in length, one in width, and 4 in depth within the shipping container. The top and the bottom of the contents of the shipping container shall be completely covered with a sheet of 30-pound (minimum) basis weight paper conforming to grade B of UU-P-268. Towards the end of the contract or when there are less than the quantity of the same size required per shipping container, mixed sizes (see 5.4.3) may be packed in the same container.

5.2.2 Level B. Eight coats, of one size only, preserved as specified in 5.1, shall be packed in a snug-fitting shipping container conforming to class domestic, style RSC-L, grade 275, size 3A of MIL-B-17757. Level A packages shall be packed flat, front up, alternated end for end and shall be packed two in length, one in width, and 4 in depth within the shipping container. The top and bottom of the contents of the shipping container shall be completely covered with a sheet of 30-pound (minimum) basis weight paper conforming to grade B of UU-P-268. Closure and strapping shall be in accordance with the appendix of the container specification. Towards the end of the contract or when there are less than the quantity of the same size required per shipping container, mixed sizes (see 5.4.3) may be packed in the same container.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

5.2.2.1 Weather-resistant fiberboard containers. When specified (see 6.2), the shipping container shall be a grade V3c, V3s, or V4s fiberboard box fabricated in accordance with MIL-B-17757 and closed in accordance with the appendix of the container specification, except that the inspection shall be in accordance with 4.5.3.3.

5.2.3 Commercial. Coats, preserved as specified in 5.1, shall be packed in accordance with ASTM D 3951.

5.2.4 Hanger pack. Twelve coats of one size only, preserved as specified in 5.1, shall be packed in a type I container, using a style A or B hanger bar, in accordance with MIL-C-44192. Coat sizes 34 through 36 shall use a 16 inch long hanger and sizes 38 through 50 shall use a 17 inch long hanger.

5.3 Palletization. When specified (see 6.2), coats packed as specified in 5.2 , shall be palletized on a 4-way, type I, style 1, 1A, or 1B, size A, class 1 pallet fabricated in accordance with MIL-P-15011 or on a 4-way, type IV, V, or VIII, class 1, size 2, grade A pallet fabricated in accordance with NN-P-71. Each prepared load shall be in accordance with load type I or Ia and bonded with the applicable strap bonding or film bonding means specified in MIL-STD-147. The pallet pattern shall be in accordance with the appendix of MIL-STD-147. Interlocking of loads shall be effected by reversing the pattern of each course. If the container is of a size which does not conform to any of the patterns specified in MIL-STD-147, the pallet pattern used shall be approved by the contracting officer.

5.3.1 Hanger pack. When specified (see 6.2), coats packed as specified in 5.2, shall be palletized in accordance with the appendix of MIL-C-44192 using pallet load pattern number 95.

5.4 Marking. In addition to any special marking required by the contract or purchase order, unit packages, the shipping containers or hanger packs as specified (see 6.2), and palletized unit loads shall be marked in accordance with MIL-STD-129, ASTM D 3951, or the appendix of MIL-C-44192, as applicable.

5.4.1 Bar code markings. Bar code markings, when specified (see 6.2), shall be in accordance with MIL-STD-129.

5.4.2 Polyethylene packages. Each polyethyelene package (see 5.1) shall have the nomenclature, the stock number, the size and length of the coat, and the quantity contained therein legibly printed or stamped in black directly on the bag across the center face or on a white paper label inserted within the bag so as to permit ready identification.

5.4.3 Labels, mixed sizes. Each shipping container packed with mixed sizes shall have securely attached to the end and side, directly under the printing, stenciling, or arrows, a white paper label, 5 inches by 4 inches. The words "MIXED NSN'S" shall be plainly stamped or printed thereon and under these words shall be legibly stamped or printed the correct quantity and NSN's contained therein.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:53Z
Check the source to verify that this is the current version before use.

6. NOTES

6.1 Intended use. The all-weather coat covered by this specification is intended to be worn by male personnel of the Department of the Air Force.

6.2 Ordering data

6.2.1 Acquisition requirements. Acquisition documents should specify the following:

a. Title, number, and date of this specification.

b. Size and length required (see 1.2).

c. When a first article is required (see 3.2).

d. Selection of applicable levels of preservation and packing (see 5.1 and 5.2).

e. When weather-resistant fiberboard containers are required (see 5.2).

f. When palletization is required (see 5.3).

g. When bar code markings are required (see 5.4).

6.3 Samples. For access to samples of the end item and shade samples, address the contracting activity issuing the invitation for bids.

6.4 First article. When a first article inspection is required, the item should be a first article sample, inspected and approved under the appropriate provisions of FAR 52.209-4. The first article should consist of one all-weather coat with liner. The contracting officer should include specific instructions in acquisition documents regarding arrangements for examinations, approval of first article test results and disposition of first article. Invitations for bids should provide that the Government reserves the right to waive the requirement for samples for first article inspection to those bidders offering a product which has been previously acquired or tested by the Government, and that bidders offering such products, who wish to rely on such production or test, must furnish evidence with the bid that prior Government approval is presently appropriate for the pending contract.

6.5 Recycled material. It is encouraged that recycled material be used when practical as long as it meets the requirements of this document (see 3.3).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

6.6 Fusing conditions. For optimum results with the particular fusible used, specific machine settings should be obtained from the contractor furnishing the fusible material. The following fusing conditions were established to include the recommendations of several fusible material suppliers and these limits are furnished for guidance only:

Temperature between pressing surface at the fuse level.	305° F	315° F
Pressure between pressing surface.	5 psi	7 psi
Pressing time	13 seconds	15 seconds

6.7 Peel strength test. The procedure for the peel strength testing with a spring scale should be obtained from the supplier of the fusible material (see 4.5.2.1).

6.8 Subject term (key word) listing.

coat, all-weather
coat, men's
coat, rain
liner, coat

6.9 Changes from previous issue. Asterisks are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

Custodian:
Air Force - 11

Reviewer:
Air Force - 82, 99
DLA - CT

Preparing activity:
Air Force - 11

Project No. 8405-F044

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

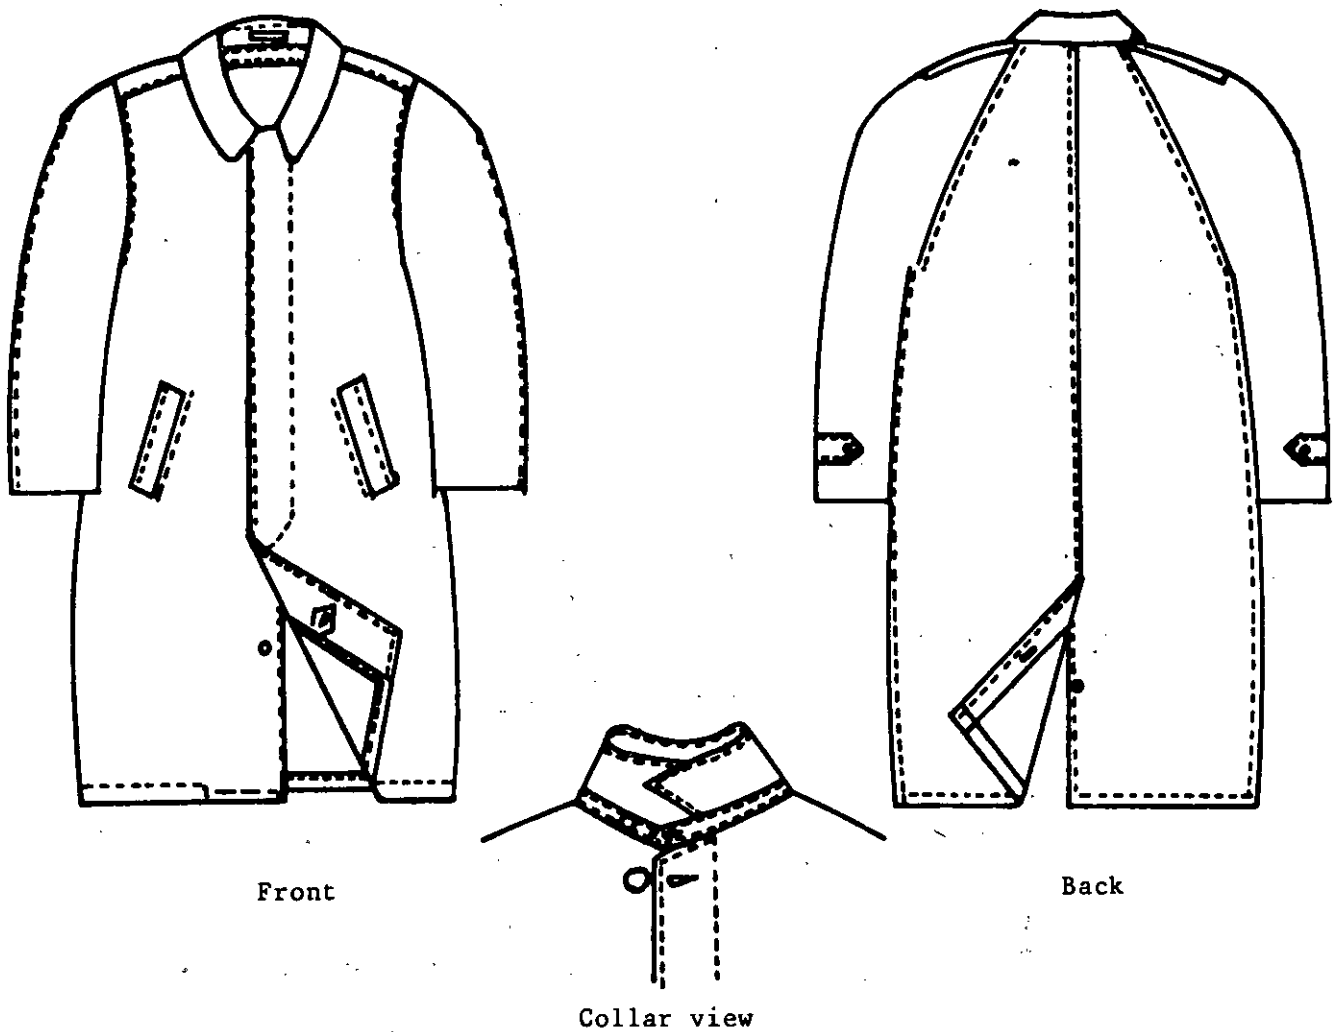


FIGURE 1. Man's all-weather coat, outer shell.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

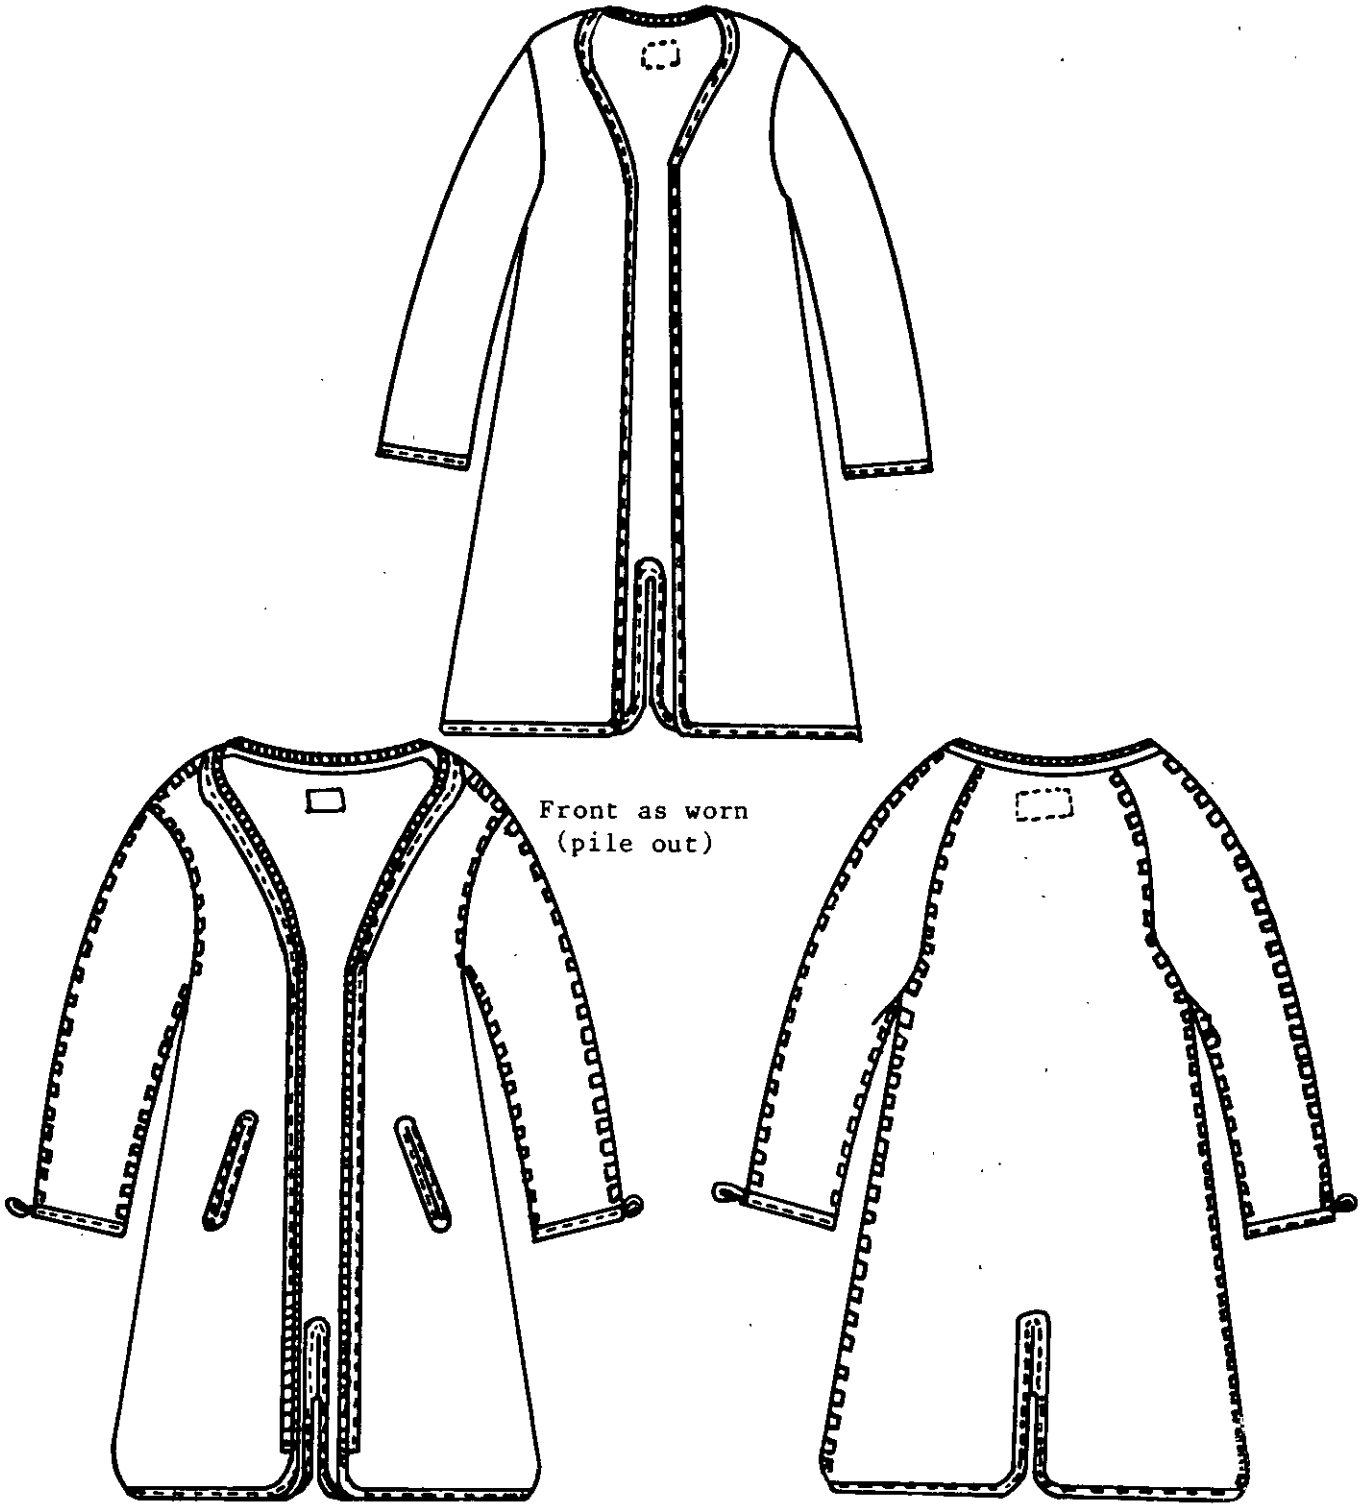


FIGURE 2. Man's all-weather coat, removable liner.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE AIR FORCE
ASD/ENES
Wright-Patterson AFB OH 45433-6503

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 73236 WASHINGTON D. C.
POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE AIR FORCE

ASD/ENES
Wright-Patterson AFB OH 45433-6503

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-C-87110A(USAF)	Coat, All-Weather; Man's, Blue, With Removable Liner

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*:

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE. ASD/ENES OVERPRINT, JAN 85

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.