MIL-C-87170(USAF)
8 April 1983
SUPERSEDING
MIL-R-83301(USAF)
13 July 1973

MILITARY SPECIFICATION

COAT, ALL WEATHER WOMAN'S

This specification is approved for use by the Department of the Air Force, and is available for use by all Departments and Agencies of the Department of Defense

1. SCOPE

1.1 Scope. This specification covers the requirements for a woman's all weather coat made of a polyester-cotton-blend fabric that has been treated with a durable water repellent finish.

1.2 Sizes. The all weather coat shall be furnished in the following sizes as specified (see 6.2).

Short	Regular	Long	Extra Long
6	6		
8	8	8	
10	10	10	
12	12	12	12
14	14	14	14
16	16	16	16
	18	18	18
	20	20	20

2. APPLICABLE DOCUMENTS

2.1 Government documents

2.1.1 Specifications and standards. Unless otherwise specified, the following specifications and standards of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DODISS) specified in the solicitation form a part of this specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

V-B-871	Button, Sewing Hole, And Button, Staple, (Plastic)
V-F-106	Fasteners, Slide, Interlocking
V-T-280	Thread, Gimp, Cotton Buttonhole

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: ASD/ENESS, Wright-Patterson AFB, OH 45433 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8410

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

UU-P-268	Paper, Kraft, Wrapping
DDD-L-20	Label: For Clothing, Equipage, And Tentage (General Use)
PPP-F-320	Fiberboard: Corrugated And Solid, Sheet Stock (Container Grade), And Cut Shapes

MILITARY

MIL-B-371	Braid, Textile, Tubular
MIL-T-3530	Thread And Twine, Mildew Resistant Or Water Repellant Treated
MIL-C-3735	Cuffs, Knit, Wrist And Ankle, And Cloth, Knitted
MIL-S-10884	Fasteners, Snap
MIL-B-17757	Boxes, Shipping, Fiberboard (Modular Sizes)
MIL-C-21852	Cloth, Taffeta, Nylon
MIL-C-29365	Cloth, Nonwoven: Interlining, Fusible, Nylon And Polyester, Polyamid
MIL-C-43251	Cloth, Pile, Acrylic Fiber Pile
MIL-C-43482	Cloth, Poplin, Cotton And Polyester (Quarpel Treated)
MIL-C-43525	Cloth, Satin, Acetate Or Rayon Face And Rayon Or Cotton Back
MIL-T-43548	Thread, Polyester, Cotton-Covered
MIL-C-43836	Cloth, Interlining, Non-Woven

STANDARDS

FEDERAL

FED-STD-191	Textile Test Methods
FED-STD-751	Stitches, Seams, And Stitchings

MILITARY

MIL-STD-129	Marking For Shipment And Storage
MIL-STD-1494	Provisions For Evaluating Quality Of Raincoats

(Copies of specifications, standards, drawings, and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. The issues of the document which are indicated as DOD adopted shall be the issue listed in the current DODISS and the supplement thereto, if applicable.

THE COLOR ASSOCIATION OF THE UNITED STATES, INC.

Department of Defense (DOD) Standard Shades for Buttons 1966

DOD Standard Color Card of Official Standardized Shades for Sewing Thread 1968

(Copies of these publications can be obtained from The Color Association of the United States, Inc., 200 Madison Avenue, New York, New York 10016.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Copies of this publication may be obtained from the American Trucking Association, Inc., Tariff Order Section, 1616 P Street, N.W. Washington, DC 20036.)

UNIFORM CLASSIFICATION COMMITTEE AGENT

Uniform Freight Classification

(Copies of this publication may be obtained from the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, IL 60606.)

(Technical society and technical association specifications and standards are generally available for reference from libraries and are also distributed among technical groups and using Federal agencies.)

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

3. REQUIREMENTS

3.1 Guide samples. Guide samples, when furnished, are solely for guidance and information to the supplier (see 6.3). Variation from this specification may appear in the sample, in which case this specification shall govern.

3.2 Materials

3.2.1 Basic fabric

3.2.1.1 Outer shell. The basic fabric for the outer shell shall conform to class 2 of MIL-C-43482 and shall be US Navy color No. 3356 (see 6.3).

3.2.1.2 Liner. Except for the sleeves, the basic fabric for the liner shall conform to class 2 of MIL-C-43251.

3.2.2 Liner sleeves. The material for the sleeves of the liner shall be black and conform to type I or II of MIL-C-43525.

3.2.3 Material for hanger loop and liner button loop. The hanger loop and sleeve liner button loop shall be cotton or rayon braid that conform to type IX, class 1, Black 385 of MIL-B-371 or the hanger loop shall be made of the basic fabric specified in 3.2.1.1.

3.2.4 Nonwoven interlining cloth. The interlining for the sleeve hem of the outer shell shall conform to type II of MIL-C-43836 with the following exceptions: Staple polyester may be substituted for the staple nylon. The weight of the cloth shall be 2.3 to 2.7 ounces per square yard. The thickness of the cloth at 0.6 pound per square inch (psi) shall be 0.010 to 0.016 inch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.2.5 Nylon taffeta cloth. The lining for the sleeves of the outer shell, the binding for the edge of the liner, and the binding for the back edge of the facings of the outer shell shall be nylon taffeta cloth that conforms to Type IV of MIL-C-21852. The color shall match US Navy Color Shade No. 3356 (see 6.3).

3.2.6 Buttons. The buttons shall be DOD Button Shade Blue BU, Cable No. 62002 (see DOD Standard Shades for Buttons 1966). Except for the stay buttons, the buttons shall conform to type II; class D; style 20 or 21; size 40 lines (front fly), 30 lines, (lapel) and 24 lines (sleeves, collar tab, facing tab, and liner sleeves), of V-B-871. The stay buttons shall conform to type II, class D, style 15, size 18 lines of V-B-871.

3.2.7 Nylon cloth. The collar stand interlining shall be nylon cloth that conforms to table I or shall be a fusible interlining that conforms to class 3 of MIL-C-29365 except the fiber content shall be polyester and the minimum weight shall be 1.6 ounces per square yard.

3.2.8 Thread. The thread for all seaming and stitching shall be DOD Thread Shade Blue AB, Cable No. 66044 (see DOD Standard Color Card of Official Standardized Shades for Sewing Threads 1968). The thread for all seaming and stitching shall conform to ticket No. 30, 3 ply; ticket No. 50, 2 or 3 ply; and ticket No. 70, 2 ply of MIL-T-43548. The thread for seaming and stitching the outer shell shall be water repellent treated in accordance with type II, class 3 of MIL-T-3530.

3.2.9 Gimp. The gimp shall conform to V-T-280, and shall be DOD Thread Shade Blue AB, Cable No. 66044. The gimp shall have colorfastness to laundering (after three cycles) equal to or better than the standard sample (see 6.3). If a standard sample is not available, the gimp shall have good colorfastness to laundering (after three cycles).

3.2.10 Wristlets. The wristlets shall conform to type I or III, class 2, size 2 of MIL-C-3735. The color shall be black.

3.2.11 Fusible seam tape. The seam tape for fusing the side seams, and the sleeve outseams of the outer shell shall be a white nonwoven polyamide fusible web, shall be 3/8 ±1/16 inch wide, and weigh 0.885 ounce per square yard.

3.2.12 Fusible interlining. The fusible interlining for the front facings, the topcollar, the undercollar, the pocket welts, as an alternate for the top and bottom collar stand, and the shoulder loops shall conform to class 3 of MIL-C-29365 except the fiber content shall be polyester and the minimum weight shall be 1.6 ounces per square yard.

3.2.13 Slide fastener. The slide fastener shall conform to type IV, style 1, size L, short tab pull, brass chain or aluminum chain of V-F-106. The length of the slide fastener shall conform to table II. The slide fastener tape shall be black and shall have colorfastness to laundering (after three cycles) and to dry cleaning equal to or better than the standard sample (see 6.3). If a standard sample is not furnished the slide fastener tape shall have good colorfastness to laundering (after three cycles) and to dry cleaning.

3.2.14 Snap fastener. The snap fasteners shall be round or square, rolled edge, sew on type, size 3, brass, black commercial finish in accordance with MIL-S-10884.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE I. Nylon cloth.

Characteristics	Requirements
Material identification	Nylon
Weave	Marquisette leno
Weight	2.6 to 3.0 ounces per square yard
Threads per inch	
Warp	48 (minimum)
Filling	24 (minimum)
Breaking strength	
Warp	110 pounds (minimum)
Filling	48 pounds (minimum)
Stiffness (warp)	0.008 inch-pound (minimum)
Color	Black

TABLE II. Length of slide fasteners.

Size of All Weather coat	Length in Inches			
	Short	Regular	Long	Extra Long
6	67	69		
8	67	69	71	
10	67	69	71	
12	69	71	71	80
14	69	71	75	80
16	71	71	75	80
18		75	75	80
20		75	75	80

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.3 Design. The all weather coat shall be a single breasted fly front model and shall have a button tab closure on the lower right facings, a tab that buttons at the throat, a convertible collar with round ends and a collar stand, two inside hanging pockets with diagonal welts, shoulder loops, split shoulder (raglan back and set-in front sleeves), a one piece back, a yoke lining, and a detachable single ply liner. The liner shall have bound edges, split shoulder raglan sleeves with wristlets, and a button loop at the bottom of each sleeve. The liner shall be attached to the raincoat by a slide fastener and the button loops.

3.4 Construction. The all weather coat shall be constructed as specified in table III; however, the manufacturer will not be required to follow the exact sequence of operations as listed therein. Any additional basting or holding stitching to facilitate manufacture will be permissible provided that the thread is removed or does not show in the finished outer shell or liner.

3.4.1 Stitches, seams, and stitchings. Stitch, seam, and stitching types specified in table III shall conform to FED-STD-751. Whenever two or more seam or stitch types are given for the same part of an operation, any of them may be used. The looper thread of stitch type 401 shall be on the inside of the outer shell and on the side of the liner that will face the outer shell in the finished raincoat. Seam allowances shall be maintained. Seams shall be sewn so that no raw edges, run offs, twists, pleats, puckers, or open seams will result. All seams shall start and finish evenly. Thread tension shall be maintained so that the stitching will not be tight or loose. Unless otherwise specified herein, raise stitching or edge stitching shall be 1/4 to 5/16-inch gage from the edge. The stitching for safety stitch construction shall be 3/8-inch gage. The guides and knives on the stitch machine shall be set to trim only the ravelled ends of the fabric. The fusible seam tape shall not be exposed in the seam construction. Seams required to be worked out having a depth between the fold of 1/16 inch or more shall not be acceptable. The stitches per inch specified in table III shall be the minimum and the maximum stitches per inch.

3.4.1.1 Thread breaks and ends of seams. The ends of all seams and stitchings that are not caught in other seams or stitchings, except the ends of continuous lines of stitching, shall be backtacked not less than 1/4 inch. The ends of continuous lines of stitching, except on labels, shall be overlapped not less than 1/2 inch. The ends of continuous lines of stitching on labels shall be overlapped not less than three stitches. Thread breaks of all stitch types shall be secured by stitching back of the break not less than 1/2 inch. Skipped stitches or thread breaks of stitch type 401 may be repaired using stitch type 301.

3.4.2 Cutting. The part of the all weather coat shall be cut, from the specified materials, in accordance with the pattern parts specified in table IV.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations.

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
1	Cut parts (a) Cut the parts of the all weather coat in accordance with the patterns which show size, seam allowance, directional lines, and marks for the placement of parts and notches for proper assembly. Unless otherwise specified, place the directional lines of the patterns in the warp direction of the material. (b) Unless otherwise specified herein, cut all parts that are made of the basic fabric specified in 3.2.1.1 from the same piece of material. The facing tab, the undercollar, the underside of the shoulder loops, the pocket outerply, the pocket interply, the front lining, the back lining, the fly lining piece, the top fly front, the undercollar stand, and the hanger loop (if not made of braid) may be cut from ends. The parts cut from ends shall approximate the shade of the other parts of the outer shell. The front lining and the back lining yoke shall match each other. (c) If the hanger loop is not made of braid, cut the stripping for the hanger loop of sufficient width so that the finished hanger loop will be 3/8 ±1/8 inch wide (see No. 7).					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	(d) Cut the parts of the liner that are made of the basic fabric specified in 3.2.1.2 from the same material. The pile liner may be cut in either of the warp directions (nap running up or down) provided that the three parts used for each unit run in the same direction. (e) Cut all interlining parts in accordance with the patterns. Approximately 1/8 inch may be trimmed from all sides of the fusible interlining pieces to facilitate the fusing operation. (f) Cut the binding for both the outer shell and the liner on the bias 1-1/8 ±1/8 inch wide.					
2	Replace defective parts (a) Remove any parts containing material defects or workmanship damages that are classified as defects in MIL-STD-1494 from production during the spreading, cutting, and manufacturing process and replace with nondefective and properly matched parts.					
3	Mark parts (a) Mark, ticket, or bundle the cut parts to insure a uniform shade and size throughout the outer shell and the liner. Unless otherwise specified herein, any method marking the cut parts may be					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	used except metal fastening devices, sew-on shade tickets, or adhesive-type tickets that will leave traces of adhesive on the material after the tickets are removed. Noncorrosive metal fastening devices may be used to mark the cut parts of the liner.					
4	Make shoulder loops					
	(a) Position the shoulder loop interlining on the top ply of each shoulder loop and fuse (see 3.4.3).					
	(b) Join the top ply of each shoulder loop (with interlining) to the underply of the shoulder loop along the sides and across the neck end. Trim and turn the corners and force out the edges and the corners. Stitch each shoulder loop 1/4 to 5/16 inch from the sewn edge.	50 50 50	50 70 50	301 or 401 and 301	SSe-2(a) SSe-2(a) SSe-2(b)	10-12 10-12 10-12
5	Make facing tab					
	(a) Fold the facing tab in half lengthwise. Stitch the facing tab along the side raw edge and the point. Trim, turn, and work out the edges of the facing tab. Stitch the sides and the point of the storm tab 1/4 to 5/16 inch from the edges.	50 50 50 50	50 70 50 50	301 or 401 and 301	SSe-2(a) SSe-2(a) SSe-2(b) and OSf-1	10-12 10-12 10-12 10-12

Source: https://assist.dla.mil -- Downloaded: 2026/10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	(b) Make a buttonhole in the facing tab (facing). The buttonhole shall be positioned as indicated on the patterns. The inside edge of the eyelet shall be 1/2 to 5/8 inch from the pointed end of the facing tab. The buttonhole shall not be off center more than 1/8 inch. The buttonhole shall be a cut-after, eyelet-end, taper-bar or square-bar type worked over gimp. The finished cut length of the buttonhole shall be 5/8 to 3/4 inch long measured from the center of the eyelet. The finished tab shall measure 2-7/8 ±1/4 inch long from the pointed edge to the back straight edge and 1-3/8 ±1/4 inch wide at the back straight edge.	30	50	Buttonhole		50-54 stitches per buttonhole
6	Make collar					
	(a) Position the topcollar interlining on the topcollar and the undercollar interlining on the undercollar and fuse (see 3.4.3).					
	(b) Stitch the undercollar to the topcollar around the side and the top edges.	50 50	50 70	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12
	(c) Trim, turn, and force out the edges and the points of the collar. Stitch the collar 1/4 to 5/16 inch from the edges.	50	50	301	SSe-2(b)	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
7	Make hanger loop (if braid is not used)					
	(a) Turn the edges of the hanger loop to the center. Stitch the abutted edges with a row of stitching, extending across and covering the edges of the material, 3/16 to 5/16-inch gage.	50	50	406	EFh-1	10-12
	OR					
	(b) Fold the hanger loop with the raw edges turned in. Stitch the hanger loop 1/16 to 1/8 inch from each edge.	50	50	301	EFp-2	10-12
8	Make collar stand and attach collar					
	(a) Quilt the collar stand interlining to the undercollar stand with four or five rows of stitching approximately 1/4 inch apart, or if optional method is used, position topcollar stand interlining on topcollar stand and undercollar stand interlining on undercollar stand and fuse (see 3.4.3).	50	50	301	SSv	10-12
	(b) Position the collar between the topcollar stand and the undercollar stand, as indicated by the marks on the patterns, with the raw edges even, and stitching along the top edge of the collar stand. Continue stitching the tab on the right side of the collar stand, in accordance with the notches, 1/4-inch gage.	50 50	50 70	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	(c) Close the left side of the collar stand. Trim the corner.	50	50	301 or 401	SSe-2(a)	10-12
	(d) Turn the collar stand and the tab to the face side with the seam allowance against the collar stand. Raise stitch the collar stand through the collar and around the outer edge of the tab 1/16-inch gage.	50	50	301	SSe-2(b)	10-12
	(e) Stitch the bottom edge of the top-collar stand and the undercollar stand together. The finished collar shall be 2-1/8 ±1/8 inch wide at the center back.	50	50	301	SSa-1	10-12
	(f) Position the hanger loop on the center of the topcollar stand. Turn the ends of the hanger loop under. Bartack each end of the hanger loop. The bartack shall be 1/2 ±1/16 inch long. The length of the finished hanger loop between the bartacks shall be 2-3/8 ±1/8 inch.	50	50	Bartack		28 stitches per bartack
	(g) Make a horizontal, cut-after, eyelet-end, taper-bar or square-bar type of buttonhole, worked over gimp, in the center of the collar stand. The button-hole shall be not more than 1/8 inch off center. The inside edge of the eyelet shall be 1/2 ±1/8 inch from the front edge of the collar stand tab. The purling	30	50	Button-hole		50-54 stitches per button-hole

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	may be on either side. The finished cut length of the buttonhole shall be 5/8 ±1/8 inch.					
9	Make pocket welts					
	(a) Position the pocket welt interlining on the pocket welts, and fuse each pocket welt (see 3.4.3).					
	(b) Fold each pocket welt in half lengthwise face to face and stitch the side edges.	50 50	50 70	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12
	(c) Trim, turn, and force out the edges and the point of each pocket welt. Stitch each pocket welt 1/4 to 5/16 inch from the side and the folded edges.	50	50	301	SSe-2(b) and OSf-1	10-12
	(d) Stitch the inner raw edges of the welt together. The finished welt on the coat shall be 1-3/4 ±1/8 inch wide and 7-1/4 ±1/4 inch long.	50	50	301	SSa-1	10-12
10	Attach welt and pocket to front					
	(a) Stitch the welt to the front with the top side of the welt against the front, simultaneously stitching the inner pocket ply to the welt in accordance with the markings indicated on the patterns.	50	50	301	SSaw-2(a)	10-12
	(b) Stitch the inner pocket ply to the outside of the front, parallel to and	50	50	301	SSe-2	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	1/2 ±1/8 inch from the pocket welt stitching with a 1/4-inch seam. (c) Cut the front between the two lines of stitching (welt and inner pocket ply), cutting a triangular tongue at each end in the front and the inner pocket. Care shall be taken so that the ends of the tongue notch in the fronts will not be deeper than the ends of the pocket welt finished position.					
	(d) Turn the welt against the inner pocket and the welt joining seam allowances toward the front; raise stitch the front through the joining seam allowances 1/16-inch gage from the welt seam line.	50	50	301	SSaw-2(b)	10-12
	(e) Turn the inner pocket ply through the opening and edge stitch front and inner pocket piece 1/16 inch from folded edge. Turn inner pocket ply to outside and stitch to outer pocket ply around the top, sides and bottom.	50	50	301	SSe-2(b)	10-12
	(f) Notch the seam allowance of the inner and outer pocket ply to the end of the stitching at the front straight edge of the outer pocket.					
	(g) Turn pocket to inside and stitch 3/16 to 1/4 inch from folded edge, continue stitching the outer pocket ply	50	50	301	SSe-2(b) and LSbj-1	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	at the front straight edge of the inner pocket 1/4-inch from the raw edge.					
	(h) Smooth out pocket and welt on outer pocket piece and edge stitch back edge of pocket opening to outer pocket piece 1/16 inch from folded edge.	50	50	301	SSe-2(b)	10-12
	(i) Smooth the welt over the pocket opening with the tongue notch at each end under the welt. Tack the ends of the welt with two connected rows of stitching at the back corners of the welt through the outer and inner pocket plies. Stitch 1/16 inch from the end of the welt to the corner of the welt, and then stitch diagonally inward to the edge stitching on the welt and along the stitching to the raise stitching on the welt joining seam.	50	50	301	LSa-1	10-12
	(j) Raise stitch the straight edge of the inner pocket ply to the front edge of coat.	50	50	301	SSa-1	10-12
11	Make shoulder darts					
	(a) Stitch the front shoulder darts, tapering to a point 1 ±1/4 inch below the drill mark of dart.	50	50	301	SSa-1	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	(b) Press the seam open flat and the folded edge at the bottom of the dart toward the center front.					
12	Make facings					
	(a) Position the neck facing interlining on the neck facing and fuse (see 3.4.3).					
	(b) Position the front facing interlining on the front facings and fuse (see 3.4.3).					
	(c) Join neck facing to front facing at shoulder.	50	50	301	SSa-1	10-12
	(d) Press seam open and flat with a heated pressing iron or machine.					
	(e) Mark a line 1-1/2 inches from the back edge of the facing on the fused side for positioning the lining.					
	(f) Bind the back raw edge of the front and neck facing. The finished binding shall be 3/16 to 1/4 inch wide.	50	50	301	BSc-1	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-0-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
13	Make right fly front					
	(a) Position the fly lining piece on the right front facing, as indicated by the pattern notches, and stitch in accordance with the seam allowance on the pattern. The front raw edge of the fly lining piece shall be positioned 1/2 ±1/8 inch back of the front raw edge of the facing. The joining seam shall be 3/4 ±1/8 inch from the front edge of the facing.	50 50	50 70	301 or 401	LSbj-1 LSbj-1	10-12 10-12
	(b) Cut the facing and the fly piece diagonally at each corner to the line of stitching.					
	(c) Turn the fly piece to the inside; stitch the length of the fly piece 1/4 to 5/16 inch from the turned edge, backtacking each end or make a 90 degree sew out to the front raw edge of the facing.	50	50	301	SSe-2(b)	10-12
14	Make buttonholes on the right front facing					
	(a) Make four buttonholes on the fly piece as indicated by the pattern marks. The buttonholes shall be cut-first, eyelet-end, taper-bar or square-bar type, worked over gimp. The taper-bar shall be finished with not less than four stitches at the bar end (excluding the crossover stitch). The square-bar shall have the ends of the gimp pulled through the underside and bartacked in a separate operation. The finished cut buttonholes	30 50	50 50	Button-hole Bartack		70-74 stitches per buttonhole 21 stitches per bartack

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	shall be 1-1/8 ±1/8 inch long. The inside edge of the eyelet of each buttonhole shall be 1/2 to 5/8 inch from the front edge of the fly lining. The buttonholes shall not be off center more than 1/8 inch. The purling of the buttonholes shall be on the outside of the fly. Position second fly piece under the right fly facing with the raw edge above and below the notches even and the front edge of the fly facing between the notched 3/4 ±1/8 inch from the raw edge of the fly piece and stitch the flies together, with the stitching centered between the buttonholes and perpendicular to the front edge.	50	50	301	LSbj-1	10-12
	OR					
	(b) As an option to the perpendicular stitching, place a bartack centered between each buttonhole superimposed on the fly piece edge stitching. The bartacks shall be caught through the facing and fly pieces only. NOTE: When a taper-bar buttonhole is used, the gimp cannot be pulled through to the underside. The lapped end shall be bar-tacked close to the end of the overlap of stitches. The ends of stitches and gimp shall be trimmed close to bartack.	50	50	Bartack		28 stitches per bartack

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
15	Attach labels to outer shell					
	(a) Position the identification label on the left facing centered with the top of the identification label not less than 1 ±1/2 inch below the lower location of the tab button. Position the instruction label below the identification label and the size label below the instruction label. Stitch the three labels on all four sides to the left facing. The stitching shall not be through the printing on the labels. The top edge of the instuction label may be caught in the bottom row of the stitching of the identification label. The top edge of the size label may be caught in the bottom row of the instruction label.	50	50	301	LSbj-1	8-12
	OR					
	(b) Position the combination identification and instruction label on the left facing not less than 1 ±1/2 inch below the location of the tab button. Position the size label below the combination identification and instruction label. Stitch the two labels on all four sides to the left facing. The stitching shall not be through the printing on the labels. The top edge of the size label may be caught in the bottom row of the stitching of the combination identification and instruction label.	50	50	301	LSbj-1	8-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
16	Attach facing tab					
	(a) Position the facing tab on the right facing, at the pattern marks, with the raw edge of the facing tab parallel to the front edge of the right facing. Stitch the facing tab to the right facing 1/4 inch from the raw edge. Turn the facing tab to the finished position (point of facing tab toward the front of the right facing), and stitch enclosing the raw edge. Continue stitching across the top of the facing tab with the stitching superimposed on the horizontal edge stitching of the facing tab. The purling of the buttonhole in the facing tab shall face the wearer of the finished all weather coat.	50 50 50	50 70 50	301 or 401 and 301	LSs-2(a) LSs-2(a) LSs-2(b)	10-12 10-12 10-12
17	Make lining (yoke)					
	(a) Join the front lining to the front sleeve lining at each armhole with a safety stitch.	50 (Chain) 70 (Over-edge)	70 (Chain and over-edge)	515 or 516 or 519	SSa-2	10-12
	(b) Position the front edge of the back sleeve lining, and stitch the front edge of each shoulder lining piece to the shoulder edge of the front lining with a safety stitch. Continue the stitching the entire length of each sleeve.	50 (Chain) 70 (Over-edge)	70 (Chain and over-edge)	515 or 516 or 519	SSa-2	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	(c) Position the back edge of each shoulder lining piece and the back edge of each back sleeve lining to the front edge of the back lining, and stitch to the bottom of each armhole with a safety stitch.	50 (Chain) 70 (Over-edge)	70 (Chain and over-edge)	515 or 516 or 519	SSa-2	10-12
	(d) Overedge stitch the bottom raw edge of each sleeve lining.	70	70	502 or 503 or 504	EFd-1	6-12
	(e) Close the side seam of the front and back lining and the underarm seam of the sleeve lining with a safety stitch.	50 (Chain) 70 (Over-edge)	70 (Chain and over-edge)	515 or 516 or 519	SSa-2	10-12
	(f) Hem the bottom of the lining with raw edges turned in. The finished hem in the bottom of the lining shall be 3/8 to 1/2 inch wide.	50	50	301	EFb-1	10-12
18	Join sleeves to outer shell					
	(a) Stitch the front sleeves to the front armholes from shoulder to 3 ±1/2 inch below the step on the front.	50 50	50 70	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12
	(b) Turn and raise stitch the seams 1/4 to 5/16 inch with stitching on the front to the step as marked on the pattern. Turn at the step and stitch to the joining seam line.	50	50	301	LSq-2(b)	10-12
	(c) Stitch a back sleeve to each back armhole from the neckline to 3 ±1/2 inch below the step on the back.	50 50	50 70	301 or 401	LSq-2(a) LAq-2(a)	10-12 10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	(d) Turn and raise stitch the seams 1/4 to 5/16 inch with stitching on the back to the step as marked on the pattern. Turn at the step and stitch to the joining seam line.	50	50	301	LSq-s(b)	10-12
19	Close sides of outer shell					
	(a) Position the fronts to the backs, face to face, with the edge of the fronts folded over the edge of the backs. Insert the seam tape on the backs under the folded edge of the fronts; stitch the side seams of the outer shell, 1/16 to 3/32 inch from the raw edge, catching the seam tape in the stitching.	50 50	50 70	301 or 401	SSw-2(a) SSw-2(a)	10-12 10-12
	(b) Turn each side seam toward the back, and raise stitch 1/4 to 5/16 inch from the folded edge of the seam.	50	50	301	SSw-2(b)	10-12
	(c) Press the side seams of the outer shell, with a heated pressing iron or machine, fusing the seam tape.					
20	Close sleeves of outer shell					
	(a) Turn each seam toward the front, and raise stitch 1/4 to 5/16 inch from the folded edge.	50	50	301	LSq-2(b)	10-12
	(a) Join each top arm seam from the neckline to the bottom of the sleeve simultaneously stitching the seam tape to the back edge of the front sleeve.	50 50	50 70	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	(c) Press the seams, with a heated pressing iron or machine, fusing the seam tape (see 3.4.3).					
	(d) Stitch the sleeve hem interlining to the bottom of each sleeve as indicated by the pattern marks.	50	50	301		10-12
	(e) Stitch each underarm seam of the outer shell.	50	50	301	SSa-1	10-12
	(f) Press each underarm sleeve seam of the outer shell open and flat with a heated pressing iron or machine.					
	(g) Complete the stitching of the sleeves to the armholes of the outer shell.	50	50	301	SSa-1	10-12
21	Attach shoulder loops					
	(a) Fit the shoulder loops to the shoulders and trim, leaving a 1/4-inch seam allowance at the sleeve end.					
	(b) Position each shoulder loop on a shoulder seam with the raw edge end facing the neck opening, and stitch with the stitching in line with the armhole seam.	50	50	301	LSb1-2(a)	10-12
	(c) Fold each shoulder loop toward the neck opening, and raise stitch 1/4 to	50	50	301	LSb1-2(b)	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	5/16 inch from the folded edge and in line with the raise stitching on the fronts.					
	(d) Sew the stud of a snap fastener to the underside of each shoulder loop centered with tolerance of 1/8 inch centered on the neck end 1/2 inch from the edge and completely hidden from the outside view. Sew the socket of a snap fastener to each shoulder to correspond with the stud on the shoulder loop. If the snap fasteners are hand sewn, tack off the hand sewing with not less than two stitches. The snap fasteners shall be positioned so that the closure will be flat and smooth and the stitching will not show on the outside of the shoulder loops.	50		Hand or		12-16 double thread stitches per stud or socket
		50	50	101 or		21-22 stitches per stud or socket
		50	50	301		14-16 stitches per stud or socket
	NOTE: The shoulder loops shall be positioned so that a finished shoulder loop will be centered on each shoulder seam with the sleeve end of the shoulder loop even with the front armhole seam and with the neck end of the shoulder loop extending to within 1/8 inch of the collar joining seam line.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
22	Attach collar to outer shell					
	(a) Stitch the collar to the outer shell, with the notches matching. Slash the front neckline seam allowance, at the curved edges to facilitate turning of collar without pleats.	50 50	50 70	301 or 401	SSa-1 SSa-1	10-12 10-12
23	Attach lining to facings					
	(a) Position raw edge of lining to marks on facings and stitch lining to facings.	50	50	301	SSa-1	10-12
24	Attach facing assembly to shell					
	(a) Position facing to front and neckline with raw edges even and stitch across neckline through coat, collar stand and collar. Continue stitching across lapels, down front and across bottom of facing.	50	50	301	SSe-2(a) and LSq-2(a)	10-12
	(b) Turn neck facing and raise stitch across neckline 1/16 to 3/32 inch from edge, the length of the collar stand. The stitching shall not be visible on the outside of coat.	50	50	301	LSq-2(b)	10-12
	(c) Stitch sleeve lining to sleeve 3/8 inch from bottom over edged seam of lining.	50	50	301	SSa-1	10-12
	(d) Turn up bottom of sleeve at hem notch, align underarm seams of lining and	50	50	301	SSa-1	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	shell and stitch together for a distance of 6 to 6-1/2 inches beginning 2-1/2 to 3 inches from the bottom.					
25	Anchor lining to side seams					
	(a) With the sleeve setting seams of the lining aligned with the sleeve setting seams of the outer shell, tack each lining side seam to an outer shell side seam 2 to 3 inches below the sleeve setting seam. The tacks shall be automatic straight tacks that are 1/2 inch long or vertical bartacks that are 3/8 to 1/2 inch long.	50 50	50 50	301 or Bartack		28 stitches per bartack 28 stitches per bartack
26	Hem bottom of outer shell					
	(a) Turn in the raw edge of the bottom of the outer shell and hem. The finished bottom hem shall be 1 ±1/8 inch wide. The turned in raw edge may be stitched prior to hemming.	50	50	301	EFb-1	10-12
27	Finish fronts					
	(a) Turn the facings; force out the edges. Edge stitch the fronts 1/4 to 5/16 inch from the edge across the top of the lapels, down the fronts, and across the bottoms to the back edge of the facings and sew out at 90 degrees and up to the bottom hem stitching catching the edge of the facing.	50	50	301	SSe-2(b)	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
28	Top stitch fly front					
	(a) Position the finished fly front shaper (stitch line) on right front 1/2 ±1/8 inch, below the bottom of the fly opening on the front and mark. Stitch on the marked line through all plies, continuing the stitch to the collar joining seam, maintaining the stitch 2-1/2 ±1/16 inch, from and parallel to the front edge.	50	50	301	LSbj-1	10-12
29	Make buttonholes					
	(a) Make a buttonhole in the right lapel as indicated by the pattern marks, with the center of the eyelet of the finished lapel buttonhole 1 to 1-1/8 inches from the top (step) edge of the lapel and 3/4 to 7/8 inch in from the finished front edge of the lapel. The buttonhole shall be a cut-first, eyelet-end, square-bar type worked over gimp with the ends pulled through to the underside and bartack in a separate operation. The finished cut buttonhole shall be 7/8 ±1/8 inch long. The purling shall be on the facing side. As an alternate, a cut-first, eyelet-end, taperbar buttonhole can be used.	30	50	Button-hole		50-54 stitches per buttonhole
		50	50	Bartack		21 stitches per bartack
30	Tack pocket to facing					
	Tack back edge of facing to top of pocket and back edge of pocket with two 1/2 to 3/4 inch vertical tacks. The tacks shall not be more than 1/2 inch from top and	50	50	Bartack		28 stitches per bartack

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	bottom edge of pocket and approximately 1 inch from edge of binding.					
31	Set slide fastener on outer shell					
	Prior to assembly of the slide fastener to the facing, permanently mark the center of the slide fastener. Make sure that the center as marked falls in line with the center back of the neck facing.					
	(a) Position the slide fastener on the outer shell facings so that the ends of the slide fastener will be equidistant from the bottom edge of the outer shell and the separating pin of the slide fastener will be on the right facing. Position the slide fastener on the underside of the outer shell facings with the front edge of the chain completely covered by the bound edge 1/8 to 3/16 inch. Turn in the end of the slide fastener tape 1/2 to 3/4 inch. Stitch the length of the slide fastener tape 3/16 to 5/16 inch from the back edge of the chain. Secure each end of the slide fastener tape with a bartack superimposed on the stitching. The bartack shall be 3/8 to 1/2 inch long. When ends of slide fastener tape are finished they need not be turned under.	50	50	301	SSa-1	10-12
		50	50	Bartack		28 stitches per bartack

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
32	Clean outer shell					
	(a) Trim thread ends.					
	(b) Remove loose threads from the outer shell.					
	(c) Remove spots, stains, and markings from the outer shell.					
	(d) Remove shade tickets from the outer shell.					
33	Press outer shell					
	(a) Press the collar, the fronts, the back, the pockets, the sleeves, and the hems with a steam pressing machine or a hand pressing iron.					
34	Sew buttons on outer shell					
	(a) Mark or gage the position of the buttons, as indicated by the pattern marks, and sew the buttons to the all weather coat as follows:	30		101 or		14-16 stitches per button
	(1) Sew four 40-line buttons on the left front 2-1/8 to 2-1/4 inches from the edge, to correspond with the buttonholes in the right fly, with the stitching of each button through the all weather coat,	30 30	30	301 or Hand		14-16 stitches per button 4-6

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	the facing, and an 18-line stay button. The 40-line buttons shall be shank wrapped. (2) Sew a 30-line button on the left front lapel 2-3/8 to 2-5/8 inches from the front edge, to correspond with the buttonhole in the right front lapel with the stitching through the all weather coat, the facing, and an 18-line stay button. (3) Sew a 24-line button on the left front, to correspond with the buttonhole in the facing tab, with the stitching through the all weather coat and the facing. (4) Sew two 24-line buttons on the sleeves, the first button centered on the topsleeve seam 1-1/4 inches from the bottom of the sleeve and the second button 3/4 inch above the center of the first button. (5) Sew one 24-line button on the left side of the undercollar stand to correspond with the buttonhole in the collar stand tab when the collar stand tab is closed. Sew one 24-line button on the right side of the undercollar stand to secure the undercollar tab when it is not in use. The buttons shall be sewn to the undercollar and the interlining only.					stitches per button.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	(6) Sew a 24-line button to the underarm seam of each sleeve corresponding to loops on liner at cuff end of sleeve. The stitching shall not be visible on the outside of the coat.					
35	Make liner Caution shall be taken in fabricating the liner so that when the liner is attached to the all weather coat, all neck seams on the liner will be lined up to correspond with all counterpart seams of the outer shell components. No seam on the liner shall be staggered more than 3/8 inch from the corresponding seam of the outer shell components. The center back of the liner shall match the center back of the outer shell. The shoulder seams of the liner shall match the shoulder seams of the outer shell. The sleeve seams of the liner shall match the sleeve seams of the outer shell.					
36	Join back to fronts of liner					
	(a) Stitch and overedge stitch the back to each front at the side seam with a 3/8 inch seam.	70	70	515 or 516 or 519	SSa-2	10-14
37	Join underarm of sleeve liner					
	(a) Stitch and overedge stitch the underarm of each sleeve with a 3/8 inch seam.	70	70	515 or 516 or 519	SSa-2	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
38	Set in sleeves of liner					
	(a) Match the front and back sleeve notch and the underarm seam of the sleeve with the side seam of the liner and stitch and overedge stitch with a 3/8 inch seam.	70	70	515 or 516 or 519	SSa-2	10-14
	(b) With the front shoulder seam matching the topsleeve notch, stitch and overedge stitch each sleeve top seam with a 3/8 inch seam.	70	70	515 or 516 or 519	SSa-2	10-14
39	Attach wristlets of liner					
	(a) Stitch and overedge stitch the wristlet at the bottom of each sleeve, with a 3/8 inch seam distributing the the fullness and catching the braid button loop on the sleeve underseam. The finished loop shall accommodate a 24-line button.	70	70	515 or 516 or 519	SSa-2	10-14
40	Bind edges of liner					
	(a) To preclude stretching of the back neck area of the liner sew a stay tape to the back of the neck from the shoulder seam to shoulder seam.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	(b) Bind the edges of the liner as specified herein. The binding shall be uniformly stitched with no raw edges showing. The fabric shall be caught in the stitching. The finished binding shall be 1/4 to 5/16 inch wide. (1) Bind the edges of the bottom, the fronts, and the neck in one operation. The ends of the binding shall be turned in and caught in the stitching. The ends of the binding shall overlap not less than 1/2 inch. The end of the binding shall be turned on itself and securely stitched or bartacked. The bartack shall be 1/2 ±1/16 inch long.	50 50 50	50 70 50	301 or 401 or Bartack	BSc-1 BSc-1	10-12 10-12 28 stitches per bartack
41	Attach labels to liner					
	(a) Position the identification label on the center back on the pile side of the liner so that the top edge of the identification label will be 1-1/4 to 1-3/4 inches from the bottom of the binding. Stitch the identification label on all four sides.	50	50	301	LSbj-1	10-12
	(b) Position the instruction label on the left front on the pile side of the liner, as indicated by the pattern marks. Stitch the instruction label on all four sides. Size label may be caught in the bottom row of the stitching of instruction or combination label.	50	50	301	LSbj-1	10-12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
	NOTE: The combination size, identification and instruction label combined in one label may be used.					
42	Set slide fastener on liner Prior to the assembly of the slide fastener to the liner, make sure the permanently marked center of the slide fastener tape that is applied to the liner corresponds with the center of the slide fastener tape that is sewn to the facings of the outer shell. The center mark shall match the back center notch at the neck of the back line.					
	(a) Position the slide fastener on the underside of the liner, with the back edge of the chain immediately adjacent to the bound edge of the liner. Turn in the raw edge end of the slide fastener tape 1/2 to 3/4 inch. Stitch the length of the slide fastener tape with the stitching superimposed on the binding stitching. The slider shall be on the left side of the finished liner. When ends of slide fastener tape are finished they need not be turned under.	50	50	301	LSa-1	10-12
	(b) Secure each end of the slide fastener tape with a bartack superimposed on the binding stitching. The bartack shall be 3/8 to 1/2 inch long.	50	50	Bartack		28 stitches per bartack.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing operations. - Continued

No.	Description of Operation	Thread		Stitch Type	Seam and Stitch Type	Stitches Per Inch
		Top	Lower			
43	Clean liner (a) Trim all thread ends. (b) Remove all loose thread from the liner. (c) Remove all spots and stains from the liner. (d) Remove all shade tickets from the liner.					
44	Attach liner to outer shell (a) Attach the liner to the outer shell by means of the slide fastener, checking the operation of the slide fastener to insure free and easy manipulation of the slider. When the slide fastener is closed, the outer shell and the liner shall not show any evidence of bulging or distortion. The liner shall match the outer shell in size.					

Source: https://assist.dla.mil -- Downloaded: 2026/10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE IV. Pattern parts.

Materials	Nomenclature	Parts Cut
Basic fabric for outer shell (see 3.2.1.1)	Back	1
	Front	2
	Facing tab	1
	Shoulder loop	4
	Collar (one topcollar and one undercollar)	2
	Collar stand (one topcollar stand and one undercollar stand with undercollar tab)	2
	Pocket welt	2
	Shoulder lining piece	2
	Pocket outer ply	2
	Pocket inner ply	2
	Fly piece	2
	Front lining	2
	Back lining	1
	Back sleeve	2
	Front sleeve	2
	Back neck facing	1
Knitted pile cloth (see 3.2.1.2)	Front liner	2
	Back liner	1
Acetate-face, rayon-acrylic-back, satin cloth (see 3.2.2)	Front sleeve liner	2
	Back sleeve liner	2
Nonwoven interlining cloth (see 3.2.4)	Sleeve hem interlining	2

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE IV. Pattern parts. - Continued

Materials	Nomenclature	Parts Cut
Nylon taffeta cloth (see 3.2.5)	Front sleeve lining	2
	Back sleeve lining	2
Nylon cloth (see 3.2.7)	Collar stand interlining	1
Fusible interlining (see 3.2.12)	Front facing interlining	2
	Back neck facing interlining	1
	Collar interlining (one for topcollar and one for undercollar)	2
	Collar stand interlining (optional)	2
	Pocket welt interlining	2
	Shoulder loop interlining	2
Shaper	Finished fly front shaper (stitch line)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.4.3 Fusing operations. The fusing operations specified in table III for fusing the fusible interlining that is specified in 3.2.7 and 3.2.12 to the basic fabric of the outer shell that is specified in 3.2.1.1 should be performed on a fusing press. Specific settings (see 6.5) for the particular fusible style and press to be used should be obtained from the supplier of the fusible material so that the optimum results can be obtained. The strength of the bond of the fusible interlining to the basic fabric of the outer shell shall be as specified in MIL-C-29365.

3.4.4 Pressing. All pressing specified in table III shall be performed with a heated pressing iron or machine.

3.5 End item appearance. After the all weather coat has been subjected to five launderings and five dry cleanings, the all weather coat shall not show any evidence of bubbling or delamination of the fused areas. The all weather coat shall not have any "strike through" of the adhesive after fusing.

3.6 Standard patterns. Standard patterns for the pattern parts and shaper listed in table IV will be furnished by the procuring activity (see 6.2). Unless otherwise specified, the standard patterns provide a seam allowance of 3/8 inch. The standard patterns will show size, seam allowance, shape and placement of pockets, and directional lines. The standard patterns shall be used by the manufacturer of the all weather coat to cut the working patterns. The working patterns shall be identical in size and shape to the standard patterns. The standard patterns and the working patterns shall not be altered in any way.

3.7 Finished measurements. The finished measurements of the outer shell shall conform to table V. The finished measurement of the liner shall conform to table VI.

3.8 Labels. The liner shall have a size label, an identification label, and an instruction label. The outer shell shall have a size label, an identification label, and an instruction label or shall have a size label and a combination identification and intruction label. The labels shall have colorfastness to laundering and to dry cleaning in accordance with DDD-L-20.

3.8.1 Size labels. The size label for the liner and the size label for the outer shell shall conform to type I, class 2 of DDD-L-20.

3.8.2 Identification labels. The identification label for the liner and the identification label for the outer shell shall conform to type I, class 1 of DDD-L-20.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Finished measurements of outer shell.

Finished Measurements in Inches 1/ 2/			
Sizes	1/2 Bust	Back Length	Sleeve Inseam Length
Short			
6	20 1/4	37 1/2	15
8	20 3/4	37 3/4	15 1/8
10	21 1/4	38	15 1/4
12	21 3/4	38 1/4	15 3/8
14	22 1/2	38 1/2	15 1/2
16	23 1/4	38 3/4	15 5/8
Regular			
6	20 1/4	39	16
8	20 3/4	39 1/4	16 1/8
10	21 1/4	39 1/2	16 1/4
12	21 3/4	39 3/4	16 3/8
14	22 1/2	40	16 1/2
16	23 1/4	40 1/4	16 5/8
18	24	40 1/2	16 3/4
20	25	40 3/4	16 7/8

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Finished measurements of outer shell. - Continued

Finished Measurements in Inches 1/ 2/			
Sizes	1/2 Bust	Back Length	Sleeve Inseam Length
Long			
6	20 1/4	40 1/2	17
8	20 3/4	40 3/4	17 1/8
10	21 1/4	41	17 1/4
12	21 3/4	41 1/4	17 3/8
14	22 1/2	41 1/2	17 1/2
16	23 1/4	41 3/4	17 5/8
18	24	42	17 3/4
20	25	42 1/4	17 7/8
Extra Long			
12	21 3/4	44 1/4	18 7/8
14	22 1/2	44 1/2	19
16	23 1/4	44 3/4	19 1/8
18	24	45	19 1/4
20	25	45 1/4	19 3/8

1/ The tolerance for the finished measurements of the outer shell shall be ±1/2 inch for the 1/2 chest and the back length and ±1/4 inch for the sleeve inseam length.

2/ The finished measurements of the outer shell shall be taken with the all weather coat flat, smooth, and buttoned. The 1/2 bust shall be taken, across the bust, from armhole seam to armhole seam. The back length shall be taken, at the center back, from the lower edge of the collar stand to the bottom of the all weather coat. The sleeve inseam length shall be taken, at the inseam, from the base of the armhole to the bottom of the sleeve.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VI. Finished measurements of liner.

Finished Measurements in Inches 1/ 2/			
Sizes	1/2 Bust	Center Back Length	Sleeve Length
Short			
6		31	11 3/4
8		31 1/4	11 7/8
10		31 1/2	12
12		31 3/4	12 1/8
14		32	12 1/4
16		32 1/4	12 3/8
Regular			
6		32	12 3/4
8		32 1/4	12 7/8
10		32 1/2	13
12		32 3/4	13 1/8
14		33	13 1/4
16		33 1/4	13 3/8
18		33 1/2	13 1/2
20		33 3/4	13 5/8

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VI. Finished measurements of liner. - Continued

Finished Measurements in Inches 1/ 2/			
Sizes	1/2 Bust	Center Back Length	Sleeve Length
Long			
6		33	13 3/4
8		33 1/4	13 7/8
10		33 1/2	14
12		33 3/4	14 1/8
14		34	14 1/4
16		34 1/4	14 3/8
18		34 1/2	14 1/2
20		34 3/4	14 5/8
Extra Long			
12		36 3/4	15 5/8
14		37	15 3/4
16		37 1/4	15 7/8
18		37 1/2	16
20		37 3/4	16 1/8

1/ The tolerance for the finished measurements of the liner shall be ±3/4 inch for the 1/2 chest and the back length and ±1/4 inch for the sleeve length.

2/ The finished measurements of the liner shall be taken with the liner flat on a table. The 1/2 bust shall be taken, with the liner folded in half (down the center back), at the base of the armhole, from the edge front to the back folded edge. The back length shall be taken, at the center back, from the neck to the bottom of the liner. The sleeve length shall be taken, along the underarm seam, from the sleeve joining seam to the bottom of the sleeve at the cuff joining seam.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.8.3 Instruction labels

3.8.3.1 Outer shell. The instruction label for the outer shell shall conform to type I, class 3 of DDD-L-20. The following instructions shall be included on the instruction label for the outer shell.

Care Instructions
Dry Cleaning (Preferred Method)

Dry cleaning in pure solvent or in detergent will not reduce water resistance provided the detergent is removed by rinsing. If poor water resistance is noted after dry cleaning, rinsing in water and then drying and pressing will renew water resistance.

Laundering (Alternate Method)

Spot wash badly soiled areas.
Wash in hot water (140°F) using detergent.
Rinse at least three times.
Machine spin or hang and dry.
Press with moderately hot iron (synthetic setting).

3.8.3.2 Liner. The instruction label for the liner shall conform to type I, class 3 of DDD-L-20. The following instructions shall be included on the instruction label for the liner.

DRY CLEAN ONLY
DO NOT STEAM OR PRESS

3.8.4 Combination identification and instruction label. The combination identification and instruction label for the outer shell shall conform to type I, classes 1 and 3 of DDD-L-20. The combination identification and instruction label for the outer shell shall include the instructions specified in 3.8.3.2.

3.9 Workmanship. The all weather coat, including the liner, shall be manufactured in a thoroughly workmanship manner.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to the prescribed requirements.

4.2 Quality conformance inspection. The inspection required by this specification is classified as quality conformance inspection.

4.2.1 Materials and component inspection. The materials and components shall be inspected in accordance with the documents referenced herein to the extent applicable and in accordance with table VII. The sample size for the inspection specified in table VII shall be as specified in table VIII. If one or more sample units fail to meet any test requirement specified in table VII; the lot represented shall not be acceptacle.

4.2.2 In-process inspection. Inspection to determine whether or not operations or assemblies conform to the requirements specified herein shall be made at any point during any phase of the manufacturing process. The Government shall reserve the right to exclude from consideration for acceptance any material or service for which in-process inspection has indicated nonconformance to the requirements specified herein.

4.2.2.1 Bond strength of fusible interlining. The strength of the bond of the fusible interlining to the outer shell shall be tested twice a day, at the fusing press location, to determine that adequate fusing is being obtained as follows: Prepare a test sample by fusing the fusible interlining specified in 3.2.12 to the basic fabric of the outer shell specified in 3.2.1.1 under the same fusing conditions to be used in the manufacture of the all weather coat. Determine the bond strength of the test sample with a commercial spring scale (see 6.6). If the bond strength of any test sample is less than 22 ounces per inch of width, the fusing conditions shall be corrected and the bond strength test shall be repeated.

4.2.3 Inspection of end item. The sample unit for the inspection of the end item shall be one all weather coat with liner.

4.2.3.1 Examinations

4.2.3.1.1 Individual examination. As a final step in the supplier's production control plan and before formation of a lot, the end item shall be buttoned on a model form or hanger and examined for the selected defects listed in MIL-STD-1494. The occurrence of defects during this examination for selected defects shall not exceed the applicable point or defect limit specified in MIL-STD-1494. Any end item that contains a selected defect shall not be included in an end item lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VII. Testing of materials and components.

Material or Components and Characteristics	Test Methods of FED-STD-191	Unit for Expression of Lot Size	Sample Unit for Testing
Nylon cloth (see 3.2.7 and table I)		Yards	1 yard full width
Material identification	1/		
Weave	2/		
Weight	5041		
Threads per inch	5050		
Breaking strength	5100		
Stiffness (warp)	5202		
Color	1/		
Fusible seam tape (see 3.2.11)		Yards	1/2 linear yard
Material identification	1/		
Width	5010		
Weight	5041		
Color	2/		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VII. Testing of materials and components. - Continued

Materials or Components and Characteristics	Test Methods of FED-STD-191	Unit of Expression of Lot Sizes	Sample Unit for Testing
Snap fasteners (see 3.2.14)		Sets	10 complete sets
Material identification	1/		
Type	1/		
Size	1/		
Finish	1/		

1/ A certificate of complaince for this requirement will be acceptable. If a certificate of compliance is furnished for any requirement specified herein, the Government shall have the right to check test items to determine the validity of the certification.

2/ The test method shall be visual. One determination per sample unit shall be made.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VIII. Sample size.

Lot Size	Sample Size
800 or less	2
801 to 22,000	3
22,001 or more	5

4.2.3.1.2 Sampling examination. After the end items have been subjected to the individual examination, samples of the end item shall be selected and shall be subjected to the dimensional examination described in MIL-STD-1494. The occurrence of defects during this dimensional examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1494.

4.2.3.2 Sampling tests. Samples of the end item shall be subjected to the sampling tests listed in table IX. The sample size for these sampling tests shall be as specified in table VIII. If one or more sample units fail to meet any test requirement listed in table IX, the lot represented shall not be acceptable.

TABLE IX. Sampling tests.

Characteristics	Test Methods
End item appearance (see 3.5)	
Bubbling or delamination of fused area after five launderings	Laundering and visual 1/
Bubbling or delamination of fused area after five dry cleanings	Dry cleaning and visual 2/
Strike through of adhesive	Visual

1/ The complete all weather coat shall be laundered five times in accordance with method 5556 (cotton procedure) of FED-STD-191 and then examined for bubbling and delamination of the fused areas.

2/ The complete all weather coat shall be dry cleaned five times in a single unit, coin-operated cycle capable of providing a complete automatic dry to dry cycle, using perchloroethylene and then shall be visually examined for bubbling and delamination of the fused areas.

4.2.4 Examination of packaging. Shipping containers that are fully prepared for delivery except for closure shall be subjected to the examination of preparation for delivery described in MIL-STD-1494. The occurrence of defects during this examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1494.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1 Packaging. Packaging shall be level A or C as specified (see 6.2).

5.1.1 Level A. Each all weather coat shall be buttoned and then folded to approximately 15 by 11-1/2 inches. Each folded all weather coat shall be inserted in a close fitting flat style clear polyethylene bag that is 0.00125 ±25 percent thick. The bag shall be formed with heat-sealed seams that are straight, continuous, and parallel to each other and the formed edges of the bag. The bag may be fabricated from either film tubing or sheeting. The bag shall be at least 1 inch longer than the folded all weather coat. The unsealed opening of the bag shall be at the smaller dimension of the bag.

5.1.2 Level C. Each all weather coat shall be packaged to afford adequate protection against physical damage during shipment from the supplier to the first receiving activity. The supplier may use his standard practice if it meets this requirement.

5.2 Packing. Packing shall be level A, B, or C as specified (see 6.2).

5.2.1 Level A. Ten all weather coats of one size only, packaged as specified, shall be packed in a fiberboard shipping container that is assembled, closed, and reinforced in accordance with grade V2s, size 3A of MIL-B-17757. The fiberboard for the liner shall conform to type CF, class weather-resistant, variety DW, grade V15c of MIL-B-17757. Level A packages shall be packed flat with every other all weather coat reversed top to bottom and shall be packed two in length, one in width, and 5 in depth within the shipping container. The top and the bottom of the contents of the shipping container shall be completely covered with a sheet of paper that is 30-pound (minimum) basis weight and that conforms to grade B of UU-P-268. Towards the end of the contract or if the quantity of the all weather coats of the same size is less than the quantity of the all weather coats required per shipping container, mixed sizes (see 5.3.2) may be packed within the same shipping container.

5.2.2 Level B. Ten all weather coats of one size only, packaged as specified, shall be packed in a shipping container that is assembled and closed to conform to class domestic, grade 275, size 3A of MIL-B-17757. The fiberboard for the liner shall conform to type CF, class domestic, variety DW, grade 275 of PPP-F-320. Level B packages shall be packed flat, front up, alternated end for end and shall be packed two in length, one in width, and 5 in depth within the shipping container. The top and bottom of the contents of the shipping container shall be completely covered with a sheet of paper that is 30-pound (minimum) basis weight and that conforms to grade B of UU-P-268. Towards the end of the contract or if the quantity of all weather coats of the same size is less than the quantity of all weather coats required per shipping container, mixed sizes (see 5.3.2) may be packed within the same shipping container.

5.2.2.1 Shipping container. If specified by the procuring activity (see 6.2), the shipping container shall be fabricated in accordance with grade V3c or V3s of MIL-B-17757 and closed in accordance with the appendix of the container specification. If specified by the procuring activity (see 6.2), the material for the shipping container shall conform to grade V4s of PPP-F-320.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

5.2.3 Level C. All weather coats shall be packaged to insure acceptance by the carrier and safe delivery at destination at the lowest transportation rate for such supplies. The containers shall be in accordance with the rules and regulations applicable to the mode of transportation.

5.3 Marking. In addition to any special marking required by the contract, shipping containers shall be marked in accordance with MIL-STD-129.

The use of labels for identification marking on exterior shipping container is not permitted. The inclusion of item nomenclature and size on exterior shipping container marking is prohibited. All other required markings, including stock number shall remain. Attention is invited to paragraph 5.5.1.5.3 of MIL-STD-129.

5.3.1 Polyethylene bags. Each polyethylene package (see 5.1.1) shall have the nomenclature, the stock number, the size, and the quantity of items packaged therein legibly printed or stamped in black directly across the center face of the bag or on a white paper label inserted within the bag so it is readable through the polyethylene.

5.3.2 Mixed sizes. Each shipping container that is packed with mixed sizes (see 5.2.1 and 5.2.2) shall have, securely attached to the end and side, directly under the printing or stenciling, a white paper label 5 by 4 inches. The words "mixed sizes" shall be plainly stamped or printed on the label. The quantity and sizes of the all weather coats contained in the shipping container shall be legibly stamped or printed under the words "mixed sizes" on the label.

6. NOTES

6.1 Intended use. The all weather coat covered by this specification is intended to be worn by female personnel of the Department of the Air Force.

6.2 Ordering data. Procurement documents should specify the following:

(a) Title, number, and date of this specification

(b) Size and length required (see 1.2)

(c) Standard patterns (see 3.6)

(d) Selection of applicable levels of packaging and packing and grade of shipping container (see 5.1, 5.2, and 5.2.2.1).

6.3 Samples. For access to samples of the end item and shade samples, address the procuring activity issuing the invitation for bids.

6.4 Figures. Figures 1 and 2 show the general design of the all weather coat and are for information only. In the event of conflict between these figures and the requirements of this specification, the requirements of this specification shall govern.

6.5 Fusing conditions. Specific machine setting should be obtained from the supplier of the particular fusible material for optimum results. The following fusing conditions include the recommendations of several suppliers of fusible material and are furnished for guidance only.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

(a) Temperature between pressing surfaces of 300 degrees Fahrenheit minimum and 320 degrees Fahrenheit maximum at the fuseline (not the temperature at the clock).

(b) Pressure between pressing surfaces of 6 psi minimum and 7 psi maximum.

(c) Pressing time of 12 seconds minimum and 14 seconds maximum.

(d) Dry heat.

NOTE: The fuseline temperature must be checked by using temperature revealing paper strips obtained from the supplier of the machine or fusible material.

6.6 Peel strength test. The procedure for the peel strength testing with a spring scale should be obtained from the supplier of the fusible material.

Custodian:
Air Force - 11

Reviewer:
Air Force - 99,82

Preparing activity:
Air Force - 11

Project No. 8410-F539

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

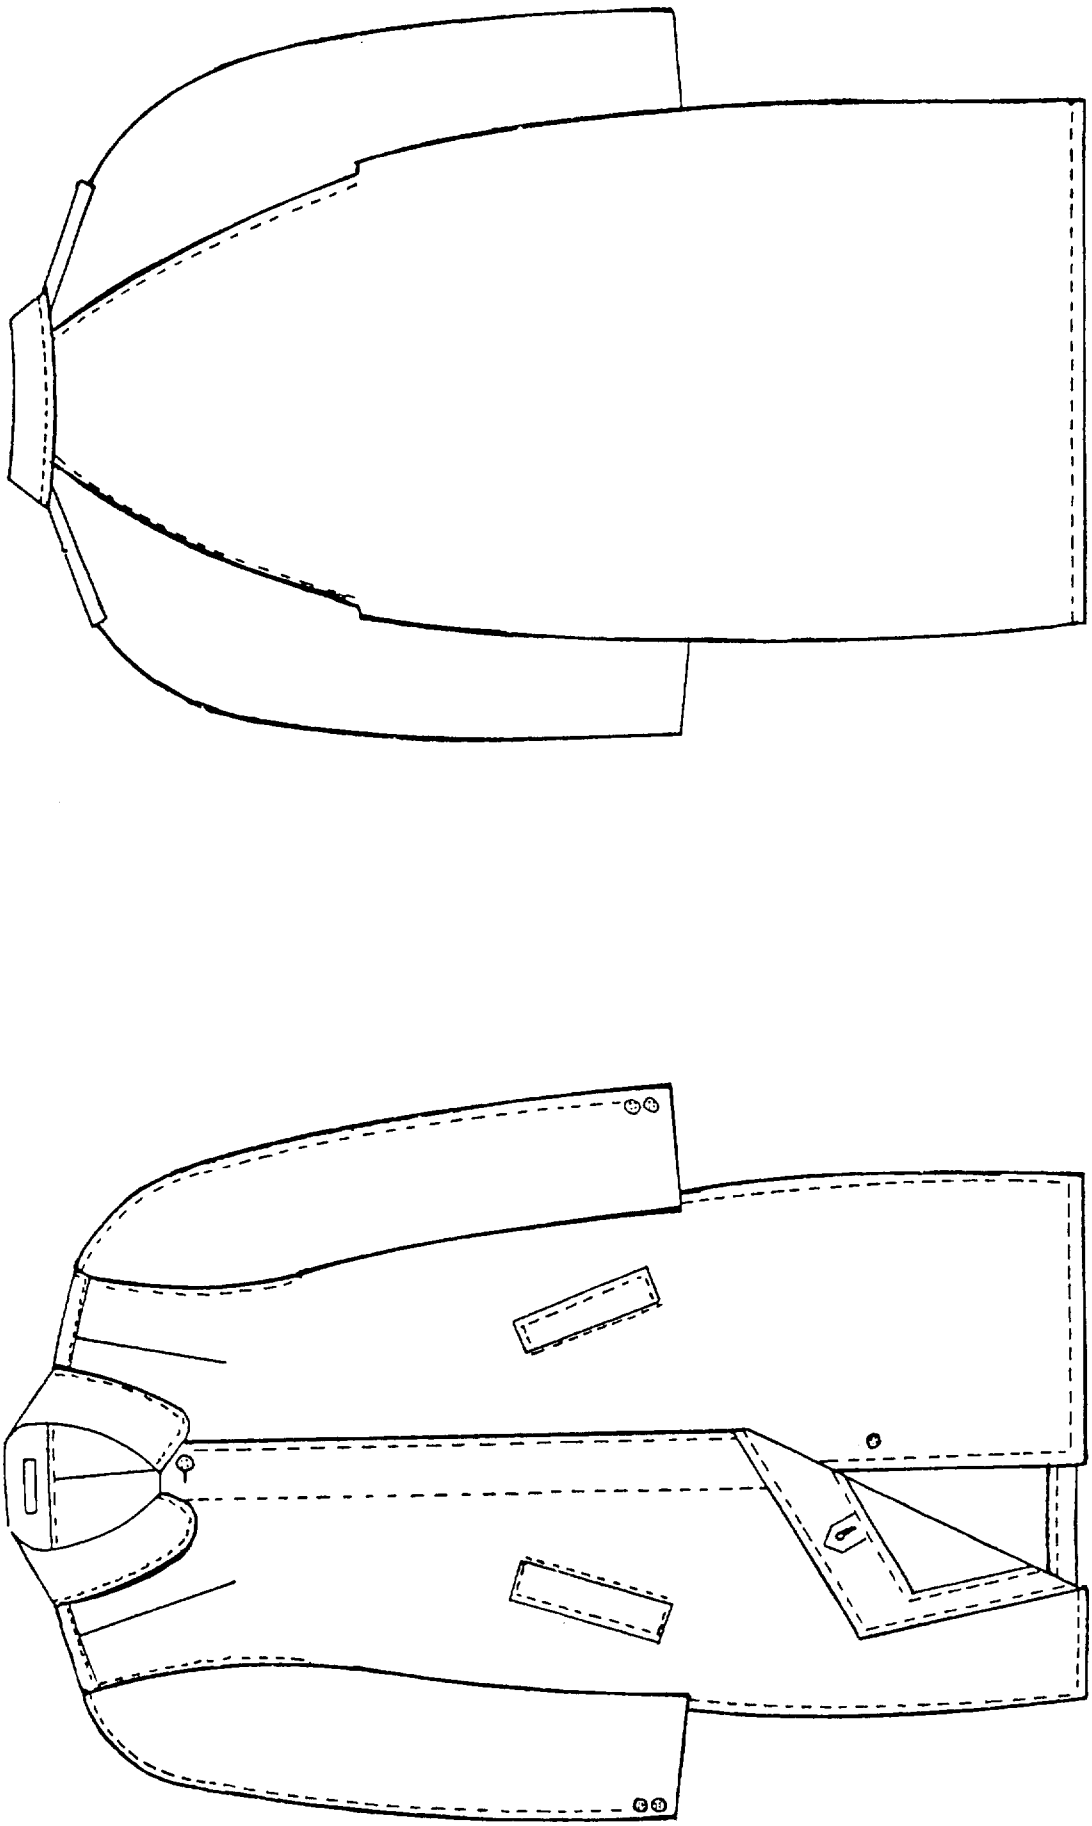


FIGURE 1. Outer shell.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

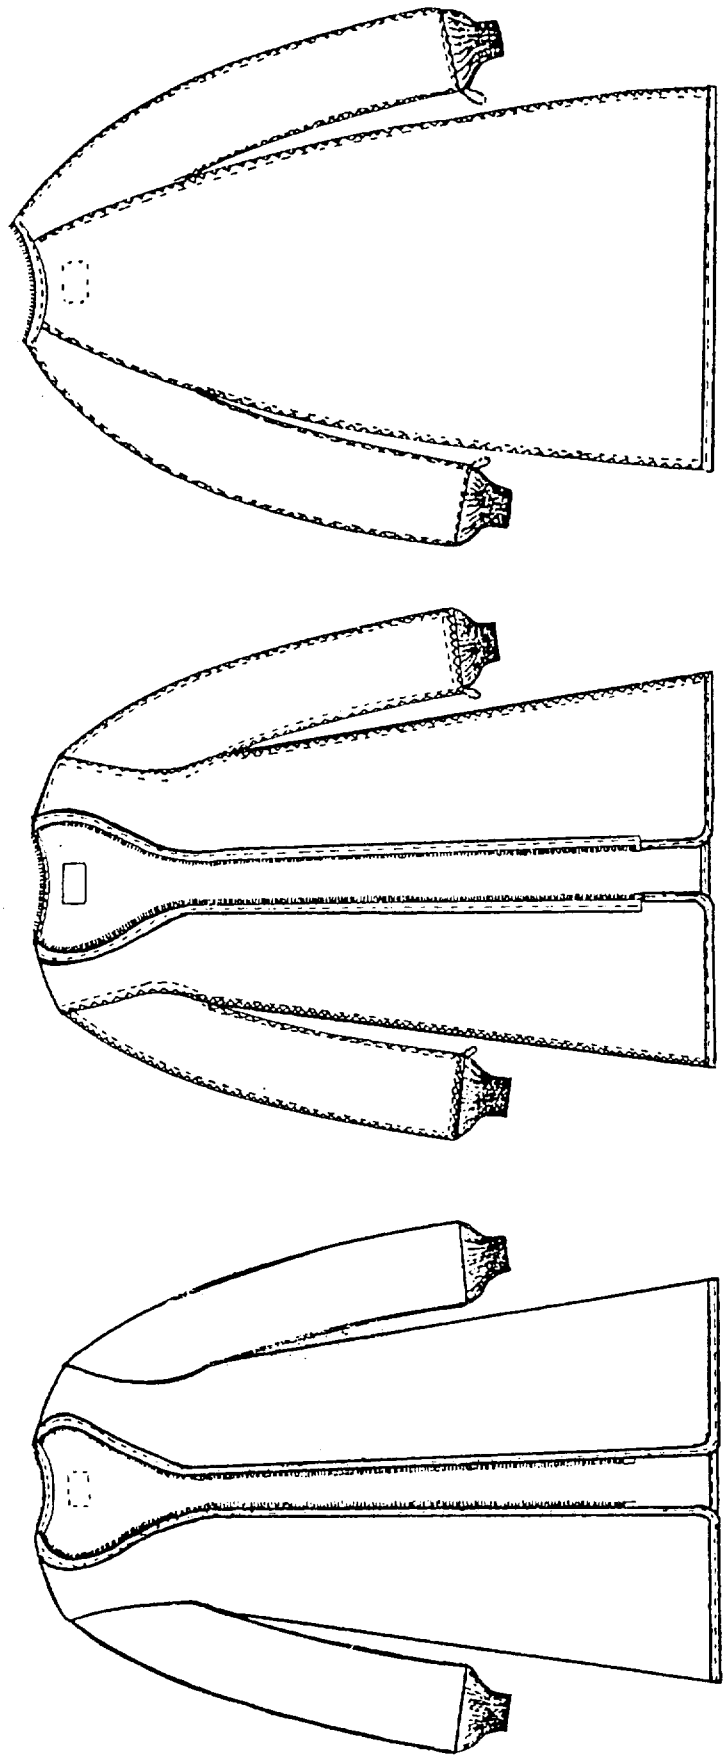


FIGURE 2. Liner.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE AIR FORCE

ASD/ENESS
WPAFB OH 45433

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 73236 WASHINGTON D. C.

POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE AIR FORCE

ASD/ENESS
Wright-Patterson AFB OH 45433

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:53Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*:

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.