MIL-C-87170A(USAF)
25 March 1988
SUPERSEDING
MIL-C-87170 (USAF)
8 April 1983

MILITARY SPECIFICATION

COAT, ALL-WEATHER: WOMAN'S, BLUE, WITH REMOVABLE LINER

This specification is approved for use within the Department of the Air Force, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirements for a woman's all-weather coat with a synthetic fiber pile removable liner.

1.2 Classification. The all weather coat shall be of one type furnished in the following lengths and sizes, as specified (see 6.2):

Schedule of lengths and sizes.

Short	6	8	10	12	14	16		
Regular	6	8	10	12	14	16	18	20
Long		8	10	12	14	16	18	20
Extra long			10	12	14	16	18	20

2. APPLICABLE DOCUMENTS

2.1 Government documents

2.1.1 Specifications and standards. The following specifications and standards form a part of this specification to the extent specified herein.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: ASD/ENES, Wright-Patterson AFB OH 45433-6503 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

A-A-1696	Bag, Plastic (Garment)
A-A-50128	Cloth, Interlining, Nonwoven
V-B-871	Button, Sewing Hole, and Button, Staple, (Plastic)
V-F-106	Fasteners, Slide, Interlocking
V-T-280	Thread, Gimp, Cotton, Buttonhole
NN-P-71	Pallets, Material Handling, Wood, Stringer Construction, 2-Way and 4-Way (Partial)
UU-P-268	Paper, Kraft, Wrapping
DDD-L-20	Label: For Clothing, Equipage, and Tentage, (General Use)
DDD-T-86	Tape, Textile; Cotton, General Purpose (Unbleached, Bleached, or Dyed)

MILITARY

MIL-B-371	Braid, Textile, Tubular
MIL-T-3530	Thread and Twine: Mildew Resistant or Water Repellent Treated
MIL-C-3735	Cuffs, Knit, Wrist and Ankle, and Cloth, Knitted
MIL-F-10884	Fasteners, Snap
MIL-P-15011	Pallets, Material Handling, Wood Post Construction, 4-Way Entry
MIL-B-17757	Boxes, Shipping, Fiberboard (Modular Sizes)
MIL-C-21852	Cloth, Taffeta, Nylon
MIL-C-29363	Cloth, Poplin: Polyester and Cotton (Water Repellent)
MIL-C-29365	Cloth, Nonwoven: Interlining, Fusible, Nylon and Polyester, Polyamid
MIL-C-43251	Cloth, Pile, Synthetic Fiber Pile
MIL-C-43525	Cloth, Satin, Acetate or Rayon Face and Rayon or Cotton Back
MIL-T-43548	Thread, Polyester Core: Cotton-, Rayon-, or Polyester-Covered
MIL-C-44192	Container, Shipping and Storage, Coat (Hanger Pack)

STANDARDS

FEDERAL

FED-STD-191	Textile Test Methods
FED-STD-751	Stitches, Seams, and Stitchings

MILITARY

MIL-STD-105	Sampling Procedures and Tables for Inspection by Attributes

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

MIL-STD-129	Marking for Shipment and Storage
MIL-STD-147	Palletized Unit Loads
MIL-STD-1494	Provisions for Evaluating Quality of Raincoats

2.1.2 Other Government document. The following other Government document forms a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

LAWS AND REGULATIONS

Rules and Regulations Under the Textile Fiber Products Identification Act

(Application for copies should be addressed to the Federal Trade Commission, Washington DC 20508-0001.)

(Copies of specifications, standards, and other Government documents required by contractors in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting activity.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted shall be those listed in the issue of the DoDISS specified in the solicitation. Unless otherwise specified, the issues of documents not listed in the DoDISS shall be the issue of the nongovernment documents which is current on the date of the solicitation.

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

ASTM D 3951 Standard Practice for Commercial Packaging

(Application for copies should be addressed to the American Society for Testing and Materials, 1916 Race St., Philadelphia PA 19103-1187.)

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense (DoD) Standard Color Card of Official Standardized Shades for Sewing Threads

Department of Defense (DoD) Standard Shades for Buttons

(Application for copies should be addressed to The Color Association of the United States, 343 Lexington Ave., New York NY 10016-0927.)

(Nongovernment standards and other publications are normally available from the organizations which prepare or which distribute the documents. These documents also may be available in or through libraries or other informational services.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Standard samples. Standard samples, when furnished (see 6.3), are solely for guidance and information to the contractor. Variations from the document may appear in the samples, in which case the document shall govern.

3.2 First article. When specified in the contract or purchase order, a sample shall be subjected to first article inspection (see 4.4 and 6.2).

3.3 Materials (see 6.5)

3.3.1 Basic material. The basic material for the all-weather coat outershell shall be a polyester and cotton, water repellent poplin cloth, USN Color Blue, Shade No. 3376, conforming to MIL-C-29363.

3.3.2 Liner material. The material for the removable liner shall be a synthetic fiber pile cloth conforming to class 2 of MIL-C-43251, except that the pH shall not apply.

3.3.3 Liner sleeves. The material for the sleeves of the liner shall conform to type I or II of MIL-C-43525, except that the color shall be black.

3.3.4 Sleeve hem interlining. The interlining for the sleeve hem of the outershell shall be nonwoven cloth conforming to type I of A-A-50128 with the following exceptions: Staple polyester may be substituted for the staple nylon; the cloth shall weigh 2.3 to 2.7 ounces per square yard; and the thickness, at 0.6 pound per square inch (psi), shall be 0.010 to 0.016 psi.

3.3.5 Nylon taffeta cloth. The lining for the sleeves of the outershell, the binding for the edge of the liner, and the binding for the back edge of the facings of the outer shell shall be nylon taffeta cloth, USN Color Blue, Shade No. 3376, conforming to type IV of MIL-C-21852.

3.3.6 Nylon cloth. The collarstand interlining shall be black nylon, marquisette leno weave cloth conforming to the requirements of table I when tested as specified in 4.5.1. As an alternate, fusible material specified in 3.3.10.1 may be used for interlining the collarstand.

3.3.7 Material for hanger loop and sleeve liner button loop. The hanger loop and sleeve liner button loop shall be cotton or rayon braid, USA Color Black, Shade No. 385, conforming to type IX, class 1 of MIL-B-371 or the hanger loop shall be made of the basic material specified in 3.3.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE I. Nylon cloth.

Characteristics	Requirements
Weight	2.6 to 3.0 ounces psi
Threads:	
Warp	48 per inch (minimum)
Filling	24 per inch (minimum)
Thickness at 0.6 psi	0.012 to 0.016 inch
Breaking strength:	
Warp	110 pounds (minimum)
Filling	48 pounds (minimum)
Stiffness (warp)	0.008 inch-pounds (minimum)

3.3.8 Tape for neck area. The stay tape for stabilizing the neck area of the liner shall be 1/4 inch in width conforming to type I, class 1 of DDD-T-86.

3.3.9 Wristlets. The wristlets shall conform to type I or III, class 2, size 2 of MIL-C-3735 and the color shall be black.

3.3.10 Fusible materials

3.3.10.1 Fusible interlining. The fusible interlining for the front facings, the top collar, the under collar, the pocket welts, the shoulder loops and as an alternate for the top and bottom collarstands shall conform to class 3 of MIL-C-29365, except the fiber content shall be polyester and the minimum weight shall be 1.6 ounces per square yard. As an alternate, a spun laced 100 percent poly nonwoven black cloth which has a uniformly distributed dot system of polyvinyl chloride-polyvinyl acetate type fusible adhesive applied to one side in accordance with good commercial practice may be used as a fusible interlining and shall meet the requirements specified in table II when tested (see 4.5.1).

3.3.10.1.1 Interlining fused to basic cloth. The interlining, after fusing to the basic cloth, shall meet the bond strength and shrinkage requirements specified in table II when tested (see 4.5.1). The all-weather coat shall show no evidence of bubbling or delamination of the fused area and there shall be no "strike through" of the adhesive after fusing.

3.3.10.2 Seam tape. The material for fusing the side and sleeve out seams of the outershell shall be a white, nonwoven polyamide fusible web, 3/8 ±1/16 inch wide and shall weigh 0.885 ounce per square yard.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.3.10.3 Fusing conditions. The interlining shall be fused to the basic material on a fusing press. For optimum results with the particular fusible material and press used, specific settings should be obtained from the contractor of the fusible interlining (see 6.6). The strength of the bond of the fusible interlining to the basic material of the outershell shall be as specified in MIL-C-29365.

3.3.11 Labels. The outershell and liner shall have a combination personal identification, identification and instruction label, and a size label conforming to DDD-L-20. The colorfastness to dry cleaning requirements of DDD-L-20 shall apply.

3.3.11.1 Combination personal identification, identification, and instrtuction label. The combination personal identification, identification, and instruction label for the outershell and liner shall conform to type VI, classes 10 and 15 and shall include the following information:

Name
Service No.
Coat, All-Weather: Woman's, Blue, with Removable Liner
8410-00-000-000 (Example) 1/
DLA-100-00-0-0000 (Example) 1/
Fiber Products Act (information as applicable) 1/
Contractor's Name: 1/

CLEANING INSTRUCTIONS
DRY CLEAN ONLY

1/ The contractor shall include the applicable information.

3.3.11.2 Size label. The size label for the outershell and liner shall conform to type VI, class 2. The sizes and lengths (short, regular, long, and extra long), may be abbreviated as follows: 12S, 12R, 12L, and 12XL.

3.3.11.3 Combination personal identification, size, identification, and instruction label. As an option to 3.3.11.1, a combination personal identification, size, identification, and instruction label for the liner may be used. The combination label shall conform to type VI, classes 10 and 14 and shall include the following information:

Name
Service No.
12S
8410-00-000-0000 (Example) 1/
Coat, All-Weather: Woman's, Blue, with Removable Liner
DLA-100-00-0-0000 (Example) 1/
Fiber Products Act (information as applicable) 1/
Contractor's Name: 1/

CLEANING INSTRUCTIONS
DRY CLEAN ONLY

1/ The contractor shall include the applicable information.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE II. Fusible nonwoven cloth.

Characteristics	Requirements
Weight	2.7 to 3.2 ounces psi
Breaking strength (machine direction):	
Warp	25 pounds per inch
Filling	10 pounds per inch
Shrinkage:	
After fusing to basic cloth	1 percent (maximum)
After 5 dry cleanings	2 percent (maximum)
Adhesion (bond strength per inch):	
Initial	22 ounces (minimum)
After 5 dry cleanings	18 ounces (minimum)

3.3.12 Thread. The thread for seaming and stitching the outershell shall be DoD Shade Blue AB, C.A. 66044 and for the liner shall be either DoD Shade Blue AB, C.A. 66044 or Black AA, C.A. 66043 (see DoD Standard Color Card) conforming to Ticket No. 30, 2 or 3 ply; Ticket No. 50, 2 or 3 ply; and Ticket No. 70, 2 ply of MIL-T-43548. The thread for seaming and stitching the outershell shall be water repellent treated in accordance with type II, class 3 of MIL-T-3530. As an alternate, cotton thread, size 00/3 for stitching and 1A3 for buttonholes may be used.

3.3.12.1 Colorfastness. The dyed thread shall show fastness to light, perspiration, and wet dry cleaning equal to or better than the standard sample (see 6.3). When no standard sample is available, the dyed thread shall show "good" fastness to light, perspiration, and wet dry cleaning.

3.3.13 Gimp. The gimp for reinforcing buttonholes shall be DoD Shade Blue AB, C.A. 66044 (see DoD Standard Color Card) conforming to size No. 8, type I or II of V-T-280.

3.3.14 Buttons. The buttons shall be DoD Shade Blue BU, C.A. 62002 (see DoD Standard Shades for Buttons). Except for the stay buttons, the buttons shall conform to type II, class D, style 20 or 21, size 40 lines (front fly); size 30 lines (lapel); and size 24 lines (sleeves, collar tab, facing tab, and liner sleeves) of V-B-871. The stay buttons shall conform to type II, class D, style 15, size 18 lines of V-B-871.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.3.15 Slide fastener. The slide fastener shall conform to type IV, style 1, size L, short tab pull, aluminum or brass chain of V-F-106. The length of the slide fastener shall conform to the requirements specified in table III.

3.3.15.1 Tape for slide fastener. The slide fastener tape shall be dyed black and shall show colorfastness to dry cleaning equal to or better than the standard sample (see 6.3). When a standard sample is not available, the slide fastener tape shall show "good" fastness to dry cleaning.

TABLE III. Length of slide fasteners (inches).

Size of All-Weather Coat	Short	Regular	Long	Extra Long
6	67	69		
8	67	69	71	
10	67	69	71	80
12	69	71	71	80
14	69	71	75	80
16	71	71	75	80
18		75	75	80
20		75	75	80

3.3.16 Snap fasteners. The snap fasteners shall be round or square, rolled edge, sew-on type, size 3, brass, black commercial finish in accordance with MIL-S-10884.

3.4 Design. The all-weather coat shall be a single breasted fly front model and shall have a button tab closure on the lower right facing, a tab that buttons at the throat, a convertible collar with round ends and a collarstand, two inside hanging pockets with diagonal welts, shoulder loops, split shoulder (raglan back and set-in front sleeves), a one piece back, a yoke lining, and a detachable single ply liner. The liner shall have bound edges, split shoulder raglan sleeves with wristlets, and a button loop at the bottom of each sleeve. The liner shall be attached to the all-weather coat by a slide fastener and the button loops.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.5 Patterns. Standard patterns shall be furnished by the Government. The standard patterns shall not be altered in any way, and are to be used as a guide for cutting the contractor's working patterns. Unless otherwise specified, the standard patterns provide a seam allowance of 3/8 inch. The standard patterns will show size, seam allowance, shape and placement of pockets, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts. The working patterns shall be identical to the Government patterns.

3.5.1 Pattern parts. The component parts of the all-weather coat and removable liner shall be cut from the materials specified in accordance with the number of parts indicated in table IV.

3.6 Construction. The construction of the all-weather coat and removable liner shall conform in all respects to the requirements specified in table V and herein. Figures are furnished for guidance and information only. If there are any inconsistencies between the specification and the figures, the specification shall govern.

3.6.1 Stitches, seams and stitchings. All stitches, seams, and stitching types specified in table V shall conform to FED-STD-751. The type of stitches, seams, stitchings, and the minimum and maximum number of stitches per inch shall be as specified in table V. Whenever two or more seam or stitch types are specified for the same part of the operation, any one may be used. The looper (underthread) of stitch type 401 shall be on the inside of the outershell and on the side of the liner that will face the outershell in the finished all-weather coat. Seam allowances shall be maintained with seams properly sewn so that no raw edges, run offs, twists, pleats, puckers, or open seams will result. All seams shall start and finish evenly. Thread tension shall be maintained so that the stitching will not be tight or loose. Unless otherwise specified herein, raise stitching or edge stitching shall be 1/4- to 5/16-inch gage from the edge. The stitching for safety stitch construction shall be 3/8-inch gage. The guides and knives on the stitch machine shall be set to trim only the ravelled ends of the fabric. The fusible seam tape shall not be exposed in the seam construction. Seams required to be worked out having a depth between the fold of 1/16 inch or more shall not be acceptable.

3.6.1.1 Thread breaks and ends of seams and stitchings. The ends of all seams and stitchings produced with stitch type 301, when not caught in other seams or stitchings, shall be backstitched not less than 1/4 inch. The ends of continuous lines of stitching, except on labels, shall be overlapped not less than 1/2 inch. The ends of continuous lines of stitching on labels shall be overlapped not less than three stitches. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch. Skipped stitches or thread breaks of stitch type 401 may be repaired using stitch type 301.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE IV. List of pattern parts.

Material	Pattern nomenclature	Cut parts
Basic material (see 3.3.1)	Back	1
	Front	2
	Front facing	2
	Storm tab	1
	Shoulder loop	4
	Collar (one top collar and one under collar)	2
	Collarstand (one top collarstand and one under collarstand with under collar tab)	2
	Pocket welt	2
	Shoulder lining piece	2
	Pocket outer ply	2
	Pocket inner ply	2
	Fly piece	2
	Front lining	2
	Back lining	1
	Back sleeve	2
	Front sleeve	2
	Back neck facing	1
Liner material (see 3.2.2)	Front liner	2
	Back liner	1
Sleeve lining (see 3.3.3)	Front sleeve liner	2
	Back sleeve liner	2
Nonwoven interlining (see 3.3.4)	Sleeve hem interlining	2
Nylon taffeta cloth (see 3.3.5)	Front sleeve lining	2
	Back sleeve lining	2
Nylon cloth (see 3.3.6)	Collarstand interlining	1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE IV. List of pattern parts. - Continued

Material	Pattern nomenclature	Cut parts
Fusible interlining (see 3.3.10.1)	Front facing interlining	2
	Back neck facing interlining	1
	Collar interlining (one for top collar and one for under collar)	2
	Collarstand interlining (optional)	2
	Pocket welt interlining	2
	Shoulder loop interlining	2
Marker	Finished fly front (stitch line)	

3.6.1.2 Repair of type 301 stitching. Repairs of type 301 stitching shall be as follows:

a. When thread breaks, skipped stitches, run-offs, or bobbin runouts occur during sewing, the stitching shall be repaired by superimposing and restarting the stitching a minimum of 1/4 inch back of the end of the stitching (see NOTE).

b. Except for prestitching, thread breaks, two or more consecutive skipped or run-off stitches noted during inspection of the item shall be repaired by overstitching. The stitching shall start a minimum of 1/4 inch in back of the defective area, continue over the defective area, and continue a minimum of 1/4 inch beyond the defective area onto the existing stitching. Loose or excessively tight stitching shall be repaired by removing the defective stitching without damaging the materials, and restitching in the required manner (see NOTE).

NOTE: When making the above repairs, the ends of the repairing stitch must be backstitched and thread ends trimmed close to the coat or liner.

3.7 Manufacturing operations requirements. The all-weather coat shall be manufactured in accordance with operation requirements specified in table V. The contractor is not required to follow the exact sequence of operations listed unless otherwise specified. Any additional basting or holding stitches used to facilitate manufacture are permissible provided the thread is removed or does not show in the finished outer shell or liner.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations.

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
1.	Cut parts. a. Cut the parts of the all-weather coat in accordance with the patterns which show size, directional lines, and marks for the placement of parts and notches for proper assembly. Unless otherwise specified, place the directional lines of the patterns in the warp direction of the material. b. Unless otherwise specified herein, cut all parts that are made of the basic material (see 3.3.1) from the same piece of material. The facing tab, the undercollar, the underside of the shoulder loops, the pocket outerply, the pocket innerply, the front lining, the back lining, the fly lining piece, the top fly front, the under collarstand, and the hanger loop (if not made of braid) may be cut from ends. The parts cut from ends shall approximate the shade of the other parts of the outer shell. The front lining and the back lining yoke shall match each other. c. If the hanger loop is not made of braid, cut the stripping for the hanger loop of sufficient width so that the finished hanger loop will be 3/8 ±1/8 inch wide. (see Op No. 7).					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
1.	Cut parts. - Contd					
	d. Cut the parts of the liner that are made of the basic material (see 3.3.2) from the same material. The pile liner may be cut in either of the warp directions (nap running up or down) provided that the three parts used for each unit run in the same direction.					
	e. Cut all interlining parts in accordance with the patterns. Approximately 1/8 inch may be trimmed from all sides of the fusible interlining pieces to facilitate the fusing operation.					
	f. Cut the binding for both the outershell and the liner on the bias 1-1/8 ±1/8 inch wide.					
2.	Replace defective parts.					
	Remove any parts containing material defects or workmanship damages that are classified as defects in MIL-STD-1494 from production during the spreading, cutting, and manufacturing process and replace with nondefective and properly matched parts.					
3.	Mark parts.					
	Mark, ticket, or bundle the cut parts to insure a uniform shade and size throughout the outershell and the liner (see 3.7.1). Noncorrosive metal fastening devices may be used to mark the cut parts of the liner.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
4.	Make shoulder loops.					
	a. Position the shoulder loop interlining on the top ply of each shoulder loop and fuse.					
	b. Join the top ply of each shoulder loop (with interlining) to the underply of the shoulder loop along the sides and across the neck end. Trim and turn the corners and force out the edges and the corners. Stitch each shoulder loop 1/4 to 5/16 inch from the sewn edge.	301 or 401 and 301	SSe-2(a) SSe-2(a) SSe-2(b)	10-12 10-12 10-12	50 50 50	50 70 50
5.	Make storm tab.					
	a. Fold the storm tab in half lengthwise. Stitch the storm tab along the side raw edge and the point. Trim, turn, and work out the edges of the storm tab. Stitch the sides and the point of the storm tab to 1/4 to 5/16 inch from the edges.	301 or 401 and 301	SSe-2(a) SSe-2(a) SSe-2(b) and OSf-1	10-12 10-12 10-12 10-12	50 50 50 50	50 70 50 50
	b. Make a buttonhole in the storm tab (facing). The buttonhole shall be positioned as indicated on the patterns. The inside edge of the eyelet shall be 1/2 to 5/8 inch from the pointed end of the storm tab. The buttonhole shall not be off center more than 1/8 inch. The buttonhole shall be a cut-after, eyelet-end, taper-bar or square-bar type worked over gimp. The finished cut length of the buttonhole shall be 5/8 to 3/4 inch long measured from the center of the eyelet. The finished	Button-hole		50-54 stitches per button-hole	30	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
5.	Make storm tab. - Contd					
	tab shall measure 2-7/8 ±1/4 inches long from the pointed edge and 1-3/8 ±1/4 inches wide at the back straight edge.					
6.	Make collar.					
	a. Position the top collar interlining on the top collar and the under collar interlining on the under collar and fuse.					
	b. Stitch the under collar to the top collar around the side and the top edges.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70
	c. Trim, turn, and force out the edges and the points of the collar. Stitch the collar 1/4 to 5/16 inch from the edges.	301	SSe-2(b)	10-12	50	50
7.	Make hanger loop (if braid is not used).					
	a. Turn the edges of the hanger loop to the center. Stitch the abutted edges with a row of stitching, extending across and covering the edges of the material, 3/16 to 5/16-inch gage.	406	EFh-1	10-12	50	50
	OR					
	b. Fold the hanger loop with the raw edges turned in. Stitch the hanger loop 1/16 to 1/8 inch from each edge.	301	EFp-2	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
8.	Make collarstand and attach collar.					
	a. Quilt the collarstand interlining to the under collarstand with four or five rows of stitching approximately 1/4 inch apart, or if optional method is used, position top collarstand interlining on top collarstand and under collarstand interlining on under collarstand and fuse.	301	SSv	10-12	50	50
	b. Position the collar between the top collarstand and the under collarstand, as indicated by the marks on the patterns, with the raw edges even, and stitching along the top edge of the collarstand. Continue stitching the tab on the right side of the collarstand, in accordance with the notches, 1/4-inch gage.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70
	c. Close the left side of the collarstand. Trim the corner.	301 or 401	SSe-2(a)	10-12	50	50
	d. Turn the collarstand and the tab to the face side with the seam allowance against the collarstand. Raise stitch the collarstand through the collar and around the outer edge of the tab 1/16-inch gage.	301	SSe-2(b)	10-12	50	50
	e. Stitch the bottom edge of the top collarstand and the under collarstand together. The finished collar shall be 2-1/8 ±1/8 inch wide at the center back.	301	SSa-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
8.	Make collarstand and attach collar. - Contd					
	f. Position the hanger loop on the center of the top collarstand. Turn the ends of the hanger loop under. Bartack each end of the hanger loop. The bartack shall be 1/2 ±1/16 inch long. The length of the finished hanger loop between the bartacks shall be 2-3/8 ±1/8 inches.	Bartack		28 stitches per bartack	50	50
	g. Make a horizontal, cut-after, eyelet-end, taper-bar or square-bar type of buttonhole, worked over gimp, in the center of the collarstand. The buttonhole shall be not more than 1/8 inch off center. The inside edge of the eyelet shall be 1/2 ±1/8 inch from the front edge of the collarstand tab. The purling may be on either side. The finished cut length of the buttonhole shall be 5/8 ±1/8 inch.	Buttonhole		50-54 stitches per buttonhole	30	50
9.	Make pocket welts.					
	a. Position the pocket welt interlining on the pocket welts, and fuse each pocket welt.					
	b. Fold each pocket welt in half lengthwise face to face and stitch the side edges.	301 or 401	SSe-2(a) SSe-2(a)	10-12 10-12	50 50	50 70
	c. Trim, turn, and force out the edges and the point of each pocket welt. Stitch each pocket welt 1/4 to 5/16 inch from the side and the folded edges.	301	SSe-2(b) and OSf-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
9.	Make pocket welts. - Contd					
	d. Stitch the inner raw edges of the welt together. The finished welt on the coat shall be 1-3/4 ±1/8 inches wide and 7-1/4 ±1/4 inches long.	301	SSa-1	10-12	50	50
10.	Make pocket and attach welt and pocket to front.					
	a. Slash under pocket as indicated by mark on pattern and tongue notch ends.					
	b. Position top pocket to under pocket and with edges even stitch around top, back and and bottom edges. Trim, turn, force out edges and point and stitch 3/16 to 1/4 inch from turned edges. Continue the stitching down front edge of under pocket closing the pocket.	301 or 401 and 301	SSe-2 SSe-2 SSe-2	10-12 10-12 10-12	50 50 50	50 70 50
	c. Position raw edge of welt to front as indicated by mark on pattern and stitch the length of the raw edge.	301 or 401	LSbj-1	10-12	50 50	50 70
	d. Slash front as indicated by mark on pattern and tongue notch end.					
	e. Turn welt to finished position and raise stitch 1/16 inch from joining seam.	301	LSq-2(b)	10-12	50	50
	f. Turn welt back so that raw edges are exposed. Position edge of opening of under pocket (edge toward open end of pocket) on raw edge of welt and stitch through seam allowance.	301 or 401	SSa-1	10-12	50 50	50 70

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
10.	Make pocket and attach welt and pocket to front. - Contd					
	g. Turn pocket thru front opening and stitch opposite raw edge of under pocket opening to raw edge of front opening.	301 or 401	LSq-2(a)	10-12	50 50	50 70
	h. With pocket smooth and flat, turn coat to finish side and top stitch front opening (side opposite welt), 1/16 inch from turned edge with stitching thru pocket.	301	LSq-2(b)	10-12	50	50
	i. Close ends of welt with box stitching thru welt, coat and pocket. The inner row of stitching shall be superimposed on the edge stitching of welt. The outer row shall be 1/16 inch from edge of welt and pointed ends at hand opening shall be diagonally stitched.	301	LSbj-1	10-12 ..	50	50
	j. Stitch front edge of top pocket to front edge of coat.	301	SSa-1	10-12	50	50
11.	Make shoulder darts.					
	a. Stitch the front shoulder darts, tapering to a point 1 ±1/4 inch below the drill mark of dart.	301	SSa-1	10-12	50	50
	b. Press the seam open flat and the folded edge at the bottom of the dart toward the center front.					
12.	Make facings.					
	a. Position the neck facing interlining on the neck facing and fuse.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
12.	Make facings. - Contd					
	b. Position the front facing interlining on the front facing and fuse.					
	c. Join neck facing to front facing at shoulder.	301	SSa-1	10-12	50	50
	d. Press seam open and flat with a heated pressing iron or machine.					
	e. Mark a line 1-1/2 inches from the back edge of the facing on the fused side for positioning the lining.					
	f. Bind the back raw edge of the front and neck facing. The finished binding shall be 3/16 to 1/4 inch wide.	301 or 401	BSc-1	10-12	50	50
13.	Make right fly front.					
	a. Position the fly lining piece on the right front facing, as indicated by the pattern notches, and stitch in accordance with the seam allowance on the pattern. The front raw edge of the fly lining piece shall be positioned 1/2 ±1/8 inch back of the front raw edge of the facing. The joining seam shall be 3/4 ±1/8 inch from the front edge of the facing.	301 or 401	LSbj-1 LSbj-1	10-12 10-12	50 50	50 70
	b. Cut the facing and the fly piece diagonally at each corner to the line of stitching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
13.	Make right fly front. - Contd					
	c. Turn the fly piece to the inside; stitch the length of the fly piece 1/4 to 5/16 inch from the turned edge, backtacking each end or make a 90 degree sew out to the front raw edge of the facing.	301	SSe-2(b)	10-12	50	50
14.	Make buttonholes on the right front facing.					
	a. Make four buttonholes on the fly piece as indicated by the pattern marks. The buttonholes shall be cut-first, eyelet-end, taper-bar or square-bar type, worked over gimp. The taper-bar shall be finished with not less than four stitches at the bar end (excluding the cross-over stitch). The square-bar shall have the ends of the gimp pulled through the underside and bartacked in a separate operation. The finished cut buttonholes shall be 1-1/8 ±1/8 inches long. The inside edge of the eyelet of each buttonhole shall be 1/2 to 5/8 inch from the front edge of the fly lining. The buttonholes shall not be off center more than 1/8 inch. The purling of the buttonholes shall be on the outside of the fly.	Buttonhole		70-74 stitches per buttonhole	30	50
		Bartack		21 stitches per bartack	50	50
	b. Position second fly piece under the right fly facing with the raw edge above and below the notches even and the front edge of the fly facing between the					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
14.	Make buttonholes on the right front facing. - Contd					
	notches 3/4 ±1/8 inch from the raw edge of the fly piece and stitch the flies together, with the stitching centered between the buttonholes and perpendicular to the front edge.	301	LSbj-1	10-12	50	50
	OR					
	c. As an option to the perpendicular stitching, place a bartack centered between each buttonhole superimposed on the fly piece edge stitching. The bartacks shall be caught through the facing and fly pieces only.	Bartack		28 stitches per bartack	50	50
15.	Attach labels to outer shell.					
	Position the combination personal identification, identification, and instruction label on the left facing not less than 1±1/2 inch below the lower tab button. Position the size label below the combination personal identification, identification, and instruction label. Stitch the two labels on all four sides to the left facing. The stitching shall not be through the printing on the labels. The top edge of the size label may be caught in the bottom row of stitching of the combination personal identification, identification, and instruction label.	301	LSbj-1	8-12	50	50

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
16.	Attach storm tab.					
	a. Position the storm tab on the right facing, at the pattern marks, with the raw edge of the storm tab parallel to the front edge of the right facing. Stitch the storm tab to the right facing 1/4 inch from the raw edge. Turn the storm tab to the finished position (point of storm tab toward the front of the right facing), and stitch enclosing the raw edge. Continue stitching across the top of the storm tab with the stitching superimposed on the horizontal edge stitching of the storm tab. The purling of the buttonhole in the storm tab shall face the wearer of the finished all-weather coat.	301 or 401 and 301	LSs-2(a) LSs-2(a) LSs-2(b)	10-12 10-12 10-12	50 50 50	50 70 50
17.	Make lining (yoke).					
	a. Join the front lining to the front sleeve lining at each armhole with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50 70	70 Chain 70 and over-edge
	b. Position the front edge of the back sleeve lining, and stitch the front edge of each shoulder lining piece to the shoulder edge of the front lining with a safety stitch. Continue the stitching the entire length of each sleeve.	515 or 516 or 519	SSa-2	10-12	50 70	70 Chain 70 and Over-edge

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
17.	Make lining yoke. - Contd					
	c. Position the back edge of each shoulder lining piece and the back edge of each back sleeve lining to the front edge of the back lining, and stitch to the bottom of each armhole with a safety stitch. The shoulder lining piece shall finish next to sleeve outershell.	515 or 516 or 519	SSa-2	10-12	50 70 Chain 70 and Overedge	
	d. Overedge stitch the bottom raw edge of each sleeve lining.	502 or 503 or 504	EFd-1	6-12	70	70
	e. Close the side seam of the front and back lining and the underarm seam of the sleeve lining with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50 70 Chain 70 and Overedge	
	f. Hem the bottom of the lining with raw edges turned in. The finished hem in the bottom of the lining shall be 3/8 to 1/2 inch wide.	301	EFb-1	10-12	50	50
18.	Close sides of outershell.					
	a. Position the fronts to the back, face to face, fold the edge of the back over the edge of the fronts. Insert the seam tape on the fronts under the folded edge of the back; stitch the side seams of the outershell, 1/16 to 3/32 inch from the raw edge, catching the seam tape in the stitching.	301 or 401	SSw-2(a) SSw-2(a)	10-12 10-12	50 50	50 70

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
18.	Close sides of outershell. - Contd					
	b. Turn each side seam toward the front, and raise stitch 1/4 to 5/16 inch from the folded edge of the seam.	301	SSw-2(b)	10-12	50	50
	c. Press the side seams of the outershell, with a heated pressing iron or machine, fusing the seam tape.					
19.	Close sleeves of outershell.					
	a. Stitch each underarm seam of the outershell.	301	SSa-1	10-12	50	50
	b. Press each underarm sleeve seam of the outershell open and flat with a heated pressing iron or machine.					
	c. Stitch the sleeve hem interlining to the bottom of each sleeve as indicated by the pattern marks.	301		10-12	50	50
	d. Stitch sleeve to armhole from front shoulder around armhole to back neckline.	301 or 401	LSq-2(a)	10-12	50 50	50 70
	e. Turn and raise the seams with the stitching on fronts and backs to the step as marked on the pattern. Turn at the step and stitch to joining seam line.	301	LSq-2(b)	10-12	50	50
	f. Join each top arm seam from the neckline to the bottom of the sleeve simultaneously stitching the seam tape to the back edge of the front sleeve.	301 or 401	LSq-2(a) LSq-2(a)	10-12 10-12	50 50	50 70

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
19.	Close sleeves of outershell. - Contd					
	g. Turn each seam toward the front, and raise stitch 1/4 to 5/16 inch from the folded edge.	301	LSq-2(b)	10-12	50	50
	h. Press the seams, with a heated pressing iron or machine, fusing the seam tape.					
20.	Attach shoulder loops.					
	a. Fit the shoulder loops to the shoulders and trim, leaving a 1/4-inch seam allowance at the sleeve end.					
	b. Position each shoulder loop on a shoulder seam with the raw edge end facing the neck opening, and stitch with the stitching in line with the armhole seam.	301	LSbl-2(a)	10-12	50	50
	c. Fold each shoulder loop toward the neck opening, and raise stitch 1/4 to 5/16 inch from the folded edge and in line with the raise stitching on the fronts.	301	LSbl-2(b)	10-12	50	50
	d. Sew the stud of a snap fastener to the underside of each shoulder loop centered with tolerance of 1/8 inch centered on the neck end 1/2 inch from the edge and completely hidden from the outside view. Sew the socket of a snap fastener to each shoulder to correspond with the stud on the shoulder loop.	Hand or 101 or		12-16 double thread stitches per stud or socket 21-22 stitches per stud or socket	50 50	 50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
20.	Attach shoulder loops. - Contd					
	If the snap fasteners are hand sewn, tack off the hand sewing with not less than two stitches. The snap fasteners shall be positioned so that the closure will be flat and smooth and the stitching will not show on the outside of the shoulder loops.	301		14-16 stitches per stud or socket	50	50
	As an alternate, tack each shoulder loop at the neck end with the stitching superimposed on the 1/4-inch to 5/16-inch raise stitching.	301	SSa-1	10-12	50	50
	NOTE: The shoulder loops shall be positioned so that a finished shoulder loop will be centered on each shoulder seam with the sleeve end of the shoulder loop even with the front armhole seam and with the neck end of the shoulder loop extending to within 1/8 inch of the collar joining seam line.					
21.	Attach collar to outershell.					
	Stitch the collar to the outershell, with the notches matching. Slash the front neckline seam allowance, at the curved edges to facilitate turning of collar without pleats.	301 or 401	SSa-1 SSa-1	10-12 10-12	50 50	50 70
22.	Attach lining to facings.					
	Position raw edge of lining to marks on facings and stitch lining to facings.	301	LSa-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
23.	Attach facing assembly to shell.					
	a. Position facing to front and neckline with raw edges even and stitch across neckline through coat, collarstand and collar. Continue stitching across lapels, down front and across bottom of facing.	301 or 401	SSe-2(a) and LSq-2(a)	10-12	50 50	50 70
	b. Turn neck facing and raise stitch across neckline 1/16 to 3/32 inch from edge, the length of the collarstand. The stitching shall not be visible on the outside of coat.	301	LSq-2(b)	10-12	50	50
	c. Stitch sleeve lining to sleeve 3/8 inch from bottom over edged seam of lining.	301	SSa-1	10-12	50	50
	d. Turn up bottom of sleeve at hem notch, align underarm seams of lining and shell and stitch together for a distance of 6 to 6-1/2 inches beginning 2-1/2 to 3 inches from the bottom.	301	SSa-1	10-12	50	50
24.	Anchor lining to side seams.					
	With the sleeve setting seams of the lining aligned with the sleeve setting seams of the outershell, tack each lining side seam to an outershell side seam 2 to 3 inches below the sleeve setting seam. The tacks shall be automatic straight tacks that are 1/2 inch long or vertical bartacks that are 3/8 to 1/2 inch long.	301 or Bartack		28 stitches per bartack 28 stitches per bartack	50 50	50 50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
25.	Hem bottom of outershell.					
	Turn in the raw edge of the bottom of the outershell and hem. The finished bottom hem shall be 1 ±1/8 inch wide. The turned in raw edge may be stitched prior to hemming.	301	EFb-1	10-12	50	50
26.	Finish fronts.					
	Turn the facings; force out the edges. Edge stitch the fronts 1/4 to 5/16 inch from the edge across the top of the lapels, down the fronts, and across the bottoms to the back edge of the facings and sew out at 90 degrees and up to the bottom hem stitching catching the edge of the facing.	301	SSe-2(b)	10-12	50	50
27.	Top stitch fly front.					
	Position the finished fly front shaper (stitch line) on right front 1/2 ±1/8 inch, below the bottom of the fly opening on the front and mark. Stitch on the marked line through all plies, continuing the stitch to the collar joining seam, maintaining the stitch 2-1/2 ±1/16 inches, from and parallel to the front edge.	301	LSbj-1	10-12	50	50
28.	Make buttonholes.					
	Make a buttonhole in the right lapel as indicated by the pattern marks, with the center of the eyelet of the finished lapel buttonhole 1 to 1-1/8	Button-hole		50-54 stitches per button-hole	30	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
28.	Make buttonholes. - Contd inches from the top (step) edge of the lapel and 3/4 to 7/8 inch in from the finished front edge of the lapel. The buttonhole shall be a cut-first, eyelet-end, square-bar type worked over gimp with the ends pulled through to the underside and bartack in a separate operation. The finished cut buttonhole shall be 7/8 ±1/8 inch long. The purling shall be on the facing side. As an alternate, a cut-first, eyelet-end, taper-bar buttonhole can be used.	Bartack		21 stitches per bartack	50	50
29.	Tack pocket to facing. Tack back edge of facing to edge of pocket with a 1/2 to 3/4 inch vertical tack. The tacks shall not be more than 1/2 inch from bottom edge of pocket and approximately 1 inch from edge of binding.	Bartack		28 stitches per bartack	50	50
30.	Set slide fastener on outershell. a. Prior to assembly of the slide fastener to the facing, permanently mark the center of the slide fastener. Make sure that the center as marked falls in line with the center back of the neck facing.					
	b. Position the slide fastener on the outershell facings so that the ends of the slide fastener will be equidistant from the bottom edge of the outershell	301	SSa-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
30.	Set slide fastener on outer-shell. - Contd and the separating pin of the slide fastener will be on the right facing. Position the slide fastener on the underside of the outer shell facings with the front edge of the chain completely covered by the bound edge 1/8 to 3/16 inch. Turn in the end of the slide fastener tape 1/2 to 3/4 inch. Stitch the length of the slide fastener tape 3/16 to 5/16 inch from the back edge of the chain. Secure each end of the slide fastener tape with a bartack superimposed on the stitching. The bartack shall be 3/8 to 1/2 inch long. When ends of slide fastener tape are finished they need not be turned under.	Bartack		28 stitches per bartack	50	50
31.	Clean outershell. a. Trim thread ends. b. Remove loose threads from the outershell. c. Remove spots, stains, and markings from the outershell. d. Remove shade tickets from the outershell.					
32.	Press outershell. Press the collar, the fronts, the back, the pockets, the sleeves, and the hems with a steam pressing machine or a hand pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
33.	Sew buttons on outershell.					
	Mark or gage the position of the buttons, as indicated by the pattern marks, and sew buttons to the all-weather coat as follows:	101 or		14-16 stitches per button	30	
	a. Sew four 40-line buttons on the left front 2-1/8 to 2-1/4 inches from the edge, to correspond with the buttonholes in the right fly, with the stitching of each button through the all-weather coat, the facing, and an 18-line stay button. The 40-line buttons shall be shank wrapped.	301 or Hand		14-16 stitches per button 4-6 stitches per button	30 30	30
	b. Sew a 30-line button on the left front lapel 2-3/8 to 2-5/8 inches from the front edge, to correspond with the buttonhole in the right front lapel with the stitching through the all-weather coat, the facing, and an 18-line stay button. The button shall be shank wrapped.					
	c. Sew a 24-line button on the left front, to correspond with the buttonhole in the facing tab, with the stitching through the all-weather coat and the facing.					
	d. Sew two 24-line buttons on the sleeves, the first button centered on the top sleeve seam 1-1/4 inches from the bottom of the sleeve and the second button 3/4 inch above the center of the first button.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
33.	Sew buttons on outershell. - Contd e. Sew one 24-line button on the left side of the under collarstand to correspond with the buttonhole in the collarstand tab when the collarstand tab is closed. Sew one 24-line button on the right side of the under collarstand to secure the under collar tab when it is not in use. The buttons shall be sewn to the under collar and the interlining only. f. Sew a 24-line button to the underarm seam of each sleeve corresponding to loops on liner at cuff end of sleeve. The stitching may be visible on the outside of the coat.					
34.	Make liner. Caution shall be taken in fabricating the liner so that when the liner is attached to the all-weather coat, all neck seams on the liner will be lined up to correspond with all counterpart seams of the outer shell components. No seam on the liner shall be staggered more than 3/8 inch from the corresponding seam of the outershell components. The center back of the liner shall match the center back of the outershell. The shoulder seams of the liner shall match the shoulder seams of the outershell. The sleeve seams of the liner shall match the sleeve seams of the outershell.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
35.	Join back to fronts of liner.					
	Stitch and overedge stitch the back to each front at the side seam with a 3/8 inch seam.	515 or 516 or 519	SSa-2	10-14	70	70
36.	Join underarm of sleeve liner.					
	Stitch and overedge stitch the underarm of each sleeve with a 3/8 inch seam.	515 or 516 or 519	SSa-2	10-14	70	70
37.	Set in sleeves of liner.					
	a. Match the front and back sleeve notch and the underarm seam of the sleeve with the side seam of the liner, stitch and overedge stitch with a 3/8 inch seam.	515 or 516 or 519	SSa-2	10-14	70	70
	b. With the front shoulder seam matching the top sleeve notch, stitch and overedge stitch each sleeve top seam with a 3/8 inch seam.	515 or 516 or 519	SSa-2	10-14	70	70
38.	Attach wristlets of liner.					
	Stitch and overedge stitch the wristlet at the bottom of each sleeve, with a 3/8 inch seam distributing the fullness and catching the braid button loop on the sleeve underseam. The finished loop shall accommodate a 24-line button.	515 or 516 or 519	SSa-2	10-14	70	70
39.	Bind edges of liner.					
	a. To preclude stretching of the back neck area of the liner sew a					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
39.	Bind edges of liner. - Contd					
	stay tape to the back of the neck from the shoulder seam to shoulder seam.					
	b. Bind the edges of the liner as specified herein. The binding shall be uniformly stitched with no raw edges showing. The fabric shall be caught in the stitching. The finished binding shall be 1/4 to 5/16 inch wide.	301 or 401 or Bartack	BSc-1 BSc-1	10-12 10-12 28 stitches per bartack	50 50 50	50 70 50
	(1) Bind the edges of the bottom, the fronts, and the neck in one operation. The ends of the binding shall be turned in and caught in the stitching. The ends of the binding shall overlap not less than 1/2 inch. The end of the binding shall be turned on itself and securely stitched or bartacked. The bartack shall be 1/2 ±1/16 inch long.					
41.	Attach labels to liner.					
	a. Position the combination personal identification, identification, and instruction label on the left front pile side of the liner. Stitch the combination label on all four sides. Position the size label below the combination label. Stitch the two labels on all four sides. The stitching shall not be through the printing on the labels. The top edge of the size	301	LSbj-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
40.	Attach labels to liner. - Contd					
	label may be caught in the bottom row of stitching of the combination label.					
	OR					
	b. As an option to Op No. 40a, position the combination personal identification, size, identification, and instruction label on the center back pile side of the liner so that the top edge of the combination label will be 1-1/4 to 1-3/4 inches from the bottom of the binding. Stitch the combination personal identification, size, identification, and instruction label on all four sides.	301	LSbj-1	10-12	50	50
41.	Set slide fastener on liner.					
	Prior to the assembly of the slide fastener to the liner, make sure the permanently marked center of the slide fastener tape that is applied to the liner corresponds with the center of the slide fastener tape that is sewn to the facings of the outershell. The center mark shall match the back center notch at the neck of the back line.					
	a. Position the slide fastener on the underside of the liner, with the back edge of the chain immediately adjacent to the bound edge of the liner. Turn in the raw edge end of the slide fastener tape 1/2 to 3/4 inch.	301	LSa-1	10-12	50	50

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE V. Manufacturing operations. - Continued

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Top	Lower
41.	Set slide fastener on liner. - Contd Stitch the length of the slide fastener tape with the stitching superimposed on the binding stitching. The slider shall be on the left side of the finished liner. When ends of slide fastener tape are finished they need not be turned under.					
	b. Secure each end of the slide fastener tape with a bartack superimposed on the binding stitching. The bartack shall be 3/8 to 1/2 inch long.	Bartack		28 stitches per bartack	50	50
42.	Clean liner. a. Trim all thread ends. b. Remove all loose thread from the liner. c. Remove all spots and stains from the liner. d. Remove all shade tickets from the liner.					
43.	Attach liner to outershell. Attach the liner to the outershell by means of the slide fastener, checking the operation of the slide fastener to insure free and easy manipulation of the slider. When the slide fastener is closed, the outershell and the liner shall not show any evidence of bulging or distortion. The liner shall match the outershell in size.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

3.7.1 Shade and size marking. The component parts of the all-weather coat and liner shall be marked, ticketed, or bundled to insure a uniform shade and size. Any method may be used except:

a. Corrosive metal fastening devices.

b. Sew-on shade tickets.

c. Adhesive type tickets which discolor or adhere to the material upon removal of tickets.

NOTE: The use of an ink pad numbering machine, rubber stamp, or pencil is allowed, provided the numbering does not show on the outside of the all-weather coat or liner and wherever possible, is covered by the seam allowance.

3.8 Finished measurements. The measurements of the finished outershell shall conform to the requirements specified in table VI and the measurements of the finished liner shall conform to the requirements specified in table VII.

3.9 Workmanship. The finished all-weather coat and removable liner shall conform to the quality of product established by this document and the occurrence of defects shall not exceed the acceptable point value or defect limit.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facility suitable for the performance of the inspection requirement specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.1.2 Certificate of compliance. Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VI. Finished measurements (inches) of outershell. 1/

Sizes	1/2 Bust 2/	Back Length 3/	Sleeve Inseam Length 4/
Short			
6	20-1/4	39-1/2	15
8	20-3/4	39-3/4	15-1/8
10	21-1/4	40	15-1/4
12	21-3/4	40-1/4	15-3/8
14	22-1/2	40-1/2	15-1/2
16	23-1/4	40-3/4	15-5/8
Regular			
6	20-1/4	41	16
8	20-3/4	41-1/4	16-1/8
10	21-1/4	41-1/2	16-1/4
12	21-3/4	41-3/4	16-3/8
14	22-1/2	42	16-1/2
16	23-1/4	42-1/4	16-5/8
18	24	42-1/2	16-3/4
20	25	42-3/4	16-7/8
Long			
8	20-3/4	42-3/4	17-1/8
10	21-1/4	43	17-1/4
12	21-3/4	43-1/4	17-3/8
14	22-1/2	43-1/2	17-1/2
16	23-1/4	43-3/4	17-5/8
18	24	44	17-3/4
20	25	44-1/4	17-7/8
Extra Long			
10	21-1/4	45	18-3/4
12	21-3/4	45-1/4	18-7/8
14	22-1/2	45-1/2	19
16	23-1/4	45-3/4	19-1/8
18	24	46	19-1/4
20	25	46-1/4	19-3/8
Tolerance	±1/2	±1/2	±1/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VI. Finished measurements (inches) of outershell. 1/ - Contd

1/ The finished measurements of the outershell shall be taken with the all-weather coat flat, smooth, and buttoned.
2/ The 1/2 bust shall be measured across the bust, from armhole seam to armhole seam.
3/ The back length shall be measured on the center back seam, from the lower edge of the collar stand to the bottom of the all-weather coat.
4/ The sleeve inseam length shall be measured at the inseam, from the base of the armhole to the bottom of the sleeve.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.4).

b. Quality conformance inspection (see 4.5).

4.3 Inspections conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in FED-STD-191 or MIL-STD-1494, as applicable.

4.4 First article inspection. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.5.3. The presence of any defect shall be cause for rejection of the first article.

4.5 Quality conformance inspection. Unless otherwise specified, sampling for inspection shall be in accordance with MIL-STD-105.

4.5.1 Components and material inspection. In accordance with 4.1, components and materials shall be inspected in accordance with all the requirements of referenced documents unless otherwise excluded, amended, modified, or qualified in this document or applicable purchase document.

4.5.1.1 Component testing. In addition to any testing required by 4.5.1, components listed in table VIII shall be tested for the characteristics noted. The methods of testing specified in table VIII shall be followed. All test reports shall contain the individual values used in expressing the final results. The lot size and sample size shall be as follows:

Lot size	Sample size
800 or less	2
801 up to and including 22,000	3
22,001 and over	5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VII. Finished measurements (inches) of liner. 1/

Sizes	Back Width 2/	Center Back Length 3/	Sleeve Length 4/
Short			
6	20	31	11-3/4
8	20-1/2	31-1/4	11-7/8
10	21	31-1/2	12
12	21-1/2	31-3/4	12-1/8
14	22-1/4	32	12-1/4
16	23	32-1/4	12-3/8
Regular			
6	20	32	12-3/4
8	20-1/2	32-1/4	12-7/8
10	21	32-1/2	13
12	21-1/2	32-3/4	13-1/8
14	22-1/4	33	13-1/4
16	23	33-1/4	13-3/8
18	23-3/4	33-1/2	13-1/2
20	24-3/4	33-3/4	13-5/8
Long			
8	20-1/2	33-1/4	13-7/8
10	21	33-1/2	14
12	21-1/2	33-3/4	14-1/8
14	22-1/4	34	14-1/4
16	23	34-1/4	14-3/8
18	23-3/4	34-1/2	14-1/2
20	24-3/4	34-3/4	14-5/8
Extra Long			
10	21	36-1/2	15-1/2
12	21-1/2	36-3/4	15-5/8
14	22-1/4	37	15-3/4
16	23	37-1/4	15-7/8
18	23-3/4	37-1/2	16
20	24-3/4	37-3/4	16-1/8
Tolerance	±1/2	±3/4	±1/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VII. Finished measurements (inches) of liner. 1/ - Contd

1/ The finished measurements of the liner shall be taken with the liner flat on a table.
2/ The back width shall be measured, on the knit (wrong) side of the liner, at the base of the armhole from side seam to side seam.
3/ The back length shall be measured, at the center back, from the neck to the bottom of the liner.
4/ The sleeve length shall be measured, along the underarm seam, from the sleeve joining seam to the bottom of the sleeve at the cuff joining seam.

The lot shall be unacceptable if one or more sample units fail to meet any test requirement specified. The lot size units and the sample units shall be as follows:

Component	Lot size unit	Sample unit
Nylon cloth	Yard	1 yard full width
Fusible interlining	Yard	1 yard full width
Interlining fused to basic cloth	Yard	1/2 yard full width
Fusible seam tape	Yard	1/2 linear yard
Snap fasteners	Sets	10 sets

4.5.2 In-process inspection. Inspection shall be made at any point or during any phase of manufacturing to determine whether operations or assemblies are accomplished as specified and to verify that the working patterns conform to the Government patterns in all respects. The Government shall reserve the right to exclude from consideration for acceptance any material or service for which in-process inspection has indicated nonconformance.

4.5.2.1 Bond strength of fusible interlining. The strength of the bond of the fusible interlining to the outershell shall be tested twice a day, at the fusing press location, to determine that adequate fusing is being obtained as follows: Prepare a test sample by fusing the fusible interlining specified in 3.3.10.1 to the basic fabric of the outershell specified in 3.3.1 under the same fusing conditions to be used in the manufacture of the all-weather coat. Determine the bond strength of the test sample with a commercial spring scale (see 6.7). If the bond strength of any test sample is less than 22 ounces per inch of width, the fusing conditions shall be corrected and the bond strength test shall be repeated.

4.5.3 End item examination.

4.5.3.1 Individual examination. As a final step in the contractor's production control plan and before formation of a lot, each all-weather coat and liner shall be buttoned on a model form and then examined for the selected defects listed in MIL-STD-1494 and 4.5.3.1.1. The occurrence of

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

TABLE VIII. Component tests.

Component	Characteristic	Requirement paragraph	Test method
Nylon cloth	Material identification	3.3.6	1/
	Weave	3.3.6	Visual 2/
	Weight	3.3.6	5041
	Threads per inch	3.3.6	5050
	Thickness	3.3.6	5030
	Breaking strength	3.3.6	5100
	Stiffness	3.3.6	5202
	Color	3.3.6	Visual 1/
Fusible interlining	Material identification	3.3.10.1	1/
	Adhesive	3.3.10.1	1/
	Weight	3.3.10.1	5041
	Breaking strength	3.3.10.1	5100
	Shrinkage after 5 dry cleanings	3.3.10.1	5556
	Color	3.3.10.1	2/
Interlining fused to basic cloth	Shrinkage	3.3.10.1.1	5556
	Bond strength: Initial	3.3.10.1.1	5951
	After 5 dry cleanings	3.3.10.1.1	5580 3/ and 5951
Fusible seam tape	Material identification	3.3.10.2	1/
	Width	3.3.10.2	5010
	Weight	3.3.10.2	5041
	Color	3.3.10.2	Visual 2/
Snap fasteners	Material identification	3.3.16	1/
	Type	3.3.16	1/
	Size	3.3.16	1/
	Finish	3.3.16	1/

1/ A certificate of compliance is acceptable for this requirement.
2/ One determination per sample unit shall be made.
3/ The pressing and the shrinkage requirements specified in 5580 of FED-STD-191 shall not apply.

defects during this examination for selected defects shall not exceed the applicable point or defect limit specified in MIL-STD-1494. Any all-weather coat and liner that contains a selected defect shall not be included in an end item lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

4.5.3.1.1 Exceptions to MIL-STD-1494. The following exceptions to MIL-STD-1494 shall apply to the examinations specified in 4.5.3.1:

a. The terms "outside" and "inside" shall be defined as follows:

Outside - Any part of all-weather coat (including undersleeves) that is visible when the completely buttoned coat is observed on the model form with collar in both the up and down position. When applicable, shoulder loops, and the area on the all-weather coat covered by overlap of back vent are considered part of the outside.

Inside - Any part of all-weather coat that is not visible when the completely buttoned coat is observed on the model form with collar in both the up and down positions.

b. Identify the following defects in table II as selected defects:

XXVIII. LINER

b. Liner tight or short causing puckering of all-weather coat. *

XXIX. SLIDE FASTENER

k. All-weather coat or liner twisted or distorted when slide fastener is engaged. *

c. Add the following selected * defects to table III:

LINER

Liner tight or short, causing puckering of all-weather coat.

SLIDE FASTENERS

All-weather coat or liner twisted or distorted when slide fastener is engaged.

4.5.3.2 Dimensional examination. The number of all-weather coats and liners, as specified in MIL-STD-1494, shall be examined for conformance to the dimensional requirements specified in tables VI and VII. The lot shall be unacceptable if the total point value resulting from the examination exceeds the maximum acceptable point value specified in MIL-STD-1494.

4.5.3.3 Packaging examination. Shipping containers fully prepared for delivery with the exception that they need not be closed shall be examined as specified in MIL-STD-1494. Hanger packs shall be examined in accordance with MIL-C-44192. The occurrence of defects during this examination shall not exceed the applicable point value or defect limit specified.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

4.5.4 Fused coat testing. The fused coats shall be tested as specified in table IX. The lot size shall be expressed in units of one coat. The sample unit shall be one fused coat. The lot shall be unacceptable if one or more sample units fail to meet the requirements specified. The lot size and sample size shall be as specified in 4.5.1.1.

TABLE IX. Fused coat tests.

Characteristic	Requirement paragraph	Test Method
Bubbling or delamination of fused area after one dry cleaning.	3.3.10.1.1	Dry cleaning and visual 1/
Strike through of adhesive.	3.3.10.1.1	Visual

1/ The finished all-weather coat shall be dry cleaned one time in a single unit, coin-operated cycle capable of providing a complete automatic dry to dry cycle, using perchloroethylene and then shall be visually examined for bubbling and delamination of the fused areas.

4.5.5 Palletization examination. An examination shall be made to determine that the palletization complies with the requirements of section 5. Defects shall be scored in accordance with the list below. The sample unit shall be one palletized unit load fully packaged. The lot size shall be the number of palletized unit loads in the inspection lot. The inspection level shall be S-1 and the AQL, expressed in terms of defects per hundred units, shall be 6.5

Examine	Defects
Finished dimensions	Length, width, or height exceeds specified maximum requirements.
Palletization	Pallet pattern not as specified. Interlocking of loads not as specified. Load not bonded with required straps or film as specified.
Weight	Exceeds maximum load limits.
Marking	Omitted; incorrect; illegible; of improper size, location, sequence, or method of application.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1 Preservation. Preservation shall be level A or commercial, as specified (see 6.2).

5.1.1 Level A. Each all-weather coat shall be buttoned at the top only and folded to measure approximately 23 x 15 inches. Each folded all-weather coat shall be inserted in a close fitting, flat style, clear polyethylene bag that is 0.00125 ±25 percent thick. The bag shall be formed with heat-sealed seams that are straight, continuous, and parallel to each other and the formed edges of the bag. The bag may be fabricated from either film tubing or sheeting. The bag shall be at least one inch longer than the folded all-weather coat. The unsealed opening of the bag shall be at the smaller dimension of the bag.

5.1.2 Commercial. Each all-weather coat shall be preserved in accordance with ASTM D 3951.

5.1.3 Hanger pack. Each all-weather coat shall be preserved in a plastic bag conforming to type III of A-A-1696.

5.2 Packing. Packing shall be level A, B, or commercial, as specified (see 6.2).

5.2.1 Level A. Eight all-weather coats, of one size only, preserved as specified in 5.1, shall be packed in a fiberboard shipping container that is assembled, closed, and reinforced in accordance with style RSC-L, grade V2s, size 3A of MIL-B-17757. Level A packages shall be packed flat, front up, alternated end for end within the shipping container. The top and bottom of the contents of the shipping container shall be completely covered with a sheet of 30-pound (minimum) basis weight paper conforming to grade B of UU-P-268. Towards the end of the contract or when there are less than the quantity of the same size required per shipping container, mixed sizes (see 5.4.3) may be packed in the same container.

5.2.2 Level B. Eight all-weather coats, of one size only, preserved as specified in 5.1, shall be packed in a snug-fitting shipping container conforming to class domestic, style RSC-L, grade 275, size 3A of MIL-B-17757. Level A packages shall be packed flat, front up, alternated end for end within the shipping container. The top and bottom of the contents of the shipping container shall be completely covered with a sheet of 30-pound (minimum) basis weight paper conforming to grade B of UU-P-268. Closure and strapping shall be in accordance with the appendix of the container specification. Towards the end of the contract or when there are less than the quantity of the same size required per shipping container, mixed sizes (see 5.4.3) may be packed in the same container.

5.2.2.1 Weather-resistant fiberboard containers. When specified (see 6.2), the shipping container shall be a grade V3c, V3s, or V4s fiberboard box fabricated in accordance with MIL-B-17757 and closed in accordance with the appendix of the container specification, except that the inspection shall be in accordance with 4.5.3.3.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

5.2.3 Commercial. All-weather coats, preserved as specified in 5.1, shall be packed in accordance with ASTM D 3951.

5.2.4 Hanger packs. Twelve all-weather coats, of one size only, preserved as specified in 5.1, shall be packed in a type I container, using a style A or B hanger bar, in accordance with MIL-C-44192. All-weather coats sizes 6 thru 16 shall use a 16-inch long hanger and sizes 18 thru 20 shall use a 17-inch long hanger.

5.3 Palletization. When specified (see 6.2), all-weather coats packed as specified in 5.2, shall be palletized on a 4-way, type I, style 1, 1A, or 1B, size A, class 1 pallet fabricated in accordance with MIL-P-15011 or on a 4-way, type IV, V, or VIII, class 1, size 2, grade A pallet fabricated in accordance with NN-P-71. Each prepared load shall be in accordance with load type I or Ia and bonded with the applicable strap bonding or film bonding means specified in MIL-STD-147. The pallet pattern shall be in accordance with the appendix of MIL-STD-147. Interlocking of loads shall be effected by reversing the pattern of each course. If the container is of a size which does not conform to any of the patterns specified in MIL-STD-147, the pallet pattern used shall be approved by the contracting officer.

5.3.1 Hanger pack. When specified (see 6.2), all-weather coats packed as specified in 5.2, shall be palletized in accordance with the appendix of MIL-C-44192 using pallet load pattern number 95.

5.4 Marking. In addition to any special marking required by the contract or purchase order, unit packages, shipping containers or hanger packs as specified (see 6.2), and palletized unit loads shall be marked in accordance with MIL-STD-129, ASTM D 3951, or the appendix of MIL-C-44192, as applicable.

5.4.1 Bar code markings. Bar code markings, when specified (see 6.2), shall be in accordance with MIL-STD-129.

5.4.2 Polyethylene packages. Each polyethylene package (see 5.1) shall have the nomenclature, the stock number, the size and length of the all-weather coat, and the quantity contained therein legibly printed or stamped in black directly on the bag across the center face or on a white paper label inserted within the bag so as to permit ready identification.

5.4.3 Labels, mixed sizes. Each shipping container packed with mixed sizes shall have securely attached to the end and side, directly under the printing, stenciling, or arrows, a white paper label, 5 inches by 4 inches. The words "MIXED NSN'S" shall be plainly stamped or printed thereon and under these words shall be legibly stamped or printed the correct quantity and NSN's contained therein.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

6. NOTES

6.1 Intended use. The all-weather coat covered by this specification is intended to be worn by female personnel of the Department of the Air Force.

6.2 Ordering data

6.1.2 Acquisition requirements. Acquisition documents should specify the following:

a. Title, number, and date of this specification.

b. Size and length required (see 1.2).

c. When a first article is required (see 3.2).

d. Selection of applicable levels of preservation and packing (see 5.1 and 5.2).

e. When weather-resistant fiberboard containers are required (see 5.2).

f. When palletization is required (see 5.3).

g. When bar code markings are required (see 5.4).

6.3 Samples. For access to samples of the end item and shade samples, address the contracting activity issuing the invitation for bids.

6.4 First article. When a first article inspection is required, the item should be a first article sample, inspected and approved under the appropriate provisions of FAR 52.209-4. The first article should consist of one all-weather coat with liner. The contracting officer should include specific instructions in acquisition documents regarding arrangements for examinations, approval of first article test results and disposition of first article. Invitations for bids should provide that the Government reserves the right to waive the requirement for samples for first article inspection to those bidders offering a product which has been previously acquired or tested by the Government, and that bidders offering such products, who wish to rely on such production or test, must furnish evidence with the bid that prior Government approval is presently appropriate for the pending contract.

6.5 Recycled material. It is encouraged that recycled material be used when practical as long as it meets the requirements of this document (see 3.3).

6.6 Fusing conditions. For optimum results with the particular fusible used, specific machine settings should be obtained from the contractor furnishing the fusible material. The following fusing conditions were established to include the recommendations of several fusible material suppliers and these limits are funished for guidance only:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

Temperature between pressing surface at the fuse level.	305° F	315° F
Pressure between pressing surface.	5 psi	7 psi
Pressing time.	13 seconds	15 seconds

6.7 Peel strength test. The procedure for the peel strength testing with a spring scale should be obtained from the supplier of the fusible material (see 4.5.2.1).

6.8 Subject term (key word) listing.

Coat, woman's
Coat, all-weather
Liner, coat

6.9 Changes from previous issue. Asterisks are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

Custodian:
Air Force - 11


Reviewer:
Air Force - 82, 99
DLA- CT

User:
Air Force - 45


Preparing activity:
Air Force - 11

Project No. 8410-F666


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

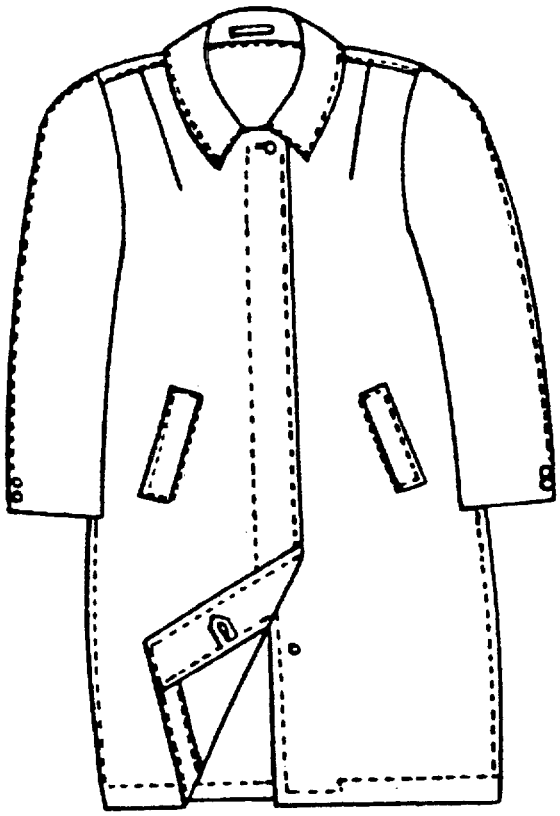

Front view

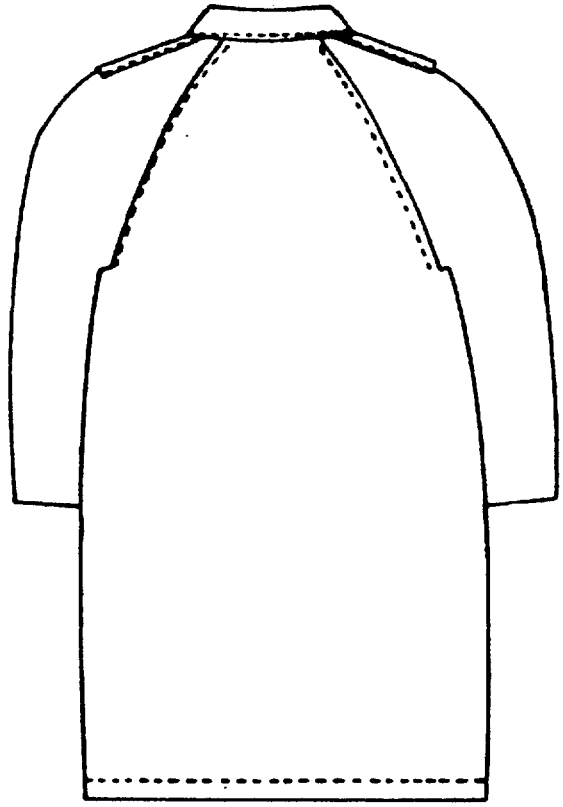

Back view

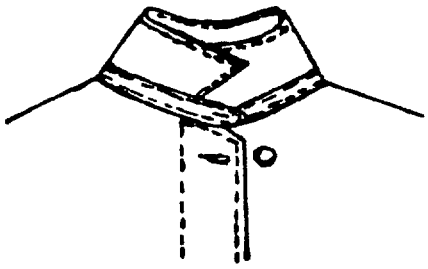

Collar view

FIGURE 1. Woman's all-weather coat, outershell.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

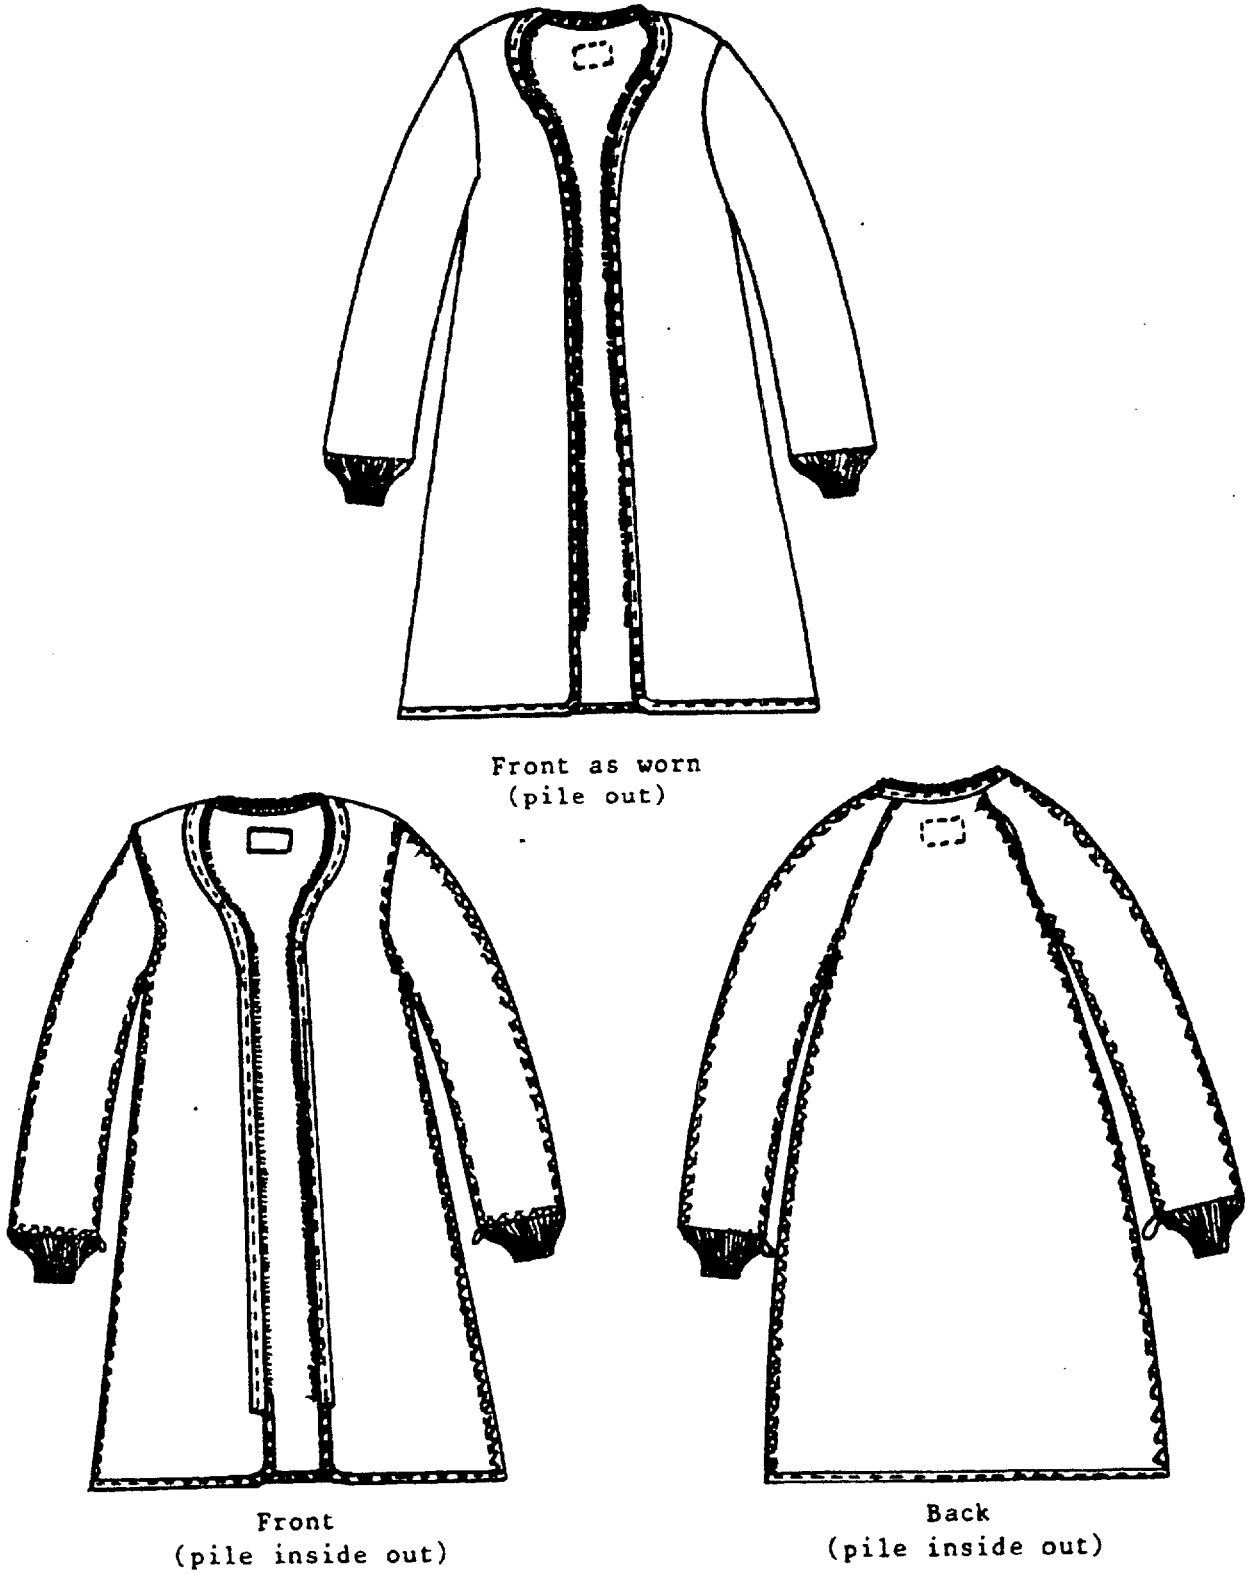


FIGURE 2. Woman's all-weather coat, liner.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-C-87170A(USAF)	Coat, All-Weather: Woman's, Blue, With Removable Liner

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR ☐ USER ☐ MANUFACTURER ☐ OTHER *(Specify)*:
b. ADDRESS *(Street, City, State, ZIP Code)*	

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE AIR FORCE
ASD/ENES
Wright-Patterson AFB OH 45433-6503

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 73236 WASHINGTON D. C.
POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE AIR FORCE

ASD/ENES
Wright-Patterson AFB OH 45433-6503

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:53Z
Check the source to verify that this is the current version before use.