MIL-P-46519D (AR)
25 July 1979
SUPERSEDING
MIL-P-46519C (MU)
20 January 1969

MILITARY SPECIFICATION

PRIMER, ELECTRIC, M73
LOADING, ASSEMBLING AND PACKING

This Specification is approved for use by the US Army Armament Research and Development Command, Department of the Army and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the loading, assembling and packing for one type of primer designated as Primer, Electric, M73, for use in artillery ammunition.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

| | | |
|---|---|---|
| MIL-P-116 | - | Preservation, Method of |
| MIL-P-223 | - | Powder, Black |
| MIL-I-46521 | - | Igniter, Primer, Electric, M74 |
| MIL-A-48078 | - | Ammunition, Standard Quality Assurance Provisions, General Specification For |

FSC: 1390

**Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.**

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

DRAWINGS

ARMY

| | | |
|---|---|---|
| 8840278 | - | Primer, Electric, M73, Assembly |
| 8796530 | - | Carton, Packing, Ammunition, for Primer Electric, M73 |
| 8796531 | - | Box, Packing, Ammunition, for Primer, Electric, M73 |
| 8845042 | - | Cartridge 165MM, HEP, M123A1 Loading Assembly and Packing |

(Copies of specifications, standards, drawings and publications required by suppliers in connection with specific procurement functions should be ontained from the procuring activity or as directed by the contracting officer.)

## 3. REQUIREMENTS

3.1 Material.-Materials and parts shall be in accordance with applicable drawings and specifications.

3.2 Primer assembly.-The primer assembly shall comply with all requirements specified on Drawing (dwg.) 8840278 and with all requirements specified in applicable specifications.

3.3 Moisture content of black powder.-The moisture content of the black powder at the loading station at the time of loading shall not exceed 0.5 percent when determined as specified in 4.5.1.

3.4 Lacquer in flash holes.-The lacquer in primer flash holes shall comply with illustration 1, 2 or 3 of Figure 1.

3.5 Primer assembly functioning (proving ground).-The primer assembly shall comply with the following requirements when tested as specified in 4.5.3 (See 6.6):

a. The primer assembly shall not fail to fire.
b. The primer body shall not rupture or become detached.
c. There shall be no audible hangfires.
d. The primer assembly shall not squib.



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

3.6 First article inspection.-This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.7 Workmanship.-All parts shall be free from dirt, burrs, cracks, chips, grease, rust, corrosion and other foreign material. The cleaning method shall not be injurious to any of the parts, nor shall the parts be contaminated by cleaning agents.

## 4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection and standard quality assurance provisions.-Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspections.-The following types of inspection shall be performed on this item:

a. First Article Inspection

b. Quality Conformance Inspection

4.3 First article inspection

4.3.1 Submission.-The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation with the provisions of 4.3.2. The first article sample shall consist of the following items in the sample quantities indicated.

| Part Description | Drawing | Quantity |
|---|---|---|
| Primer, Electric, M73 | 8840278 | 100 |
| Primer, Prior to Assembly of Igniter | 8840278 | 50 |
| Sealed Bag | 8796530 | 10 |

4.3.2 Inspections to be performed.-See MIL-A-48078 and Table I specified herein.

4.3.3 Rejection.-See MIL-A-48078.



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| | Primer, Electric, M73 | | | | See Below<br>NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Primer, Prior to Assembly of Igniter (Dwg. 8840278) | | | | |
| | Examination for Defects | 50 | | 3.2 | 4.4.2.1 |
| | Moisture Content of Black Powder | | | 3.3 | 4.5.1 |
| | Primer, Electric, M73 Assembly (Dwg. 8840278) | | | | |
| | Examination for Defects | 50 | | 3.2 | 4.4.2.2 |
| | Electrical Resistance Check | | | 3.2 | 4.5.2 |
| | Ballistic Test | 50 | | 3.5 | 4.5.3 |
| | Sealed Bag (Dwg. 8796530) | | | | |
| | Heat Seal Test | 10 | | 3.1 | 4.4.3.4 |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection

4.4.1 Inspection lot formation.-Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of loaded primers shall contain:

a. Primer metal parts of one lot interfix number from one manufacturer.

b. Black powder of one lot interfix number from one manufacturer.

c. M74 igniters of one lot interfix number from one manufacturer.

4.4.2 Examination.-See MIL-A-48078.

a. Sampling plans.-Unless otherwise specified in the Classification of Defects and Test tables, sampling plans and procedures shall be in accordance with MIL-STD-105, Inspection Level II.



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-P-46519D (AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.1 | Assembly, Prior to Inserting Igniter | | 8840278 |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | | | | | |
| 1 | One or more flash holes missing | | | 3.1 | Visual |
| Major | | | | | |
| 101 | Weight of Black Powder charge | | 0.40% | 3.1 | Balance |
| 102 | Moisture content of Black Powder | a | | 3.3 | Test/4.5.1 |
| 103 | Liner missing or out of position, exposing flash hole | | 0.40% | 3.1 | Visual |
| Minor | | | | | |
| 201 | Foreign matter in charge cavity | | 0.65% | 3.1 | Visual |
| 202 | Evidence of poor workmanship | | 0.65% | 3.7 | Visual |

NOTES: a. See 4.4.3.1 for sampling plan.

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

# CLASSIFICATION OF DEFECTS & TESTS

MIL-P-46519D (AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.2 | Assembly | | | | 8840278 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Primer-Igniter circuit resistance | | | 3.1 | Test/4.5.2 |
| Major | | | | | |
| 101 | Staking missing | | 0.40% | 3.1 | Visual |
| 102 | Igniter loose to finger pressure torque | | 0.40% | 3.1 | Manual |
| 103 | Igniter not completely seated | | 0.40% | 3.1 | Visual/Manual |
| 104 | Flash hole(s) not completely sealed | | 0.40% | 3.4 | Visual/Figure 1 |
| Minor | | | | | |
| 201 | Total length, max. | | 0.65% | 3.1 | Gage |
| 202 | Marking missing, incorrect or unidentifiable | | 0.65% | 3.1 | Visual |
| 203 | Evidence of poor workmanship | | 0.65% | 3.7 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-P-46519D (AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.3 | Unsealed Carton Prior to Insertion into Bag | | 8796530 |
| | | | NEXT HIGHER ASSEMBLY |
| | | | 8796531 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Incorrect number of primers in box | | 0.40% | 3.1 | Visual |
| 102 | Primer inverted | | 0.40% | 3.1 | Visual |
| Minor | | | | | |
| 201 | Any required packing component missing | | 0.65% | 3.1 | Visual |
| 202 | Evidence of poor workmanship | | 0.65% | 3.7 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-P-46519D (AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.4 | Sealed Carton Prior to Insertion into Bag | | 8796530 |
| | | | NEXT HIGHER ASSEMBLY |
| | | | 8796531 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Contents exposed | | 0.40% | 3.1 | Visual |
| 102 | Sealing strip incomplete or badly wrinkled | | 0.40% | 3.1 | Visual |
| Minor | | | | | |
| 201 | Carton damaged | | 0.65% | 3.1 | Visual |
| 202 | Contents loose when carton is shaken | | 0.65% | 3.1 | Manual |
| 203 | Evidence of poor workmanship | | 0.65% | 3.7 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

# CLASSIFICATION OF DEFECTS & TESTS

MIL-P-46519D (AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.5 | Sealed Bag | | 8796530 |
| | | | NEXT HIGHER ASSEMBLY 8796531 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Seal improper or incomplete | | 0.40% | 3.1 | Visual |
| 102 | Bag torn or otherwise multilated | | 0.40% | 3.1 | Visual |
| 103 | Heat seal test | a | | 3.1 | Test/4.5.4 |
| Minor | | | | | |
| 201 | Seal location improper | | 0.65% | 3.1 | Visual |
| 202 | Evidence of poor workmanship | | 0.65% | 3.7 | Visual |

NOTES: a. See 4.4.3.4 for sample size.



DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

# CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.6 | Unsealed Wood Packing Box | | 8796531 |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Incorrect number of cartons | | 0.40% | 3.1 | Visual |
| Minor | | | | | |
| 201 | Any packing component missing | | 0.65% | 3.1 | Visual |
| 202 | Evidence of poor workmanship | | 0.65% | 3.7 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-P-46519D (AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.7 | Sealed Wood: Packing Box | | 8796531 |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Strapping missing, broken or loose | | 0.40% | 3.1 | Visual |
| 102 | Board broken or split | | 0.40% | 3.1 | Visual |
| Minor | | | | | |
| 201 | Strapping improperly engaged | | 0.65% | 3.1 | Visual |
| 202 | Contents loose | | 0.65% | 3.1 | Manual |
| 203 | Marking incorrect, missing or illegible | | 0.65% | 3.1 | Visual |
| 204 | Evidence of poor workmanship | | 0.65% | 3.7 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Moisture content of black powder.-Major Defect-A sample of one primer, prior to assembly of igniter, shall be randomly selected from each eight hours production. The black powder shall be tested as specified in 4.5.1 and any failure to comply with the applicable requirement shall be cause for rejection of the eight hours production represented by the sample.

4.4.3.2 Primer assembly functioning (see 3.5).-The primer assemblies shall be observed for evidence of the following defect (see 6.6):

TABLE II

| Defects | Classification |
|---|---|
| Body ruptures or becomes detached | Critical |
| Failure to fire | Major |
| Primer assembly hangfires (audible) | Major |
| Primer assembly squibs | Major |

4.4.3.2.1 Initial production.-Beginning with the first lot produced and continuing until three consecutive lots have met the acceptance criteria herein, 35 primer assemblies shall be selected from each lot for this test. If one or more primer assemblies fail to meet the acceptance criteria, the lot represented by the primer samples shall be rejected.

4.4.3.2.2 Subsequent production.-After three consecutive lots have met the criteria of 4.4.3.3.1, 10 primer assemblies shall be tested from each lot. If one or more primer assemblies fail to meet the acceptance criteria, the lot represented by the primer samples shall be rejected.

4.4.3.3 Check test of igniter primer, electric, M74.-If the total elapsed time between the original acceptance of a lot of Igniter, Primer, Electric, M74 and the assembly of that lot into the primers covered by this specification exceeds two years, or if the igniters have been subjected to any adverse conditions, however



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

brief, at any time since tests, the igniter lot shall be subjected to, and must satisfactorily pass, the check test specified in the applicable igniter specification (see Specification MIL-I-46521) immediately before the igniters are assembled into artillery primers. This test shall be performed by the contractor on igniters selected by the Government inspector at the facility assembling the igniters into the artillery primers (see 6.4). Examples of exposure of primers to adverse conditions are indications of corrosion products on the primer body; moisture (water) marks or stains on the exterior packaging; or cuts, scrapes, scuff marks, gouges or tears in the inner packaging, including the integrity of the barrier bag and the security of the seal.

4.4.3.4 Heat seal test of sealed bag (see dwg. 8796530).-Major Defect-Sampling and acceptance criteria for the testing of the heat seal's security shall be as prescribed by MIL-P-116 (see 4.5.4).

4.4.4 Inspection equipment.-The inspection equipment required to perform the examinations and tests prescribed herein is described in the "Paragraph Reference/Inspection Method" column in the tables starting with paragraph 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract (see 6.2 and Section 6 of MIL-A-48078).

4.5 Test methods and procedures

4.5.1 Moisture content of black powder.-The moisture content of the black powder shall be determined in accordance with the procedure specified in Specification MIL-P-223.

4.5.2 Electrical resistance.-The electrical resistance of the primer assembly shall be measured by a resistance measuring instrument connected between the igniter button and the primer body. The circuit current shall be limited to 20 milliamperes. Test equipment shall be in accordance with 4.4.4.

4.5.3 Proving ground test.-The samples to be ballistically tested shall be fired in a M135 gun. The ammunition shall be conditioned to $70^{o} \pm 2.5^{o}F$ ($21.1^{o} \pm 1.4^{o}C$) until all propellant is stabilized at a uniform temperature prior to firing, which normally requires a period of twenty-four hours, minimum. Observation shall be made for the defects listed in 4.4.3.3 both during and after fire. Muzzle velocity shall be recorded for information (see 6.7). After the firing of each test sample, observation shall be made for evidence of primer metal parts remaining in the gun tube.

4.5.3.1 Loading of samples.-The primer assembly samples shall be assembled to M123A1, 165MM cartridges in accordance with dwg. 8845042, except that inert filler shall be used for the projectile and M62A2 fuze boosted high explosive fillers, respectively.



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

4.5.4 Heat seal test of sealed bag.-The procedures for the performance of this test shall be as prescribed by MIL-P-116.

## 5. PREPARATION FOR DELIVERY

### 5.1 Preservation and packaging

5.1.1 Level B.-Packaging shall be in accordance with dwg. 8796530.

### 5.2 Packing

5.2.1 Level B.-Packing shall be in accordance with dwg. 8796531.

5.3 Marking.-Exterior containers shall be marked in accordance with drawing 8796531.

## 6. NOTES

6.1 Ordering data.-See MIL-A-48078.

6.2 Submission of designs for approval.-Submit equipment designs as required to: Commander, ARRADCOM, ATTN: DRDAR-QAR-I, Dover, New Jersey 07801 (see 6.2.3 of MIL-A-48078).

6.3 Delivery of data cards to the technical activity.-The following address is to be added to those listed in the contract (Form DD 1423) for the delivery of one copy of each Ammunition Data Card prepared by the contractor for the duration of the contract: Commander, US Army Armament Research and Development Command, ATTN: DRDAR-QAR-E, Dover, New Jersey 07801.

6.4 Cost of check tests.-The contracting officer shall arrange for the contractor to be reimbursed for the expense incurred in the performance of the check tests. The tests shall be conducted at Government expense without cost to the contractor who loaded the igniters or to the contractor assembling the igniters into the artillery primers and shall not constitute a basis for rejection against either contractor except where deterioration has occurred as a direct result of carelessness in handling, storage, etc., permitted while the igniter or artillery primer lot was under the jurisdiction of either contractor.



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

6.5 Check test for deterioration of the M73 primer.-The following tests are designed to prevent loading M73 primers which have deteriorated into a major ammunition item. The tests should be performed on each lot of M73 primers which have been stored under normal conditions for more than 2 years, or under adverse conditions for any length of time. If the specification for the ammunition item into which the M73 primers are loaded does not require that the check test be performed, the contracting officer should insert the provision for the check test in the contract.

6.5.1 Moisture content of black powder.-A sample of 25 primers shall be selected for this test. The black powder shall be removed from the primer by any suitable means. The moisture content of the powder shall be determined in accordance with the method specified in Specification MIL-P-223. If the moisture content of the powder tested exceeds 0.7 percent, the lot of primers shall be rejected. Since black powder is hygroscopic, it is advisable to place the powder in a dry, air-tight container immediately upon removal, and to run the determination as soon as possible thereafter.

6.5.2 Electrical resistance.-This test shall be performed 100 percent. Testing shall be as specified on drawing 8840278 using test equipment specified in 4.5.2. Any primer that fails to comply with the requirement specified shall be classed defective and removed from the lot.

6.5.3 Functioning.-300 primers shall be selected from each lot for this test. The igniters (Igniter, Primer, Electric, M74) shall be removed from the primers and tested as specified in Specification MIL-I-46521. If three or more igniters fail to comply with the applicable requirement the lot shall be rejected. At the option of the contractor, complete M73 primer assemblies can be tested as specified in Specification MIL-I-46521. Observation shall be made on functioning of the complete primer assembly. If three or more primers fails to comply with the applicable requirement the lot shall be rejected.

6.5.4 Non-functioning.-50 primers shall be selected from each lot for this test. The igniters (Igniter, Primer, Electric, M74) shall be removed from the primers and tested as specified in Specification MIL-I-46521. If one or more igniters fail to comply with the applicable requirement the lot shall be rejected. At the option of the contractor, complete M73 primer assemblies can be tested as specified in Specification MIL-I-46521. Observation shall be made on non-functioning of the complete primer assembly. If one or more primers fail to comply with the applicable requirement the lot shall be rejected.



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

# ARTILLERY PRIMERS
# STANDARDS FOR PAINT CONDITIONS IN FLASH HOLES

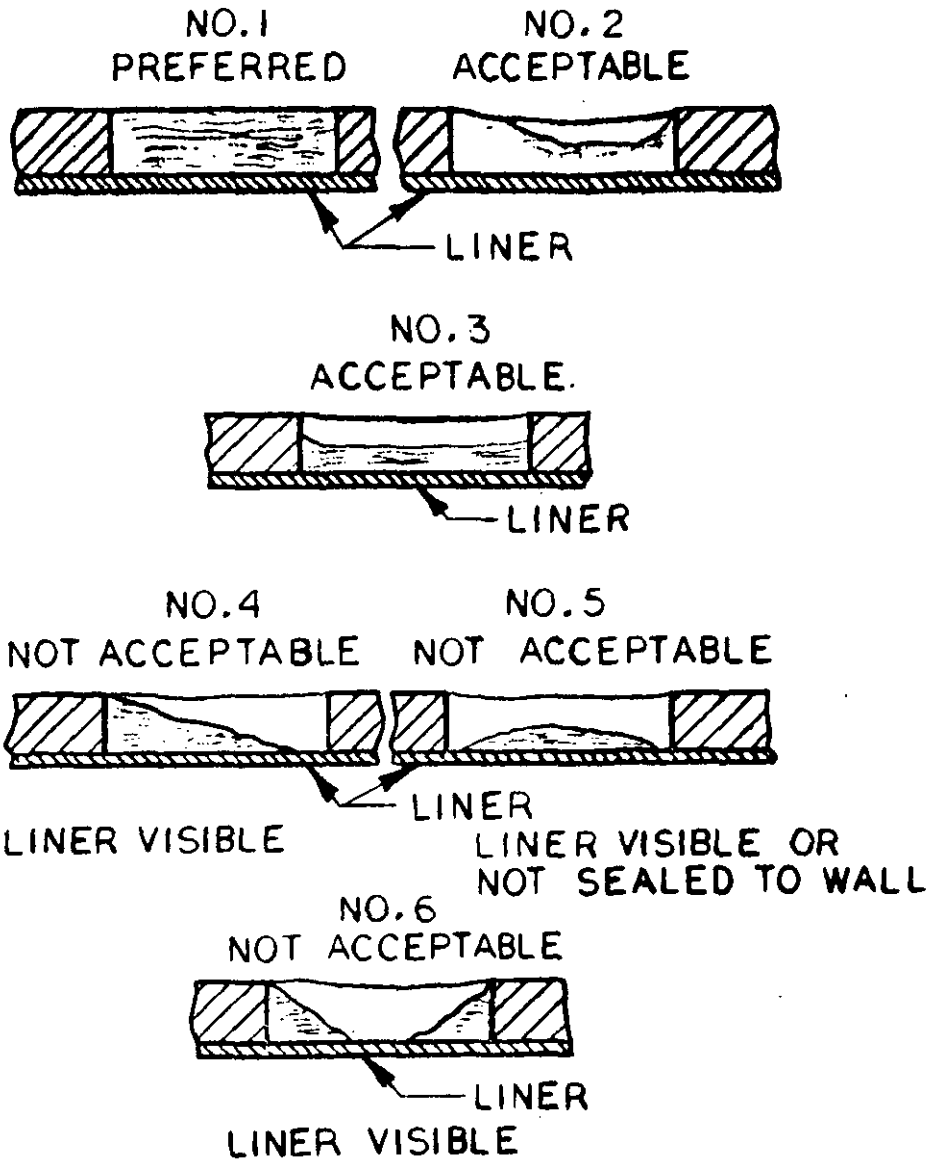



FIGURE 1



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

6.6 Definitions:

a. Hangfires - A perceptible delay occurring between the instant of application of energy and detonation.

b. Squib - A burning of the primer mixture without detonation.

6.7 Firing record information.-The ballistic test firing records shall include the serial numbers of all weapon and fire control components. Stock component lots of cartridges, warmers or spotters shall also be included. For each round fired, the record shall contain deflection, elevation, time of firing, muzzle velocity and the results of any post-firing examination of primer assemblies that had been performed. The following addresses are to be added to those listed in the Ballistic Test Request (BTR) for the distribution of firing test reports to the technical activity: Commander, US Army Armament Research and Development Command, ATTN: DRDAR-QAR-E and DRDAR-LCU-CV, Dover, New Jersey 07801.

6.8 Proving ground summary

| Phase | Sample Size | Requirements | Test Proc. Para. |
|---|---|---|---|
| First Article | 50 | | 4.5.3 |
| Initial Production | 35* | 4.4.3.2.1 | 4.5.3 |
| Production | 10 | 4.4.3.2.2 | 4.5.3 |

*For three consecutive accepted lots.

6.9 Changes from previous issue.-Due to the extensiveness of the changes, asterisks are not used in this revision to identify changes with respect to the previous issue.

Custodian:
ARMY-AR

Preparing Activity:
ARMY-AR

Project No.:1390-A214



Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID




OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

COMMANDER
US ARMY ARMAMENT RESEARCH & DEVELOPMENT COMMAND
ATTN: DRDAR-QAR
DOVER, NJ 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.

# STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A *response will be provided to the submitter, when name and address is provided, within 30 days indicating that* the 1426 was received and when any appropriate action on it will be completed.
NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-P-47519D Primer, Electric, M73 Loading, Assembling and Packing

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1 OCT 76 1426

EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T06:10Z
Check the source to verify that this is the current version before use.