INCH-POUND
MIL-DTL-32640
14 January 2020
SUPERSEDING
PD-FDBCO
10 July 2018

DETAIL SPECIFICATION

COAT, WOMAN'S: POLYESTER/WOOL, GABARDINE, BLUE, OFFICER

This specification is approved for use by the United States Marine Corps and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This document covers the requirements for a woman's blue, polyester/wool gabardine dress coat worn by female officers of the United States Marine Corps.

1.2 Classification. The coat is of one type in the following sizes and lengths, as specified (see 6.2).

1.2.1 Schedule of sizes.

Extra Short	Short	Regular	Long	Extra Long
X0	X0	X0	X0	X0
2	2	2	2	2
4	4	4	4	4
6	6	6	6	6
8	8	8	8	8
10	10	10	10	10
12	12	12	12	12
14	14	14	14	14
16	16	16	16	16
18	18	18	18	18

2. APPLICABLE DOCUMENTS

2.1 General. The documents listed in this section are specified in sections 3 and 4 of this specification. This section does not include documents cited in other sections of this specification or recommended for additional information or as examples. While every effort has been made to ensure the completeness of this list, document users are cautioned that they must meet all specified requirements of documents cited in sections 3 and 4 of this specification, whether or not they are listed.

Comments, suggestions, or questions on this document should be addressed to Marine Corps Systems Command, 2200 Lester Street, Quantico, VA 22134 ATTN: SEAL-SE-STDS or emailed to USMC_STDZ@usmc.mil. Since contact information can change, you may want to verify the currency of this address information using the ASSIST Online database at https://assist.dla.mil.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release. Distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

2.2 Government documents.

2.2.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those cited in the solicitation or contract.

COMMERCIAL ITEM DESCRIPTIONS

A-A-50067	-	Cloth, Flannel, Wool
A-A-50198	-	Thread, Gimp, Cotton, Buttonhole
A-A-50199	-	Thread, Polyester Core, Cotton or Polyester-Covered
A-A-52071	-	Tape, Textile, Cotton, General Purpose
A-A-52106	-	Cloth, Twill or Plain Weave, Polyester and Polyester Blend
A-A-55126	-	Fastener Tapes, Hook and Loop, Synthetic
A-A-59826	-	Thread, Nylon
A-A-59992	-	Cloth, Interfacings: Woven, Cotton and Synthetic
A-A-59994	-	Button, Sewing Hole, and Button, Staple, (Plastic)

DEPARTMENT OF DEFENSE SPECIFICATIONS

MIL-DTL-371	-	Braid, Textile, Tubular
MIL-B-3461	-	Button, Insignia, Metal, Uniform and Cap
MIL-DTL-3738	-	Cloth, Elastique, Wool
MIL-DTL-10176	-	Cloth, Gabardine: Wool, Polyester and Wool
MIL-DTL-15064	-	Pads, Shoulder and Sleeve-Head
MIL-C-15065	-	Coat Fronts
MIL-DTL-32075	-	Label: For Clothing, Equipage, and Tentage, (General Use)
MIL-C-44296	-	Cloth, Fusibles

DEPARTMENT OF DEFENSE STANDARDS

MIL-STD-984 - Provisions for Size Labeling for Women's Uniform Clothing

(Copies of these documents are available online at https://quicksearch.dla.mil/.)

2.2.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those cited in the solicitation or contract.

THE INSTITUTE OF HERALDRY (TIOH)

U.S. ARMY STANDARD METAL FINISH CHIP SET

(Copies of the chip set are available from The Institute of Heraldry, 9325 Gunston Road, Room S-113, Fort Belvoir, VA 22060-5579, or by emailing us.army.belvoir.hdqa.mail.tioh-webmaster@mail.mil.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

2.3 Non-Government publications. The following documents form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those cited in the solicitation or contract.

AMERICAN ASSOCIATION OF TEXTILE CHEMISTS AND COLORISTS (AATCC)

AATCC TM8	-	Colorfastness to Crocking: Crockmeter Method
AATCC TM15	-	Colorfastness to Perspiration
AATCC TM20A	-	Fiber Analysis: Quantitative
AATCC TM132	-	Colorfastness to Drycleaning
AATCC TM158	-	Dimensional Changes on Drycleaning in Perchloroethylene: Machine Method

(Copies of these documents are available online at www.aatcc.org.)

AMERICAN SOCIETY FOR QUALITY (ASQ)

ANSI/ASQ Z1.4	-	Sampling Procedures and Tables for Inspection by Attributes

(Copies of this document are available online at www.asq.org.)

ASTM INTERNATIONAL

ASTM D1777	-	Standard Test Method for Thickness of Textile Materials
ASTM D3775	-	Standard Test Method for End (Warp) and Pick (Filling) Count of Woven Fabrics
ASTM D3776/D3776M	-	Standard Test Methods for Mass Per Unit Area (Weight) of Fabric
ASTM D5034	-	Standard Test Method for Breaking Strength and Elongation of Textile Fabrics (Grab Test)
ASTM D6193	-	Standard Practice for Stitches and Seams

(Copies of these documents are available online at www.astm.org.)

2.4 Order of precedence. Unless otherwise noted herein or in the contract, in the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Inspections.

3.1.1 First article. When specified (see 6.2), a sample shall be subjected to first article inspection in accordance with 4.2.

3.1.2 Conformance. When specified (see 6.2), a sample shall be subjected to a conformance inspection in accordance with 4.3.

3.2 Recycled, recovered, environmentally preferable, or biobased materials. Recycled, recovered, environmentally preferable, or biobased materials should be used to the maximum extent possible, provided that the material meets or exceeds the operational and maintenance requirements, and promotes economically advantageous life cycle costs.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.3 Materials and components.

3.3.1 Basic material. The basic material for the coat shall be a polyester/wool gabardine cloth, 6.8 ounces per square yard, dark blue shade 2312, conforming to MIL-DTL-10176, type II, class 12 when tested as specified in 4.4.1.

3.3.1.1 Alternate basic material. As an alternate, the coat may be made from a wool elastique cloth, 16 ounces per linear yard, dark blue shade 2309, conforming to MIL-DTL-3738, type III when tested as specified in 4.4.1.

3.3.2 Lining. The material for lining the coat body, sleeves, and collar shall be an acetate lining material, twill or satin (alternate) weave, conforming to the requirements specified in table I below when tested as specified in 4.4.1.

TABLE I. Lining requirements.

Characteristic	Twill requirement	Satin requirement
Shade	Good match to basic material	
Fiber identification	Acetate	
Yarns per inch (minimum)		
Warp	120	288
Filling	68	68
Weight (minimum)	3.8 ounces per square yard	4.9 ounces per square yard
Breaking strength (minimum)		
Dry: Warp	74 pounds	83 pounds
Dry: Filling	49 pounds	117 pounds
Wet: Warp	54 pounds	54 pounds
Wet: Filling	34 pounds	77 pounds
Colorfastness to perspiration (minimum) (see 6.6)		
Color change	5	5
Staining on cotton	3.5	5
Staining on wool	4.5	5
Colorfastness to drycleaning (minimum) (see 6.6)		
Color change	4.5	5
Staining on cotton	4.5	5
Staining on wool	4.5	5
Colorfastness to crocking (minimum) (see 6.6)	4.5	4.5
Dimensional stability to drycleaning (maximum)		
Individual sample unit	±3.5%	±3.5%
Lot average	±3.0%	±3.0%

3.3.3 Inside breast pocket and stay pieces. The material for the inside breast pocket and stay pieces for the armhole and shoulder seams shall be a black polyester or polyester/cotton twill or plain weave cloth conforming to A-A-52106, class 1 when tested as specified in 4.4.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.3.4 Fusible interfacings. Fusible interfacings shall be applied in accordance with the fusible manufacturer's recommended time, temperature, and pressure settings.

3.3.4.1 Front and side panels, center back neck, and center vent. The fusible interfacing for the front and side panels, center back neck, and center vent shall be a woven twill cloth conforming to MIL-C-44296, type II, class 1, style B or a weft inserted knit cloth conforming to MIL-C-44296, type III, class 1, style B when tested as specified in 4.4.1. The color shall be black or charcoal grey.

3.3.4.2 Front facings, top ply of shoulder straps, sleeve cuffs and belt. The front facings, top ply of the shoulder straps, sleeve cuffs, and belt shall be fused with a black or charcoal grey non-woven fusible interfacing conforming to MIL-C-44296, type V or VI, class 1, style A or B or type VIII, class 1, style A when tested as specified in 4.4.1.

3.3.5 Floating chest piece. The chest piece will be constructed as depicted in figure 1 from the following materials, when tested as specified in 4.4.1: haircloth (see 3.3.5.1) for the chest piece, shoulder piece, wedge piece, and neck piece; needle punched non-woven cloth for the chest padding (see 3.3.5.2); and a polyester or polyester/cotton twill or plain weave cloth for the buttonhole stand (see 3.3.5.3).

3.3.5.1 Haircloth. The haircloth (see 6.4) for the chest piece, shoulder piece, wedge piece, and neck piece shall conform to the requirements of MIL-C-15065 when tested as specified in 4.4.1 and 4.4.1.1, except the patterns shall be in accordance with 3.6.1.

3.3.5.2 Chest piece padding. The padding for the chest piece shall be a polyester, needle punched, non-woven material conforming to the requirements specified in table II when tested as specified in 4.4.1.

TABLE II. Chest piece padding requirements.

Characteristic	Requirement
Fiber identification	100% polyester
Color	Unbleached
Construction	Needle punched non-woven
Weight (minimum)	3.4 ounces per square yard
Thickness (minimum)	
Initial	.055 inch
After 3 drycleanings and steam pressings	.065 inch
Breaking strength (minimum)	
Machine direction	20 pounds
Cross direction	40 pounds
Shrinkage after 3 drycleanings and steam pressings (maximum)	
Machine direction	4.0%
Cross direction	2.5%

3.3.5.3 Buttonhole stand. The material for the buttonhole stand shall be a black polyester or polyester/cotton twill or plain weave cloth conforming to A-A-52106, class 1 when tested as specified in 4.4.1.

3.3.6 Collar. The collar, as depicted in figure 2, will be constructed in accordance with the requirements stated in operation 8 and operations 47-48 of 3.8.

3.3.6.1 Collar tab. The material for the collar tab shall be a wool flannel material conforming to A-A-50067 when tested as specified in 4.4.1. The color shall match the shade of the basic material (see 3.3.1).

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.3.6.2 Collar buckram. The material for the collar buckram shall be a two-ply cotton buckram laminated with a starch finish and natural in color conforming to A-A-59992, type III, class 7, except that the weight range shall be 12.0 to 18.0 ounces per square yard when tested as specified in 4.4.1.

3.3.6.3 Collar interfacing. The material for the collar interfacing shall be a black polyester or polyester blend twill or plain weave cloth conforming to A-A-52106, class 1 when tested as specified in 4.4.1.

3.3.6.4 Collar closure hook and eye. The hook and eye for closing the collar shall conform to the requirements specified in figure 3 and table III when tested as specified in 4.4.1 and 4.4.1.2.

TABLE III. Collar closure hook and eye requirements.

Characteristic	Requirement
Material	Cartridge Brass 70/30 (UNS alloy C27000)
Design	Figure 3
Dimensions	Figure 3
Color/finish	TIOH chip #21, dull flat black
Coating type	Lacquer, clear, commercial grade
Coating application	Continuous, level, and adherent
	Completely coating the hook and eye
	Free from lint, dust, or other foreign inclusions
Coating tackiness	No tackiness
Openings	Completely open, free of any lacquer or black finish
Edges and surfaces	Clean and smooth
	Free from burrs and tool marks
	No sharp edges or roughness

3.3.7 Sleeve head pads. The sleeve head pads shall conform to MIL-DTL-15064, type IV when tested as specified in 4.4.1. As an option, the sleeve head may be provided on a continuous roll and cut to the required length.

3.3.8 Shoulder pads. The shoulder pads shall conform to MIL-DTL-15064, type III, class 1 when tested as specified in 4.4.1.

3.3.9 Hanger loop. The hanger loop shall be made from a cotton, tubular, flat braid, ⅛ to 3/16 inch wide, black, with a minimum breaking strength of 50 pounds conforming to MIL-DTL-371, type VIII, class 1 when tested as specified in 4.4.1.

3.3.10 Armhole shield binding. The binding for the armhole shields shall be bias cut and conform to the lining material specified in 3.3.2 when tested as specified in 4.4.1. The cut binding material shall be ¾ to 1 inch wide and the edges shall be finished to prevent unravelling.

3.3.11 Tapes.

3.3.11.1 Woven tape. The armholes shall be taped with a ¼-inch wide, plain weave, unbleached cotton tape conforming to A-A-52071, type II, class 1 when tested as specified in 4.4.1.

3.3.11.2 Fusible tape. The fusible tape used to join the left facing to the left front shall conform to MIL-C-44296, type I, class 1, style B when tested as specified in 4.4.1, except it shall be cut in the filling (cross-cut) direction. The fusible tape shall be ⅝ inch wide, black or charcoal color, with a thermoplastic polyamide resin.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.3.12 Threads. The threads used in the construction of the coat shall conform to the requirements of the thread Commercial Item Descriptions cited in table IV when tested as specified in 4.4.1. Threads shall match the shade requirements specified in table IV.

TABLE IV. Thread requirements.

Use (Seam type)	Description	Document	Ticket No. (Tex)	Ply	Shade
Seaming (301)	Cotton-covered polyester core	A-A-50199, type I	50 (36-45) for needle and bobbin	2	Good match to the shade of the basic material (see 3.3.1 and 6.7)
Seaming (401)	Cotton-covered polyester core	A-A-50199, type I	50 (36-45) for needle	2	Good match to the shade of the basic material (see 3.3.1 and 6.7)
			70 (31-35) for looper	2	
Overedging (504 and 505)	Cotton-covered polyester core	A-A-50199, type I	70 (31-35) for needle and looper	2	Good match to the shade of the basic material (see 3.3.1 and 6.7)
Raise, edge, & topstitching	Cotton-covered polyester core	A-A-50199, type I	50 (36-45) for needle and bobbin	2	Good match to the shade of the basic material (see 3.3.1 and 6.7)
Buttonholes	Nylon, twisted, soft finish	A-A-59826, type I, class A	Government letter Size B (45-46)	2 or 3	Good match to the shade of the basic material (see 3.3.1 and 6.7)
			and Size F (90-101)	3 or 4	
Buttonhole reinforcement	Cotton gimp	A-A-50198, soft or glazed finish	8 (210)		Good match to the shade of the basic material (see 3.3.1 and 6.7)
Buttons	Cotton-covered polyester core	A-A-50199, type I	30 (61-70)	2 or 3	Good match to the shade of the basic material (see 3.3.1 and 6.7)
Snap fasteners	Cotton-covered polyester core	A-A-50199, type I	50 (36-45)	2	Good match to the shade of the basic material (see 3.3.1 and 6.7)
Eyelets	Nylon, twisted, soft finish	A-A-59826, type I, class A	Government letter Size B (45-46)	2 or 3	Good match to the shade of the basic material (see 3.3.1 and 6.7)
Felling	Nylon, tailoring, twisted multiple cord, soft finish	A-A-59826, type VI	Government letter Size O (24)	2 or 3	Good match to the shade of the basic material (see 3.3.1 and 6.7)
Machine tacking armholes	Cotton-covered polyester core	A-A-50199, type I	30 (61-70)	2 or 3	Good match to the shade of the basic material (see 3.3.1 and 6.7)
Tacking (103 or Hand)	Cotton-covered polyester core	A-A-50199, type I	50 (36-45) or	2	Good match to the shade of the basic material (see 3.3.1 and 6.7)
			70 (31-35)	2	
Basting	Commercial grade cotton, cotton-covered polyester core, nylon, or monofilament synthetic				White or clear

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.3.12.1 Colorfastness. All threads, except thread used for basting, shall show colorfastness to light, perspiration, and drycleaning equal to or better than "3-4" when tested as specified in 4.4.1.

3.3.13 Buttons.

3.3.13.1 Insignia buttons. The insignia buttons shall be metal, 24-karat gold plated, conforming to the Institute of Heraldry metal chip No. 6 and to MIL-B-3461, type I, style 3, class A, subclass 1 when tested as specified in 4.4.1. The buttons for the coat front shall be 40-line, and the buttons for the shoulder straps shall be 27-line.

3.3.13.2 Sewing hole buttons for collar. The collar buttons shall be pearlescent polyester conforming to A-A-59994, type I, class 2, style 25 when tested as specified in 4.4.1. The size shall be 16-line, and the color shall be white.

3.3.13.3 Sewing hole buttons for belt. The belt button shall be melamine formaldehyde composition, glossy finish, conforming to A-A-59994, type I, class 1, style 4 when tested as specified in 4.4.1. The size shall be 22-line, and the color shall be black.

3.3.14 Hook and loop fastener tape. The hook and loop fastener tape for securing the waist shall conform to A-A-55126, type I, class 1 when tested as specified in 4.4.1. Colorfastness to laundering shall not apply. The color shall be black.

3.3.15 Labels. Each coat shall have a combination identification/instruction label, a separate size label, and a separate barcode label/tag conforming to the requirements below. As an alternate to the material specified in MIL-DTL-32075, the material for the identification/instruction label and the size label may be a 100 percent polyester-coated tape (see 6.5).

3.3.15.1 Identification/instruction label. Each coat shall have a combination identification/instruction label conforming to type VI, class 15 of MIL-DTL-32075, including the colorfastness to drycleaning requirement, when tested as specified in 4.4.1. The color of the label shall be white. The label shall bear the following inscription:

COAT, WOMAN'S: POLYESTER/WOOL, GABARDINE, BLUE, OFFICER

FIBER CONTENT: 55% Polyester/45% Wool (Example)

CONTRACT NO: SPO100-00-0-0000 (Example)

LOT NO:

NAME OF CONTRACTOR:

DRY CLEAN ONLY

TO KEEP YOUR COAT LOOKING SMART,

INSIST ON IT BEING PROPERLY PRESSED.

PRESSING INSTRUCTIONS

1. AVOID PRESSING DRY OR WITH TOO HOT AN IRON.
2. REMOVE ALL GLOSS FROM EDGES AND SEAMS BY PRESSING WITH A DAMP CLOTH.
3. CREASE ONLY THE LOWER THREE-FOURTHS OF SLEEVES.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.3.15.2 Size label. Each coat shall have a size label conforming to type VI, class 2 of MIL-DTL-32075, including the colorfastness to drycleaning requirement, when tested as specified in 4.4.1. The color of the label shall be white. The labeling system shall conform to MIL-STD-984, and the size label shall bear the following body dimensions. The height range information shall be in accordance with 3.3.15.2.1.

EXAMPLE	SIZE CODE	12R
	BUST CIRC	38"
	HIP CIRC	40½"
	HEIGHT	63½ - 67"
	NSN	8410-XX-XXX-XXXX

NOTE: The Marine Corps body measurements (bust and hip circumference) for each size label are contained in MIL-STD-984, and are not to be confused with the finished dimensions of the coat contained in 3.9 of this specification.

3.3.15.2.1 Height. The information in table V shall be cited for height, as appropriate.

TABLE V. Height information.

Height	Abbreviation	Inscription
Extra short	XS	Less than 60 inches (XS)
Short	S	60 to 63½ (S)
Regular	R	63½ to 67 (R)
Long	L	67 to 70½ (L)
Extra long	XL	More than 70½ inches (XL)

3.3.15.3 Barcode label/tag. Each item shall be individually bar-coded with a paper label/tag conforming to MIL-DTL-32075, type VIII, class 17 when tested as specified in 4.4.1. The tag shall be attached to the item by a fastener. The barcoding element shall be a 13-digit national stock number (NSN) and the appropriate 12-digit Universal Product Code (UPC) assigned to the NSN by the government. The initials “UPC” shall appear beneath the code. The bar codes for NSN and UPC shall be a medium to high density and shall be located so that they are completely visible on the item when the item is folded and/or packaged as specified herein. The label’s location shall cause no damage to the item.

3.3.16 Snap fastener. The snap fastener (socket and stud) for the belt shall conform to the requirements specified in table VI when tested as specified in 4.4.1.

TABLE VI. Snap fastener requirements.

Characteristic	Requirement
Material	Cartridge brass 70/30 (UNS alloy C27000)
Color/Finish	TIOH chip #21, dull flat or shiny black
Coating type	Lacquer, clear, commercial grade
Style	Round or square
Edge finish	Rolled edge
Size	1/0
Application	Sew-on type

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.4 Design. The coat shall be the United States Marine Corps design shown on figures 4 through 7 and conform to the requirements specified on figures 1, 2, 3 and 8. The coat is fitted and single-breasted with fully-lined sleeves and body. The front is comprised of six panels, and the back is comprised of four panels. The stand-up collar is closed by a hook and eye closure. The coat front is closed by four insignia buttons (buttonholes positioned on the right front and buttons sewn onto the left front) and a piece of hook and loop fastener tape at the waist (hook on the left front, loop on the right facing). The coat has a center vent, sleeve cuffs at the bottoms of the sleeves, and shoulder straps with insignia buttons. The belt is one piece, with a button closure at the square end (used to attach the buckle, not included in this document) and a belt keeper loop. A belt loop is positioned at the waist on each side seam. An inside pocket is positioned in the right facing/lining seam below the loop fastener tape. Five sewing hole buttons are attached inside the collar to allow attachment of a removable white collar (commercial item).

3.5 Figures. When inconsistencies exist between the written document and the figures, the written document shall govern. The floating chest piece (see 3.3.5) shall conform to the construction specified on figure 1. The collar (see 3.3.6) shall conform to the construction specified on figure 2. The collar closure hook and eye (see 3.3.6.4) shall conform to the requirements specified on figure 3. The belt shall conform to the requirements specified on figure 8. All other figures are furnished for information purposes only.

3.6 Patterns. Standard patterns will be furnished by the Government as specified (see 6.2). Government patterns show size, seam allowances, and directional lines for cutting and are marked or notched for proper placement and assembly of component parts. The directional lines indicate the warp direction of the cloth unless otherwise indicated on the patterns. The list of pattern parts and computer nomenclature in 3.6.1 is provided to ensure that the pattern set provided is complete. The Government patterns shall not be altered in any way and shall only be used for cutting the contractor's working patterns. The working patterns shall be identical to the Government patterns, except that additional notching, if needed to facilitate manufacture, for use during construction is permitted on the working patterns. Minor modifications are permitted where necessary to accommodate the manufacturer's processes and the use of automated equipment, provided the modifications do not alter the dimensional, serviceability, or appearance requirements cited in the document or those governed by the Government pattern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.6.1 Pattern parts. Component parts shall be cut from the specified materials in accordance with the number of parts specified in table VII. Requirements for cutting component parts that are not included in table VII are included in 3.8.

TABLE VII. Pattern parts.

Material	Nomenclature	Pattern abbreviation	Cut Parts
Basic material (3.3.1)	Right front 1/	32640-RIGHT_FRONT	1
	Left front 1/	32640-LEFT_FRONT	1
	Side front	32640-SIDE_FRONT	2
	Side front dart	32640-SD_FRT_DART	2
	Side back	32640-SIDE_BACK	2
	Center back	32640-CENTER_BACK	2
	Right front facing 1/	32640-RGT_FRT_FAC	1
	Left front facing 1/	32640-LFT_FRT_FAC	1
	Top sleeve	32640-TOP_SLV	2
	Under sleeve	32640-UND_SLV	2
	Outer collar	32640-OUTER_COLLAR	1
	Armhole shield	32640-ARMHOL_SHLD	2
	Shoulder strap top	32640-SHLDR_STRP-TOP	2
	Shoulder strap bottom	32640-SHLDR_STRP-BOT	2
	Sleeve cuff	32640-SLV_CUFF	2
	Belt	32640-BELT	1
Lining (3.3.2)	Front lining	32640-FRNT_LINING	2
	Right back lining	32640-RGT_BCK_LIN	1
	Left back lining	32640-LFT_BCK_LIN	1
	Side back lining	32640-SID_BCK_LIN	2
	Top sleeve lining	32640-TOP_SLV_LIN	2
	Under sleeve lining	32640-UND_SLV_LIN	2
	Collar lining	32640-COLLAR_LIN	1
Pocketing (3.3.3)	Inside pocket	32640-INSIDE_POCKET	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VII. Pattern parts – Continued.

Material	Nomenclature	Pattern Abbreviation	Cut Parts
Fusible interfacing (front and side panels, center back neck, and center vent): Woven or weft knit (3.3.4.1)	Right front fusing	32640-RGT_FRT_FUS	1
	Left front fusing	32640-LFT_FRT_FUS	1
	Side front fusing	32640-SD_FRT_FUS	2
	Side front dart fusing	32640-SD_FR_DRT_FU	2
	Center back neck fusing	32640-CTR_BK_NKFUS	2
	Center vent fusing	32640-CNT_VENT_FUS	2
Fusible interfacing (front facings, top shoulder straps, belt and sleeve cuffs: Non-woven (3.3.4.2)	Right front facing fusing	32640-RT_FR_FC_FS	1
	Left front facing fusing	32640-LF_FR_FC_FS	1
	Shoulder strap top fusing	32640-SHD_STR_TOP_FS	2
	Belt fusing	32640-BELT_FUS	1
	Sleeve cuff fusing	32640-SLV_CUFF_FUS	2
Collar tab (3.3.6.1)	Collar tab	32640-COLLAR_TAB	1
Collar buckram (3.3.6.2)	Collar buckram	32640-COLLAR_BUCKRAM	1
Collar interfacing (3.3.6.3)	Collar interfacing	32640-COLLAR_INTRL	1
Floating chest piece/ haircloth (3.3.5.1)	Chest piece	32640-CHEST_PIECE	2
	Shoulder piece	32640-SHLDR_PIECE	2
	Wedge piece	32640-WEDGE_PIECE	2
	Neck piece	32640-NECK_PIECE	2
Floating chest piece/ chest piece padding (3.3.5.2)	Chest padding	32640-CHEST_PADDING	2
Floating chest piece/ buttonhole stand (3.3.5.3)	Buttonhole stand	32640-BUTTON_STAND	2
Templates	Left vent marker	32640-LFT_VNT_MRKR	--
	Side seam belt loop marker	32640-BELTLOOP_MRKR	--
	Shoulder strap placement marker	32640-SHLDR_STR_MRKR	--
	Shoulder strap finished shaper	32640-SH_STR_FIN_SH	--
	Sleeve cuff shaper	32640-SLV_CUFF_SHPR	--

FOOTNOTE:

1/ As an option, the fronts and facings may be cut as pairs. When cut as a pair, the manufacturer shall dress the right side.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.7 Construction.

3.7.1 Stitches, seams, and stitching. Stitch, seam, and stitching types shall conform to the requirements of ASTM D6193. Whenever two or more methods for seam or stitch types are specified for the same part of the operation, any one of the specified methods may be used. Seam allowances shall be maintained with seams uniformly sewn so that no raw edges, runoffs, twists, pleats, puckers, gathers, other distortions, or open seams result. All seams shall start and finish evenly. Joined components shall lie smooth and flat. Thread tension shall be maintained so that there is no tight, loose, or unbalanced stitching. Where stitch type 401 or 101 is used, the loops of the chain shall be on the inside of the coat. Edge stitching shall be 1/16 to 1/8 inch from the edge. During the overedge operations, the knife shall be set to trim the loose threads and raveled edge without cutting the material. Buttonholes shall be clean cut and the stitching shall be securely caught in the fabric. Gimp shall be pulled to the underside. Use of additional basting to facilitate manufacturing is acceptable provided the basting thread does not show on the outside of the finished item.

3.7.1.1 Thread sizes for stitches, seams, and stitching. The thread sizes used for the stitch type and seam type requirements of 3.8 shall be in accordance with the requirements listed in 3.3.12.

3.7.1.2 Stitches per inch. The minimum and maximum number of stitches per inch shall be as specified in 3.8.

3.7.1.3 Thread uniformity, thread breaks, and ends of seams. The shade of the black thread visible on the outside of the coat shall be consistent; multiple shades of thread on the outside of the coat are not allowed. The ends of seams and stitching produced with 301 stitch type, when not caught in another line of stitching, shall be backstitched not less than ¼ inch. The ends of a continuous line of stitching (except the label) shall be overlapped not less than ½ inch. The ends of the label stitching shall be overlapped not less than 3 stitches. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than ½ inch. Skipped stitches or thread breaks (401 stitch type) shall be repaired by using 301 stitch type.

3.8 Manufacturing operations requirements. The coat shall be made in accordance with all operation requirements specified in table VIII. The contractor is not required to follow the sequence of operations specified provided the finished coat meets the finished form, fit, and function requirements as those produced by following the sequence of operations specified in table VIII. All pressing operations referenced in table VIII shall be performed by using a heated pressing iron or steam pressing machine commercially intended for tailored coats. A left and right chest press, designed specifically for finish pressing, is required. Any additional underpressing to facilitate manufacture is permissible.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations.

Operation	Stitch type	Seam type	Stitches per inch
1. CUT AND SHADE MARK.			
a. Cut the component parts (listed in 3.6.1) as indicated on the patterns and in the material specified. Unless otherwise specified on the pattern, the directional line is with the warp direction of the cloth. Additional cutting requirements are provided below for those components not controlled by a furnished pattern piece.			
b. Cut all basic material parts (see 3.3.1 or 3.3.1.1) of the coat from one piece of basic material, except the belt loops, armhole shields, and front facings, which may be cut from ends. The belt loops are cut 1 inch wide and of sufficient length to comply with operations 4 and 22. Parts cut from ends are a good match to the main assembly. When the armhole shields are cut from ends, the shields match each other.			
c. Cut the lining (see 3.3.2) for the coat body (fronts, sides, and backs) and collar from one piece of lining material. All other lining components may be cut from ends. All sleeve lining parts (two top and two under) match in shade.			
d. Cut the two armhole and two shoulder stay pieces (see 3.3.3) on the bias, ⅝ to ¾ inch wide and 4±¼ inches long.			
e. Cut the fusible interfacings (see 3.3.4.1 and 3.3.4.2) in accordance with the directional lines on the patterns.			
f. Cut the braid for the hanger loop (see 3.3.9) of sufficient length to comply with the finished length (operation 37).			
g. Cut the binding for the armhole shields from the bias binding (see 3.3.10), ¾ to 1 inch wide.			
h. Dress the left vent in accordance with the left vent marker.			
i. The component parts of the coat and lining cut from one piece of basic material and lining material, respectively, and the sleeve linings cut from ends, are marked or ticketed to ensure a uniform shade and size throughout the garment. The numbering does not show on the outside of the garment or on the lining and, whenever possible, is covered by the seam allowance. The use of an ink pad numbering machine, rubber stamp, or pencil is allowed. The following methods are not allowed: corrosive metal fastening devices, sew-on shade tickets, and adhesive type tickets that discolor or adhere to the material upon removal of the tickets.			
2. REPLACE DEFECTIVE OR DAMAGED PARTS.			
a. During cutting, replace all parts containing defects such as a hole, cut, tear, smash, mend, burn, scorched area, open place, loose yarn, snagged thread, area of no dye penetration, dye streak, missing yarn, broken yarn, thin place, shade bar, or woven-in waste.			
b. During the manufacturing process, replace all parts damaged by needle chews, scissor or knife cuts, tears, holes, mends, or burns.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
3. APPLY FUSIBLE INTERFACING.			
a. Position the fusible onto the related component part (see table VII for listing) set back ⅛ inch from edges, and fuse together in accordance with the fusible manufacturer's recommendations for time, temperature and pressure.			
b. The fused lots are cool to the touch prior to tying into bundles.			
4. MAKE BELT LOOPS AND BELT KEEPER.			
a. Finished appearance: The belt loops and keeper finish ½±⅛ inch wide and finish smooth and flat.			
b. Fold the sides of the strip lengthwise towards the center, abutting the raw edges together with a covering stitch. Each row of stitching is uniformly ⅛ inch from the folded edge.	406	EFh-1	10-14
c. Cut each loop for the left and right side 3½±⅛ inches long.			
d. Cut the keeper 4½ inches long. Fold the keeper in half, end to end, and join the ends with a bartack or row of stitching across the width of the keeper. Turn to finished position, with the joining seam on the underside positioned in the middle of the keeper. The finished keeper measures 2⅛ to 2¼ inches long from folded end to folded end.	Bartack or 301	SSa-1	28 per bartack or 10-14
5. MAKE SHOULDER STRAPS.			
a. Finished appearance: Each shoulder strap finishes smooth and flat, and is in accordance with the shoulder strap finished shaper. The pair of shoulder straps are uniform in appearance.			
b. The shoulder strap consists of two plies of basic material. The top ply is interfaced with fusible.			
c. Stitch the two plies of the shoulder strap together with a ¼-inch seam.	301	SSe-2(a)	10-14
d. Trim the points and turn the shoulder strap, working the seams out to the edges. Topstitch the shoulder strap uniformly ⅛ inch from the edge through all plies.	301	SSe-2(b)	10-14
e. Make a horizontal, eyelet-end, square bar type buttonhole, cut ¾ inch long to fit a 27-line insignia button, in each strap midway between the back and front edges and with the inside edge of the eyelet placed to ensure that, in the finished coat, the end of the shoulder strap finishes ¼ to ⅜ inch from the edge of the collar. The purling finishes on the outside of the strap. The buttonhole is clean cut, well made through all plies of material, and worked over gimp. The gimp is pulled through to the underside of the buttonhole.			
f. Press the shoulder strap smooth and flat with a heated pressing iron or pressing machine.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
6. MAKE ONE PIECE BELT (see figure 8).			
a. Finished appearance: The belt finishes smooth and flat, without twists, pleats, puckers, or raw edges. The pointed end of the belt is well-formed.			
b. The belt is made of one piece of basic material, fully interfaced with fusible.			
c. Fold the piece in half lengthwise, forming two plies. Join the two plies together with a ⅜-inch seam.	301	SSa-1	10-14
d. Spread the seam open and press the belt smooth and flat with a heated pressing iron, matching the pointed end of the belt.			
e. Close the pointed end of the belt with a ¼-inch seam along the slanted edges.	301	SSe-2(a)	10-14
f. Evenly trim the pointed end of the belt for turning. Turn the belt through the open end, completely working out the point.			
g. Topstitch the belt uniformly ⅛ inch from the top and bottom folded edges and the seamed end, turning in the square end of the belt ¼ inch and catching the turned-in portion in the stitching. The seam of the belt finishes off center.	301	OSf-1 (top and bottom edges); SSe-2(b) pointed end; and SSc-1 (square end)	
h. Or, as an alternate, the square end of the belt may be overedged.	504 or 505	EFd-1	8-10
i. The finished width of the belt finishes 1¾+1/16, -⅛ inches. The finished length of the belt for each size coat is shown in table IX.			
j. Make a horizontal eyelet end, taper-bar type buttonhole, cut ⅝ inch long, in the center of the belt. The inside edge of the eyelet end is ½ to ⅝ inch from the buckle end of the belt. The buttonhole is worked over gimp to fit a 22-line sewing hole button. The purling of the buttonhole finishes on the outside of the belt. The buttonhole is clean-cut and well made. The end of the buttonhole is securely tacked.	Buttonhole		60 per buttonhole including tack
k. Mark the location for sewing one 22-line sewing hole button to the underside of the belt.			
l. Securely sew the 22-line button at the mark on the belt to properly engage the buttonhole in the square end. On the finished belt, the button finishes 3⅝±⅛ inches from the square end of the belt. The button is sewn to the belt with the end of the stitching securely tacked.	Hand		6 per button (double thread)
m. Place the belt keeper on the belt at the square end and secure by buttoning the end. Press the belt smooth and flat with a heated pressing iron or pressing machine. The end of the keeper is spread open and pressed flat on the underside at the center of the belt.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
7. ATTACH SNAP FASTENER.			
a. Finished appearance: The snap fastener is securely attached to the belt. The stitching does not show on outside of the belt.			
b. Sew the socket part of the snap fastener to the inside pointed end of the belt ½ to ⅝ inch from the point.	101 or	21 per fastener	
	301 or	21 per fastener	
	Hand	3-4 (double thread)	
c. Snap the stud part of the snap fastener onto the socket part.			
8. ASSEMBLE COLLAR (see figure 2).			
a. Finished appearance: The completed collar finishes smooth and flat without distortion. The edges are uniformly even. The edge stitching is uniform.			
b. The collar is made of one ply each of basic material (3.3.1), collar interfacing (polyester or polyester/cotton twill or plain weave, 3.3.6.3), collar buckram (cotton buckram, 3.3.6.2), and lining (3.3.2).			
c. Seam the collar interfacing and collar buckram together ⅛ to ¼ inch from all edges and trim interfacing even with the edges of the buckram.	301	SSa-1	10-14
d. Lap the upper edge of the interfacing approximately ½ inch on the outside edge of the collar outer ply and seam together ¼ inch from the raw edge of the interfacing. The outer ply extends not less than 1 inch at each end of the collar interfacing.	301	LSa-1	10-14
e. Smoothly fold the outer ply over the upper and lower edges of the interfacing. Tack the portion of the outer ply folded to the inside at the lower edge of the interfacing. The stitching is not through to the outer ply of the collar.	Hand		2-3
f. Fold the ends of the outer ply to the inside ends of the interfacing and tack to the interfacing with overcast stitching, turning under the upper and lower edges sufficiently so as not to be visible in the finished collar.	Hand		2-3
g. Lap approximately ½ inch of the top inside edge of the collar on the raw top edge of the collar lining with the lining face up. Stitch the collar uniformly ⅛ inch on both front and top edges, catching the collar lining in the stitching at the upper edge. The lining extends a minimum of 1 inch beyond each end of the collar.	301	LSa-1 (top edge) and OSf-1 (ends)	10-14
h. Turn the collar lining at the seam to the inside of the collar and press smooth and flat with a heated pressing iron or pressing machine.			
i. Make one eyelet through all plies at each end of the collar midway between the top and bottom edges and 1¾±⅛ inches from the finished ends. The eyelet finishes with the purling on the outside of the collar and finishes with a ⅛-inch diameter opening.	Eyelet		20 per eyelet (minimum)

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
9. ASSEMBLE SLEEVES AND SLEEVE CUFFS.			
a. Finished appearance of forearm and backarm seams: The seams finish smooth and flat without twists, gathers, puckers, or pleats and start and finish evenly.			
b. Finished appearance of sleeve cuffs: The upper curved and pointed edge of the sleeve cuff are formed and creased in accordance with the sleeve cuff marker and are uniformly stitched to the sleeve.			
c. Position the top and under sleeves with the notches matching and join at the forearm with a ⅜-inch seam.	301	SSa-1	10-14
d. Spread the seam open and press flat with a heated pressing iron.			
e. Fold the sleeve cuff lengthwise at the point with the wrong side out. Tack the point ⅛ inch from the raw edges. Turn the sleeve cuff, completely working out the point.	301	SSa-1	10-14
f. Turn under the upper edge of the sleeve cuff, forming the finished curved edge in accordance with the shape of the pattern. Press smooth and flat with a heated pressing iron or pressing machine, creasing the upper edge of cuff. The cuff may be basted instead of pressed.	101		4-6
g. Mark the sleeve in accordance with the pattern for positioning the sleeve cuffs, with the notch matching the forearm seam line and with the lower raw edge of the sleeve and marker even.			
h. Position the sleeve cuff at the mark on the sleeve and seam uniformly ⅛ inch from the upper edge of cuff.	301	LSd-1	10-14
i. Join the top and under sleeve at the backarm with a ⅜-inch seam, catching the ends of the sleeve cuff in the seam.	301	SSa-1	10-14
j. Spread the sleeve and sleeve cuff seam open and press smooth and flat with a heated pressing iron. Trim ends of cuff if necessary.			
k. Turn the sleeve cuff outlet to the inside, in accordance with notches, against the bottom end of the sleeve and baste along the turned edge of the sleeve cuff.	Hand or 301		4-6
l. Tack the raw edge of the sleeve cuff to the body of the sleeve with blind stitching. Press the bottom edge smooth and flat with a heated pressing iron.	103	SSm-1	4-6
m. On the finished coat, the height of the cuff, when measured from the folded bottom edge of the cuff, is 2¾±¼ inches at the forearm and backarm seams and 4¾±¼ inches at the point.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
10. MAKE SLEEVE LININGS AND ASSEMBLE SLEEVES.			
a. Finished appearance: The sleeve lining is properly positioned and finishes smooth and flat without twists, pleats, puckers, or gathers. The seams start and finish evenly.			
b. Position the top and under sleeve linings in accordance with notches on pattern and join at the forearm and backarm, respectively, with a ⅜-inch seam.	301 or 401	SSa-1	10-14
c. Position the sleeve lining on the sleeve with the upper edge of the lining extending ¾ to 1 inch beyond the armhole edge of the sleeve.			
d. Tack the forearm seam and backarm seam of the sleeve lining to the forearm seam and back arm seam respectively. The backarm seam tacking extends from approximately the midpoint of the backarm seam to not more than 6 inches above the creased bottom edge. The forearm seam tacking extends for a distance of 1½ to 2 inches below the bottom left open forearm seam notch.	301	SSa-1	6-8
e. As an alternate to 10.b - d, when using a sleeve lining felling machine:			
(1) Join the backarm seam and forearm seam of the sleeve lining. The distance between the notches on the forearm are left open.	301 or 401	SSa-1	10-14
(2) Position the sleeve lining top notches to the top of forearm sleeve seam and top of the backarm sleeve seam.			
(3) Tack the forearm seam and backarm seam of the sleeve lining to the forearm seam and backarm seam, respectively. The backarm seam tacking extends from approximately the midpoint of the backarm seam to not more than 6 inches above the creased bottom edge. The forearm seam tacking extends for a distance of 1½ to 2 inches below the bottom left open forearm seam notch.	Hand or 301	SSa-1	2-3 4-8
f. Pull the sleeve through the sleeve lining.			
11. FELL TURN-UP OF SLEEVE LININGS AND PRESS SLEEVES.			
a. Finished appearance: The sleeve lining is not short, tight, or twisted at the bottom of sleeves.			
b. Turn under the bottom edge of the sleeve lining to finish approximately 1 inch above the finished end of the sleeve. Fell the folded edge of sleeve lining to the turn-up of the cuff with blind stitching.	301 or Hand	EFc-1	6-8 8-10
c. As an option, the bottom edge of the sleeve may be basted to the turn-up prior to felling (operation 11.b).			
d. Turn the sleeves and assemble in pairs. The lower half of the sleeve may be pressed smooth and flat, creasing at the backarm and forearm. The backarm crease is on the backarm seam.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
12. FOLD AND STITCH LOWER FRONT DARTS IN FRONT LININGS.			
a. Finished appearance: The dart finishes without gathers, puckers, or pleats. The dart is tapered to a point at the upper end.			
b. Sew the lower front dart with a ⅜-inch seam, tapering the dart to a point at the upper end, and securely backtack.	301 or 401	SSa-1	10-14
c. Overedge each edge of the lower dart, tapering off not more than 1 inch from the inner end.	504 or 505	Efd-1	8-10
d. As an alternate to operations b and c, the dart may be stitched and overedged together in one operation. The thread chains are run off a minimum of 1 inch at the top of the dart.	515, 516, 517, 518, or 519	SSa-2	10-14
13. ASSEMBLE LININGS.			
a. Matching the notches, join the right and left back linings along the center back seam with a ⅜-inch seam, stopping at the top of the vent; join the side back linings to the right and left back linings with a ⅜-inch seam; and join the front linings to the back assembly at each side seam with a ¾-inch seam.	301	SSa-1	10-14
b. Press the side and side back joining seam open and flat. Press the lower front dart towards the side.			
c. Fold the back lining at the center back seam to form a ½-inch wide pleat at the center back. The folded edge of the pleat faces the left side of coat (as worn). As an option, the pleat may be stitched across the top of the pleat at the neckline.			
d. Press the pleat smooth and flat from the neckline to the vent area with a heated pressing iron.			
14. ASSEMBLE INSIDE POCKET.			
a. Finished appearance: The pocket is uniformly stitched and finishes smooth and flat without causing any distortion.			
b. The pocket is made of 2 plies of polyester or polyester twill or plain weave material (see 3.3.3).			
c. Position both plies of the pocketing face-to-face with the notches matching and stitch together from the top notch across the top, back, and bottom and up the front to the bottom notch with a ⅜-inch seam, leaving a 4½-inch pocket opening.	301	SSa-1	10-14
d. Attach the pocket to the right front facing and the right front lining in accordance with the notches with a ⅜-inch seam, leaving a 4½±⅛ inch pocket opening. In the finished coat, the pocket opening begins ½ inch below the bottom edge of the loop tape.	301	SSa-1	10-14
e. Raise stitch the pocket material onto the facing and lining with a 1/16-inch topstitch.	301	SSc-1	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
15. ATTACH FRONT FACINGS TO LININGS AND SEW ON LABEL.			
a. Finished appearance: The lining finishes smooth and flat along the facing/lining joining seam without creases, bulges, overlapping of excess material, or other defect or distortion.			
b. Position the lining on the facing, with the notches matching, and seam the front edge of the lining to the back edge of the facing ⅜ inch from the edge. The stitching extends from the top (shoulder) edge of the facing to the top of the pocket, and from the bottom of the pocket to the bottom notch of the facing approximately 1¼ inches from the bottom edge, excluding the pocket opening.	301 or 401	SSa-1	10-14
c. Press the facing/lining joining seam with the seam allowance toward the side.			
d. Sew the identification/instruction label to the left front lining with a single row of stitching 1/16 inch from each edge of the label. The label is positioned horizontally with one end adjacent to the facing/lining seam and the lower edge of the label approximately 3 inches above the bottom edge of the finished coat.	301	LSbj-1	10-14
16. MAKE ARMHOLE SHIELDS.			
a. Finished appearance: The armhole shields finish without puckers, gathers, or raw edges. The basic material and both edges of the binding are securely caught in the binding stitching.			
b. Bind the rounded edge of armhole shield with bias binding (3.3.10), turning under the outer or both raw edges of the binding, and catching the turned under portion(s) in the stitching, 1/16 inch from folded edge(s).	301	BSc-1 or BSb-1	10-14
17. JOIN BACKS.			
a. Finished appearance: The side and center back are joined without gathers, puckers, or pleats. The folded edge of the left vent is in vertical alignment with the center back seam. The left center back overlaps the right center back not less than 2¾ inches when measured at the bottom edge of the coat.			
b. Position the center back edges even and join with a ⅝-inch seam from the top edge of the backs to approximately ¾ inch below the top end of the vent. From that point, continue to stitch diagonally across the top end of the vent, stopping ⅜ inch from the end.	301	SSa-1	10-14
c. Turn the left vent to the inside of the left center back in accordance with the notches and edge stitch ⅛ inch from the folded edge. The folded edge of the vent is in line with the center back seam line.	301	OSf-1	10-14
d. Join the left and right side backs to the respective center backs with a ⅜-inch seam.	301	SSa-1	10-14
e. Press the side and center back seams open and flat with a heated pressing iron or pressing machine.			
f. Notch the top end of the right vent diagonally from the juncture point of the vent and center seam allowance of the right center back to 1/16 inch from the center back seam. The notch does not extend to the seam.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
18. TOPSTITCH TOP END OF VENT.			
a. Finished appearance: The edge of the right side of the vent extends beyond the center seam allowance of the left back part.			
b. Stitch and backstitch across the top end of the vent through all plies from the back center seam to the edge of the vent for a distance of 1 inch.	301	SSa-1	10-14
19. SEAM REINFORCEMENT STAYS TO FRONT ARMHOLES AND SHOULDERS.			
a. Finished appearance: The reinforcement stay pieces are sewn to the armhole and shoulder edge of the front without gathers, puckers, or pleats.			
b. Seam the ⅝- to ¾-inch wide stay pieces (operation 1.d) to the underside of the front along the shoulder edge and upper front edge of the armhole, ⅛ inch from the outer edges. The top end of the armhole stay and the lower edge of the shoulder stay form a right angle at the armhole without the stays overlapping each other.	301	SSaa-1	10-14
20. ASSEMBLE FRONT PANELS.			
a. Finished appearance: Each front consists of a front panel, a side front panel, and a side front dart panel. The panels are joined without gathers, puckers, or pleats.			
b. With notches matching, position the front panel and side front panel together with the edges even and join with a ⅜-inch seam. With the notches matching, position that assembly to the side front dart panel with the edges even and join with a ⅜-inch seam.	301	SSa-1	10-14
c. Spread all the seams open and press flat with a heated pressing iron.			
d. Press and shape the fronts on a heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest without distortion to the fronts or armholes. Maintain the contour of the seams without stretching the seam.			
21. JOIN BACK AND FRONT AT SIDES AND TAPE ARMHOLE.			
a. Finished appearance: The back and fronts are carefully joined at the sides without twists, gathers, puckers, or pleats.			
b. Position the back and fronts with the edges even and join at the sides with a ¾-inch seam.	301	SSa-1	10-14
c. Spread the side seams open and press flat with a heated pressing iron.			
d. Attach the ¼-inch wide woven tape to the inside of the coat at the lower edge of the armhole, starting approximately 2 inches above the notch in the fronts and continue to the side seam. Cut the tape and continue stitching along the bottom and back edge to lower notch. Holding the tape taut, continue to stitch the tape to the back armhole to ¾ inch from the shoulder.	301	SSaa-1	10-14
e. Press the armhole tape and the shoulder area smooth and flat with a heated pressing iron or pressing machine.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
22. ATTACH BELT LOOPS TO SIDE SEAM.			
a. Finished appearance: The belt loops finish aligned with each side seam and measure 2+⅛, -0 inches long from the top to bottom folded edges.			
b. Position the bottom end of a belt loop on each side seam in accordance with the side seam belt loop marker and secure the inside bottom of the loop with a ⅜-inch wide bartack, centered over the loop. Fold the belt loop up to the finished position on the side seam and turn under the top raw edge. Bartack the top of the belt loop to the coat ⅛ inch from the folded edge, catching the turned-under portion of the loop in the stitching with the bartack centered over the loop.	Bartack	-	20 per bartack (minimum)
23. SHAPE FRONTS.			
a. Mark the fronts 1⅛ inches from the bottom edge of the coat and trim excess material at the front and back, when necessary. The right front overlaps the left front 3¾±⅛ inches and the left front does not extend below the bottom edge of the right front at the bottom edge.			
24. ATTACH FLOATING CHEST PIECE.			
a. Position the floating chest piece assembly on the underside of the front with the haircloth facing the fused interfacing, aligning the outer edges and neckline. The padding is placed so that it will not be caught in the shoulder seaming of the coat. Baste through the front and floating chest piece assembly, allowing room for placement of the shoulder pad. A jump basting machine may be used. Keep the assembly slightly full in order to support the form and shape of the fronts.	101or 301 or Hand	Hopper	Variable
b. Trim excess from the front edge and trim the shoulder in excess of ¾ inch.			
25. BASTE AND JOIN FACING-LINING ASSEMBLIES TO FRONTS.			
a. Position the cross-cut fusible tape (3.3.11.2) on the inside of the top and front edge, from the collar notch to 1 inch above the bottom edge of the coat, and fuse in place in accordance with the manufacturer's recommendations for time, temperature, and pressure.			
b. Position the facing-lining assembly on the outside of the front. Baste along the front and continue basting along the bottom edge. The facing is held slightly taut across the bottom edge of the front while basting.	301	Hopper	Variable
c. Join the facing to the front 3/16 inch from the top and front edge of the coat, stitching thru the fusible tape.	301	SSa-1	10-14
d. Clip the depth of the collar notch to the seam line.			
e. Remove the basting from the facing and notch at the collar terminal. Trim upper front corner of the facings.			
f. Spread the seam joining the facing to the front from the collar notch to the bottom edge of the coat and press smooth and flat with a heated pressing iron. The corner is worked out.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
26. BASTE FRONTS – 1ST TIME.			
a. Turn the facing-lining assembly to the inside of the fronts, completely working out the corners. Turn up the bottom of the coat, lapping the back edge of the facing on the ends of the bottom turn up and working the front corners out completely.			
b. Baste along the front edge, working the seam to the edge of the coat. The basting extends from the collar notch to the finished bottom edge of the coat.	101 or Hand	SSm-1	4-6
27. BASTE FRONTS – 2ND TIME.			
a. Baste the facings to the fronts approximately 1½ inches from the top, front, and bottom edge of coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing while basting.	301 or Hand	Hopper	Variable
b. Notch at the collar terminal. Turn under and baste the top edge of the right facing to the front from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	301 or Hand	Hopper	Variable
c. Baste the facings to the fronts starting approximately 3 inches down from the shoulder edge of the facing and as close as possible to the facing-lining seam, placing the fullness over the chest. Continue to baste the facing along the inner folded edge of the binding from the bottom end of the facing-lining to the mark at the lower edge of facing, properly distributing the fullness in the facing. Turn up the bottom edge of the facing at the mark and baste along the folded edge.	301 or Hand	Hopper	Variable
28. FELL FACINGS TO FRONTS AND TACK TO INTERFACING.			
a. Fell the facing to the right and left chest pieces. The felling stitching does not show through to the outside of the coat.	301 or	BSa-1	6-8
	306		6-8
b. Tack the right and left facing-lining seam allowance to the respective front interfacing.	Hand or	SSm-1	2-4
	103 or		4-6
	306		4-6
29. BLINDSTITCH BOTTOM TURNUP.			
a. Blindstitch the bottom turnup.	103 or 306 or hand	EFl-1	4-6
30. JOIN LINING TO VENT.			
a. Position the right and left back lining on the respective right and left vent openings, face to face, with the notch of the lining even with the top of the vent and joining each side respectively with a ⅜-inch seam to ¾ inch above the bottom turnup.	301	SSe-2(a)	10-14
b. The left vent corner is finished with a mitre corner (do not cut the corner).	Hand or machine	-	4-6
c. Edgestitch the right vent with a ⅛-inch seam from the folded edge of the vent ensuring the lining is not exposed on the outside.	301	SSe-2(b)	4-6

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
31. FIT, BASTE AND TRIM BODY LINING TO COAT.			
a. Fold the front lining at the shoulder in accordance with the notches, forming the chest pleat, and baste the entire length of the pleat. Continue to baste from the lower edge of armhole, along the side seam and across the bottom edge of lining. The folded edge of the chest pleat on the outside of the lining faces the armhole.	301 or Hand	Hopper	Variable
b. Left side of the coat: From the side seam of the lining at the waist, baste across the back lining to the center vent. Fold the lining up from the bottom and continue basting the lining approximately ½ inch from the bottom edge of coat.	301 or hand	Hopper	Variable
c. Right side of the coat: From the side seam of the lining at the waist, baste across the back lining to the top of the vent. Fold the lining up from the bottom and continue basting the lining approximately ½ inch from the bottom edge of the coat.	301 or hand	Hopper	Variable
d. Baste the center pleat from the top of the vent with a zero pleat, tapering up to the matched notches at the neckline, adding fullness to approximately 2 inches from the neck. The folded edge of the pleat on the outside of lining is toward the left side.	301 or hand	Hopper	Variable
e. Baste the back lining along the lower edge of the armhole approximately 2 inches from the edge and continue up and across the shoulders and neckline to the other armhole, leaving room for insertion of the shoulder pads.	301 or hand	Hopper	Variable
32. TRIM FRONT LINING AND INTERFACING AT ARMHOLE.			
a. Trim the excess coat front interfacing and front lining at the armhole.			
b. Or, when the shoulder lining seams are joined by machine, trim the excess coat front interfacing and front and back lining at the shoulders to allow insertion of the shoulder pads.			
c. Trim the lining even with the back at the neck.			
33. BASTE SHOULDER PADS.			
a. Insert the shoulder pad between the shoulder piece and chest padding piece of the floating chest piece in line with the armhole edge and securely tack the pad to the interfacing and chest padding only.	301 or Hand	Tack	2-4 2-4
34. JOIN SHOULDERS.			
a. Finished appearance: The shoulder seam finishes without a distorted appearance, with the front and back seam lines matching.			
b. Join the front to the back at the shoulders with a ⅜-inch seam, working in fullness on the back.	301	SSa-1	10-14
c. Spread the shoulder seam open and press flat with a heated pressing iron or pressing machine over a block, holding the shoulder short. The pressed shoulder does not show any distortion.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
35. SET SHOULDER STRAPS.			
a. Finished appearance: The shoulder straps are uniformly stitched to the coat without twists, fullness, or tightness. On the finished coat, the strap is 2¼±⅛ inches wide at the armhole seam and tapers to 1¾±⅛ inches at the eyelet end of the buttonhole. The rounded end of the strap is ¼ to ⅜ inch from the lower edge of the collar in the finished coat.			
b. Position the shoulder strap on the shoulder seam in accordance with shoulder strap placement marker.			
c. Seam the shoulder strap to the coat 3/16 to ¼ inch from the armhole edge. Trim the shoulder strap even with the armhole, where necessary.	301	SSa-1	10-14
36. JOIN LINING SHOULDER SEAMS.			
a. Trim the shoulder edge of the front lining and the back lining to approximately ⅜ inch past the shoulder at the armhole edge and tapering to ⅛ inch at the neck. Join the back lining to the facing-lining assembly with a ⅜-inch seam, working in the proper fullness on the back.	301 or 401	SSa-1	10-14
37. SEAM NECKLINE AND ATTACH SIZE LABEL AND HANGER LOOP.			
a. Finished appearance: The neckline finishes smooth and flat without twists, pleats, or puckers. The size label is centered between the ends of the hanger loop. In the finished coat, the hanger loop opening is 2±⅛ inches long when measured along the lower edge of the collar lining.			
b. Join the facing and the back lining to the coat at the neckline from collar notch to collar notch with a ¼-inch seam. The upper edge of the size label and the ends of the hanger loop are properly positioned and caught in the stitching at the inside center back.	301	SSa-1	10-14
38. SET COLLAR.			
a. Finished appearance: The collar is carefully joined to the coat without twists, puckers, pleats, raw edges, or distortion.			
b. Mark the neckline on the outside ½ inch from the top edge, from collar step to collar step, for proper positioning of the collar.			
c. Position the collar with the lower edge lapped on the outside top edge of coat at the mark.			
d. Seam the collar to the coat from end to end, 1/16 to ⅛ inch from the lower edge of collar. The stitching is not through the collar lining. The collar position does not deviate more than ⅛ inch from the collar steps on each end of collar.	301	LSa-1	10-14
39. EDGESTITCH COAT.			
a. Finished appearance: The coat is uniformly edgestitched without distortion. The stitching is uniformly ⅛ inch from the edge.			
b. Edgestitch the top and front edges of the coat and continue the stitching along the bottom edge of the coat the width of the facings. Edgestitch the left edge of the vent.	301	SSe-2(a)	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
40. SET SLEEVES.			
a. Finished appearance: The armhole sleeve seam finishes smooth and flat without twists, gathers, puckers, or pleats. The front edge of the sleeve crease at the sleeve bottom finishes 1 inch in front of the front/side front seam.			
b. Position the outside of the sleeve on the outside of the coat with the notches matching and with the sleeve lining turned back from the armhole edge.			
c. Join the sleeve to the coat with a ⅜-inch seam, distributing the fullness between the notches and catching the ends of the shoulder strap in the stitching.	301	SSa-1	10-14
d. Notch the armhole seam allowance on the back and front adjacent to each side of the shoulder strap.			
e. Press fullness of the sleeve flat all around the armhole, with the seam facing toward the sleeve, with a heated pressing iron on a shaped pressing buck, shrinking the fullness and holding armhole short. The armhole is not stretched during pressing.			
41. BASTE ARMHOLES.			
a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad, and front lining in place and distributing the fullness evenly. Turn the coat on the outside.	Hand or 301	Hopper	Variable
b. Baste around the outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting extends the entire circumference of the armhole.	Hand or 301	Hopper	Variable
42. STITCH SLEEVE HEAD PADS AND LININGS AT SLEEVE ARMHOLES.			
a. Finished appearance: The sleeve armhole is not distorted or puckered due to stretching of the sleeve head pads and lining at the armhole.			
b. Position the sleeve head pad on the sleeve with the folded edge of the pad approximately ⅛ inch back from the raw edge of the armhole sleeve seam. The pad begins at the notch in the front and extends around the armhole, ending approximately 2 inches beyond the back arm seam. Trim any excess pad if necessary: 15 inches for sizes XO-6, 16 inches for sizes 8-14, and 17 inches for sizes 16-18.			
c. Stitch the sleeve head pad to the sleeve from end to end, through the armhole sleeve seam allowance, ⅛ inch from the folded edge of the pad, catching the armhole, the front and back linings, and the shoulder pad in the stitching. Continue stitching the lining around the remainder of the armhole. Trim away excess material.	301	SSa-1	4-6

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
43. ATTACH ARMHOLE SHIELDS TO COAT.			
a. Position the armhole shield on the lining side of the coat with the raw edges even with the lower edge of the armhole.			
b. Baste or tack the armhole shield at the base of the armhole.	301 or	SSa-1	4-8
	Hand		2-3
c. Or, as an alternate to operation b, the armhole shield may be joined to the lining by superimposing the stitching on the seam joining the binding to the shield.	301	LSbj-1	10-14
44. ATTACH SLEEVE LININGS.			
a. Position the sleeve lining at the armhole with the back and forearm seam of the sleeve and sleeve lining matching. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining at the armhole. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of the lining and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge, beginning approximately 1½ inches to the front of the forearm sleeve lining seam and extending the stitching to the side seam of the body lining.	Hand	SSa-1	8-10
b. Or, as an alternate, stitch the sleeve lining by machine to the armhole on the inside from the forearm to the backarm sleeve across the under sleeve.	301	SSa-1	10-14
c. Or, as an alternate construction by machine:			
(1) Stitch the sleeve lining to the armhole on the inside from the front sleeve notch to the backarm seam across the under sleeve.	301	SSa-1	10-14
(2) Stitch the top sleeve lining to the armhole on the inside from the front armhole notch to the top back arm lining seam across the crown of the top of the sleeve lining.	306	SSa-1	10-14
(3) Close the previously left opened forearm seam $\frac{1}{16}$ to $\frac{3}{32}$ inch from edge.	310	SSc-1	10-14
NOTE: When the alternate construction to fell the armhole lining by machine is used, it consists of leaving an opening between the notches of the forearm sleeve lining seam, stitching the lining to the armhole on the inside from the front sleeve notch of sleeve to back arm seam across the under sleeve (301 stitch), and, utilizing the forearm sleeve opening, stitching the top sleeve lining to the armhole on the inside by felling machine from the front sleeve notch to the back arm seam across the crown of the top sleeve lining. Close the previously left opened forearm seam.			
45. PRESS FRONT EDGES.			
a. Press the left and right front edges, individually, smooth and flat with a heated pressing iron or pressing machine.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
46. MAKE FRONT BUTTONHOLES AND ATTACH FASTENER TAPE.			
a. Finished appearance: The front buttonholes are eyelet end, square bar, cut first type. The buttonholes are clean cut, well worked over gimp, with the stitching of the buttonhole securely caught in the basic material. The purling of the buttonhole finishes on the outside. The buttonhole finishes clean and is positioned according to the pattern marks. The inside edge of the eyelet end of the buttonhole is ⅝ inch from the front edge.			
b. Mark the right front in accordance with the marks on the pattern for the location of four buttonholes and the loop fastener tape. The mark for the top buttonhole is ¾ to 1 inch below the top edge of the front, and the marks for the remaining three buttonholes are evenly spaced between the top buttonhole and the center of the loop tape.			
c. Make one horizontal, eyelet end, square bar type buttonhole, 1¼ inches long at each buttonhole mark.	Button-hole		50 per buttonhole (minimum) not including tack
d. If the end of the gimp finishes on top of the buttonhole, pull the end through to the underside. Securely bartack the end of each buttonhole, catching the end of the gimp in the bartack and covering the width of the bar. The bartack is centered over the bar and is not more than ¼ inch long and 1/16 inch wide. Trim the end of the gimp.	Bartack		20 per bartack (minimum)
e. Position a 1-inch wide piece of loop fastener tape on the right facing according to the marks on pattern. Stitch the tape to the facing through all plies, stitching around all four sides of the tape ⅛ inch from the edge. The vertical raw edges are turned under. The fastener tape finishes 1¾±⅛ inches long by 1 inch wide.	301	LSbj-1	10-14
f. Mark the position of the 1-inch wide piece of hook fastener tape on the left front according to the marks on pattern. Stitch the tape to the front through all plies, stitching around all four sides of the tape ⅛ inch from the edge. The vertical raw edges are turned under. The fastener tape finishes 1¾±⅛ inches long by 1 inch wide.	301	LSbj-1	10-14
47. SEW HOOK AND EYE TO COLLAR.			
a. Finished appearance: The hook and eye are positioned to properly engage each other, effecting a flat, smooth closure at the front of the collar without misalignment.			
b. Position and securely sew the hook to the right end and the eye to the left end of the collar. The hook and eye are positioned with their front edges even with the respective front ends of the collar and are securely sewn to the collar at the top and bottom of the forward edge of the hook and eye. The stitching on each side is not more than ⅜ inch from the front end of the collar through the individual holes at the rear of the hook and eye.	Hand		16 per hook, 16 per eye

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
48. FINISH COLLAR.			
a. Securely tack the lower corners of the collar to the coat.	Hand		8-10
b. Turn under the end and top edge of the lining at the right end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge to the end of the stitching, joining the lining to the collar.	Hand		8-10
c. Or, as an alternate, the collar lining may be attached to the coat using a simulated hand felling machine.			
d. Turn under and fell the lower folded edge of the collar lining to the coat from end to end, catching the turned under portion of the lining at the right end in the felling.	Hand or Machine		8-10 6-8
e. Position the collar tab on the inside of the collar at the left end, with the collar tab extending approximately ¾ inch beyond the front end of the collar. Fell the top, back, and bottom raw edges of tab to the collar lining.	Hand		8-10
49. CLEAN COAT.			
a. Pull and remove all basting thread; trim and remove all loose ends of thread; and remove all spots, stains, tickets, and marking without injury to the material.			
50. PRESS COAT.			
a. Finished appearance: The coat is well pressed throughout with a heated pressing iron or pressing machine to obtain the desired shape and appearance in accordance with good manufacturing practices, ensuring no shine or gloss.			
b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. The bottom edges of the fronts are even.			
c. Press the entire collar smooth and flat.			
d. Press the upper fronts on a left and right body machine, shrinking in and properly shaping the chest.			
e. Press the lower fronts smooth and flat.			
f. Press the sides, working the fullness towards the back.			
g. Press the back smooth and flat, removing all fullness and lapping the left vent on the right vent.			
h. Press the sleeves smooth and flat, creasing at the backarm and forearm. The backarm crease is positioned on the backarm seam and in line with the forearm crease. The crease extends from the sleeve hem to a point on the sleeve in horizontal alignment with the top folded edge of the side seam belt loop.			
i. Block the shoulders to remove fullness and press shoulders smooth on a shoulder shaping machine.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE VIII. Table of operations – Continued.

Operation	Stitch type	Seam type	Stitches per inch
j. Press the armholes solid from the inside, creasing the armholes at the front, back, and armpit. The armpit and the back of the armhole are held short while pressing.			
k. Block the armholes on a pressing buck, shrinking in the top sleeves.			
l. Press the lower edge of the coat smooth, flat, and even.			
m. Remove all wrinkles and impressions from the coat.			
n. Press the linings throughout, removing all wrinkles and creases. Press the front shoulder pleats, back lining pleat, and vent linings smooth and flat.			
51. MARK AND ATTACH BUTTONS.			
a. Mark the left front for the location of four 40-line insignia buttons to properly engage with the buttonholes on the right front. The mark for the top button is in line with the left front end of collar and the remaining buttons are in vertical alignment with the top mark and equal distance from the front edge of the coat.			
b. Sew one 40-line insignia button at each of the marks on the left front. The buttons are securely sewn through all plies of material and properly engage the buttonholes on the right front. The buttons finish with the head of the eagle in an upright position.	101or 301 or		21/ button
	Hand		6-8/button (double thread)
c. Mark each shoulder for the location of one 27-line insignia button to properly engage with the buttonhole in the shoulder strap.			
d. Sew one 27-line insignia button at the mark on each shoulder. The button is sewn through all plies of material. The head of the eagle is positioned towards the bottom edge of the collar.	101 or 301 or		21/ button;
	Hand		6-8/button (double thread)
c. Mark the collar lining for the location of five 16-line sewing hole buttons in accordance with the pattern marks.			
d. Sew one 16-line sewing hole button at each of the marks on the collar lining. The button stitching does not show on the outside of the collar.	Hand		8 per button (double thread)
52. ATTACH BELT TO COAT.			
a. Thread the belt through the belt loops.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

3.9 Finished measurements. The finished coat shall conform to the measurements shown in table IX and table X, as defined in table XI, when measured as specified in 4.4.4. All measurements and tolerances are expressed in inches.

TABLE IX. Finished measurements – Chest, waist, sweep, back length, collar length, and belt length.

Size	Chest (A)	Waist (B)	Sweep (C)	Back length (D)					Collar length (E)	Belt length (F)
				Extra short	Short	Regular	Long	Extra long		
XO	33½	27½	40	23¼	24½	25¾	27	29	13	33
2	34½	28½	41	23½	24¾	26	27¼	29¼	13¼	34
4	35½	29½	42	23¾	25	26¼	27½	29½	13½	35
6	36½	30½	43	24	25¼	26½	27¾	29¾	13¾	36
8	38	32	44½	24¼	25½	26¾	28	30	14	37½
10	39½	33½	46	24½	25¾	27	28¼	30¼	14½	39
12	41	35	47½	24¾	26	27¼	28½	30½	15	40½
14	43	37	49½	25	26¼	27½	28¾	30¾	15½	42½
16	45	39	51½	25¼	26½	27¾	29	31	16	44½
18	47	41	53½	25½	26¾	28	29¼	31¼	16½	46½
Tolerance	±¾	±¾	±¾	±½	±½	±½	±½	±½	±¼	±½

TABLE X. Finished measurements – Sleeve length and collar height.

	Extra short	Short	Regular	Long	Extra long	Tolerance
Sleeve length (G)	15¾	16¾	17¾	18¾	20¾	+½, -⅜
Collar height (H)	1¾	1¾	1¾	1¾	1¾	±⅛

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XI. Methods of measure.

Letter	Measurement	Method 1/
A	Chest	From folded edge to folded edge, in line with the pit of the armhole. Multiply by 2.
B	Waist	At center of fastener tape from folded edge to folded edge.
C	Sweep	Buttoned and folded with both fronts together, from folded edge to folded edge along the curve of the coat bottom, with the front overlapped 3¾ inch and the center vent overlapped 2¾ inch.
D	Back length	Along center back seam from outer collar seam to bottom of coat.
E	Collar length	With the coat opened (unbuttoned), measure length from front edge to front edge at the center of the collar.
F	Belt length	With belt removed from belt loops, from point to square end of belt along the center of belt.
G	Sleeve length	Along inseam from pit of armhole to bottom edge of sleeve.
H	Collar height	From top edge of collar to bottom edge of collar.

FOOTNOTE:

1/ Unless otherwise specified in table XI, the coat is buttoned and lays flat upon a table.

3.10 Workmanship. The finished coat shall conform to the quality of product established by this document. Defects shall not exceed the established Acceptance Quality Limits (AQL) (see 6.2) and shall not adversely affect the serviceability, appearance, and uniformity of the product.

4. VERIFICATION

4.1 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.2).

b. Conformance inspection (see 4.3).

4.2 First article inspection. The first article, submitted in accordance with 3.3.1, shall be examined in accordance with 4.4.1 through 4.4.4 for compliance with the design, configuration, workmanship, dimensional requirements, and testing as specified in this document.

4.2.1 First article samples and acceptance criteria. Unless otherwise specified in the contract (see 6.2), first article samples shall be provided. The sample size shall be as specified (see 6.2). The sample unit shall be one finished coat. The lot size shall be expressed in units of coats. The presence of defects exceeding AQLs (see 6.2) or failure of any testing shall be cause for rejection of the first article.

4.3 Conformance inspection. Unless otherwise specified in the contract (see 6.2), conformance inspection, in accordance with 3.1.2, shall consist of the examinations and tests as specified in 4.4.1 through 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

4.3.1 Component and material sampling and acceptance criteria. Unless otherwise specified in referenced documents or procurement documents (see 6.2), sampling shall be in accordance with table XII.

TABLE XII. Material sampling.

Lot size	Sample size (sample unit)
800 or less	2
801 through 22,000	3
22,001 and over	5

The unit for expressing lot size and sample unit for testing each component shall be in accordance with the applicable referenced document and table XIII:

TABLE XIII. Component sampling.

Component	Lot size expressed as	Sample unit for testing
Lining	Yards	3 yards full width
Collar padding	Yards	¼ yard full width
Collar closure hook and eye	100 each	2 each hook and eye
Snap fastener	100 each	2 each hook and eye

The component lot shall be unacceptable if one or more sample units fail to meet any examination or test requirements specified in this document (see 6.2).

4.3.2 End item sampling and acceptance criteria. Unless otherwise specified in the contract (see 6.2), sampling for inspection shall be performed in accordance with ANSI/ASQ Z1.4. The sample unit shall be one finished coat. The lot size shall be expressed in units of coats. The presence of excessive defects or failure of any testing as specified (see 6.2) shall be cause for rejection of the lot.

4.4 Inspection methods.

4.4.1 Component and material examinations and tests. In accordance with 4.1, components and materials shall be examined and tested in accordance with the examinations and tests specified in tables XIV through XVIII, unless otherwise excluded, amended, or modified in this document or applicable procurement documents (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XIV. Component and material verification.

Material	Requirement	Verification
Basic material	3.3.1	MIL-DTL-10176
Alternate basic material	3.3.1.1	MIL-DTL-3738
Lining	3.3.2	As listed in table XV
Inside breast pocket and stay pieces	3.3.3	A-A-52106
Fusible interfacing: front and side panels, center back neck and center vent (woven or weft knit)	3.3.4.1	MIL-C-44296
Fusible interfacing: front facings, top ply of shoulder straps, belt and sleeve cuffs (non-woven)	3.3.4.2	MIL-C-44296
Floating chest piece: haircloth	3.3.5.1	MIL-C-15065
Floating chest piece: chest piece padding	3.3.5.2	As listed in table XVI and 4.4.1.1
Floating chest piece: buttonhole stand	3.3.5.3	A-A-52106
Collar tab	3.3.6.1	A-A-50067
Collar buckram	3.3.6.2	A-A-59992
Collar interfacing	3.3.6.3	A-A-52106
Collar closure hook and eye	3.3.6.4	As listed in table XVII and 4.4.1.2
Sleeve head pads	3.3.7	MIL-DTL-15064
Shoulder pads	3.3.8	MIL-DTL-15064
Hanger loop	3.3.9	MIL-DTL-371
Armhole shield binding	3.3.10	As listed in table XV
Tape: woven tape	3.3.11.1	A-A-52071
Tape: fusible tape	3.3.11.2	MIL-C-44296
Threads	3.3.12	Per specific thread specification listed in table IV
Thread, shade	3.3.12	Visual 1/
Thread, colorfastness (black threads only)	3.3.12.1	Per specific thread specification listed in table IV
Buttons: insignia buttons	3.3.13.1	MIL-B-3461
Buttons: sewing hole for collar	3.3.13.2	A-A-59994
Buttons: sewing hole for belt	3.3.13.3	A-A-59994
Hook and loop fastener tape	3.3.14	A-A-55126, excluding colorfastness to laundering
Labels	3.3.15, 3.3.15.1, 3.3.15.2, 3.3.15.3	MIL-STD-984 and MIL-DTL-32075
Fastener, snap	3.3.16	As listed in table XVIII

FOOTNOTE:

1/ Results recorded as pass or fail.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XV. Lining verification.

Characteristic	Requirement	Verification
Shade	3.3.2 and 3.3.10	Visual [1/]
Fiber identification	3.3.2 and 3.3.10	AATCC TM20A
Yarns per inch: warp and filling	3.3.2 and 3.3.10	ASTM D3775
Weight	3.3.2 and 3.3.10	ASTM D3776/D3776M
Breaking strength	3.3.2 and 3.3.10	ASTM D5034
Dry: warp and filling		
Wet: warp and filling		
Colorfastness to perspiration	3.3.2 and 3.3.10	AATCC TM15
Color change		
Staining on cotton		
Staining on wool		
Colorfastness to drycleaning	3.3.2 and 3.3.10	AATCC TM132
Color change		
Staining on cotton		
Staining on wool		
Colorfastness to crocking	3.3.2 and 3.3.10	AATCC TM8
Dimensional stability to drycleaning	3.3.2 and 3.3.10	AATCC TM158
Width (armhole shield binding only)	3.3.10	Visual [1/]
Edge finish (armhole shield binding only)	3.3.10	Visual [1/]

FOOTNOTE:

[1/] Results reported as pass or fail.

TABLE XVI. Floating chest piece: chest piece padding verification.

Characteristic	Requirement	Verification
Fiber identification	3.3.5.2	AATCC TM20A
Color	3.3.5.2	Visual [1/]
Construction	3.3.5.2	Visual [1/]
Weight	3.3.5.2	ASTM D3776/D3776M, option C
Thickness: initial and after 3 drycleanings and steam pressings	3.3.5.2	ASTM D1777 [2/]
Breaking strength: machine and cross direction	3.3.5.2	ASTM D5034
Shrinkage after 3 drycleanings and steam pressings: machine and cross direction	3.3.5.2	4.4.1.1 [2/]

FOOTNOTES:

[1/] Results recorded as pass or fail.

[2/] Any commercial drycleaning method may be used. Material shall be steam pressed after each drycleaning.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XVII. Collar closure hook and eye verification.

Characteristic	Requirement	Verification 1/
Material	3.3.6.4	Standard commercial
Design	3.3.6.4	Visual
Dimensions	3.3.6.4	Visual
Color/finish	3.3.6.4	Visual
Coating type	3.3.6.4	Visual
Coating application	3.3.6.4	Visual
Coating tackiness	3.3.6.4	4.4.1.2
Openings	3.3.6.4	Visual
Edges and surfaces	3.3.6.4	Visual
FOOTNOTE: 1/ Results recorded as pass or fail.		

TABLE XVIII. Snap fastener verification.

Characteristic	Requirement	Verification 1/
Material	3.3.16	Standard commercial
Color/finish	3.3.16	Visual
Coating type	3.3.16	Visual
Style	3.3.16	Visual
Edge finish	3.3.16	Visual
Size	3.3.16	Visual
Application	3.3.16	Visual
FOOTNOTE: 1/ Results recorded as pass or fail.		

4.4.1.1 Dimensional stability of floating chest piece: chest piece padding. Three 22-inch by 22-inch specimens shall be cut from the polyester material (see 3.3.5.2), parallel to the machine and cross machine directions, and no closer than 3 inches from the selvage. An 18-inch square shall be marked as a minimum at each corner within the 22-inch specimen with indelible ink. No marks shall be closer to the edge of the specimen than 1 inch. The specimen shall be commercially drycleaned three times using a solvent-based solution. Samples shall be bottom steam pressed after each drycleaning for 20 seconds in a non-locked position and vacuumed for 10 seconds.

4.4.1.1.1 Dimensional stability calculation. Each of the three 22-inch by 22-inch specimens shall be laid out without tension on a flat surface. Care should be taken that the specimens are free from wrinkles and creases. The previously measured distances marked on the specimen (initial measurement, 18 inches) in each direction (machine and cross) shall be remeasured to the nearest 1/16 inch, recorded, averaged, and calculated for dimensional change. The dimensional change of the sample unit (3 specimens) shall be calculated to the nearest 0.10 percent using the following formula:

$$\text{Dimensional change, percent} = \frac{A-B}{A} \times 100$$

Where A = Average of initial measurements (18 inches)

B = Average measurements after drycleaning

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

4.4.1.2 Tackiness of collar closure hook and eye. At room temperature (60 to 80 °F), a piece of commercial tissue paper shall be pressed against the lacquered surface of a hook and eye for 30 seconds, using the thumb and two fingers to exert pressure. After 30 seconds, the paper shall be removed from the surface. Any evidence of tissue adhering to the surface shall be scored as a failure.

4.4.2 In-process examination. Visual and dimensional examinations shall be made at any point or during any phase of the manufacturing process to determine whether construction details which cannot be examined in the finished product are in accordance with the requirements specified in Section 3. Materials and components which contain defects and damages as defined in the visual examination of 4.4.3.2 shall be removed from production. Any in-process nonconformance remaining in the finished coat shall be classified as a defect in accordance with the visual examination of 4.4.3.

4.4.3 Visual examination. The coat shall be examined for defects in color, design, material, construction, workmanship, and marking. The defects shall be classified in accordance with the list of defects specified in 4.4.3.2. Inspection for defects I through XII shall occur when the coat is on the model form or when spread out on a table, inspection for defects XIII through XXV shall occur when the coat is completely buttoned on a model form; and inspection for defects XXVI through XXXIX shall occur when the coat is spread out on a table. The inspection conditions and the AQLs shall be as specified (see 6.2).

4.4.3.1 Model forms. The coat sizes listed below shall be examined on the appropriate size model form in accordance with table XIX.

Table XIX. Model forms.

Coat size	Model form size	Model form measurements (inches)		
		Bust	Waist	Hip
X0, 2, 4	4	33	24	34
6, 8, 10	6	34	25	35
12, 14	12	37	28	38
16, 18	16	40	31	41
Tolerance		±1	±½	±½

4.4.3.2 Classification of defects. All defects shall be classified as indicated in table XX, except those in the "(*)" column. "(*)" defects shall be scored as a Major defect when seriously affecting the appearance or serviceability of the item. All other "(*)" defects shall be scored as a Minor A.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table.

Defect	Classification			
	Major	(*)	Minor A	Minor B
I. BARTACKS				
a. One or more missing, loose, or misplaced (except bartacks on the buttonholes)			201	
II. BUTTONHOLES				
a. One or more omitted, added, or wrong type	101			
b. Not corresponding to the size of the button:				
1. Too small, not permitting the button to enter the buttonhole	102			
2. Too large, ⅜ inch or more longer than the diameter of the button (measured at the inside of the purling)			202	
c. Buttonhole not securely caught on the fabric, causing the stitching to pull away from the fabric	103			
d. Bartack missing or loose on:				
1. One front buttonhole			203	
2. Two or more front buttonholes	104			
e. Bartack misplaced, not serving intended purpose on one or more buttonholes			204	
f. One or more broken stitches in:				
1. One buttonhole			205	
2. Two or more buttonholes	105			
g. More than 2 skipped stitches in:				
1. One buttonhole				301
2. Two or more buttonholes			206	
h. Ragged edge, affecting appearance				302
i. Any uncut buttonhole			207	
j. Gimp omitted in one or more buttonholes or the end of the gimp not pulled through to the underside			208	
k. Stitches per buttonhole (not including the bartack) less than the minimum specified by:				
1. One or two stitches				303
2. Three or more stitches			209	
l. One or more buttonholes finished with the purling on the underside	106			
III. BUTTONS				
a. One or more missing, loose, defective, or improper size or type			210	
b. One or more front buttons sewn with the head of the eagle in other than the upright position, or one or more shoulder strap insignia buttons sewn with the head of the eagle in direction other than towards the edge of the collar				304
NOTE: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; unsound soldering; scratches, dents, blemishes, or imbedded foreign matter; loose or bent shanks; or are poorly plated or badly shaded.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
IV. CLEANNESS				
a. Any spot or stain clearly noticeable				
1. On the outside	107			
2. On the inside				305
b. Thread ends not trimmed throughout the garment, one or more bastings not removed, or two or more shade tickets not removed				306
c. Any residue of synthetic thread (when used) not brushed off or removed				307
V. COMPONENTS AND ASSEMBLY				
a. Any component part or required operation omitted (not herein classified)		01		
b. Any defective component or defect of assembly (not herein classified)		02		
VI. CUTTING				
a. Any component part of the basic material not cut in accordance with the patterns or not cut in accordance with the specified requirements	108			
b. Any non-basic material component not cut in accordance with the patterns or not cut in accordance with the specified requirements			211	
VII. EYELETS				
a. One or more omitted or added	109			
b. Wrong type			212	
c. Eyelet not securely caught in the fabric, causing the stitching to pull away from the fabric	110			
d. Diameter of the inside opening less than ⅛ inch or more than ¼ inch			213	
e. Any eyelet uncut			214	
f. One or more broken stitches in:				
1. One eyelet				308
2. Two eyelets			215	
g. More than two skipped stitches in one or both eyelets			216	
VIII. HOOK AND EYE				
a. Hook or eye omitted	111			
b. Not specified type or size			217	
c. Hook or eye not securely tacked to the ends of the collar			218	
d. Not aligned, causing the collar ends to be uneven by ¼ inch or more when the front is buttoned and the hook and eye are fastened	112			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
IX. MATERIAL DEFECTS AND DAMAGES				
a. Any hole, cut, tear, smash, mend, burn, scorched area, shade marking, or open place:				
1. On the outside	113			
2. On the inside (longest dimension in any direction				
(a) Up to ¼ inch, inclusive				309
(b) More than ¼ inch			219	
b. Loose yarn, misweave, area of no dye penetration, dye streak, or woven-in waste: more than ¼ inch (largest dimension in any direction) on the outside			220	
c. Permanent fold, pleat, or crease in the cloth (when caught in seaming or stitching) on the outside	114			
d. Visible needle hole(s) (no thread present) or needle chew, i.e., presence of scuffed or broken yarns caused by stitching:				
1. On the outside:				
(a) Up to ¼ inch, inclusive			221	
(b) More than ¼ inch	115			
2. On the inside, more than ½ inch			222	
e. Knot or slub on the outside			223	
NOTE: Only knots and slubs that exceed the limits specified in the material specification shall be scored as defects in evaluating the quality of the coat.				
X. PRESSING				
a. Burned, scorched, or area with shine or gloss		03		
b. Pressing omitted - entire garment			224	
c. Armhole stretched		04		
d. Poorly pressed (unless otherwise indicated)				310
e. Basting or pressing impression not removed				311
f. Gloss not removed				312
g. Armholes not blocked or poorly blocked			225	
h. Edge bulky, i.e., not pressed solid			226	
i. Inside of the armhole not creased as required			227	
j. Armhole seam not pressed open across the top as required			228	
k. Sleeve not creased at the front or backarm seam as specified				313
l. Wrinkles not removed				314
m. Lining not pressed smooth				315

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
XI. SEAMS AND STITCHING				
a. Accuracy of seaming:				
1. Any seam twisted, gathered, puckered, or pleated			229	
2. Part of the garment caught in any unrelated operation or stitching		05		
3. Unsightly hand felling or blindstitching exposed on the outside of the coat, affecting appearance			230	
4. End of any stitching (when not caught in other seams or stitching) not backtacked or backstitched as required				316
5. Wrong shade of thread or two shades of thread used on the outside of the coat, affecting appearance		06		
b. Gage of stitching (edge, raise, and topstitching):				
1. Irregular, i.e., unevenly gaged, or various stitchings not uniform, affecting appearance			231	
2. Beyond the range of width specified or varies more than 1/16 inch when no range is specified				317
c. Open seams:				
1. On the outside:				
(a) Up to ¼ inch, inclusive				318
(b) More than ¼ inch, but not more than ½ inch			232	
(c) More than ½ inch	116			
2. On the inside, except machine felling:				
(a) Up to ½ inch, inclusive				319
(b) More than ½ inch			233	
3. Machine felling:				
(a) Up to 1 inch, inclusive				320
(b) More than 1 inch			234	
NOTE: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.				
d. Raw edges:				
1. On the outside:				
(a) Up to ⅛ inch, inclusive				321
(b) More than ⅛ inch, but not more than ¼ inch			235	
(c) More than ¼ inch	117			
2. On the inside:				
(a) More than ⅛ inch, but not more than ¼ inch				322
(b) More than ¼ inch			236	
NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
e. Run-offs (see classification of open seam)				
f. Stitch tension:				
1. Loose tension resulting in a loose seam (stitches grin)	118			
2. Loose tension on raised, edge, or top stitching, resulting in loosely exposed bobbin or top thread			237	
3. Tight tension (stitches break when normal strain is applied)	119			
g. Stitches per inch less than the minimum specified by:				
1. One or two stitches (except label stitching)				323
2. Three stitches (except label stitching)			238	
3. Four or more stitches (except label stitching)	120			
4. One or more stitches on label				324
NOTE: To be scored only if condition exists on major portion of the seam.				
h. Wrong stitch or seam type			239	
i. Stitching skipped or broken (on edge, raised, or topstitching when seam is seamed, turned, and stitched):				
1. ¼ inch or more, but not more than ½ inch				325
2. More than ½ inch			240	
XII. SHADED PARTS				
a. On the outside:				
1. Any shaded part (except belt loops)		07		
2. Belt loop shaded				326
b. On the inside:				
1. Any lining part shaded (except sleeve lining)			241	
2. Any sleeve lining part shaded or pairs not matching each other				327

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
XIII. COLLAR CONSTRUCTION				
a. Interfacing or buckram omitted	121			
b. Interfacing or buckram tight or twisted, causing puckers on the collar, affecting appearance			242	
c. Tight at the joint to front or back, causing puckers or pleats at the neck of the coat, affecting appearance		08		
d. Collar ends overlapping when fastened			243	
e. Collar ends gap more than ¼ inch when fastened	122			
f. Center of the eyelet from the finished end of the collar less than 1⅜ inches or more than 1⅝ inches			244	
g. One or both eyelets off-center with the top and bottom edges of the collar by more than 1/16 inch	123			
h. Collar off-center by more than ¼ inch	124			
i. Finished height of the collar less than 1⅝ inches or more than 1⅞ inches			245	
j. Collar irregular in height by 3/16 inch or more	125			
k. Front finished ends of the collar uneven in height by 3/16 inch or more			246	
l. End of the collar distorted, twisted, or crooked, caused by hand felling or hand stitching exposed on the outside of either collar end			247	
m. Hand tacking at lower corner of the collar to the coat insecure or omitted			248	
XIV. ALIGNMENT OF FRONT BUTTONS AND BUTTONHOLES				
a. Not aligned, causing a noticeable bulge or twist on the front when buttoned, affecting appearance	126			
XV. LENGTH OF BUTTONED FRONTS				
a. Right front at the corner shorter than the left front at the bottom by:				
1. More than ⅛ inch but not more than ¼ inch			249	
2. More than ¼ inch	127			
b. Right front at the corner longer than the left front by:				
1. More than ¼ inch but not more than ⅜ inch				328
2. More than ⅜ inch			250	
c. Left front at the corner exposed beyond the bottom of the right front by more than ⅛ inch			251	
XVI. SHOULDER (CONSTRUCTION)				
a. Improperly sewn, causing the shoulders or back to twist		09		

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
XVII. SHOULDER PADS				
a. Not completely caught in the armhole tacking			252	
b. Misplaced, not serving intended purpose, i.e., too far back or too far forward			253	
c. One or both pads omitted	128			
XVIII. SHOULDER STRAPS				
a. Misplaced, i.e., one shoulder strap further forward or back from the position of the other strap, affecting appearance			254	
b. Shoulder strap stitched to the coat too full or twisted, or stitched to the coat too tight, causing fullness or twist on the front or back of the coat	129			
c. Poorly shaped	130			
d. Shoulder seam exposed beyond the back edge of the shoulder strap (except the rounded end)			255	
e. Width of the shoulder strap at the armhole seam:				
1. Less than 2⅜ inches, but not less than 2⅛ inches				329
2. More than 2⅝ inches, but not more than 2⅞ inches				330
3. Less than 2⅛ inches or more than 2⅞ inches			256	
f. Width of shoulder strap across the center of the insignia button:				
1. Less than 1⅝ inches, but not less than 1½ inches				331
2. More than 1⅞ inches but not more than 2 inches				332
3. Less than 1½ inches or more than 2 inches			257	
g. Rounded end of the shoulder strap positioned less than ¼ inch or more than ⅜ inch from the collar edge				333
h. Buttons not uniformly set from the collar edge by more than ¼ inch			258	
i. Center of button less than ¾ inch or more than ⅞ inch from the rounded end of the shoulder strap (including scarlet piping)				334
XIX. ARMHOLES (CONSTRUCTION)				
a. Stretched		10		
b. Taped too tight, causing puckering around the armhole seam, affecting appearance		11		
c. Crooked seam				335
d. Tape stitching exposed and visible on the outside of the coat				336
e. Sleeve head pads not completely tacked to the armholes, or misplaced, not serving the intended purpose			259	
f. One or both sleeve head pads omitted			260	
g. Armhole not tacked completely or insecurely tacked			261	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
XX. SLEEVES				
a. Setting and hang:				
1. Sleeve fullness misplaced, affecting appearance			262	
2. Sleeve too far front, i.e., the front edge of the creased sleeve bottom more than 2 inches in front of the front/side front seam		12		
3. Sleeve too far back, i.e., the front edge of the creased sleeve bottom less than exactly even going back from the front/side front seam		13		
4. Hang of sleeves in opposite directions, i.e., one sleeve too far forward and one sleeve too far back, tolerance of 1½ inches		14		
5. Sleeve tight in the armhole, i.e., roll effect not present at the front or back of sleeve		15		
b. Sleeve lining:		16		
1. Twisted, tight, or short, causing bulge, twist, or puckering on the outside of sleeve				
2. Sleeve lining too long, causing the lining to sag at the bottom more than ½ inch				337
3. Sleeve lining seams out of alignment more than ⅜ inch with the sleeve seams at the armholes or at the bottom of the sleeve				338
c. Construction of sleeves:				
1. Tacking on bottom turnup to the sleeve interfacing omitted or insecure			263	
2. Sleeve bottom edge uneven by more than ¼ inch				339
3. Tacking on one or both sleeve lining seams to sleeve seams omitted or insecure				340
4. Bottom edge of the sleeve lining turnup less than 1 inch or more than 1½ inches up from the bottom edge of the sleeve				341
d. Sleeve cuffs:				
1. Full, tight, puckered, or twisted			264	
2. Point of the sleeve cuff not uniformly shaped or not forced out to a sharp point			265	
3. Finished height of the sleeve cuff at the point or the sleeve crease not as specified			266	
4. Edge of the cuff irregular by ⅛ inch or more			267	
XXI. BODY (OUTSIDE)				
a. Fitting of the linings tight, short, or twisted, causing fullness or twist on the outside of the coat, affecting appearance		17		

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
XXII. FRONT AND BOTTOM EDGES				
a. Front edges stretched, affecting appearance			268	
b. Tape set on tight, causing puckering on the front, affecting appearance			269	
c. Bottom edge stretched, puckered, or uneven, affecting appearance				342
d. Bottom corner of the right front poorly shaped, affecting appearance			270	
e. Right front rolling outward below the loop fastener tape piece		18		
f. Front edge irregular, affecting appearance			271	
g. Right forepart overlapping the left forepart at bottom. To measure the coat lying flat, match the side seams with the bottoms even. The left shall be 3¾±¼ inches from the outer finished edge of the right front.				343
XXIII. FRONT FACING				
a. Short, tight, or twisted, causing fullness or twist on the fronts, affecting appearance		19		
XXIV. OUTERSHELL PANEL SEAMS				
a. Not pressed open			272	
b. Any curved panel seam stretched or distorted, affecting appearance			273	
XXV. VENT OPENING				
a. Left vent edge stretched, causing the vent to spread open, affecting appearance			274	
b. Row of stitching across the top of the vent opening omitted or insecure or not caught through the vent lining			275	
c. Left vent shorter than the right vent by ¼ inches or more			276	
d. Left vent longer than the right vent by ¼ inches or more				345
e. Left edge tight, causing puckering on the vent edge, affecting appearance			277	
f. Left vent edge crooked, affecting appearance			278	
g. Left vent back part overlapping the right vent back part at the bottom edge less than 2½ inches or more than 3 inches				346
h. Width of the left vent (measured at bottom piped edge) less than 1⅞ inches or more than 2⅛ inches				347
i. Row of stitching across the top of the vent opening less than 1⅝ inches or more than 2 inches long				348
j. Row of stitching across the top of the vent opening misplaced, not serving the intended purpose			279	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
XXVI. FRONT BUTTONHOLES				
a. Inside edge of the buttonhole eyelet positioned less than ½ inch or more than ¾ inch from the front edge, including the piped edge			280	
b. More than ¼ inch from equal spacing			281	
c. Top buttonhole less than ¾ inch or more than 1 inch from the top edge			282	
d. Unevenly spaced from the front edge by more than 3/16 inch			283	
XXVII. FRONT BUTTONS (POSITIONED AND SECURE SEWING)				
a. Out of vertical alignment by ¼ inch or more			284	
b. Button stitching caught through the interfacing (buttonhole stand) but not caught in the facing:				
1. On 1 button				349
2. On 2 or more buttons			285	
c. Button stitching not caught through the interfacing (buttonhole stand) on one or more buttons	131			
XXVIII. BELT LOOPS				
a. Loops less than ⅜ inch or more than ⅝ inch wide				350
b. Length of the belt loop from the top to bottom folded edge less than 2⅝ inches or more than 2⅞ inches				351
c. Bottom end of the loop bartacked through the double fold, exposing the bartack				352
d. Omitted:				
1. 2 belt loops	132			
2. 1 belt loop			286	
e. Loop not aligned with the side seam:				
1. More than ¼ inch, but not more than ½ inch				353
2. More than ½ inch			287	
f. Top folded end of the loop bartacked to the coat less than ⅛ inch or more than ¼ inch from the folded end				354
XXIX. LABELS				
a. Any required label misplaced, missing, incorrect, or illegible or the size label not securely caught in the stitching			288	
b. Combination instruction/identification label not stitched on 4 sides or not positioned as specified on the facing				355

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
XXX. HANGER LOOP				
a. Hanger loop omitted or any end not securely stitched			289	
b. Less than 1⅞ inches or more than 2⅛ inches long, measured along the collar seam				356
c. Hanger loop not stitched to the neck of the coat prior to seaming the collar to the neck of the coat				357
XXXI. FRONT FACING				
a. Fullness or pleats on the facings between the buttons, between the buttonholes, or between the front edge and the button or buttonholes when buttoned				358
b. Tacking of the back edge to one or both interfacings:				
1. Omitted			290	
2. Insecure or incomplete for a distance of more than 5 inches below the shoulder seam, or more than 4 inches above the bottom edge of the lining				359
XXXII. BACK LINING				
a. Excessive fullness or pleats				360
b. Twisted, not affecting smoothness on the outside surface of the back				361
c. Pleat in the center of the lining omitted			291	
d. Folded edge of the center pleat facing the right side of the coat				362
XXXIII. FRONT LININGS				
a. Excessive puckering or pleated				363
b. Twisted, not affecting smoothness on the outside of the coat				364
c. One or both chest pleats on the shoulder omitted			292	
d. Folded edge of one or both chest pleats facing toward the shoulder				365
e. Side seam of the lining not tacked to one or both side seams of the outer shell				366
f. Back stitch at the lower armhole edge from approximately 1½ inches to front of forearm sleeve lining seam to side seam of the body lining omitted				367
XXXIV. COLLAR LINING AND COLLAR TAB				
a. Collar tab at the right end of the collar omitted or extending beyond the collar end less than ¾ inch or more than 1 inch			293	
b. Stitching not extending the full width of the collar tab			294	
c. Ends of the collar lining not securely tacked			295	
d. Hand felling of the lining across the full width at the left or right end of the collar omitted			296	
XXXV. RIGHT VENT LINING				
a. Top edge not completely covering the edges of the center back seam outlets			297	
b. Folded edge of the lining not extending beyond the center seam allowance or the right back part				368
c. Tight, short, or twisted, causing fullness or twist on the outside of the coat			298	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

TABLE XX. Defect table – Continued.

Defect	Classification			
	Major	(*)	Minor A	Minor B
XXXVI. BARCODE LABELS/TAGS				
a. Barcode omitted or not readable by scanner			299	
b. Human Readable Interpretation (HRI) omitted or illegible			201a	
c. Not visible on the folded, packaged item or causes damage to the item			202a	
XXXVII. FUSING				
a. Omitted on any component part	133			
b. Twisted or causing puckers or pleats on any fused component	134			
c. Full, causing waviness on any fused component	135			
d. Any partial or complete delamination of any fused component	136			
e. Any strike through, bleed through, or color change	137			
f. Any resin transfer to the coat				
1. On any fused component	138			
2. On any non-fused component			203a	
XXXVIII. BELT				
a. Interfacing omitted	139			
b. Pointed end poorly shaped, affecting appearance			204a	
c. Square end of the belt not finished			205a	
d. Any part short, full, or twisted, causing fullness or twists on the outer side of the belt, affecting appearance			206a	
e. Width not as specified				369
f. Irregular in width by ⅛ inch or more, affecting appearance			207a	
g. Belt keeper omitted	140			
h. Length of the belt keeper not as specified when measured from the bartack to the folded end			208a	
i. Center of the buttonhole to the end of the belt				
1. Less than ⅞ inch, but not less than ¾ inch or more than 1⅛ inches				370
2. Less than ¾ inch			209a	
j. Buttonhole off center by more than ¼ inch			210a	
k. Purling of the buttonhole finished on the underside of the belt				371
l. Button omitted			211a	
m. Button misplaced				372
n. Stud or socket portion of the snap omitted			212a	
o. Snap misplaced				373
XXXIX. INSIDE POCKET				
a. Width of the opening not within the tolerances specified				374

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

4.4.4 Dimensional examination. The coat shall be examined for conformance to the dimensions specified in tables IX and X, and the methods of measure specified in table XI. Any measurement deviating from dimensions and tolerances specified in tables IX and X shall be scored as a measurement defect. Sleeve lengths uneven by ½ inch or more shall be classified as a measurement defect. The inspection and the AQL shall be as specified in the contract or purchase order (see 6.2).

5. PACKAGING

5.1 Packaging. For acquisition purposes, the packaging requirements shall be as specified in the contract or order (see 6.2). When packaging of materiel is to be performed by DoD or in-house contractor personnel, these personnel need to contact the responsible packaging activity to ascertain packaging requirements. Packaging requirements are maintained by the Inventory Control Point's packaging activities within the Military Service or Defense Agency, or within the military service's system commands. Packaging data retrieval is available from the managing Military Department's or Defense Agency's automated packaging files, CD-ROM products, or by contacting the responsible packaging activity.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coat is intended for wear by female officer personnel of the United States Marine Corps.

6.2 Acquisition requirements. Acquisition documents should specify the following:

a. Title, number, and date of this specification.
b. Sizes and lengths required (see 1.2).
c. When first article inspection is required (see 3.1.1).
d. When conformance inspection is required (see 3.1.2 and 4.3).
e. Applicable Government patterns (see 3.6).
f. AQLs (see 3.10).
g. First article sampling and acceptance criteria (see 4.2.1).
h. Component and material sampling and acceptance criteria (see 4.3.1).
i. End item sampling and acceptance criteria (see 4.3.2).
j. Component and material examination and tests (see 4.4.1).
k. Visual examination inspection conditions and AQLs (see 4.4.3).
l. Dimensional examination inspection conditions and AQLs (see 4.4.4).
m. Packaging required (see 5.1).

6.3 Information requests. For access to information such as specification, patterns, drawings, and standard shade samples of cloth, go to http://www.dla.mil/TroopSupport/ClothingandTextiles/SpecRequest.aspx for the Defense Logistics Agency Troop Support's Clothing and Textile Specification/Pattern/Drawing Request form. Complete the request form and then submit the form. Requests to use equivalent materials or components or to make changes to the pattern should be sent to the contracting officer for approval by the military services.

6.4 Suggested source of supply – haircloth. A suggested source for the haircloth (see 3.3.5.1) is QST Industries, Inc., www.qst.com. A suggested source for the alternate is Cotswold Industries, www.cotswoldindustries.com. Equivalent products may be available from other sources.

6.5 Suggested source of supply – label tape. A suggested source of supply and style number for the alternate label tape (see 3.3.15) is https://eaglewright.com, style Avery Dennison 4800TWT Polyester Thermal Transfer Printable Tape. Equivalent products may be available from other sources.

6.6 Solution dyed acetate lining material. A solution dyed acetate lining material is recommended to meet the specified colorfastness requirements (see 3.3.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

6.7 Thread shade. Black AA, Cable No. 66023 of the obsolete Department of Defense (DoD) Standard Color Card for Sewing Threads or equivalent is recommended to meet the shade match requirements (see 3.3.12).

6.8 Subject term (key word) listing.

Dress

Female

Uniform

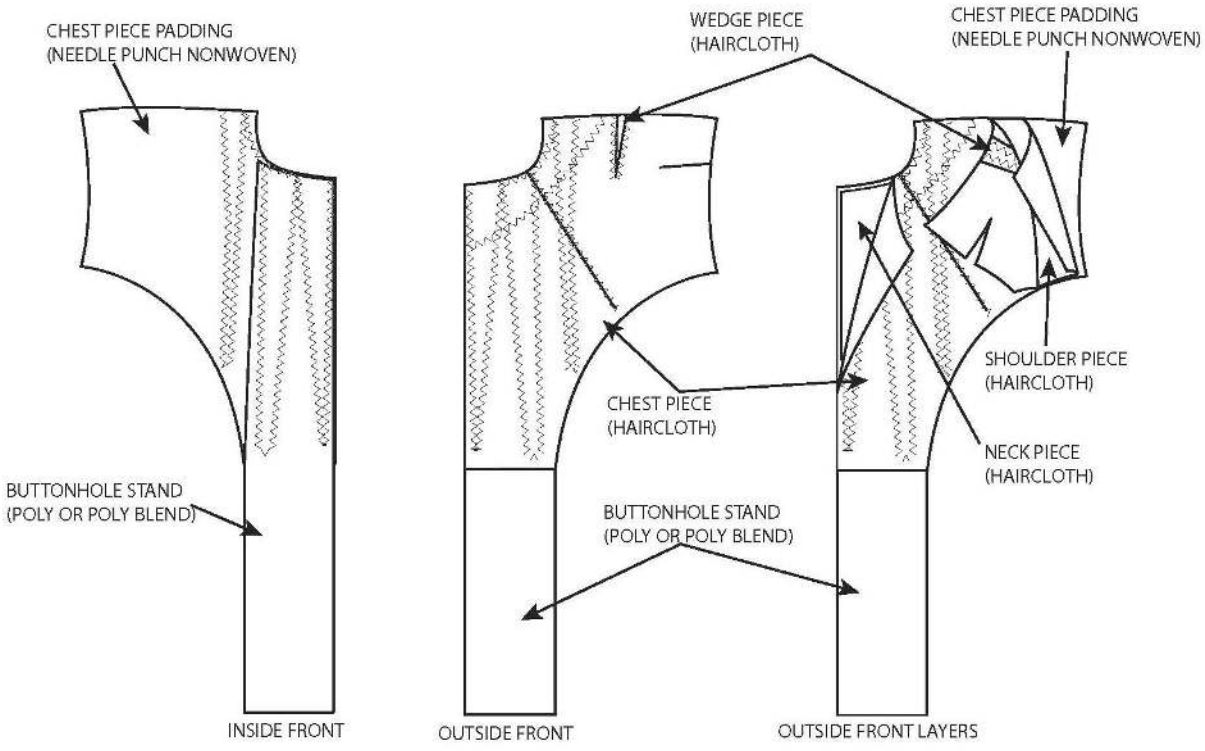


FIGURE 1. Floating chest piece.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.


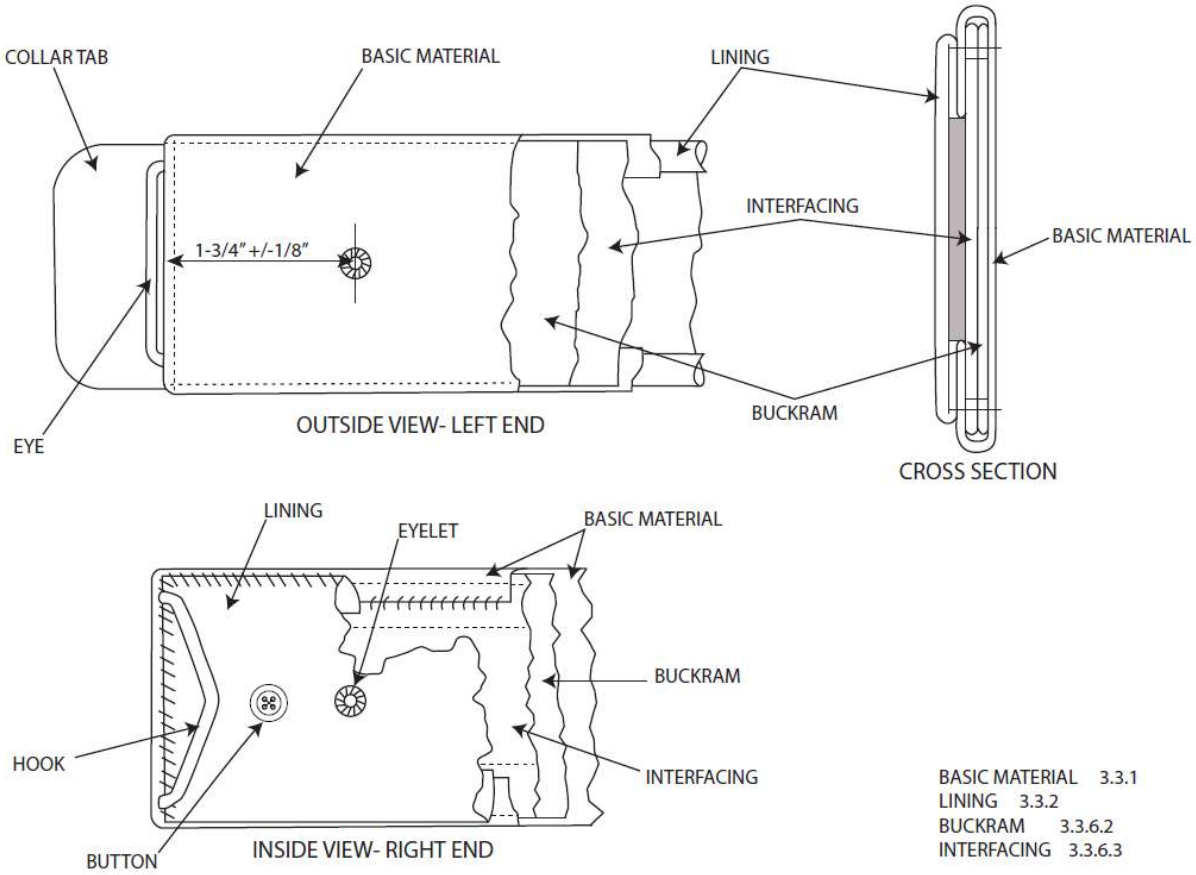


FIGURE 2. Collar.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

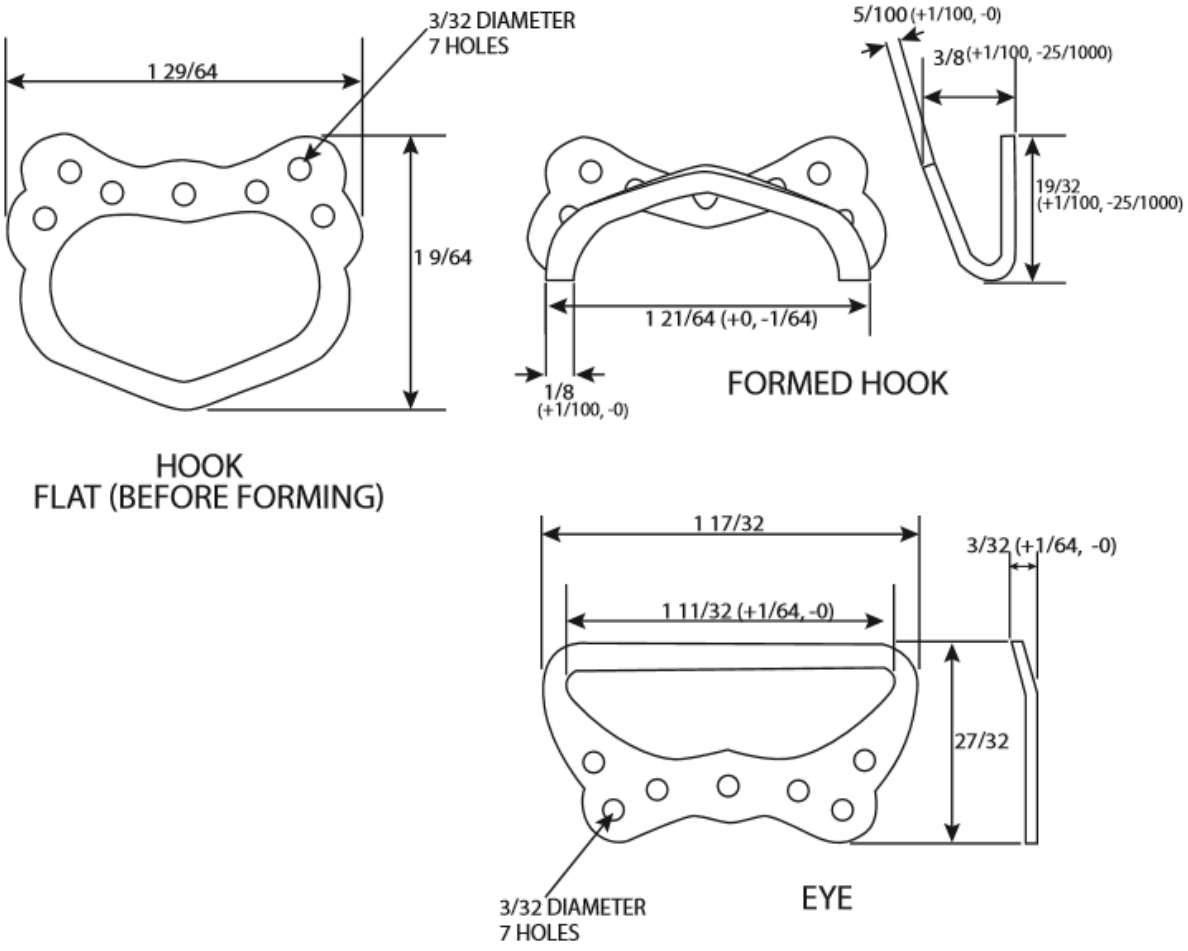

TOLERANCES: UNLESS OTHERWISE SHOWN ARE +/-1/100.
Note: All measurements are in inches.

FIGURE 3. Hook and eye.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

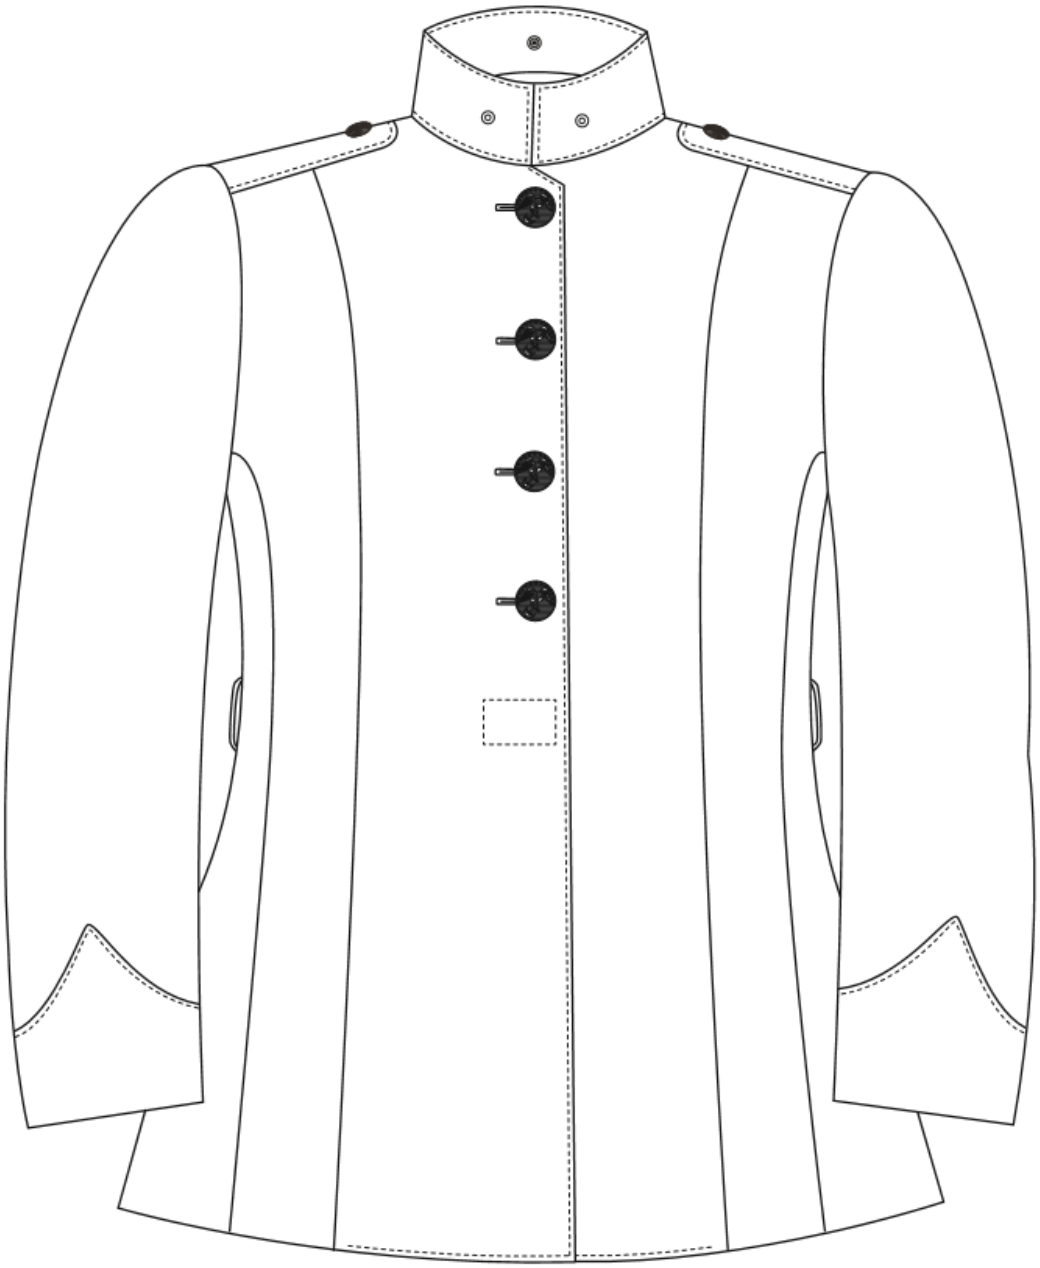


FIGURE 4. Front view – closed.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

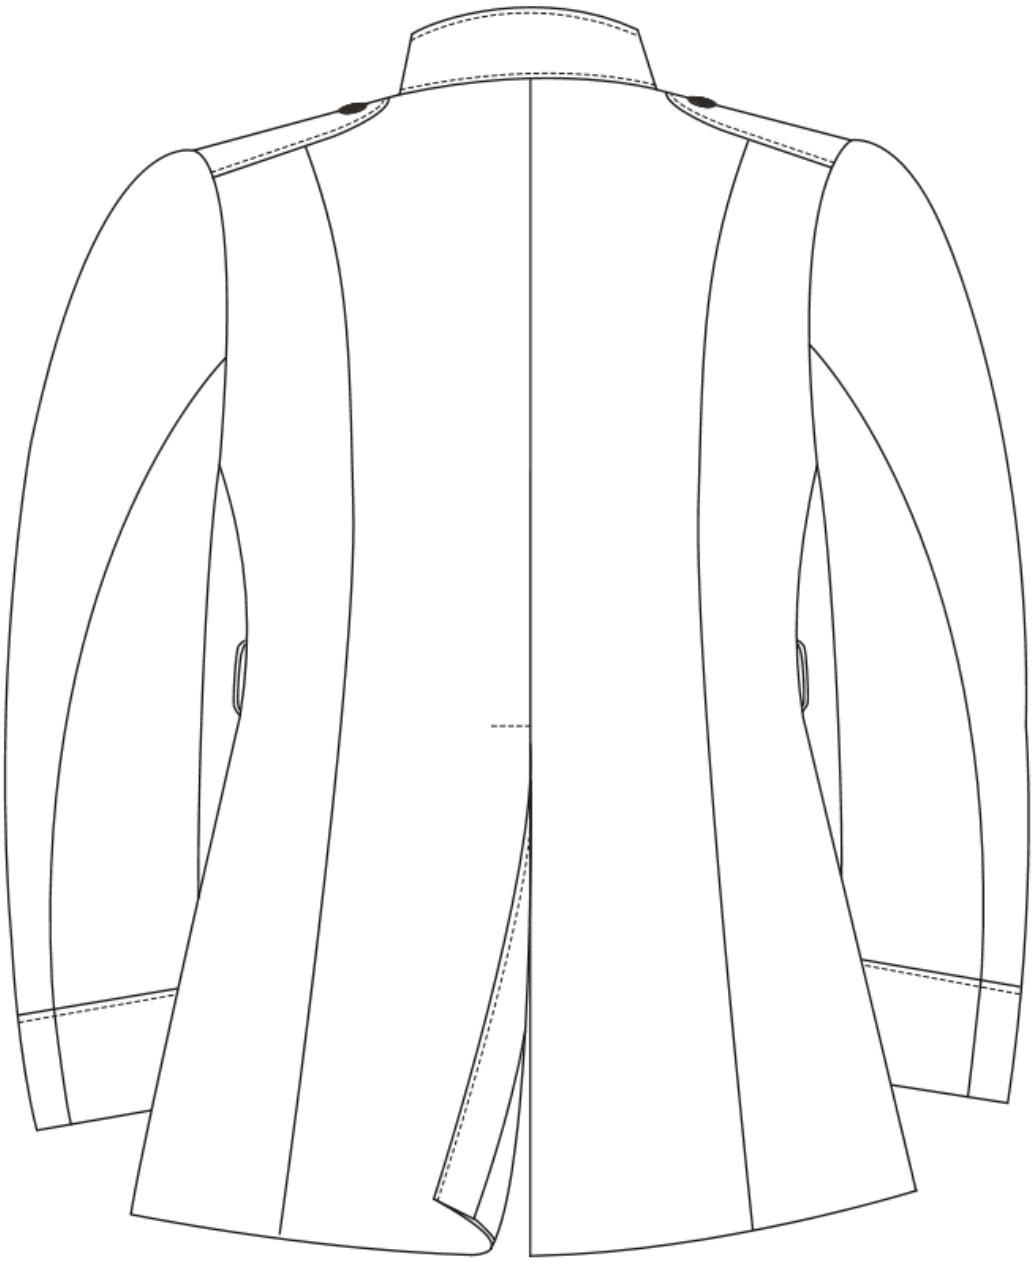


FIGURE 5. Back view.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

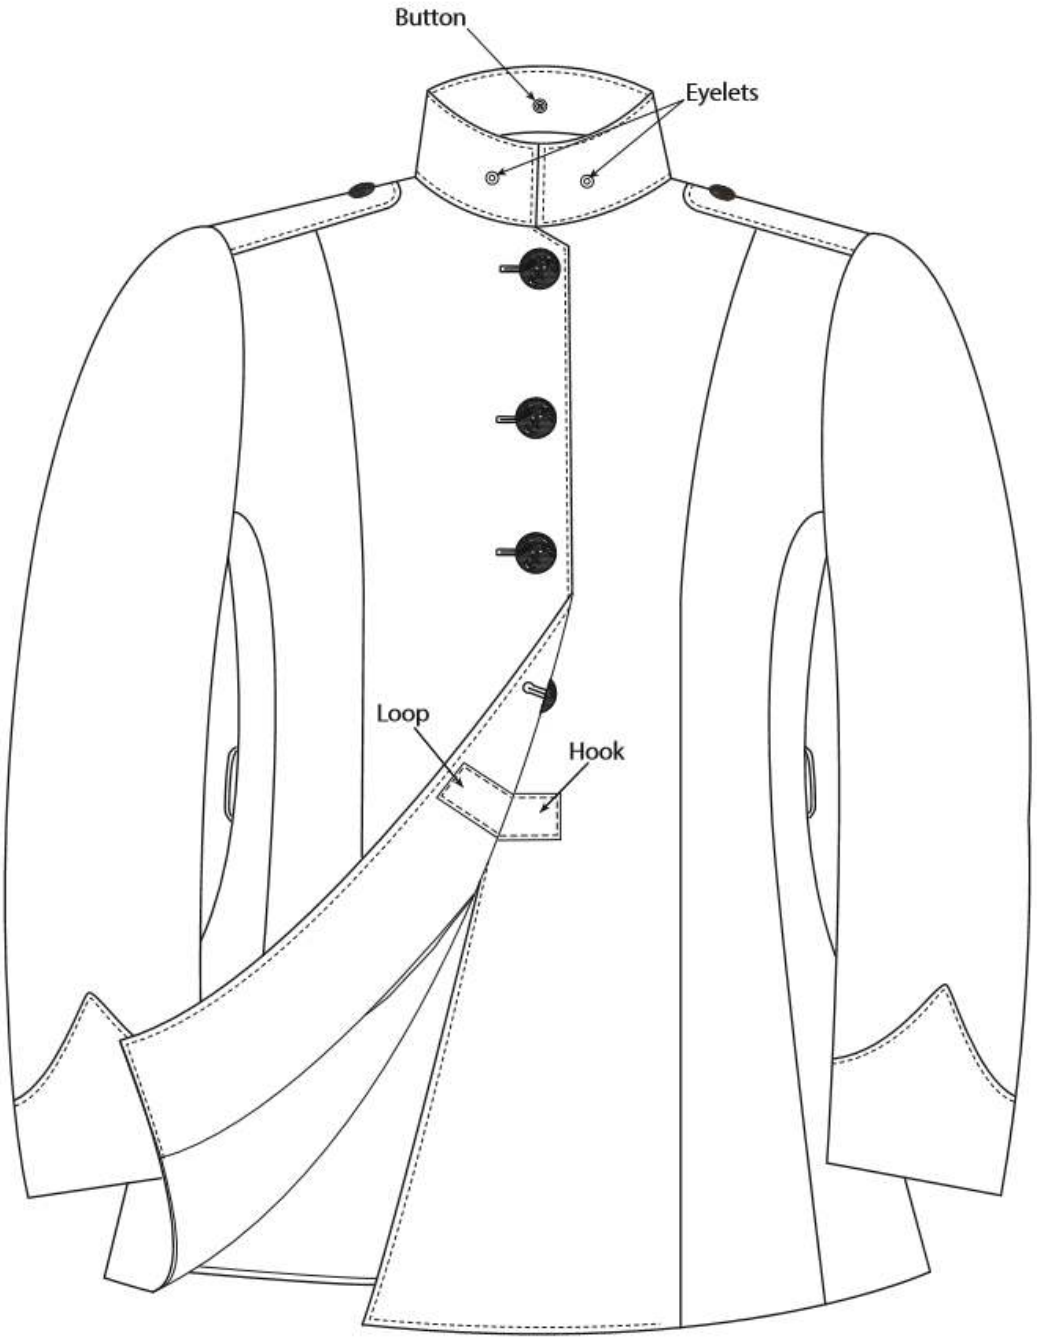


FIGURE 6. Front view – opened.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

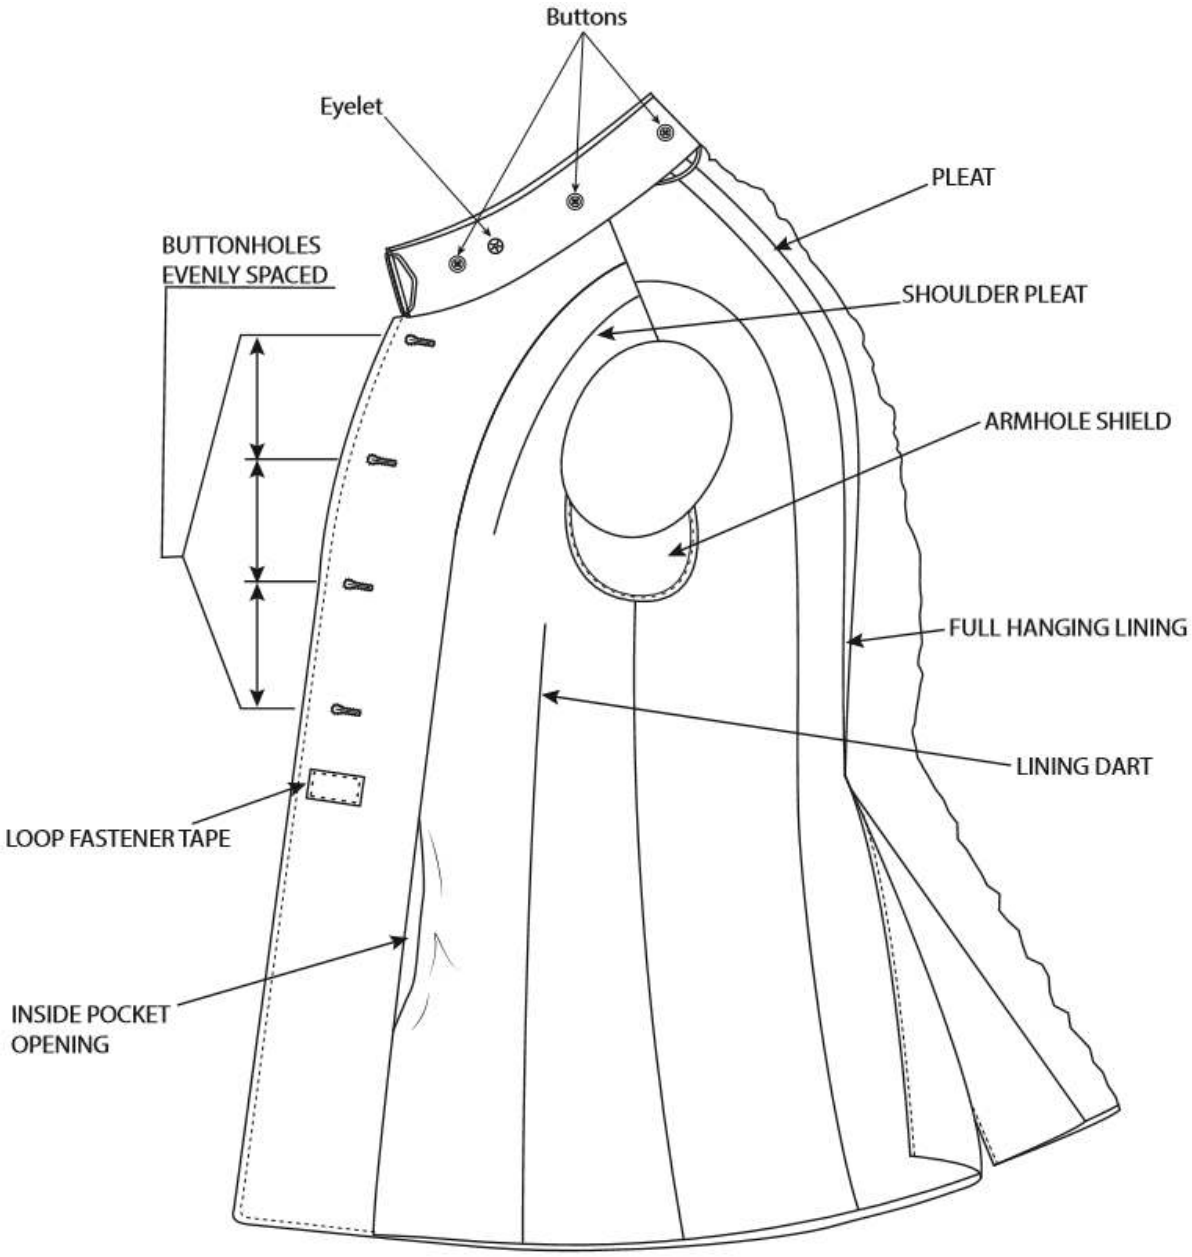


FIGURE 7. Inside view.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

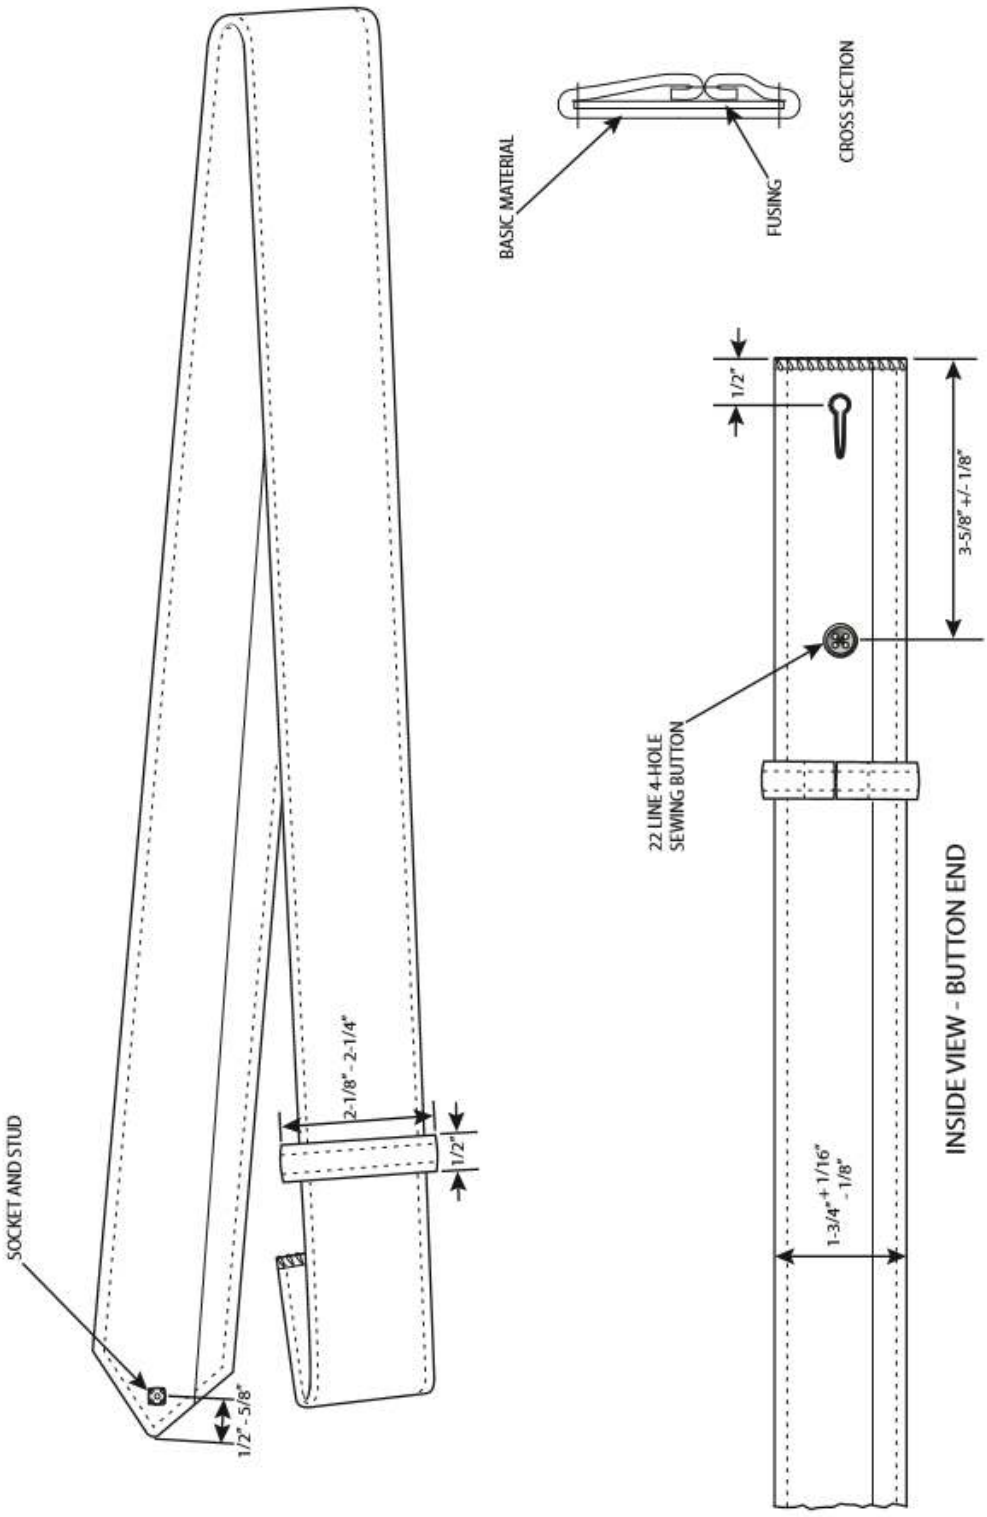


FIGURE 8. Belt.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.

CONCLUDING MATERIAL

Custodians:
Army – GL
Navy – MC

Preparing activity:
Navy – MC
(Project 8410-2020-001)

Review activities:
Army – AV, MI
Navy – CG1, NU
DLA – CT

Civil agency:
GSA – FAS

NOTE: The activities listed above were interested in this document as of the date of this document. Since organizations and responsibilities can change, you should verify the currency of the information above using the ASSIST Online database at https://assist.dla.mil.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:17Z
Check the source to verify that this is the current version before use.