MIL-H-9697(USAF)
AMENDMENT 1
30 September 1958

MILITARY SPECIFICATION

HEADSET-MICROPHONE H-163( )/U

This amendment forms a part of Military Specification
MIL-H-9697(USAF) dated 6 August 1958

Page 2, paragraph 3.2, item 1: Delete "Housing" and substitute "Assembly".
Page 2, paragraph 3.2, item 2: Delete "Housing" and substitute "Assembly".
Page 3, paragraph 3.4: Delete in its entirety and substitute the following:

"3.4 DESIGN AND CONSTRUCTION.- The headset-microphone shall consist of a headband assembly and a microphone assembly. The headband assembly shall contain two receiver assemblies. Each receiver assembly shall consist of a receiver housing and a receiver element. Receiver housings shall be attached to the headband by means of a movable metal band with an adjustment block and a metal fork. The microphone assembly shall consist of a hollow square boom anchored inside one receiver housing on one end and having a transmitter housing anchored on the other end. The transmitter housing shall contain a transmitting element. The two receiver housings and the transmitter housing shall each have a screw cap for holding the elements in place. The square boom shall contain the wiring between the transmitter and receiver elements with the wiring connected to terminals in the transmitter and receiver housing".

Page 3, paragraph 3.4.1, line 1: Delete and substitute:

"3.4.1 RECEIVER ELEMENTS.- The headset-microphone receiver elements shall be Western Electric Co. Type HC-3, or equal".

Page 3, paragraph 3.5.1: Delete "RECEIVERS"and substitute "RECEIVER".
Page 3, paragraph 3.5.1.1, line 1: Delete "receivers" and substitute "receiver".
Page 4, paragraph 3.5.1.3, line 1: Delete "receivers" and substitute "receiver".
Page 4, paragraph 3.5.1.4, line 1: Delete "receivers" and substitute "receiver".
Page 8, paragraph 3.6.1: Delete in its entirety and substitute the following:

"3.6.1 RECEIVER ASSEMBLY.- The receiver assembly shall consist of a receiver housing and a receiver element. There shall be a snug fit between the circular slot in the receiver housing and the rotating headband assembly ring to permit the microphone to remain in a desired set position."

MWM CORP. DAYTON, OHIO
3/60 250

FSC-5965

Source: https://assist.dla.mil -- Downloaded: 202610-17T13:03Z
Check the source to verify that this is the current version before use.

Page 9, paragraph 3.6.4, line 4: Delete "follows" and substitute "shown in figure 6".
Page 9, paragraph 3.6.4: Delete subparagraphs "a", "b" and "c" in their entirety.
Page 10, paragraph 4.4.2.2: Delete in its entirety.
Page 12, paragraph 4.4.5, subparagraph "a", line 5: After "element" add "or".
Page 12, paragraph 4.4.5 subparagraph "d": Delete in its entirety and substitute the following: "d". Over-voltage: After applying 10 volts at 400 cps directly across the receiver element terminals for 10 hours, the response shall be as specified in 3.5.1.4".
Page 18: Add the following new paragraph:

"4.4.8 RECEIVER HOUSING METAL BAND TEST.- The movable metal band on the receiver housing shall be given a reciprocating motion test through a 60° arc. Duration of the test shall be 10,000 cycles. At the completion of the test the microphone shall remain in any desired set position."

Page 19, paragraph 6.1, line 3: Delete "aircraft for all altitudes up to 15,000 feet". and substitute "ground communications".

RDF (RADC)
RCSSES

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T13:03Z
Check the source to verify that this is the current version before use.

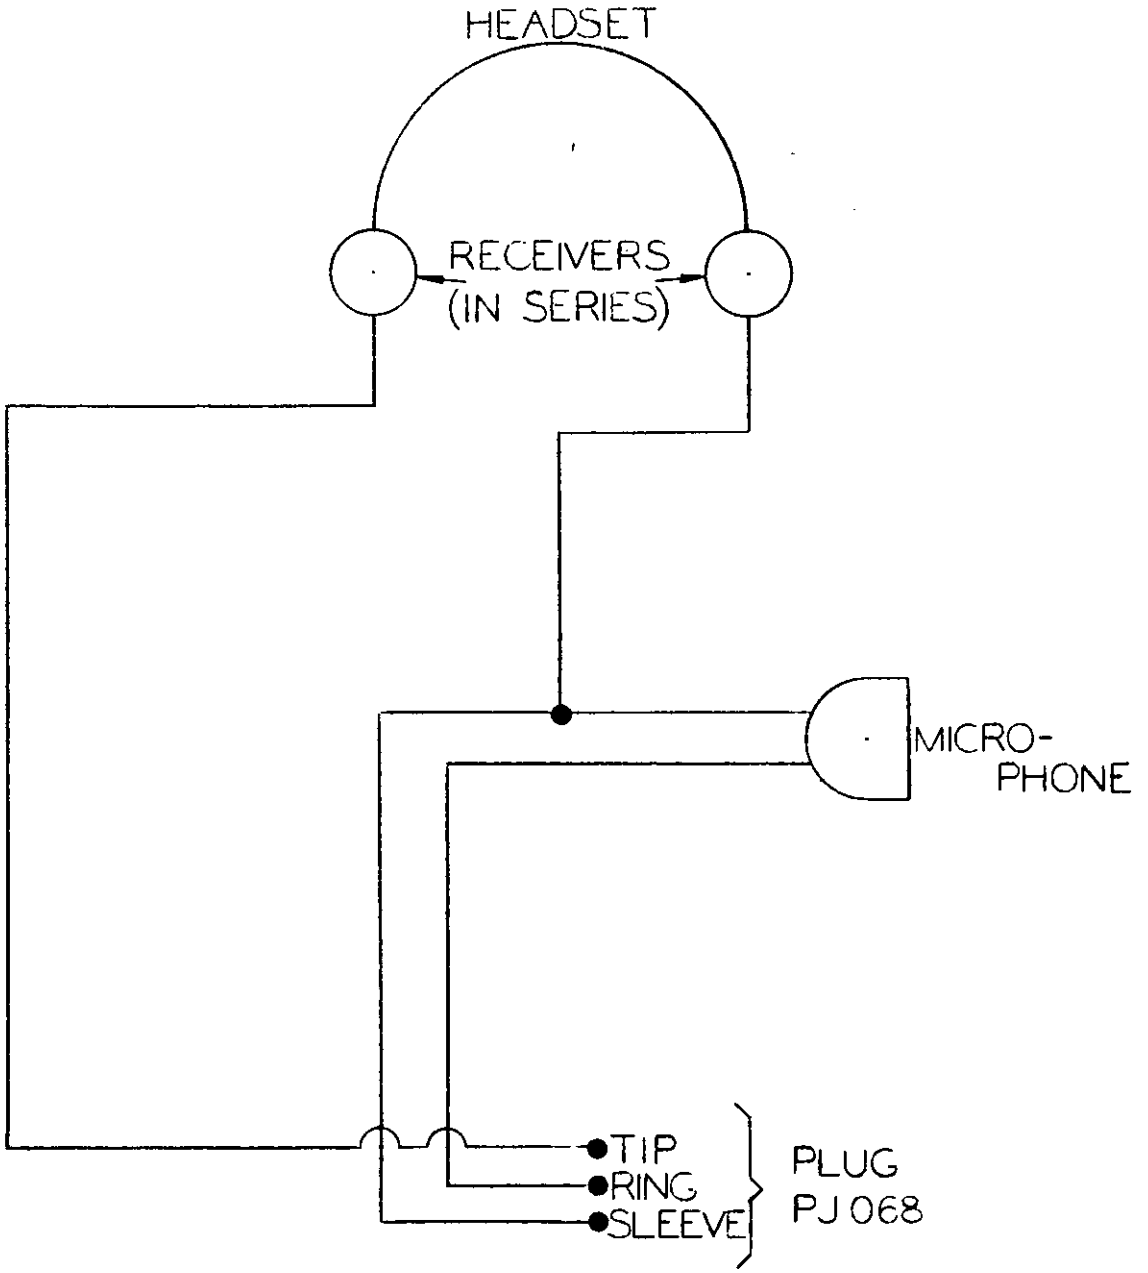


FIGURE 6. WIRING OF HEADSET-MICROPHONE

Source: https://assist.dla.mil -- Downloaded: 202610-17T13:03Z
Check the source to verify that this is the current version before use.