MILITARY SPECIFICATION

VOLTAGE REGULATOR ASSEMBLY

DL 2540850

(For Guidance Control Test Set Mk 443 Mod 0 and Mod 1)

This amendment forms a part of Military Specification MIL-V-82568(OS) of 12 September 1968 and has been approved by the Naval Ordnance Systems Command, Department of the Navy.

Wherever it appears in specification delete "Bureau of Naval Weapons" and substitute "Naval Ordnance Systems Command"; also delete "BuWeps" and substitute "NAVORD".

Page 1, paragraph 2.1 under "SPECIFICATIONS, Federal": Delete "PP-B-636" and substitute "PPP-B-636".

Page 1, paragraph 2.1, under "SPECIFICATIONS, Military": Delete "MIL-S-901" and associated title.

Page 2, paragraph 2.1, under "STANDARDS, Military". Add:

"MIL-STD-202 Test Methods for Electronic and Electrical Component Parts:"

* Page 2, paragraph 2.1, under "DRAWINGS": Delete "DL 2452605" and substitute "LD 547003".

Page 3, paragraph 3.3.2, first sentence. Delete and substitute:
"The output voltage between P1-3 and P1-4 (negative) and P1-7 (positive), shall be adjustable from 18.5 ±1.5 vdc to 31.5 ±1.5 vdc."

Page 3, paragraph 3.4.2. Delete and substitute:
"3.4.2 Shock (see 6.3.2). The assembly shall be capable of withstanding shock as specified in MIL-STD-202, Method 213A, test condition J."

FSC 1355

Source: https://assist.dla.mil -- Downloaded: 202610-23T07:15Z
Check the source to verify that this is the current version before use.

Page 4, paragraph 4.1. Delete and substitute:
"4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements."


Page 6, paragraph 4.5.2.2. Delete and substitute:
"4.5.2.2 Shock. Subject the assembly to shock test as specified in MIL-STD-202, Method 213A, test condition J."

Page 9, Table I, lower section. Add the following:


R3	Resistor, 3 ohm, 210w	RW47V3R0	1

Page 10, Figure 2. Revise value of "R3" as follows:

FROM:

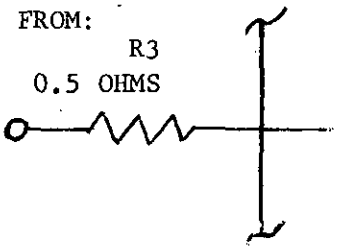

TO:

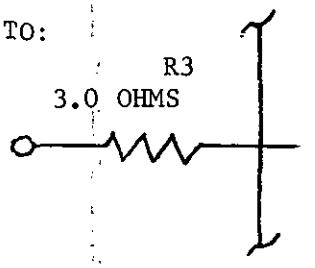

Page 11, paragraph 4.7.3.2.1: Delete "-18.0 ±1.5 vdc" and substitute "-18.5 ±1.5 vdc".

Page 11, paragraph 4.7.3.2.2. After paragraph, add new paragraph:
"4.7.3.2.3 Set VOLTAGE ADJ control for digital voltmeter indication of -25.0 ±0.5 vdc."

Page 11, paragraph 4.7.3.3.1: Delete "in 4.7.3.2.2" and substitute "in 4.7.3.2.3".

Page 11, paragraph 4.7.3.4.1. Delete and substitute:
"4.7.3.4.1 Hold switch S1 to 5 OHMS position. Adjust power supply output from -37.6 to -42.4 vdc, while observing output voltage on digital voltmeter. The output voltage shall remain within ±0.5 vdc of indication in 4.7.3.2.3. Release switch S1."

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T07:15Z
Check the source to verify that this is the current version before use.

Page 11, paragraph 4.7.3.4.1. After paragraph, add new paragraph as follows:

"4.7.3.4.2 Adjust power supply for a -40.0 ± 0.5 vdc indication on digital voltmeter."

Page 11, paragraph 4.7.3.5.1. Delete and substitute:

"4.7.3.5.1 Hold switch S1 to the 3.0 OHM position. Digital voltmeter shall indicate a maximum -24.0 vdc for more than 2 seconds but less than 5 seconds. Release switch S1."

APPENDIX page (2), paragraph 10.3.2.1. Add the following data:

"VOLTAGE ADJ control	4.7.3.2.3	-24.5 to -25.5 vdc"

APPENDIX page (2), paragraph 10.3.2.2, under "Limits" column. Delete and substitute:

"±0.5 vdc of 4.7.3.2.3"

APPENDIX page (2), paragraph 10.3.2.3, under "Limits" column. Delete and substitute:

"±0.5 vdc of 4.7.3.2.3"

APPENDIX page (2), paragraph 10.3.2.4, under "Limits" column. Delete and substitute:

"-24.0 vdc max"

The margins of this amendment are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

Custodian:
Navy - OS

Preparing Activity
Navy - OS
Project No. N1355-N301

Source: https://assist.dla.mil -- Downloaded: 202610-23T07:15Z
Check the source to verify that this is the current version before use.