NOTE: The document identifier and heading have been changed on this page to reflect that this is a performance specification. There are no other changes to this document. The document identifier on subsequent pages has not been changed, but will be changed the next time this document is revised.

INCH-POUND

MIL-PRF-83536/4
AMENDMENT 2
10 July 1999
SUPERSEDING
AMENDMENT 1
15 December 1995

PERFORMANCE SPECIFICATION SHEET

RELAYS, ELECTROMAGNETIC, ESTABLISHED RELIABILITY, DPDT,
LOW LEVEL TO 5 AMPERES, PERMANENT MAGNET DRIVE, MAGNETIC LATCH,
HERMETICALLY SEALED, ALL WELDED, TRANSIENT SUPPRESSED DC COILS

This amendment forms a part of MIL-PRF-83536/4, dated 27 March 1992, and is approved for use by all Departments and Agencies of the Department of Defense.

PAGE 1

FIGURE 1, side view: Delete "SERIAL NUMBER SHALL BE MARKED ON TOP OF RELAYS".

PAGE 2

FIGURE 1, side view: Delete "SERIAL NUMBER SHALL BE MARKED ON TOP OF RELAYS".

PAGE 4

FIGURE 1, add the following circuit diagram:

"

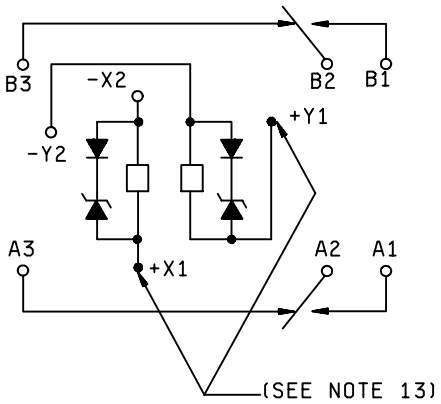

CIRCUIT DIAGRAM
(OPTIONAL INTERNAL
DIODE CONFIGURATION)

TO CLOSE A1 AND B1 CONTACTS (OPERATE)
ENERGIZE X1 AND X2
TO CLOSE A3 AND B3 CONTACT (RESET)
ENERGIZE Y1 AND Y2

"

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:43Z
Check the source to verify that this is the current version before use.

PAGE 5

* NOTE 9, delete and substitute “9. Socket pin terminals shall provide the operational, environmental, and interface characteristics to provide a reliable interconnect to gold-plated contacts. Terminals, except the polarizing pin, shall be gold plated. One system for gold plating that may be used is ASTM B488, type 3, class 1.25 with a nickel underplate of 50 to 150 microinches thick. The gold plating system shall enable the product to meet the performance requirements of this specification and shall be approved by the qualifying activity.”

* NOTE 10, delete and substitute “10. Gasket shall provide a reliable seal between the relay and mating socket that will meet the environmental, operational, and interface requirements of the relay with the mating socket. The gasket shall have shore hardness 15 to 35, thickness .050 ±.005. Gasket material according to AMS 3332 has been considered acceptable.”

PAGE 6

Delete "Contact voltage drop or resistance:" and substitute "Contact voltage drop and resistance:".

PAGE 8

TABLE III, Coil resistance (ohms) minimum column, 6 V dc rated coil voltage (3 places): Delete "40" and substitute "38" (3 places).

TABLE III, column headings: Delete "Specified pickup voltage" and substitute "Specified latch/reset voltage" (2 places).

PAGE 9

Vibration (random), line 2: Delete "15 minutes each plane".

Weight: Delete "(16.34 g's)" and substitute "(16.34 grams)".

The margins of this amendment are marked with asterisks to indicate where changes from the previous amendment were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous amendment.

Custodians:
Army - CR
Navy - EC
Air Force – 11
DLA – CC

Preparing activity:
DLA - CC

(Project 5945-1059-05)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:43Z
Check the source to verify that this is the current version before use.