NOTE: The document identifier and heading have been changed on this page to reflect that this is a performance specification. There are no other changes to this document. The document identifier on subsequent pages has not been changed, but will be changed the next time this document is revised.

INCH-POUND

MIL-PRF-83536/9
AMENDMENT 3
10 July 1999
SUPERSEDING
AMENDMENT 2
29 March 1996

PERFORMANCE SPECIFICATION SHEET

RELAYS, ELECTROMAGNETIC, ESTABLISHED RELIABILITY, DPDT,
LOW LEVEL TO 10 AMPERES, PERMANENT MAGNET DRIVE,
HERMETICALLY SEALED, ALL WELDED, DC COILS

This amendment forms a part of MIL-PRF-83536/9, dated 27 March 1992, and is approved for use by all Departments and Agencies of the Department of Defense.

PAGE 1

FIGURE 1, side view: Delete "SERIAL NUMBER SHALL BE MARKED ON TOP OF RELAYS" and "MARKING (EITHER SIDE)".

PAGE 2

FIGURE 1, side view: Delete "SERIAL NUMBER SHALL BE MARKED ON TOP OF RELAYS" and "MARKING (EITHER SIDE)".

PAGE 3

FIGURE 1, side view: Delete "SERIAL NUMBER SHALL BE MARKED ON TOP OF RELAYS".

FIGURE 1, side view: Delete "MARKING (EITHER SIDE)" and substitute "MARKING (SEE NOTES 8 AND 9)".

PAGE 4

FIGURE 1, socket pin diagram, delete and substitute:

"

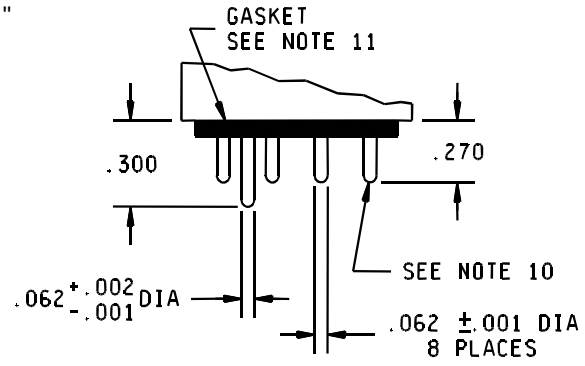

SOCKET PIN

"

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:45Z
Check the source to verify that this is the current version before use.

PAGE 7

* NOTE 10, delete and substitute “10. Socket pin terminals shall provide the operational, environmental, and interface characteristics to provide a reliable interconnect to gold-plated contacts. Terminals, except the polarizing pin, shall be gold plated. One system for gold plating that may be used is ASTM B488, type 3, class 1.25 with a nickel underplate of 50 to 150 microinches thick. The gold plating system shall enable the product to meet the performance requirements of this specification and shall be approved by the qualifying activity.”

* NOTE 11, delete and substitute “11. Gasket shall provide a reliable seal between the relay and mating socket that will meet the environmental, operational, and interface requirements of the relay with the mating socket. The gasket shall have shore hardness 15 to 35, thickness .050 ±.005. Gasket material according to AMS 3332 has been considered acceptable.”

PAGE 8

Delete "Contact voltage drop or resistance:" and substitute "Contact voltage drop and resistance:".

PAGE 10

TABLE III, mount column: For dash numbers 028 and 029, change "HFM" to "RVFM".

PAGE 12

Vibration (random), line 2: Delete "15 minutes each plane". Add: "For -028 and -029, use test condition IH, except that power spectral density shall be 0.65 G^2/Hz."

Weight: Delete "(46 g's)" and substitute "(46 grams)".

The margins of this amendment are marked with asterisks to indicate where changes (additions, modifications, corrections, or deletions) from the previous amendment were made. This was done as a convenience only, and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content, irrespective of the marginal notations and relationship to the last previous amendment.

Custodians:
Army - CR
Navy - EC
Air Force - 11
DLA - CC

Preparing activity:
DLA - CC

(Project 5945-1059-11)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:45Z
Check the source to verify that this is the current version before use.