INCH-POUND
MIL-DTL-32732
8 February 2023
SUPERSEDING
PD-FDBCE
16 October 2017

DETAIL SPECIFICATION

COAT, WOMAN'S – POLYESTER/WOOL, GABARDINE, BLUE, ENLISTED

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This document covers a blue, polyester/wool gabardine woman's dress coat worn by female enlisted personnel of the United States Marine Corps.

1.2 Classification. The coat is of one type in the sizes and lengths indicated in table I, as specified (see 6.2).

TABLE I. Schedule of sizes and lengths.

Lengths	Extra Short	Short	Regular	Long	Extra Long
Sizes	X0	X0	X0	X0	X0
	2	2	2	2	2
	4	4	4	4	4
	6	6	6	6	6
	8	8	8	8	8
	10	10	10	10	10
	12	12	12	12	12
	14	14	14	14	14
	16	16	16	16	16
	18	18	18	18	18

2. APPLICABLE DOCUMENTS

2.1 General. The documents listed in this section are specified in sections 3 and 4 of this specification. This section does not include documents cited in other sections of this specification or recommended for additional information or as examples. While every effort has been made to ensure the completeness of this list, document users are cautioned that they must meet all specified requirements of documents cited in sections 3 and 4 of this specification, whether or not they are listed.

Comments, suggestions, or questions on this document should be addressed to Marine Corps Systems Command, 2200 Lester Street, Quantico, VA 22134 ATTN: SEAL-SE-STDS or emailed to USMC_STDZ@usmc.mil. Since contact information can change, you may want to verify the currency of this address information using the ASSIST Online database at https://assist.dla.mil.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release. Distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

2.2 Government documents.

2.2.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those cited in the solicitation or contract.

COMMERCIAL ITEM DESCRIPTIONS

A-A-50198 - Thread, Gimp, Cotton, Buttonhole

A-A-50199 - Thread, Polyester Core, Cotton or Polyester-Covered

A-A-52071 - Tape, Textile, Cotton, General Purpose

A-A-52106 - Cloth, Twill or Plain Weave, Polyester and Polyester Blend

A-A-55126 - Fastener Tapes, Hook and Loop, Synthetic

A-A-59826 - Thread, Nylon

A-A-59992 - Cloth, Interfacings: Woven, Cotton and Synthetic

DEPARTMENT OF DEFENSE SPECIFICATIONS

MIL-DTL-371 - Braid, Textile, Tubular

MIL-B-3461 - Button, Insignia, Metal, Uniform and Cap

MIL-DTL-10176 - Cloth, Gabardine: Wool, Polyester and Wool

MIL-DTL-15064 - Pad, Shoulder and Sleeve-Head

MIL-C-15065 - Coat Fronts

MIL-DTL-29405 - Cloth, Broadcloth: Wool and Wool/Nylon

MIL-DTL-32075 - Label: For Clothing, Equipage, and Tentage, (General Use)

MIL-C-44296 - Cloth, Fusibles

DEPARTMENT OF DEFENSE STANDARDS

MIL-STD-984 - Provisions for Size Labeling for Women's Uniform Clothing

(Copies of these documents are available online at https://quicksearch.dla.mil/.)

2.3 Non-Government publications. The following documents form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those cited in the solicitation or contract.

AMERICAN ASSOCIATION OF TEXTILE CHEMISTS AND COLORISTS (AATCC)

AATCC TM8 - Colorfastness to Crocking: Crockmeter Method

AATCC TM15 - Colorfastness to Perspiration

AATCC TM20A - Test Method for Fiber Analysis: Quantitative

AATCC TM132 - Colorfastness to Drycleaning

AATCC TM158 - Dimensional Changes on Drycleaning, Perchloroethylene

(Copies of these documents are available online at www.aatcc.org.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

AMERICAN SOCIETY FOR QUALITY (ASQ)

ASQ/ANSI Z1.4 - Sampling Procedures and Tables for Inspection by Attributes

(Copies of this document are available online at www.asq.org.)

ASTM INTERNATIONAL

ASTM D1777 - Standard Test Method for Thickness of Textile Materials

ASTM D3775 - Standard Test Method for End (Warp) and Pick (Filling) Count of Woven Fabrics

ASTM D3776/D3776M - Standard Test Methods for Mass Per Unit Area (Weight) of Fabric

ASTM D5034 - Standard Test Method for Breaking Strength and Elongation of Textile Fabrics (Grab Test)

ASTM D6193 - Standard Practice for Stitches and Seams

(Copies of these documents are available online at www.astm.org.)

SAE INTERNATIONAL

AMS-STD-595 - Colors Used in Government Procurement

AMS-STD-595/31348 - Scarlet 2501

AMS-STD-595/35040 - Dark Blue 2312

(Copies of these documents are available online at www.sae.org.)

2.4 Order of precedence. Unless otherwise noted herein or in the contract, in the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Inspections.

3.1.1 First article. When specified (see 6.2), a sample shall be subjected to first article inspection in accordance with 4.2.

3.1.2 Conformance inspection. When specified (see 6.2), a sample shall be subjected to a conformance inspection in accordance with 4.3.

3.2 Recycled, recovered, environmentally preferable, or biobased materials. Recycled, recovered, environmentally preferable, or biobased materials should be used to the maximum extent possible, provided that the material meets or exceeds the operational and maintenance requirements, and promotes economically advantageous life cycle costs.

3.3 Design. The coat is in the United States Marine Corps design described in table II and as shown on figures 1 through 7.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE II. Coat design.

Design Feature	Detail
Body	Fitted
	Six-panel front
	Four-panel back
	Fully lined
Front closure	Single-breasted
	Six insignia buttons (buttonholes positioned on the right front and buttons sewn on the left front)
	Hook and loop fastener tape closure at the waist (hook on the left front and loop on the right facing)
Collar	Stand-up collar
	Closed by hook and eye closure
	Eyelet and eyelet covering piece at each end of collar
Sleeves	Long sleeves
	Ornamental sleeve pieces with insignia buttons
	Fully lined
Shoulder straps	Stitched down shoulder straps with insignia buttons
Vent	Center back vent
Belt loops	Positioned on each side seam at the waist
Piping	Top and bottom edges of the collar
	Right front
	Bottom edges
	Shoulder strap edges
	Top, bottom, and back edges of the ornamental sleeve pieces

3.4 Materials and components.

3.4.1 Basic material. The basic material for the coat, including the binding for the upper edge of the collar interfacing, shall be a polyester/wool gabardine, 6.8-ounce-per-square-yard cloth, dark blue shade 2312 (AMS-STD-595/35040), conforming to MIL-DTL-10176, type II, class 12 when tested as specified in 4.4.1.

3.4.2 Lining. The material for lining the coat body, sleeves, collar, and vent and for the collar eyelet covers shall be an acetate lining material, twill, or satin (alternate) weave, conforming to the requirements specified in table III below when tested as specified in 4.4.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE III. Lining requirements.

Characteristic	Twill Requirement	Satin Requirement
Shade	Good match to basic material	
Fiber identification	Acetate	
Yarns per inch (minimum)		
Warp	120	288
Filling	68	68
Weight, ounces per square yard (minimum)	3.8	4.9
Breaking strength, pounds (minimum)		
Dry: Warp	74	83
Dry: Filling	49	117
Wet: Warp	54	54
Wet: Filling	34	77
Colorfastness to perspiration, rating (minimum) (see 6.7)		
Color change	5	5
Staining on cotton	3.5	5
Staining on wool	4.5	5
Colorfastness to drycleaning, rating (minimum) (see 6.7)		
Color change	4.5	5
Staining on cotton	4.5	5
Staining on wool	4.5	5
Colorfastness to crocking, rating (minimum) (see 6.7)	4.5	4.5
Dimensional stability to drycleaning, percent (maximum)		
Individual sample unit	±3.5	±3.5
Lot average	±3.0	±3.0

3.4.3 Stay pieces. The material for the stay pieces for the armhole and shoulder seams shall be a black polyester or polyester/cotton twill or plain weave cloth conforming to A-A-52106, class 1 when tested as specified in 4.4.1. The requirement for seam efficiency in A-A-52106 shall not apply.

3.4.4 Fusible interfacings. The fusible interfacings shall be applied in accordance with the fusible manufacturer's recommended time, temperature, and pressure settings.

3.4.4.1 Front and side panels, center back neck, and center vent. The fusible interfacing for the front and side panels, center back neck, and center vent shall be a weft inserted knit cloth conforming to MIL-C-44296, type III, class 1, style B when tested as specified in 4.4.1. The color shall be black or charcoal grey.

3.4.4.2 Front facings, shoulder straps, ornamental sleeve pieces, top sleeves, and under sleeves. The fusible interfacing for the front facings, shoulder straps, ornamental sleeve pieces, top sleeves, and under sleeves shall be a black or charcoal grey non-woven fusible interfacing conforming to MIL-C-44296, type V or VI, class 1, style A or B or type VIII, class 1, style A when tested as specified in 4.4.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

3.4.5 Floating chest piece. As specified in 3.6, the chest piece will be constructed from the materials specified in 3.4.5.1 through 3.4.5.3, when tested as specified in 4.4.1. The finished chest piece should resemble the item illustrated on figure 1.

3.4.5.1 Haircloth. The haircloth (see 6.4) for the chest piece, shoulder piece, wedge piece, and neck piece shall conform to the requirements of MIL-C-15065 when tested as specified in 4.4.1.

3.4.5.2 Chest piece padding. The padding for the chest piece shall be a polyester, needle punched, non-woven material conforming to the requirements specified in table IV, when tested as specified in 4.4.1 and 4.4.1.1.

TABLE IV. Chest piece padding requirements.

Characteristic	Requirement
Fiber identification	100% polyester
Color	Unbleached
Construction	Needle punched non-woven
Weight (minimum)	3.4 ounces per square yard
Thickness (minimum)	
Initial	0.055 inch
After 3 drycleanings and steam pressings	0.065 inch
Breaking strength (minimum)	
Machine direction	20 pounds
Cross direction	40 pounds
Shrinkage after 3 drycleanings and steam pressings (maximum)	
Machine direction	4.0%
Cross direction	2.5%

3.4.5.3 Buttonhole stand. The material for the buttonhole stand shall be a black polyester or polyester/cotton twill or plain weave cloth conforming to A-A-52106, class 1 when tested as specified in 4.4.1. The requirement for seam efficiency of A-A-52106 shall not apply.

3.4.6 Collar. The collar, as depicted on figure 2, will be constructed in accordance with the requirements stated in operations 6 through 11 and operations 52 through 53 of 3.7.

3.4.6.1 Collar padding. The material for padding the collar shall be a polyester, needle punched non-woven material conforming to the requirements specified in table V when tested as specified in 4.4.1.

TABLE V. Collar padding requirements.

Characteristic	Requirement
Fiber identification	100 percent polyester
Construction	Needle punched non-woven
Weight, ounces per square yard	4.2 to 5.0

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

3.4.6.2 Collar interfacing. The material for the interfacing of the collar shall be a 2-ply cotton buckram laminated with a starch finish, and natural in color conforming to A-A-59992, type III, class 7 when tested as specified in 4.4.1.

3.4.6.3 Collar eyelet reinforcement pieces and binding for the lower edge of the collar interfacing. The material for the collar eyelet reinforcement pieces and for binding the lower edge of the collar interfacing shall be a black polyester or polyester/cotton twill or plain weave cloth conforming to A-A-52106, class 1 when tested as specified in 4.4.1. The requirement for seam efficiency in A-A-52106 shall not apply.

3.4.6.4 Collar closure hook and eye. A known source for a hook and eye closure that has been found to be acceptable for use on the end item is provided in 6.5.

TABLE VI. Collar closure hook and eye requirements.

Characteristic	Requirement
Material	Cartridge Brass 70/30 (UNS Alloy C27000)
Design	Figure 3
Dimensions	Figure 3
Color/finish	Dull flat black
Coating type	Lacquer, clear, commercial grade
Coating application	Continuous, level, and adherent
	Completely coating the hook and eye
	Free from lint, dust, or other foreign inclusions
Coating tackiness	No tackiness
Attachment holes	Completely open, free of any lacquer or black finish
Edges and surfaces	Clean and smooth
	Free from burrs and tool marks
	No sharp edges or roughness

3.4.7 Sleeve head pads. The sleeve head pads shall conform to MIL-DTL-15064, type IV when tested as specified in 4.4.1. As an option, the sleeve head may be provided on a continuous roll and cut to the required length.

3.4.8 Shoulder pads. The shoulder pads shall conform to MIL-DTL-15064, type III, class 1 when tested as specified in 4.4.1.

3.4.9 Hanger loop. The hanger loop shall be made from a black, cotton, tubular, flat braid, 1/8- to 3/16-inch wide, with a minimum breaking strength of 50 pounds conforming to MIL-DTL-371, type VIII, class 1 when tested as specified in 4.4.1.

3.4.10 Armhole shield binding. The binding for the armhole shields shall be bias cut from the lining material specified in 3.4.2 when tested as specified in 4.4.1. The cut binding material shall be 3/4 to 1 inch wide and the edges shall be finished to prevent unravelling.

3.4.11 Scarlet piping. The material used for the piping on the following areas shall be a wool broadcloth, matching scarlet shade 2501 (AMS-STD-595/31348), conforming to MIL-DTL-29405, type I when tested as specified in 4.4.1:

a. The shoulder straps

b. The upper and lower edges of the collar

c. The upper, lower, and back edges of the ornamental sleeve pieces

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

d. The left bottom edge of the coat

e. The right bottom and right front edges of the coat

3.4.12 Tapes.

3.4.12.1 Woven tape. The armholes shall be taped with a 1/4-inch wide, plain weave, unbleached cotton tape conforming to A-A-52071, type II, class 1 when tested as specified in 4.4.1. Or as an alternate, the tape shall be a 3/16-inch wide herringbone tape conforming to A-A-52071, with 58 picks per inch when tested as specified in 4.4.1.

3.4.12.2 Fusible tape. The fusible tape used to join the left facing to the left front shall conform to MIL-C-44296, type I, class 1, style B when tested as specified in 4.4.1, except it shall be cut in the filling (cross-cut) direction. The fusible tape shall be 5/8 inch wide and black or charcoal color with a thermoplastic polyamide resin.

3.4.13 Threads. The threads used in the construction of the coat shall conform to the requirements of the thread references cited in table VII when tested as specified in 4.4.1. Threads shall match the shade requirements specified in table VII.

TABLE VII. Thread requirements.

Use (Seam Type)	Description	Document	Ticket No. (Tex)	Ply	Shade
Seaming (301)	Cotton-covered polyester core	A-A-50199, type I	50 (36-45) for needle and bobbin	2	Good match to the shade of the basic material (see 3.4.1 and 6.8)
Seaming (401)	Cotton-covered polyester core	A-A-50199, type I	50 (36-45) for needle	2	Good match to the shade of the basic material (see 3.4.1 and 6.8)
			70 (31-35) for looper	2	
Overedging (504 and 505)	Cotton-covered polyester core	A-A-50199, type I	70 (31-35) for needle and looper	2	Good match to the shade of the basic material (see 3.4.1 and 6.8)
Raise, edge, and topstitching	Cotton-covered polyester core	A-A-50199, type I	50 (36-45) for needle and bobbin	2	Good match to the shade of the basic material (see 3.4.1 and 6.8)
Buttonholes	Nylon, twisted, soft finish	A-A-59826, type I, class A	Government Letter Size B (45-46)	2 or 3	Good match to the shade of the basic material (see 3.4.1 and 6.8)
			Government Letter Size F (90-101)	3 or 4	
Buttonhole reinforcement	Cotton gimp	A-A-50198, soft or glazed finish	8 (210)		Good match to the shade of the basic material (see 3.4.1 and 6.8)
Buttons	Cotton-covered polyester core	A-A-50199, type I	30 (61-70)	2 or 3	Good match to the shade of the basic material (see 3.4.1 and 6.8)
Eyelets	Nylon, twisted, soft finish	A-A-59826, type I, class A	Government Letter Size B (45-46)	2 or 3	Good match to the shade of the basic material (see 3.4.1 and 6.8)
Felling	Nylon, tailoring, twisted multiple cord, soft finish	A-A-59826, type VI	Government Letter Size O (24)	2 or 3	Good match to the shade of the basic material (see 3.4.1 and 6.8)
Felling (alternate)	Cotton-covered polyester core	A-A-50199, type I	40 (46-60)	2 or 3	Good match to the shade of the basic material (see 3.4.1 and 6.8)

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE VII. Thread requirements – Continued.

Use (Seam Type)	Description	Document	Ticket No. (Tex)	Ply	Shade
Hook and eye	Nylon, twisted, soft finish, handwaxed	A-A-59826, type I, class A 1/	Government Letter Size F (90-101)	3 or 4	Good match to the shade of the basic material (see 3.4.1 and 6.8)
Machine tacking armholes	Cotton-covered polyester core	A-A-50199, type I	30 (61-70)	2 or 3	Good match to the shade of the basic material (see 3.4.1 and 6.8)
Tacking (103 or hand)	Cotton-covered polyester core	A-A-50199, type I	50 (36-45) or	2	Good match to the shade of the basic material (see 3.4.1 and 6.8)
			70 (31-35)	2	
Basting	Commercial grade cotton, cotton-covered polyester core, nylon, or monofilament synthetic				White or clear

FOOTNOTE:

1/ The thread shall be handwaxed with a U.S.-made beeswax for a smooth, dressed surface to facilitate hand-sewing.

3.4.13.1 Colorfastness. All threads, except thread used for basting, shall show colorfastness to light, perspiration, and drycleaning equal to or better than “3-4” when tested as specified in 4.4.1.

3.4.14 Buttons.

3.4.14.1 Insignia buttons. The insignia buttons shall be metal, 24-karat gold plated, conforming to MIL-B-3461, type I, style 3, class A, subclass 1 when tested as specified in 4.4.1. The buttons for the coat front shall be 40-line and the buttons for the ornamental sleeve pieces and the shoulder straps shall be 27-line.

3.4.14.2 Split pin or ring toggles. Split pin or ring toggles for securing buttons to ornamental sleeve pieces and shoulders shall conform to MIL-B-3461when tested as specified in 4.4.1.

3.4.14.3 Reinforcement discs. The reinforcement discs for the ornamental sleeve piece and shoulder strap buttons shall be punched from cotton buckram, double texture, laminated, starch finish, natural color conforming to A-A-59992, type III class 7 when tested as specified in 4.4.1.

3.4.15 Hook and loop fastener tape. The hook and loop fastener tape for securing the waist shall conform to A-A-55126, type I, class 1 when tested as specified in 4.4.1. Colorfastness to laundering shall not apply. The color shall be black.

3.4.16 Labels. Each coat shall have a combination identification/instruction label, a separate size label, and a separate barcode label/tag conforming to the requirements below. As an alternate to the material specified in MIL-DTL-32075 for the identification/instruction label and the size label, the label material may be a 100-percent polyester-coated tape (see 6.6).

3.4.16.1 Identification/instruction label. Each coat shall have a combination identification/instruction label conforming to MIL-DTL-32075, type VI, class 15 including the colorfastness to drycleaning requirement, when tested as specified in 4.4.1. The color of the label shall be white. The label shall bear the following inscription:

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

COAT, WOMAN'S: POLYESTER/WOOL, GABARDINE, BLUE, ENLISTED

FIBER CONTENT: 55% Polyester/45% Wool (Example)

CONTRACT NO: SPO100-00-0-0000 (EXAMPLE)

LOT NO:

NAME OF CONTRACTOR:

DRY CLEAN ONLY

TO KEEP YOUR COAT LOOKING SMART,

INSIST ON IT BEING PROPERLY PRESSED

PRESSING INSTRUCTIONS:

1. AVOID PRESSING DRY OR WITH TOO HOT AN IRON.
2. REMOVE ALL GLOSS FROM EDGES AND SEAMS BY PRESSING WITH A DAMP CLOTH.
3. CREASE ONLY THE LOWER THREE-FOURTHS OF SLEEVES.

3.4.16.2 Size label. Each coat shall have a size label conforming to MIL-DTL-32075, type VI, class 2 including the colorfastness to drycleaning requirement, when tested as specified in 4.4.1. The color of the label shall be white. The inscription on the size label shall conform to MIL-STD-984, and the size label shall bear the following body dimensions. The height range shall be in accordance with 3.4.16.2.1.

EXAMPLE	SIZE CODE	12R
	BUST CIRC	38"
	HIP CIRC	40½"
	HEIGHT	63½– 67"
	NSN	8410-XX-XXX-XXXX

Note: The Marine Corps body measurements (bust and hip circumference) for each size label are contained in MIL-STD-984, and are not to be confused with the finished dimensions of the coat contained in 3.8 of this specification.

3.4.16.2.1 Height. The information in table VIII shall be cited for height, as appropriate.

TABLE VIII. Height information.

Height	Abbreviation	Inscription
Extra short	XS	Less than 60 inches (XS)
Short	S	60 to 63-1/2 (S)
Regular	R	63-1/2 to 67 (R)
Long	L	67 to 70-1/2 (L)
Extra long	XL	More than 70-1/2 inches (XL)

3.4.16.3 Barcode label/tag. Each item shall be individually barcoded with a paper label/tag conforming to MIL-DTL-32075, type VIII, class 17 when tested as specified in 4.4.1. The paper used for the tag shall have a smooth finish to accept thermal transfer and direct printing. The tag shall have a hole and shall be attached to each item by a fastener. The tag shall be clearly legible and readable by a scanner. The barcoding element shall be a 13-digit national stock number (NSN) and the appropriate 12-digit Universal Product Code (UPC) assigned to the NSN by the Government. The initials "UPC" shall appear beneath the code. The barcodes for NSN and UPC shall be a medium to high density and shall be located so that they are completely visible on the item when the item is folded or packaged as specified herein. The label's location shall cause no damage to the item.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

3.5 Figures. When inconsistencies exist between the written document and the figures, the written document shall govern. The floating chest piece (see 3.4.5) should resemble the construction shown on figure 1. The collar (see 3.4.6) should resemble the construction shown on figure 2. The collar closure hook and eye (see 3.4.6.4) should resemble the construction shown on figure 3. All figures are furnished for information purposes only.

3.6 Patterns. Standard patterns will be furnished by the Government as specified (see 6.2). Government patterns show size, seam allowances, and directional lines for cutting and are marked or notched for proper placement and assembly of component parts. The directional lines indicate the warp direction of the cloth unless otherwise indicated on the patterns. The list of pattern parts in table IX is provided to ensure that the pattern set provided is complete. The Government patterns shall not be altered in any way and shall only be used for cutting the contractor's working patterns. The working patterns shall be identical to the Government patterns, except that additional notching, if needed to facilitate manufacture for use during construction may be performed on the working patterns. Minor modifications may be made where necessary to accommodate the manufacturer's processes and the use of automated equipment, provided the modifications do not alter the dimensional, serviceability, or appearance requirements cited in the document or those governed by the standard pattern. Component parts shall be cut from the specified materials in accordance with the number of parts specified in table IX. Requirements for cutting component parts that are not included in the table IX are included in 3.7.

TABLE IX. Pattern parts.

Material	Piece Name	Cut Parts
Basic material (see 3.4.1)	Right front 1/	1
	Left front 1/	1
	Side front	2
	Side front dart	2
	Side back	2
	Center back	2
	Right front facing 1/	1
	Left front facing 1/	1
	Top sleeve	2
	Under sleeve	2
	Outer collar	1
	Armhole shield	2
	Shoulder strap	2
	Ornamental sleeve piece	2
Lining (see 3.4.2)	Front lining	2
	Right back lining	1
	Left back lining	1
	Side back lining	2
	Top sleeve lining	2
	Under sleeve lining	2
	Collar lining	1
	Collar eyelet cover lining	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE IX. Pattern parts – Continued.

Material	Piece Name	Cut Parts
Fusible interfacing (front and side panels, center back neck, and center vent): Woven or weft knit (see 3.4.4.1)	Right front fusing	1
	Left front fusing	1
	Side front fusing	2
	Side front dart fusing	2
	Center back neck fusing	2
	Center vent fusing	2
Fusible interfacing (front facings, shoulder straps, ornamental sleeve piece, and top and under sleeve): Non-woven (see 3.4.4.2)	Right front facing fusing	1
	Left front facing fusing	1
	Shoulder strap fusing	2
	Ornamental sleeve piece fusing	2
	Top sleeve fusing	2
	Under sleeve fusing	2
Collar interfacing (see 3.4.6.2)	Collar interfacing	1
Floating chest piece/haircloth (see 3.4.5.1)	Chest piece	2
	Shoulder piece	2
	Wedge piece	2
	Neck piece	2
Floating chest piece/chest piece padding (see 3.4.5.2)	Chest padding	2
Floating chest piece/buttonhole stand (see 3.4.5.3)	Buttonhole stand	2
Templates	Left vent marker	--
	Ornamental sleeve piece marker	--
	Side seam belt loop marker	--
	Shoulder strap placement marker	--
	Shoulder strap finished shaper	--
	Ornamental sleeve piece finished shaper	--

FOOTNOTE:

1/ As an option, the fronts and facings may be cut as pairs. When cut as a pair, the manufacturer should dress the right side.

3.7 Construction requirements. End item construction and appearance shall conform to the requirements in table X and table XI and the finished dimensions cited in 3.8 to maintain end item configuration as verified in 4.4.3 and 4.4.4. Following the exact sequence of operations of table XI is not required, provided the finished coat meets the finished form, fit, and function requirements as those produced by following the sequence of operations specified in table XI. Whenever two or more methods for seam or stitch types are specified for the same part of the operation, any one of the specified methods may be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE X. Construction requirements.

Construction Feature	Requirement
1. Thread	
a. Type and size	(1) See table VII.
b. Tension	(1) Maintained so that there is no tight, loose, or unbalanced stitching.
c. Shade on outside of coat	(1) Consistent thread shade on the outside of the coat. Multiple shades of thread on the outside of the coat are not allowed.
d. Breaks (all stitch types)	(1) Secured by stitching back of the break not less than 1/2 inch.
	(2) If 401 stitch type, repaired using 301 stitch type.
2. Stitches and Seams	
a. Stitches and seam types	(1) ASTM D6193.
b. Stitches per inch	(1) See table XI.
c. Overedging	(1) Knife set to trim loose threads and raveled edge without cutting the material.
d. Seams and seam allowances	(1) Maintained with seam uniformly sewn so that no raw edges, runoffs, twists, pleats, gathers, other distortions, or open seams result.
e. Edgestitching	(1) 1/16 to 1/8 inch from edge unless otherwise specified see (table XI).
f. Beginning and ending of seams	(1) Start and finish evenly.
g. Joined components	(1) Lie flat.
h. Position of the chain of 401 and 101 stitch types	(1) When used, loops of the chain finish on the inside of the coat.
i. Ends of seams and stitching - 301 stitch type	(1) If not caught in another line of stitching: backstitched not less than 1/4 inch.
	(2) If the end of a continuous line of stitching (except label): overlapped not less than 1/2 inch.
	(3) If label stitching: overlapped not less than 3 stitches.
j. Skipped stitches (301 or 401)	(1) Repaired by using 301 stitch type.
k. Additional bastings	(1) Acceptable provided the basting thread does not show on the outside of the finished item.
3. Pressing	(1) All pressing operations referenced in table X performed by using a heated pressing iron or steam pressing machine commercially intended for tailored coats
	(2) A left and right chest press, designed specifically for finish pressing, is required.
	(3) Any additional underpressing to facilitate manufacture is permissible.
4. Buttonholes	(1) Clean cut.
	(2) Stitching securely caught in fabric.
	(3) Gimp positioned to the underside.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations.

Operation	Stitch Type	Seam Type	Stitches Per Inch
1. CUT AND SHADE MARK			
a. Cut the component parts (listed in 3.6) as indicated on the patterns and in the material specified. Unless otherwise specified on the pattern, the directional line is with the warp direction of the cloth. Additional cutting requirements are provided in operations 1.b, 1.d, and 1.f through 1.l for those components not controlled by a furnished pattern piece.			
b. Cut all basic material parts (see 3.4.1) of the coat from one piece of basic material, except the belt loops, armhole shields, and front facings, which may be cut from ends. Cut the binding for the upper edge of the collar interfacing from the same piece of basic material as the outer collar, 1 inch wide and of sufficient length to comply with operation 7. The belt loops are cut 1 inch wide of sufficient length to comply with operations 4 and 26. Parts cut from ends are a good shade match to the main assembly. When armhole shields are cut from ends, the shields match each other for shade.			
c. Cut the lining (see 3.4.2) for the fronts, backs, and collar from one piece of lining material. All other lining components may be cut from ends. All sleeve lining parts (two top and two under) match in shade.			
d. Cut the two armhole and two shoulder stay pieces (see 3.4.3) on the bias, 5/8 to 3/4 inch wide and 4±1/4 inches long.			
e. Cut the fusible interfacings (see 3.4.4.1 and 3.4.4.2) in accordance with the directional lines on the patterns.			
f. Cut the collar padding (see 3.4.6.1) 1-1/4 inches wide and sufficiently long to fold over the ends of the interfacing for each collar size.			
g. Cut the binding for the lower edge of the collar interfacing (see 3.4.6.3) on the bias, 1 inch wide and of sufficient length to comply with operation 7.			
h. Cut the collar eyelet reinforcement pieces (see 3.4.6.3) not less than 2 inches long and 1-3/4 inches wide.			
i. Cut the braid for the hanger loop (see 3.4.9) of sufficient length to comply with the finished length (see operation 44).			
j. Cut the binding for the armhole shields from the bias binding (see 3.4.10), 3/4 to 1 inch wide.			
k. Cut the scarlet piping (see 3.4.11) on the straight of the cloth. The piping is cut 5/8 inch wide for the shoulder straps, collar, and ornamental sleeve pieces, and 1-1/8 inches wide for the left bottom and right bottom/front edges of the coat.			
l. Punch the reinforcement discs (see 3.4.14.3) 7/8 inch wide (diameter) with a 1/8-inch hole at the center.			
m. Dress the left vent in accordance with the left vent marker.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
n. The component parts of the coat and lining cut from one piece of basic material and lining material, respectively, and the sleeve linings cut from ends are marked or ticketed to ensure a uniform shade and size throughout the garment. The numbering does not show on the outside of the garment or on the lining and, whenever possible, is covered by the seam allowance. The use of ink pad numbering machine, rubber stamp, or pencil is allowed. The following methods are not allowed: corrosive metal fastening devices, sew-on shade tickets, adhesive type tickets that discolor or adhere to the material upon removal of the tickets.			
2. REPLACE DEFECTIVE OR DAMAGED PARTS			
a. During cutting, replace all parts containing defects such as hole, cut, tear, smash, mend, burn, scorched area, open place, loose yarn, snagged thread, area of no dye penetration, dye streak, missing yarn, broken yarn, thin place, shade bar, or woven in waste.			
b. During the manufacturing process, replace all parts damaged by needle chews, scissor or knife cuts, tears, holes, mends, or burns.			
3. APPLY FUSIBLE INTERFACING			
a. Position the fusible onto the related component part (see table IX for listing), set back 1/8 inch from edges, and fuse together in accordance with the fusible manufacturer's recommendations for time, temperature, and pressure.			
b. The fused lots are cool to the touch prior to tying into bundles.			
4. MAKE BELT LOOPS			
a. Finished appearance: each belt loop finishes 1/2±1/8 inch wide and finishes smooth and flat.			
b. Fold the sides of the strip lengthwise towards the center, abutting the raw edges together with a covering stitch. Each row of stitching is uniformly 1/8 inch from the folded edge.	406	EFh-1	10-14
c. Cut each loop for the left and right side 3-1/2±1/8 inches long.			
5. MAKE SHOULDER STRAPS			
a. Finished appearance: the shoulder strap finishes smooth, flat, and uniform in appearance and is in accordance with the shoulder strap finished shaper (including piping). The scarlet piping is uniformly stitched to the shoulder strap without twists, gather, puckers, or pleats and is uniformly worked out to the edges. In the finished coat, the piping finished 1/16 to 1/8 inch wide.			
b. The shoulder strap consists of one ply of basic material interfaced with fusible, and it is piped with scarlet broadcloth.			
c. Seam a 5/8-inch wide strip of scarlet piping to the shoulder strap, along front and back edges and around collar end, 1/8 inch from edges. OR	301	SSe-2(a)	10-14
d. Fold the scarlet piping, slightly offsetting the raw edges, and stitch to the edge of the shoulder strap, along the front, back, and collar end, 1/8 inch from the edges.	301	SSav-2(a)	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
e. Turn back the shoulder strap and scarlet piping, uniformly working the folded edge of the piping 1/8 inch beyond the ends of the shoulder strap. Topstitch the shoulder strap uniformly 3/16 inch from the folded edge of the piping through all plies. Clip the excess material at the collar end so that the shoulder strap lies flat.	301	BSm-2(b) (modified)	10-14
f. Press the shoulder strap smooth and flat with a heated pressing iron or pressing machine.			
6. MAKE COLLAR EYELET COVERS			
a. Finished appearance: the collar eyelet cover finishes 1-3/4±1/8 inches wide.			
b. Turn under the side edges of the cover and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1	10-14
c. Fold each cover in half across the width and seam 1/16 inch from the folded side edges. Continue stitching across the folded end.	301	SSc-1 (side edge) and OSf-1 (folded end)	10-14
7. ASSEMBLE COLLAR INTERFACING			
a. Finished appearance: the edges of the upper and lower binding of the collar interfacing are uniformly stitched 1/4 inch from the folded edges and are not tight or full. The interfacing and both edges of each binding are securely caught in the binding stitching. The interfacing finishes with the collar eyelet reinforcement piece positioned on the inside and the felt padding positioned on the outside of the interfacing. The collar eyelet covers are positioned so that in the finished collar, the covers are centered over the eyelets.			
b. Position the collar eyelet reinforcement piece at each end of the collar interfacing. Using a 1-inch wide strip of the basic material (see operation 1.b), bind the upper edge of the collar interfacing, stitching 1/4 inch from the folded edge. Using a 1-inch wide strip of polyester or polyester/cotton twill or plain weave material (see operation 1.g), bind the lower edge of the collar interfacing, stitching 1/4 inch from the folded edge. The collar eyelet reinforcement pieces are caught in the binding stitching.	301	BSa-1	10-14
c. Center the strip of the collar padding (see operation 1.f) on the outside of the collar interfacing with the ends of the padding sufficiently long to fold over each end of the interfacing. Stitch the padding to the interfacing from end to end, 1/8 inch from top and bottom edges of the padding.	301	SSau-2	10-14
d. Lap the raw edge of the collar eyelet cover 1/2 to 5/8 inch on the top inside edge of the collar interfacing. Stitch the cover to the interfacing 1/4 inch from the raw edge of the cover.	301	LSa-1	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
8. ATTACH SCARLET PIPING TO OUTER PLY OF COLLAR			
a. Finished appearance: the scarlet piping extends the full length of the collar along the upper and lower edges of the outer ply. The piping is uniformly stitched to the collar without twists, gathers, puckers, or pleats, and is uniformly worked out to the edges. In the finished coat, the piping finishes 1/16 to 1/8 inch wide.			
b. Seam a 5/8 inch wide strip of scarlet piping to the outer ply 1/8 inch from the upper and lower edges.	301	SSe-2	10-14
c. Turn back the piping and outer ply at the upper and lower edges, uniformly working the folded edge of the piping 1/8 inch beyond the edge of the outer ply. Topstitch the outer ply uniformly 3/16 inch from the folded edges of the piping. OR	301	BSm-2(b) (modified, each edge)	10-14
d. As an alternate to operation 8.c, fold the scarlet piping, slightly offsetting the raw edges, and seam as specified in operation 8.b. Turn the edge of the collar back and stitch through the outer ply 1/16 inch from the edge, leaving the folded edge of the slightly offset folded edge of the scarlet piping extending 1/8 inch beyond the edge of the outer ply.	301	SSav-2(a) and BSm-2(b) (modified, each edge)	10-14
9. ASSEMBLE COLLAR			
a. Finished appearance: the collar is assembled without twists, gathers, puckers, or pleats. In the finished collar, the ends of the lining extend approximately 1/2 inch beyond the right end of the collar, and approximately 2-1/2 inches beyond the left end of the collar for the extension tab. The eyelet covers are not caught in the eyelet operation.			
b. Position the outer ply of the collar on the outside of the interfacing assembly with the binding for the upper edge of the collar interfacing extending uniformly 1/8 inch beyond the scarlet piping on the top edge of the outer ply. The binding for the lower edge of the collar interfacing is not exposed beyond the scarlet piping on the bottom edge of the collar.			
c. Seam the outer ply and interfacing assembly together with a row of stitches as close as possible to, but not on top of, the topstitching at the top and bottom edges of the outer ply.	301	SSa-1	10-14
d. Lap the top inside edge of the collar assembly over the top raw edge of the collar lining approximately 1/2 inch, with the lining face up. Seam the collar to the lining with a row of stitches as close as possible to, but not on top of, the rows of stitches at the upper edge of the collar. The stitching extends from center to center of the collar eyelet covers.	301	Lsa-1	10-14
e. Smoothly fold the ends of the collar padding and the outer ply to the inside over the ends of the interfacing assembly and press smooth and flat with a heated pressing iron or pressing machine.			
f. Turn collar lining at the seam to the inside of the collar and press smooth and flat with a heated pressing iron or pressing machine.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
10. MAKE COLLAR EXTENSION TAB			
a. Finished appearance: the collar extension tab extends 3/4 to 1 inch beyond the folded edge of the left end of the collar.			
b. Turn the top and bottom edges and the end of the collar lining at the left end of the collar to the inside of the lining and baste the turned portion along the top, front, and bottom edges to the body of the lining, forming the collar extension tab.	Hand	SSc-1 (top and bottom) OSf-1 (front)	2-3
c. Stitch the collar extension tab 1/16 inch from the top, front, and bottom edges and continue the stitching at the back of tab to the top row, forming a 1-3/8- to 1-1/2-inch wide box stitch.	301	SSc-1 (top and bottom) OSf-1 (front) SSa-1 (back)	10-14
11. FELL ENDS OF OUTER PLY TO COLLAR AND MAKE EYELETS			
a. Finished appearance: the upper and lower edges at each end of the outer ply are not visible on the outside of the finished collar.			
b. Tack the ends of the outer ply to the reinforcement pieces and to the collar eyelet covers with overcast stitching.	Hand	---	2-3
c. Make an eyelet through all plies of the collar and lining midway ±1/16 inch between outer edges of the scarlet piping and 1-1/2±1/8 inches from each finished end of the collar. The finished eyelet opening finishes 1/8 inch wide.	Eyelet	---	20 (minimum)
12. MAKE ORNAMENTAL SLEEVE PIECES			
a. Finished appearance: the ornamental sleeve pieces finish smooth and flat and are uniform in appearance, and the shape is in accordance with the ornamental sleeve piece finished shaper (including piping). The scarlet piping is uniformly stitched to the ornamental sleeve piece without twists, gathers, puckers, or pleats, and is uniformly worked out to the edges. In the finished coat, the piping finishes 1/16 to 1/8 inch wide.			
b. The ornamental sleeve piece consists of one ply of basic material interfaced with fusible, and it is piped with scarlet broadcloth.			
c. Seam a 5/8-inch wide strip of scarlet piping to the ornamental sleeve piece 1/8 inch from the top, the scalloped side, and the bottom edges. OR	301	SSe-2(a)	10-14
d. As an alternate to operation 12.c, fold the scarlet piping, slightly offsetting the raw edge and seam to edges as above.	301	SSav-2(a)	10-14
e. Turn back the ornamental sleeve piece and the scarlet piping at the seamed edges, uniformly working the folded edge of the piping 1/8 inch beyond the edges of the piece. Notch the excess scarlet material at the top and lower points of the piece in order to reduce bulk. Topstitch the ornamental sleeve piece uniformly 3/16 inch from the folded edge of the piping through all plies.	301	BSm-2(b) (modified)	10-14
f. Press the ornamental sleeve piece smooth and flat with a heated pressing iron or pressing machine.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
g. Mark the ornamental sleeve piece for the location of insignia buttons as indicated by the marks on the pattern. Assemble the ornamental sleeve pieces in pairs.			
h. Punch a hole though the ornamental sleeve piece at each mark for attaching the three buttons.			
i. Insert the shanks of the 27-line insignia buttons through the punched holes of each ornamental sleeve piece and reinforcement disc and secure each button to the ornamental sleeve piece with a metal split pin or ring toggle. The reinforcement disc and toggle finish on the underside of the ornamental sleeve piece.			
13. ASSEMBLE SLEEVES AND ATTACH ORNAMENTAL SLEEVE PIECES			
a. Finished appearance: the ornamental sleeve piece is uniformly stitched to the sleeve without twists, gathers, puckers, or pleats; finishes smooth and flat; and has no raw edges. The folded front edge of the piece is not topstitched.			
b. Position the top and under sleeve with the notches matching and join at the forearm with a 3/8-inch seam.	301	SSa-1	10-14
c. Spread the seam open and press flat with a heated pressing iron.			
d. Mark the sleeve end for the turn-up and mark the top sleeve for positioning of the ornamental sleeve piece according to the ornamental sleeve piece marker.			
e. Mark the ornamental sleeve piece on the inside 1/4 inch from the raw edge. Position the sleeve piece on the sleeve with the marks matching and with the bottom edge of the sleeve piece even with the mark for the bottom turn-up of the sleeve.			
f. Seam the ornamental sleeve piece to the sleeve at the mark.	301	LSbj-1	10-14
g. Turn back the ornamental sleeve piece at the seam and stitch as close as possible to, but not on top of, the topstitching at the top and bottom edges and at the scalloped peaks, leaving two openings on the scalloped edge to remove and replace the buttons. The ornamental sleeve piece finishes 5±1/8 inches long, measured along the folded edge from each folded edge of piping, and 2-1/4±1/8 inches wide at the center point, measured from the folded edge to the folded edge of the scarlet piping.	301	LSbj-1	10-14
h. Join the top and under sleeve at the backarm with a 3/8-inch seam.	301	SSa-1	10-14
i. Spread the seam open and press smooth and flat with a heated pressing iron.			
j. Turn up the bottom edge of the sleeve at the mark and tack to the seam allowances of the forearm and backarm seams.	Hand or 301	---	2-3
k. Press the bottom edge smooth and flat with a heated pressing iron.			
14. MAKE SLEEVE LININGS AND ASSEMBLE SLEEVES			
a. Finished appearance: the sleeve lining is positioned and attached to the sleeve without twists, pleats, puckers, or gathers.			
b. Position the top and under sleeve linings in accordance with the notches on the pattern and join at the forearm and backarm, respectively, with a 3/8-inch seam.	301 or 401	SSa-1	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
c. Position the sleeve lining on the sleeve with the upper edge of the lining extending 3/4 to 1 inch beyond the armhole edge of the sleeve.			
d. Seam or tack the lining to the sleeve backarm and forearm seam allowance, respectively, commencing at the top of the sleeve fusible and extending up 6 to 7 inches along the backarm and forearm seams. OR	301	SSa-1	6-8
e. As an alternate to operations 14.b through 14.d, when using a sleeve lining felling machine:	301 or 401	SSa-1	10-14
(1) Join the backarm seam and forearm seam of the sleeve lining. The distance between the notches on the forearm is left open.			
(2) Position the sleeve lining top notches to the top of the forearm sleeve seam and the top of the backarm sleeve seam.			
(3) Tack the forearm seam and backarm seam of the sleeve lining to the forearm seam and backarm seam, respectively. The backarm seam tacking extends from approximately the midpoint of the backarm seam to not more than 6 inches above the creased bottom edge. The forearm seam tacking extends for a distance of 1-1/2 to 2 inches below the bottom left open forearm seam notch.	Hand or 301	SSa-1	2-3 or 4-8
f. Pull the sleeve through the sleeve lining.			
15. FELL TURN-UP OF SLEEVE LININGS			
a. Finished appearance: the sleeve lining is not short, tight, or twisted at the bottom of the sleeves.			
b. Turn under the bottom edge of the sleeve lining to finish approximately 1 inch above the finished end of the sleeve. Fell the folded edge of the sleeve lining to the turn-up of the sleeve with blindstitching.	301 or Hand	EFc-1	6-8 or 8-10
c. As an option, the bottom edge of the sleeve may be basted to the turn-up prior to felling (see operation 15.b).			
d. Turn the sleeves and assemble in pairs.			
16. FOLD AND STITCH LOWER FRONT DARTS IN FRONT LININGS			
a. Finished appearance: the dart finishes without gathers, puckers, or pleats. The dart is tapered to a point at the upper end.			
b. Sew the lower front dart with a 3/8-inch seam, tapering the dart to a point at the upper end, and securely backtack.	301 or 401	SSa-1	10-14
c. Overedge each edge of the lower dart, tapering off not more than 1 inch from the inner end. OR	504 or 505	EFd-1	8-10
d. As an alternate to operations 16.b and 16.c, the dart may be stitched and overedged together in one operation. The thread chains are run off at the top of the dart a minimum of 1 inch.	515, 516, 517, 518, or 519	SSa-2	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
17. ASSEMBLE LININGS			
a. Overedge all edges of each front, side back, and right and left back lining part (including the vent edge), excluding the bottom hem, armhole, shoulder, and neckline.	504 or 505	EFd-1	8-10
b. Matching the notches, join the right and left back linings along the center back seam with a 3/8-inch seam, stopping at the top of the vent; join the side back linings to the right and left back linings with a 3/8-inch seam; and join the front linings to the back assembly at each side seam with a 3/4-inch seam.	301	SSa-1	10-14
c. Press the side and side back joining seam open and flat. Press the lower front dart towards the side.			
d. Hem the bottom edge of the linings, with the raw edge turned under and caught in the stitching 1/16 inch from the folded upper edge of hem. The hem finishes 1±1/8 inch wide. The side and side back joining seams remain open and flat and the lower front dart is positioned towards the side.	301	EFb-1	10-14
e. Fold the lining back at the center back seam to form a 1/2-inch wide pleat at the center back. The folded edge of the pleat faces the left side of the coat (as worn.) As an option, the pleat may be stitched across the top of the pleat at the neckline.			
f. Press the pleat smooth and flat from the neckline to the vent area with a heated pressing iron.			
18. OVEREDGE BODY PANELS AND FACINGS			
a. Overedge all edges of the right and left fronts, side fronts, side front darts, side backs, and right and left backs, excluding the bottom edge, armhole, shoulder, and neckline. Overedge the back edge of the facings.	504 or 505	EFd-1	8-10
19. ATTACH FRONT FACINGS TO LININGS AND SEW ON LABEL			
a. Finished appearance: the lining is seamed to the facing so that in the finished coat, the lining is smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.			
b. Position the lining on the facing, with notches matching, and seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching extends from the top (shoulder) edge of the facing to the bottom hemmed edge of the lining.	301 or 401	SSa-1	10-14
c. Press the facing/lining joining seam with the seam allowance toward the side.			
d. Sew the identification/instruction label to the left front facing with a single row of stitching 1/16 inch from each edge of the label. The label is positioned horizontally with one end adjacent to the facing/lining seam and the lower edge of the label approximately 2-1/2 inches up from the bottom piped edge of the coat.	301	LSbj-1	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
20. MAKE ARMHOLE SHIELDS			
a. Finished appearance: the armhole shield finishes without puckers, gathers, or raw edges. The basic material and both edges of the binding are securely caught in the binding stitching.			
b. Bind the rounded edge of armhole shield with bias binding (see 3.4.10), turning under the outer or both raw edges of the binding and catching the turned under portion(s) in the stitching, 1/16 inch from the folded edge(s).	301	BSc-1 or BSb-1	10-14
21. JOIN BACKS			
a. Finished appearance: the side and center back are joined without gathers, puckers, or pleats. The folded edge of the left vent is in vertical alignment with the center back seam. The left center back overlaps the right center back not less than 2-3/4 inches and the left vent measures 2±1/8 inches wide, when measured at the bottom edge of the coat.			
b. Position the center back edges even and join with a 5/8-inch seam from the top edge of the backs to approximately 3/4 inch below the top end of the vent. From that point, continue to stitch diagonally across the top end of the vent, stopping 3/8 inch from the end.	301	SSa-1	10-14
c. Turn the left vent to the inside of the left center back in accordance with the notches and edgestitch 1/8 inch from the folded edge. The folded edge of the vent is in line with the center back seam line.	301	OSf-1	10-14
d. Join the left and right side backs to the respective center backs with a 3/8-inch seam.	301	SSa-1	10-14
e. Press the side and center back seams open and flat with a heated pressing iron or pressing machine.			
f. Notch the top end of the right vent diagonally from the juncture point of the vent and center seam allowance of the right center back to 1/16 inch from the center back seam. The notch does not extend to the seam.			
22. TOPSTITCH TOP END OF VENT			
a. Finished appearance: the edge of the right side of the vent extends beyond the center seam allowance of the left back part.			
b. Stitch and backstitch across the top end of the vent through all plies from the back center seam to the edge of the vent for a distance of 1 inch.	301	SSa-1	10-14
23. SEAM REINFORCEMENT STAYS TO FRONT ARMHOLES AND SHOULDERS			
a. Finished appearance: the reinforcement stay pieces are sewn to the armhole and shoulder edge of the front without gathers, puckers, or pleats.			
b. Seam the 5/8- to 3/4-inch wide stay pieces (see operation 1.d) to the underside of the front along the shoulder edge and upper front edge of the armhole, 1/8 inch from the outer edges. The top end of the armhole stay and the lower edge of the shoulder stay forms a right angle at the armhole without the stays overlapping each other.	301	SSaa-1	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
24. ASSEMBLE FRONT PANEL			
a. Finished appearance: each front consists of a front panel, a side front panel, and a side front dart panel. The panels are joined without gathers, puckers, or pleats.			
b. With notches matching, position the front panel and side front panel together with the edges even and join with a 3/8-inch seam. With notches matching, position that assembly to the side front dart panel with the edges even and join with a 3/8-inch seam.	301	SSa-1	10-14
c. Spread all seams open and press flat with a heated pressing iron.			
d. Press and shape the fronts on a heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest without distortion to the fronts or armholes. Maintain contour of the seams without stretching the seam.			
25. JOIN BACK AND FRONT AT SIDES AND TAPE ARMHOLE			
a. Finished appearance: the back and fronts are carefully joined at the sides without twists, gathers, puckers, or pleats.			
b. Position the back and fronts with edges even and join at the sides with a 3/4-inch seam.	301	SSa-1	10-14
c. Spread the side seams open and press flat with a heated pressing iron.			
d. Attach the 1/4-inch wide woven tape to the inside of the coat at the lower edge of the armhole, starting approximately 2 inches above the notch in the fronts and continue to the side seam. Cut the tape and continue stitching along the bottom and back edge to the lower notch. Holding the tape taut, continue to stitch the tape to the back armhole to 3/4 inch from the shoulder.	301	SSaa-1	10-14
e. Press the armhole tape and the shoulder area smooth and flat with a heated pressing iron or pressing machine.			
26. ATTACH BELT LOOPS TO SIDE SEAM			
a. Finished appearance: the belt loops finish aligned with each side seam and measure 2-3/4±1/8 inches long from top to bottom folded edges.			
b. Position the bottom end of a belt loop on each side seam in accordance with the side seam belt loop marker and secure the inside bottom of the loop with a 3/8-inch wide bartack, centered over the loop. Fold the belt loop up to the finished position on the side seam and turn under the top raw edge. Bartack the top of the belt loop to the coat 1/8 inch from the folded edge, catching the turned under portion of the loop in the stitching, with the bartack centered over the loop.	Bartack		20 per bartack (minimum)
27. STITCH SCARLET PIPING TO COAT			
a. Finished appearance: the scarlet piping is uniformly stitched to the bottom edge of the coat and up the front and top edge of the right front without twists, gathers, puckers, or pleats. The piping extends from the bottom left front edge to the collar notch at the top edge of the right front.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
b. Mark the fronts 1-1/8 inches from the bottom edge of the coat and trim excess material at the front and back, when necessary. At the bottom edge, the right front overlaps the left front 3-3/4±1/8 inches and the left front does not extend below the bottom edge of the right front.			
c. Position and stitch a 1-1/8-inch wide strip of scarlet piping on the outside bottom of the left front and back, with one edge even with the bottom. Position and stitch a 1-1/8-inch wide strip of piping on the outside bottom of the right front and back, up along the right front, and across the top edge. Leave approximately 3/8 inch extension of piping at the end of each back at the vent edge for turning under. OR	301	SSa-1	10-14
d. As an alternate to operation 27.c, fold over 1/4 inch of the 1-1/8 inch scarlet piping and seam to the coat as indicated in operation 27.c above.	301	SSav-2(a)	10-14
e. Turn the scarlet piping to the inside, working out the corners, and topstitch uniformly 3/16 inch from the folded edge of the piping, catching the turned under portion of the piping at each end of the center vent. The piping finishes 1/8 inch beyond the edge of the coat.	301	SSbe-2(b)	10-14
f. Notch out the excess scarlet piping at the lower corner of the right front to eliminate bulkiness. Notch the top edge of the piping approximately 2 inches from the lower front edge of the coat.			
g. Turn under the raw edge of the scarlet piping 3/8 inch along the bottom edge of the coat, starting at the notch. Stitch the piping 1/16 to 3/32 inch from the turned edge across the bottom of the coat.	301	EFb-1	10-14
h. Trim the inner edge of the scarlet piping on the right front sufficiently so that in the finished coat, the piping will not be visible in the front buttonholes.			
i. Fell upper, front, and lower inner edges of the piping to the coat front interfacing.	301 or Hand	EFc-1	4-6
j. Press the piped edges smooth and flat.			
28. ATTACH FLOATING CHEST PIECE			
a. Position the floating chest piece assembly on the underside of the front with the haircloth facing the fused interfacing, aligning the outer edges and neckline. The padding is placed so that it will not be caught in the shoulder seaming of the coat. Baste through the front and floating chest piece assembly, allowing room for placement of the shoulder pad. A jump basting machine may be used. Keep the assembly slightly full in order to support the form and shape of the fronts.	101, 301, or Hand	Hopper	Variable
b. Trim excess from the front edge and trim the shoulder in excess of 3/4 inch.			
29. BASTE AND JOIN FACING-LINING ASSEMBLY TO LEFT FRONT			
a. Position the cross-cut fusible tape on the inside of the left top and front edge, from the collar notch to 1 inch above the bottom edge of the coat, and fuse in place in accordance with the manufacturer's recommendations for time, temperature, and pressure.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
b. Position the left facing-lining assembly on the outside of the left front. Baste along the front and continue basting along the bottom edge. The facing is held slightly taut across the bottom edge of the front while basting.	301	Hopper	Variable
c. Join the left facing to the left front 3/16 inch from the top and front edge of the coat, stitching thru the fusible tape.	301	SSa-1	10-14
d. Clip the depth of the collar notch to the seam line.			
e. Remove the basting from the left facing; notch at the collar terminal and trim the upper front corner of the facings.			
f. Spread the seam joining facing to the left front from the collar notch to the bottom edge of the coat, and press smooth and flat with a heated pressing iron. The corner is worked out.			
30. BASTE AND JOIN FACING-LINING ASSEMBLY TO RIGHT FRONT			
a. Position the right front to the front facing (face-to-face) according to the notches on the pattern, with the front piped edge approximately 3/8 inch from the front raw edge of the facing. Mark along the top, front, and bottom edges of the facing.			
b. Lap the front edge of the right front on the outside of the facing at the marks and join the front to the facing as close as possible to, but not on top of, the stitching joining the scarlet piping to the front. The stitching extends from the top to the bottom edge of the coat front only. Trim excess facing material when necessary. OR	301	LSa-1	10-14
c. As an alternate to operation 30.b, complete the following:			
(1) Position the right facing-lining assembly on the outside of the right front and baste along the front.	301 or Hand	Hopper	Variable
(2) Join the right front to the facing, seaming through all plies, forming a 1/8 inch scarlet piping of the right front edge. The line of stitching is adjacent to the seam line of the scarlet piping.	301	SSav-2(b)	10-14
(3) Remove the basting on the right front, open up the facing and front, and stitch the right front 3/16 inch from the edge of the scarlet piping.	301	SSav-2(c)	10-14
d. Press the front edge smooth and flat with a heated pressing iron or pressing machine, removing fullness.			
31. BASTE LEFT FRONT – FIRST TIME			
a. Turn the facing-lining assembly to the inside of the fronts, completely working out the corners.			
b. Baste along the front edge on the left side, working the seam to the edge of the coat. The basting extends from the collar notch to the bottom edge of the coat.	101 or Hand	SSm-1	4-6

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
32. BASTE RIGHT FRONT AND LEFT FRONT – SECOND TIME			
a. Baste the facings to the fronts approximately 1-1/2 inches from the top, front, and bottom edge of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing while basting.	301 or Hand	Hopper	Variable
b. Notch at the collar terminal. Turn under and baste the top edge of the right facing to the front from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	301 or Hand	Hopper	Variable
c. Baste the facings to the fronts starting approximately 3 inches down from the shoulder edge of the facing and as close as possible to the facing-lining seam, placing the fullness over the chest. Continue to baste the facing along the inner folded edge of the binding from the bottom end of the facing-lining to the mark at the lower edge of the facing, properly distributing the fullness in the facing. Turn up the bottom edge of the facing at the mark and baste along the folded edge.	301 or Hand	Hopper	Variable
33. FELL FACINGS TO FRONTS AND TACK TO INTERFACING			
a. Fell facing to the right and left chest pieces. The felling stitching does not show through to the outside of the coat.	301 or 306	BSa-1	6-8
b. Tack the right and left facing-lining seam allowance to the respective front interfacing.	Hand or 103 or 306	SSm-1	2-4 or 4-6
34. FIT, BASTE, AND TRIM BODY LINING TO COAT			
a. Fold the front lining at the shoulder in accordance with the notches, forming the chest pleat, and baste the entire length of the pleat. Continue to baste from the lower edge of the armhole, along the side seam and across the bottom edge of the lining. The folded edge of the chest pleat on the outside of the lining faces the armhole.	301 or Hand	Hopper	Variable
b. Baste the lining back by joining the basting at the pit of the armhole at the side seam, continuing diagonally upward to the center back neck edge, taking in excess material and maintaining the back pleat, with the folded edge of the pleat facing the left side of the coat (as worn).	301 or Hand	Hopper	Variable
c. Baste the back pleat, tapering from the neckline to the vent. Pleats in the lining are pressed prior to removing the basting threads.	301 or Hand	Hopper	Variable
d. Trim the lining as needed.			
35. JOIN LINING TO VENT			
a. Position the right and left vent back lining on the respective right and left vent opening, face to face, with the notch of the lining even with the top of the vent. Join each side respectively with a 3/8-inch seam, extending stitching to the bottom hem of the lining.	301	SSe-2(a)	10-14
b. Edgestitch the right vent 1/8 inch from folded edge of the vent, ensuring the lining is not exposed on the outside.	301	SSe-2(b)	10-14
36. EDGE STITCH LEFT FRONT			
a. Edgestitch the left front uniformly 1/8 inch from the top and front edges. The stitching extends from the collar notch to the bottom of the coat.	301	SSe-2 (shows finished seam)	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
37. BASTE SHOULDER PADS			
a. Insert the shoulder pad between the shoulder piece and the chest padding piece of the floating chest piece in line with the armhole edge and securely tack the pad to the interfacing and chest padding only.	301 or Hand	Tack	2-4
38. PRESS FRONT EDGES			
a. Press the left and right front edges individually, smooth and flat, with a heated pressing iron or pressing machine.			
39. MAKE BUTTONHOLES AND ATTACH FASTENER TAPE			
a. Finished appearance: each buttonhole is eyelet end, square bar, cut first type. Each buttonhole is clean cut and well worked over gimp, with the stitching of the buttonhole securely caught in the basic material. The purling of the buttonhole finishes on the outside. The buttonhole finishes clean and is positioned according to the pattern marks. The inside edge of the eyelet end of the buttonhole is 5/8 inch from the front piped edge.			
b. Mark the right front in accordance with the marks on the pattern for the location of six buttonholes and the loop fastener tape. The mark for the top buttonhole is 3/4 to 1 inch below the top piped edge of the front, and the marks for the remaining five buttonholes are evenly spaced between the top buttonhole and the center of the loop tape.			
c. Make one horizontal, eyelet end, square bar type buttonhole, 1-1/4 inches long, at each buttonhole mark.	Buttonhole	---	50 per buttonhole (minimum) not including tack
d. If the end of the gimp finishes on top of the buttonhole, pull the end through to the underside. Securely bartack the end of each buttonhole, catching the end of the gimp in the bartack and covering the width of the bar. The bartack is centered over the bar and is not more than 1/4-inch long and 1/16-inch wide. Trim the end of the gimp.	Bartack	---	20 per bartack (minimum)
e. Position a 1-inch wide piece of loop fastener tape on the right facing according to the marks on the pattern. Stitch the tape to the facing through all plies, stitching around all four sides of the tape, 1/8 inch from the edge. The vertical raw edges are turned under. The fastener tape finishes 1-3/4±1/8 inches long by 1 inch wide.	301	LSbj-1	10-14
f. Mark the position of the 1-inch wide piece of hook fastener tape on the left front according to the marks on the pattern. Stitch the tape to the front through all plies, stitching around all four sides of the tape, 1/8 inch from the edge. The vertical raw edges are turned under. The fastener tape finishes 2±1/8 inches long by 1 inch wide.	301	LSbj-1	10-14
40. JOIN SHOULDERS			
a. Finished appearance: the shoulder seam finishes without a distorted appearance.			
b. Join the front to the back at the shoulders with a 3/8-inch seam, working in fullness on the back.	301	SSa-1	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
c. Spread the shoulder seam open and press flat with a heated pressing iron or pressing machine over a block, holding the shoulder short. The pressed shoulder is not distorted.			
41. SET SHOULDER STRAPS			
a. Finished appearance: the shoulder straps are uniformly stitched to the coat without twists, fullness, or tightness. On the finished coat, the strap, including the scarlet piping, is 2-1/2±1/8 inches wide at the armhole seam and tapers to 1-3/4±1/8 inches wide at the center of the insignia button. The rounded end of the strap is 1/4 to 3/8 inch from the lower edge of the collar in the finished coat.			
b. Position the shoulder strap on the shoulder seam in accordance with the shoulder strap placement marker.			
c. Seam the shoulder strap to the coat at the front and back edges and around the collar end as close as possible to, but not on top of, the stitching for the scarlet piping. Trim the shoulder strap even with the armhole where necessary.	301	LSbj-1	10-14
42. ATTACH SHOULDER STRAP BUTTONS			
a. Finished appearance: the center of the insignia button in the finished coat is 3/4 to 7/8 inch from the rounded end of the shoulder strap.			
b. Mark each shoulder strap for the location of one 27-line insignia button.			
c. Punch a hole at the mark through the shoulder strap and front only. Insert the shank of the insignia button through the hole and reinforcement disk and secure the button to the coat on the inside with a split pin or ring toggle.			
d. As an alternate to punching a hole through the strap as outlined in operation 42.c, an eyelet may be made at the mark on the shoulder strap prior to attaching the strap to the coat. The eyelet is well worked and finishes with a 1/8-inch opening.	Eyelet	---	20 per eyelet (minimum)
43. JOIN LINING SHOULDER SEAMS			
a. Trim the shoulder edge of the front lining and the back lining to approximately 3/8 inch past the shoulder at the armhole edge and tapering to 1/8 inch at the neck. Join the back lining to the facing-lining assembly with a 3/8-inch seam, working in the proper fullness on the back.	301 or 401	SSa-1	10-14
44. SEAM NECKLINE AND ATTACH SIZE LABEL AND HANGER LOOP			
a. Finished appearance: the neckline finishes smooth and flat without twists, pleats, or puckers. The size label is centered between the ends of the hanger loop. In the finished coat, the hanger loop opening is 2±1/8 inches long when measured along the lower edge of the collar lining.			
b. Join the facing and the back lining to the coat at the neckline from the collar notch to the collar notch with a 1/4-inch seam, securely catching the size label and the ends of the hanger loop at the inside of the center back.	301	SSa-1	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
45. SET COLLAR			
a. Finished appearance: the collar is carefully joined to the coat without twists, puckers, pleats, raw edges, or distortion.			
b. Mark the neckline on the outside 1/2 inch from the top edge, from the collar step to the collar step, for proper positioning of the collar.			
c. Position the collar with the lower edge lapped on the outside top edge of the coat at the mark.			
d. Seam the collar, from end to end, to the coat as close as possible to, but not on top of, the stitching for the scarlet piping at the lower edge of the collar. The stitching is not through the collar lining. The collar position does not deviate more than 1/8 inch from the collar steps on each end of the collar.	301	LSb-1	10-14
46. SET SLEEVES			
a. Finished appearance: the armhole sleeve seam finishes smooth and flat without twists, gathers, puckers, or pleats. The front edge of the sleeve crease at the sleeve bottom finishes 1 inch in front of the front/side front seam.			
b. Position the outside of the sleeve on the outside of the coat with the notches matching and with the sleeve lining turned back from the armhole edge.			
c. Join the sleeve to the coat with a 3/8-inch seam, distributing the fullness between the notches and catching the ends of the shoulder strap in the stitching.	301	SSa-1	10-14
d. Notch the armhole seam allowance on the back and front adjacent to each side of the shoulder strap.			
e. Press fullness of the sleeve flat all around the armhole, with the seam facing toward the sleeve, with a heated pressing iron on a shaped pressing buck, shrinking fullness and holding the armhole short. The armhole is not stretched while pressing the armhole seam.			
47. BASTE ARMHOLES			
a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad, and front lining in place and distributing the fullness evenly. Turn the coat on the outside.	Hand or 301	Hopper	Variable
b. Baste around the outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting extends the entire circumference of the armhole.	Hand or 301	Hopper	Variable
48. STITCH SLEEVE HEAD PADS AND LININGS AT SLEEVE ARMOLES			
a. Finished appearance: the sleeve armhole is not distorted or puckered due to stretching the sleeve head pads and lining at the armhole.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
b. Position the sleeve head pad on the sleeve with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole sleeve seam. The pad begins at the notch in the front and extends around the armhole, ending approximately 2 inches beyond the back arm seam. When necessary, trim excess pad to approximately 15 inches for sizes X0 through 6; 16 inches for sizes 8 through 14; and 17 inches for sizes 16 through 18.			
c. Stitch the sleeve head pad to the sleeve from end to end, through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the armhole, the front and back linings, and the shoulder pad in the stitching. Continue stitching the lining around the remainder of the armhole. Trim away excess material.	301	SSa-1	4-6
49. ATTACH ARMHOLE SHIELDS TO COAT			
a. Position the armhole shield on the lining side of the coat with raw edges even with the lower edge of the armhole.			
b. Baste or tack the armhole shield at the base of the armhole.	301 or	SSa-1	4-8
OR	Hand		2-3
c. As an alternate to operation 49.b, the armhole shield may be joined to the lining by superimposing stitching on the seam that joins the binding to the shield.	301	LSbj-1	10-14
50. ATTACH SLEEVE LININGS			
a. Position the sleeve lining at the armhole with the back and forearm seam of the sleeve and sleeve lining matching. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining at the armhole. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of lining and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge, beginning approximately 1-1/2 inches to the front of the forearm sleeve lining seam and extending the stitching to the side seam of the body lining. OR	Hand	SSa-1	8-10
b. As an alternate to operation 50.a, stitch the sleeve lining by machine to the armhole on the inside from the forearm to the backarm sleeve across the under sleeve. OR	301	SSa-1	10-14
c. As an alternate to operation 50.a or 50.b, the armhole lining may be felled utilizing a sleeve lining felling machine that consists of a feed off the arm machine equipped with a lower and upper feed (review specification requirements for felling of sleeve lining in relation to appropriate turn under).			
(1) Stitch the sleeve lining to the armhole on the inside from the front sleeve notch to the backarm seam across the under sleeve.	301	SSa-1	10-1
(2) Stitch the top sleeve lining to the armhole on the inside from the front armhole notch to the top back arm lining seam across the crown of the top of the sleeve lining.	306	SSa-1	10-14

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
(3) Close the previous left opened forearm seam 1/16 to 3/32 inch from edge.	310	SSc-1	10-14
Note: Alternate construction: When the alternate construction to fell the armhole lining by machine is used, it consists of leaving an opening between the notches of the forearm sleeve lining stitching seam, stitching the lining to the armhole on the inside from the front sleeve notch of the sleeve to the backarm seam across the under sleeve (301 stitch), and utilizing the forearm sleeve opening, stitching the top sleeve lining to the armhole on the inside by felling machine from the front sleeve notch to the back arm seam across the crown of the top sleeve lining. Close the previous left opened forearm seam.			
51. FINISH ATTACHING FACINGS			
a. Securely tack the folded top edge of the right facing to the scarlet piping at the top edge of the coat from the collar notch to the front edge.	Hand	SSc-1	8-10
b. Turn under the bottom edge of each facing and stitch to the coat through all plies. The stitching is superimposed on the lower row of edgestitching for the scarlet piping.	301	SSa-1	10-14
c. Tack the lining and the coat body seam allowances together at each side seam, approximately 1 inch up from the bottom edge of the lining.	Hand or 301	SSa-1	2-3 4-8
52. SEW HOOK AND EYE TO COLLAR			
a. Finished appearance: the hook and eye are positioned to properly engage each other, effecting a flat, smooth closure at the front of the collar without misalignment.			
b. Position and securely sew the hook to the right end and the eye to the left end of the collar. The hook and eye are positioned with their front edges even with the respective front ends of the collar and securely sewn to the collar at the top and bottom of the forward edge of the hook and eye. The stitching on each side is not more than 3/8 inch from the front end of the collar through the individual holes at the rear of the hook and eye.	Hand	---	16 per hook, 16 per eye
53. FINISH COLLAR			
a. Securely tack the lower corners of the collar to the coat.	Hand	---	8-10
b. Turn under the end and top edge of the lining at the right end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge to the end of the stitching, joining the lining to the collar. OR	Hand	---	8-10
c. As an alternate to operation 53.b, the collar lining may be attached to the coat using a simulated hand felling machine.			
d. Turn under and fell the lower folded edge of the collar lining to the coat from end to end, catching the turned under portion of the lining at the right end in the felling.	Hand or Machine	---	8-10 6-8

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
e. Fell the collar extension tab from the underside to the collar across the left front end of the collar, leaving an opening of 1/4 to 3/8 inch between the stitching line and the inside back edge of the eye to properly engage the hook. Continue felling along the folded top edge to the end of the stitching, joining the lining to the collar.	Hand	---	8-10
f. Turn the collar eyelet covers to the inside of the collar and fell the cover to the collar lining along the front edge. Continue the felling along the bottom edge for a distance of approximately 1/2 inch from the front edge.	Hand	---	8-10
54. CLEAN COAT			
a. Pull and remove all basting thread. Trim all thread ends and remove all loose threads, spots, stains, tickets, and marking without injury to the material.			
55. PRESS COAT			
a. Finished appearance: the coat is well pressed throughout with a heated pressing iron or pressing machine to obtain the desired shape and appearance in accordance with good manufacturing practices, ensuring no shine or gloss.			
b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Ensure that the bottom edges are kept even during the pressing of the fronts.			
c. Press the entire collar smooth and flat.			
d. Press the upper fronts on a left and right body machine, shrinking in and properly shaping the chest.			
e. Press the lower fronts smooth and flat.			
f. Press the sides, working the fullness towards the back.			
g. Press the back smooth and flat, removing all fullness and lapping the left vent on the right vent.			
h. Press the sleeves smooth and flat, without injury to the buttons on the ornamental sleeve pieces, creasing at the backarm and forearm. The backarm crease is on the backarm seam and in line with the forearm crease. The crease extends from the sleeve hem to a point on the sleeve in horizontal alignment with the top folded edge of the side seam belt loop.			
i. Block the shoulders to remove fullness and press the shoulders smooth on a shoulder-shaping machine.			
j. Press the armholes solid from the inside, creasing the armholes at the front, back, and armpit. The armpit and the back of the armhole are held short while pressing.			
k. Block the armholes on a pressing buck, shrinking in the top sleeves.			
l. Press the lower edge of the coat smooth, flat, and even.			
m. Remove all wrinkles and impressions from the coat.			
n. Press linings throughout, removing all wrinkles and creases. Press the front shoulder pleats, back lining pleat, and vent linings smooth and flat.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XI. Table of operations – Continued.

Operation	Stitch Type	Seam Type	Stitches Per Inch
56. MARK AND ATTACH FRONT BUTTONS			
a. Finished appearance: the buttons are securely sewn to the left front and properly engage buttonholes on the right front. The buttons finish with the head of the eagle in an upright position.			
b. Mark the left front for the location of six 40-line insignia buttons to properly engage with the buttonholes on the right front. The mark for the top button is in line with the left front end of the collar, and the remaining buttons are in vertical alignment with the top mark and equal distance from the front edge of the coat.			
c. Sew one 40-line insignia button at each of the marks on the left front. The buttons are sewn through all plies of material.	101 or 301 or	---	21/button
	Hand		4-6/button (double thread)

3.8 Finished measurements. The finished coat shall conform to the measurements shown in tables XII and XIII as defined in table XIV, when measured as specified in 4.4.4. All measurements and tolerances are expressed in inches.

TABLE XII. Finished measurements – chest, waist, sweep, back length, and collar length.





Size	Chest (A)	Waist (B)	Sweep (C)	Back Length (D)					Collar Length (E)
				Extra Short	Short	Regular	Long	Extra Long	
X0	33-1/2	27-1/2	40	23-1/4	24-1/2	25-3/4	27	29	13
2	34-1/2	28-1/2	41	23-1/2	24-3/4	26	27-1/4	29-1/4	13-1/4
4	35-1/2	29-1/2	42	23-3/4	25	26-1/4	27-1/2	29-1/2	13-1/2
6	36-1/2	30-1/2	43	24	25-1/4	26-1/2	27-3/4	29-3/4	13-3/4
8	38	32	44-1/2	24-1/4	25-1/2	26-3/4	28	30	14
10	39-1/2	33-1/2	46	24-1/2	25-3/4	27	28-1/4	30-1/4	14-1/2
12	41	35	47-1/2	24-3/4	26	27-1/4	28-1/2	30-1/2	15
14	43	37	49-1/2	25	26-1/4	27-1/2	28-3/4	30-3/4	15-1/2
16	45	39	51-1/2	25-1/4	26-1/2	27-3/4	29	31	16
18	47	41	53-1/2	25-1/2	26-3/4	28	29-1/4	31-1/4	16-1/2
Tolerance:	±3/4	±3/4	±3/4	±1/2	±1/2	±1/2	±1/2	±1/2	±1/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XIII. Finished measurements – sleeve length and collar height.




Measurement	Extra Short	Short	Regular	Long	Extra Long	Tolerance
Sleeve length (F)	15-3/4	16-3/4	17-3/4	18-3/4	20-3/4	+1/2, -3/8
Collar height (G)	1-3/4	1-3/4	1-3/4	1-3/4	1-3/4	±1/8

TABLE XIV. Methods of measure.

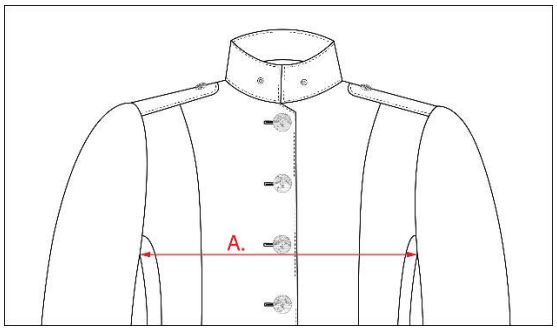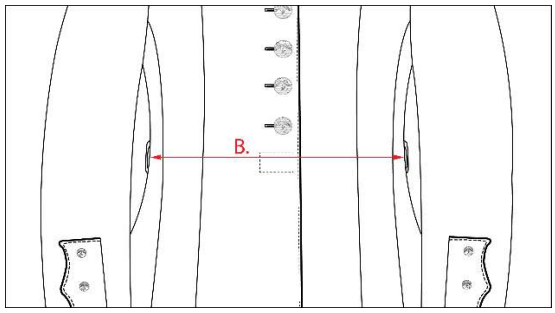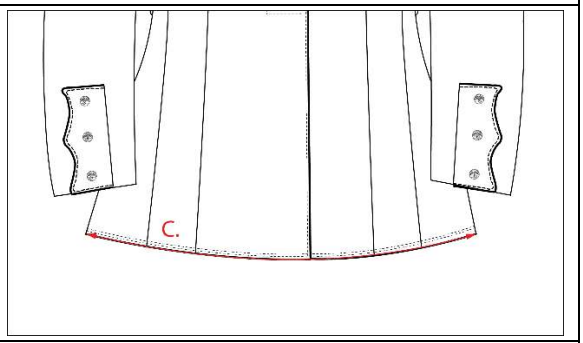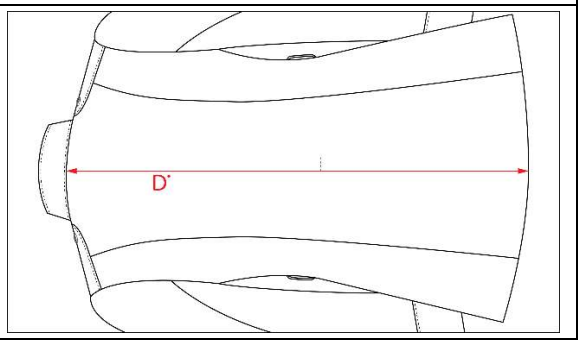Letter	Measurement	Method 1/	Measurement Depiction
A	**Chest**	From the folded edge to the folded edge, in line with the pit of the armhole. Multiply by 2.	
B	**Waist**	At the center of the fastener tape from the folded edge to the folded edge.	
C	**Sweep**	Buttoned and folded with both fronts together from the folded edge to the folded edge along the curve of the coat bottom, with the front overlapped 3-3/4 inch and the center vent overlapped 2-3/4 inch.	
D	**Back length**	Along the center back seam from the outer collar seam to the bottom of the coat.	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XIV. Methods of measure – Continued.

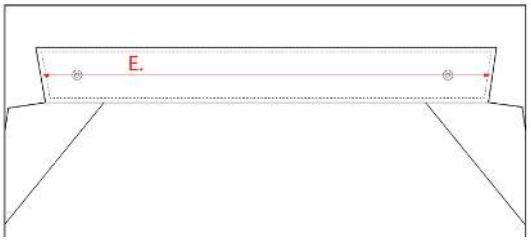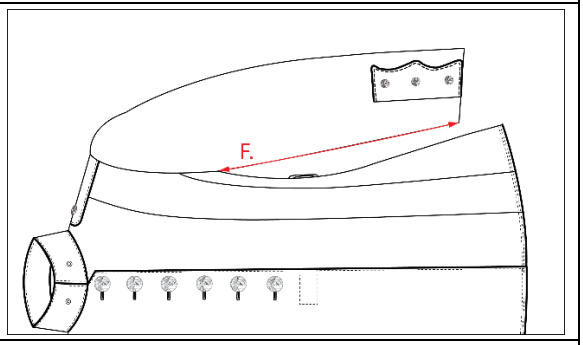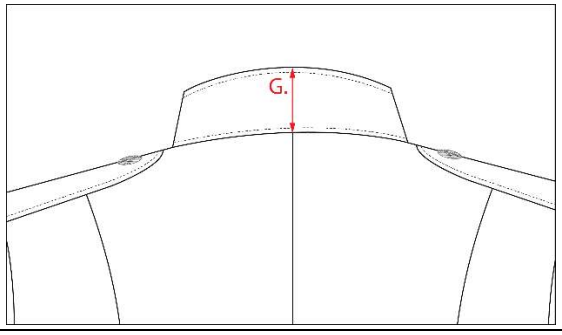Letter	Measurement	Method [1/]	Measurement Depiction
E	**Collar length**	With the coat unbuttoned and opened flat, measure the collar length from the front edge to the front edge at the center of the collar.	
F	**Sleeve length**	Along the inseam from the pit of the armhole to the bottom edge of the sleeve.	
G	**Collar height**	From the folded edge of the piping on the top edge of the collar to the folded edge of the piping on the bottom edge of the collar.	

FOOTNOTE:

[1/] Coat is buttoned and laid flat upon a table for all measurements except E (collar length).

3.9 Workmanship. The finished coat shall conform to the quality of product established by this document. Defects shall not exceed the established acceptance quality limits (AQL) (see 6.2) and shall not adversely affect the serviceability, appearance, and uniformity of the product.

4. VERIFICATION

4.1 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.2).

b. Conformance inspection (see 4.3).

4.2 First article inspection. The first article, submitted in accordance with 3.1.1, shall be examined in accordance with 4.4.1 through 4.4.4 for compliance with the design, configuration, workmanship, dimensional requirements, and testing as specified in this document.

4.2.1 First article samples and acceptance criteria. The first article sample size will be specified in the procurement document (see 6.2). The sample unit shall be one finished coat. The lot size shall be expressed in units of coats. The presence of defects exceeding AQLs (see 6.2) or failure of any testing shall be cause for rejection of the first article.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

4.3 Conformance inspection. Conformance inspection, submitted in accordance with 3.1.2, shall consist of the examinations and tests as specified in 4.4.1 through 4.4.4. The Government reserves the right to inspect and test all components and end items to determine conformance.

4.3.1 Component and material sampling and acceptance criteria. Unless otherwise specified in referenced documents or procurement documents (see 6.2), sampling shall be in accordance with table XV. The unit for expressing the lot size and the sample unit for testing each component shall be in accordance with the applicable referenced document and table XVI. The component lot shall be unacceptable if one or more sample units fail to meet any examination or test requirements specified in this document (see 6.2).

TABLE XV. Material sampling.

Lot Size	Sample Size (Sample Unit)
800 or fewer	2
801 through 22,000	3
22,001 or more	5

TABLE XVI. Component sampling.

Component	Lot Size Expressed As	Sample Unit for Testing
Lining and armhole shield binding	Yards	3 yards full width
Chest piece padding	Yards	3 yards full width
Collar padding	Yards	1/4 yard full width
Collar closure hook eye	100 each	2 each hook and eye

4.3.2 End item sampling and acceptance criteria. Unless otherwise specified in the procurement documents (see 6.2), sampling for inspection shall be performed in accordance with ASQ/ANSI Z1.4. The sample shall be one finished coat. The lot size shall be expressed in units of coats. The presence of defects exceeding AQLs or failure of any testing, as defined in the contract (see 6.2), shall be cause for rejection of the lot.

4.4 Inspection methods.

4.4.1 Component and material examinations and tests. In accordance with 4.1, components and materials shall be examined and tested in accordance with the examinations and tests specified in tables XVII through XXI, unless otherwise excluded, amended, or modified in this document or applicable procurement documents (see 6.2 and 6.9).

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XVII. Component and material verification.

Material	Requirement	Verification
Basic material	3.4.1	MIL-DTL-10176
Lining	3.4.2	As listed in table XVIII
Stay pieces	3.4.3	A-A-52106, excluding seam efficiency
Fusible interfacing: front and side panels, center back neck, and center vent (woven or weft knit)	3.4.4.1	MIL-C-44296
Fusible interfacing: front facings, shoulder strap, ornamental sleeve piece, and top and under sleeve (non-woven)	3.4.4.2	MIL-C-44296
Floating chest piece: haircloth	3.4.5.1	MIL-C-15065
Floating chest piece: chest piece padding	3.4.5.2	As listed in table XIX and 4.4.1.1
Floating chest piece: buttonhole stand	3.4.5.3	A-A-52106
Collar padding	3.4.6.1	As listed in table XX
Collar interfacing	3.4.6.2	A-A-59992
Binding for collar eyelet reinforcement pieces and lower edge of collar interfacing	3.4.6.3	A-A-52106, excluding seam efficiency
Collar closure hook and eye	3.4.6.4	As listed in table XXI and 4.4.1.2
Sleeve head pads	3.4.7	MIL-DTL-15064
Shoulder pads	3.4.8	MIL-DTL-15064
Hanger loop	3.4.9	MIL-DTL-371
Armhole shield binding	3.4.10	As listed in table XVIII
Scarlet piping	3.4.11	MIL-DTL-29405
Tape: woven tape	3.4.12.1	A-A-52071
Tape: fusible tape	3.4.12.2	MIL-C-44296
Threads	3.4.13	Per specific thread specification listed in table VII
Thread, shade	3.4.13	Visual 1/
Thread, colorfastness (black threads only)	3.4.13.1	Per specific thread specification listed in table VII
Buttons: insignia buttons	3.4.14.1	MIL-B-3461
Buttons: split pin or ring toggles	3.4.14.2	MIL-B-3461
Buttons: reinforcement discs	3.4.14.3	A-A-59992
Hook and loop fastener tape	3.4.15	A-A-55126, excluding colorfastness to laundering
Labels	3.4.16, 3.4.16.1, 3.4.16.2, and 3.4.16.3	MIL-STD-984 and MIL-DTL-32075

FOOTNOTE:

1/ Results reported as pass or fail.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XVIII. Lining verification.

Characteristic	Requirement	Verification
Shade	3.4.2 and 3.4.10	Visual [1/]
Fiber identification	3.4.2 and 3.4.10	AATCC TM20A
Yarns per inch: warp and filling	3.4.2 and 3.4.10	ASTM D3775
Weight	3.4.2 and 3.4.10	ASTM D3776/D3776M
Breaking strength	3.4.2 and 3.4.10	ASTM D5034
Dry: warp and filling		
Wet: warp and filling		
Colorfastness to perspiration	3.4.2 and 3.4.10	AATCC TM15
Color change		
Staining on cotton		
Staining on wool		
Colorfastness to drycleaning	3.4.2 and 3.4.10	AATCC TM132
Color change		
Staining on cotton		
Staining on wool		
Colorfastness to crocking	3.4.2 and 3.4.10	AATCC TM8
Dimensional stability to drycleaning	3.4.2 and 3.4.10	AATCC TM158
Width (armhole shield binding only)	3.4.2 and 3.4.10	Visual [1/]
Edge finish (armhole shield binding only)	3.4.2 and 3.4.10	Visual [1/]

FOOTNOTE:

[1/] Results reported as pass or fail.

TABLE XIX. Floating chest piece: chest piece padding verification.

Characteristic	Requirement	Verification
Fiber identification	3.4.5.2	AATCC TM20A
Color	3.4.5.2	Visual [1/]
Construction	3.4.5.2	Visual [1/]
Weight	3.4.5.2	ASTM D3776/D3776M, option C
Thickness: initial and after three drycleanings and steam pressings	3.4.5.2	ASTM D1777 [2/]
Breaking strength: machine and cross direction	3.4.5.2	ASTM D5034
Shrinkage after three drycleanings and steam pressings: machine and cross direction	3.4.5.2	4.4.1.1 [2/]

FOOTNOTES:

[1/] Results reported as pass or fail.

[2/] Any commercial drycleaning method may be used. Material shall be steam pressed after each drycleaning.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XX. Collar padding verification.

Characteristic	Requirement	Verification
Fiber identification	3.4.6.1	AATCC TM20A
Construction	3.4.6.1	Visual 1/
Weight	3.4.6.1	ASTM D3776/D3776M, option C
FOOTNOTE: 1/ Results reported as pass or fail.		

TABLE XXI. Collar closure hook and eye verification.

Characteristic	Requirement	Verification 1/
Material	3.4.6.4	Standard commercial
Design	3.4.6.4	Visual
Dimensions	3.4.6.4	Visual
Color/finish	3.4.6.4	Visual
Coating type	3.4.6.4	Visual
Coating application	3.4.6.4	Visual
Coating tackiness	3.4.6.4	4.4.1.2
Openings	3.4.6.4	Visual
Edges and surfaces	3.4.6.4	Visual
FOOTNOTE: 1/ Results reported as pass or fail.		

4.4.1.1 Dimensional stability of floating chest piece: chest piece padding. Three 22- by 22-inch square specimens shall be cut from the polyester material (see 3.4.5.2) parallel to the machine and cross machine directions and no closer than 3 inches from the selvage. An 18- by 18-inch square shall be marked as a minimum at each corner within the 22-inch specimen with indelible ink. No marks shall be closer to the edge of the specimen than 1 inch. The specimen shall be commercially drycleaned three times using a solvent-based solution. Samples shall be bottom steam pressed after each drycleaning for 20 seconds in a non-locked position and vacuumed for 10 seconds.

4.4.1.1.1 Dimensional stability calculation. Each of the three 22- by 22-inch square specimens shall be laid out without tension on a flat surface. Care should be taken that the specimens are free from wrinkles and creases. The previously measured distances marked on the specimen (initial measurement, 18 inches) in each direction (machine and cross) shall be remeasured to the nearest 1/16 inch, recorded, averaged, and calculated for dimensional change. The dimensional change of the sample unit (three specimens) shall be calculated to the nearest 0.10 percent using the following formula:

$$\text{Dimensional change, percent} = \frac{A-B}{A} \times 100$$

Where:

A = Average of initial measurements (18 inches)

B = Average measurements after drycleaning

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

4.4.1.2 Tackiness of collar closure hook and eye. At room temperature (60 to 80 °F), a piece of commercial tissue paper shall be pressed against the lacquered surface of a hook and eye for 30 seconds, using the thumb and two fingers to exert pressure. After 30 seconds, the paper shall be removed from the surface. Any evidence of tissue adhering to the surface shall be scored as a failure.

4.4.2 In-process examination. Visual and dimensional examinations shall be made at any point or during any phase of the manufacturing process to determine whether construction details that cannot be examined in the finished product are in accordance with the requirements specified in section 3. Materials and components that contain defects and damages as defined in the visual examination of 4.4.3.2 shall be removed from production. Any in-process nonconformance remaining in the finished coat shall be classified as a defect in accordance with the visual examination of 4.4.3.

4.4.3 Visual examination. The coat shall be examined for defects in color, design, material, construction, workmanship, and marking. The defects shall be classified in accordance with the list of defects specified in 4.4.3.2. Inspection for defect categories 1 through 12 shall occur when the coat is on the model form or when spread out on a table, inspection for defect categories 13 through 26 shall occur when the coat is completely buttoned on a model form, and inspection for defect categories 27 through 38 shall occur when the coat is spread out on a table. The inspection conditions and the AQL shall be as specified in the contract or purchase order (see 6.2).

4.4.3.1 Model forms. The coat sizes listed below shall be examined on the appropriate size model form in accordance with table XXII.

TABLE XXII. Model forms.

Coat Size	Model Form Size	Model Form Measurements (Inches)		
		Bust	Waist	Hip
X0, 2, 4	4	33	24	34
6, 8, 10	6	34	25	35
12, 14	12	37	28	38
16, 18	16	40	31	41
Tolerance:		±1 inch	±1/2 inch	±1/2 inch

4.4.3.2 Classification of defects. All defects shall be classified as indicated in table XXIII. Any defect that affects appearance to an extent that it makes a coat unserviceable as a dress coat may be cause for rejection of the coat.

TABLE XXIII. Defects.

Examine	Defect	Classification		
		Major	Minor A	Minor B
1. Bartacks	a. One or two missing, loose, or misplaced (except bartacks on the buttonholes)		201	
	b. Three or more missing, loose, or misplaced (except bartacks on the buttonholes)	101		

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
2. Buttonholes	a. One or more omitted, added, or wrong type	102		
	b. Not corresponding to the size of the button:			
	(1) Too small, not permitting the button to enter the buttonhole	103		
	(2) Too large, longer than the diameter of the button by 3/4 inch or more (measured at the inside of the purling)	104		
	(3) Too large, longer than the diameter of the button by more than 3/8 inch, but less than 3/4 inch (measured at the inside of the purling)		202	
	c. Buttonhole not securely caught on the fabric, causing the stitching to pull away from the fabric	105		
	d. Bartack missing or loose on the following:			
	(1) One front buttonhole		203	
	(2) Two or more front buttonholes	106		
	e. Bartack misplaced, not serving intended purpose on one or more buttonholes		204	
	f. One or more broken stitches in the following:			
	(1) One buttonhole		205	
	(2) Two or more buttonholes	107		
	g. More than two skipped stitches in one or more buttonholes		206	
	h. Ragged edge, affecting appearance		207	
	i. Any uncut buttonhole		208	
	j. Gimp omitted in one or more buttonholes or the end of the gimp not pulled through to the underside		209	
	k. Stitches per buttonhole (not including the bartack) less than the minimum specified by the following:			
	(1) Two or more stitches		209	
	l. One or more buttonholes finished with the purling on the underside	108		
3. Buttons	a. One or more missing, loose, defective, or improper size or type		210	
	b. One or more buttons sewn with the head of the eagle in other than the upright position			304
	Note: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; unsound soldering; scratches, dents, blemishes, or imbedded foreign matter; loose or bent shanks; or are poorly plated or badly shaded.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
4. Split pin or ring toggles and reinforcement disks	(Applies to the shoulder and ornamental sleeve piece buttons)			
	a. One ring toggle omitted			305
	b. Two ring toggles omitted		211	
	c. Three or more ring toggles omitted	107		
	d. One or more reinforcement disks omitted		212	
5. Cleanness	a. Any spot or stain clearly noticeable:			
	(1) On outside	108		
	(2) On inside			306
	b. Thread ends not trimmed throughout the garment, one or more bastings not removed, or two or more shade tickets not removed			307
	c. Any residue of synthetic thread (when used) not brushed off or removed			308
6. Components and assembly	a. Any component part or required operation omitted (not herein classified)		213	
	b. Any defective component or defect of assembly (not herein classified)		214	
7. Cutting	a. Any component part of the basic material not cut in accordance with the patterns or the specified requirements	109		
	b. Scarlet piping cut on the bias		215	
	c. Any non-basic material component not cut in accordance with the patterns or the specified requirements		216	
8. Eyelets	a. One or more omitted or added	110		
	b. Wrong type		217	
	c. Eyelet not securely caught in the fabric, causing the stitching to pull away from the fabric	111		
	d. Diameter of the inside opening less than 1/8 inch or more than 1/4 inch		218	
	e. Any eyelet uncut		219	
	f. One or more broken stitches in the following:			
	(1) One eyelet			309
	(2) Two eyelets		220	
	g. More than two skipped stitches in one or both eyelets		221	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
9. Hook and eye	a. Hook or eye omitted	112		
	b. Not specified type or size		222	
	c. Hook or eye not securely tacked to the ends of the collar		223	
	d. Not aligned, causing the collar ends to be uneven by 1/4 inch or more when the front is buttoned and the hook and eye are fastened	113		
10. Material defects and damages	a. Any hole, cut, tear, smash, mend, burn, scorched area, shade marking, or open place:			
	(1) On outside	114		
	(2) On inside (longest dimension in any direction)			
	(a) Up to 1/4 inch, inclusive			310
	(b) More than 1/4 inch		224	
	b. Loose yarn, misweave, area of no dye penetration, dye streak, or woven in waste: more than 1/4 inch (largest dimension in any direction) on the outside		225	
	c. Permanent fold, pleat, or crease in the cloth (when caught in the seaming or stitching) on the outside	115		
	d. Visible needle hole(s) (no thread present) or needle chew (i.e., presence of scuffed or broken yarns caused by stitching):			
	(1) On outside:			
	(a) Up to 1/4 inch, inclusive		226	
	(b) More than 1/4 inch	116		
	(2) On inside, more than 1/2 inch		227	
	e. Knot or slub on the outside (note: only knots and slubs that exceed the limits specified in the material specification shall be scored as defects in evaluating quality of the coat)		228	
11. Pressing	a. Burned, scorched, or area with shine or gloss		229	
	b. Pressing omitted entire garment		230	
	c. Armhole stretched		231	
	d. Poorly pressed (unless otherwise indicated)			311
	e. Basting or pressing impression not removed			312
	f. Gloss not removed			313
	g. Armholes not blocked or poorly blocked		232	
	h. Edge bulky (i.e., not pressed solid)		233	
	i. Inside of the armhole not creased as required		234	
	j. Armhole seam not pressed open across the top as required		235	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
11. Pressing (continued)	k. Sleeve not creased at the front or backarm seam as specified			314
	l. Wrinkles not removed			315
	m. Lining not pressed smooth			316
12. Seams and stitching	a. Accuracy of seaming:			
	(1) Any seam twisted, gathered, puckered, or pleated		236	
	(2) Part of the garment caught in any unrelated operation or stitching		237	
	(3) Unsightly hand felling or blindstitching exposed on the outside of the coat affecting appearance		238	
	(4) End of any stitching (when not caught in other seams or stitching) not backtacked or backstitched as required			317
	(5) Wrong shade of thread or two shades of thread used on the outside of the coat, affecting appearance		239	
	b. Gage of stitching (edge, raise, and topstitching):			
	(1) Irregular (i.e., unevenly gaged, or various stitchings not uniform), affecting appearance		240	
	(2) Beyond the range of width specified or varies more than 1/16 inch when no range is specified			318
	c. Open seams:			
	(1) On outside:			
	(a) Up to 1/4 inch, inclusive			319
	(b) More than 1/4 inch but not more than 1/2 inch		241	
	(c) More than 1/2 inch	117		
	(2) On inside, except machine felling:			
	(a) More than 1/2 inch		242	
	(b) Up to 1/2 inch, inclusive			320
	(3) Machine felling:			
	(a) Up to 1 inch, inclusive			321
	(b) More than 1 inch		243	
	NOTE: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
12. Seams and stitching (continued)	d. Raw edges:			
	(1) On outside:			
	(a) Up to 1/8 inch, inclusive			322
	(b) More than 1/8 inch but not more than 1/4 inch		244	
	(c) More than 1/4 inch	118		
	(2) On inside:			323
	(a) More than 1/8 inch but not more than 1/4 inch			
	(b) More than 1/4 inch		245	
	NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.			
	e. Run-offs (see classification of open seam)			
	f. Stitch tension:			
	(1) Loose tension resulting in a loose seam (stitches grin)	119		
	(2) Loose tension on raised, edge, or top stitching, resulting in loosely exposed bobbin or top thread		246	
	(3) Tight tension (stitches break when normal strain is applied)	120		
	g. Stitches per inch less than minimum specified by:			
	(1) One or two stitches (except label stitching)			324
	(2) Three stitches (except label stitching)		247	
	(3) Four or more stitches (except label stitching)	121		
	(4) One or more stitches on the label			325
	NOTE: To be scored only if condition exists on major portion of the seam.			
	h. Wrong stitch or seam type		248	
	i. Stitching skipped or broken (on edge, raised or topstitching when seam is seamed, turned, and stitched):			
	(1) 1/4 inch or more, but not more than 1/2 inch			326
	(2) More than 1/2 inch		249	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
13. Shaded parts	a. On outside:			
	(1) Any shaded part (except belt loops)		250	
	(2) Belt loop shaded			327
	b. On inside:			
	(1) Any lining part shaded (except sleeve lining)		251	
	(2) Any sleeve lining part shaded or pairs not matching each other			328
14. Collar construction	a. Interfacing omitted	122		
	b. Interfacing tight or twisted, causing puckers on the collar, affecting appearance		252	
	c. Tight at the joint to front or back, causing puckers or pleats at the neck of the coat, affecting appearance		253	
	d. Scarlet piping irregular, affecting appearance		254	
	e. Collar ends overlapping when fastened		255	
	f. Collar ends gap more than 1/4 inch when fastened	123		
	g. Binding strip at the bottom edge of the interfacing omitted	124		
	h. Binding strip at the top edge of the interfacing other than the specified material	125		
	i. Center of the eyelet from the finished end of the collar less than 1-3/8 inches or more than 1-5/8 inches		256	
	j. One or both eyelets off-center with the top and bottom edges of the collar by more than 1/16 inch	126		
	k. Collar off-center by more than 1/4 inch	127		
	l. Finished height of the collar: Less than 1-5/8 inches or more than 1-7/8 inches		257	
	m. Collar irregular in height by 3/16 inch or more	128		
	n. Front finished ends of the collar uneven in height by 3/16 inch or more		258	
	o. Binding not exposed or not extending uniformly 1/8 inch beyond the scarlet piping at the top edge of the collar		259	
	p. Binding strip exposed beyond the bottom edge of the collar		260	
	q. End of the collar distorted, twisted, or crooked, caused by hand felling or hand stitching exposed on the outside of either collar end		261	
	r. Hand tacking at the lower corner of the collar to the coat insecure or omitted		262	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
15. Alignment of front buttons and buttonholes	a. Not aligned, causing a noticeable bulge or twist on the front when buttoned, affecting appearance	129		
16. Length of buttoned fronts	a. Right front at the corner shorter than the left front at the bottom by the following:			
	(1) More than 1/8 inch but not more than 1/4 inch		263	
	(2) More than 1/4 inch	130		
	b. Right front at the corner longer than the left front by the following:			
	(1) More than 1/4 inch but not more than 3/8 inch			329
	(2) More than 3/8 inch		264	
	c. Left front at the corner exposed beyond the bottom of the right front by more than 1/8 inch		265	
17. Shoulder construction	a. Improperly sewn, causing the shoulders or back to twist		266	
18. Shoulder pads	a. Not completely caught in the armhole tacking		267	
	b. Misplaced, not serving intended purpose (i.e., too far back or too far forward)		268	
	c. One or both pads omitted	131		
19. Shoulder straps	a. Misplaced (i.e., one shoulder strap further forward or back from the position of the other strap affecting appearance)		269	
	b. Shoulder strap stitched to the coat too full or twisted, or stitched to the coat too tight, causing fullness or twist on the front or back of the coat	132		
	c. Poorly shaped	133		
	d. Shoulder seam exposed beyond the back edge of the shoulder strap (except the rounded end)		270	
	e. Width of the shoulder strap at the armhole seam (including the scarlet piping):			
	(1) Less than 2-3/8 inches but not less than 2-1/8 inches			330
	(2) More than 2-5/8 inches but not more than 2-7/8 inches			331
	(3) Less than 2-1/8 inches or more than 2-7/8 inches		271	
	f. Width of the shoulder strap across the center of the insignia button (including the scarlet piping):			
	(1) Less than 1-5/8 inches but not less than 1-1/2 inches			332
	(2) More than 1-7/8 inches but not more than 2 inches			333
	(3) Less than 1-1/2 inches or more than 2 inches		272	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
19. Shoulder straps (continued)	g. Rounded end of the shoulder strap positioned less than 1/4 inch or more than 3/8 inch from the collar edge			334
	h. Scarlet piping irregular in width, affecting appearance		273	
	i. Buttons not uniformly set from the collar edge by more than 1/4 inch		274	
	j. Center of the button less than 3/4 inch or more than 7/8 inch from the rounded end of the shoulder strap (including the scarlet piping)			335
20. Armholes (construction)	a. Stretched		275	
	b. Taped too tight, causing puckering around the armhole seam, affecting appearance		276	
	c. Crooked seam			336
	d. Tape stitching exposed and visible on the outside of the coat			337
	e. Sleeve head pads not completely tacked to the armholes or misplaced, not serving intended purpose		277	
	f. One or both sleeve head pads omitted		278	
	g. Armhole not tacked completely or insecurely tacked		279	
21. Sleeves	a. Setting and hang:			
	(1) Sleeve fullness misplaced, affecting appearance		280	
	(2) Sleeve too far front (i.e., the front edge of the creased sleeve bottom more than 2 inches in front of the front/side front seam)		281	
	(3) Sleeve too far back (i.e., the front edge of the creased sleeve bottom less than exactly even going back from the front/side front seam)		282	
	(4) Hang of sleeves in opposite directions (i.e., one sleeve too far forward and one sleeve too far back, tolerance of 1-1/2 inches)		283	
	(5) Sleeve tight in the armhole (i.e., roll effect not present at the front or back of the sleeve)		284	
	b. Sleeve lining:			
	(1) Twisted, tight, or short, causing bulge, twist, or puckering on the outside of the sleeve		285	
	(2) Sleeve lining too long, causing the lining to sag at the bottom more than 1/2 inch			338
	(3) Sleeve lining seams out of alignment more than 3/8 inch with the sleeve seams at the armholes or at the bottom of the sleeve			339

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
21. Sleeves (continued)	c. Construction of sleeves:			
	(1) Tacking on the bottom turnup to the sleeve interfacing omitted or insecure		286	
	(2) Sleeve bottom edge uneven by more than 1/4 inch			340
	(3) Tacking on one or both sleeve lining seams to the sleeve seams omitted or insecure			341
	(4) Bottom edge of the sleeve lining turnup less than 1 inch or more than 1-1/2 inches up from the bottom edge of the sleeve			342
	d. Ornamental sleeve pieces:			
	(1) Scarlet piping irregular, affecting appearance		287	
	(2) Ornamental sleeve piece stitched to the sleeve too full or twisted, affecting appearance		288	
	(3) Length of the ornamental sleeve piece (including the scarlet piping) less than 4-7/8 inches or more than 5-1/8 inches	134		
	(4) Width at the top, center, and bottom points (including the scarlet piping) less than 2-1/8 inches or more than 2-3/8 inches	135		
	(5) Poorly shaped, affecting appearance		289	
	(6) Set on crookedly, affecting appearance		290	
	(7) Misplaced (i.e., one piece further forward or back from the position of the other piece), affecting appearance		291	
	(8) Bottom edge not horizontal with the bottom edge of the sleeve by more than 1/8 inch or the edge extends beyond the bottom edge of the sleeve		292	
	(9) Ornamental sleeve piece stitched to the sleeve with the pointed ends toward the forearm seam of the sleeve	136		
	e. Position of the buttons on the ornamental sleeve pieces (measurements made from the center of the button):			
	(1) From the top and bottom edges, including the piped edge:			
	(a) Less than 3/4 inch but not less than 1/2 inch			343
	(b) More than 1 inch but not more than 1-1/4 inches			344
	(c) Less than 1/2 inch or more than 1-1/4 inches		293	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
21. Sleeves (continued)	(2) Top or bottom button from the scalloped edge including the piped edge:			
	(a) Less than 5/8 inch but not less than 3/8 inch			345
	(b) More than 7/8 inch but not more than 1-1/8 inches			346
	(c) Less than 3/8 inch or more than 1-1/8 inches		294	
	(3) Center button from the pointed edge including the piped edge:			
	(a) Less than 1-1/8 inches but not less than 1 inch or more than 1-3/8 inches but not more than 1-1/2 inches			347
	(b) Less than 1 inch or more than 1-1/2 inches		295	
	(4) Center button not in line with the pointed edge by more than 1/4 inch		296	
22. Body (outside)	a. Fitting of the linings: Tight, short, or twisted, causing fullness or twist on the outside of the coat, affecting appearance		297	
23. Front and bottom edges	a. Front edges stretched, affecting appearance		298	
	b. Tape or the scarlet piping set on tight, causing puckering on the front, affecting appearance		299	
	c. Front or bottom scarlet piping irregular, affecting appearance		201a	
	d. Bottom edge stretched, puckered, or uneven, affecting appearance			348
	e. Bottom corner of the right front poorly shaped, affecting appearance		202a	
	f. Right front rolling outward below the loop fastener tape piece		203a	
	g. Front edge irregular, affecting appearance		204a	
	h. Right forepart overlapping the left forepart at the bottom. To measure the coat lying flat, match the side seams with the bottoms even. The left shall be 3-3/4±1/4 inches from the outer finished edge of the right front.			349
	i. Scarlet piping tight on the front or bottom edge, causing puckering on the outside of the coat, affecting appearance		205a	
24. Front facing	a. Short, tight, or twisted, causing fullness or twist on the fronts, affecting appearance		206a	
25. Outershell panel seams	a. Not pressed open		207a	
	b. Any curved panel seam stretched or distorted, affecting appearance		208a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
26. Vent opening	a. Left vent edge stretched, causing the vent to spread open, affecting appearance		209a	
	b. Row of stitching across the top of the vent opening omitted or insecure or not caught through the vent lining		210a	
	c. Left vent shorter than the right vent by 1/4 inch or more		211a	
	d. Left vent longer than the right vent by 1/4 inch or more			350
	e. Left edge tight, causing puckering on the vent edge, affecting appearance		212a	
	f. Left vent edge crooked, affecting appearance		213a	
	g. Left vent backpart overlapping the right vent backpart at the bottom edge less than 2-1/2 inches or more than 3 inches			351
	h. Width of the left vent (measured at the bottom piped edge) less than 1-7/8 inches or more than 2-1/8 inches			352
	i. Row of stitching across the top of the vent opening less than 1-5/8 inches or more than 2 inches long			353
	j. Scarlet piping exposed and visible on the left vent edge			354
	k. Row of stitching across the top of the vent opening misplaced, not serving intended purpose		214a	
27. Front buttonholes	a. Inside edge of the buttonhole eyelet positioned less than 1/2 inch or more than 3/4 inch from the front edge including the piped edge		215a	
	b. More than 1/4 inch from equal spacing		216a	
	c. Top buttonhole less than 3/4 inch or more than 1 inch from the top edge		217a	
	d. Unevenly spaced from the front edge by more than 3/16 inch		218a	
28. Front buttons (position and secure sewing)	a. Out of vertical alignment by 1/4 inch or more		219a	
	b. Button stitching caught through the interfacing (buttonhole stand) but not caught in the facing:			
	(1) On 1 button			355
	(2) On 2 or more buttons		220a	
	c. Button stitching not caught through the interfacing (buttonhole stand) on 1 or more buttons	137		

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
29. Belt loops	a. Loops less than 3/8 inch or more than 5/8 inch wide			356
	b. Length of belt loop from top to bottom folded edge less than 2-5/8 inches or more than 2-7/8 inches			357
	c. Bottom end of the loop bartacked through the double fold exposing the bartack			358
	d. Omitted:			
	(1) Two belt loops	138		
	(2) One belt loop		221a	
	e. Loop not aligned with the side seam:			
	(1) More than 1/4 inch but not more than 1/2 inch			359
	(2) More than 1/2 inch		222a	
	f. Top folded end of the loop bartacked to the coat less than 1/8 inch or more than 1/4 inch from the folded end			360
30. Labels	a. Any required label misplaced, missing, incorrect, illegible or the size label not securely caught in the stitching		223a	
	b. Combination instruction/identification label not stitched on 4 sides or not positioned as specified on the facing			361
31. Hanger loop	a. Hanger loop omitted or any end not securely stitched		224a	
	b. Less than 1-7/8 inches or more than 2-1/8 inches long, measured along the collar seam			362
	c. Hanger loop not stitched to the neck of the coat prior to seaming the collar to the neck of the coat			363
32. Front facing	a. Fullness or pleats on the facing between the buttons, between the buttonholes, or between the front edge and the button or buttonholes when buttoned			364
	b. Tacking on back edge to one or both interfacings:			
	(1) Omitted		225a	
	(2) Insecure or incomplete for a distance of more than 5 inches below the shoulder seam, or more than 4 inches above the bottom edge of the lining			365
	c. Tacking omitted or insecure at the back edge of one or both facings from the bottom edge across the scarlet piping			366

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
33. Back lining	a. Excessive fullness or pleats			367
	b. Twisted, not affecting smoothness on the outside surface of the back			368
	c. Hem twisted or width less than 7/8 inch or more than 1-1/8 inch			369
	d. Bottom raw edge of the body lining not turned under in stitching forming the hem			370
	e. Pleat in the center of the lining omitted		226a	
	f. Folded edge of the center pleat facing the right side of the coat			371
34. Front linings	a. Excessive puckering or pleated			372
	b. Twisted, not affecting smoothness on the outside of the coat			373
	c. One or both chest pleats on the shoulder omitted		227a	
	d. Folded edge of one or both chest pleats facing toward the shoulder			374
	e. Side seam of the lining not tacked to one or both side seams of the outer shell			375
	f. Back stitch omitted at the lower armhole edge from approximately 1-1/2 inches to the front of the forearm sleeve lining seam to the side seam of the body lining			376
	g. Hem twisted, or width less than 7/8 inch or more than 1-1/8 inch			377
	h. Bottom raw edge of the body lining not turned under in the stitching forming the hem			378
35. Collar lining and eyelet cover	a. Collar lining tab at the left end of the collar omitted or extending beyond the collar end less than 3/4 inch or more than 1 inch		228a	
	b. Stitching omitted on the end, side edges, or across the width of the collar tab		229a	
	c. Ends of the collar lining not securely tacked		230a	
	d. One or both eyelet covers omitted		231a	
	e. One or both eyelet covers not covering the eyelet		232a	
	f. Width of the collar eyelet cover less than 1-5/8 inches or more than 1-7/8 inches			379
	g. Felling on the front edge and along the lower corner of one or both eyelet covers omitted		233a	
	h. Felling along the lower corner of one or both eyelet covers extending for a distance of more than 3/4 inch			380
	i. Hand felling of the lining across the full width at the left or right end of the collar omitted		234a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIII. Defects – Continued.

Examine	Defect	Classification		
		Major	Minor A	Minor B
36. Right vent lining	a. Top edge not completely covering the edges of the center back seam outlets		235a	
	b. Felling at the corners of the vent opening omitted or insecure		236a	
	c. Folded edge of the lining not extending beyond the center seam allowance or right back part			381
	d. Tight, short, or twisted, causing fullness or twist on the outside of the coat		237a	
37. Barcode labels/tags	a. Barcode omitted or not readable by the scanner		238a	
	b. Human Readable Interpretation omitted or illegible		239a	
	c. Not visible on the folded, packaged item or causes damage to the item		240a	
38. Fusing	a. Omitted on any component part	139		
	b. Twisted or causing puckers or pleats on any fused component	140		
	c. Full, causing waviness on any fused component	141		
	d. Any partial or complete delamination of any fused component	142		
	e. Any strike through, bleed through, or color change	143		
	f. Any resin transfer to the coat:			
	(1) On any fused component	144		
	(2) On any non-fused component		241a	

4.4.4 Dimensional examination. The coat shall be examined for conformance to the dimensions specified in tables XII and XIII and the methods of measure specified in table XIV. Any measurement deviating from dimensions and tolerances specified in tables XII and XIII shall be scored as a measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a measurement defect. The inspection and the AQL shall be as specified in the contract or purchase order (see 6.2).

5. PACKAGING

5.1 Packaging. For acquisition purposes, the packaging requirements shall be as specified in the contract or order (see 6.2). When packaging of materiel is to be performed by DoD or in-house contractor personnel, these personnel need to contact the responsible packaging activity to ascertain packaging requirements. Packaging requirements are maintained by the Inventory Control Point's packaging activities within the Military Service or Defense Agency, or within the military service's system commands. Packaging data retrieval is available from the managing Military Department's or Defense Agency's automated packaging files, CD-ROM products, or by contacting the responsible packaging activity.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coat is intended for wear by female enlisted personnel of the United States Marine Corps.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

6.2 Acquisition requirements. Acquisition documents should specify the following:

a. Title, number, and date of this specification.

b. NSNs.

c. Size and length required (see 1.2).

d. When first article inspection is required (see 3.1.1).

e. When conformance inspection is required (see 3.1.2).

f. Applicable Government patterns (see 3.6).

g. AQLs (see 3.9, 4.4.3, and 4.4.4).

h. First article sampling and acceptance criteria (see 4.2.1).

i. Component and material sampling and acceptance criteria (see 4.3.1).

j. End item sampling and acceptance criteria (see 4.3.2).

k. Component and material examination and tests, if other than specified (see 4.4.1).

l. Visual examination inspection conditions (see 4.4.3).

m. Dimensional examination inspection conditions (see 4.4.4).

n. Packaging requirements (see 5.1).

6.3 Information requests. For access to information such as specifications, patterns, or standard shade samples of cloth, go to DLA Troop Support's Clothing and Textile website for their Specification/Pattern/Drawing Request form, https://www.dla.mil/TroopSupport/ClothingandTextiles/SpecRequest.aspx. Complete the request form, and then submit the form. Requests to use equivalent materials or components or to make changes to the pattern should be sent to the contracting officer for approval by the military services.

6.4 Suggested source of supply – haircloth. A suggested source for the haircloth (see 3.4.5.1) is QST Industries, Inc., www.qst.com. A suggested source for the alternate is Cotswold Industries, www.cotswoldindustries.com.

6.5 Suggested source of supply – collar hook and eye. A hook and eye that has been found to be acceptable, when produced in accordance with OGS Drawing 10-10372 Sheets 1 and 2, may be procured from the following source:

Waterbury Button

1855 Peck Lane

Cheshire, CT 06410

6.6 Suggested source of supply – label tape. A suggested source of supply and style number for the alternate label tape (see 3.4.16) is Eagle Wright, https://eaglewright.com, style Avery Dennison 4800TWT Polyester Thermal Transfer Printable Tape.

6.7 Solution dyed acetate lining material. A solution dyed acetate lining material is recommended to meet the specified colorfastness requirements (see 3.4.2).

6.8 Thread shade. Black AA, Cable No. 66023 of the Department of Defense Standard Color Card for Sewing Threads or equivalent is recommended to meet the shade match requirements (see 3.4.13).

6.9 Certificates of compliance (CoC). CoC may be acceptable to satisfy component requirements. It is recommended that vendors verify the acceptability of CoC with the contracting agency prior to using CoC to address any requirement.

6.10 NSN. For informational purposes only, an NSN that corresponds to this specification is listed in table XXIV. Table XXIV is not intended to be a comprehensive list of all NSNs associated with this specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

TABLE XXIV. NSN.

NSN	Size (Inches)
8410-01-512-4723	12R

6.11 Subject term (key word) listing.

Dress

Female

Marine Corps

Uniform

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.


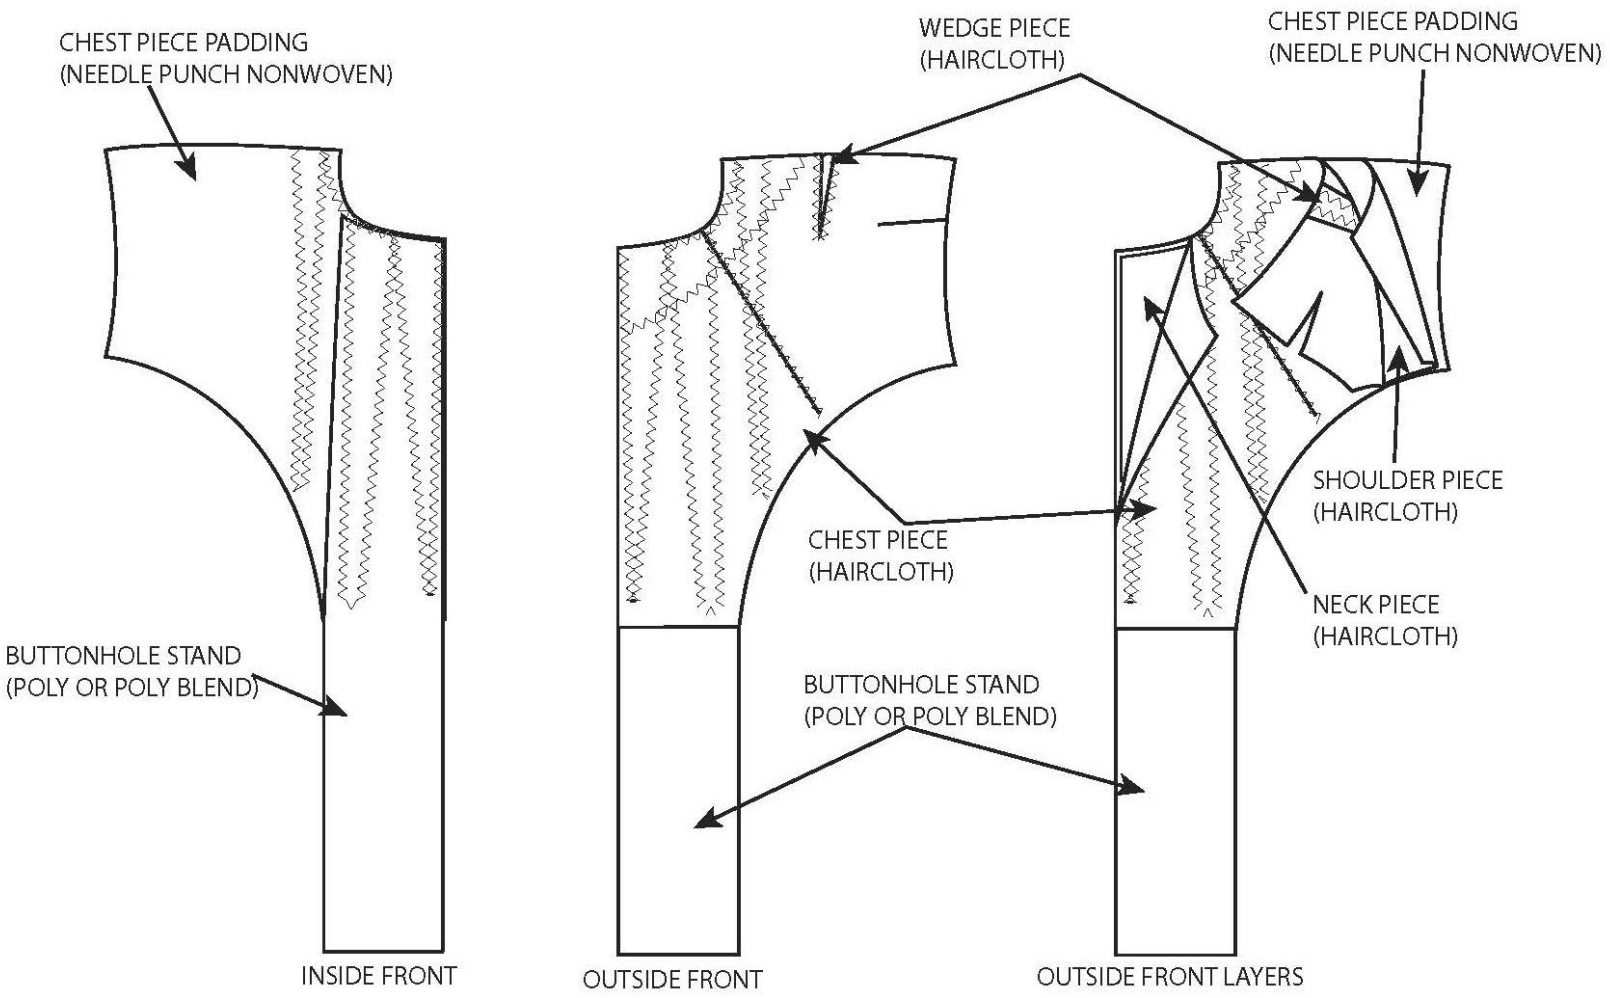


FIGURE 1. Floating chest piece.


Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

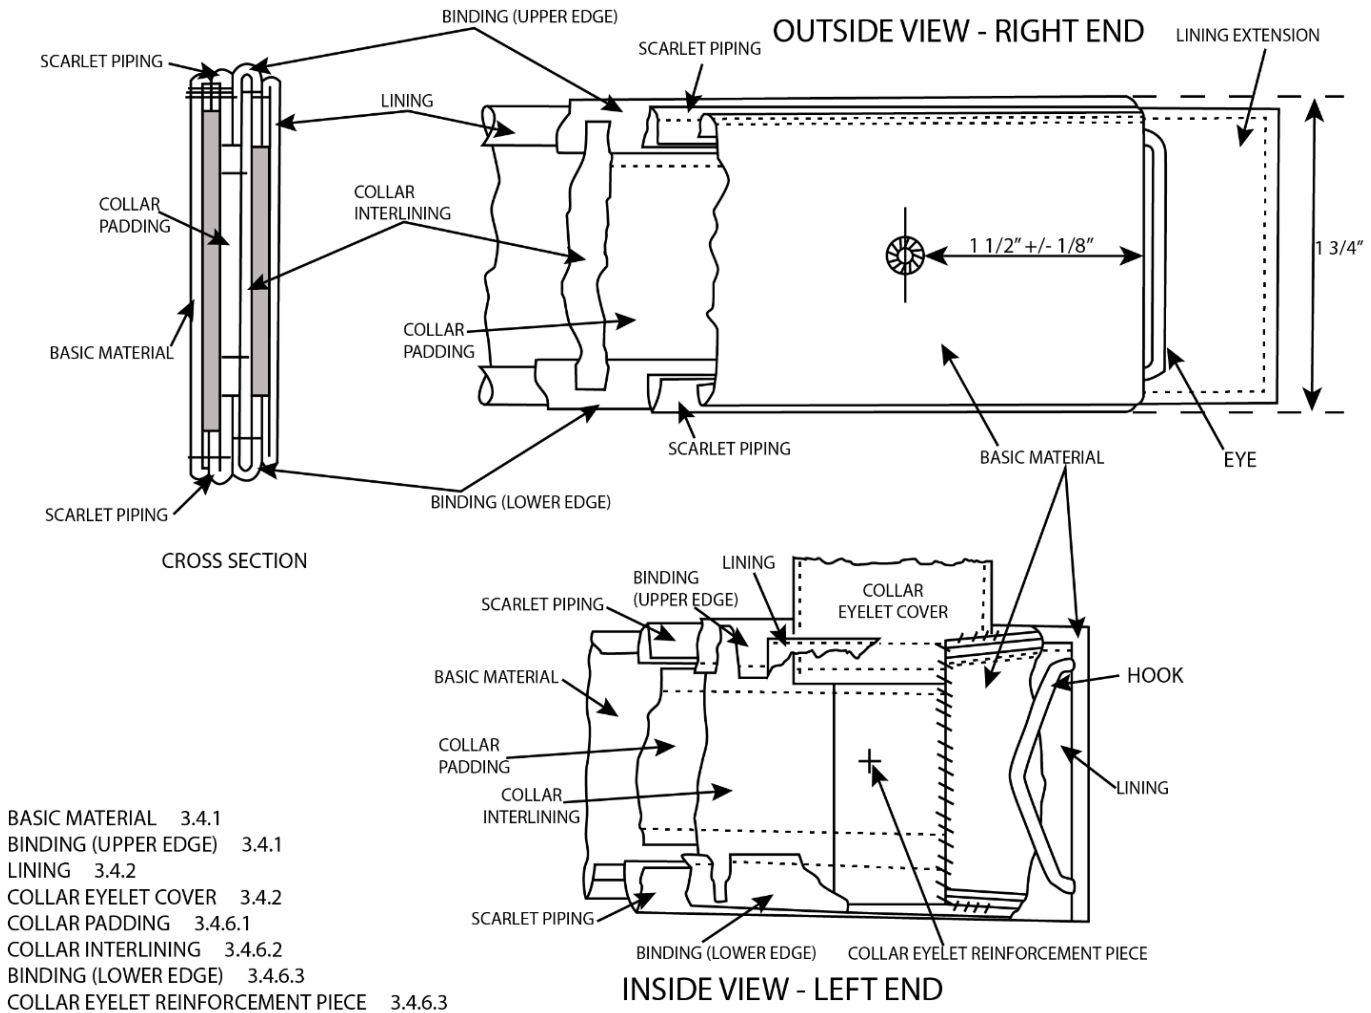

BASIC MATERIAL 3.4.1
BINDING (UPPER EDGE) 3.4.1
LINING 3.4.2
COLLAR EYELET COVER 3.4.2
COLLAR PADDING 3.4.6.1
COLLAR INTERLINING 3.4.6.2
BINDING (LOWER EDGE) 3.4.6.3
COLLAR EYELET REINFORCEMENT PIECE 3.4.6.3
HOOK AND EYE 3.4.6.4
SCARLET PIPING 3.4.11

FIGURE 2. Collar.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

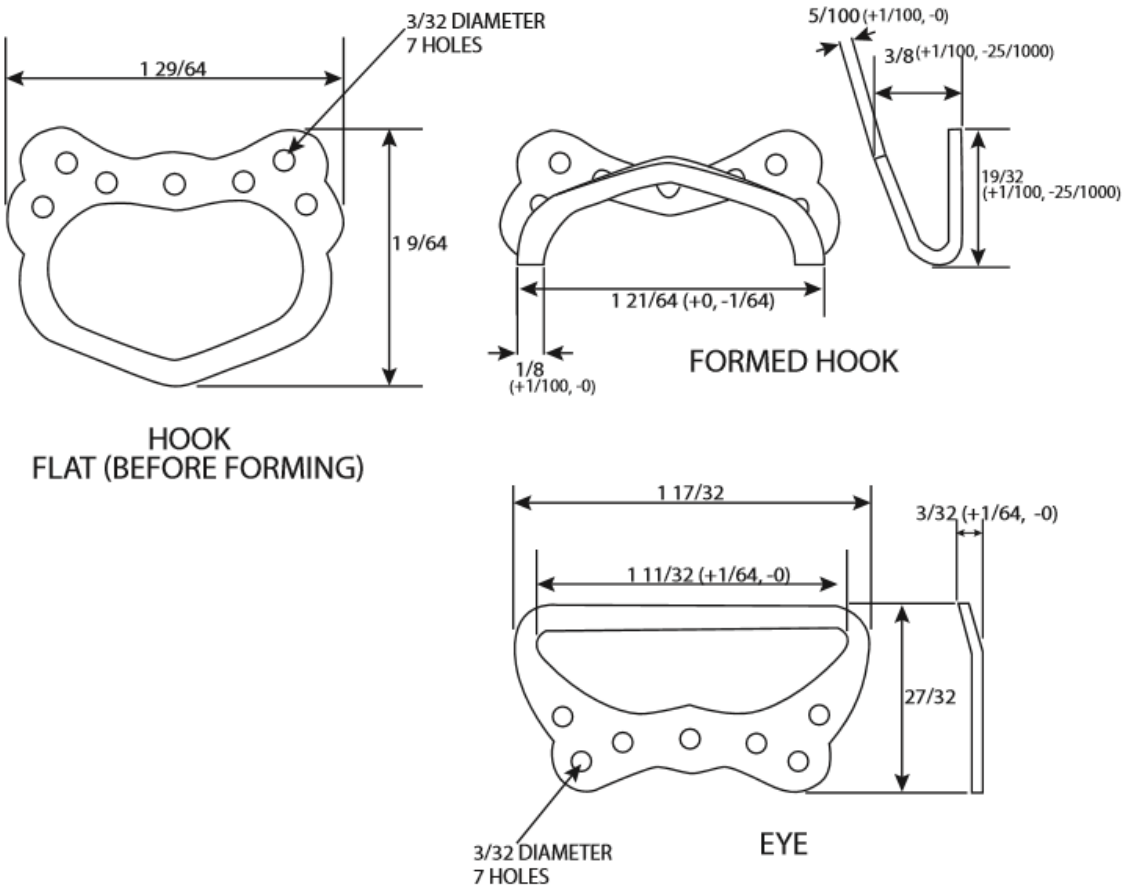

NOTE: Additional dimensions are specified in Drawing 10-10372 (see 6.5).

FIGURE 3. Hook and eye.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

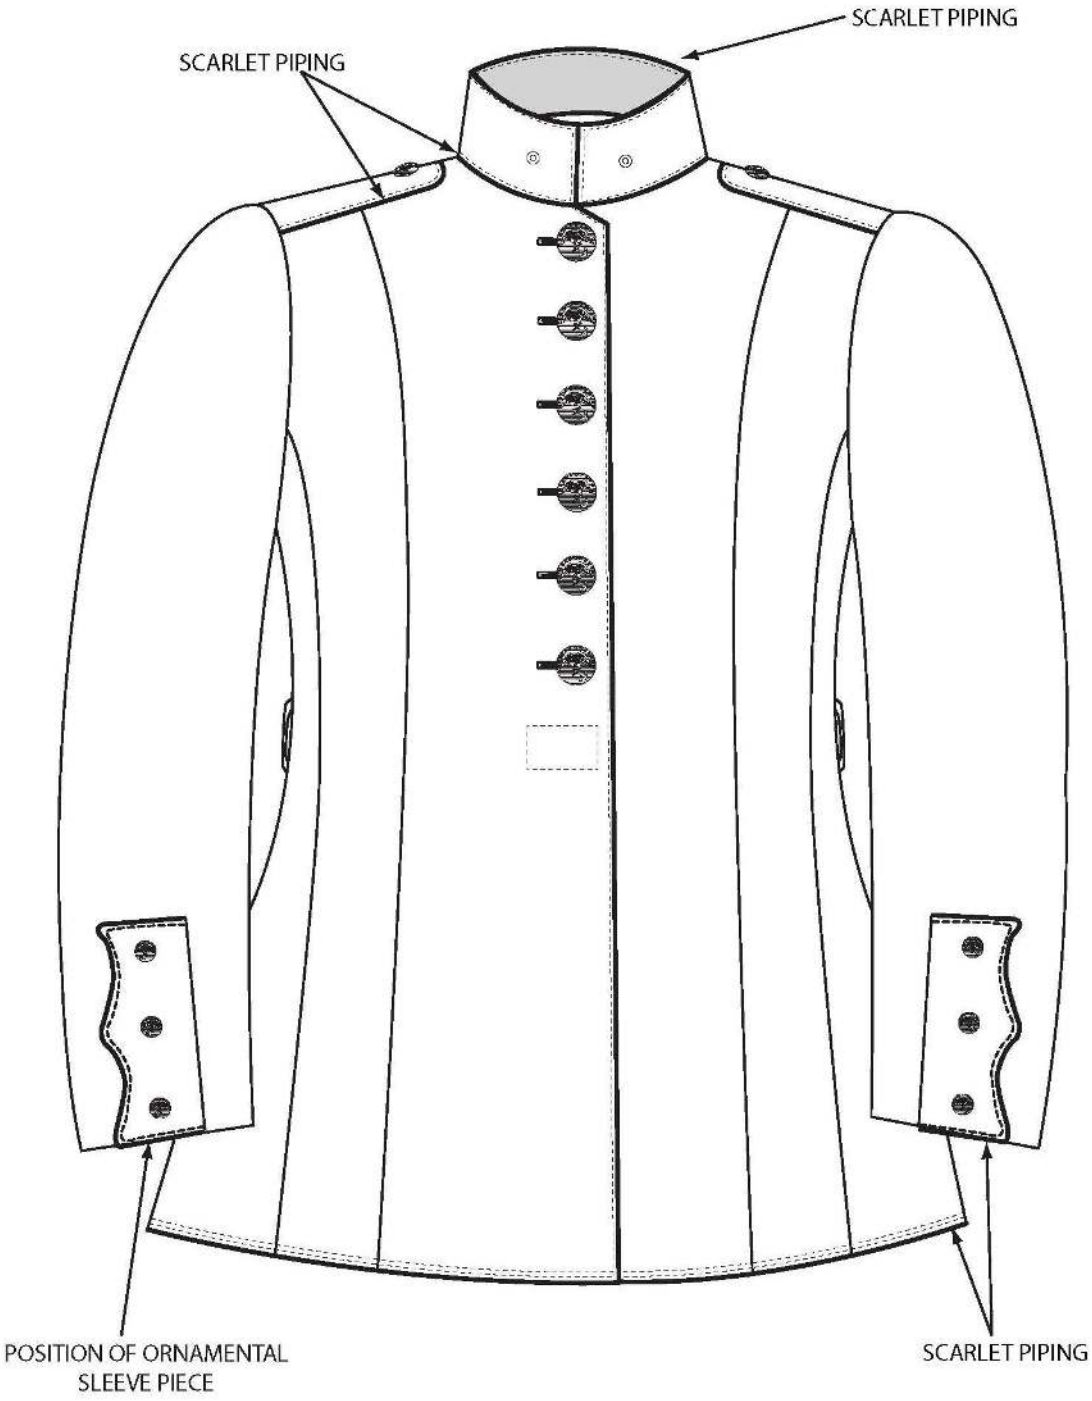


FIGURE 4. Front view – closed.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

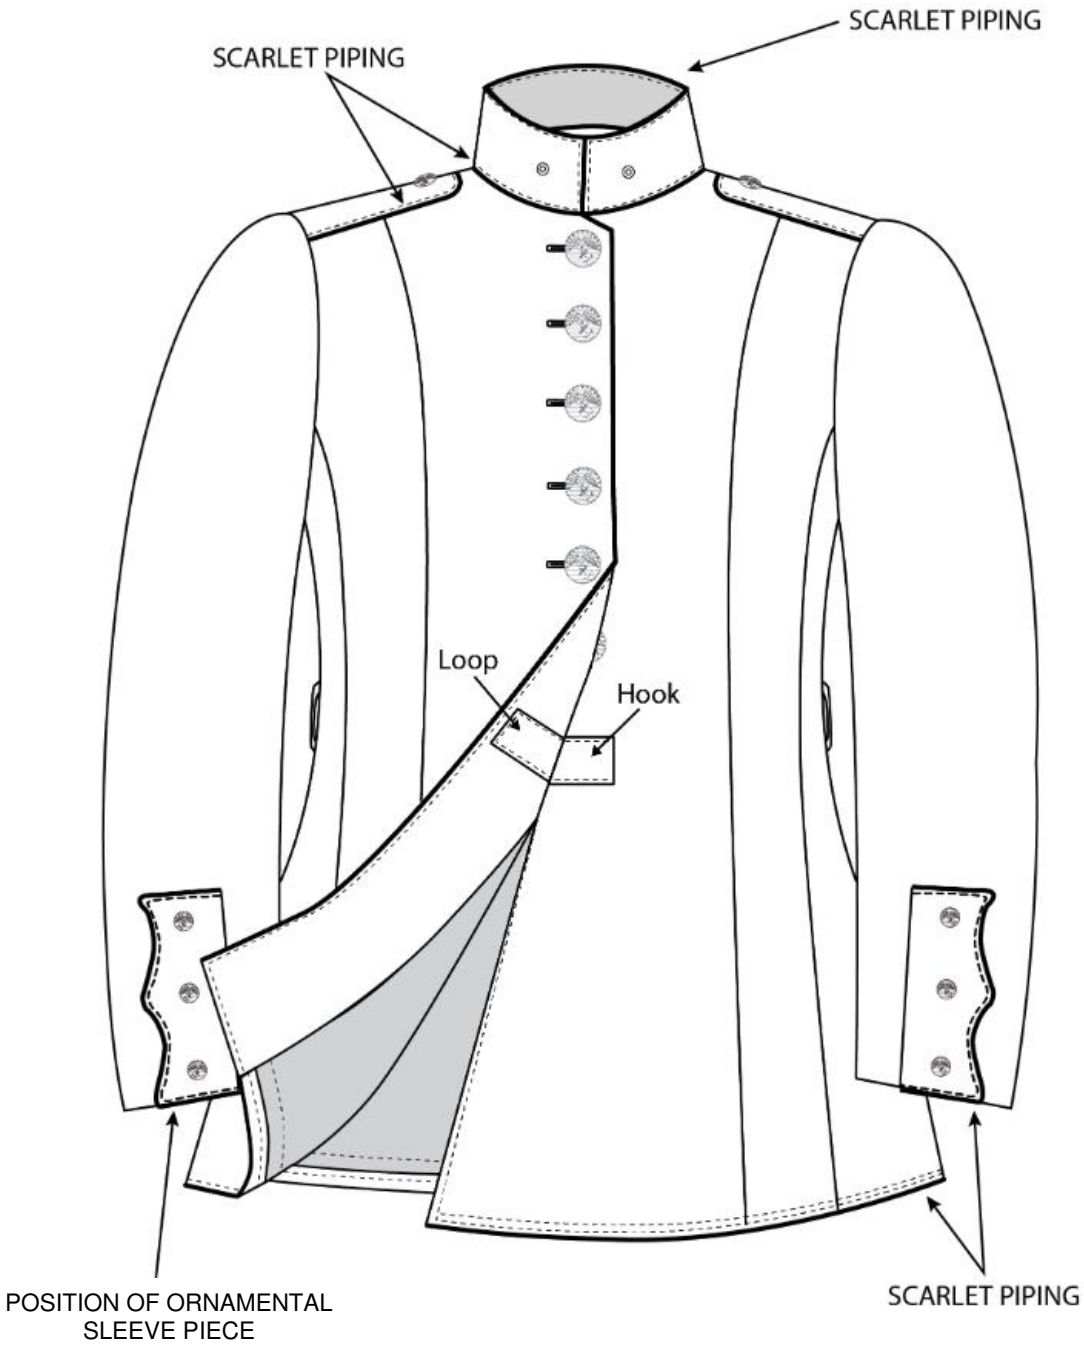


FIGURE 5. Front view – opened.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

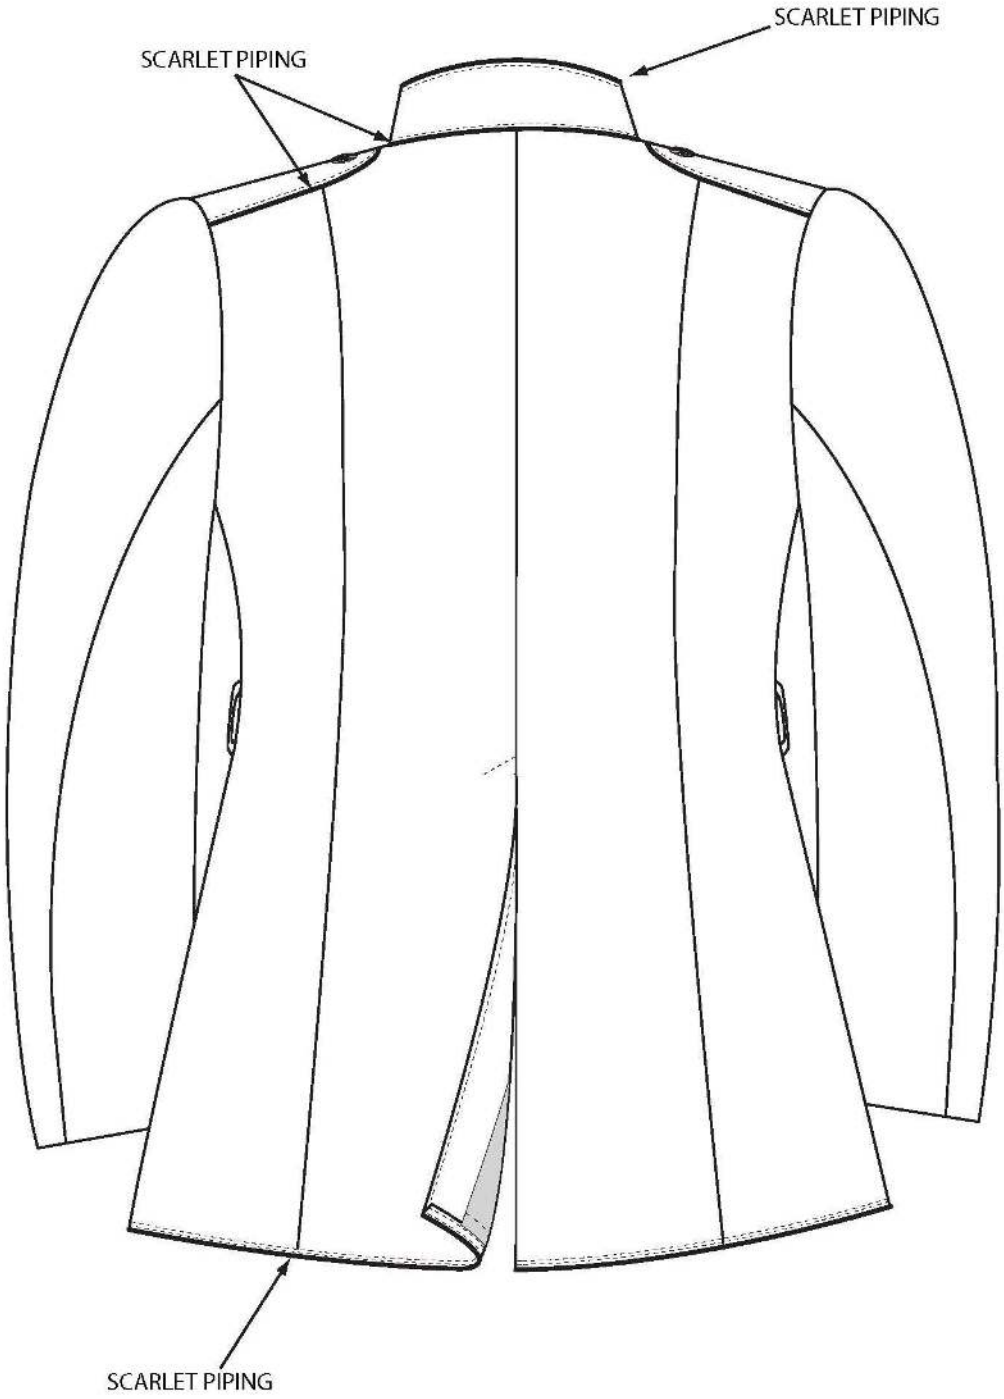


FIGURE 6. Back view.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

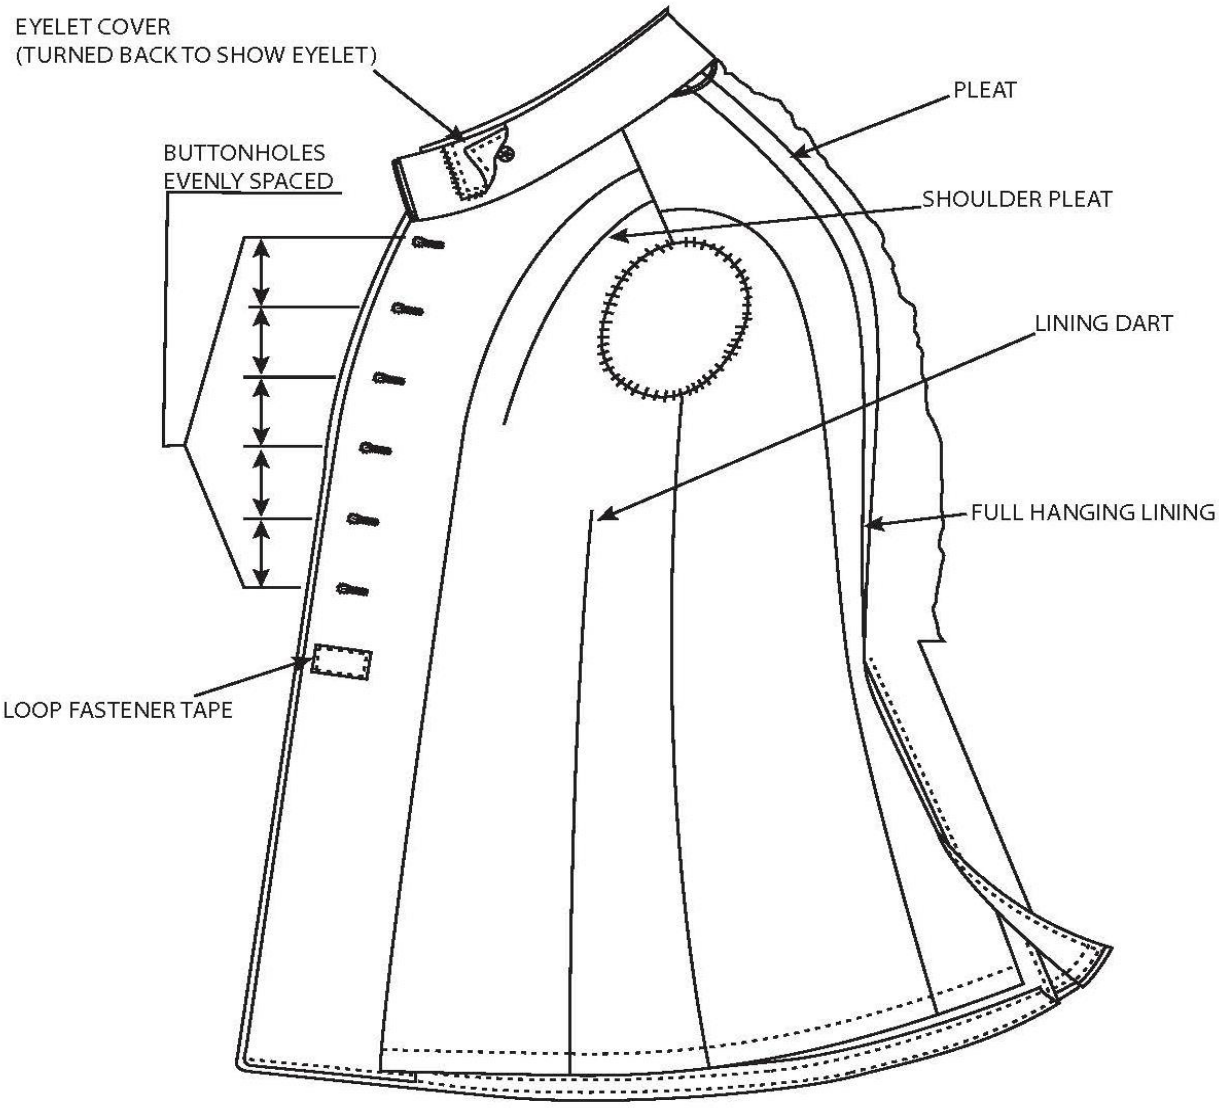


FIGURE 7. Inside view.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.

CONCLUDING MATERIAL

Custodians:
Army – GL
Navy – MC
Air Force – 11

Review activities:
Army – AV, MI
Navy – CG1, NU
DLA – CT

Civil agency:
GSA – FAS

Preparing activity:
Navy − MC
(Project 8410-2023-001)

NOTE: The activities listed above were interested in this document as of the date of this document. Since organizations and responsibilities can change, you should verify the currency of the information above using the ASSIST Online database at https://assist.dla.mil.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T07:40Z
Check the source to verify that this is the current version before use.