BY ORDER OF THE COMMANDER
ALTUS AIR FORCE BASE

ALTUS AIR FORCE BASE
INSTRUCTION 13-204

15 JULY 2025

Nuclear, Space, Missile, Command, and Control

AIRFIELD OPERATIONS PROCEDURES AND PROGRAMS

COMPLIANCE WITH THIS PUBLICATION IS MANDATORY

ACCESSIBILITY: Publications and forms are available on the e-Publishing website at http://www.e-publishing.af.mil for downloading or ordering.

RELEASABILITY: There are no releasability restrictions on this publication.

OPR: 97 OSS/OSA

Certified by: 97 OSS/CC
(Lt Col Christopher J. Schlener)

Supersedes: *ALTUSAFBII13-204, Airfield Operations Procedures and Programs, 30 March 2021*

Pages: 78

This instruction implements Air Force (AF) Policy Directive (AFPD) 13-2, *Air Traffic Control, Airspace, Airfield, and Range Management*, 22 July 2020. This instruction provides general and frequently required instructions and information particular to flight and ground operations at Altus Air Force Base (AFB). It implements the guidance from AFMAN 13-204v1, *Management of Airfield Operations;* AFMAN13-204v2, *Airfield Management*, 22 July 2020*;* and AFMAN 13- 204v3, *Air Traffic Control*, 22 July 2020. This instruction applies to all assigned, attached, and hosted aircrew members and all personnel involved in base flying activities. It provides guidance regarding airfield and terminal environment activities which directly affect flying operations. This instruction is the primary source document for describing local air traffic control (ATC), airfield, and flying operations applicable to base assigned aircrews such as Visual Flight Rules (VFR), radar traffic patterns, In- Flight Emergency (IFE) response procedures, local aircraft priorities, and etc. Refer recommended changes and questions about this publication to the Office of Primary Responsibility (OPR) using the AF Form 847, *Recommendation for Change of Publication*; route AF Forms 847 from the field through the appropriate functional chain of command. **Any changes to this instruction must be coordinated with 97 OSS/OSA.** Ensure that all records created as a result of processes prescribed in this publication are maintained in accordance with AFI 33-322, *Records Management and Information Governance Program,* 23 March 2020 and are disposed of in accordance with the Air Force Records

Information Management System (AFRIMS) Records Disposition Schedule (RDS) located at https://www.my.af.mil/gcss- af61a/afrims/afrims/.

SUMMARY OF CHANGES

This publication has been revised and must be reviewed in its entirety. Major changes include updated runway designations (throughout), the addition of Altus Night Vision Device, White Light Pattern Operations (Attachment 19) and the addition of non-towered operations procedures.

Table of Contents

Chapter 1-GENERAL

1.1. Airfield Description……4
1.2. Altus Air Space……4
1.3. Runway Selection Procedure……...7
1.4. Controlled Movement Area (CMA) ……7
1.5. Airfield Lighting Systems……9
1.6. Permently Closed/Unusable Portions of the Airfield……10
1.7. Aircraft Arresting Systems……10
1.8. Airfield Parking Plan and Restrictions……..10
1.9. ATC and AMOPS Operating Hours……..12
1.10. Local Frequencies……13
1.11. Navigational Aids (NAVAIDs) ……13
1.12. Transient Alert (TA) Services……...13
1.13. Automatic Terminal Information Service (ATIS) Procedures……..14
1.14. Aircraft Special Operations Areas/Ramps: Arm/De-Arm Areas, Engine Run-Up Areas, Drag Chute Jettison Areas, Hot Pit Refueling Areas, Unmanned Aircraft System (UAS) Designated Start Areas……..14
1.15. Aircraft Towing Procedures……..14
1.16. Aircraft Taxiing Requirements/Routes (to include Heavy Aircraft Jet Thrust Avoidance Procedures, Taxiway/Taxilane Restrictions and Wingtip Clearance, etc……...14
1.17. Airfield Maintenance (Airfield Lighting, Sweeper Operations, Grass Mowing……15
1.18. Runway Surface Condition (RSC) and/or Runway Condition Reading (RCR) Values……17
1.19. Procedures/Requirements for Conducting Runway Inspection/Checks…17
1.20. Procedures for Opening and Closing the Runways……18
1.21. Procedures for Suspending Operations on or Closing Runways and Taxiways……..18
1.22. Engine Test/Run-up Procedures……19
1.23. Noise Abatement Procedures……....20
1.24. Protection of Precision Approach Critical Areas……..20
1.25. Restricted/Avoidance Areas on the Airfield……21
1.26. Non-Tower Operations……21

Chapter 2-LOCAL FLYING AREAS

2.1. Local Flying Area/Designation of Airspace……..…23
2.2. Local Training Areas……23
2.3. VOR and Area Navigation (RNAV) (GPS)-A and B Approaches……23
2.4. Simultaneous Runway Operations……24
2.5. UAS Activities on Altus AFB……24

Chapter 3-VISUAL FLIGHT RULES (VFR) PROCEDURES

3.1. VFR Traffic Patterns……25
3.2. Special Procedures……26
3.3. Reduced Same Runway Separation Procedures……...26
3.4. Intersection Departures……27
3.5. VFR Flight Following……..27
3.6. VFR Tactical Procedures……27
3.7. VFR Departures……27
3.8. VFR Training Points……27

Chapter 4-INSTRUMENT FLIGHT RULES (IFR) PROCEDURES

4.1. Radar Traffic Pattern……..29
4.2. RNAV (RNP) X. 4.2 RNAV (RNP) X. RNAV (RNP) X…….29
4.3. Cell Departures……29
4.4. Break-Out Procedures……29
4.5. Go-Around Procedures……29
4.6. Standard Climb-out Procedures……29
4.7. Option Clearances……30
4.8. Practice Approaches by Transient Aircraft……30

Chapter 5-EMERGENCY PROCEDURES

5.1. Operation of the Primary Crash Alarm System (PCAS) and Secondary Crash Net (SCN)……..31
5.2. Emergency Response Procedures……33
5.3. Emergency Locator Transmitter (ELT) Procedures……34
5.4. Cargo/External Stores Jettison Area Procedures……..34
5.5. Fuel Dumping……35
5.6. Emergency Arresting/Barrier Gear Procedures……35
5.7. Abandonment of Aircraft……..35
5.8. Hot Brake Area and Procedures……35
5.9. Hung Ordnance Procedures……..35
5.10. Wind Limitations/Evacuation of Airfield Ops Flight (AOF) Facilities….35
5.11. Hijack Prevention and Response Procedures……36

5.12. Alternate Facility Procedures……36

Chapter 6-AIRFIELD VEHICLE/PEDESTRIAN OPERATIONS

6.1. Responsibilities……37
6.2. Airfield Driving Requirements……37
6.3. Agencies Authorized Privately Owned Vehicle Passes……37
6.4. Airfield Driving Violations and Penalties……37
6.5. Vehicle Traffic Procedures……37
6.6. Vehicular Call Signs……37
6.7. Procedures for Gaining Access to the CMA……38
6.8. Emergency Vehicle Operations……38
6.9. Airfield Construction/Work Crew/ Maintenance Restrictions……38

Chapter 7-FLIGHT PLANNING PROCEDURES

7.1. Flight Plan (FP) Filing Requirements: All aircraft departing Altus AFB must have a valid FP on file prior to departure……39
7.2. Flying Squadrons Flight Planning Procedures……39
7.3. AMOPS Flight Plan Processing Procedures……40
7.4. Flight Plan Change Procedures……40

Chapter 8-MISCELLANEOUS PROCEDURES

8.1. Airfield Operations Board (AOB)……42
8.2. Notice to Airmen (NOTAM) Procedures……43
8.3. Flight Information Publication (FLIP) Accounts and Procedures for Requesting Changes……43
8.4. Prior Permission Required (PPR) Procedures……44
8.5. Medical Airlift Aircraft Notification and Response Procedures……44
8.6. Unscheduled/Unauthorized Aircraft Arrivals……44
8.7. Local Aircraft Priorities……44
8.8. Distinguished Visitor Aircraft Notification Procedures……44
8.9. Unscheduled Aircraft Arrivals……45
8.10. Dangerous/Hazardous Cargo and Arm/De-Arm Area……45
8.11. Wear of Hats……45
8.12. Lost Communications Instructions……46
8.13. Reporting of Hazards to Air Navigation……46
8.14. Opposite Direction Traffic……47
8.15. Flight Line Smoking Policy……47
8.16. Civil Aircraft Operations……47
8.17. Civil Use of Military NAVAIDs……47
8.18. Aero Club Operations……48
8.19. Hazardous/ Severe Weather Dissemination and Coordination Procedures.48
8.20. Airfield Snow Removal Operations……48

8.21. Bird/Aircraft Strike Hazard (BASH) Program Guidelines……...48
8.22. Bird Watch Conditions……..48
8.23. Supervisor of Flying (SOF)……..48
8.24. Airfield Photography……49
8.25. Weekend Operations……49
8.26. Flight Check Operations……49
Attachment 1-GLOSSARY OF REFERENCES AND SUPPORTING INFORMATION…51
Attachment 2-AIRFIELD DIAGRAM……..54
Attachment 3-ALTUS CLASS D AIRSPACE……..55
Attachment 4-ALTUS RADAR APPROACH CONTROL AIRSPACE……56
Attachment 5-GLIDE SLOPE CRITICAL AREA/PRECISION OBSTACLE FREE ZONE……...57
Attachment 6- BORGER AIRWORK AREA……...61
Attachment 7-LOW ALTITUDE TACTICAL NAVIGATION AREA (LATN)…...62
Attachment 8-VFR TRAFFIC PATTERNS……..63
Attachment 9-RECOMMENDED WEST PATTERN GROUND TRACK……65
Attachment 10-HELICOPTER VFR PATTERN……66
Attachment 11-INTERSECTION DEPARTURE DISTANCES……67
Attachment 12-NORTH RAMP PARKING DIAGRAM……68
Attachment 13-STARTURN TRAINING AREAS……...69
Attachment 14-CMA ACCESS TRACKING LOG……..71
Attachment 15-WINGTIP CLEARANCE TRAINING LINES……..72
Attachment 16-RADAR PATTERN……..73
Attachment 17-RUNWAY 18L/36R LIGHTING CONFIGURATION……74
Attachment 18-ALZ LOCATION AND MARKINGS ON RWY 18L/36R……75
Attachment 19-Altus Night Vision Device and White Light Pattern Operations…..76

Chapter 1
GENERAL

1.1. Airfield Description. See Attachment 2, Airfield Diagram.
NOTE: Information concerning the maximum gross weight allowed per aircraft type and landing gear configuration is published in appropriate flight information publication (FLIP) documents. Airfield Management Operations (AMOPS) will ensure publication after receipt of updated information from 97th Civil Engineer Squadron (CES).

1.1.1. There are two runways and one assault strip at Altus AFB. The runways are designated as 18R/36L and 18L/36R; the assault strip is designated as 176/356. Runway 18R/36L is 13,440 feet long and 150 feet wide with a 75-foot concrete center/keel. Runway 18L/36R is 9,001 feet long and 150 feet wide. The first 1,000 feet of both runways are 150 feet wide concrete. The assault strip, featuring a grooved runway, is 3,500 feet long and 90 feet wide, and is used for assault operations training only. **NOTE:** Additional airfield information can be found in the appropriate FLIPs.

1.1.1.1. Distance between runway 18R/36L and the Assault Strip – 2,500 feet.

1.1.1.2. Distance between runway 18L/36R and the Assault Strip – 1,800 feet.

1.1.2. The runway overruns are 1000 feet long; the assault strip overruns are 300 feet long. The overruns for 18R/36L and 18L/36R are non-load bearing, 176/356 is load bearing and constructed to support aircraft traffic. **NOTE**: All non-load bearing areas are marked IAW United Facilities Criteria (UFC) 3-260-04, Airfield and Heliport Marking.

1.1.3. There are 4 taxilanes and 14 taxiways on the aerodrome. The taxilanes are A, B, B1 and B2. The taxiways are C, D, E1, E2, F, G, H, J, K1, K2, K3, L, M, and N. All taxiways are 75 feet wide. All taxiways are Portland Cement Concrete (PCC) with the exception of taxiway M, which is asphalt.

1.2. Altus Airspace.

1.2.1. Class D Airspace. That airspace extending from the surface up to and including 3,900 feet Mean Sea Level (MSL) within a 6 NM radius of Altus AFB and within 2 NM each side of the ILS 18R Localizer north course extending from the 6 NM radius to 7.6 NM north of the airport and excluding that airspace below 2,500 feet MSL west of longitude 99°18'52"W. See Attachment 3.

1.2.2. Approach Control Airspace. Designated airspace includes that airspace within an approximate 25 NM radius of Altus AFB, from the surface up to and including 9,000 feet MSL, with a western extension to 48 NM from Altus AFB, and extensions North-East around Hobart Regional Airport, and South around Wilbarger County Airport. The South extension is from the surface up to and including 4,000 feet MSL. See Attachment 4, Altus Radar Approach Control Airspace.

1.2.3. Altus Terminal Radar Service Area (TRSA): That airspace within a 6 NM radius of Altus AFB extending from the surface to 7,500 feet MSL, and within 2 NM each side of the Altus AFB Instrument Landing System (ILS) 18R Localizer north course extending to 7.6 NM north of the airport, and excluding that airspace below 2,500 feet MSL west of long. 99°18'52" W; and that airspace extending from the 6 NM radius to a 10 NM radius of Altus AFB beginning at Altus Very High Frequency Omni-Directional Radio-range Tactical Air Navigation (VORTAC) 330° radial clockwise to the Altus VORTAC 200° radial excluding that area within 2 NM each side of the Altus AFB ILS 18R Localizer north course extending to 7.6 NM north of the airport, extending upward from 2,700 feet MSL to 7,500 feet MSL; and that airspace from the 10 NM radius to a 15 NM radius of Altus AFB beginning at Altus VORTAC 330° radial clockwise to the Altus VORTAC 090° radial extending upward from 3,500 feet MSL to 7,500 feet MSL; and that airspace from the 10 NM radius to a 15 NM radius of Altus AFB beginning at Altus VORTAC 090° radial clockwise to the Altus VORTAC 200° then from the 6 NM radius of Altus AFB to a 15 NM radius clockwise to the Altus VORTAC 330° radial extending upward from 3,000 feet MSL to 7,500 feet MSL.

1.3. Runway Selection Procedure.

1.3.1. Altus Tower will determine the runway in use IAW Federal Aviation Administration (FAA) JO 7110.65. Runway 18 is designated as the calm wind runway.

1.3.2. Runway Change. Tower will coordinate with Radar Approach Control (RAPCON) prior to any runway changes. Tower will notify the Supervisor of Flying (SOF), AMOPS, Weather (WX), and Fire Department (FD) after any runway change. AMOPS shall notify Command Post.

1.4. Controlled Movement Area (CMA).

1.4.1. The complete dimensions of the CMA are depicted on Attachment 2. The CMA encompasses the active runways, ALZ, overruns, and taxiways K2 and K3, as depicted in Attachment 2. The CMA is 100 feet either side of Runways 18L/36R and 18R/36L, and the ALZ, and extends to just past the ILS Localizers for Runways 18L/36R and 18R/36L, and overruns of the ALZ. The VFR hold lines, and corresponding signs, at the intersection of each taxiway and runway or ALZ indicates the CMA boundary at taxiway and runway intersections. The VFR hold line markings are indicated by a solid, double yellow line paralleling a dashed double yellow line and are located approximately 220 - 230 feet from the runway edge. During hours that the control tower is operational, personnel and vehicles shall not enter the CMA without specific permission from the control tower and must maintain direct two-way radio communication with the tower while in the CMA.

1.4.2. Controlled Movement Area (CMA) Transfer of Control. The control tower has control of the CMA upon opening. AMOPS will normally assume accountability of the CMA from Command Post (CP) 2 hours prior to tower opening. If the tower is closed and AMOPS is open, AMOPS has accountability for the CMA and will track all personnel/vehicles in the CMA on the events log. AMOPS normal operating hours are 2 hours prior to the published airfield opening until the last wing assigned aircraft has landed and is parked/chocked. CP has

accountability for CMA when AMOPS or tower releases the area to them and will relinquish control when requested to do so by either AMOPS or the control tower. CP will maintain accountability of vehicle/personnel traffic on the CMA Monday thru Friday between the time Tower/AMOPS closes to the time Tower/AMOPS opens, weekends, federal holidays, wing down days and any other period when AMOPS and the tower are closed.

1.4.3. The tower's light gun will be used in the event radio communication is lost with a vehicle on the runway. If the vehicle driver does not respond to the light gun signals, the tower will raise and lower the intensity of the runway lighting. This signal means to immediately exit the CMA and establish communications with the tower.

1.4.4. Command Post will:

1.4.4.1. Track, document, and monitor all personnel and vehicles entering the CMA during periods of tower and AMOPS closures using the tracking sheet at attachment 14. The following information will be provided to the tower or AMOPS as requested when either facility opens: vehicle call sign (e.g., Sweeper 1, METNAV 1, etc.), number of vehicles, starting point and destination on the CMA and any other pertinent information. Note: CP will only be able to track personnel and vehicles that make contact with CP.

1.4.4.2. Discontinue tracking of personnel/vehicles when AMOPS or the tower is open. Have personnel requesting access to the CMA contact AMOPS (when tower is not yet open) at 481- 6200. When the tower is open, have personnel requesting access contact tower via FM radio for approval.

1.4.5. AMOPS will:

1.4.5.1. Notify CP of any changes to the airfield hours of operation (i.e. early opening or late closing).

1.4.5.2. Notify CP of any weekend or after-hours airfield construction or repair.

1.4.5.3. Upon opening, request all CMA activity from CP.

1.4.5.4. Upon completion of the airfield check and no later than 5 minutes prior to tower opening, AMOPS will advise the tower of all vehicles and personnel (to include call sign, location, and any other pertinent information) within the CMA and will transfer control of the CMA, to include all vehicles and personnel, to the tower.

1.4.6. Control Tower will:

1.4.6.1. Upon obtaining control of the CMA from AMOPS via FM radio or a recorded line to AMOPS, confirm the location of all vehicles and personnel on the CMA as relayed by AMOPS and request any other vehicles to contact ground if not already called.

1.4.6.2. Upon official opening of the airfield by AMOPS, the tower will make the

following announcement to all agencies on the Ramp and Crash FM nets: "Altus tower is open, all vehicles and personnel within the radio controlled movement area, contact ground with your call sign and location."

1.4.6.3. Prior to closing, notify CP of any vehicles or personnel remaining on the CMA and advise those vehicles or personnel to contact CP at 481-6313 upon exiting.

1.4.6.4. Just prior to closing, tower will make the following announcement to all agencies on the Ramp and Crash FM nets: "Attention all personnel, Altus tower is now closed. Contact Command Post for access to the Controlled Movement Area."

1.5. Airfield Lighting Systems. The Altus Control Tower is equipped with the capability to operate airfield lighting systems and the rotating beacon. During airfield operating hours, control tower personnel will operate the airfield lighting system. During hours when the airfield is closed, airfield lighting personnel are responsible for operating airfield lighting systems for maintenance, snow removal operations, etc. AMOPS shall recall stand-by airfield lighting personnel for emergency lighting outages.

1.5.1. Lighting System Types.

1.5.1.1. Runway Lights. Standard High Intensity Runway Lights (HIRL) for runways 18L/R and 36L/R (5-step intensity). **NOTE:** When the prevailing visibility is 1 SM or less, or the runway visual range (RVR) is 6,000 feet or less, report changes in the high intensity runway light (HIRL) setting to the weather observer. This ensures the RVR, based on the HIRL setting of 3, 4, or 5, represents the existing RVR.

1.5.1.2. Approach Lights: U.S. Standard "A" configuration.

1.5.1.2.1. Approach Lighting System with Sequenced Flashing Lights (ALSF-1) configuration for runways 36L/R (5-step intensity). Short Approach Lighting System with Sequenced Flashing Lights (SALSF) configuration for runways 18L/R (5-step intensity).

1.5.1.2.2. If the operation of the sequenced flashing lights is distracting due to flash intensity and/or halo effects, pilots may request the lights be turned off.

1.5.1.3. Precision Approach Path Indicator (PAPI) lights for runways 18L/R and 36L/R (5-step intensity). The lights are coincidental with the associated glideslope.

1.5.1.4. Taxiway Lights: Taxiway lights have 3-step intensity settings. There are no lights on Taxiways D or Taxiway N (Alternate Hot Cargo Pad).

1.5.1.5. Threshold Lights: All runways. Threshold lights cannot be simultaneously illuminated for both ends of the runways.

1.5.1.6. Runway Distance Remaining Markers: Runways 18L/R and 36L/R. The Assault Landing Zone (ALZ) does not have distance remaining markers, but Airfield Marking

Pattern 1 (AMP-1) Visual Landing Zone Marker Panels (VLZMP) are installed. VLZMPs are placed nine feet prior to each threshold, then at 500 feet adjacent to 500 foot Touchdown Box Stripe, then every 625 feet for interior VLZMPs.

1.5.1.7. Assault Landing Zone Lighting Systems.

1.5.1.7.1. Assault 176/356: Tower controllable AMP-1 overt (5-step), and AMP-3 overt (5-step) and IR covert lighting are available.

1.5.1.7.2. Rwy 18L/36R: AMP-1 overt (5-step) and AMP-3 IR covert tower controllable lighting systems are available on Rwy 18L/36R. See Attachments 17 and 18 for lighting, location, and marking layout.

1.6. Permanently Closed/Unusable Portions of the Airfield. Taxiway F (north of the 60's row and west of taxiway C), the Towway between Spot 27 and Taxilane B, and the south hammerhead adjacent to Taxiway D are permanently closed.

1.7. Aircraft Arresting Systems. Altus AFB does not have aircraft arresting systems.

1.8. Airfield Parking Plan and Restrictions.

1.8.1. Airfield Parking Plan. Airfield Management will review the Aircraft Parking Plan Map for the Altus airfield annually IAW AFMAN 13-204v1, *Management of Airfield Operations*.

1.8.2. Airfield Parking.

1.8.2.1. 97 MXG will ultimately determine parking for assigned aircraft. Generally, 97 AMW aircraft are typically assigned to the following parking locations:

Table 1.8. Aircraft Parking Location.

AIRCRAFT TYPE	PARKING RAMP LOCATION
C-17	Spots 1-8; 21-26; 37-39; North Ramp 1-3
KC-135	32; 33; 50-58; 60-68; 523A; North Ramp 1, 4-6
KC-46	Spots 41 – 47

1.8.2.2. Transient Alert (TA), in coordination with the AFM, will park transient aircraft based on ramp workload and pre-coordinated requirements. If able, diverted aircraft will be parked in the same general area. All procedures concerning diverted aircraft will be accomplished IAW DAFI 31- 101, *Integrated Defense*. If other considerations allow, TA will attempt to park Protection Level III aircraft remaining overnight in lighted areas of the ramp to reduce the need for portable light units.

1.8.2.3. Maintenance Operations Center (MOC) will coordinate with 97th Security Forces Squadron (97 SFS) to determine aircraft security classifications.

1.8.2.4. Oversized Transient Aircraft Operations. Oversized transient aircraft landings require prior coordination with the Airfield Manager (AFM) so special ground handling can be arranged. If an oversized aircraft requires an immediate landing due to an emergency, control tower personnel will direct the aircraft to remain on the runway and await TA's assistance after termination of emergency by the Senior Fire Officer (SFO). Tower will suspend runway operations until TA arrives to marshal the aircraft onto the taxiway and ramp. Caution: Failure to comply with these procedures may result in damage to the aircraft and/or airfield equipment.

1.8.3. Restrictions.

1.8.3.1. Aircraft capable of takeoff weights greater than 255,000 lbs may make 180 degree turns only on the high stressed concrete portions located at the last 1,000' of each runway end. All aircraft must remain within the white runway edge marks when executing 180 degree turns.

1.8.3.2. The North Ramp, located directly North-east of the control tower is an authorized location on the airfield for motorcycle training/testing IAW DAFI 91-207, *The Traffic Safety Program*. 97 AMW/SE (Safety) shall coordinate with MOC and AMOPS prior to conducting motorcycle training/testing. AMOPS will notify control tower personnel of all scheduled training/testing.

1.8.3.3. The north hammerhead can accommodate two base assigned aircraft at a time.

1.8.3.4. Taxiway N is for daytime visual meteorological conditions (VMC) use only.

1.8.3.5. Entry into the North Ramp for Parking: Aircraft other than C-17 will not taxi into the North Ramp area for parking without a marshaller. Aircraft should expect to taxi straight onto the ramp and await marshaller's instructions. All spots on the north ramp are "pushback" spots only. Exception: Aircraft utilizing spot NR-7 are authorized to taxi into designated parking spot.

1.8.3.6. North Ramp Training Areas: North Ramp star turns are not authorized while aircraft are parked on spots NR-3 through NR-7. North Ramp 180 turns training and KC-46 wingtip training area use is not authorized while aircraft are parked on spots NR-1 through NR-4 and NR-7. Aircrews use extreme vigilance for Aerospace Ground Equipment (AGE) equipment. Crews utilizing the North Ramp for training maneuvers will make their request with Altus Ground Control. The tower will then contact AMOPS for proper coordination with the MOC, which must be completed prior to aircraft entering the North Ramp. Altus Ground will notify crews when coordination is complete. See Attachment 12 for north ramp training areas.

1.8.3.7. Exiting the North Ramp: Aircraft parked on spots NR-1, NR-2, NR-4, NR-5, and NR-6 are permitted to taxi out of parking without restrictions provided they stay on the taxi lines. C-17 or KC-135 aircraft parked on NR-3 require "wing walkers" to taxi off the north ramp if any aircraft is parked on NR-2. "Wing walkers" will be used until the aircraft

reaches the eastbound taxi line that leads out of the North Ramp. More than 3 C-17's require off-set from the painting parking lines to accommodate. If there is no aircraft parked on NR-2 the "wing walker" restriction does not apply. Aircrews are solely responsible for adhering to these restrictions. See Attachment 12 for ramp layout.

1.8.3.8. The Airfield Manager or designated representative will coordinate with applicable agencies (e.g. CES, MX, Fire Dept., etc.) to impose additional airfield restrictions when conditions of facilities and services are reduced or lack sufficient resources to support current operational or mission requirements.

1.8.3.9. C-5 aircraft not permitted to taxi on taxiways K2, K3, L and ALZ due to Visual Landing Zone Marker Panel (VLZMP) obstructions at the associated taxiway and ALZ intersections.

1.8.3.10. Runway 18L/36R Weight Bearing Capacity (WBC) values for 97 AMW aircraft with the corresponding gear configuration are TT = 323, 2D = 402, TRT = 585.

1.8.3.10.1. The Airfield Manager, in coordination with CES, can approve WBC waivers for transient aircraft for Runway 18L/36R.

1.9. ATC and AMOPS Operating Hours. Facilities will normally operate 0900L-0230L Monday-Friday; closed on weekends and holidays as published in the Instrument Flight Rules (IFR) Enroute Supplement. Other operating hours will be published in the current Notice to Airmen (NOTAM). AMOPS will be available two hours prior to published airfield operating hours until the last scheduled aircraft lands and is chocked in parking.

1.9.1. Tower will conduct their opening checklist 30 minutes prior to the first scheduled departure or arrival.

1.9.2. RAPCON will conduct their opening checklist 30 minutes prior to the first scheduled departure or arrival.

1.9.3. Flying will not be scheduled outside published operating hours without prior coordination with 97 OSS/OSA (Airfield Operations) and approval of 97 OG/CC. Aircraft will not taxi earlier than the published airfield opening time.

1.9.4. For the purposes of ATC staffing, wing flying is defined as those periods when there are four or more wing aircraft operating in the local VFR/IFR pattern. **Note:** As the OG/CC designated representative the SOF may authorize the airfield to be closed after the last base assigned aircraft has landed and it is determined that there are no projected inbounds. If the OG/CC has authorized no SOF on duty, the Tower Watch Sup is also authorized to close the airfield after the last base assigned aircraft has landed and it is determined that there are no projected inbounds through AMOPS and command post.

1.9.5. During approved operations outside normal airfield operating hours, the ATC and AMOPS facilities will be manned and operated as determined by the respective facility chiefs,

considering forecasted weather, expected traffic complexity, etc. Unless specifically coordinated/approved, arriving aircraft will conduct full stop landings only (no transitions).

1.10. Local Frequencies. 97 AMW aircraft channelization of radios is programmed to the following UHF frequencies:

Table 1.10. Local Frequencies.

LOCAL CHANNEL	FACILITY	UHF	VHF
1	Clearance Delivery	284.7	120.65
2	Ground	275.8	121.85
3	Tower	254.4	119.65
4	Departure Common	290.9	
5	**Arrival Common**	391.9	127.175
6	**Approach Common**	353.7	125.1
8	**Arrival Discrete**	253.5	
9	**Emergency Single Freq Approach (ESFA)**	251.9	
10	AMC Common	319.4	
11	Command Post (CP)	349.4	
12	Pilot to Dispatch (PTD)	372.2	
13	Command Post (Alt)	321.0	
14	Pilot-to-Metro Service	239.8	
15	ATIS	273.5	109.8
16	Ft Worth Center (OK City Low)	269.375	128.4
17	Ft Worth Center (Wichita Falls Low)	350.35	133.5
18	AR 400 Primary	228.25(P) 364.325 (S)	
19	Flight Service	225.4	
20	Sooner DZ	340.6	139.6

1.11. Navigational Aids (NAVAIDs).

1.11.1. LTS VORTAC (channel 35/109.8 VHF) is located on the airfield.

1.11.2. Instrument Landing System (ILS): Available to runway 18R (111.3) / 36L (110.3) and 18L (110.55) / 36R (110.55).

1.11.3. Radar, Airfield and Weather Systems (RAWS) restoral, response, and preventive maintenance will be accomplished IAW the IFR Enroute Supplement, and the Responsibilities and Procedures for Operations and Communication Circuit Restorals MOU between the 97 OSS, 97 CES and 97 CS.

1.12. Transient Alert (TA) Services. Transient maintenance is available between 0830L and 2300L. Parts support is extremely limited. Other services are outlined in the IFR Supplement.

1.13. Automatic Terminal Information Service (ATIS) Procedures. The Altus ATIS provides aircrews with current weather, airfield advisories, NOTAMs, and additional non-control information during airfield operating hours on 273.5 and 109.8 MHZ VOR Frequency. Long-term NOTAMS shall be broadcast for 24 hours or at the discretion of the Tower Chief Controller.

1.14. Aircraft Special Operations Areas/Ramps: Arm/De-Arm Areas, Engine Run-Up Areas, Drag Chute Jettison Areas, Hot Pit Refueling Areas, Unmanned Aircraft System (UAS) Designated Start Areas.

1.14.1. Engine running crew change (ERCC) procedures.

1.14.1.1. C-17/KC-135/KC-46 ERCC aircraft will be directed as follows: primary will be on Taxilane B directly adjacent to Base Operations (Building 185); alternate will be on Taxiway C behind spot 47. Do not block access point to either the fire department or base operations. **NOTE**: Ramp congestion or airfield construction may dictate use of other locations as approved by ground control.

1.14.2. UAS arrival procedures will be followed IAW the BAMS-D MOU in the event of an RQ-4 divert. UAS Departure procedures are as follows: Maintenance crews will tow the RQ-4 to the designated "start" location for all RQ-4 departures. The taxi route will be: For Runway 36L; Charlie to Delta. For Runway 18R: Charlie to Kilo-1. The UAS designated start area is on Taxiway K-1 or Taxiway D, depending on the runway in use. Once the RQ-4 is started, maintenance crews will coordinate with Altus Ground control prior to towing the RQ-4 onto the runway. After maintenance crews disconnect from the RQ-4, they will exit the runway at the nearest taxiway and advise Altus Ground Control that they are off the active runway.

1.14.3. Unable to support Drag Chute Jettison Areas and Hot Pit Refueling Areas.

1.14.4. Hot Pit Refueling is permitted on the North Ramp for KC-135, C-17 and KC-46 aircraft.

1.15. Aircraft Towing Procedures. Personnel towing aircraft are required to be in contact with the control tower during airfield operating hours. Prior coordination between the Maintenance Operations Center (MOC) and the control tower is necessary before moving aircraft. MOC has automatic authority for pushback operations on spots in the 20/30 and 50/60 rows. MOC will notify CP of all towing operations when the Tower and AMOPS is closed.

1.16. Aircraft Taxiing Requirements/Routes (to include Heavy Aircraft Jet Thrust Avoidance Procedures, Taxiway/Taxilane Restrictions and Wingtip Clearance, etc.

1.16.1. Aircraft are authorized to taxi behind a parked C-17/KC-135/KC-46 with power settings at idle.

1.16.2. When using Taxiways E, F, or G to enter or exit runway 18R/36L or Taxiway L for

runway 18L/36R, pilots will ensure all landing gear remain on the concrete portion of these taxiways (i.e. square your turns). Taxiing on the non-stressed asphalt portions of the ramp and taxiways is prohibited, as these areas are susceptible to damage.

1.17. Airfield Maintenance (Airfield Lighting, Sweeper Operations, Grass Mowing, etc.).

1.17.1. Airfield Lighting (97 CES/CEOFE) will:

1.17.1.1. Coordinate airfield lighting maintenance activities with the AFM prior to taking control of the lights. Coordinate any planned airfield lighting checks or maintenance procedures with the control tower prior to taking control of the airfield lighting and advise tower of termination.

1.17.1.2. Conduct a daily airfield lighting check Monday through Friday (workload permitting), not including holidays or "wing down days." The inspection of the lighting system should be thorough and complete, including the approach lighting systems located off base. Airfield Lighting will notify Airfield Management (via radio or telephone) when initiating a daily inspection.

1.17.1.3. Before conducting the daily airfield lighting check, review the Command and Control Incident Management and Emergency Response Application (C2IMERA) for airfield lighting discrepancies. Update C2IMERA discrepancy status (e.g. completed, on-hold, etc.) or report status to AMOPS daily so that the C2IMERA airfield discrepancies site can be updated to reflect the most current information.

1.17.1.4. Ensure all personnel have access to C2IMERA.

1.17.1.5. Major system outages, including total system outages (e.g. runway lights, approach lights, etc.) will be reported to AMOPS immediately upon recognition.

1.17.2. Horizontal Repair (97 CES/CEOHP) will:

1.17.2.1. Ensure sweeper operators are airfield driver qualified.

1.17.2.2. Ensure Airfield Sweeper checks in with AMOPS NLT 0800L, via radio, for sweeping requirements. Use the callsign "SWEEPER1." If a second sweeper is operating on the airfield, use the callsign "SWEEPER2."

1.17.2.3. Be on cellular phone stand-by after regular duty hours and respond within 30 minutes.

1.17.2.4. At a minimum, CES/CEOHP will ensure all airfield pavements (e.g. runways, taxiways, parking spots, AGE yards, behind blast fences, etc.) are swept weekly, and/or as requested by AMOPS.

1.17.3. Airfield Mowing Operations (97 CES/CEOES) will:

1.17.3.1. Ensure areas around taxiways and runways are mowed to a height of 7 to 14 inches as required.

1.17.3.2. Ensure mower operators report to AMOPS before proceeding to the flight line.

1.17.3.3. Ensure mower operators are flight line qualified for flight line driving.

1.17.3.4. During grass growing season, inspect the condition and height of the grass for mowing or removal at least weekly or as requested by AMOPS. Grass/weeds should not be allowed to encroach on NAVAIDs, distance remaining markers or other airfield objects.

1.17.3.5. Pest Management (97 CES/CEOIE) will ensure that weed control (removal of vegetation) on taxiways and runway shoulders will be conducted quarterly, or as needed. **NOTE:** Mower operators will maintain radio contact with the tower at all times when mowing in the CMA.

1.17.4. Airfield Management (97 OSS/OSAA) will:

1.17.4.1. During normal hours of operation, conduct an airfield inspection, airfield checks (as required) and nightly airfield lighting serviceability check. All airfield discrepancies (e.g. pavement, lighting, etc.) will be annotated and tracked on C2IMERA. AMOPS will inspect lighting systems for items that cause safety of flight issues or NOTAM, in accordance with applicable directives.

1.17.4.2. Create airfield discrepancies for all deficiencies (e.g. lighting, pavement, etc.) on C2IMERA. AMOPS will notify CES customer service or CES Fire Department (if required after hours), if an airfield discrepancy qualifies as a NOTAM or is a safety of flight issue, AMOPS will provide the following information:
(a) Equipment or system description, specific to what the problem is. (e.g., Runway 36L approach lighting system, failed pavement on runway, etc…)
(b) Nature of discrepancy
(c) Time of outage
(d) Caller's initials

1.17.4.3. AMOPS will annotate discrepancy status (e.g. new, on-hold, completed, etc.) for deficiencies on C2IMERA if not already completed by 97 CES/CEOFE.

1.17.4.4. When time constraints and the amount of FOD make it practical, pick up FOD by hand.

1.17.4.5. Notify sweeper of any specific areas requiring sweeper attention when sweeper checks in with AMOPS each morning and as required throughout the duty day.

1.17.4.6. Request Fire Department contact stand-by sweeper when sweeping services are required after normal duty hours.

1.17.4.7. Notify sweeper, in advance if possible, when known after hours support will be required (e.g. scheduled weekend flying, DV arrivals, etc.).
NOTE: Any person identifying an area of potential FOD hazard on the flight line should call AMOPS during normal duty hours and report areas that require sweeping. AMOPS will contact 97 CES/CEOHP for sweeper response.
NOTE: Sweeper operators will maintain radio contact with the tower at all times when sweeping in the CMA.

1.18. Runway Surface Condition (RSC) and/or Runway Condition Reading (RCR) Values.

1.18.1. When the airfield is open, Airfield Management will determine and report the RSC/RCR as required IAW AFMAN 13-204v2, Chapter 2, T.O. 33-1-23, *Equipment and Procedures for Obtaining Runway Condition Readings*, and local operating procedures. Airfield Management will disseminate RSC/RCR information to base weather station, the Control Tower, and CP.

1.19. Procedures/Requirements for Conducting Runway Inspections/Checks.

1.19.1. The purpose of airfield inspections/checks is to ensure the airfield is safe and capable of supporting the flying mission. Construction sites and pavement repair areas are of special interest. Additionally, BASH-related inspections will be a special interest item during migratory season.

1.19.2. The following agencies will conduct inspections as described below:

1.19.2.1. In addition to paragraph 1.18, 97 CES will:

1.19.2.1.1. Inspect all excavations or closed areas when construction is in progress on the airfield at the end of the contractor workday to ensure contractual safety precautions are strictly enforced. In-house work on the airfield shall be closely monitored for strict compliance with safety regulations.

1.19.2.1.2. In conjunction with 97 OSS/OSAA and 97 AMW/SE personnel, inspect closed areas for repair/construction prior to opening.

1.19.2.1.3. Coordinate all crane requests on Altus AFB through the Deputy Airfield Manager or Airfield Manager, and the Terminal Instrument Procedures Specialist.

1.19.2.2. AMOPS will:

1.19.2.2.1. Perform a comprehensive daily airfield inspection IAW AFMAN 13-204v2 and local procedures.

1.19.2.2.2. Conduct airfield checks IAW AFMAN 13-204v2 and local procedures, to include the following:

1.19.2.2.2.1. In response to in-flight emergencies/ground emergencies.

1.19.2.2.2.2. In determining runway surface condition or runway condition reading. Additionally, AMOPS will maintain decelerometer equipment as required by AFMAN 13-204v2 and corresponding AETC Supplement.

1.19.2.2.2.3. Foreign Object Debris (FOD) checks.

1.19.2.2.2.4. Bird Aircraft Strike Hazard (BASH)/habitat control. Refer to Altus AFB BASH Plan for reporting procedures.

1.19.2.2.2.5. Inspect construction areas to ensure they do not present a hazard to aircraft operations.

1.19.2.2.2.6. Airfield lighting checks.

1.20. Procedures for Opening and Closing the Runways.

1.20.1. AMOPS is the only agency authorized to open or close a runway. AMOPS will initiate NOTAM action after notifying Tower and CP when any runway opens or closes.

1.21. Procedures for Suspending Operations on or Closing Runways and Taxiways.

1.21.1. AMOPS, SOF, or ATC are required to suspend operations to runways/taxiways when an unsafe condition exists. Unsafe runway(s)/taxiway(s) shall remain closed/operations suspended until an inspection is completed by AMOPS.

1.21.2. When an emergency aircraft has landed, the control tower shall suspend all aircraft operations to the runway of intended landing at a time or location determined by the tower watch supervisor. The suspension will take place at an appropriate time or location so as not to impede crash vehicle response or delay emergency aircraft arrival.

1.21.2.1. Operations to the runway shall remain suspended until a runway check is completed, and all vehicles/emergency aircraft have vacated the runway, except when both of the following conditions exist:

1.21.2.2. The emergency aircraft lands and taxis off the runway without assistance (i.e., crash/rescue, tow vehicles).

1.21.2.3. The SOF may waive the runway check. This option will normally be used for non- equipment related emergencies. ATC and AMOPS will log all SOF-waived runway checks on the events log.

1.21.3. When flight line firefighting capability cannot support continued flying operations, the fire department shall notify AMOPS and other required agencies. AMOPS will issue a

NOTAM, if appropriate. Landings and departures shall be restricted at the direction of the 97 OG/CC or designated representative.

1.22. Engine Test/Run-up Procedures.

1.22.1. Aircraft maintenance engine runs must be coordinated with the MOC. Radio contact must be made with the tower prior to engine stat when the tower is open. When it becomes necessary for the control tower to terminate an engine run for any reason, the maintenance crew will be advised of the reason and length of delay, time permitting.

1.22.2. MOC will coordinate all engine runs with AMOPS after complying with Table 1.23. Once AMOPS validates the request against Table 1.23., AMOPS will approve/deny the location of the engine run. MOC will then notify Tower of the aircraft tail number, location, and power setting of the engine run. The Tower will approve/deny the engine run based on traffic conditions. When the airfield is closed, MOC will coordinate with CP.

1.22.3. 97 AMW aircraft operations will be given priority over above-idle engine runs unless the SOF has coordinated with MOC and advised the tower otherwise.

1.22.4. Tower/Ground Control shall not approve engine runs above idle on spots 1 through 8 or the 40s row when another aircraft will be operating behind the engine run on Taxiway Charlie or Runway 18R/36L. This restriction shall be in effect from the time landing aircraft reach five miles from touchdown on Runway 18R/36L or turn base leg in the VFR pattern, unless aircraft will be conducting a restricted low approach at or above 1,900 MSL.
NOTE: Aircraft taxiing out of parking are not considered to be operating above idle for the purpose of suspending operations to Runway 18R/36L however, aircraft shall not taxi behind a heavy aircraft taxiing out of parking.

1.22.5. If communications are lost with the aircraft conducting the engine run, the tower shall notify the MOC.

1.22.6. C-17 engine runs above idle are permitted in reverse thrust. Landings are permitted to 18R/36L and aircraft are permitted to taxi behind engine runs in reverse.
NOTE: When operating engine runs in reverse, aircraft maintenance personnel must ensure reverse thrust is vectored away from asphalt.

Table 1.22. Engine Runs.

LOCATION	AUTHORIZED: YES or NO	RESTRICTIONS
Taxiway J/H	Yes	Acft must be centered on Twy
Taxiway J/H Parking Spots 91 – 99	No	Violates UFC 3-260-01, Appendix B, Section 12 criteria
North Ramp/Spot 7	Yes	Note: Auth. all Directions
North Ramp Spot 1	Yes	Jet Blast Southbound
North Ramp Spot 2	Yes	Jet Blast Southbound
North Ramp Spot 3	No	Violates UFC 3-260-01 Criteria

North Ramp Spot 4	No	Violates UFC 3-260-01 Criteria
North Ramp Spot 5	No	Violates UFC 3-260-01 Criteria
North Ramp Spot 6	No	Violates UFC 3-260-01 Criteria
Tanker Ramp/50's Row	Yes	None
Tanker Ramp/60's Row	Yes	Idle Run Only
Taxiway N (Alt Hot Cargo Area)	Yes	No jet blast aimed at vehicle access road
Spots 1-8	Yes	None
Spots 21-23	Yes	None
Spot 24	Yes	Reverse Idle/Reverse Thrust Above Idle
Spots 25, 26	Yes	Reverse Idle/Reverse Thrust Above Idle
Spots 32, 33, 37-39	Yes	None
Spots 41-47	Yes	None
Spot 523A	Yes	None

1.23. Noise Abatement Procedures.

1.23.1. To minimize noise pollution for Altus AFB and surrounding communities, the following procedures and restrictions apply:

1.23.1.1. Circling approaches are prohibited west of 18R/36L**.**

1.23.1.2. Aircrews shall overfly the densely populated parts of the city of Altus (west of Park Lane) at or above 4,500 feet MSL. Exception: aircraft conducting a 360 in the west rectangular pattern.

1.24. Protection of Precision Approach Critical Areas.

1.24.1. The localizer and glideslope critical areas are depicted in Attachment 5.

1.24.2. Localizer Critical Areas. When official weather observation reports ceiling less than 800 feet or visibility less than 2 SM, tower will not authorize vehicle/aircraft operations in or over the localizer critical areas when an aircraft conducting an ILS approach is inside the final approach fix (FAF).

1.24.3. Glideslope Critical Area. When official weather observation reports ceilings of less than 800 feet or visibility less than 2 SM, tower will not authorize vehicle/aircraft operations when an aircraft conducting an ILS approach is inside the FAF.

1.24.4. Precision Obstacle Free Zone (POFZ). Tower will ensure the POFZ is clear of traffic (aircraft or vehicles) when an aircraft on a vertically-guided final approach is within 2 miles of the runway threshold and the reported ceiling is below 300 feet or visibility is less than 3/4 SM to protect aircraft executing a missed approach.
NOTE: The Instrument Hold Lines on Taxiway K1, H and E2 are positioned to protect the

runway 18R and 36R POFZs.

1.24.5. Precision Obstacle Clearance Surfaces (OCS). When weather is below an 800 feet Above Ground Level (AGL) ceiling or 2 SM visibility, tower will not authorize vehicle/aircraft operations beyond the Instrument Hold Lines on Taxiway K1, H when an aircraft on the vertically-guided approach is within 2 miles of the runway threshold. NOTE: The Instrument Hold Lines on Taxiway K1 and H are positioned to protect the runway 18R POFZ and OCS.

1.25. Restricted/Avoidance Areas on the Airfield. All aircraft parking areas are in restricted areas. The North Ramp and Alert Area (Taxiways H/J) are restricted only when aircraft are present at these locations.

1.26. Non-Tower Operations.

1.26.1. Crews will follow the guidance from AFMAN11-202v3 para 14.16 and AIM 4-1-9 for non-towered operations at Altus AFB. Non-Towered operations will only be conducted during daytime, and if the forecast plus one hour will be suitable for VFR operations. Traffic advisory calls will be made on KLTS CTAF VHF frequency (119.65 MHz) as well as KAXS CTAF (122.8 MHz), which will be monitored from no later than 10NM to the airfield until clear of runway 18R/36L, the only authorized runway for non-towered operations. Crews will conduct a low approach of the intended landing runway to inspect the runway and ensure it is clear of hazards, obstacles, or personnel prior to landing. KAXS AWOS will be utilized to obtain an updated weather observation prior to landing at KLTS.

1.26.2. Crews will ensure their flight plans are closed, either with ATC prior to landing or by calling Flight Service after landing IAW AIM 5-1-15. An alternate with suitable crash/fire/rescue/medical services will be filed, regardless of weather conditions at Altus AFB, with preference given to selecting suitable DoD facilities. Crews experiencing an In-Flight Emergency requiring emergency response services will not land at Altus AFB unless in the judgment of the Aircraft Commander the aircraft cannot reach another location. If an aircraft needs assistance after landing due to a malfunction or emergency, crews will contact Altus Command Post (Geronimo) for assistance and coordination of any required services. Crews should expect extended delays for any assistance required, including but not limited to crash/fire/rescue services or maintenance support during non-towered airfield operations at Altus AFB.

1.26.3. Parking will be pre-coordinated with maintenance to determine expected parking location upon return. KC-135 crews will park in spot 50, with spots 51-58 as backups to allow self-parking with their crew chiefs marshalling into parking. Crew chiefs will be deplaned prior to taxiing onto taxiway B1. C-17 crews will park in spots 1-8, and will deplane their crew chiefs or additional crewmembers to serve as marshallers prior to turning off Taxiway C to ensure taxi clearances. KC-46 crews will park in spots 41-47, and will deplane their crew chiefs or additional crewmembers to serve as marshallers prior to turning off Taxiway C to ensure taxi clearances. Command and Control is through Geronimo, with primary frequency being 349.4 and secondary being 321.0. Crews will notify Command Post prior to stepping to

the aircraft and will notify Geronimo of wheels up time. Upon arrival, crews will notify Geronimo 30 minutes prior to arrival and upon landing, passing their parking location. Geronimo will be responsible for coordinating any required services such as crash/fire/rescue/medical if required, however there could be a potentially lengthy delay in response times.

Chapter 2

LOCAL FLYING AREAS

2.1. Local Flying Area/Designation of Airspace. A majority of the flight training conducted at Altus AFB occurs in an area bounded by a line from Chickasha, Oklahoma; southwest to Snyder, Oklahoma; southwest to Tipton, Oklahoma; south to SNEED intersection; west to Guthrie Very High Frequency Omni-Directional Range (VOR); northwest to the Prairie Dog Town Fork of the Red River; north to White Deer, Texas; northeast to Canadian, Texas, on the Canadian River; east to a point on the Canadian River; south of Camargo, Oklahoma; then southeast to the starting point at Chickasha, Oklahoma.

2.2. Local Training Areas.

2.2.1. Borger Airwork Area (KC-135). The Borger Airwork (BGAA) training area is the area between the Panhandle (PNH) 020 radial, clockwise to the PNH 070 radial, between 20 and 60 Distance Measuring Equipment (DME) (N35° 31’ 45”/W101° 30’ 24” to N36° 07’ 00”/W101° 07’ 04” to N35° 26’ 13”/W100° 29’ 54” to N35° 18’ 13”/W101° 17’ 58” to N35° 31’ 45”/W101° 30’ 24”). The altitude will be assigned by Fort Worth Air Route Traffic Control Center (ARTCC) between FL 200 and FL 260. Crews can expect a 2,000 foot block altitude within this range. Pilots shall file the PNH 045040 (BGAA) and place the altitude (2,000 foot block between FL 190 through FL 270) in the route of flight block on DD Form 1801, *DoD International Flight Plan.* Flight planning procedures are outlined in Chapter 7. The Borger Airwork Area is depicted in Attachment 6.

2.2.2. Low Altitude Tactical Navigation (LATN) Training Area. The LATN training area is bounded by N34° 00’ – N36° 00’ latitude and W99° 00’ – W101° 30’ longitude. This area is environmentally assessed for one-time flights on random routes at altitudes down to 300 feet AGL. Low-level routes flown outside of this area must be flown at or above 500’ AGL. Prior coordination with 97 OSS/DOA (Airspace Manager) and 97 OSS/OSK (Weapons and Tactics) (via Air Movement Table) is required before utilizing the Altus LATN to ensure compliance with local no fly and noise abatement areas and to deconflict traffic utilizing Sooner Drop Zone (DZ)—see Attachment 7.

2.3. VOR and Area Navigation (RNAV) (GPS)-A and B Approaches:

2.3.1. VOR or aircraft/aircrew and may be flown to any landing surface or as assigned by tower.

2.3.2. VMC Procedures. The VOR or RNAV (GPS)-A and B may be flown when radar is operational. The approach will be flown to runway 18L/36R (18R/36L or 176/356 may be used at Tower’s discretion). When the weather is 2,000 foot ceilings or greater and 3 SM visibility or greater, IFR clearances will be automatically cancelled at the FAF. If the aircraft requests to return to the radar pattern, Tower will coordinate and issue climbout instructions. Aircraft requesting approach to runway 18R/36L may expect delay due to sequencing with straight- in traffic.

2.3.3. Instrument Meteorological Conditions (IMC) Restrictions. Radar is required to conduct the VOR or AV (GPS)-A and B approaches. During busy traffic periods, aircraft may expect delays due to traffic sequencing and increased separation requirements.

2.4. Simultaneous Runway Operations. RAPCON may conduct simultaneous approaches to 18R/36L and 18L/36R IAW FAA JO 7110.65.

2.5. UAS Activities on Altus AFB. Installation Commander is the approval authority for use of drones on Altus AFB.

Chapter 3

VISUAL FLIGHT RULES (VFR) PROCEDURES

3.1. VFR Traffic Patterns. Altus AFB VFR traffic patterns consist of the overhead, rectangular, and East low closed patterns (see Attachment 8). Runway 18R/36L is designated as the primary instrument runway and Runway 18L/36R as the primary VFR runway; however, ATC may elect to use either runway for both VFR/IFR operations.
NOTE: Traffic pattern saturation occurs when there are six VFR or more aircraft in the traffic pattern(s). When this occurs, aircrews can expect delays, extended vectors, extended downwind, holding, etc., to provide the proper interval between arrivals and departures.

3.1.1. East Rectangular Traffic Pattern. The pattern altitude is 2,900 feet MSL. The weather minimums are at least a 2,000 foot ceiling and 3 SM visibility.

3.1.2. West Rectangular Traffic Pattern: The pattern altitude is 2,900 feet MSL. Normally, VFR patterns from/to Runway 18R/36L will be a west pattern. Aircraft must be at 2,900 feet MSL prior to turning crosswind. Aircraft flying the west pattern should remain east of Park Lane (see Attachment 8 for visual references) in order to reduce potential for conflicts with Altus/Quartz Mountain Airport (AXS) general aviation traffic. If the aircraft commander or ATC requires a 360 degree turn on the downwind leg, the aircraft commander shall climb to 3,400 feet MSL prior to executing a westbound turn. Altus Tower, time permitting, will advise aircraft prior to executing a westbound turn to climb to 3,400 feet MSL. The absence of ATC climb instructions does not alleviate the aircrew from complying with this requirement. Even though the distance between Assault Landing Zone 176/356 and Runway 18R/36L is greater than 2,500 feet, to the maximum extent possible, pilots and controllers should attempt to avoid a base turn to final that places aircraft nose- to-nose on a base turn. The weather minimums are at least a 2,500 foot AGL ceiling and 3 SM visibility. NOTE: Aircrews shall use caution when operating in the Altus AFB West Pattern. Aircraft operating in the vicinity of AXS are small and difficult to see from the Altus AFB air traffic control tower. Altus tower and approach are normally not in radio communication with aircraft operating in the AXS shelf defined as: that airspace West of Longitude 99°18’52”W (Park Lane) below 2,500 feet MSL.

3.1.3. Low Closed Traffic Pattern. 97 AMW aircraft only are authorized to fly the circling approach ground track, East traffic only, within 4.5 NM of Runway 18L/36R or 18R/36L at 2,000 feet MSL to simulate a circling maneuver. Weather minimums are at least a 1,500 foot ceiling and 3 SM visibility. Should extensions beyond 4.5 NM of the runway become necessary for spacing/sequencing, aircraft shall be instructed to climb to 2,900 feet MSL or 3,400 feet MSL to enter the tower VFR pattern.

3.1.4. Overhead Traffic Pattern. With the exception of Duke Overhead procedures, RAPCON will provide vectors (upon pilot request) to initial for aircraft under their control requesting the overhead traffic pattern. The initial entry altitude for aircraft flying the overhead traffic pattern is 3,400 feet MSL. Aircraft will execute a level break. The direction of break will be determined by Altus Tower on initial contact. Aircraft will descend in the base turn, unless otherwise instructed by ATC. Weather minimums for the overhead pattern are at least a 2,500

foot AGL ceiling and 3 SM visibility. Note: Non-base assigned aircraft are authorized to conduct the overhead traffic pattern with an east or west break.

3.1.5. Tower will restrict departing and go-around aircraft as necessary to protect aircraft in the overhead pattern. All aircraft departing runway 36 shall be restricted to at or below 2,400 feet MSL until reaching the departure end of the runway. All aircraft departing runway 18 shall be restricted to at or below 2,400 feet MSL until 1.5 DME South.

3.2. Special Procedures.

3.2.1. Helicopter VFR Pattern. Enter downwind at 1,900 feet MSL; maintain 1,700 feet MSL on base leg until turning final. Direct approach from the east may be used to expedite helicopters crossing final approach. See Attachment 10.

3.2.2. Sooner DZ Deconfliction Procedures. The Sooner DZ is designated as the LTS R247/022.

3.2.2.1. On every 180 degree run-in to the DZ, the airdrop formation will report "Reed Southbound" to Altus Approach Control. On other run-ins aircraft will give their approximate position (i.e., "ten miles west of the DZ"). Approach control will provide traffic advisories to the airdrop formation.

3.2.2.2. If the drop zone is reported hot, aircraft on IR-105 will climb to 1500' AGL until they have visual/radar contact with the heavy aircraft. Once visual/radar contact is established, aircraft may return to minimum altitudes.

3.2.2.3. If an airdrop formation is on an IFR Station Keeping Equipment (SKE) run-in and there is IFR traffic on IR-105, Altus Approach Control will break off the SKE run-in unless the formation cancels IFR. (IFR traffic on an IR route has priority.)

3.2.3. Transitions.

3.2.3.1. Radar to Tower. After completing the option, aircraft will maintain VFR and request approval to enter the VFR pattern.

3.2.3.2. Tower to Radar. Tower will issue local climb-out, radar vectors, or aircraft can expect closed traffic with radar climb-out issued on VFR downwind.
NOTE: From the VFR pattern and for optimum service, request local climb-out one pattern in advance.

3.2.4. Night Vision Goggles. Reference NVD/White Lights MOU.

3.3. Reduced Same Runway Separation Procedures. Altus Tower will apply reduced same runway separation IAW AFMAN 13-204v3 and AETC Supplement to applicable AETC aircraft.

3.4. Intersection Departures. Intersection departures from runway 18R/36L and runway 18L/36R may be approved by Altus Tower. Intersection departure distances are depicted in Attachment 11.

3.5. VFR Flight Following. All Altus VFR arrivals shall participate in flight following and contact Altus Approach on 257.725 or 125.1 MHz. RAPCON will normally transfer arriving aircraft to the control tower no later than (NLT) 10 miles from the airport.

3.6 VFR Tactical Procedures. (97 AMW aircraft or organizations with approved Letter of Agreement) All VFR tactical procedures will be accomplished IAW the guidance outlined in the 97 AMW In-Flight Guide.

3.6.1. Duke Tactical departures. Duke Tactical departures will normally be flown with a VFR climb to 6500 feet MSL. When requested, the departure may be flown between 4500 feet and 8500 feet MSL. Prior to climbing to an altitude other than 6500 feet MSL, aircrews will coordinate and receive approval from ATC. Aircraft departing on a Duke Tactical departure may be instructed to climb to 3400 feet MSL prior to eastbound turn when departing from runway 18R/36L in order to protect aircraft departing from 18/36A or 18L/36R.

3.6.2. Duke Beam. Duke Beam arrivals will normally be flown departing Duke at 7500 feet MSL. When requested, aircrew may depart Duke between 4500 feet and 8500 feet MSL. Prior to departing Duke at an altitude other than 7500 feet MSL, aircrews will coordinate and receive approval from ATC.

3.6.3. Duke Shallow arrivals. Duke Shallow arrivals will normally initiate at Duke when no more than one (1) other aircraft is in the VFR pattern. Aircrews may request to initiate these arrivals from the VFR pattern, when no more than one (1) other aircraft is in the VFR pattern.

3.6.4. RNAV (RNP) X approaches should normally be conducted when no more than one (1) other aircraft is in the pattern.

3.7. VFR Departures. Tower will normally instruct all VFR departures leaving the tower pattern to fly runway heading and climb to 4,500 feet MSL.
NOTE: Not applicable to Tactical Departures.

3.8. VFR Training Points. Locations are:

Table 3.8 VFR Point Locations.

VFR POINTS	DME POINTS
STEED	LTS R058/016 DME
KACIE	LTS R104/021 DME
CAMMS	LTS R169/016 DME
BENDD	LTS R221/021 DME
BABBS	LTS R289/016 DME
ALEXX	LTS R348/019 DME

NOTE: When utilizing BABBS or ALEXX, aircrews should plan their routing to avoid flying over the town of Mangum, Oklahoma. In addition, caution should be used when flying to point KACIE. KACIE is in the vicinity of the transition corridor from IR-103 to R-5601. Aircrews should be on alert for potential conflicts in this area. VFR flight following is mandatory when flying to and from Altus from all VFR training points and between all VFR training points.

Chapter 4

INSTRUMENT FLIGHT RULES (IFR) PROCEDURES

4.1. Radar Traffic Pattern. The radar traffic pattern (east or west downwind) will normally be flown at 4,000 feet - 5,000 feet MSL. Aircraft should expect vectors from RAPCON to the final approach course.

4.2. RNAV (RNP) X. 4.2 RNAV (RNP) X. RNAV (RNP) X approaches should normally be conducted when no more than one (1) other aircraft is in the pattern.

4.3. Cell Departures. Cell departures are classified as "military authority assumes responsibility for separation of aircraft" (MARSA) operations and pilots will be responsible for separation between cell aircraft on departure. Each aircraft within a non-standard formation cell departure will have a dedicated call sign/flight plan and beacon code (IAW FAA JO 7110.65). Clearance Delivery will determine the break up point (last common fix) using the full route flight plan or by asking the flight lead. A clearance to the break up point will then be issued followed by "EXPECT FURTHER CLEARANCE AT (breakup point) VIA FILED FLIGHT PLAN ROUTE."
Exception: All C-17 formation flights will depart on a single flight plan. MARSA will be cancelled upon split-up.

4.4. Break-Out Procedures. Break-out procedures are designed for aircraft outside the confines of the Altus Class D airspace. In the event of a breakout, aircraft will be directed by the appropriate ATC facility to climb and maintain 4,000' MSL and await specific vector instructions, unless otherwise coordinated by ATC.

4.5. Go-Around Procedures. Go-around procedures are designed for aircraft within LTS Class D airspace. When an aircraft is required to go-around, ATC will instruct aircraft to "CLIMB AND MAINTAIN 4,000 FEET, FLY RUNWAY HEADING" when necessary to discontinue an approach. The phrase "GO-AROUND" may be issued to aircraft in time critical situations to indicate this procedure. Aircraft will be restricted IAW paragraph 3.1.4 when the overhead pattern is in use.

4.6. Standard Climb-out Procedures. Standard climb-out procedures are: "FLY RUNWAY HEADING, CLIMB AND MAINTAIN 4,000'." The ATC phraseology has been abbreviated for base assigned aircraft. Procedures are as follows:

4.6.1. ATC Phraseology: "(Call sign) AFTER COMPLETING (low approach, option, or touch-and-go), EXECUTE LOCAL CLIMB-OUT."
NOTE: "LOCAL CLIMBOUT" or any radar vector and IFR altitude constitutes an abbreviated IFR clearance for locally assigned aircraft, and may be issued by tower or RAPCON in lieu of "CLEARED TO ALTUS AFB AIRPORT AS FILED." During IMC, execute published missed approach procedures unless directed otherwise by ATC.

4.7. Option Clearances. Aircraft "Cleared for the Option" are authorized to conduct a Low Approach, Touch and Go or Full Stop landing for all runways including the assault strip. Aircraft that desire a full-stop landing shall advise ATC to aid in sequencing other aircraft in the pattern.

4.8. Practice Approaches by Transient Aircraft. RAPCON in coordination with Tower shall approve/deny practice approaches for transient aircraft based on current traffic conditions and workload. Control tower shall issue either low approach or touch-and-go clearances for transient practice approaches. Transient aircraft desiring to terminate in a full stop landing must have a valid PPR number issued by AMOPS.

Chapter 5

EMERGENCY PROCEDURES

5.1. Operation of the Primary Crash Alarm System (PCAS) and Secondary Crash Net (SCN).

5.1.1. The PCAS is comprised of voice equipment designed to provide direct line communications from Altus Tower to selected locations on base. Tower will test the PCAS every day the Tower opens within 30 minutes of opening.

5.1.1.1. The PCAS is activated only by Altus Tower. Two-way communications are limited to the following agencies:

5.1.1.1.1. AMOPS.
NOTE: AMOPS relays PCAS information over the SCN.

5.1.1.1.2. Fire Department.

5.1.1.1.3. Medical Center. (Mon-Fri 0730-1630)

5.1.1.2. Altus Tower watch supervisor shall initiate activation of the PCAS when necessary for the following reasons (not all inclusive):

5.1.1.2.1. An aircraft emergency (in flight or ground) when declared by the pilot, an ATC facility, or the officials responsible for operation of aircraft (i.e., SOF).

5.1.1.2.2. Reports indicate that an aircraft has made a forced landing, is about to do so, or reports indicate a forced landing may be necessary.

5.1.1.2.3. Reports indicate the crew has abandoned the aircraft or is about to do so.

5.1.1.2.4. The need for ground rescue is likely.

5.1.1.2.5. Aircraft reporting an unsafe or uncertain landing gear position.

5.1.1.2.6. Hot brakes are declared or suspected.

5.1.1.2.7. Aircraft theft/hijack is suspected.

5.1.1.2.8. Aircraft mishap.

5.1.1.2.9. Aircraft bomb threat.

5.1.1.2.10. No Radio (NORDO) aircraft, if radio failure cannot be determined as the only problem.

5.1.1.2.11. Unauthorized civil aircraft landings.

5.1.1.3. Upon activation, parties on the PCAS shall pick up the receiver and wait for the message. When all parties are on the line, the following information shall be relayed:

5.1.1.3.1. Aircraft identification.

5.1.1.3.2. Type of aircraft.

5.1.1.3.3. Nature of emergency.

5.1.1.3.4. Pilot's intentions or specific instructions, and aircraft tail number, if known.

5.1.1.3.5. Number of personnel on board and location on the aircraft.

5.1.1.3.6. Fuel remaining on board.

5.1.1.3.7. ETA or last known position.

5.1.1.3.8. Wind information.

5.1.1.3.9. If hazardous material is involved, relay the net explosive weight (NEW), hazardous material on board (Department of Transportation (DOT) or Department of Defense (DoD) class/division) and if known the approximate firefighting time and withdrawal distance.

5.1.1.3.10. Anticipated landing runway.
NOTE: Information in 5.1.1.3.1-5.1.1.3.4 are the required minimums. Other information will be passed if available.

5.1.1.4. Agencies on the PCAS will develop a readily available checklist to record the above listed information during activation. Do not interrupt the initial report. When the message is completed, each station will be asked to verify receipt of the message with their initials. Once this is complete, Tower personnel will ask if there are any questions. Agencies will not secure their phone until told to do so by the control tower.

5.1.1.5. If the CP or AMOPS receives notification of an aircraft accident, emergency, bomb threat, or hijack by any means other than the PCAS, the information in paragraph 5.1.1.3 will immediately be relayed to the tower.

5.1.2. The SCN is comprised of voice equipment designed to transmit information critical to aircraft and airfield operations. These notices may be received from tower or from off-base personnel reporting an inbound emergency or aircraft crash. AMOPS is the primary activation authority for the SCN.

5.1.2.1. The SCN will be used to pass initial data concerning in-flight emergencies/aircraft

accidents; severe weather notification; initial exercise messages; updated information pertinent to an emergency/accident; coordinates of a crash site or major accident; coordinates for the entry control point; and emergency termination.
NOTE: AMOPS will test the SCN following the PCAS test. SCN back-up procedures/testing will be IAW Airfield Management Operating Instruction (AMOI) 13-204.

5.1.2.2. Upon receipt of an emergency/crash notice, (actual or exercise) AMOPS will activate the SCN. AMOPS will notify tower via ring line whenever the SCN has been activated that is not result of the PCAS activation. The type of emergency/exercise will be read verbatim, distinctly and chronologically. Personnel receiving information will listen and copy without interruption. Information will be repeated at the end of roll call, if requested.

5.1.2.3. Receive and transmit capability on the SCN is limited to those activities having responsibilities directly related to an aircraft crash or major accident. The following agencies have receive and transmit capability on the Altus SCN:
Civil Engineering Fire and Emergency Services
Fuels Management Medical Center
MOC Emergency Management
Wing Safety Command Post
Mission Support Group Law Enforcement Desk Weather

5.2. Emergency Response Procedures.

5.2.1. The emergency incident commander (IC) will be the senior fire officer on duty that day. The IC is responsible for the overall handling of the emergency to include safety, assignment of duties, and coordination with ATC. All procedures will be IAW DAFI 32-2001, *Fire and Emergency Services (F&ES) Program*, Altus AFB Installation Emergency Management Plan (IEMP) 10-2, and local supplements.

5.2.2. On/off-base crashes. The CP is the central communications agency for all crashes for which Altus AFB may have responsibility. Instructions to aircraft involved in the rescue will be passed to the Control Tower via landline from the CP.

5.2.3. The Control Tower will make every effort to pinpoint the crash scene using the crash grid map. Procedures shall include, but are not limited to:

5.2.3.1. Requesting range and bearing from a NAVAID (preferable Altus (LTS) TACAN), or a prominent landmark, from an aircraft at the scene (when available).

5.2.3.2. Requesting any airborne aircraft in contact with Control Tower or RAPCON to orbit the accident scene.

5.2.4. In the event Airfield Management is notified of a crash by means other than the primary crash circuit, they will:

5.2.4.1. Notify the Control Tower via telephone to activate the primary crash circuit.

5.2.4.2. Activate the secondary crash net.

5.2.5. Contractors working on the airfield must be notified of in-flight and ground emergencies, either by radio or by Airfield Management personnel. If the emergency is serious enough and affects the area where the contractors are working that area must be evacuated until the emergency is terminated.

5.2.6. AMOPS will physically respond to all IFE/GEs.

5.2.6.1. The SOF may waive the airfield check. This will be documented on the events log.

5.3. Emergency Locator Transmitter (ELT) Procedures.

5.3.1. Scheduled operational testing of personnel, emergency, or crash locator beacon is authorized and does not require response, if the following conditions are met:

5.3.1.1. The test is conducted within the first 5 minutes of the hour and is no longer than 3 audio sweeps.

5.3.2. CP is the designated response control coordinator for unscheduled personnel, emergency, or crash locator beacon signals. CP is the single base agency for ELT notification and information collection. ATC facilities will notify AMOPS and the ARTCC. AMOPS will notify the CP. The PCAS circuit will not be activated when these ELT beacon signals occur.

5.4. Cargo/External Stores Jettison Area Procedures. The designated cargo/external stores jettison area is located at LTS 220R/25 DME (Red River); east/west direction (recommend 273 degree heading); entry point LTS 216R/24 DME, exit point LTS 222R/27 DME; altitude at or below 5,000 feet.

5.4.1. RAPCON may vector aircraft to the jettison area. However, controllers shall not advise the pilot when to jettison stores.

5.4.2. Stores jettison should be made in VMC, if possible. In the event of an extreme emergency, a drop in IMC may be made if the VORTAC is operational or radar vectoring to the jettison area is provided. Sooner DZ will not be used for emergency jettison of non-airdrop rigged loads.

5.4.3. The aircraft commander will immediately report the inventory of stores jettisoned to their squadron operations section. Squadron operations will forward the inventory within 24 hours to 97 CES/CEIE (Environmental Element, Installation Management) for cleanup, if necessary, and to 97 AMW/JA for liability determination.

5.5. Fuel Dumping. The designated fuel dumping area for Altus AFB is located in an area bounded by a 23 NM arc and a 46 NM arc, from the LTS 250R clockwise to the 305R. Within

Altus ATC airspace, fuel dumping altitude will be coordinated with Altus ATC. Outside Altus ATC airspace, fuel dumping will be coordinated with the appropriate controlling agency; ie: Fort Worth Center while following the fuel dumping guidance found in JO 7110.65. A ground fuel dump area is located at the ends of runway 18R/36L on the east side. Aircraft will advise tower if this area is required. **NOTE:** C-17 aircraft will not dump fuel above FL 200 per the aircraft technical order. A lower altitude will be coordinated with Ft Worth ARTCC for C-17 fuel dumping operations.

5.6. Emergency Arresting/Barrier Gear Procedures. Altus AFB does not have arresting barriers.

5.7. Abandonment of Aircraft. The designated aircraft abandonment area is located at LTS 220R/25 DME (Red River); east/west direction (recommend 273 degree heading). In the event of an aircraft abandonment, RAPCON will determine the last known location of the aircraft IAW Altus AFB Operations Plan 506-98, *Search and Rescue Plan*.

5.8. Hot Brake Area and Procedures.

5.8.1. The designated hot brake areas are taxiways D, E, F, G, K, or L.

5.8.2. Aircraft will hold their position on the taxiway and await fire department response. The pilot will inform ground control immediately if aircrew will egress the aircraft so alternate taxi routes can be implemented. The aircraft will be moved by taxiing or towing only after the on-scene fire department official has given the authority to do so.

5.9. Hung Ordnance Procedures. All aircraft landing with hung ordnance will be taxied from the runway to the alternate Hot Cargo Area and into position facing north. When parking Alternate Hot Cargo Area is not feasible, the aircraft will be parked on taxiway K-1, D, or ground operations area, facing north. If the aircraft is parked in the ground operations area, operations to 176/356 will be suspended. Aircraft will remain parked, facing north, until the systems are cleared and pinned by maintenance, armament, or aircrew personnel.

5.10. Wind Limitations/Evacuation of Airfield Operations Flight (AOF) Facilities.

5.10.1. Tower. Tower cab will be evacuated when wind gusts or sustained winds reach 70 knots. In the event of fire/ bomb threat or emergency situations other than tornado, tower personnel will evacuate to Building 530, RAPCON. If RAPCON is also relocated, proceed to the 97 OSS Command Section. Control of aircraft shall be transferred to either RAPCON or Fort Worth ARTCC. When directed, AMOPS personnel will issue a NOTAM closing the airfield. If airfield lights need to be turned on/off or intensity settings adjusted after tower evacuation, AMOPS shall notify airfield lighting personnel.

5.10.2. RAPCON. When required to evacuate the RAPCON, aircraft control shall be transferred to Fort Worth ARTCC IAW the Fort Worth ARTCC and Altus AFB RAPCON LOA.

5.10.3. AMOPS. When required to evacuate, AMOPS will be relocated to the 97 OSS RAPCON facility.

5.11. Hijack Prevention and Response Procedures. Will be IAW FAAO 7610.4 and Altus AFB Operations Plan 502, *Anti-Hijacking Plan and Prevention of Unauthorized Aircraft Movement.*

5.12. Alternate Facility Procedures.

5.12.1. In the event that the tower evacuates and 97 AMW assets are still airborne, the watch supervisor/senior controller (WS/SC) will coordinate with the SOF to determine a need to continue ATC operations to recover airborne aircraft.

5.12.2. Tower and RAPCON do not have alternate facilities.

5.12.3. The PCAS is unavailable, the senior controller (SC) shall notify AMOPS via phone line or ramp net for all emergency situations. **Note:** AMOPS will pass all emergency information via the SCN.

5.12.4. ATIS is unavailable in the emergency ATC facility. A fixed message will be broadcasted when the tower evacuates the primary tower. Therefore, tower will issue all pertinent weather and airfield information to all aircraft.

5.12.5. NAVAID monitoring capability is unavailable.

5.12.6. During operations at the emergency ATC facility, the following restrictions shall apply:

5.12.6.1. Aircraft operations will be restricted to runway 18R/36L only.

5.12.6.2. Aircraft will be restricted to one full-stop landing.

5.12.6.2.1. Tower will coordinate with RAPCON with a landing assured for each arrival prior to RAPCON inbounding the next aircraft to ensure full runway separation exists.

5.12.6.3. Runway 18R/36L crossings are limited/restricted to aircraft taxiing to park, emergency response vehicles and aircraft tows at taxiways Echo and Kilo only.

5.12.7. Airfield lighting panel is unavailable. If ATC determines a need in airfield lighting change, coordination will be made via ramp net or relayed through AMOPS for airfield lighting personnel to control the lights.

Chapter 6

AIRFIELD VEHICLE/PEDESTRIAN OPERATIONS

6.1. Responsibilities. A detailed outline of Altus AFB airfield driving responsibilities and requirements can be found in DAFI 13-213, *Airfield Driving*, and the local supplement. Only mission essential government vehicles and other approved vehicles displaying the appropriate flight line pass are permitted in the CMA as defined in paragraph 1.5. Two-way radio communications must be established with Altus Tower prior to entering the CMA. In the event the tower is not opened, contact AMOPS at 481-6200 or CP at 481-6313 for CMA access. All airfield maintenance activities must be coordinated with AMOPS prior to starting.

6.1.1. Unit Commanders will ensure training is conducted, a program manager is selected, and limit airfield driving authorization to only those personnel requiring airfield driving to accomplish their duties.

6.2. Airfield Driving Requirements. Airfield Driving requirements are outlined in DAFI 13-213 and the local supplement.

6.3. Agencies Authorized Privately Owned Vehicle Passes. Will be IAW DAFI 13-213 and the local supplement.

6.4. Airfield Driving Violations and Penalties. Airfield driving violations and penalties are outlined in DAFI 13-213 and the local supplement.

6.5. Vehicle Traffic Procedures. Will be IAW DAFI 13-213 and the local supplement.

6.6. Vehicular Call Signs. Table 6.6. identifies approved callsigns. Additional callsigns may be assigned with approval of AMOPS. AMOPS will inform Tower of callsigns being used on the airfield by personnel not listed in Table 6.6.

Table 6.6. Vehicle Call Signs.

CALL SIGN	IN USE BY	CALL SIGN	IN USE BY
Warrior 1	97 AMW/CC	POSSE 1	OSS/CC
Warrior 2	97 AMW/CV	POSSE 2	OSS/DO
Warrior 3	97 OG/CC	OPS 1	AOF/CC/DO/SO
Warrior 4	97 MSG/CC	Airfield 1	AFM
Maintenance 1	97 MXG/CL	Airfield 2	DAFM
Maintenance 2	97 MXG/DD	Airfield 3	AMOPS
Warrior 7	97 OG/CD1	Airfield 4	AMOPS (as needed)
Warrior 11	97 OG/CD2	Transient 1	Transient Alert 1
Warrior 18	Supervisor of Flying	Transient 2	Transient Alert 2
Safety 1	97 AMW/SE	Sweeper 1	Airfield Sweeper
USDA 1	USDA BASH Team	RAWS 1-5	97 OSS/OSAM
Airfield Lighting	Airfield Lighting	Snowman	97 OSS/DO
Hammer 1	MXS/Director	Snow 1	Snow Removal Supervisor

Hammer 2	MXS/ Deputy Director	Snow 2-9	Snow Equipment
Quality	Quality Assurance	Power-Pro 1	Power Production 1
Talon 1	AMXS/Director	Power-Pro 2	Power Production 2
Talon 2	AMXS/Deputy	Power-Pro 2	Power Production 2
AGE 1-10	AGE Flight Chief/Sup/Drvrs	CE 1-20	97 CE/Grounds
Mustang 1-7	KC46 Flight Chief/Sup/Drvrs	Tanker 1-10	KC135 Flight Chief/Sup/Drvr
		Falcon 1-6	C17 Flight Chief/Sup/Drvrs

6.7. Procedures for Gaining Access to the CMA. All vehicles and personnel must establish two-way communications with the control tower and obtain tower's approval prior to entering the CMA. In the event the tower is not opened, contact AMOPS at 481-6200 or CP at 481-6313 for CMA access. In the event of radio failure, personnel will follow the instructions in paragraph 1.5.3. Detailed guidance for operations in the CMA can be found in DAFI 13-213 and the local supplement.

6.8. Emergency Vehicle Operations. Will be IAW DAFI 13-213 and the local supplement.

6.9. Airfield Construction/Work Crew/ Maintenance Restrictions. Will be IAW DAFI 13- and the local supplement.

Chapter 7

FLIGHT PLANNING PROCEDURES

7.1. Flight Plan (FP) Filing Requirements: All aircraft departing Altus AFB must have a valid FP on file prior to departure.

7.1.1. Aircrews shall use DD Form 1801, *DoD International Flight Plan,* or other authorized forms according to AFMAN 11-202V3, *Flight Operations*.

7.1.1.1. In accordance with General Planning, Electronic Filing (e.g. ForeFlight, AISR, etc.) is an acceptable method to file flight plans per Service Directives and, once printed, will suffice for the DD Form 1801, FAA Form 7233-1, *Flight Plan*, and FAA Form 7233-4, *Pre-Flight Pilot Checklist*.

7.1.2. Flight plans can be hand carried, faxed (DSN FAX 866-5049, commercial FAX 580-481- 5049), emailed (97oss.osaa.fp@us.af.mil) or sent to AMOPS via Mattermost.

7.1.3. Electronic Flight Plans (e-FP) filed via ForeFlight must be received by AMOPS over the FAA Aeronautical Information System Replacement (AISR) and emailed to the 97 OSS/OSAA Flight Plans org box.

7.1.3.1. The Airfield Manager may approve the use of other e-FP applications/sites should others provide comparable and consistent results.

7.2. Flying Squadrons Flight Planning Procedures:

7.2.1. Ensure a flight plan is on file with AMOPS prior to departure. The Pilot in Command should ensure that an aircrew member contacts AMOPS prior to departing to the aircraft to confirm receipt and answer any questions. Failure to confirm FP receipt may result in delays.

7.2.1.1. Prior to taxiing, ATC will confirm aircraft have a flight plan on file with AMOPS. ATC will not authorize aircraft movement until the status of the FP, e-FP, or stereo is determined. **NOTE**: Aircraft are not allowed to operate (taxi, takeoff or land) when the airfield is closed.

7.2.2. File domestic DD Form 1801 flight plans at least 1 hour prior to ETD. International flight plans will be filed at least 2 hours prior to ETD. **NOTE**: Estimated time of departure (ETD) and estimated time of arrival (ETA) must be within the airfield operating hours as published in the IFR Supplement and/or NOTAMS.

7.2.2.1. If filing via ForeFlight, AMOPS should receive an e-FP at least 1 hour prior to the proposed departure time and it must be received prior to engine start. The e-FP will be e-mailed to 97 OSS/OSAA Flight Plans org box (97oss.osaa.fp@us.af.mil) through ForeFlight.

7.2.3. File FPs listed in the Canned/Stereo Flight Plan excel sheet on DD Form 1801 with the route title listed in the route of flight section. Each flying squadron is responsible for maintaining the currency of Canned/Stereo Flight Plans and provide to AMOPS to ensure correct FP filing with the FAA system.

7.2.4. Maintain crew orders, weight and balance, and passenger manifest, as applicable, for all flights IAW appropriate Air Force RDS.

7.3. AMOPS Flight Plan Processing Procedures:

7.3.1. Accept FAX or electronic delivery of a FP when AM can determine the FP was authorized.

7.3.3.1. When AMOPS receives an e-FP from ForeFlight, once printed, the e-FP will constitute the "original flight plan". AMOPS will process this original e-FP following established procedures to notify tower, send departure message(s), implement flight following, etc. AMOPS will print the e-FP and file in the same manner as an original DD Form 1801 FP.

7.3.2. FPs will be reviewed for accuracy and completeness and submitted to the appropriate ARTCC via AISR IAW General Planning, FLIP Area Planning 1/B, AFMAN 11-213, *Military Flight Data Telecommunications System,* and this instruction.

7.3.3. Use Canned Stereo Flight Plan excel sheet provided by each squadron to file canned/stereo route flight plans at the request of the pilot in command.

7.3.4. Monitor all proposed arrival times for inbound and local area flights and initiate overdue aircraft actions IAW AFI 13-202, *Overdue Aircraft*, when necessary.

7.3.5. Maintain a flight planning room IAW AFMAN 13-204v2 for transient aircrews and local aircrews when squadron facilities are not available.

7.3.6. Maintain original, hand delivered, e-FP, or emailed flight plans IAW AF RDS, Table 13- 07, Rule 3.00.

7.4. Flight Plan Change Procedures.

7.4.1. FPs can be amended by any means (e.g. radio, telephone, fax, email, etc.), provided a FP is on file at AMOPS. Transient, stopover, and or divert aircraft can either re-file or request amendment to an existing FP provided an originally filed FP is able to be verified by AMOPS.

7.4.1.1. AMOPS cannot amend FPs within 30 minutes of ETD or change/amend activated FPs. Airborne aircraft can contact servicing flight service stations to request changes to activated flight plans.

7.4.2. FPs for aircraft flying in the local area will be closed when the aircraft lands and returns

to parking unless the pilot advises ground control to keep the flight plan open.

7.4.2.1. If aircraft flying in the local area return early due to maintenance, etc., and the flight plan is closed, it cannot be reactivated. If further flight operations are required, use the procedures listed paragraph 7.2. to file, change, or amend an original FP on file with AMOPS.

7.4.3. Aircrews should expect a 20-30 minute delay after revising flight plans before a revised clearance is issued, unless remaining in Altus airspace for the entire flight.

Chapter 8

MISCELLANEOUS PROCEDURES

8.1. Airfield Operations Board (AOB).

8.1.1. General Information. The AOB is a forum to discuss and resolve issues such as airspace, ATC procedures, RAWS, airfield construction and lighting, hazardous air traffic reports, airfield environment, Air Force Inspection System (AFIS) observations, and other issues pertinent to the local flying environment. This board is vital in sustaining flying operations at Altus AFB and is held IAW AFMAN 13-204v1.

8.1.2. Procedures. The AOB will convene at least once every quarter and will be chaired by the AMW/CV or designated representative, IAW AFMAN 13-204v1. The following personnel (or designated representative) are identified as mandatory members:

97 AMW/CV (Chairperson)
97 OG/CC
97 MSG/CD
97 TRS/DO
54 ARS/DO
56 ARS/DO
58 AS/DO
97 OSS/CC
97 CS/CC
97 CES/CC
97 SFS/CC
97 AMW/SEF
97 OSS/OSW
97 OSS/OSA
97 OSS/OSAM
97 OSS/OSAA
97 OSS/DOA
97 OSS/OSAT
97 OSS/OSAR
97 OSS/OSAP
97 OSS/OSAG
97 OSS/OSAV
97 OG/OGV

8.1.2.1. The 97 OSS/OSA records and publishes board minutes.

8.1.2.2. The following agenda items must be reviewed annually:

8.1.2.2.1. Aircraft Parking Plan (1st Quarter)

8.1.2.2.2. Status of the Annual Airfield Waiver Review (2nd Quarter)

8.1.2.2.3. Air Installation Compatible Use Zone (3rd Quarter).

8.1.2.2.4. Local Operating Procedure (LOP) Status (4th Quarter).

8.1.2.2.5. AFIS Self-Assessment Communicators (SAC). Report the results of new AF or MAJCOM SAC checklists, including SACs carried over from the previous year, at the first AOB following the release of the SAC checklist.

8.2. Notice to Airmen (NOTAM) Procedures.

8.2.1. Altus Tower is designated the NAVAID status and NOTAM monitoring facility for Altus AFB. Tower will track and report NAVAID status IAW RAWS Generator MOU.

8.2.2. During airfield operating hours, AMOPS is designated the NOTAM submitting facility for Altus AFB. AMOPS will:

8.2.2.1. Process local NOTAMs and flight safety NOTAMs on RAWS outages, airfield hazards (runway closure, threshold displacement, airfield lighting, etc.), etc., and returns to normal service IAW AFI 11-208, *Department of Defense Notice to Airmen System*.

8.2.2.2. Provide all flight safety and local NOTAMs when requested by transient aircrew.

8.2.2.3. Verify with tower current flight safety and local NOTAMs before each airfield opening.

8.2.2.4. Notify tower and RAPCON of flight safety or local NOTAM initiation or cancellation.

8.3. Flight Information Publication (FLIP) Accounts and Procedures for Requesting Changes.

8.3.1. AMOPS will maintain a FLIP account with the National Geospatial Intelligence Agency (NGA) for transient aircraft support. The NCOIC, AMOPS or designated representative will manage the FLIP account (change annual requirements, one-time orders, etc.) directly with NGA through the NGA website, to include FLIP requirements for over-water navigation kits.

8.3.2. All procedural and non-procedural FLIP changes will be reviewed, coordinated and submitted by the Airfield Management representative or TERPS specialist.

8.3.3. Local flying units will maintain individual unit FLIP accounts with NGA. Manage FLIP accounts (change annual requirements, one-time orders, etc.) directly with NGA through the NGA website.

8.4. Prior Permission Required (PPR) Procedures. A valid PPR is required for all transient aircraft desiring to terminate in a full stop landing at Altus. All requests for PPR must be coordinated with AMOPS a minimum of 48 hours in advance.
NOTE: RAPCON serves as the approval/disapproval authority for transient aircraft requesting practice approaches.

8.5. Medical Airlift Aircraft Notification and Response Procedures. AMOPS will coordinate medical airlift aircraft arrivals and departures at Altus AFB, when requested by the MEDEVAC aircraft commander. RAPCON will notify AMOPS when the aircraft is 15 flying miles from landing and will pass the pilot's intentions. AMOPS will forward all necessary information to appropriate agencies.

8.6. Unscheduled/Unauthorized Aircraft Arrivals. For unscheduled aircraft arrivals during airfield operating hours, paragraph 8.4 applies. For unauthorized aircraft arrivals (which include any aircraft arrival during those times when the airfield is closed), the response shall be in accordance with Altus AFB Operations Plan 31-101, *Integrated Defense Plan,* Appendix 2. When notified of an unscheduled arrival, CP will notify 97 SFS Base Defense Operations Center (BDOC), MOC, and the Airfield Operations Flight Commander.

8.7. Local Aircraft Priorities. ATC services are provided on a first-come, first served basis as circumstances permit, with the exception of the operational priorities listed in FAA JO 7110.65, *Air Traffic Control*. 97 AMW aircraft shall have priority over non-base assigned aircraft. Local aircraft priorities are listed below in the following order:

8.7.1. Aircraft requiring special handling (Emergency Aircraft, distinguished visitors [DVs] etc.)

8.7.2. 97 AMW tactical formation arrivals and departures.

8.7.3. 97 AMW refueling departures with a 14-minute departure window.

8.7.4. Other mission departures approaching late times (14 minutes after scheduled departure time).
NOTE: Does not include taxi-back operations.

8.7.5. Arrivals.

8.7.6. Departures.

8.7.7. Practice Approaches.

8.8. Distinguished Visitor Aircraft Notification Procedures. AMOPS serves as the focal point for DV notification. DV notifications are secondary to ATC services IAW AFMAN 13-204v2. RAPCON will notify AMOPS when an aircraft is 20 flying miles from Altus AFB, and Tower will provide landing roll notification to AMOPS. AMOPS is responsible for notifying all appropriate agencies as information is provided to them from RAPCON and Tower.

8.9. Unscheduled Aircraft Arrivals. When notified of an unscheduled arrival, CP will notify MOC and AOF/CC.

8.10. Dangerous/Hazardous Cargo and Arm/De-Arm Area. The primary hazardous cargo area is Spot 97 (Alert Area), and the alternate location is at the end of Taxiway N. Routine use of Altus AFB by explosives- loaded aircraft carrying DoD Class/Division 1.1 or 1.2 munitions and/or DOT Class A/B poisons is discouraged. Altus AFB can support mission essential movements of munitions or hazardous cargo bound for Altus AFB, or in-flight emergencies when required. The Net Explosive Weights (NEWs) for Primary and Alternate Hot Cargo Pad (HCPs) are provided in Table A2.4.

8.10.1. If the pilot of an explosives-loaded aircraft or a hazardous cargo aircraft declares an in- flight emergency and requires landing at Altus AFB, the following actions shall be accomplished:

8.10.1.1. Altus Tower shall relay all information received from the pilot or RAPCON over the PCAS as indicated in paragraph 5.1.1.3.

8.10.1.2. Upon landing, aircraft will be escorted to the hazardous cargo area and marshaled into position.

8.10.1.3. For aircraft carrying dangerous materials other than DoD 1.1/1.2 class explosives or DOT Class A/B poisons, the wing explosives safety manager will coordinate with AMOPS, MOC and the CP for specific guidance as to quantity/distance requirements if special handling is needed.

8.10.1.4. If CP receives notification (by means other than the SCN) of an in-flight emergency involving an explosives-loaded aircraft or a cargo aircraft with hazardous cargo aboard, they shall relay all information to tower. Tower will then activate the PCAS.

8.10.2. The northeast end of taxiway N has been designated as the primary arm/de-arm area. Aircraft will be parked with armament pointed to the north (approximately 350 degrees).Taxiways D and K 1 are secondary locations for arm/de-arm area. Additionally, F-16 aircraft that operated an Emergency Power Unit or have a suspected hydrazine leak will be parked at the end of taxiway N.

8.11. Wear of Hats. Wear of hats on the flight line is prohibited. This includes parking ramps, aprons, taxiways, and runways. Hats will be secured in a pocket or held to prevent FOD. **EXCEPTION:** Headgear is permitted as required for aircraft maintenance, handling, or security IAW DAFI 21-101, *Aircraft and Equipment Maintenance Management*, and DAFMAN 91-203, *Air Force Occupational Safety, Fire, and Health Standards*; or, in performance of other official functions.

8.12. Lost Communications Instructions.

8.12.1. In daytime VMC conditions, aircraft should overfly runway 18R/36L at 3,400 feet MSL, slightly offset to the west and rock the wings. The aircraft should enter the VFR pattern on the downwind leg at 3,400 feet MSL and monitor the tower for light gun signals. If no light signals are observed, repeat procedure until light signals can be observed.

8.12.2. In nighttime VMC conditions, aircraft should overfly runway 18R/36L at 3,400 feet slightly offset to the west and flash landing lights. The aircraft should enter the VFR pattern on the downwind leg at 3,400 feet and monitor tower for light gun signals. If no light signals are observed, repeat procedure until light signals can be observed.

8.12.3. In IMC conditions, aircraft will follow the procedures in the *DOD Flight Information Handbook*, Section A, *Emergency Procedures* and Federal Aviation Regulation (FAR) Part 91.

8.13. Reporting of Hazards to Air Navigation. Aircrews will report hazards to air navigation to the Altus Airspace Manager (97 OSS/DOA).

8.13.1. Examples of potential hazards include, but are not limited to, UAS, possible bird attractants, uncharted towers (obstructions) or airports along military training routes and the local flying area, obstructions within the terminal area, or any other potential flight safety hazard.

8.13.2. When a potential hazard is identified, the aircraft commander will provide the Altus Airspace Manager the following information no later than the next duty day after the flight (e-mail is the preferred method of notification):

8.13.2.1. Towers or other obstructions:

8.13.2.1.1. Explanation of obstruction (single or multiple towers, oil derrick, etc.).

8.13.2.1.2. Location of obstruction (name of low-level route or other flight path).

8.13.2.1.3. Height of obstruction.

8.13.2.1.4. Longitude and latitude coordinates.

8.13.2.2. Airports or other conflicts:

8.13.2.2.1. Brief description of conflict (airport traffic, VFR practice area, bird attractants, etc.).

8.13.2.2.2. Radial/DME fix.

8.13.2.2.3. Longitude and latitude coordinates.

8.13.2.2.4. Name of ATC Facility, if applicable.

8.14. Opposite Direction Traffic.

8.14.1. Opposite Direction VFR Cutoff Points.

8.14.1.1. Opposite direction IFR/VFR arrival vs. VFR arrivals/low approaches, etc. Operations shall be conducted to ensure the preceding IFR/VFR arriving aircraft has landed prior to the succeeding VFR aircraft turning base or reaching 10 NM final.

8.14.1.2. Opposite direction IFR/VFR departure vs. VFR arrivals/low approaches, etc. Operations shall be conducted to ensure the IFR/VFR departing aircraft is airborne and is clear of the succeeding VFR aircraft's final approach course prior to the succeeding VFR aircraft turning base, or prior to the aircraft reaching 10 NM final.

8.14.2. Opposite Direction IFR Cutoff Points.

8.14.2.1. Arrival vs. Arrival. Operations shall be conducted to ensure the preceding IFR arriving aircraft has landed before the succeeding IFR aircraft reaches a point 10 NM on final to the opposite runway.

8.14.2.2. Arrival vs. Departure, Low Approach, etc. Operations shall be conducted to ensure an IFR departing/low approach aircraft is established on a course diverging by at least 45 degrees from the reciprocal of the final approach course before an IFR arriving aircraft reaches 10 NM final.

8.14.3. Control tower and RAPCON shall follow the coordination procedures in the Control Tower/RAPCON Operations Letter.

8.15. Flight Line Smoking Policy. Flight line smoking policy will be IAW DAFMAN 91- 203, and local guidelines.

8.15.1. Smoking is authorized in designated smoking areas and within 50 feet of the centerline of the taxilanes west of taxiway C.

8.16. Civil Aircraft Operations. The Airfield Manager and/or Deputy Airfield Manager (DAFM) are the designated representatives to process and approve Civil Aircraft Landing Permits IAW AFI 10-1001, *Civil Aircraft Landing Permits.* Civil aircraft desiring to operate at Altus AFB must comply with procedures in AFI 10-1001, and AFI 10-1002, *Joint Use Agreements for Military and Civilian Flying Facilities,* as applicable.

8.17. Civil Use of Military NAVAIDs. The Altus AFB Digital Airport Surveillance Radar (DASR) and approach control VHF frequency (125.1MHz) are considered part of the National Airspace System (NAS).

8.18. Aero Club Operations. Altus AFB currently has no aero club. Transient aero club members will comply with DAFMAN 34-152, *Air Force Aero Club Operations* and local base requirements, to include obtaining PPR prior to arrival.

8.19. Hazardous/ Severe Weather Dissemination and Coordination Procedures. The primary method for disseminating weather information to aircraft command and control agencies and ground operation centers is via the new tactical forecast system (NTFS) through the CP emergency notification system. The primary back-up for NTFS outages will be via telephone calls from the base weather shop to all units identified on the CP checklist. During flight operations, aircrew will utilize Pilot-to-Metro Service (PMSV) or local ATC facilities to disseminate/obtain weather information.

8.19.1. Each agency with NTFS capability is responsible for ensuring personnel are trained to operate, interpret and monitor products received. The Combat Weather Team will provide training and technical assistance.

8.19.2. Priority of calls during NTFS outages will be: tower, RAPCON, CP and MOC.

8.19.3. Lightning response procedures will be IAW AAFBI 15-101, *Weather Support*.

8.19.4. AMOPS will activate the SCN for Tornado Watches, Tornado Warnings and Severe Thunderstorm Warnings.

8.20. Airfield Snow Removal Operations. Will be IAW Altus AFB Operations Plan 414-03, *Snow Removal and Ice Control*.

8.21. Bird/Aircraft Strike Hazard (BASH) Program Guidelines. Will be IAW 97 AMW BASH Plan.

8.22. Bird Watch Conditions. Will be IAW 97 AMW BASH Plan.

8.23. Supervisor of Flying (SOF). Operations will be conducted IAW AFI 11-418, *Operations Supervision*. The primary SOF duty location will be the control tower. Alternate duty locations will be IAW AFI 11-418 and the 97 OG Supplement 1 to the AETC 11-418 Supplement.

8.23.1. The SOF will:

8.23.1.1. Coordinate all issues through the tower watch supervisor when operating from the control tower.

8.23.1.2. Not perform ATC functions nor issue ATC instructions to aircraft.

8.23.1.3. Brief special operations that may affect the flying mission to the tower watch supervisor on duty.

8.23.1.4. Normally relay advice and instructions to an emergency aircraft utilizing CP frequency. When the advice is extremely technical, or when SOF feels an unacceptable delay will incur, the SOF coordinates through ATC to directly transmit to the aircraft.

NOTE: Anyone who commandeers an ATC frequency assumes responsibility for

separation of aircraft.

8.23.1.5. Receive an airfield status briefing from AMOPS, to include construction activities, runway/taxiway closures, current RSC/RCR, current BWC, current airfield restrictions (i.e. quiet hours) prior to reporting to the control tower.

8.23.1.6. Review published NOTAMs as appropriate.

8.23.2. The tower watch supervisor will:

8.23.2.1. Inform SOF of airfield/facility outages, equipment problems, and restrictions that could adversely affect the safe conduct of flying operations.

8.23.2.2. Relay information regarding emergency aircraft to the SOF in a timely manner.

8.24. Airfield Photography. All military, civilian and contract personnel required by their position to take photographs on or near the airfield for official use must make the following notifications:

8.24.1. Coordinate the location and purpose of photographs with AMOPS and security forces desk.

8.24.2. Personnel must possess a valid line badge or have an escort with a valid line badge if on the flight line.

8.24.3. Individuals requesting to take other than official photographs will be referred to Public Affairs.

8.24.4. Photography is permitted from outside the restricted area and CMAs without prior coordination/approval.

8.25. Weekend Operations: Weekend operations will be scheduled and approved IAW paragraph 1.10 of this instruction. During approved weekend operations (arrivals/departures), the LTS RAPCON will be staffed in the event of a significant Air Traffic Control and Landing Systems (ATCALS) outage or if the current/forecasted weather is below 5 SM visibility and/or a 5000 foot ceiling. Additionally, the tower will be staffed with a 7-level controller for arrival/departure. Unless specifically coordinated/approved, arriving aircraft will conduct full stop landings only (no transitions).

8.26. Flight Check Operations: When flight check operations are occurring, 97 AMW aircraft will conduct off station training to accommodate priority handling of flight check aircraft IAW FAA Orders. **Note:** AMOPS will issue a NOTAM detailing flight check operations.

JEFFREY M. MARSHALL, Colonel, USAF
Commander, 97th Air Mobility Wing

Attachment 1

GLOSSARY OF REFERENCES AND SUPPORTING INFORMATION

References
AFI 11-418, *Operations Supervision,* 22 December 2021
AFMAN 13-204v1, *Management of Airfield Operations,* 22 July 2020
DAFMAN 13-204v2, *Airfield Management,* 20 September 2024
AFMAN 13-204v3, *Air Traffic Control,* 26 April 2024
AFI 13-213_ALTUSAFBSUP, *Airfield Driving,* 13 April 2021
ALTUSAFBI 32-2001, *Fire Protection and Prevention Program,* 5 November 2021
AFMAN 24-604, *Preparing Hazardous Materials for Military Air Shipments,* 9 October 2020
DAFI 31-101, *Base Defense Operations (CUI)*
DAFI 91-207, *The Traffic Safety Program,* 9 January 2024
ALTUSAFBI 15-101, *Weather Support,* 15 June 2021
AAFB PLAN 10-2, *Installation Emergency Management Plan (IEMP),* 1 August 2024
AAFB PLAN 31-101, *Integrated Defense Plan,* 1 July 2023
AAFB BASH Plan, 1 October 2024
AAFB PLAN 414-03, *Snow Removal and Ice Control Plan*
AAFB PLAN 502, *Anti-Hijacking Plan and Prevention of Unauthorized Aircraft Movement,* 1 December 2024
AAFB PLAN 506, *Search and Rescue Plan,* 1 January 2024

Prescribed Forms
None

Adopted Forms

AF Form 847, *Recommendation for Change of Publication*

Abbreviations and Acronyms

AFM – Airfield Manager
ALSF-1 – Approach Lighting System with Sequenced Flashing Lights
AMP-1 – Airfield Marking Pattern 1
AFIS – Air Force Inspection System
AGE – Aerospace Ground Equipment
AGL – Above Ground Level
AIRMET – Airmen's Meteorological Information
AMOPS – Airfield Management Operations
ALZ – Assault Landing Zone
AOB – Airfield Operations Board
AOF – Airfield Operations Flight
ARTCC – Air Route Traffic Control Center
ATC – Air Traffic Control
ATCALS – Air Traffic Control and Landing Systems

ATIS – Automatic Terminal Information Service
BASH – Bird Wildlife Aircraft Strike Hazard
CMA – Controlled Movement Area
C2IMERA– Command and Control Incident Management and Emergency Response Application
CP – Command Post
DAFM – Deputy Airfield Manager
DASR – Digital Airport Surveillance Radar
DME – Distance Measuring Equipment
DoD – Department of Defense
DOT – Department of Transportation
DV – Distinguish Visitor
DZ – Drop Zone
ESFA – Emergency Single Freq Approach
ELT – Emergency Locator Transmitter
ETA – Estimated Time of Arrival
ETD – Estimated Time of Departure
ERCC – Engine Running Crew Change
FAA – Federal Aviation Administration
FAF – Final Approach Fix
FD – Fire Department
FLIP – Flight Information Publication
FM – Frequency modulation
FOD – Foreign Object Debris
GE – Ground Emergency
HCP – Hot Cargo Pad
HIRL – High Intensity Runway Lights
IAW – In Accordance With
IC – Incident Commander
IFE – Inflight Emergency
IFR – Instrument Flight Rules
ILS – Instrument Landing System
LATN – Low Altitude Tactical Navigation
LOP – Local Operating Procedure
MARSA – Military Authority Assumes Responsibility for Separation of Aircraft
MEDEVAC – Medical Evacuation
MOC – Maintenance Operations Center
MOU – Memorandum of Understanding
MSL – Mean Sea Level
NAVAID – Navigational Aid
NEW – Net Explosive Weight
NGA – National Geospatial Intelligence Agency
NLT – No Later Than
NM – Nautical Mile
NOTAM – Notice to Airmen
NTFS – New Tactical Forecast System

NVG – Night Vision Goggles
NORDO – No Radio
OCS – Obstacle Clearance Surface
PNH - Panhandle
PCAS – Primary Crash Alarm System
PCC – Portland Cement Concrete
PMSV – Pilot-to-Metro Service
POFZ – Precision Obstacle Free Zone
PPR – Prior Permission Required
PTD – Pilot to Dispatch
RAPCON – Radar Approach Control
RAWS – Radar, Airfield and Weather Systems
RCR – Runway Condition Reading
RNAV – Area Navigation
RSC – Runway Surface Condition
RVR – Runway Visual Range
SCN – Secondary Crash Phone
SFO – Senior Fire Officer
SALSF – Short Approach Lighting System with Sequenced Flashing Lights
SKE – Station Keeping Equipment
SOF – Supervisor of Flying
SM – Statue Mile
STARS – Standard Terminal Automation Replacement System
TA – Transient Alert
UAS – Unmanned Aircraft System
USDA – United States Department of Agriculture
VFR – Visual Flight Rules
VLZMP – Visual Landing Zone Marker Panels
VMC – Visual Meteorological Conditions
VOR – Very High Frequency Omni-Directional Range
VORTAC – Very High Frequency Omni-Directional Radio-range Tactical Air Navigation
WX – Weather

Attachment 2

AIRFIELD DIAGRAM


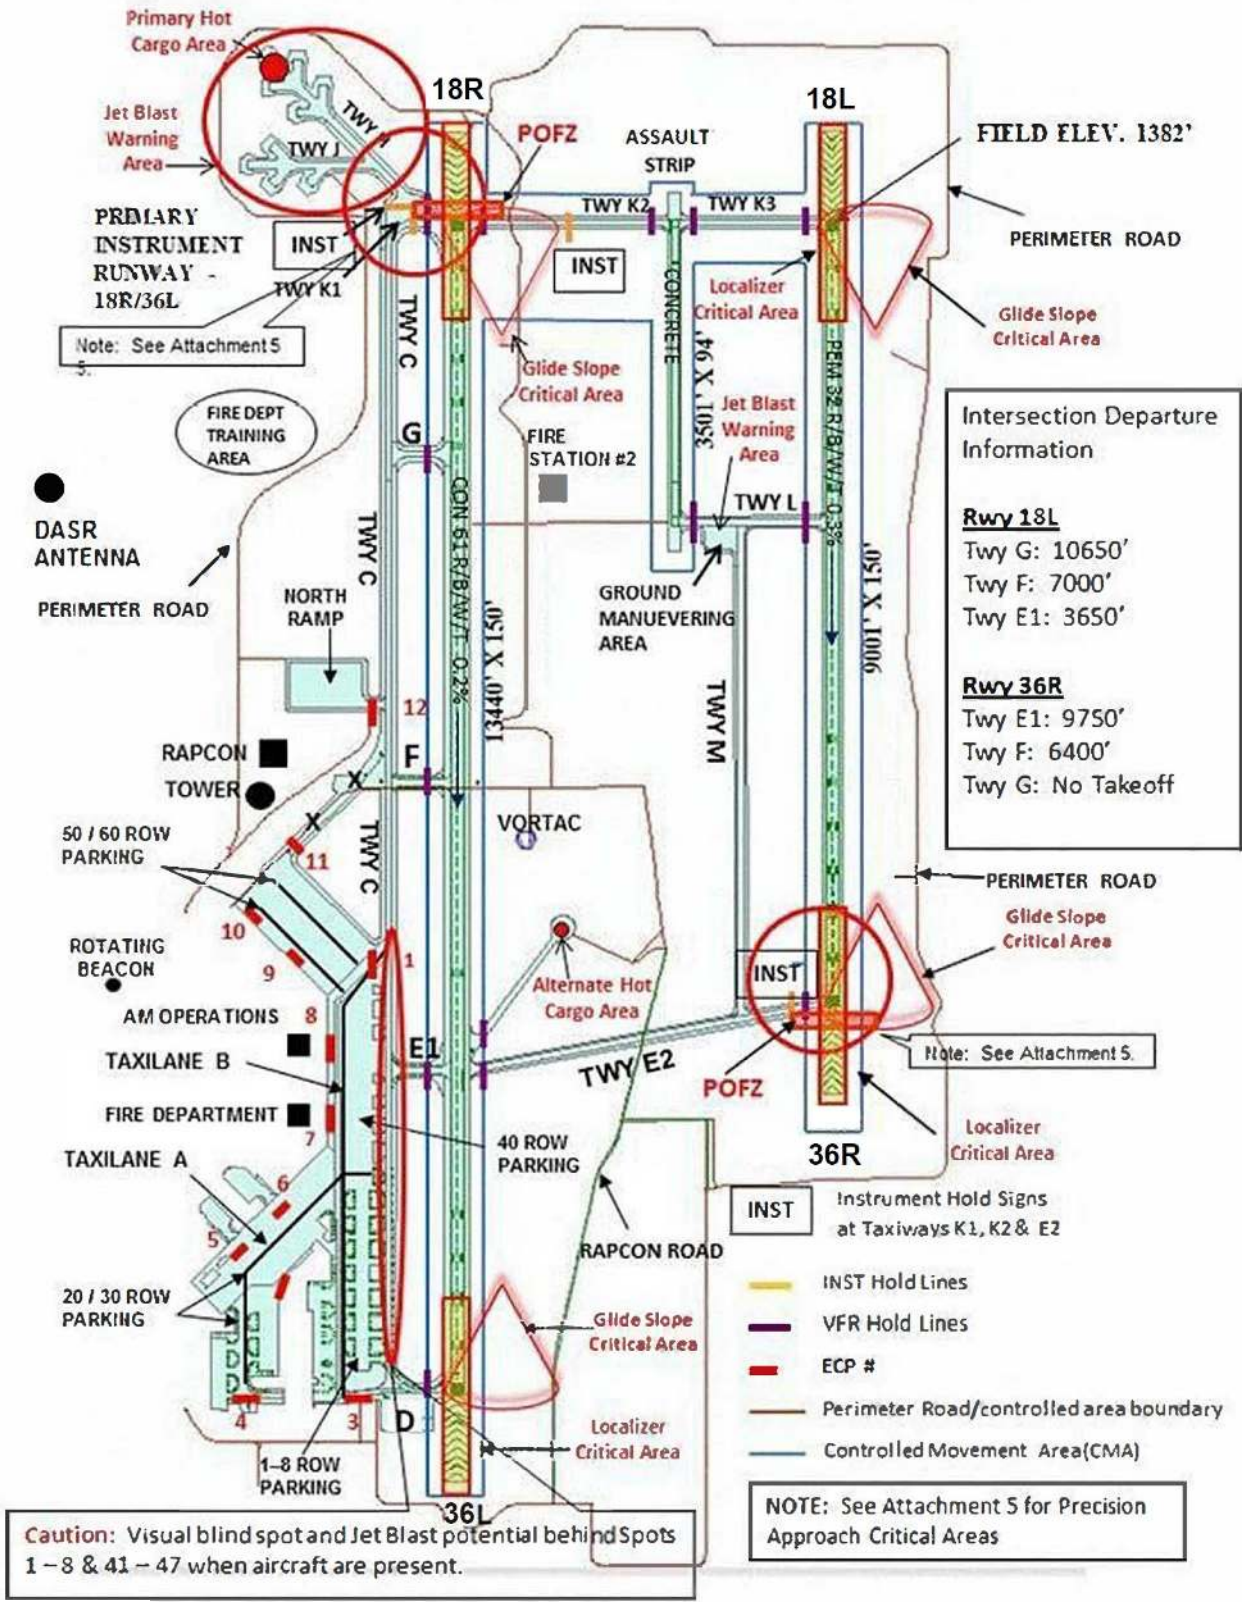


Figure A2.1.

Attachment 3

ALTUS CLASS D AIRSPACE

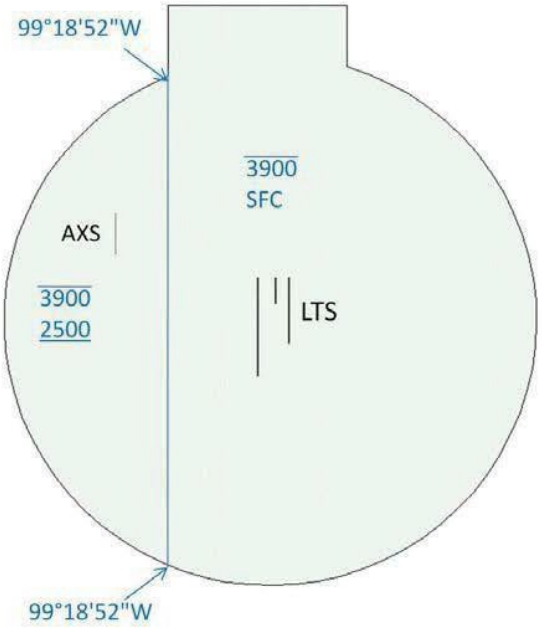

Note: The shelf boundary longitude coincides with Park Lane.

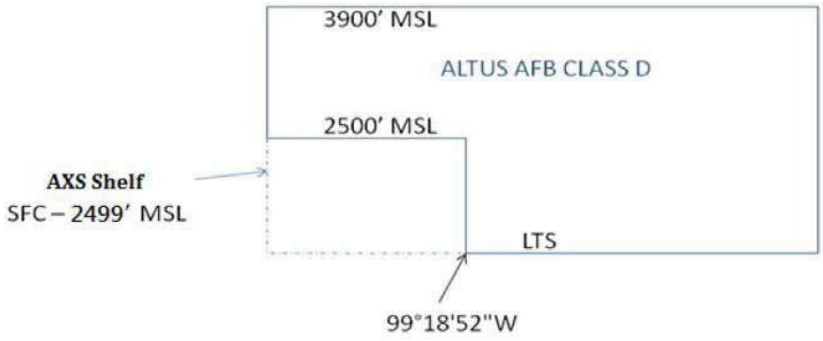


Figure A3.1.

Attachment 4

ALTUS RADAR APPROACH CONTROL AIRSPACE

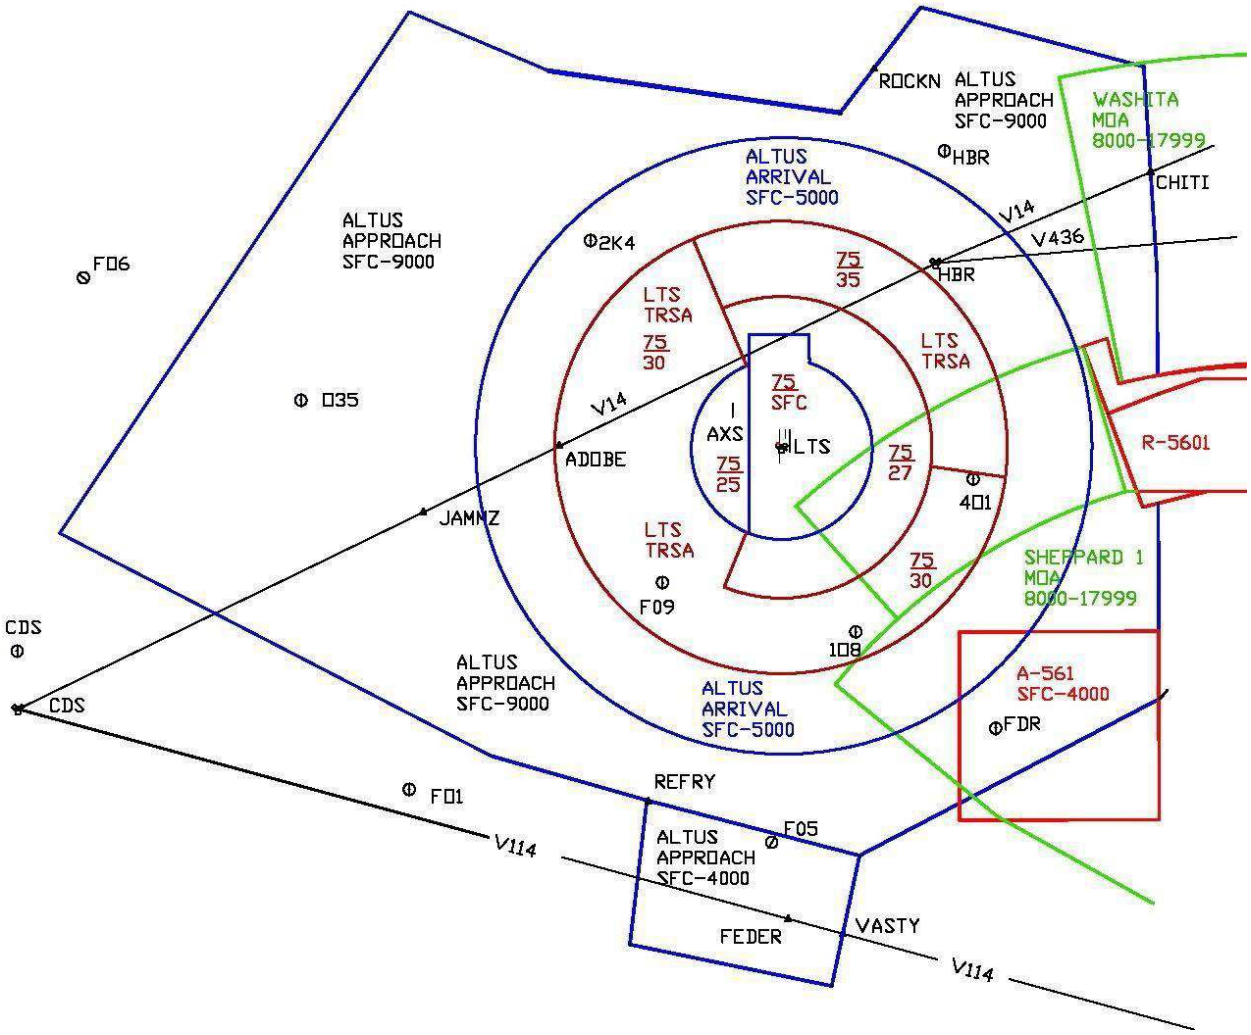


Figure A4.1.

Attachment 5

GLIDE SLOPE CRITICAL AREA/PRECISION OBSTACLE FREE ZONE

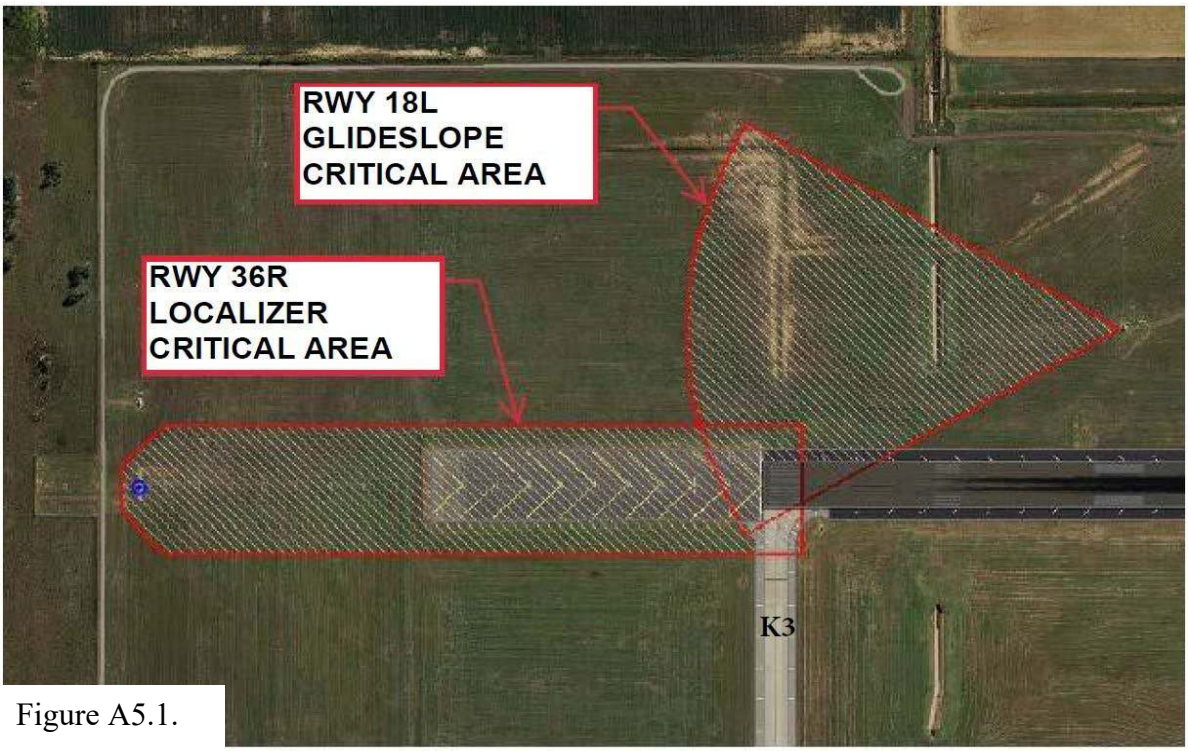


Figure A5.1.

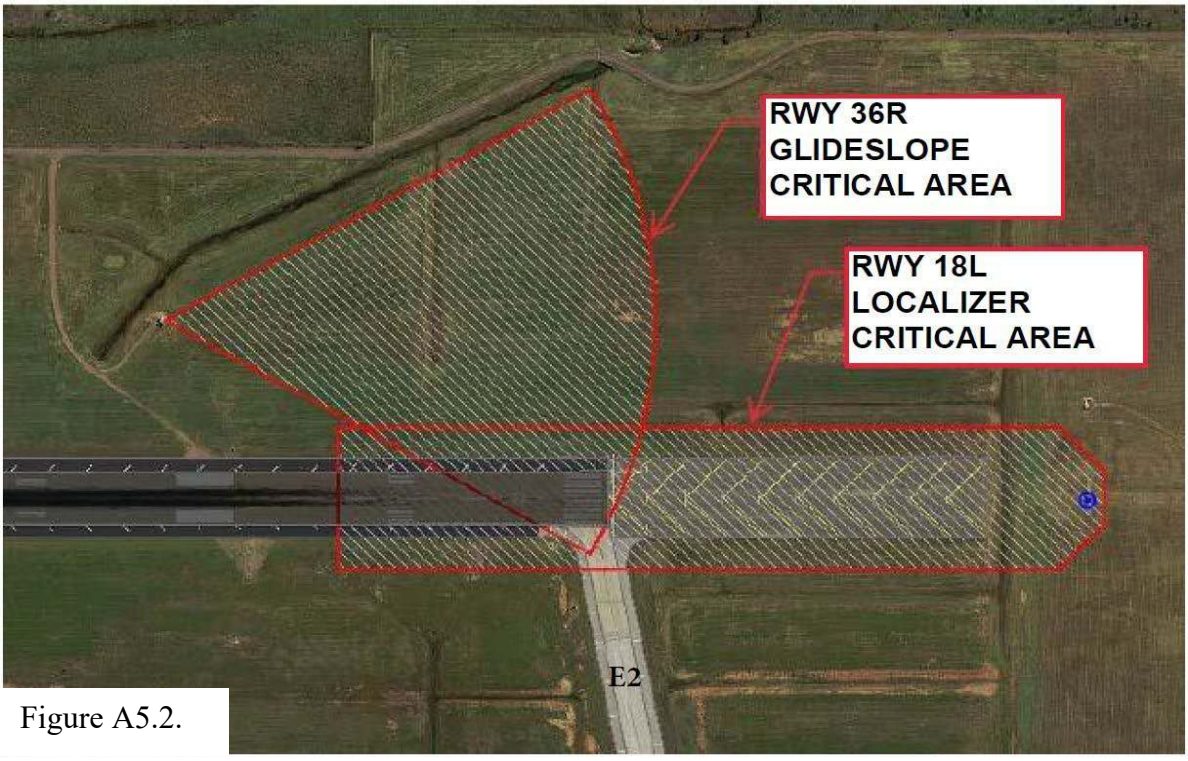


Figure A5.2.

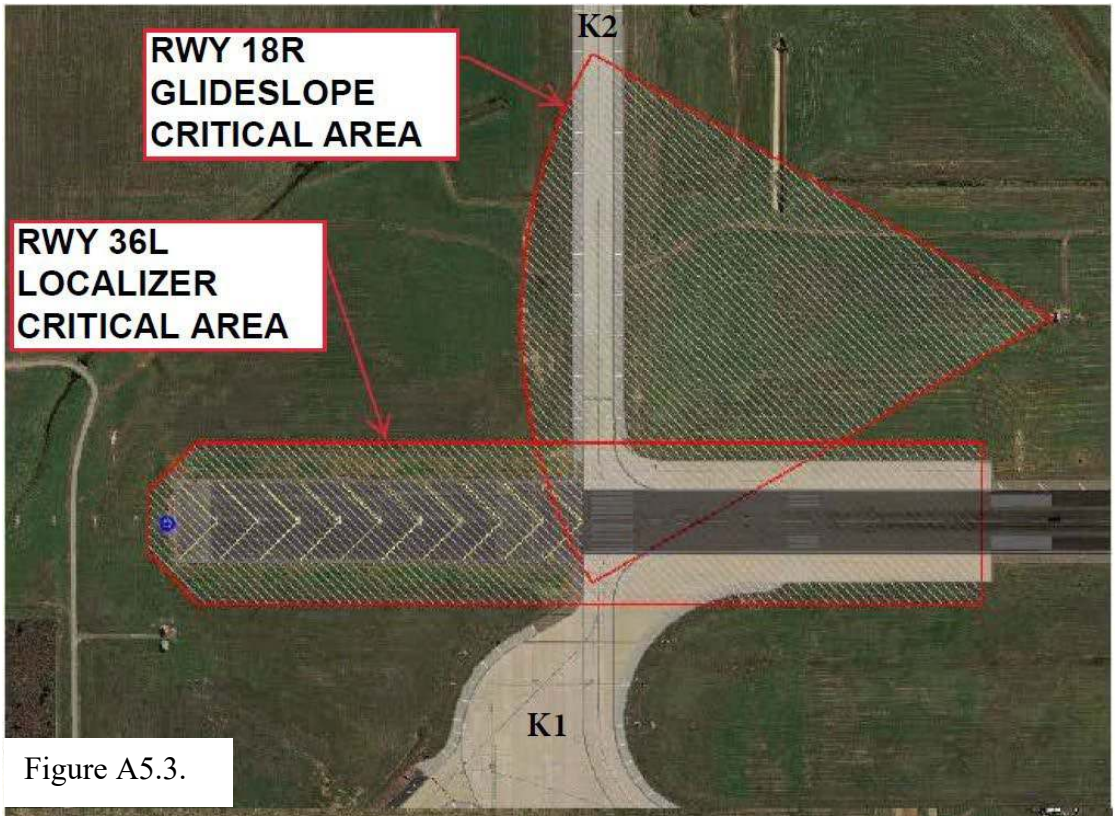


Figure A5.3.

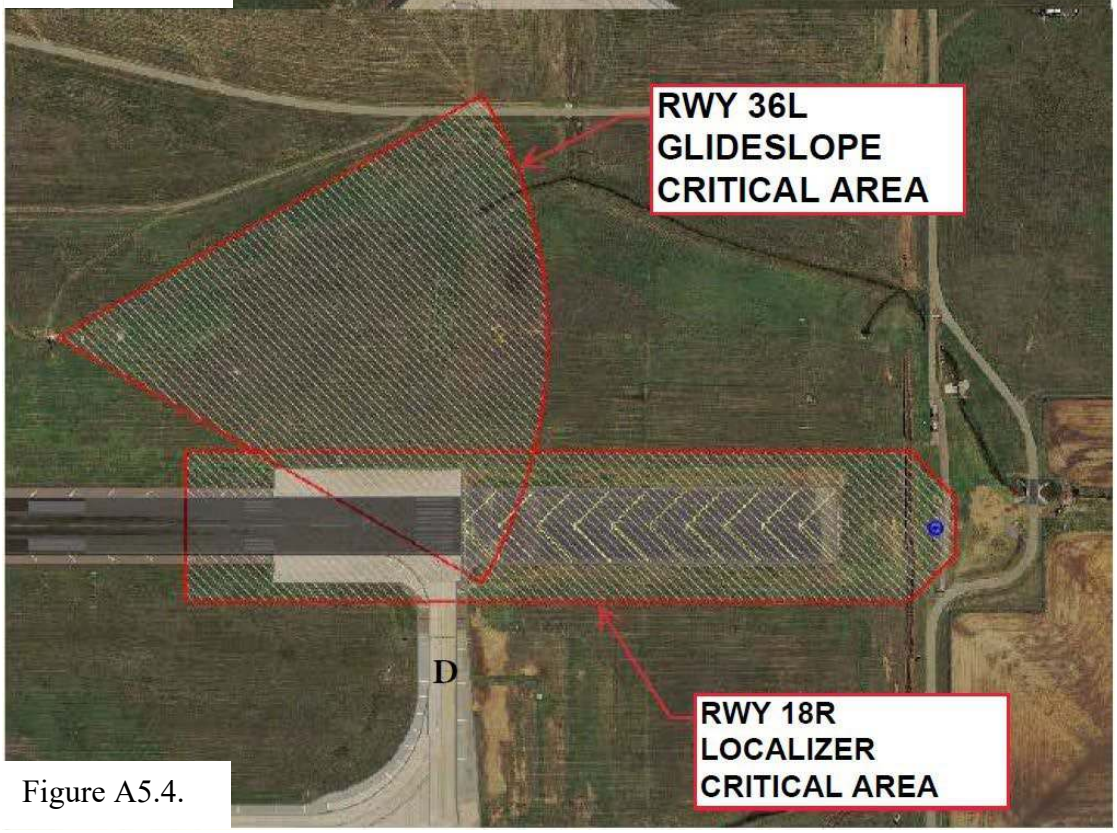


Figure A5.4.

NOTE: The 36L glideslope critical area is penetrated on its eastern tip by RAPCON road. This penetration has been permanently waived by AETC/DO.

TACAN Ground Checkpoints

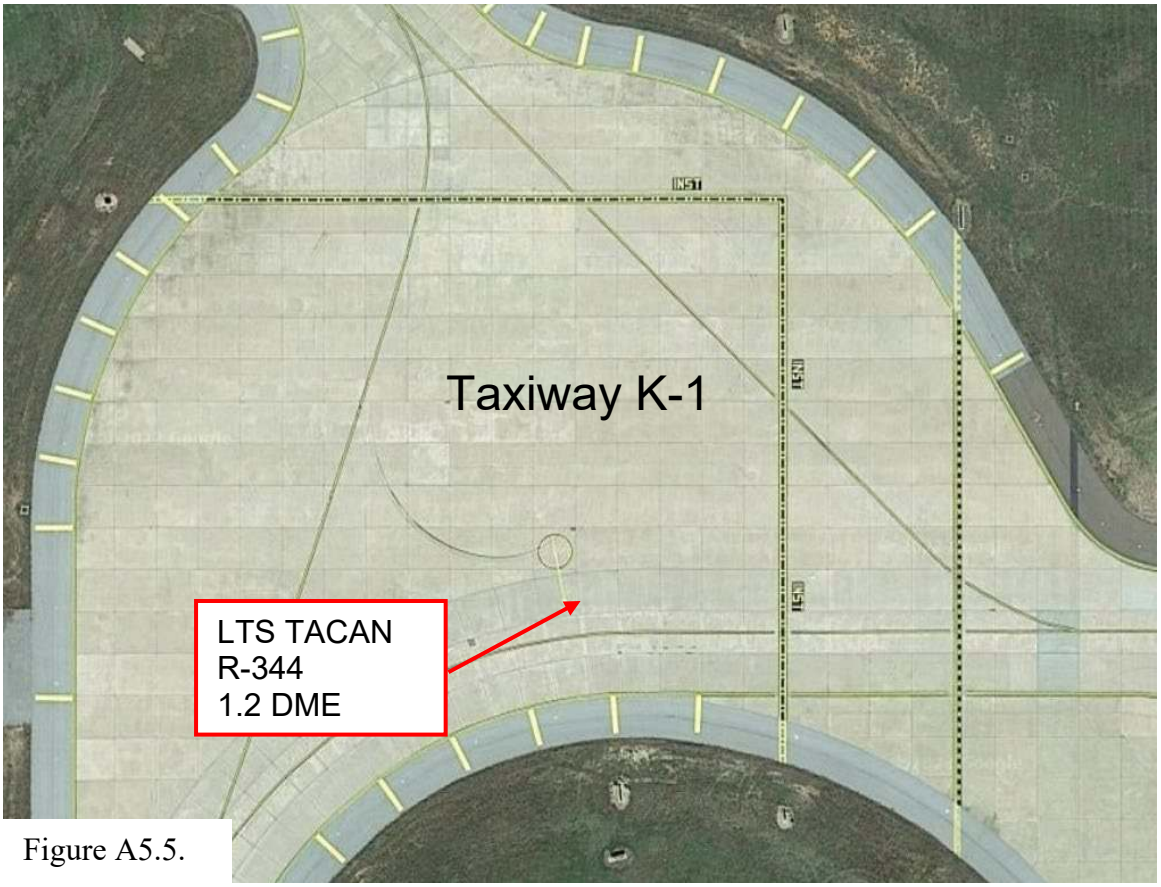


Figure A5.5.



Figure A5.6.

Attachment 6

BORGER AIRWORK AREA

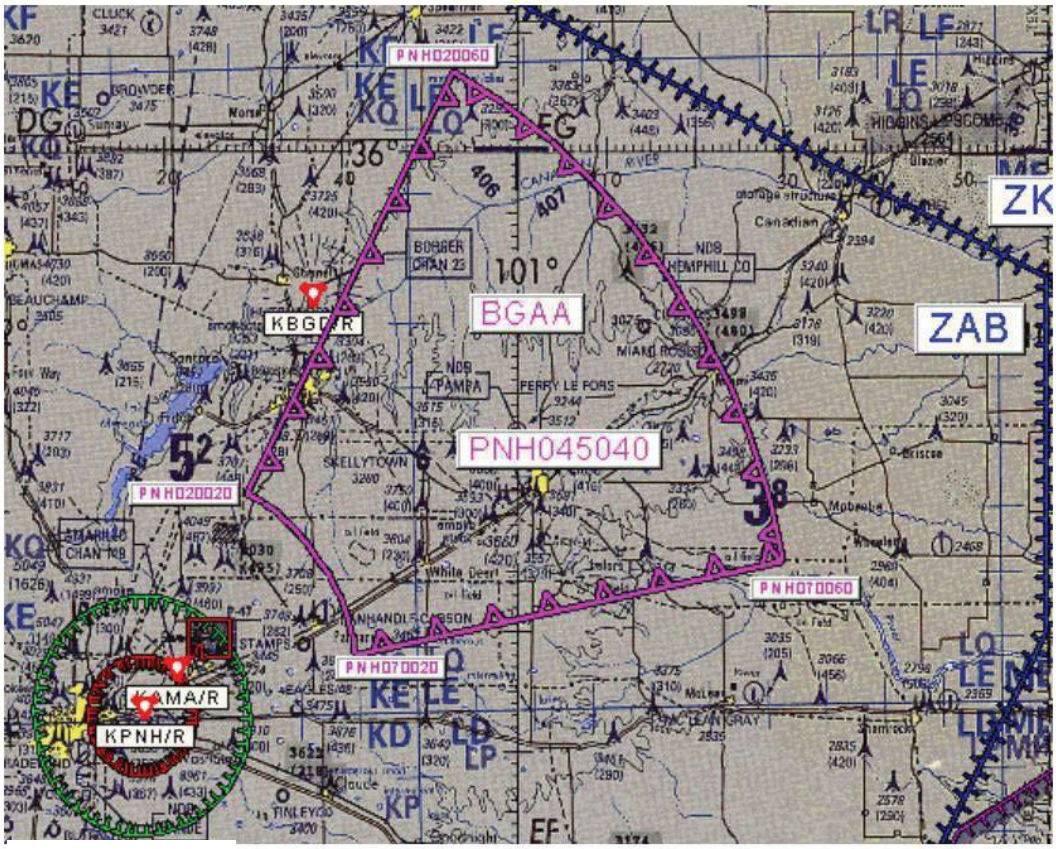


Figure A6.1.

Attachment 7

LOW ALTITUDE TACTICAL NAVIGATION AREA (LATN)

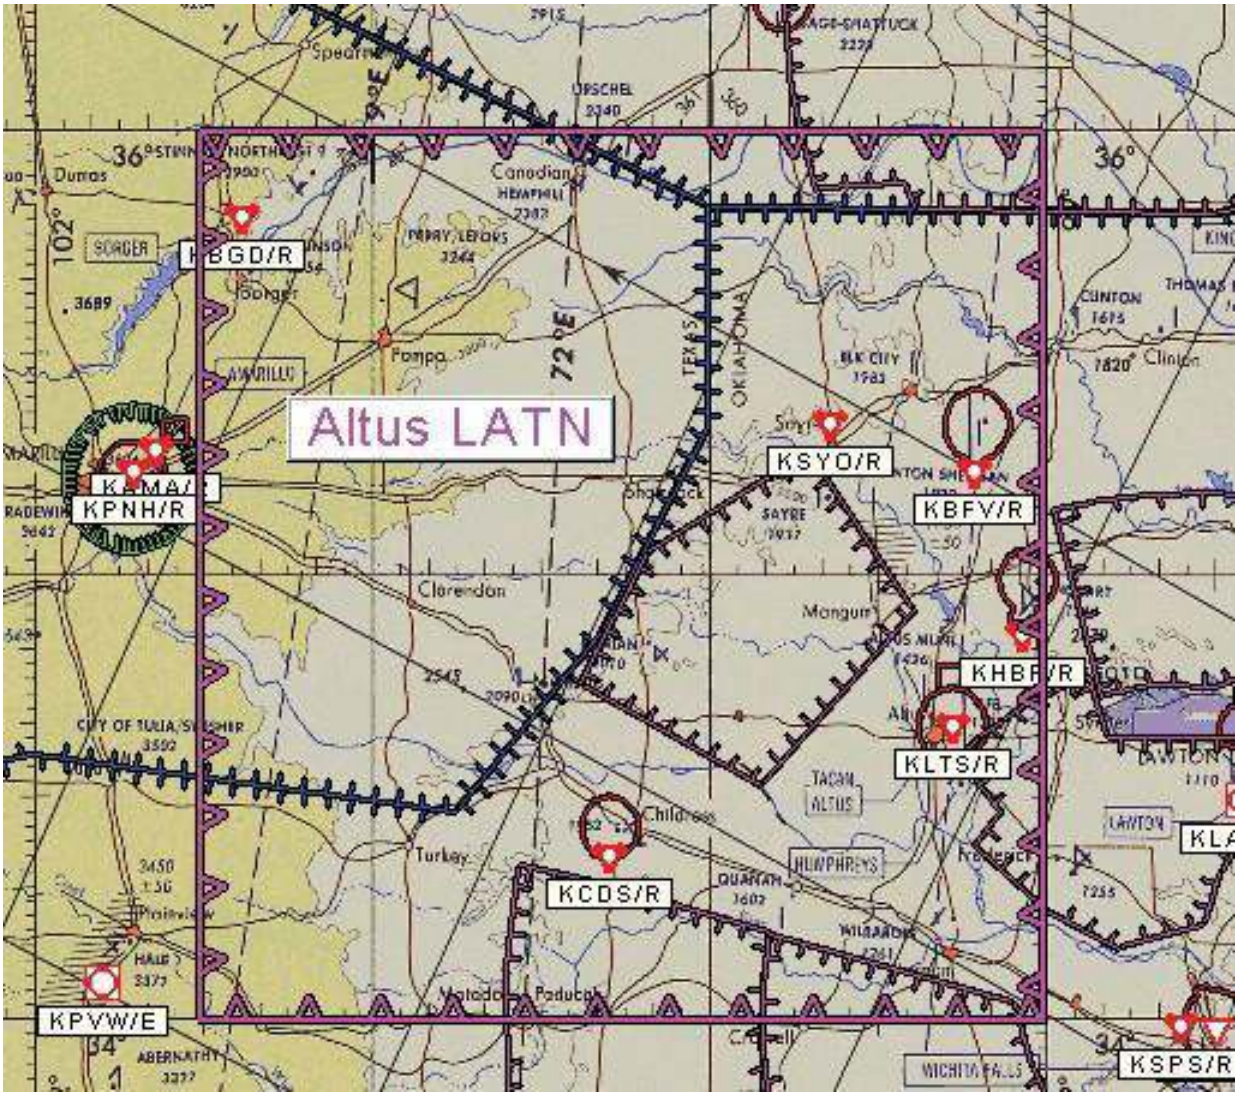


Figure A7.1.

Attachment 8

VFR TRAFFIC PATTERNS

ALTUS AFB VFR RECTANGULAR PATTERN

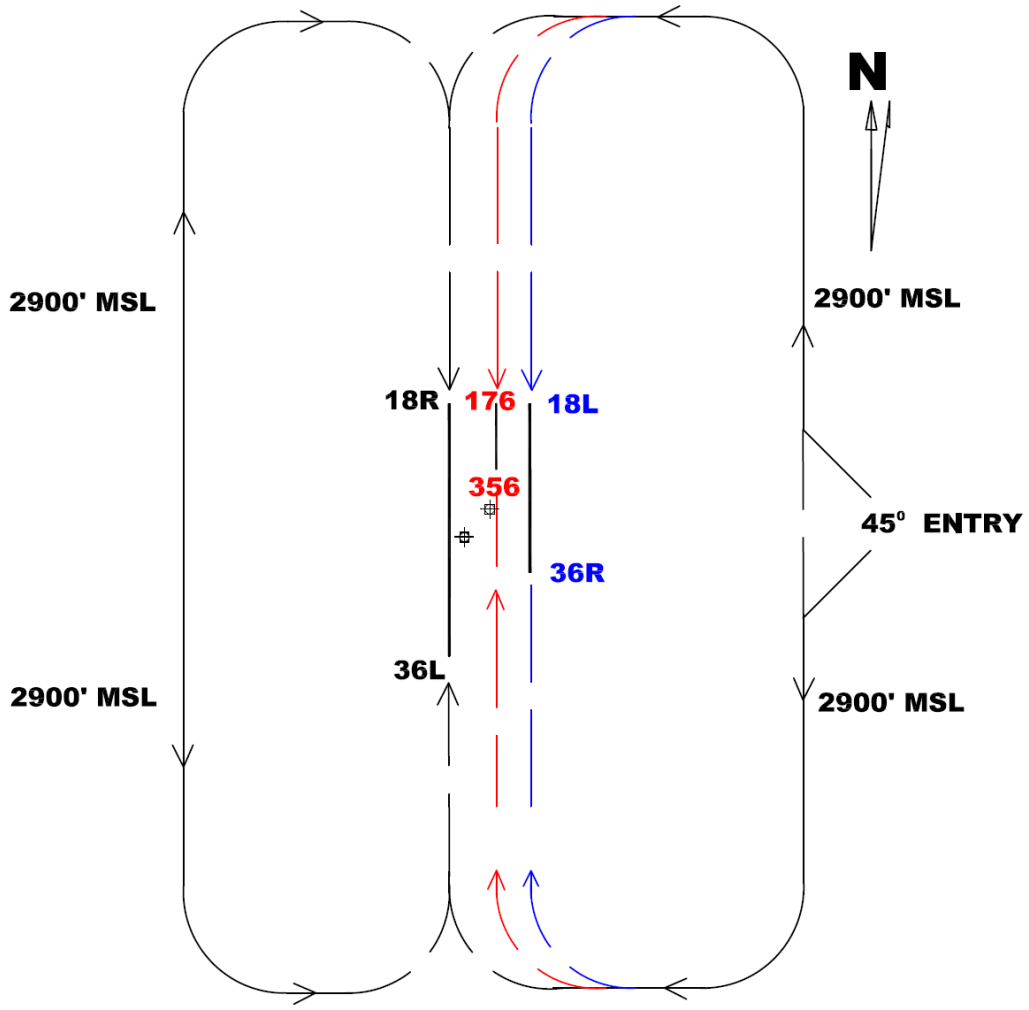


Figure A8.1.

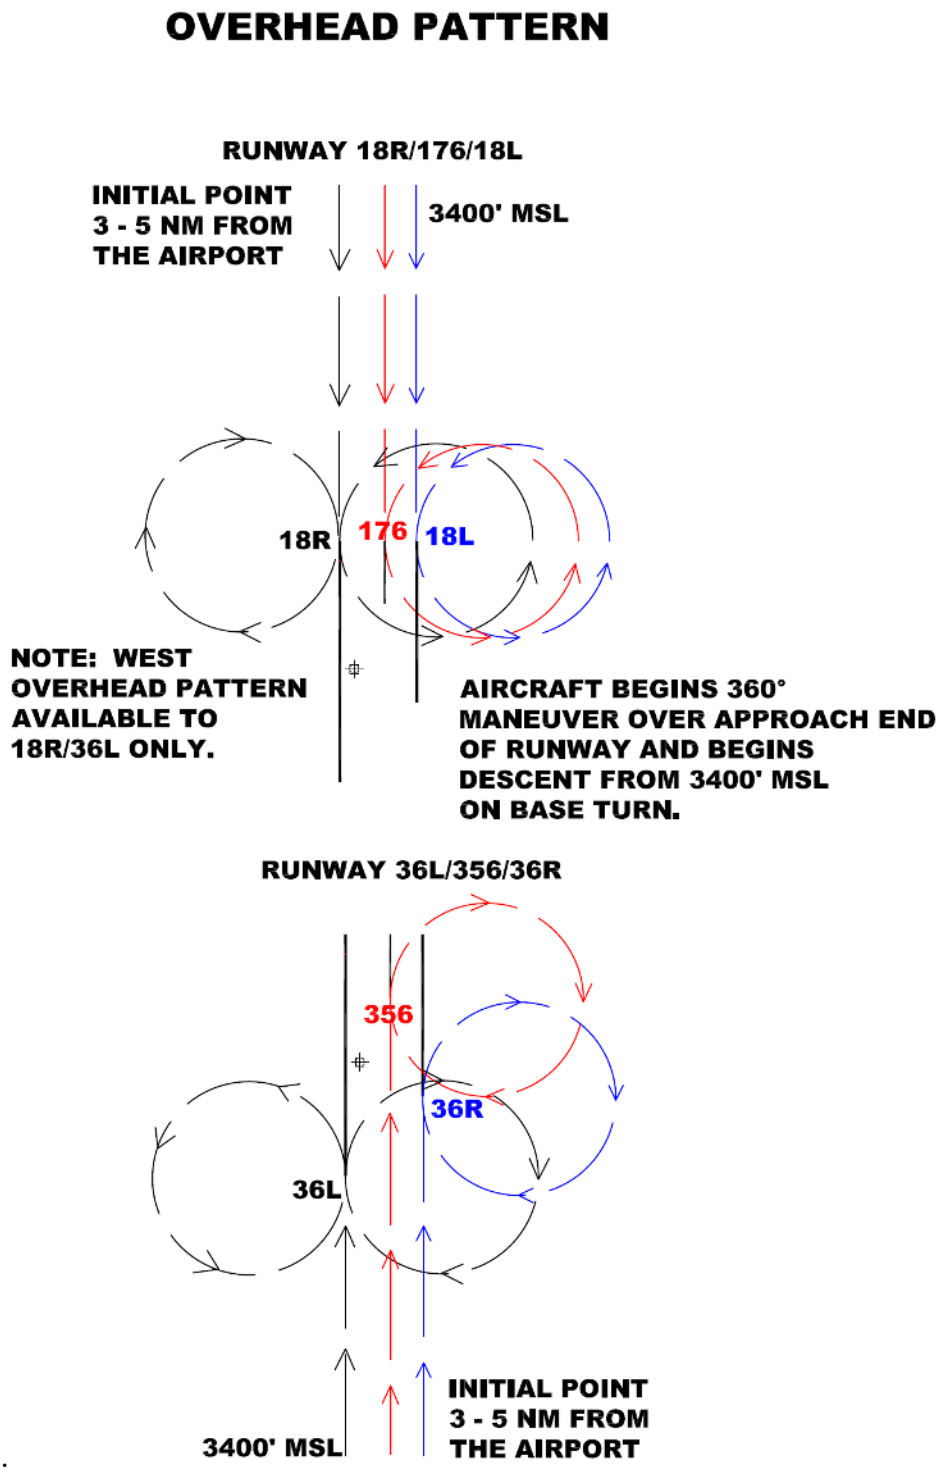


Figure A8.2.

NOTE: Non-base assigned aircraft are authorized to conduct the overhead traffic pattern with an east or west break.

Attachment 9

RECOMMENDED WEST PATTERN GROUND TRACK

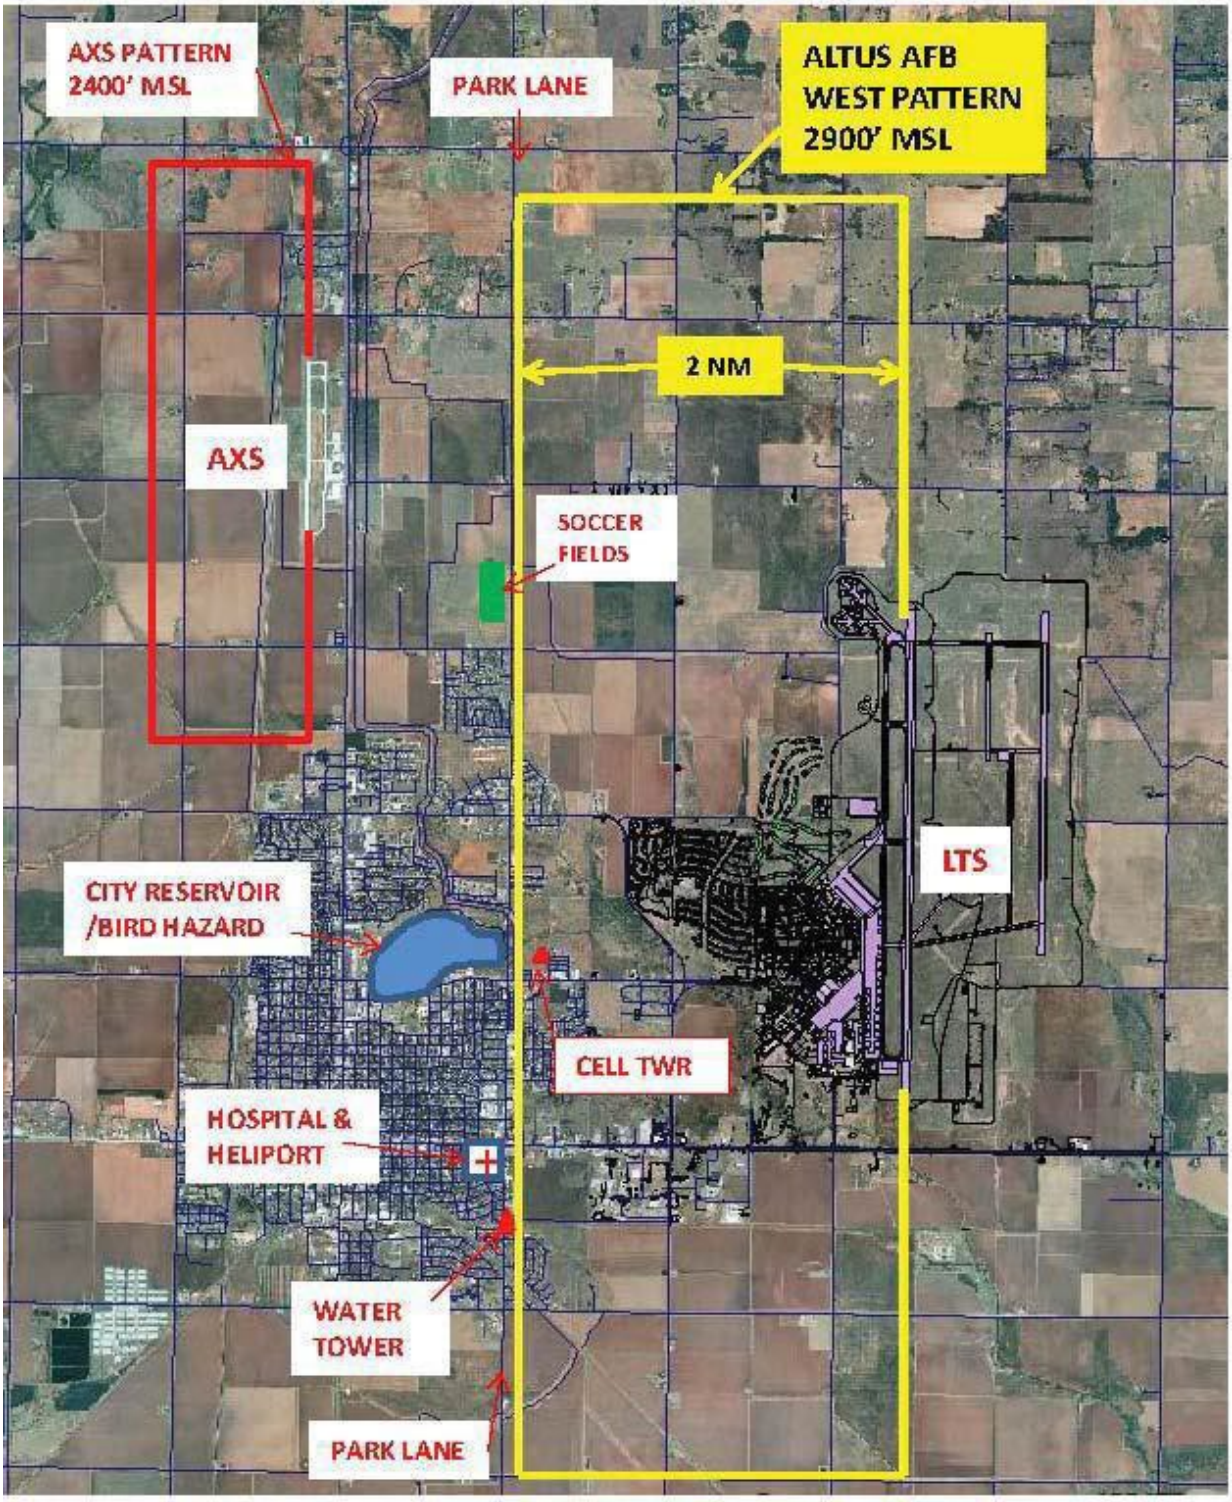


Figure A9.1.

Attachment 10

HELICOPTER VFR PATTERN


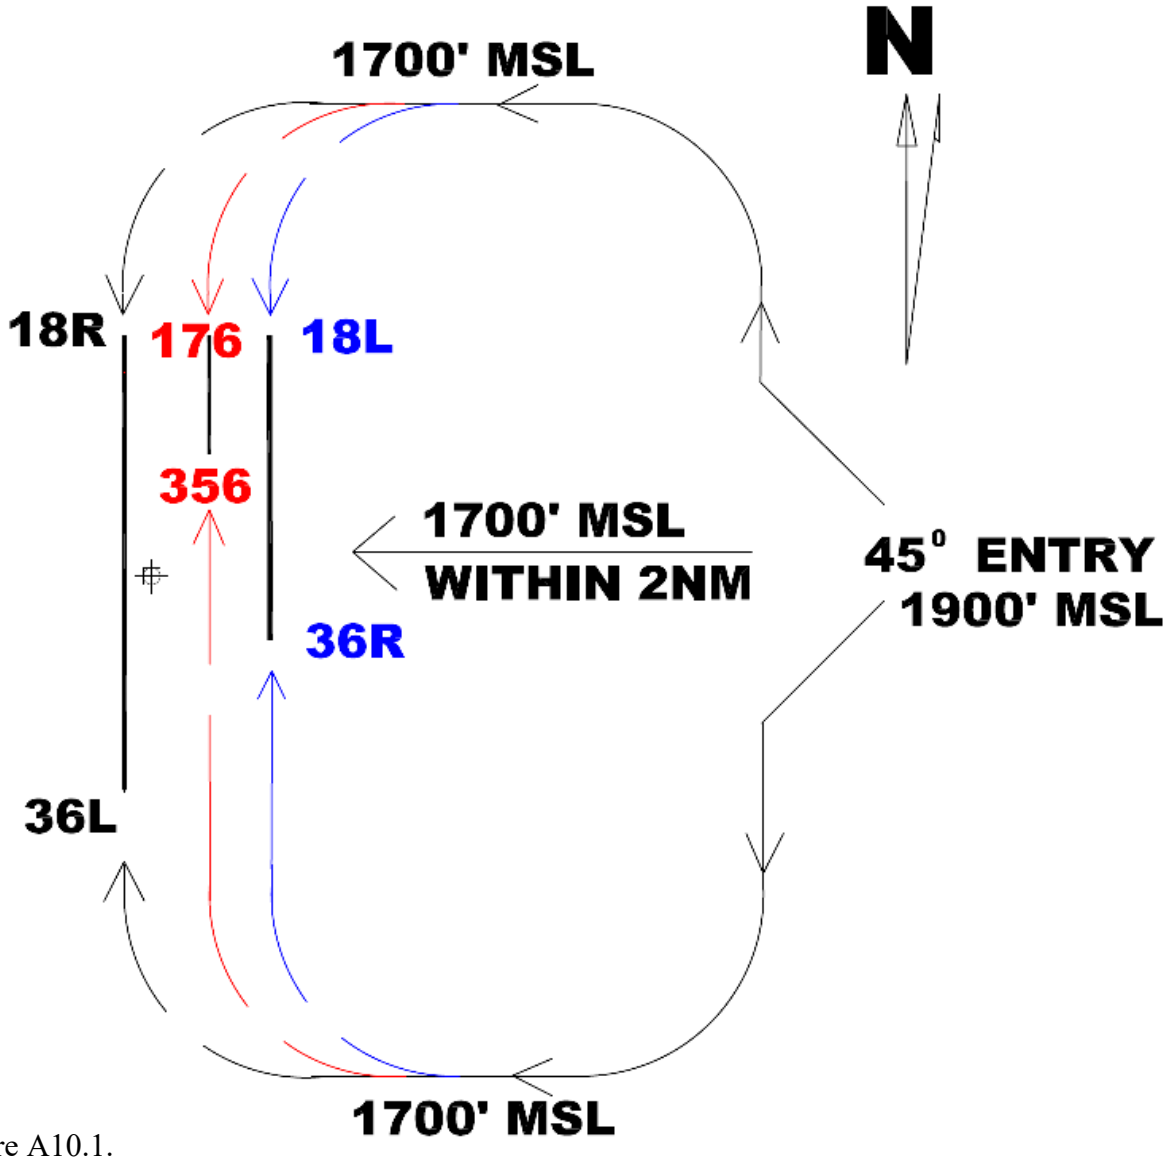


Figure A10.1.

Attachment 11

INTERSECTION DEPARTURE DISTANCES

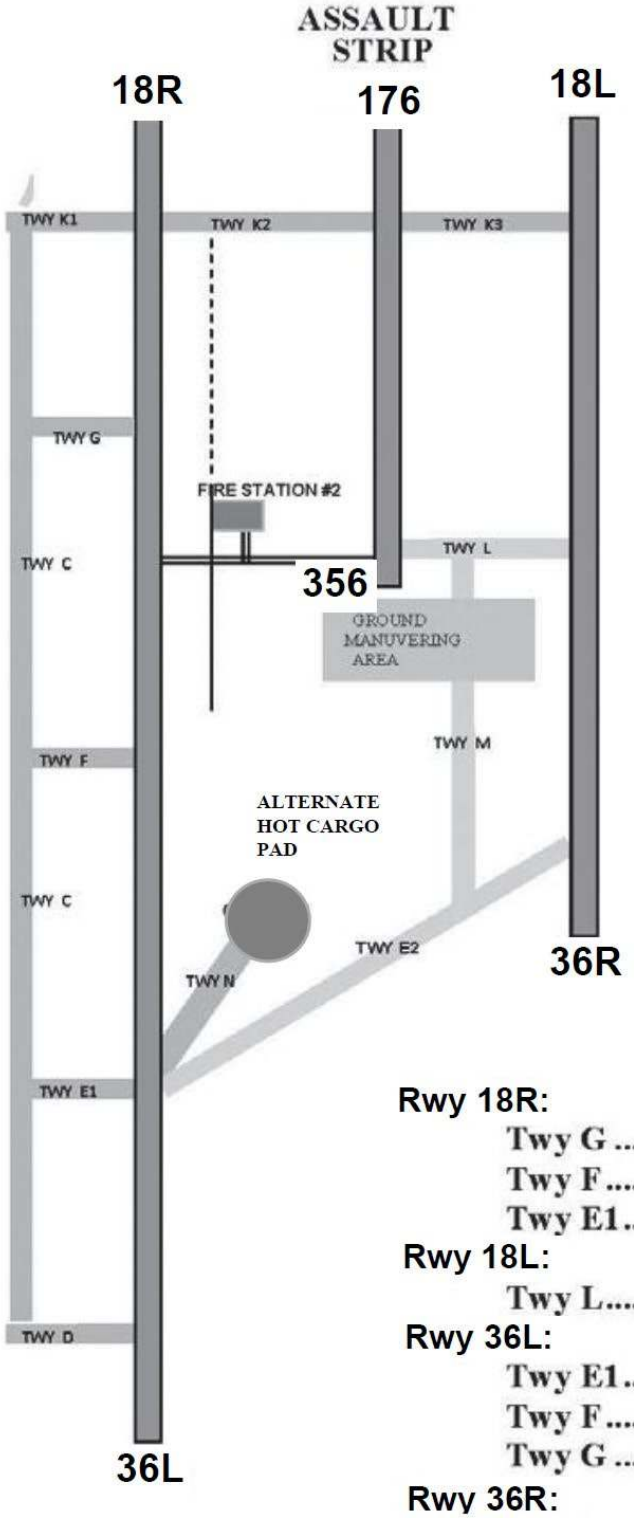

Rwy 18R:
- Twy G .....10,650'
- Twy F .....7000'
- Twy E1.....3650'

Rwy 18L:
- Twy L.....5500'

Rwy 36L:
- Twy E1.....9750'
- Twy F .....6400'
- Twy G ...NO TAKEOFF

Rwy 36R:
- Twy L.....3500'

Figure A11.1.

Attachment 12

NORTH RAMP PARKING DIAGRAM

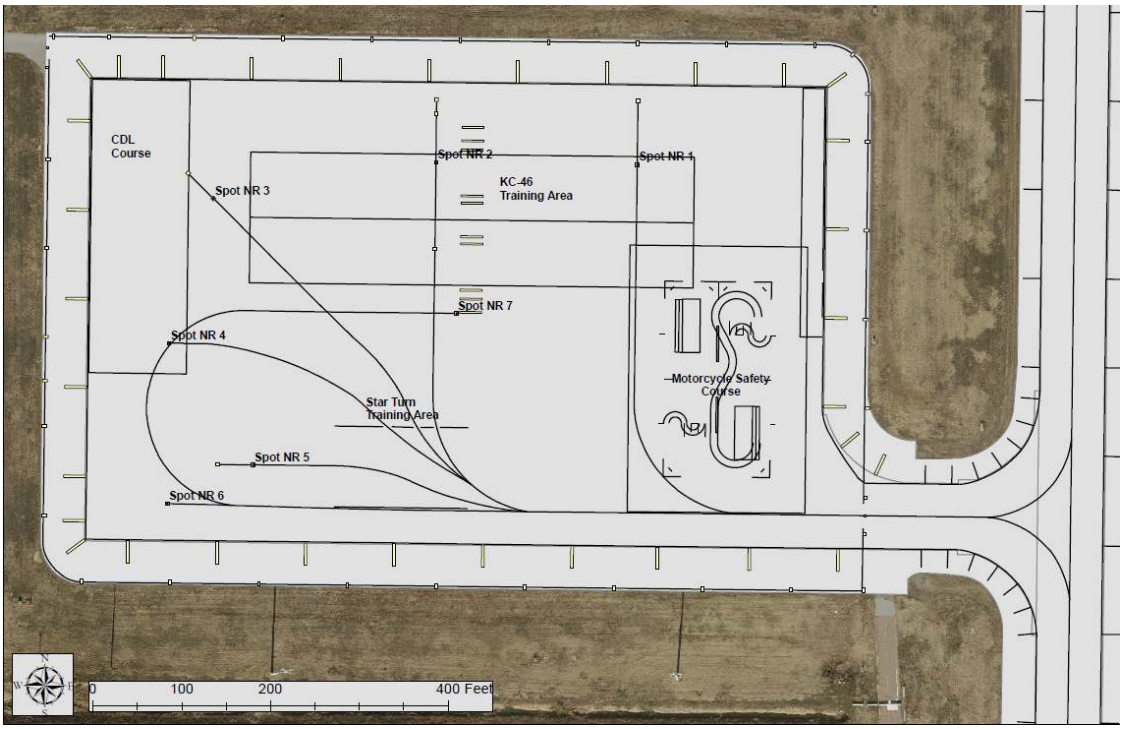


Figure A12.1.

Attachment 13

STAR TURN TRAINING AREAS

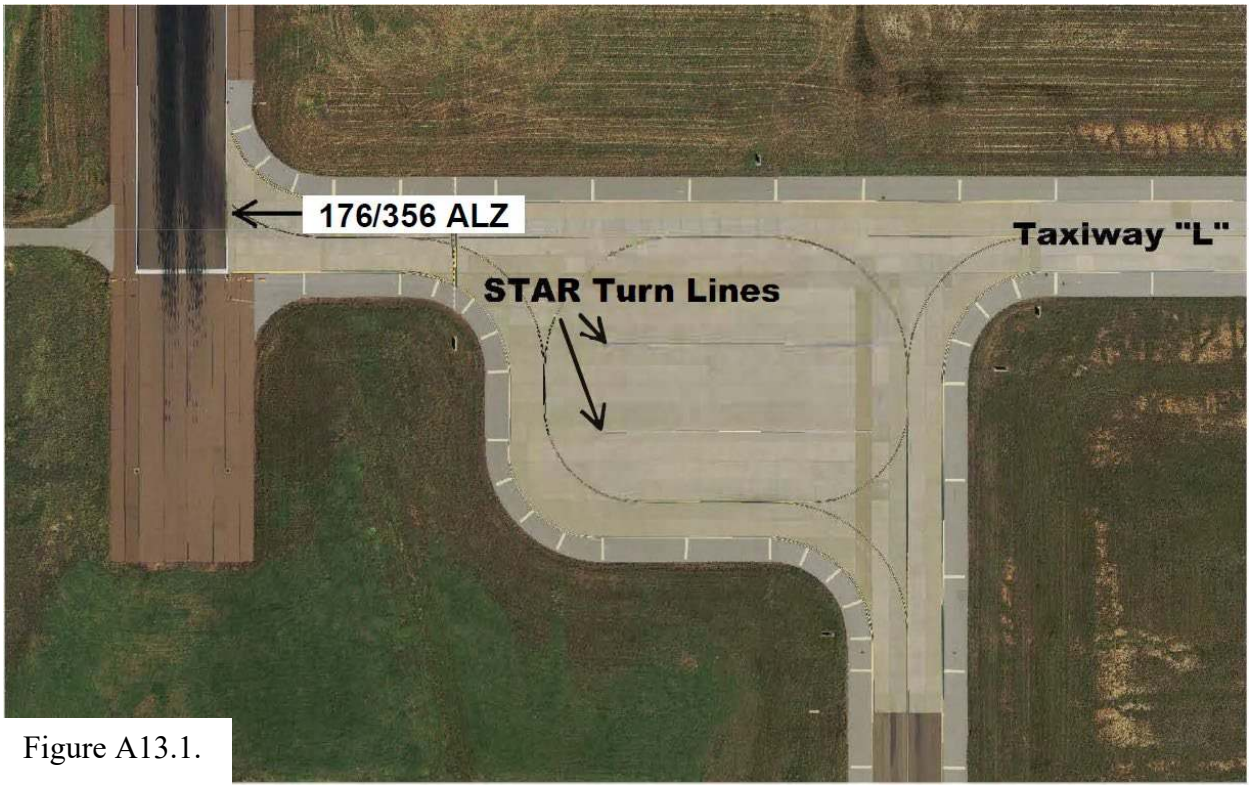


Figure A13.1.

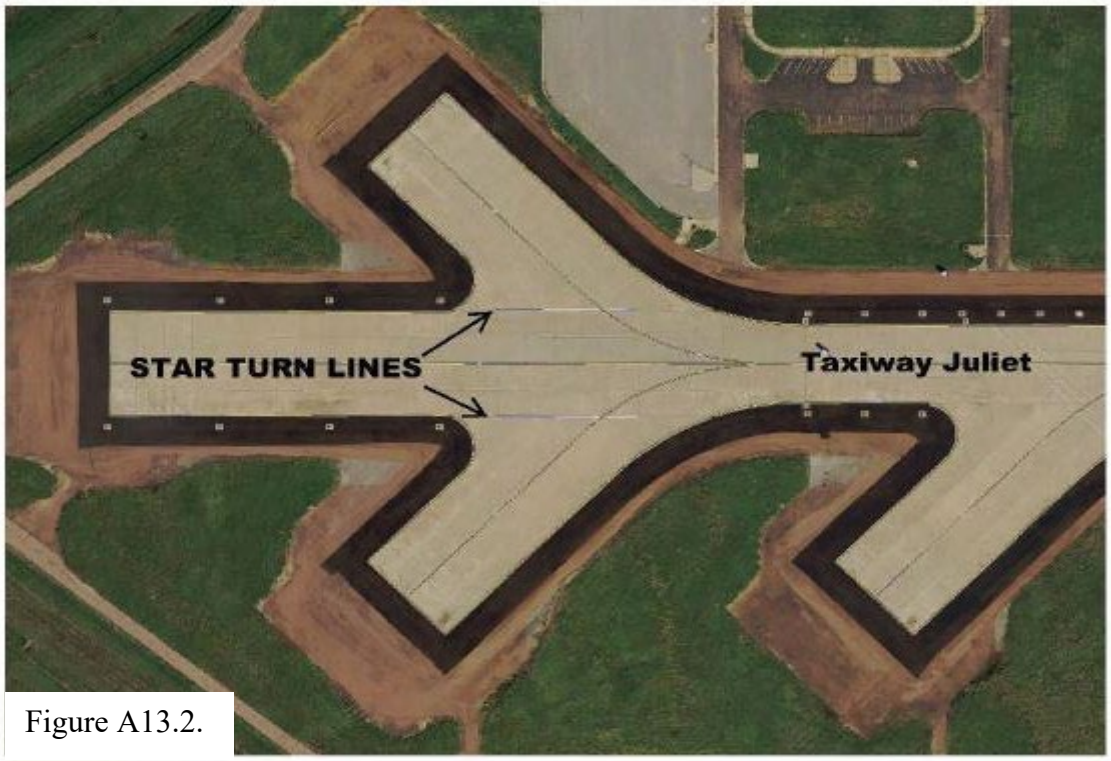


Figure A13.2.

Attachment 14

CMA ACCESS TRACKING LOG

Date/Time Reported (Z)	Call Sign	Starting Point, Destination, Number of Vehicles and Other Pertinent Info	Time Reported off CMA

Figure A14.1.

Ensure all active CMA vehicle/personnel information is passed to AMOPS or tower when requested prior to those facilities opening.

Attachment 15

WINGTIP CLEARANCE TRAINING LINES

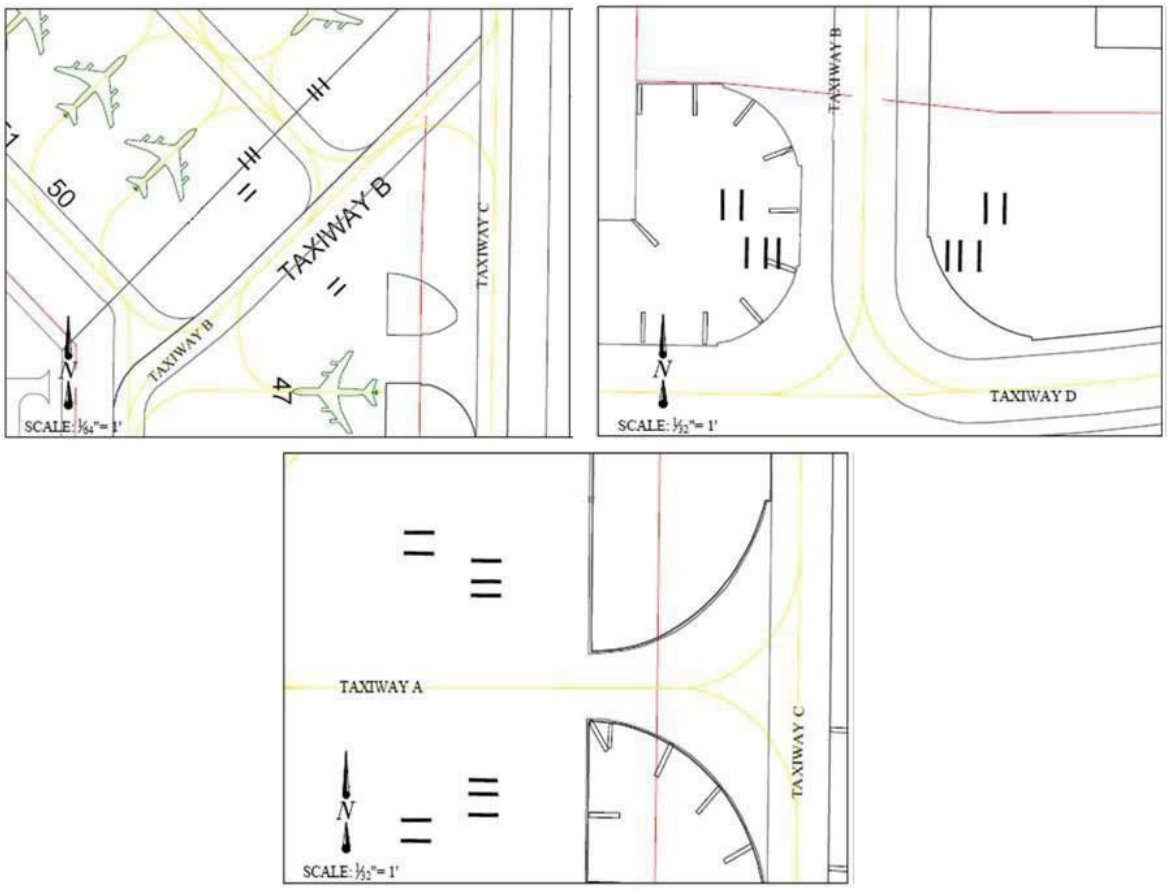


Figure A15.1.

Attachment 16

RADAR PATTERN

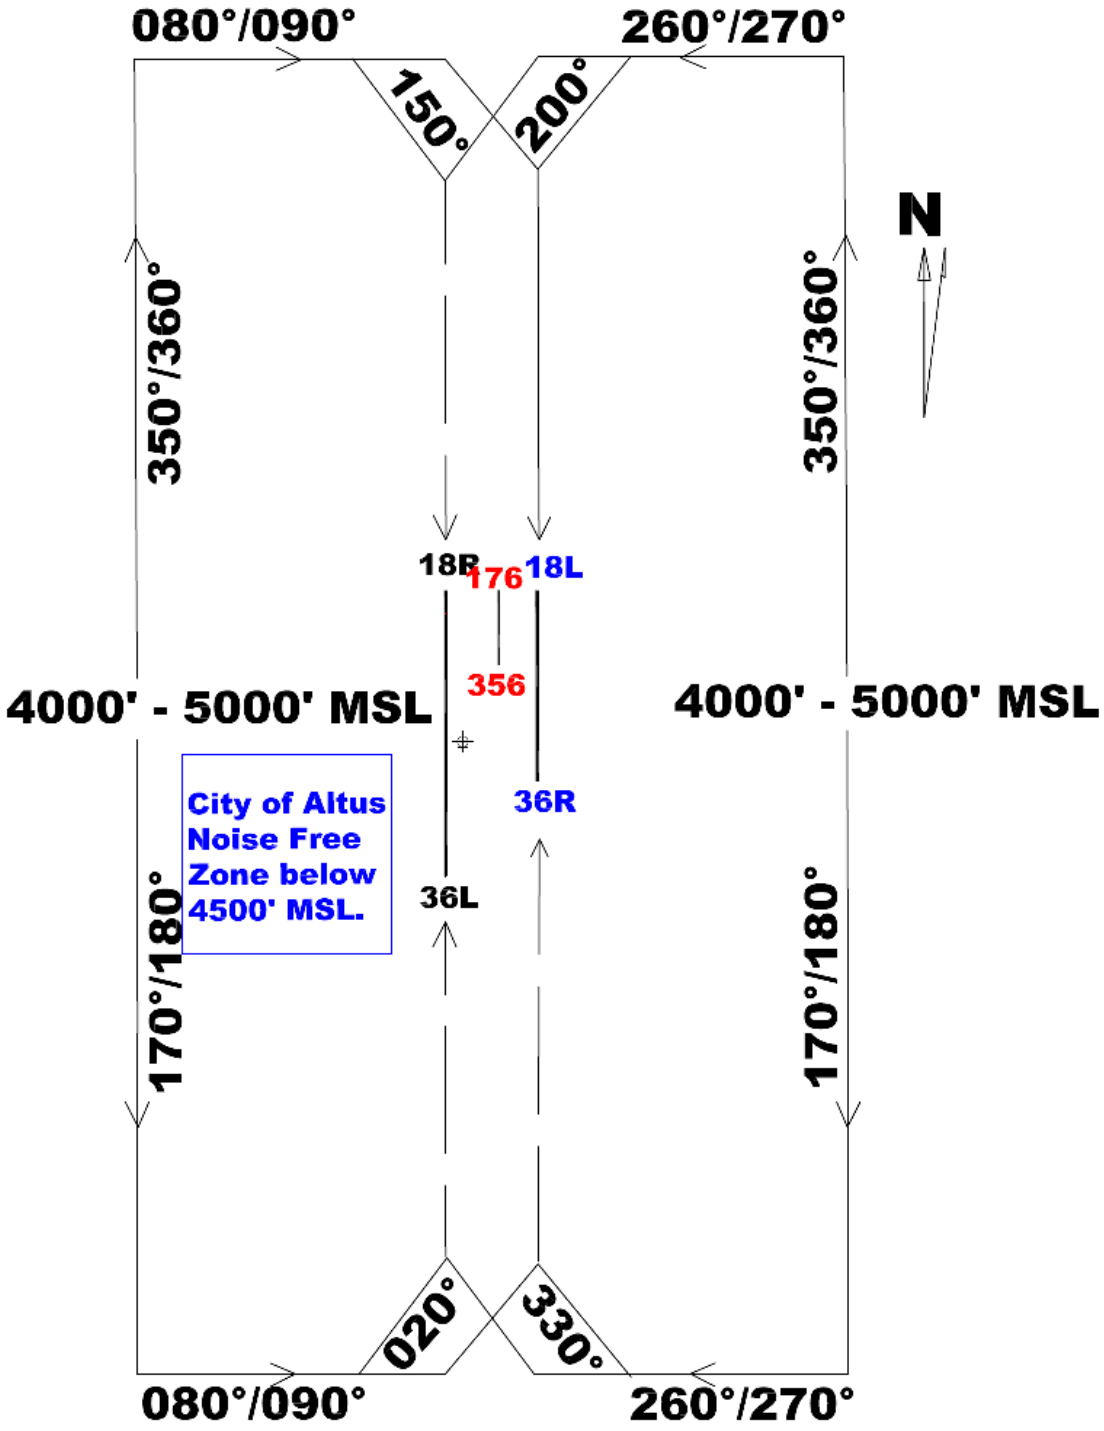


Figure A16.1.

Attachment 17

RUNWAY 18L/36R LIGHTING CONFIGURATION

AMP-1, OVERT		AMP-3 COVERT (NVG)	
White Light	○	IR Light	●
Green Light	●		
Red Light	●	Flashing IR Light	◂●
Flashing White Light	◂○		

Note: C-17s with "NOGS" callsigns are assumed to be conducting NVG approaches (AMP-3, covert), while "CADDO" or "TRIBE" callsigns are assumed to be conducting white light approaches (AMP-1, overt). If you are conducting an NVG touch and go, request full-length NVG lighting.

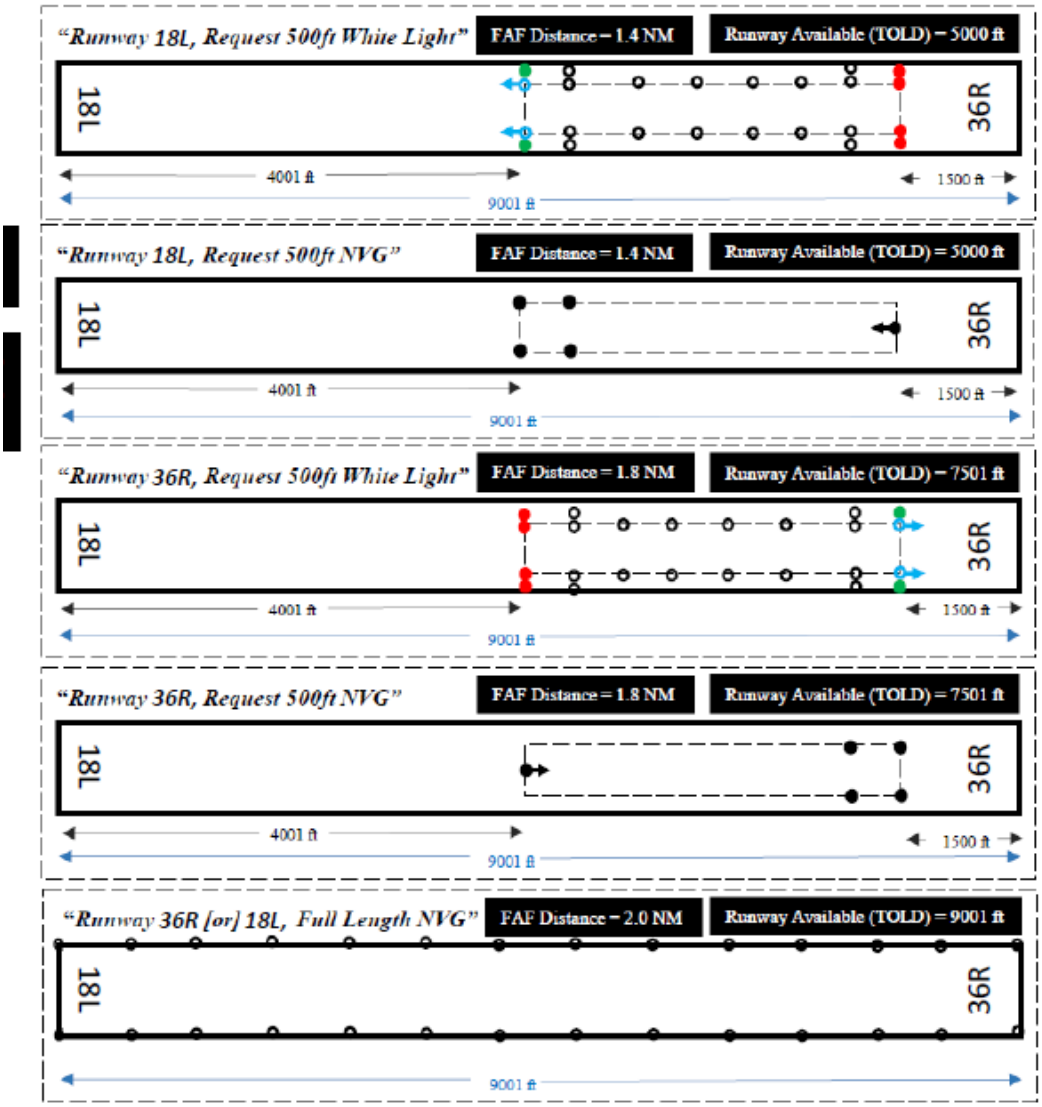


Figure A17.1.

Attachment 18

ALZ LOCATION AND MARKINGS ON RWY 18L/36R

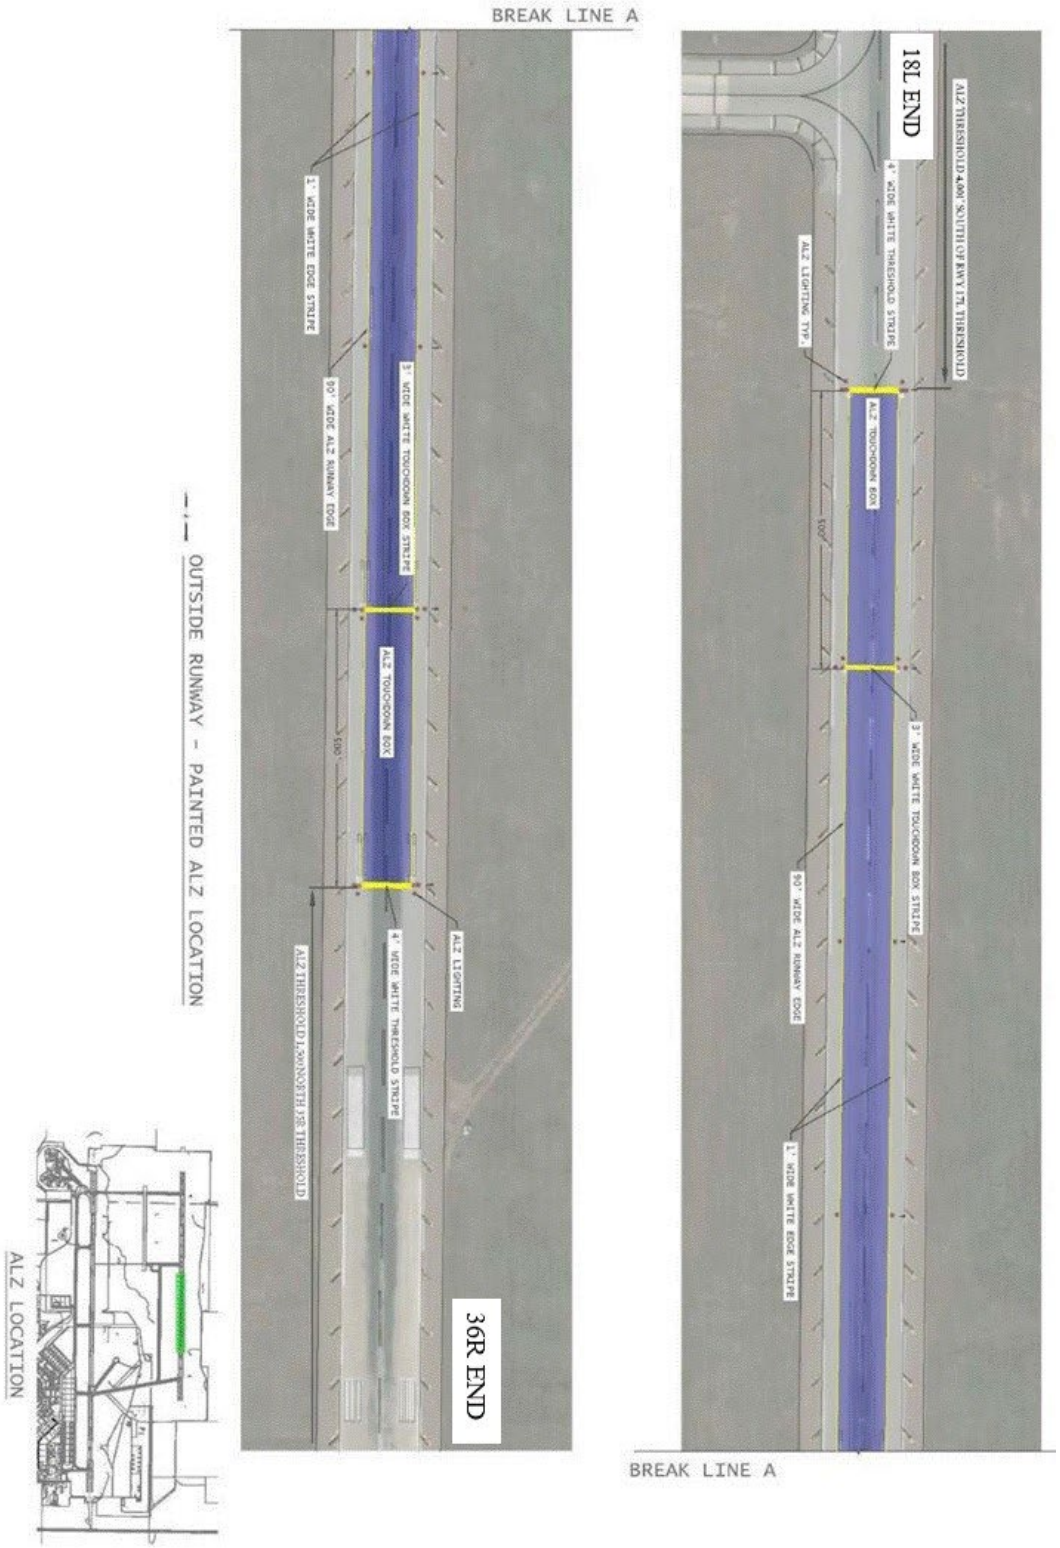


Figure A18.1.

Attachment 19

ALTUS NIGHT VISION DEVICE AND WHITE LIGHT PATTERN OPERATIONS

1. Participating Aircraft.

1.1. All 97 AMW assigned or gained aircraft are considered "participating aircraft."

1.2. Aircraft from other organizations operating under LOAs that include NVD operations may also be treated as "participating aircraft" if so designated.

2. Airfield Lighting Guidance.

2.1. Altus Air Force Base Air Traffic Control Tower, hereafter referred to as Tower, shall configure airfield lighting in accordance with JO 7110.65, chapter 3, section 4.

2.2. Where NVD operations demand additional guidance not found in JO 7110.65, Tower shall configure airfield lighting in accordance with this attachment.

3. Coordinating and Requesting Airfield Lighting Configurations.

3.1. The procedures listed in this attachment will be in effect from approximately one hour after sunset until airfield closure or upon termination of NVD training. This window is published in the IFR Supplement.

3.1.1. Anytime NVD training is taking place outside this window, Tower will include the following statement in the ATIS broadcast: "NVD Operations in Effect" and applicable NOTAM will be published.

3.2. C-17 aircraft operating under the "NOGS" call sign are assumed to be to conducting NVD approaches unless otherwise specified. C-17 aircraft operating under the "CADDO" or "TRIBE" call signs are assumed to be conducting a white-light approaches unless otherwise coordinated with Tower.

3.3. "CADDO" or "TRIBE" aircraft desiring an NVD approach, and "NOGS" aircraft desiring a white-light approach should make their request with Tower upon initial call-up of that approach. Requests for lighting configurations made after initial call-up of that approach may be denied to maintain pattern spacing and safety.

3.4. Tower Watch Supervisor shall have the final approval for all mixed operations based on equipment capabilities and traffic load.

4. Concept of Operations. The most efficient configuration for accomplishing a mixture of white-light and NVD training is to use Runway 18R/36L for white-light training while using Runway 18L/36R, assault strip 176/356, and embedded ALZ 18L/36R for NVD training.

4.1. Full-length NVD operations to runway 18L/36R will be conducted with runway edge lights set to steps 1-3. IR lights will illuminate assault strip 176/356 and the embedded ALZ.

Normal airfield lighting will illuminate all taxiways and Runway 18R/36L.

4.2. NVD aircraft have priority over white-light aircraft to the assault strip 176/356.

4.3. In the event that airfield construction, pattern saturation, training requirements, or other circumstances prevent this concept of operations from being used, the available concept most closely approximating it will be used.

4.3.1. NVD and participating non-NVD aircraft may operate in the same closed pattern. White-light training may be conducted to a landing surface while aircraft in the same closed pattern use that landing surface for NVD training. The need to reset lighting configurations between approaches in these configurations will reduce pattern efficiency.

4.4. Lighting Requirements for IFR and VFR Approaches.

4.4.1. All applicable runway lights should be set no later than an IFR aircraft reaching the final approach fix (FAF) and no later than a VFR aircraft reaching a two-mile final. If the lights are not in the proper configuration by these points Tower shall direct the aircraft to execute a go-around.

4.4.2. Airfield lighting shall not be reconfigured for a following aircraft's requirements prior to the first aircraft passing the departure end of the runway.

NOTE: Aircraft operating under the NOGS call sign may depart from 18R/36L for departure.

5. Scheduling Procedures.

5.1. 97 OSS/OSA will not issue non-participating or non-NVD aircraft a PPR during NVD operations except in extenuating circumstances.

5.2. 97 OSS/OSO will publish scheduling restrictions in a Current Operations directive during prolonged periods when the most efficient concept of operations cannot be used.

6. Air Traffic Control Procedures.

6.1. Altus AFB air traffic controllers will not use NVDs while performing ATC duties.

6.2. Tower shall adjust interior cab lighting appropriately to observe NVD operations.

6.3. Suspension of NVD Operations.

6.3.1. In the event Altus AFB is operating under single runway operations (18R/36L or 18L/36R NOTAM Closed) and a non-participating aircraft will land or depart Altus AFB, NVD operations shall be suspended.

6.3.1.1. For arrivals, airfield lighting shall be returned to JO 7110.65 configurations

prior to a non-participating VFR aircraft reaching a two-mile final and prior to a non-participating IFR aircraft reaching the final approach fix.

6.3.1.2. For departures, airfield lighting shall be returned to JO 7110.65 configurations prior to the aircraft taking the runway for departure and shall not be changed again until the aircraft crosses the departure end of the runway.

6.3.1.3. Tower shall broadcast an advisory on Ground and Tower frequencies and allow approximately one minute for aircrews to transition from NVD to white-light operations.

6.3.1.4. Aircrew may continue to use NVDs at their discretion.

6.3.2. Tower will suspend NVD operations when necessary for safety of flight.

6.3.2.1. Tower shall not transition to white-light configurations when NVD aircraft are in critical phases of flight.

6.3.3. Suspension Procedures.

6.3.3.1. NVD operations may be terminated at the request of aircraft or Tower. Tower will notify the SOF and will make announcements on Ground and Tower frequencies. After this, Tower will wait one minute and return all airfield lighting to JO 7110.65 configurations.

6.3.3.2. Aircrew may continue to use NVDs at their discretion.

6.4. NVD traffic patterns to include entry/re-entry points will be in accordance tower traffic patterns and flying squadron training syllabus requirements.

7. Weather Requirements.

7.1. Mission planners will determine if lunar conditions will allow NVD operations.

7.2. NVD operations are governed by the same weather minima as non-NVD pattern operations.

8. Aircraft Lighting.

8.1. All white-light aircraft will operate with normal navigation, anti-collision, and position lights at an intensity that will allow the Tower to visually observe them.

8.2. C-17 NVD aircraft conducting mainly NVD training will operate IAW AFMAN 11-2C-17V3, current FCIFs, and FCBs.

8.3. Aircraft shall not operate with all lights turned off.

9. Traffic Pattern Capacity.

9.1. Traffic density should not exceed four aircraft to IR lit landing surfaces, with a maximum of six in the VFR (rectangular) traffic patterns.

9.2. The Tower Watch Supervisor may raise or lower the maximum number of aircraft in the VFR (rectangular) traffic patterns as traffic conditions permit.

10. Ground Operations.

10.1. NVD ground operations may be conducted in the designated ground operations area, the North Ramp, and taxiways H, J, N, L, M and C north of F.

Note: Tower does not have the capability to control the ballpark lights.

10.2. IAW AFI 13-213 AAFBSUP1, paragraph 3.2.7.22., use of Night Vision Devices (NVD) for airfield driving during blackout conditions/operations is not authorized at Altus AFB.

10.2.1. During blackout conditions, for C-17 and KC-46 NVD training, all vehicles will be restricted to the parking aprons and shall follow normal speed limits. Vehicles that must drive on the CMA during C-17 NVD training shall turn off headlights and turn on hazard warning flashers.

10.2.2. During an emergency situation to a runway being used for NVD operations, Night Vision Goggles (NVG) training should be suspended and the airfield should be returned to JO 7110.65 lighting configurations.

10.3. Vehicles with daytime running lights shall park in a safe location with ignition off, parking brake set, and emergency flashers on. (ref: AFI 91-203, 24.13.11.1)

11. Phraseology. The following phraseology shall be used by both aircrew and Air Traffic Controllers to make all requests concerning runway light adjustments.

11.1. The term “NVG” and its assumption through the use of the NOGS call sign apply to the runway requested, i.e.

“ALTUS TOWER, NOGS 67 INBOUND FROM FISHER, RUNWAY 18L, GEAR DOWN, FULL-LENGTH NVG, OPTION.”

11.2. The term “White-Light” shall be defined as normal runway edge light configuration based on required setting IAW JO 7110.65, i.e.

“ALTUS TOWER, NOGS 67 INBOUND FROM FISHER, RUNWAY 18L, GEAR DOWN, WHITE LIGHT, OPTION.”

11.3. Runway 18L/36R embedded ALZ IR light operations shall be requested using the following phraseology:

“ALTUS TOWER, CADDO 73, INBOUND FROM FISHER, RUNWAY 18L, GEAR DOWN, 500 FOOT NVG, OPTION.”

11.4. Runway 18L/36R embedded ALZ white-light operations shall be requested using the following phraseology:

"ALTUS TOWER, NOGS 67, INBOUND FROM FISHER, RUNWAY 18L, GEAR DOWN, 500 FOOT WHITE LIGHT, OPTION."

11.5. The assault landing zone 176/356 is equipped with AMP-1 overt, AMP-3 overt, and AMP-3 covert lighting.

11.5.1. Unless otherwise specified, use of the callsign "NOGS" is a request for AMP-3 (covert/NVG) lighting.

11.5.2. While utilizing callsign "NOGS" to the ALZ and the alternate lighting configuration of AMP-3 (overt/white-light) is desired, the following phraseology will be used:

"ALTUS TOWER, NOGS 67, INBOUND FROM FISHER, 18 ASSAULT, GEAR DOWN, WHITE LIGHT, OPTION."

11.5.3. Unless otherwise specified, use of the callsign "CADDO" or "TRIBE" is a request for AMP-3 (overt/white-light) lighting.

11.5.4. While utilizing callsign "CADDO" or "TRIBE" to the ALZ and the alternate lighting configuration of AMP-3 (covert/NVG) is desired, the following phraseology will be used:

"ALTUS TOWER, CADDO 11, INBOUND FROM FISHER, 18 ASSAULT, GEAR DOWN, NVG, OPTION."

11.5.5. When operating under either callsign to the ALZ and are requesting AMP-1 (full runway lights), use the following phraseology:

"ALTUS TOWER, NOGS 55, INBOUND FROM FISHER, 18 ASSAULT, GEAR DOWN, AMP-1, OPTION."