BY ORDER OF THE COMMANDER
8TH FIGHTER WING INSTRUCTION

8TH FIGHTER WING
13-204

12 JUNE 2025

Nuclear, Space, Missile, Command, and Control

AIRFIELD OPERATIONS

COMPLIANCE WITH THIS PUBLICATION IS MANDATORY

ACCESSIBILITY: Publications and forms are available on the e-Publishing website at **www.e-Publishing.af.mil** for downloading or ordering.

RELEASABILITY: There are no releasability restrictions on this publication.

OPR: 8 OSS/OSA

Certified by: 8 OG/CC
(Col Derrick R. Frank)

Supersedes: 8FWI 13-204, 8 Jun 2018

Pages: 140

This instruction implements Air Force Policy Directive (AFPD) 13-2, *Air Traffic, Airfield, Airspace, and Range Management*; Department Air Force Instruction (DAFMAN) 13-201, *Airspace Management;* Air Force Manual (AFMAN) 13-204V1, *Management of Airfield Operations*; AFMAN 13-204V2, *Airfield Management*; AFMAN 13-204V3, *Air Traffic Control*; DAFMAN 13-204V4, *Radar, Airfield, and Weather Systems;* and Federal Aviation Administration Order (FAAO) Job Order (JO) 7110.65, *Air Traffic Control*. This instruction consolidates basic Air Traffic Control (ATC) procedures, base directives, and policies of the 8th Fighter Wing Commander (8 FW/CC) for safe and effective operation of ground and air traffic at Kunsan Air Base (AB) under normal and emergency conditions. It contains policies and procedures used by Kunsan AB Air Traffic Control Tower (ATCT), Radar Approach Control (RAPCON), Airfield Management Operations (AMOPS) and Radar, Airfield, and Weather Systems (RAWS) and is the source document for airfield and flying procedures found in AFMAN 11-2F-16V3, *F-16 Operations Procedures*. This instruction applies to all units and personnel (permanently assigned or temporary duty) operating at 8th Fighter Wing (8 FW), Kunsan AB, airspace, airfield and airfield facilities. Ensure all records generated as a result of processes prescribed in this publication adhere to Air Force Instruction (AFI) 33-322, Records Management and Information Governance Program and are disposed in accordance with (IAW) the Air Force Records Disposition Schedule which is located in the Air Force Records Information Management System. Refer recommended changes and questions about this publication to the office of primary responsibility (OPR) using the DAF Form 847, Recommendation for Change of Publication; route DAF Forms 847 from the field through the appropriate functional chain of command. The use of the name or mark of any specific manufacturer, commercial product, commodity, or service in this publication does not imply endorsement by the Air Force.

SUMMARY OF CHANGES

This document has been substantially revised and must be completely reviewed. Major changes include Air Traffic Control procedures, Unmanned Aircraft Systems (UAS) operations, Wolf Pack Airspace operations, Alternate Departure and Landing Surface (ADLS) procedures, Landing Zone Operations and airfield operational information and procedures. Minor changes were made throughout which include reference updates and editing errors.

Table of Contents

Chapter 1.	Administrative……..….	4
Chapter 2.	General Information ……..…	5
Chapter 3.	Aircraft Arresting Systems …….…..	31
Chapter 4.	Flight Planning Procedures …….……..….	35
Chapter 5.	Flying Areas ……..…	37
Chapter 6.	VFR Procedures ……..…..	43
Chapter 7.	IFR Procedures …….	52
Chapter 8.	Emergency Operations ……..…	53
Chapter 9.	Transient Aircraft Support ……...	68
Chapter 10.	Landing Zone Operations ……..…	73
Chapter 11.	Alternate Departure and Landing Surface Operations ……..…	76
Chapter 12.	Miscellaneous Procedures ……	90
Attachment 1	Glossary of References and Supporting Information ……...	108
Attachment 2	Taxi Flow and Barrier Locations …….	113
Attachment 3	Hot Pits …….	114
Attachment 4	VFR Entry Points …….	115
Attachment 5	VFR Re-Entry/Breakout Procedures ……..…	116
Attachment 6	Overhead/F-16 SFO Patterns/Controlled Bailout/Jettison Area ……	117
Attachment 7	Local Departure Transitions ……..….	118
Attachment 8	Local Climb-out ……..…	119
Attachment 9	Combat Departure Procedures ……...	120
Attachment 10	Korean Special use Airspace (SUA) ……..….	121
Attachment 11	Kunsan Airspace ……..…	123
Attachment 12	Adjacent Special Use Airspace ……...	124
Attachment 13	Minimum Vectoring Altitude (MVA) Chart ……...	125

Attachment 14	Minimum Altitude Chart (MIFRAC) ……..……..	126
Attachment 15	Airfield Diagram ……...…	127
Attachment 16	Alternate Departure and landing Surface (ADLS) Operations……..	128
Attachment 17	Kunsan AB Drop Zones …….....	129
Attachment 18	Wolf Pack Airspace ……..…	130
Attachment 19	Raws Equipment Wind Speed and Ice Accumulation Tolerances ……	131
Attachment 20	MQ-9 Emergency Mission with Lost Link Land Logic for RWY 18 …….	132
Attachment 21	MQ-9 Emergency Mission with Lost Link Land Logic for RWY 36 …….	133
Attachment 22	MOA Lost Link Procedures ……..	134
Attachment 23	MQ-9 SCA RWY 18 …….……	135
Attachment 24	MQ-9 SCA RWY 36 ……..…	136
Attachment 25	ADLS Operations Checklist ……..	137
Attachment 26	ADLS Operations Diagram …….……..	140

Chapter 1

ADMINISTRATIVE

1.1. Reproduction. Reproduction of this instruction in whole or in part is authorized to prepare supporting procedures only. Appendices and unit Critical Information lists can be reproduced and posted "FOR OFFICIAL USE ONLY" in unit read files.

1.2. Implementation. Commanders and supervisors are responsible for implementing the procedures of this instruction as they pertain to their assigned function. Many procedures contained herein task specific agencies for specific actions.

1.3. General Prudential Rule. The procedures and policies set forth herein are not intended to cover every contingency nor every rule of safety and good practice. Operations or procedures not specifically addressed may be accomplished if they enhance safe and effective mission accomplishment. The 8 FW/CC is the waiver authority for Kunsan specific procedures outlined in this document or as allowed via applicable AFIs.

1.3.1. The attachments provided in this instruction are designed to clarify the specific purpose of the referenced procedure and are not necessarily to scale.

1.4. Revisions. In accordance with (IAW) DAFMAN 13-204V1, this instruction will be reviewed annually. Any recommended changes should be sent to the 8th Operations Support Squadron (8 OSS), Airfield Operations Flight (AOF) Commander (8 OSS/OSA) Any revisions to this instruction may require revisions to aircrew publications and should be coordinated with Airfield Operations and the 8th Operations Group, Standardization and Evaluation (8 OG/OGV).

1.4.1. Procedural Changes Affecting Airfield Operations. IAW DAFMN13-204V1, changes to Airfield Operations may require a training period of up to 2 weeks from the effective date to enable safe and effective implementation. The AOF/CC will provide a recommended training period to the 8th Operations Group Commander (8 OG/CC) for any proposed changes.

Chapter 2

GENERAL INFORMATION

2.1. Hours of Operation. Hours of operation for 8 OSS/OSAR RAPCON, 8 OSS/OSAT ATCT, 8 OSS/OSAA AMOPS and 8 OSS/OSAM RAWS are 24 hours, 7 days a week.

2.2. Runway, Taxiways and Aprons. See **Attachment 15**.

2.2.1. Runway. Single, grooved concrete; 9,008 ft x 150 ft; magnetic bearing 176°/356°; designated 18/36. The runway shoulders are 25 ft concrete/asphalt.

2.2.2. Overruns.

2.2.2.1. Runway 18 (South End): 996 ft x 150 ft; first 151 ft is concrete, remaining portion is asphalt.

2.2.2.2. Runway 36 (North End): 991 ft x 150 ft; first 141 ft is concrete, remaining portion is asphalt.

2.2.3. Taxiways/Towways.

2.2.3.1. Alpha (A). Concrete (140 ft); 25 ft asphalt shoulders. Restricted to fighter-type aircraft with a wingspan of 43 ft or less (i.e. F-15, F-16, F-18, etc. [A-10 does not have sufficient wingtip clearance]) when arm/de-arm operations ongoing. To ensure the availability of Taxiway Alpha 1 for alert scrambles, narrow/wide-body aircraft shall taxi up to the Visual Flight Rules (VFR) Holdline or hold short of Taxiway Alpha 1 intersection on Taxiway Papa.

2.2.3.2. Alpha 1 (A1 – High Speed Taxiway): Concrete (75 ft). Restricted to fighter-type aircraft, no shoulders.

2.2.3.3. Bravo (B). Concrete (75 ft); 25 ft asphalt shoulders. No restrictions.

2.2.3.4. Charlie (C). The taxiway dimensions are 8,100 ft x 75 ft. Taxiway C serves as the Alternate Departure and Landing Surface (ADLS) to launch and recover aircraft if Runway 18/36 is rendered unusable and may be used during exercises, contingencies, emergencies and as deemed necessary by the 8 OG/CC. Chapter 11 of this regulation outlines operation of the ADLS.

2.2.3.4.1. Runway 18/36 to Taxiway Papa: Concrete (150 ft); no shoulders. When aircraft are parked on Overflows North or South, Taxiway Charlie is restricted to aircraft with a wingspan of 110 ft or less (i.e. fighter-type aircraft, C-12, B-737/100-500, etc.); restricted to aircraft with a wingspan of 140 ft or less (i.e. B-737/600-900, C-130, KC-135, etc.) when wing-walkers are utilized.

2.2.3.4.2. Taxiway Papa to North Loop Taxitrak: Concrete (75 ft); no shoulders. Restricted to 8 FW-based and sponsored fighter-type aircraft and helicopters. Deviations may be approved by the Airfield Manager (AFM).

2.2.3.4.3. North Loop Taxitrak to Taxiway Hotel: Concrete (75 ft); 10 ft asphalt shoulders. Restricted to 8 FW-based and sponsored fighter-type aircraft and helicopters. Deviations may be approved by the AFM.

2.2.3.5. Delta (D). Concrete (75 ft); 25 ft asphalt shoulders. No restrictions.

2.2.3.6. Echo (E). Concrete (250ft +); 25 ft asphalt shoulders. No restrictions.

2.2.3.7. Foxtrot (F). Concrete (50 ft); no shoulders. Restricted to 8 FW-based and sponsored fighter-type aircraft and helicopters. Deviations may be approved by the AFM.

2.2.3.8. Towway Golf (G). Asphalt (102 ft); (North Loop Taxitrak to B-2238); (75 ft) (B-2238 to Taxiway C); no shoulders. Restricted to tow operations and daytime Visual Meteorological Conditions (VMC) only due to absence of taxiway edge lights, unless otherwise approved by the AFM.

2.2.3.9. Hotel (H). Concrete (50 ft); no shoulders. Restricted to 8 FW-based/sponsored fighter-type aircraft and helicopters, unless otherwise approved by the AFM. Taxiway H can also be used as parking for helicopter operations.

2.2.3.10. Papa (P). Concrete (9,000 ft x 80 ft); Center 20ft Concrete; outer 20 ft Asphalt; 25 ft asphalt shoulders.

2.2.3.10.1. “A” to “B”: No restrictions.

2.2.3.10.2. **“**B” to “C”: No restrictions unless aircraft parked on Overflow South. If aircraft is parked on Overflow South, restricted to aircraft with a wingspan of 136 ft or less (i.e. fighter-type aircraft, C-12, C-130, B-737/100-900, B-757, KC-135); restricted to aircraft with a wingspan of 166 ft or less (i.e. E-3, KC-10, B-767, L-1011) when wing-walkers are utilized.

2.2.3.10.3. “C” to “D”: No restrictions unless aircraft parked on Overflow North. If aircraft is parked on Overflow North, restricted to aircraft with a wingspan of 136 ft or less (i.e. fighter-type aircraft, C-12, C-130, B-737/100-900, B-757, KC-135); restricted to aircraft with a wingspan of 166 ft or less (i.e. E-3, KC-10, B-767, L-1011) when wing-walkers are utilized.

2.2.3.10.4. “D” to “E”: Restricted to aircraft with a wingspan of 146 ft or less (i.e. C-130, KC-135, E-3, B-737, B-757); restricted to aircraft with a wingspan of 176 ft or less (i.e. C-17, KC-10, B-767, L-1011) when wing-walkers are utilized;

restricted to aircraft with a wingspan of 228 ft or less (i.e. C-5, E-4, B-747/100-800) when wing-walkers are utilized. Aircraft continuing to Gunsan Airport Terminal are restricted to a wingspan of 120 ft or less due to location of north End of Runway (EOR) shack, 85 ft east of Taxiway E.

2.2.3.10.5. "E" to Gunsan Airport Terminal: Asphalt (75 ft); 25 ft asphalt s houlders; restricted to aircraft with a wingspan of 120ft or less due to location of north EOR shack and security gate opening width.

2.2.3.11. Aprons. See Flight Information Publication AP3 for a detailed description of all apron weight and tire pressure restrictions.

2.2.3.11.1. Hot Cargo Pad. Concrete: 25 ft asphalt shoulders. All aircraft not locally assigned or sponsored by 8 FW must park on the north side of the apron to the maximum extent possible so that no part of the aircraft is south of the runway threshold. Aircraft with forward firing ordnance must park facing west. Perimeter fence (unlit) located 48 ft from west edge of apron. Republic of Korea Air Force (ROKAF) defensive fighting position (unlit) located 44 ft from west edge of apron. Primary parking location for all 1.1 and 1.2 hazardous cargo; 1.3 or 1.4 over Net Explosive Weight (N.E.W.) 10,000 lbs. Helicopter Forward Arming and Refueling Point (FARP) operations are allowed on Hot Cargo Pad.

2.2.3.11.1.1. 8 FW or a tenant unit will provide road guards for Air Mobility Command (AMC) and/or Tanker and Airlift Control Center (TACC) missions to protect vehicles and pedestrians from jet blast and hazardous operations on the Hot Cargo Pad. Any visiting unit not assigned to the 8 FW will be responsible for providing their own road guards during hazardous operations.

2.2.3.11.2. Transient Aircraft (TA) Pad: Concrete; no shoulders. Primary parking for transient and Distinguished Visitor (DV) aircraft. No apron lights; flood lights only.

2.2.3.11.3. Overflow North: Concrete: 50 ft asphalt shoulders. No apron or flood lights. All aircraft shall remain west and north of the taxilane markings (double dashed yellow line) located 93 ft from Taxiway C and Taxiway P centerlines.

2.2.3.11.4. Overflow South: Concrete: 50 ft asphalt shoulders. No apron or flood lights. All aircraft shall remain west and south of the taxilane markings (double dashed yellow line) located 93 ft from Taxiway C and Taxiway P centerlines.

2.2.3.11.5. Tree Area, Juvat Flows, Juvat Pad, Panton Flows and Wolf Pack Flows: Restricted to 8 FW-based/sponsored fighter-type aircraft, unless approved by the AFM. Any fighter type aircraft parking in these areas with a wingspan larger than the following criteria will require wingtip waiver approval from 8 FW/CC to park in any hardened facility. Contact the AFM a minimum of 90 days prior for waiver

coordination. The Tree Area is considered a closed portion of the airfield unless being actively used by aircraft. AMOPS will inspect the area at least once a month and daily if being actively used.

2.2.3.11.5.1. Tree area: 33 ft

2.2.3.11.5.2. Wolf Pack flows: 35 ft

2.2.3.11.5.3. Juvat/Panton Flows & Juvat Pad: 50 ft

2.2.3.11.6. Contingency Pad ("C" Pad): Concrete; no shoulders. No apron or flood lights. Restricted to 8 FW-based/sponsored fighter-type aircraft or as specified in 8 FW Base Support Plan. Coordinate parking of all aircraft through the AFM. Tow only for all fighter aircraft. Aircraft larger than F-15 (43 ft-wingspan) require a wingtip clearance waiver.

2.2.3.11.7. Wizard Apron: Concrete; 25 ft asphalt shoulders. Apron has 20 Hardened Aircraft Shelters (HASs) capable of supporting wingspans up to 44 ft. No apron lights, flood lights only.

2.3. Weight Bearing Waivers. The AFM is the delegated approval authority for transient aircraft requesting weight bearing waivers of up to 50% over allowed weight capacity.

2.4. Control of Ground Traffic in the Controlled Movement Area (CMA). The CMA encompasses the runway, overruns and any area within 100 ft of the runway and overruns (excluding perimeter road).

2.4.1. All vehicle/pedestrian traffic must maintain radio contact with ATCT Ground Control on the Tower or Crash Net while operating in the CMA. All vehicle/pedestrian traffic must receive specific approval prior to entering the CMA. Likewise, all personnel and vehicles must report and receive ATCT acknowledgment when departing the CMA. Personnel will monitor Ground Control on the Tower or Crash Nets while in the CMA.

2.4.2. If radio contact is lost, personnel should attempt to contact ATCT by calling 063-470-5800 via cellphone. If still unable to contact ATCT, personnel/equipment/vehicles shall exit the CMA by the most direct route (NOT crossing the runway), remain a safe distance outside the CMA and watch ATCT for light gun signals. Personnel will remain alert for ongoing aircraft operations. ATCT shall notify AMOPS to respond. ATCT shall flash runway/taxiway lights to alert personnel to exit the CMA in an emergency situation. Personnel should advise ATCT via DSN 782-5800 when outside the CMA.

2.4.3. Ramp Net. The Ramp Net is monitored by ATCT, however, if unable to contact ATCT on the Ramp Net, contact AMOPS and they will notify ATCT. The Ramp Net is for airfield-related operations and not for general communication.

2.5. Airfield Vehicle Operations. See DAFI13-213_8FWSUP, *Airfield Driving,* for specific procedures relating to the following areas.

2.5.1. Overview of AMOPS, individual unit and Commander Responsibilities for control of vehicle/pedestrian operations on the airfield.

2.5.1.1. Airfield driving requirements.

2.5.1.2. Agencies authorized Privately Owned Vehicle (POV) Passes.

2.5.1.3. Airfield driving violations and penalties.

2.5.1.4. Vehicle traffic procedures (to include addressing bicycle traffic, when applicable).

2.5.1.5. Vehicle call signs.

2.5.1.6. Emergency vehicle operations (fire and rescue, ambulance, security forces).

2.5.1.7. Airfield Construction/Work Crew/Maintenance Restrictions.

2.6. Airfield Lighting Systems. AMOPS processes all airfield lighting outages IAW AFMAN 13-204V2 and AFI Interservice Publication 11-208, *Department of Defense Notice to Air Missions (NOTAM) System*.

2.6.1. ATCT will operate the airfield lighting IAW FAAO JO 7110.65 and AFMAN 13-204V3. Airfield lighting is turned on, off and adjusted by ATCT based on time of day and visibility. When not needed for aircraft operations and in accordance with FAAO JO 7110.65, the airfield lights should be turned off for energy conservation. Personnel, agencies, or units requiring airfield lighting may coordinate real-time through AMOPS or ATCT.

2.6.2. The following airfield lighting systems are available at Kunsan Air Base:

2.6.2.1. Standard Type 1 Approach Lighting System with Sequenced Flashing Lights (ALSF-1). Runway 18/36 (3000 ft).

2.6.2.2. Precision Approach Path Indicators (PAPI). Glide slope angle is 3.0 degrees and coincides with the Precision Approach Radar (PAR)/glidepath and ILS/glideslope. Runway point of intercept: Runway 36: 944'. Runway 18: 936'.

2.6.2.3. Threshold and Runway End Lights.

2.6.2.4. High Intensity Runway Lights (HIRL). Five intensity settings are available and utilized based on visibility conditions.

2.6.2.5. Taxiway/Towway/Apron Lights. Taxiways A, B, C (Runway 18/36 to North Loop, east of Juvat Flows), D, E, F, North and South Loop, Wizard's Ramp and the Hot Cargo Pad have standard taxiway edge lighting. Towway G, Wolf Pack Flows, Panton Flows, Juvat Pad, Juvat Flows, Tree Area, Contingency Pad, Overflow North Apron, Overflow South Apron, Taxiway H, Taxiway C (east of Juvat Flows) and the Transient Pad do not have taxiway or apron lights.

2.6.2.6. Obstruction Lights.

2.6.3. AMOPS shall manage airfield lighting outages per standards of tolerance established in Air Force Flight Standards Agency (AFFSA) Lighting Chart, UFC 3-535-01, *Visual Air Navigation Facilities*, FAA Order 6850.5, *Maintenance of Lighted Navigational Aids* and FAA Advisory Circular 150/5340-26, *Maintenance of Airport Visual Aid Facilities* Appendix A and issue a NOTAM as required IAW AFI 11-208. Lighting outages will be e-mailed to Airfield Lighting and reported to the CES Service Call Desk during duty hours and to the Fire Department after duty hours. Emergency service requests will be reported immediately and actions taken IAW AFFSA's Airfield Lighting Chart.

2.6.4. Anytime an outage exceeds standards of tolerance, AMOPS will notify the AFM or Deputy Airfield Manager (DAFM), ATCT (who will notify 8 OG/SOF as applicable) and RAPCON. ATCT shall inform arriving aircraft of any approach lighting problems. AMOPS will coordinate to have the affected lighting system turned off and related pavement area closed as necessary unless 8 FW/CC, or delegated authority IAW AFMAN13-204v2 2.3.2.6., waives the requirement and approves continued use of the affected lighting system IAW AFFSA Lighting Chart.

2.6.5. Rotating Beacon. The rotating beacon will be on between sunset and sunrise or anytime airfield weather is below 1,000 ft ceiling and/or 3SM (4800M) visibility.

2.6.6. Inspection Policy/Procedures.

2.6.6.1. Airfield Lighting shall:

2.6.6.1.1. Inspect the airfield lighting system daily, compare to standards published in Unified Facilities Criteria (UFC) 3-535-01, including the full length of approach lighting systems and will report any problems to AMOPS immediately. Inspection of full-length approach lighting systems during inclement weather will be subject to safety considerations based on risk to personnel.

2.6.6.1.2. Provide AMOPS estimated outage durations and advise when systems are returned to service.

2.6.6.1.3. Coordinate with AMOPS prior to beginning any maintenance activity and notify them once maintenance is completed.

2.6.6.1.4. Stock at least 5% of airfield lights/lighting fixtures and long-lead order

items integral to the operation of these systems. Advise the AFM when parts stock is critically low (at or below 2%) or when depleted.

2.6.6.1.5. Stock at least three windsocks and replace unserviceable windsocks as soon as possible, but no later than (NLT) eight (8) hours after receiving windsock unserviceable report. Stock should be increased to six (6) before the end of each fiscal year to ensure availability during fiscal year transition.

2.6.6.1.6. Respond immediately to emergency lighting outages and provide estimated repair time.

2.6.6.1.7. Perform daily (or as needed) lighting repairs according to AMOPS provided outage reports.

2.6.7. Runway Lighting Failure. If the runway lights fail when required or exceed allowable outages:

2.6.7.1. ATCT or AMOPS shall suspend runway operations, notify 8 FW/SOF, RAPCON and AMOPS. During periods of 8 FW/ROKAF flying, ATCT shall broadcast on Guard that runway lights are out of service.

2.6.7.2. AMOPS shall submit required NOTAMs and notify 8th Fighter Wing Command Post
(8 FW/CP), Airfield Lighting, transient aircrews planning for departure and 8th Civil Engineer Squadron (8 CES) Customer Service at 782-5313.

2.6.7.2.1. If unable to restore runway lighting, AMOPS shall close the runway and Airfield Lighting shall set up the Emergency Airfield Lighting System (EALS). Installation may take up to 10 hours.

2.7. Parking Plan/Restrictions.

2.7.1. AMOPS shall:

2.7.1.1. Provide Transient Alert (TA) the next day's Prior Permission Required (PPR) Log daily.

2.7.1.2. Coordinate with TA to de-conflict aircraft parking plan priorities and airfield activities.

2.7.1.3. Validate, determine and coordinate Kunsan airfield parking plans. Publish airfield and aircraft operations and parking restriction updates to Area Planning 3 (AP3). Approve daily and contingency parking plans and update, as necessary, the Kunsan AB Base Support Plan.

2.7.2. Maintenance Operations Control Center (MOCC) and TA shall coordinate with AMOPS before parking aircraft outside any HAS, to include training (i.e. egress training, crash/recovery, static displays). AMOPS coordination is not required if aircraft will be parked outside of a HAS during the flying window (i.e. in-between sorties).

2.8. Aircraft Special Operations Areas/Ramps.

2.8.1. Arm/De-Arm Areas. Taxi lines and "half-moons" painted on south side of Taxiway Alpha and the north side of Taxiway E.

2.8.2. Engine Run-up Areas.

2.8.2.1. 8 FW-assigned aircraft will utilize the hush-house and hangars on Towway Golf, trim pads located on the Juvat Flows and the Panton Flows. Other 8 FW-sponsored aircraft may coordinate to utilize 8 FW engine run areas through MOCC. Engine runs will not be performed that will cause jet blast directly toward a taxiway unless approved by AMOPS.

2.8.2.2. ROKAF 38 FG F-16s utilize the ROKAF Pad HAS. ROKAF may not perform engine runs that create jet blast towards Taxiway P unless approved by AMOPS. 8 FW Maintenance Group personnel shall serve as escort for ROKAF aircraft utilizing Trim Pads within the Loop Restricted Area after coordination with ATCT and 8th Security Forces Squadron (8 SFS).

2.8.2.3. Engine runs, other than for normal pre-taxi engine start, or pre-departure thrust requirements, must be approved by the AFM or designated representative on any taxiway, the runway, Hazardous Cargo Apron, TA Apron and North or South Overflows. Engine run maintenance is not allowed in the Wolf Pack Flows, Contingency Pad, or any active taxiway except during contingency operations.

2.8.3. Hot Pit Refueling Areas. 8 FW and sponsored unit fighter aircraft only. Adjacent to both Taxiway P (Wolf Pack Flows) and Taxiway C (Panton Flows/Juvat Flows). Overflow North and South aprons can be used for hot pits via fuel truck, see **Attachment 3**. **Note:** For non-base assigned aircraft, refer to Hot Pit Refueling Site Certification Letter of Agreements (LOA).

2.8.4. Radar Warning Receiver (RWR)/ Radar Threat Warning System (RTWS) Checks. RWR and RTWS checks are accomplished on Taxiway P prior to the EOR or on Taxiway C east of James Avenue to avoid excessive delays to traffic on James Avenue. During exercises or contingency operations, a "Last Look" check is accomplished simultaneously while aircraft are stopped. MOCC or responsible maintenance unit will advise AMOPS one hour prior to RWR pit setup. AMOPS will coordinate and publish taxiway restrictions for non-participating aircraft. Wing Airfield Driving Program Manager, or designated representative, will notify unit program managers for vehicle operation limitations.

2.8.5. Drag Chute Jettison Areas. EORs Alpha and Echo are designated for drag chute jettison. TA (USAF aircraft) or ROKAF Maintenance personnel (ROKAF aircraft) will collect drag chutes as expeditiously as possible to prevent operational delays. AMOPS will conduct a Foreign Object Damage (FOD) check upon confirmation of drag chute removal.

2.9. Aircraft Towing Procedures.

2.9.1. 8 FW Tows. MOCC shall notify ATCT and 8 SFS of all tows, to include tail number, starting point and destination. When an aircraft tow must enter or cross any taxiway or the CMA, tow crews shall maintain two-way radio communication with ATCT, watch ATCT for light gun signals and give way to taxiing aircraft. Tows shall not enter the CMA or cross the runway without ATCT approval. Aircraft tows that do not occur within the CMA or any taxiway do not require two-way radio communication between tow crews and ATCT.

2.9.2. ROKAF 38 Fighter Group (FG) Tows. 38 FG/CP shall pre-coordinate with ATCT prior to initiating. Wing walkers and tail spotter shall carry illuminated wands. Tows shall not enter the CMA or cross runway without ATCT approval.

2.10. Aircraft Taxiing Requirements/Routes/Unauthorized Movements. See **Attachment 2**, Taxi Flow and Barrier Locations.

2.10.1. Departures.

2.10.1.1. Prior to taxi, aircraft shall request any flight plan changes with AMOPS via Pilot to Dispatch. Aircraft requesting combat departure will coordinate with Ground Control (GC).

2.10.1.2. Aircraft shall request taxi from GC, stating number in flight (as fragged), current position, current ATIS code, advise of any flight members not taxiing with the flight and combat departure if requested.

2.10.1.3. If necessary for completion of pre-flight procedures, aircraft may reposition in the loops and on Taxiway C in front of the flows without contacting GC. Aircraft shall not taxi past the intersection of Towway G and Taxiway C without GC approval.

2.10.1.4. For suspected unauthorized movement, ATCT should attempt to contact aircraft on all available frequencies. ATCT shall activate the Primary Crash Alarm System (PCAS) and immediately contact 8 SFS if contact cannot be established with the unauthorized aircraft movement.

2.10.1.5. Taxiing aircraft shall yield to alert scrambles, aircraft must avoid blocking runway access from the ROKAF alert pad (Taxiway A1).

2.10.1.6. Aircraft shall taxi IAW **Attachment 2**. Aircraft shall request approval for deviations with GC. Aircraft taxiing from the South Loop Taxi-track shall give way to aircraft taxiing west on Taxiway C. GC shall advise of any further restrictions.

2.10.2. Arrivals.

2.10.2.1. All aircraft not de-arming at the EOR may exit the runway at the nearest taxiway. Aircraft will exit the runway, hold position and contact GC for taxi instructions.

2.10.3. Heavy Aircraft Jet Thrust Avoidance. Heavy aircraft will utilize reverse thrust on the inboard engines only, to the maximum extent possible, to prevent the introduction of FOD on the airfield. All smaller aircraft, vehicles and personnel will avoid passing within 200 ft behind heavy aircraft with engines running to avoid jet blast. Heavy aircraft may only enter/exit the runway via Taxiways Bravo and Delta.

2.11. Runway Selection Procedures.

2.11.1. 8 OG/CC has determined it is operationally advantageous to use Runway 36 as the primary runway when there is a tailwind component of 10 kts or less. Runway 36 is also the primary instrument/calm wind runway. When the 8 FW Supervisor of Flying (8 FW/SOF) is on duty, ATCT Watch Supervisor (WS) determines the active runway with input from the Supervisor of Flying (SOF). At all other times, ATCT WS will select the active runway. EXCEPTION: If live ordnance (forward firing munitions or bombs) are scheduled for the day and the tailwind component Takeoff and Landing Data (TOLD) allows, select Runway 18 to minimize taxi distance to the hot cargo pad for aircraft with hung ordinance.

2.11.2. ATCT shall coordinate with 8 FW/SOF (if manned) or Liaison (during periods of ROKAF flying) and RAPCON prior to initiating a runway change. Notify AMOPS, Fire and Weather of the runway change.

2.11.3. ATCT and RAPCON shall broadcast runway change information on all appropriate frequencies. Include transmission on emergency frequencies during 8 FW/ROKAF flying.

2.11.4. AMOPS shall make notifications IAW established checklists.

2.11.5. Barrier Maintenance shall notify AMOPS and ATCT prior to barrier reconfiguration and when configuration following runway change is complete. Runway operations are suspended during the barrier change process and shall resume only after AMOPS performs a post-configuration runway inspection. AMOPS will advise ATCT when runway operations may be resumed.

2.11.6. Complete aircraft arresting systems reconfiguration during runway changes takes approximately 1 to 1.5 hours.

2.12. Procedures/Requirements for Conducting Runway Inspections/Checks.

2.12.1. AMOPS performs daily airfield inspection and checks IAW AFMAN 13-204V2. AMOPS shall notify the AFM and AOF/CC when a reported discrepancy is a hazard

requiring immediate corrective action. Special attention will be given to the following areas:

2.12.1.1. General airfield condition.

2.12.1.2. General condition and operational status of aircraft arresting systems.

2.12.1.3. All aprons, taxiways and the runway for debris or other material that constitutes a hazard to aircraft movement.

2.12.1.4. Bird/Wildlife Aircraft Strike Hazard (BASH)/habitat control, ponding etc.

2.12.2. AMOPS shall conduct a runway FOD check following all In-Flight Emergencies (IFE). The SOF may waive FOD check for emergencies that do not involve the likelihood of fluid, parts, or debris release hazards when necessary to safely recover 8 FW aircraft only. SOF may not waive FOD checks for non-8 FW aircraft (i.e. Gunsan Airport traffic).

2.12.3. AMOPS shall conduct a runway check following a landing or departure of heavy aircraft. AMOPS will conduct a check after any heavy/wide-body aircraft makes a 180-degree or greater turn on the runway due to the potential of FOD.

2.12.3.1. AMOPS may be required to conduct a FOD and barrier check following the departure of 737 aircraft depending on barrier configuration. This will be required when barriers are configured IAW Chapter 3 of this regulation.

2.12.4. AMOPS will increase the frequency of airfield checks during rapidly changing runway conditions to provide the most current Runway Surface Condition/Runway Condition Reading (RSC/RCR). The AFM will determine necessary frequency based on real-time conditions.

2.13. Runway Surface Condition/Runway Condition Reading Values.

2.13.1. AMOPS determines and reports surface conditions, condition readings and changes to reportable conditions IAW AFMAN 13-204V2 and Technical Order (T.O.) 33-1-23, *Equipment Procedures for Obtaining Runway Condition Readings.* Surface condition and condition readings are reported for all airfield pavements. AMOPS will notify 8 FW/SOF or 8 OG/CC when RCR readings are less than 10. AMOPS will temporarily suspend or close runway, taxiway or apron operations when unsafe conditions exist. AMOPS will conduct periodic checks of the airfield as conditions change and/or improve. AMOPS will report updates as necessary.

2.13.2. Reporting Runway Surface Condition (RSC).

2.13.2.1. Wet Runway: A wet runway is reported as WR//, indicating discernible moisture on the runway. When water is the only form of moisture, a Runway Condition Reading (RCR) is not reported or reportable.

2.13.2.2. Slush on Runway: A slush-covered runway is reported as SLR//, indicating slush, but no ice or snow is present on the runway. When slush is the only surface condition, an RCR is not reported or reportable.

2.13.2.3. Ice or Snow on Runway: Ice or snow on the runway is reported as IR/LSR/PSR. The predominant surface condition and associated condition reading will be reported.

2.13.2.3.1. IR - Ice on Runway.

2.13.2.3.1. LSR - Loose Snow on Runway.

2.13.2.3.3. PSR - Packed Snow on Runway.

2.13.2.4. Refer to AFMAN 13-204V2 for other RSC and RCR conditions, Water or Slush and Ice on Runway and Runway Partially Covered with Ice or Snow.

2.13.3. Reporting RCR.

2.13.3.1. ATCT shall report the most current RSC and RCR information received from AMOPS prior to issuing taxi, takeoff or landing clearance. It is reported as a three-letter condition code and two-digit number from 01 (worst) to 26 (best). Use "RCRNR" when RCR information is unavailable. ATCT will provide International Civil Aviation Organization (ICAO) equivalent braking action (Good, Good to Medium, Medium, Medium to Poor, Poor and Nil) to any civilian aircraft as applicable.

2.13.3.2. Minimum RCR for 8 FW F-16 take-offs, landings or taxi is 10. ROKAF Alert KF-16s require a minimum RCR of 12 while normal ROKAF operations require a minimum of 18. For all other aircraft, minimum RCR requirements are determined by aircraft technical order and owning command policy.

2.14. Engine Test/Run-Up Procedures.

2.14.1. Crew chiefs shall request engine runs through MOCC, who shall verify crew chief qualification and notify ATCT of proposed engine run time, parking location and tail number.

2.14.2. Crew chiefs shall request approval from ATCT prior to real-time engine start, monitor the appropriate Ground Control frequency and notify ATCT upon termination.

2.14.3. Engine runs, performed in accordance with facility design standards, maintenance job guides, maximum engine thrust versus anchor device capabilities and quiet hours policy, may be automatically approved for the following locations:

2.14.3.1. North Loop HAS 2400 through 2414.

2.14.3.2. South Loop HAS 2415 through 2443.

2.14.3.3. Juvat Flows 2444 through 2453.

2.14.3.4. Panton Flows 1A through 8B.

2.14.3.5. Taxiway C (East) Trim Pads.

2.14.3.6. Towway G Hush House Building 2238 (Tie-down anchor rated to 51,320 load pounds).

2.14.3.7. Towway G Hush House Building 2244 (Tie-down anchor rated to 54,700 load pounds).

2.14.3.8. Towway G Maintenance Hangars.

2.14.3.9. Tree Area HAS's 2912 through 2924.

2.14.3.10. ROKAF Pad HAS's 5061 through 5068.

2.14.3.11. ROKAF Alert HAS's.

2.14.3.12. Wizard's Apron HAS with advanced coordination with AFM and MXG.

2.15. Kunsan Civil Airport Gate Operations.

2.15.1. RAPCON shall notify ATCT as soon as possible after taking hand-off of inbound commercial aircraft or after issuing clearance to departing commercial aircraft.

2.15.2. ATCT shall:

2.15.2.1. Coordinate with 8 SFS LE desk as soon as possible via SFS direct line of impending arrival/departure.

2.15.2.2. Open gate only after confirming security forces are in-place.

2.15.2.3. Close gate only after pilot has reported aircraft is clear of the gate. ATCT will close the gate while aircraft is staged at the Gunsan City Airport (GCA) terminal.

2.15.3. 8 SFS LE Desk shall:

2.15.3.1. Dispatch patrol officer to gate within 10 minutes of notification.

2.15.3.2. Advise 8 OSS/OSAT via direct line when in-place and shall remain in-

place until the Gate is closed and secured.

2.16. Noise Abatement Procedures.

2.16.1. Aircraft are prohibited from flying below 3,000 ft Above Ground Level (AGL) over the small islands that form the Gogunsan-Gundo Island Group. The center of this island group is located at N 35.50.000/E 126.24.000 (located approximately 12 miles southwest of the field).

2.16.2. Aircraft should avoid over-flying the commercial terminal NE of Runway 36 departure end and ROKAF housing area.

2.17. Quiet Hours.

2.17.1. IAW AFPD 11-2, *Aircrew Operations* and applies to all units assigned to 8 FW, as well as units assigned, attached, or supported by Kunsan AB, ROK. There are two types of official quiet hours, full and partial. As applicable, civilian aircraft are exempt from quiet hours. Recurring ROK-wide quiet hours for school testing are published via Air Advisory (AIRAD) by 607 Air Operations Center (AOC) Airspace Operations.

2.17.2. Full Quiet Hours. Takeoffs, landings, low approaches, touch and goes, stop and goes, engine runs, turbine powered Aerospace Ground Equipment (AGE) runs and taxiing anywhere on the airfield are prohibited. Full quiet hours are usually reserved for Change of Command ceremonies of colonels and higher or approved wing events.

2.17.3. Partial Quiet Hours. All low approaches, touch and goes and, stop and goes are prohibited. Engine runs, turbine powered AGE runs and taxiing on the airfield is limited for departing and arriving aircraft only. Landings must be full stop via straight-in approach.

2.17.4. Approving authority for all quiet hours/waivers is 8 OG/CC.

2.17.5. Quiet Hour Scheduling. Quiet hours shall be requested through Wing Scheduling (8 OSS/OSO), Current Ops, NLT **2 weeks** prior to the event. 8 OSS/OSO will forward the request along with impact on projected 8 FW, ROKAF and transient operations to 8 OSS Director of Operations (8 OSS/DO) for approval coordination. 8 OSS/OSO will notify the requestor of approval/denial and will notify 8 OSS/OSA for NOTAM publishing.

2.17.6. Unofficial Quiet Hours. Kunsan has an unofficial quiet hour agreement with the city of Gunsan for the hours of 2300L to 0600L. AMOPS shall notify Public Affairs of any non-base assigned aircraft requesting a departure or arrival during these hours. Public Affairs will pass the information to the Gunsan Mayor's Office as necessary.

2.18. Ground Support Equipment.

2.18.1. Mobile ground support equipment may be located on aprons but must be positioned to provide minimum wingtip clearance distances for all aircraft other than those being

serviced with the equipment.

2.18.1.1. Examples of ground support equipment exempt under this category are aerospace ground equipment, electrical carts, forklifts, tow bar trailers, fire extinguisher carts, material-handling equipment, flightline maintenance stands, stair trucks and portable floodlights. Similar equipment may be included in this category.

2.18.2. When such equipment is not in use, it must be removed from the aircraft parking area and stored at the AGE Yard ready-line or approved AGE sub-pool location. AGE sub-pool locations are defined by a 4- or 6-inch solid white line (non-reflective). On aprons, these areas appear as boxes; on non-aircraft pavements adjacent to aprons, they appear as a solid white line.

2.18.3. Support equipment shall not be positioned earlier than three hours prior to an aircraft arrival and shall be removed no later than three hours after aircraft departure IAW UFC 3-260-01, *Airfield and Heliport Planning and Design*.

2.19. Procedures for Opening/Closing/Suspending/Resuming Runway Operations.

2.19.1. ATCT, 8 FW/SE, 8 OG/CC, 8 FW/SOF, or AMOPS will suspend runway operations when there is reason to believe a hazard exists on/near the runway or in the immediate approach area. Only AMOPS can open/resume runway/taxiway operations.

2.19.2. Runway operations are automatically suspended when an aircraft shuts down on the runway.

2.19.3. Any preplanned or scheduled activity that will interfere with or close runway operations will be coordinated through AOF/CC and approved by 8 OG/CC.

2.19.4. As required, AMOPS will complete a check on the suspended/closed area prior to resuming operations.

2.20. Airfield Maintenance.

2.20.1. Pavement Repair. AMOPS will coordinate repair with 8 CES Heavy (8 CES/CEOHP) when any portion of the airfield pavement presents an unsafe condition (i.e. spalls, cracks, holes, etc.). AMOPS will suspend/close affected areas as required until the condition has been rectified. AMOPS in conjunction with CE will determine the severity of the pavement condition and if emergency/immediate repair is required. AMOPS will coordinate with all airfield users if conditions require alternate routes to be established.

2.20.2. Grass Mowing.

2.20.2.1. 8 CES/CEOHP shall report to AMOPS and coordinate mowing activities prior to commencing mowing operations.

2.20.2.2. Mowers shall maintain vegetation IAW DAFI 91-202, *The Department of the Air Force Mishap Prevention Program* and 8FW OPLAN 91-212, *Bird/Wildlife Aircraft Strike Hazard (BASH) Plan*. A 7”-14” grass height will be maintained except immediately around taxiway edge lights (3”-5”) and airfield signs (no taller than 6”).

2.20.2.3. AMOPS coordinates and publishes all restrictions and NOTAMs related to mowing operations, as needed.

2.20.2.4. 8 CES/CEO shall maintain a CE airfield maintenance team to perform required maintenance and repair activities and monitor pavement deterioration.

2.20.3. Sweeper and FOD Control Responsibilities.

2.20.3.1. Heavy Repair Superintendent (8 CES/CEOH) shall:

2.20.3.1.1. Implement this guidance.

2.20.3.1.2. Ensure all sweeper operators are properly trained.

2.20.3.1.3. Ensure all airfield obstructions are clearly marked to mitigate safety risks.

2.20.3.2. AFM or designated representative shall:

2.20.3.2.1. Ensure areas are swept in order of priority. AMOPS may modify priority for mission requirements.

2.20.3.2.2. Implement priority changes as the airfield mission dictates.

2.20.3.2.3. Complete appropriate airfield inspections and checks prior to the start of flying activities and as necessary thereafter.

2.20.3.2.4. Direct runway/taxiways to be swept after snow removal.

2.20.3.2.5. Conduct suitability checks after sweeping operations or as the mission dictates. Inform ATCT when pavement areas are suitable or unsuitable for aircraft operations.

2.20.3.2.6. Inform sweeper of active EOR area and provide a prioritized list of aircraft shelters requiring attention, as necessary.

2.20.3.2.7. Log and report FOD to Wing FOD Manager.

2.20.3.3. 8 FW/SEF shall conduct an airfield FOD inspection, ending no later than 30 min before the first scheduled takeoff and forward an inspection report to AMOPS for reprioritizing sweeper areas.

2.20.4. Airfield Sweeper Operations.

2.20.4.1. During normal wing flying days, the airfield sweeper must physically check in with AMOPS to determine airfield sweeping priorities. Airfield sweeper shall be available from 0700L or three hours before first scheduled day or night flying, whichever is earlier, until flying is complete. The stand-by sweeper shall handle any other requirements per AMOPS.

2.20.4.2. AMOPS supervisor and airfield sweepers shall coordinate extensively throughout the day to ensure all areas are effectively swept. Airfield Sweeper shall inform AMOPS anytime they arrive and/or depart the airfield.

2.20.4.3. Coordinate all sweeper requests through AMOPS to prevent redundant tasking.

2.20.5. Airfield Sweeper Priorities.

2.20.5.1. Priority 1 Areas: To be swept between 1.5 hours – 30 minutes prior to 8 FW day/night takeoffs. AMOPS and sweeper shall alternately inspect these areas during 8 FW flying.

2.20.5.1.1. Runway.

2.20.5.1.2. Taxiway C from eastern-most portion of restricted area to runway.

2.20.5.1.3. North/South loops.

2.20.5.1.4. PANTON/JUVAT flows.

2.20.5.1.5. Taxiway F.

2.20.5.1.6. Hot Cargo Pad.

2.20.5.2. Priority 2 Areas: Started at 0700L daily or no later than three hours before the start of any scheduled day/night flying.

2.20.5.2.1. High-speed taxiway.

2.20.5.2.2. Taxiways P, A and E (including arm/de-arm pads).

2.20.5.2.3. Airfield access control and debris check points.

2.20.5.3. Priority 3 Areas: Swept at least once a day.

2.20.5.3.1. Wolf Pack Flows.

2.20.5.3.2. Overflow North/South.

2.20.5.3.3. TA pad.

2.20.5.3.4. Taxiway P (prior to first arrival) between Taxiway E and GCA gate.

2.20.5.3.5. Taxiways B, D and G.

2.20.5.4. Priority 4 Areas: Swept a minimum of once a week.

2.20.5.4.1. C Pad. (Upgraded to Priority 3 when aircraft are present).

2.20.5.4.2. Taxiway H and Taxiway C (East of restricted area).

2.20.5.4.3. Tree area: In the event of a Slammer Recall, Slammer Super shall notify AMOPS to have the tree area cleared immediately. When alert aircraft are present, the tree area is upgraded to Priority 1.

2.20.5.4.4. Wizard Apron. (Upgraded to Priority 3 when aircraft are present).

2.20.5.4.5. AMOPS, based on safety, effectiveness, or mission need, may override above priorities.

2.21. Wear of Hats. All airfield and flightline areas are no-hat areas to include designated object and debris-controlled areas. For further guidance, refer to the 8 FW Community Standards.

2.22. Flightline Smoking Policy. IAW 8 FWI 32-2001, *Fire Prevention Program,* smoking, striking matches and using mechanical lighters are not permitted within 50 ft of hangars, aircraft, repair docks, paint shops, Liquid Oxygen carts, refueling vehicles, flammable storage cabinets or flammable storage buildings. Additionally, smoking is not permitted within 100 ft of compressed gas cylinder storage areas, fuel pump houses, dispensing areas or munitions storage and handling areas or other similar hazardous locations.

2.23. Navigational Aids (NAVAIDs).

2.23.1. Very High Frequency (VHF) Omni-directional Range and Tactical Air Navigation (VORTAC): VOR: 112.8; Tactical Air Navigation (TACAN): CH 75. The VORTAC is located 7,117 ft north of Runway 36 threshold and 859 ft west of centerline.

2.23.2. Instrument Landing System (ILS): Category I; Runway 18/36.

2.23.3. PAR: The MPN-14K is located 3,703.6 ft north of Runway 36 threshold and 475.87 ft west of centerline. (Belongs to ROKAF)

2.23.4. Digital Airport Surveillance Radar (DASR): The Airport Surveillance Radar (ASR)-11/GPN-30 is located 5,519 ft north of Runway 36 threshold and 747 ft west of centerline.

2.23.5. Preventive Maintenance Inspection (PMI) Schedule: Maintenance personnel shall not perform unscheduled PMIs or take NAVAIDs offline without prior approval from AOF/CC and RAPCON Watch Supervisor. RAPCON Watch Supervisors will not release NAVAIDS when there is current or forecasted weather minimums of less than 3,000 ft ceiling and/or 5SM (8000M) visibility.

2.23.6. PMIs will be performed during the following local times:

2.23.6.1. DASR:	Monday - Friday	2300 – 0600L
	Saturday/Sunday	0600 – 1000L
2.23.6.2. ILS:	Monday - Friday	0200 – 0700L
	Saturday/Sunday	0600 – 1000L
2.23.6.3. TACAN:	Monday - Friday	0200 – 0700L
	Saturday/Sunday	0600 – 1000L
2.23.6.4. VOR:	Monday - Friday	0200 – 0700L
	Saturday/Sunday	0600 – 1000L
2.23.6.5. UHF/VHF Radios:	Monday - Friday	0400 – 0700L
	Saturday/Sunday	0600 – 1000L
2.23.6.6. STARS:	Monday - Friday	2300 – 0600L
	Saturday/Sunday	0600 – 1000L
2.23.6.7. ETVS:	Monday - Friday	0400 – 0700L
	Saturday/Sunday	0600 – 1000L
2.23.6.8. NVR:	Monday - Friday	0400 – 0700L
	Saturday/Sunday	0600 – 1000L

2.23.6.9 PMI's performed outside of these times must be approved by the 8 OG/CC

2.23.7. All voice communication between ATCT, RAPCON and RAWS Maintenance regarding RAWS status, downtime requests, equipment release and return and final downtime approval will be made over the recorded line 782-4827 (RAPCON) or 782-5800 (ATCT).

2.23.8. Watch Supervisor will ensure PMIs do not interfere with wing flying by advising RAWS Maintenance when flying is scheduled to start. NAVAIDs/equipment released for PMIs shall be operational no later than 30 minutes before the first scheduled takeoff.

Multiple systems may be released for PMIs if it does not interfere with the base's flying mission and will be at the Watch Supervisor's discretion.

2.23.9. The RAPCON will notify RAWS Maintenance when wind speeds are forecasted to reach 70 knots or greater, in accordance with **Attachment 20**. RAWS technicians will implement the high wind preparation procedures for the DASR where the antenna must be stopped and allowed to freewheel with the wind to minimize damage.

2.23.10. Back-Up Power. All NAVAIDs have back-up generator power. Additionally, the VORTAC, DASR, Next Generation Weather Radar (NEXRAD), ILS 36 and ILS 18 are on Uninterrupted Power Supplies (UPS).

2.23.11. Maintenance personnel must receive RAPCON Watch Supervisor approval prior to transferring NAVAIDs from commercial to generator power.

2.23.12. Notify AMOPS of all scheduled and/or non-scheduled NAVAID outages for NOTAM purposes.

2.24. RAWS Equipment Outage Categories.

2.24.1. RED status outages: Equipment outages that do not have a fully operational back-up available, are mission essential, or will jeopardize the safety of personnel or aircraft.

2.24.2. AMBER status outages: Equipment outages that have a fully operational back-up available or an outage that is that does not warrant immediate response but should be corrected the next duty day.

2.24.2.1. For dual-transmitter NAVAIDs, the loss of one transmitter will result in an "AMBER" condition.

2.25. RAWS Equipment Restoral Priorities.

2.25.1. RAWS Maintenance shall restore "RED" and "AMBER" outages by order of priority in accordance with this document. If "AMBER" outages occur on high priority equipment while lower priority equipment is "RED," or when jobs assigned to different work centers require the same maintenance resources (i.e., test equipment, parts, personnel, etc.), the RAWS Maintenance NCOIC will coordinate with AOF/CC for restoral prioritization.

2.25.2. RAWS restoral priorities are subject to change depending on flying conditions, weather, or at the Chief Controller's (CCTLR) discretion.

2.25.3. RAWS technicians will respond to outages will be IAW Table 2.1.

Table 2.1. RAWS Technician Response Times

RESPONSE TIMES			
PRIORITY	DUTY HRS	NON-DUTY HRS	REQUIREMENTS
Red Outages	30 minutes	1 hour	24-hr maintenance required unless otherwise authorized by the user.
Amber Outages	1 hour	As determined by the user.	Maintenance may be deferred after1600 hours with user approval.

2.25.3.1. Unless directed otherwise by AOF/CC, RAWS Restoral Priorities will be IAW Table 2.2.

Table 2.2. RAWS Equipment Restoral Priorities

SYSTEM	EQUIPMENT	LOCATION	USER	Priority
Full Service (STARS)	FSQ-204	RAPCON	8 OSS/OSAR	RED
DASR – Primary Radar	GPN-30	BLDG 2031	8 OSS/OSAR	RED
DASR – Secondary Radar	GPN-30	BLDG 2031	8 OSS/OSAR	RED
Primary Crash Alarm System	PCAS	Tower	8 OSS/OSAT	RED
NEXRAD	WSR-88D	BLDG 494	8 OSS/OSW	RED
Control Tower Recorder	NVR	Tower	8 OSS/OSAT	RED
RAPCON Recorder	NVR	RAPCON	8 OSS/OSAR	RED
FMQ-19	FMQ-19	WX Station/Airfield	8 OSS/OSW	RED
Tower Display Workstation (TDW)	FSQ-204	Tower	8 OSS/OSAT	RED
UHF/VHF/Multi-Channel Radios	CM300/350	GATR/RAPCON/Tower	8 OSS/OSA	AMBER
Tower ETVS*	FSC-127	Tower	8 OSS/OSAT	AMBER
RAPCON ETVS*	FSC-127	RAPCON	8 OSS/OSAR	AMBER

* The ETVS is a priority RED if all workstations are inoperative in the ATCT or RAPCON

2.25.3.2. If there are multiple UHF/VHF radio outages, RAWS technicians will coordinate with the Watch Supervisor to determine the restoration priorities.

2.26. Protecting Precision Approach Critical Areas/Precision Obstacle Free Zone (POFZ).

2.26.1. Kunsan AB has a Category (CAT) I ILS requiring protection of the precision approach critical area. Physical protection of the ILS critical areas is required when the ceiling is reported less than 800 feet and/or less than 2 miles visibility. Precision approach critical area protection is not required when aircraft conduct a PAR.

2.26.2**.** When the weather is reported with a ceiling less than ***800 feet and/or the visibility is less than 2 miles, but at or above 200 feet and/or visibility at or above 1/2 mile*** (Runway Visual Range (RVR) 2,400) the ATCT shall:

2.26.2.1. Implement the following ILS critical area and POFZ protection procedures:

2.26.2.1.1. Inform AMOPS that precision approach critical area/POFZ protection procedures are required for the active runway.

2.26.2.1.1.1. AMOPS will expeditiously conduct a physical sweep of the ILS critical areas (north and south) and the POFZ on the airfield to ensure no aircraft, vehicles, or pedestrians are operating within these areas.

2.26.2.1.1.2. AMOPs will broadcast on the Ramp Net to contact ATCT for entry into the critical areas when precision approach critical area protection procedures are in effect.

2.26.2.1.1.3. AMOPs will report each area (localizer, glideslope and POFZ) free of obstructions. Once these 3 areas are reported as free of obstructions, then ATCT will consider precision approach critical areas/POFZ as protected.

2.26.2.1.1.3.1. Once precision approach critical areas/POFZ are protected, ATCT is the approval authority for movement within this area. All non-fighter type aircraft, vehicles and personnel are required to hold short of the instrument hold line and contact ATCT for clearance to enter. An Automatic Terminal Information System (ATIS) advisory will be broadcast that precision approach critical area protections procedures are in effect for all non-fighter type aircraft.

2.26.2.1.2. Advise the SOF and RAPCON WS once the areas to be protected are secure that precision approach critical area procedures are in effect. ATIS broadcast shall include ***precision approach critical area protection procedures are in effect.***

2.26.2.1.3. If both critical areas cannot be and/or are not secured IAW this procedure, ATCT will inform the pilot that the ILS critical area is unprotected and issue traffic to landing aircraft.

2.26.2.2. ATCT shall not permit vehicles or aircraft to transit or stop within the ***localizer critical area*** when an aircraft on the ILS approach is inside the Final Approach Fix (FAF), unless it is a preceding aircraft landing, departing, or exiting the runway.

2.26.2.2.1. ATCT will restrict all vehicles from proceeding beyond the instrument hold line when an aircraft executing an ILS approach is inside the FAF, unless the arriving aircraft has reported the runway in sight or is circling to land on another runway. This excludes launch essential vehicles, mission support vehicles and end

of runway vehicles directly escorting/supporting the fighter type-sized aircraft (ex. EOR crews).

2.26.2.3. ATCT will restrict all aircraft larger than fighter type size from taxiing beyond the instrument hold line within the ***glideslope critical area*** when an aircraft executing an ILS approach is inside the FAF.

2.26.2.3.1. ATCT will not permit vehicles to proceed beyond the instrument hold line within the ***glideslope critical area*** when an aircraft executing an ILS approach is inside the FAF, unless the arriving aircraft has reported the runway in sight or is circling to land on another runway. This excludes launch essential vehicles, mission support vehicles and end of runway vehicles directly escorting/supporting the fighter type-sized aircraft (ex. EOR crews).

2.26.3. When the weather is reported with a ceiling ***less than 200 feet and/or RVR 2,000 feet or less (1/2 mile visibility if no RVR),*** ATCT shall:

2.26.3.1. Notify EOR crews to move personnel and equipment accordingly. If utilizing North EOR, all equipment must be located east of Taxiway Papa or within the vicinity of the EOR shack. If utilizing the South EOR, all equipment must be located east of spot 1.

2.26.3.2. Not authorize vehicle or aircraft operations in or over the localizer critical area when an arriving aircraft is inside 1 Nautical Mile (NM) of final approach.

2.26.3.3. Not permit any aircraft to taxi or vehicles and/or personnel to proceed beyond the instrument hold line when an aircraft executing an ILS approach is inside the FAF to protect the glideslope critical area. An ATIS advisory will be broadcast that instrument hold line procedures are in effect for *all* aircraft.

2.26.4. To protect the POFZ the following procedures will be conducted IAW FAA JO 7110.65 and AFMAN 11-230, *Instrument Procedures*:

2.26.4.1. ATCT shall ensure the POFZ is clear of traffic (aircraft or vehicles) when an aircraft on a vertically guided final approach is within 2 NM of the runway threshold and the reported ceiling is below 300 feet or visibility is less than 3/4 Statute Miles (SM) to protect aircraft executing a missed approach.

2.26.4.2. When instrument critical area guard lights are not operational, AMOPS will guard Runway 18's instrument critical area along the north end of Perimeter Road during aircraft arrivals.

2.26.4.3. Parking spots 4-6 in the North EOR and 5-6 in the South EOR fall within the POFZ. These spots will not be used and must be clear when the weather conditions are below 300 feet or visibility is less than 3/4 SM when an aircraft is on an ILS approach. If it is needed to be in these areas for contingency operations, contact ATCT for

permission on the Tower net. **Note:** Only horizontal surfaces (e.g., the wings) can penetrate the POFZ, but not the vertical surfaces (e.g., fuselage or tail).

2.27. Local Channelization / Intra-Flight Frequencies. 8 FW and Tenant Units Only.

2.27.1. 8 OSS/OSA and 8 OG/OGV shall coordinate local radio channelization changes with all concerned agencies.

2.27.2. When ATC issues local channels, this refers to the UHF listed in Table 2.3.

Table 2.3. 8 FW Local Channelization / Intra-Flight Frequencies.

Agency	Channelization	UHF	VHF
Emergency		*243.0	*121.5
KUN Departure	4	*293.525	124.1
KUN Approach	6	292.65	124.1
KUN Arrival	7	349.9	133.925
KUN Clearance Delivery	19	287.7	133.75
Kun Tower	3	292.3	126.5
Kun Ground	2	273.52	123.5
Wolfpack Discrete	8	307.1	
Single Frequency Approach	9	*268.025	
ATIS	20	304.8	120.225
Pilot to Dispatch			132.25
KUN Discrete		300.2	
Viper SOF	10	245.1	141.675
PILSUNG Ranger		254.2	
COBRA	5	297.9	
WOLFPIT	18	277.200	
Incheon Control		355.50	High Sector-132.200
			Low Sector-120.72
Daegu Control		262.75	High Sector-122.75

			Low Sector- 125.37

Note: High Sector ≥ FL230 and Low Sector ≤ FL225. Channelization may be subject to change. Please contact 8 OG/OGV for most up to date channelization.

Table 2.3. 8 FW Intra-Flight Frequencies and Channelization

8FW Intra-Flight Frequencies and Channelization				
Channel	**UHF Frequency**		**VHF Frequency**	
	35 FS	**80 FS**	**35 FS**	**80 FS**
15	226.50	233.60	134.225	119.275
16	253.50	255.60	118.575	123.625
17	266.50	278.10		
18	267.90	370.80		
19	283.90	280.80		
20	286.00	227.90		
Spare (TSP/Guest Unit, etc.)	284.00 299.47 300.80 308.00		131.575	

2.27.3. SOFs may use ATC frequencies with ATCT Watch Supervisor approval. SOFs shall only use ATC frequencies for safety purposes and will not provide control instructions IAW AFMAN 13-204V3.

2.27.4. Report any unauthorized frequency use to 8 OSS/OSA and forward to 8 OG/CC, via 8 OSS/CC, for action.

2.28. ATIS Procedures.

2.28.1. During periods of no traffic or rapidly changing weather conditions, ATCT may provide instructions to retrieve ATIS information via radio transmissions.

2.28.2. Format and Content: In addition to FAAO JO 7110.65 requirements, ATCT shall include: VFR/IFR fuel status, tower pattern status, 8 FW VFR/Instrument Flight Rules (IFR) divert status, bird watch conditions, weather category holds, weather advisories, weather warnings and other information as applicable. **Note:** The ATIS shall refer to Seosan as *"Haemi"* to avoid confusion with Osan.

2.29. Airfield Construction: Approved construction activities may exist on the airfield. Contractors or construction personnel are required to sign in/out at the Airfield Management Building (bldg. 2858) prior to the start and at the end of construction activities daily, until the project is complete. AMOPS will verify construction activities do not violate airfield criteria without a Temporary Airfield Construction Waiver. AMOPS will submit appropriate NOTAMS

and coordinate with applicable agencies as required. AMOPS will conduct daily construction checks and will coordinate with the Contracting Officer Representative if violations exist.

2.30. Aircraft Rescue and Firefighting Capability. Fire Department will notify AMOPS when Aircraft Rescue and Fire Fighting (ARFF) status is reduced and/or returns to service. AMOPS will submit NOTAMS as required.

2.31. RAWS Equipment Auxiliary Power.

2.31.1. ATCT and RAPCON shall notify CE Power Pro personnel when there is a facility transfer of commercial power to back up generator.

2.31.2. Generator runs: Prior to releasing or approving any facility power transfer ATCT and RAPCON shall review current/forecasted traffic and weather conditions. RAWS equipment will normally not be released when the ceiling is less than 3000 feet and of visibility is less than 5 SMs, current or forecasted.

2.32. Permanently Closed/Unusable Portions of the Airfield. There are currently no permanently closed or unusable portions of the airfield.

2.33. Restricted/Classified Areas on the Airfield. There are currently no permanently restricted or classified areas on the airfield.

2.34. Entry Authorization Lists. AOF/CC is the approval authority for Airfield Operations facilities requiring an Entry Authorization Lists.

Chapter 3

AIRCRAFT ARRESTING SYSTEMS

3.1. Aircraft Arresting System/Barrier Configuration: (See Attachment 2).

3.1.1. Bi-directional BAK-12 arresting cables are located 1,410 ft and 2,814 ft from the approach end of runway 18 and 1,406 ft and 2,802 ft from the approach end of runway 36.

3.1.2. A unidirectional E-5 arresting cable is located 49 ft into Runway 18 overrun and 38 ft into Runway 36 overrun.

3.1.3. Standard Arresting System Configuration:

3.1.3.1. Runway 18: The BAK-12 (System #5) located 1,410 ft from the approach end, the BAK-12 (System #2) located 7,602 ft from the approach end and BAK-12 (System #3) located 6,206 ft from the approach end shall be in 8-point tiedown operational configuration. The departure end E-5 arresting cable shall be connected and operational.

3.1.3.1.1. The remaining BAK-12 (System #4) will be disconnected and placed alongside the runway. The approach end E-5 (System #6) arresting cable shall be disconnected and placed alongside the overrun.

3.1.3.2. Runway 36: The BAK-12 (System #2) located 1,406 ft from the approach end, the BAK-12 (System #4) located 6,194 ft from the approach end and BAK-12 (System #5) located 7,590 ft from the approach end shall be in 8-point tiedown operational configuration. The departure end E-5 arresting cable will be connected and operational.

3.1.3.1.2. The remaining BAK-12 (System #3) will be disconnected and placed alongside the runway. The approach end E-5 (System #1) arresting cable shall be disconnected and placed alongside the overrun.

Table 3.1. Aircraft Arresting System Standard Configuration

Arresting System #	Type	Location	Operational (Yes/No)	
			Rwy 18	Rwy 36
1	E-5	38 ft – Runway 36 Approach End Overrun	Yes	No
2	BAK-12	1,406 ft – Approach End Runway 36	Yes	Yes
3	BAK-12	2,802 ft – Approach End Runway 36	Yes	No
4	BAK-12	2,814 ft – Approach End Runway 18	No	Yes
5	BAK-12	1,410 ft – Approach End Runway 18	Yes	Yes
6	E-5	49 ft – Runway 18 Approach End Overrun	No	Yes

3.1.4. Deviations to the Standard Arresting System Configurations must be approved by 8 FW/SOF, reported to AMOPS and may be published as a NOTAM if the non-standard configuration meets AFI 11-208 IP NOTAM criteria.

3.1.5. Taxiway C BAK-12: Bi-directional BAK-12 arresting cable is located approximately 3,369 ft from the west end of Taxiway C; 4,746 ft from the east end of Taxiway C.

3.1.6. Changes to Aircraft Arresting System layout, to include runway changes, generally takes 1 hour to re-configure, but may take 90 minutes or more.

3.2. ADLS Aircraft Arresting Systems

3.2.1. During ADLS activations, a Mobile Aircraft Arresting System (MAAS) may be located on the west end of taxiway Charlie, approx. 1,350 ft from the Runway 18/36 VFR holdline or approximately 7,209 ft from the east end of Taxiway Charlie. This system should be maintained to the maximum extent practical to meet real-world and/or exercise requirements. Personnel will coordinate with AMOPS prior to any airfield equipment changes/reconfigurations.

3.2.2. If the MAAS is installed for ADLS operations, it will require high-speed taxi engagement to certify the system prior to operational use.

3.2.2.1. Should the MAAS remain installed between ADLS operations, the system shall be destrung until required.

3.2.2.2. Should the MAAS remain installed, a high-speed taxi engagement is not required.

3.2.2.3. 8 FW/CC may waive certification engagements if extenuating circumstances or mission requirements prevent certification by high-speed taxi engagement. Barrier Maintenance will perform a certification inspection in lieu of a high-speed taxi engagement.

3.3. RPA Operations

3.3.1. RPAs may not be able to utilize standard arresting system configurations. Alternate Arresting System Configurations are available upon request to AMOPS. Requests should be made at least one duty day prior. Alternate Arresting System Configurations may require runway back taxi operations.

3.3.1.1. Departing RWY 36

3.3.1.1.1. BAK-12 (System #4) will be disconnected and the cable will be placed adjacent to the Runway.

3.3.1.1.2. Intersecting Taxiway departure at TWY Bravo - there is 5,390 ft of usable RWY before BAK-12 (System #5).

3.3.1.1.3. Back taxiing to BAK-12 (System #5) - There is 6,192 ft of usable RWY before BAK-12 (System #5).

3.3.1.2. Departing RWY 18

3.3.1.2.1. BAK-12 (System #3) will be disconnected and the cable will be placed adjacent to the runway.

3.3.1.2.2. Intersecting Taxiway departure at TWY Delta - There is 5,194 ft of usable RWY before BAK-12 (System #2).

3.3.1.2.3. Back taxiing to BAK-12 (System #2) - There is 6,192 ft of usable RWY before BAK-12 (System #3).

3.4. Maintenance:

3.4.1. Barrier Maintenance shall inspect the airfield arresting systems at the start of each day and report operability via radio to ATCT and AMOPS before departing the airfield.

3.4.2. All personnel must immediately report aircraft arresting system deficiencies to Barrier Maintenance (782-4298). If no contact is made, contact 8 CE customer service at 782-5313, Facilities Superintendent (8 CE/CEOF) at 782-6373, or Ops Flight Commander (8 CE/CEO at 782-7974.

3.4.3. IAW AFI 32-1040, *Civil Engineering Airfield Infrastructure Systems*, Barrier Maintenance is the only certifying/decertifying authority. Should personnel question the safety of arresting systems, Barrier Maintenance must be notified to determine arresting system status.

3.4.4. All personnel shall immediately report any mission inhibiting aircraft arresting system problems to Barrier Maintenance, AMOPS, AOF/CC, 8 FW/CP and 8 FW/SEF.

3.4.5. Barrier Maintenance shall notify AMOPS and ATCT prior to any aircraft arresting system maintenance or configuration changes. AMOPS shall suspend runway ops during maintenance or configuration changes and shall resume runway ops following an inspection of the area.

3.5. Emergency Engagement:

3.5.1. ATCT shall:

3.5.1.1. Notify RAPCON of engagement or impending engagement.

3.5.1.2. Activate PCAS.

3.5.1.3. Notify RAPCON of changes in cable status.

3.5.1.4. Transmit advisories of impending engagements on Guard.

3.5.2. AMOPS shall notify Barrier Maintenance of all impending real-world (via SCN) or practice engagements.

3.5.3. Barrier Maintenance shall notify ATCT and AMOPS of changes in cable status to include cable setup/reset time. The reset time starts when the aircraft engages the arresting cable.

3.5.3.1. The reset time for an unannounced and/or pre-announced engagement of the BAK-12 is approximately 30 min.

3.5.3.2. The E-5 may take in excess of 4 hours to reset following an engagement. Heavy equipment, not normally readily available, is required to reset the anchor chain.

3.5.4. For all engagements (including practice engagements), pilots should relay their landing gross weight, configuration, engagement ground speed and tail number to AMOPS.

3.5.5. Runway operations are automatically suspended following any aircraft arresting system engagement until AMOPS resumes runway operations.

3.6. Certification/Practice Engagement:

3.6.1. Pending ATCT approval, aircraft shall back-taxi onto the runway at the departure end, lower tail hook and attempt to engage the aircraft arresting system. Following a missed attempt, aircraft shall back taxi to approach end, exit runway, contact GC and hold position until further advised. The hook shear pin must be replaced and rewired before attempting another engagement.

3.6.2. The pilot shall attempt to engage the cable at a minimum of 75 knots groundspeed, as close to center as possible (within 35 ft).

Chapter 4

FLIGHT PLANNING PROCEDURES

4.1. General. IAW AFMAN 13-204V2, all aircraft departing Kunsan AB must have a flight plan on file with AMOPS prior to takeoff. Military and civilian aircraft shall use DD Form 1801, *DoD International Flight Plan.* AMOPS shall maintain all original Flight Plan data and records IAW Air Force RDS, table 13-07, rule 3.00.

4.1.1. AMOPS can be reached at DSN: 782-4422 or e-mail: airfieldmanagement.8oss@us.af.mil.

4.1.2. Civil airliners operating in/out of the Gunsan City Airport terminal are exempt from having a flight plan on file with Kunsan AMOPS per AFMAN 13-204V2.

4.1.3. Aircrew may file a flight plan via ForeFlight but must verify a copy is on file with AMOPS. It is recommended to add the AMOPS e-mail as a recipient in ForeFlight.

4.1.4. Flight plans should be sent to AMOPS NLT two hours prior to Estimated Time of Departure (ETD) to avoid delays. AMOPS will file all flight plans NLT one hour before ETD.

4.2. Pack Flight Plans. "Pack" flight plans are locally established, round robin stereo and canned routes to special use airspace (SUA) and are Kunsan AB's primary departure procedures.

4.2.1. 8 FW assigned or sponsored aircraft shall:

4.2.1.1. "Pack" routes may be filed by wing assigned/sponsored/38 FG aircraft by telephone or e-mail and do not require a DD Form 1801. Any modification to "Pack" routes will require the requestor to forward flight plan changes to AMOPS in a timely manner.

4.2.2. While operating out of Kunsan AB, Sponsored and Transient Units must inform AMOPS of their operating location, flight plan points of contact, phone numbers and the estimated number of sorties flown per day/week.

4.2.2.1. Visiting units may file "Pack" routes if approved by sponsoring squadron.

4.2.3 ROKAF 38 FG shall:

4.2.3.1. File approved "Pack" flight plan a minimum of two hours before takeoff by phoning AMOPS with callsign, "Pack" number, ROKAF initials and ETD.

4.2.3.2. Contact AMOPS with callsign, number of aircraft, "Pack" flight plan changes and cancellations.

4.2.4. AMOPS shall:

4.2.4.1. Input flight plan within 15 minutes of receipt or as soon as possible if higher priority mission requirements take precedence. Changes to “Pack” flight plan, including callsigns, require an additional 15 minutes of processing time.

4.2.4.2. Maintain a Flight Planning Room IAW AFMAN 13-204V2 except for a non-Common Access Card (CAC) enabled computer. Wi-Fi is available for tablet/laptop use.

Chapter 5

FLYING AREAS

5.1. Local Flying Area/Designation of Airspace. See **Attachment 11**, *Kunsan Airspace.*

5.1.1. RAPCON Airspace is delegated by Incheon Air Control Center (ACC). For specific lateral/vertical parameters, see Korean Aeronautical Information Publication Enroute 2.1.

5.1.2. Tower Surface Area (TSA). Tower delegated airspace is a six-mile radius from the center of the airfield; surface up to and including 2,000 ft Mean Sea Level (MSL).

5.1.3. Kunsan Class C Airspace. That airspace consists of a five-mile radius from the center of the airfield; surface up to 5,000 ft MSL and a 10-mile radius shelf area extending from 1,000 ft - 5,000 ft MSL.

5.1.3.1. Parameters: IFR/VFR flights permitted; no specific pilot certification required. Aircraft shall establish two-way radio communication with ATC prior to entering Class C airspace.

5.1.3.2. Equipment requirements: Two-way radio communications and an operational transponder are normally required for operations within Class C airspace.

5.1.3.3. Class C Service.

5.1.3.3.1. Class C services are provided IAW FAAO JO 7110.65.

5.1.3.3.2. All aircraft landing at Kunsan AB are sequenced to the airport by the RAPCON. Aircraft not working in Military Operations Area (MOA) will contact Kunsan Approach no later than 30 NM from Kunsan AB. Aircraft recovering from MOAs or restricted airspace will call Kunsan Approach no later than 20NM from the airport. Upon initial contact, flight lead will advise Kunsan Approach of the number of aircraft in the flight, position from Kunsan, ATIS identifier and requested approach or intentions.

5.1.3.3.3. Arriving VFR aircraft shall be directed to points “Alpha” and “Delta” (Runway 18) and points “Charlie” and “Bravo” (Runway 36); see **Attachment 4** for VFR sequencing into Kunsan AB. Arriving IFR aircraft shall expect vectors for IFR sequencing into Kunsan AB.

5.1.3.4. Flight Procedures.

5.1.3.4.1. Aircraft approaching Class C airspace shall establish communications with ATC prior to entering the airspace. Aircraft shall provide callsign, number in flight (if applicable), position, altitude, beacon code (if applicable) and destination.

5.1.3.4.2. Aircraft departures will maintain communication until leaving Class C airspace or pilot requests termination of services.

5.1.4. For adjacent SUA, see **Attachment 12**.

5.1.5. For the Minimum Vectoring Altitude (MVA) Chart, see **Attachment 13**.

5.1.6. For the Minimum IFR Altitude Chart (MIFRAC), see **Attachment 14**.

5.2. VFR Local Training Areas. Kunsan AB has no designated VFR local training areas.

5.3. Wolf Pack Airspace.

5.3.1. All aircraft must declare Military Assumes Responsibility for Separation of Aircraft (MARSA) prior to entry into Wolf Pack Airspace.

5.3.2. Wolf Pack Airspace: Wolf Pack airspace is categorized as ATC Assigned Airspace (ATCAA) over Kunsan AB outlined with a straight line between the following points: SW point: N35 40.00 El25 25.00 (CONAN) to NW point N36 19.93 E126 25.22 (SEMI) to NE point: N36 19.78 E126 51.03 (Yankee) to SE point: N35 39.85 E126 46.48 (Zulu) and contained within altitudes 9,000'-14,000' MSL. Wolf Pack airspace is divided into two sections, Wolf Pack South and Wolf Pack North. The dividing line is N36 06.4. Wolf Pack South altitudes are 9,000'-14,000' MSL and Wolf Pack North is 11,000'-14,000' MSL. See attachment 18.

5.3.3. Participating aircraft are required to operate under VMC and maintain VFR at all times when operating in Wolf Pack airspace.

5.3.3.1. Aircrew may schedule use of Wolf Pack through 8 OSS/OSO. Wolf Pack is available to tenant units, 51 FW and ROKAF 38 FG IAW paragraph 5.3.5.1. of this regulation. Aircrew shall coordinate with RAPCON prior to departure or when airborne prior to scheduled time to request working altitudes, discrete frequency and inform if desiring practice airfield attacks. Aircrew will coordinate with SOF prior to flight to begin ATCT coordination.

5.3.3.2. When active, RAPCON will separate non-participating IFR aircraft 500' vertically and up to the boundaries of Wolf Pack airspace. No separation services will be provided for participating aircraft operating within the confines of active Wolf Pack airspace. Aircraft filed on Wolf Pack 36 and Wolf Pack 18 flight plans or requesting approval to enter Wolf Pack airspace will be considered participating aircraft.

5.3.3.3. Traffic advisories and additional coordination will be provided by RAPCON as an additional service as workload allows. Aircrew will be responsible for providing their own deconfliction within the lateral and vertical boundaries of Wolf Pack airspace when active.

5.3.3.4. Chaff/Flares/Electronic Countermeasures (ECM) are prohibited regardless of altitude.

5.3.3.5. Aircraft will not exceed 550 KCAS/0.95 Mach.

5.3.3.6. When Wolf Pack airspace is active, the following information will be available on the ATIS: *"WOLF PACK AIRSPACE ACTIVE. REMAIN AT OR BELOW 8,500 FEET IN THE VICINITY OF KUNSAN AIR BASE UNLESS OTHERWISE DIRECTED BY ATC."*

5.3.4. Emergency aircraft will get Simulated Flame Out (SFO) airspace up to 10,000' MSL, or higher, as requested. Any aircraft in Wolf Pack airspace will be immediately directed (on UHF 307.1) to remain above 11,000' MSL and within the lateral confines of Wolf Pack airspace.

5.3.5. Coordination and Communication

5.3.5.1. Kunsan RAPCON is the authority for Wolf Pack airspace activation. Coordination and approval from RAPCON shall be accomplished prior to Wolf Pack airspace entry and exit via two-way radio communication on Approach/Departure Control frequency (292.65/124.1). Once aircrew has approval to enter Wolf Pack airspace, pilots will cancel IFR and request access to the airspace. RAPCON Phraseology: *"(Callsign), IFR CANCELLATION RECEIVED, MAINTAIN VFR, WOLF PACK AIRSPACE APPROVED (altitude restriction if required), FREQUENCY CHANGE APPROVED*."

5.3.5.2. Aircrew will utilize UHF 307.1 for tactical operations in Wolf Pack airspace. RAPCON will NOT continuously monitor UHF 307.1 but will utilize UHF 307.1 to contact aircrew as required. Aircraft requesting ATC service will contact approach on local channel (CH) 8.

5.3.5.3. If Wolf Pack airspace is active, RAPCON will advise aircraft of existing user callsign(s) and approve airspace entry. Requesting aircraft will coordinate with aircraft operating within Wolf Pack airspace on UHF 307.1 prior to entry.

5.3.5.4. RAPCON shall inform aircraft of known active airspace (R-111, R-97 A/B/C/D/E/F) within 30 minutes of becoming active before approving aircraft into the North Wolf Pack airspace. Additionally, controllers will provide a real-time general broadcast on UHF 307.1 when the areas go active and inactive to ensure protection of the restricted areas.

5.3.5.5. Aircraft will remain clear of restricted areas R97 A-F, R111 and R138. ATC will instruct aircrew to remain in Wolf Pack South when R97 A-F, R111 and R138 are active.

5.3.5.6. Wolf Pack airspace shall not be active when R-97B and R-97D is active. R-97B

and R-97D take priority over Wolf Pack airspace activations.

5.3.5.7. Runway 36: IFR departure for entry into Wolf Pack airspace.

5.3.5.7.1. Wolf Pack 36 Stereo Flight Plan: Aircraft will fly runway heading to 3 DME, then turn left heading 235 to intercept HWY 5 at the KUZ 254 radial at 10 DME at 8,000' MSL. Once established on HWY 5, aircraft will turn left direct CONAN and climb to FL140, cancel IFR and receive RAPCON approval prior to entry into Wolf Pack airspace.

5.3.5.7.2. If VMC is not achieved by CONAN (SW point), continue IFR departure clearance (fly the border) east to the southeast, then northbound to the northeast coordinate for climb. If unable to cancel by Yankee (NE point), expect to vector for holding while coordinating flight intentions with RAPCON.

5.3.5.7.3. Aircraft routing:
RKJK..KUZ254010..CONAN..KUZ157016..KUZ032027..KUZ.. WWOLF..RKJK

5.3.5.8. Runway 18: IFR departure for entry into Wolf Pack airspace.

5.3.5.8.1. Wolf Pack 18 Stereo Flight Plan: Aircraft will fly runway heading to intercept HWY 8 at the KUZ 174 radial at 15 DME at 8,000' MSL. Once established on HWY 8, aircraft will turn left direct to the KUZ 157 radial at 16 DME and climb to FL140, cancel IFR and receive RAPCON approval prior to entry into Wolf Pack airspace.

5.3.5.8.2. If VMC is not achieved by the KUZ 157 radial at 16 DME (Zulu – SE point), continue IFR departure clearance (fly the border) north to the northeast. If unable to cancel by Yankee (NE point), expect to vector for holding while coordinating flight intentions with RAPCON.

5.3.5.8.3. Aircraft routing:
RKJK..KUZ174015..KUZ157016..KUZ032027..KUZ..WWOLF..RKJK

5.3.6. Wolf Pack Airspace Exit Procedures

5.3.6.1. All aircraft must contact RAPCON Approach to initiate recovery from Wolf Pack. The last aircraft in the airspace will advise RAPCON that the airspace is no longer required.

5.3.6.2. Multiple flights in Wolf Pack airspace:

5.3.6.2.1. IFR Option 1: Participating aircraft will coordinate altitude de-confliction with other users in Wolf Pack airspace. Once established at the agreed upon altitude, contact RAPCON and state the altitude with exit request. RAPCON will issue IFR clearance, vector aircraft outside the lateral airspace border and

descend aircraft for recovery.

5.3.6.2.2. IFR Option 2: Aircraft will proceed to the eastern boundary of Wolf Pack airspace, establish on a north or south heading along the boundary at 9,000' MSL and contact RAPCON for IFR clearance and recovery.

5.3.6.2.3. VFR: Coordinate with other aircraft in Wolf Pack airspace for altitude/routing de-confliction. Contact RAPCON with VFR intentions.

5.3.7. Procedures for Active Wolf Pack Airspace

5.3.7.1. All Minimal Risk Arrivals (MRAs) will remain at or below 8,000 MSL.

5.3.7.2. High Tactical Initial will be at or below 8,000 MSL.

5.3.7.3. SFOs will be limited to maximum altitude of 8,000 MSL for overhead and straight-in
patterns only when Wolf Pack airspace is active.

5.4. Coyote Airspace

5.4.1. Coyote airspace dimensions are defined as a six NM radius around Kunsan airfield, are surface - 9,000' MSL and is authorized for 8 FW. Transient units may schedule use of Coyote Airspace IAW 9.13.

5.4.1.1. Aircrew may schedule use of Coyote airspace through 8 OSS/OSO. Coyote airspace is available to tenant units, 51 FW and ROKAF 38 FG IAW paragraph 5.3.5.1. of this regulation. Aircrew shall coordinate with RAPCON prior to departure or when airborne prior to scheduled time to request working altitudes, discrete frequency and inform if desiring practice airfield attacks. Aircrew will coordinate with SOF prior to flight to begin ATCT coordination.

5.4.2. Kunsan ATCT is the authority for Coyote airspace coordination and activation. Initial request for Coyote airspace will be accomplished on CH 8. ATCT approval and subsequent coordination will be accomplished on UHF 307.1. Aircrew will remain on UHF 307.1 for Coyote airspace tactical execution. Upon completion, advise ATCT utilizing Local Channel 3. "*TOWER, (Callsign), COYOTE OPS COMPLETE, ESTABLISHED WOLF PACK AIRSPACE"*

5.4.2.1. ATCT will NOT continuously monitor UHF 307.1 but will utilize UHF 307.1 as required to issue advisory information. During coordination, requestor should state time needed for Coyote airspace to help with sequencing. If no traffic exists, ATCT may authorize Coyote airspace until further notice (UFN).

5.4.3. "*COYOTE ALL*" airspace operations are defined as the lateral boundaries of Kunsan Tower's delegated airspace (6-NM radius from the center of the airfield) surface - 9,000'

MSL.

5.4.4. Aircraft will not exceed 550 kts (KCAS)/0.95 Mach.

5.4.5. Aircraft will not overfly the Munitions Storage Area (MSA) below 1,500’ AGL.

5.4.6. Aircraft are required to operate under VMC and maintain VFR at all times when operating in Coyote airspace.

5.4.7. If ATC terminates Coyote operations, ATC will utilize UHF 307.1 (UHF Guard 243.0 if 307.1 is unavailable) with the phraseology, “(*Callsign), TERMINATE COYOTE OPS, REPORT ESTABLISHED IN WOLF PACK AIRSPACE.”* Aircraft will terminate Coyote ops and immediately climb back to block 9,000’-FL140 MSL and advise ATCT on UFH 307.1 when all aircraft are established above 9,000’ MSL. *“TOWER, (Callsign), ESTABLISHED WOLF PACK AIRSPACE*.”

5.4.8. ATCT may restrict Coyote airspace operations to “*COYOTE HIGH*” operations at or above 3,500’ MSL (3,500’ – 9,000’ MSL) to protect aircraft recovering simultaneously to the airfield. MRAs and Overhead/Straight-in Simulated Flameout (SFO) approaches are not authorized when Coyote airspace is active. Aircraft re-entry points are authorized when the Coyote airspace is restricted to “Coyote High.*”*

5.4.9. ATCT shall transmit on frequency UHF 307.1, “*ATTENTION ALL AIRCRAFT, COYOTE HIGH OPS ARE NOW ACTIVE 3,500 TO 9,000 FEET.”* ATCT must receive acknowledgment from all participating formations.

5.4.10. Aircraft shall only recover to the airfield via instrument approach, overhead pattern, or straight-in when Coyote High operations are active.

5.4.11. ATCT may authorize departures during Coyote High operations only. Aircraft will be instructed to maintain at or below 3,000 ft until outside 6 DME from the airfield.

5.4.12. Aircraft approved into Coyote Airspace and Wolf Pack airspace may transition between the two airspaces seamlessly while monitoring UHF 307.1 without coordinating with ATC.

Chapter 6

VFR PROCEDURES

6.1. VFR Weather Minimums.

6.1.1. Simulated Flameout (SFO) Pattern. 1000 ft ceiling above the highest requested SFO altitude flown and 5SM (8000M) visibility. SFO altitudes: High Key 7,000' – 10,000' MSL, Low Key 3,000' – 5,000' MSL, Base Key minimum 2,000' MSL.

6.1.2. MRA Pattern. Ceiling must be at least 1,000' above MRA altitude and visibility must be at least 5NM. Aircraft conducting SFO procedures will not be cleared from High Key to Low Key while a MRA is being conducted. Aircraft may hold at High Key above the MRA altitude.

6.1.3. Overhead Pattern/VFR Pattern Breakout Weather Minimums: 2,500 ft ceiling/3SM (4800M) visibility.

6.1.4. Fighter Rectangular Pattern Weather Minimums: 2,000 ft ceiling/3SM (4800M) visibility.

6.1.5. Conventional Aircraft Rectangular Pattern Weather Minimums: 1,500 ft ceiling/3SM (4800M) visibility.

6.1.6. Helicopter Pattern Weather Minimums: 1,000 ft ceiling/3SM (4800M) visibility.

6.2. Preferred Recovery. The overhead pattern via the VFR entry points is the preferred recovery. Pilots recovering to Kunsan on an IFR flight plan must cancel IFR prior to the VFR entry points of "Alpha, Bravo, Charlie, or Delta." If unable to cancel IFR prior to these points, aircraft should recover IFR via an IFR approach procedure.

6.3. VFR Recoveries. RAPCON provides basic radar advisory services for VFR recoveries. Aircraft shall contact RAPCON no later than 30NM from the field with current ATIS and request type approach and landing. Pattern entry via Kunsan's VFR recovery points (**Attachment 4***)* is standard unless weather or traffic conditions require otherwise. Weather minimums at VFR reporting points are 3,000 ft ceiling/3SM (4800M) visibility for aircraft recoveries via the overhead and 2,000 ft ceiling/3SM (4800M) visibility for aircraft recoveries via VFR straight-in.

6.4. VFR Departures. Aircraft may depart VFR with an approved flight plan. Aircraft shall make VFR departure requests on initial contact with ground control. Aircraft shall maintain at or below 1,000 ft MSL until departure end of runway then climb to requested altitude. Once clear of the Class C, aircraft will advise RAPCON when changing frequencies.

6.5. Quick Climb. Pilots shall request quick climbs from ground control on initial call up. Aircraft shall maintain at or below 1,000 ft MSL until departure end of runway unless specifically approved by ATCT.

6.6. VFR Traffic Patterns.

6.6.1. Opening and Closing Tower VFR Traffic Patterns. ATCT Watch Supervisor will coordinate with the SOF during periods of 8 FW flying when opening or closing the Tower's VFR patterns. ATCT Watch Supervisor has the final authority for opening or closing the VFR patterns. 8 FW SOF may restrict 8 FW aircraft from using VFR patterns at any time.

6.6.2. MRA Pattern. Pilots will request "MRA" from Kunsan Approach and specify desired MRA entry point: "MRA North/South/East/West." Each entry point is 5NM from the center of the runway in the cardinal direction indicated. MRA North is only available for Runway 18 operations. MRA South is only available for Runway 36 operations. Maintain VFR at 5,000 – 9,000 ft MSL enroute to requested entry.

6.6.2.1. Upon check-in with ATCT, pilots will report current position and intended MRA entry point "10NM East for MRA East." Report "High Initial North/East/South/West" upon reaching the MRA entry point. When directed by ATCT to "Report Base" and once within 3NM of the field, descend as required to arrive at a normal base position West of the runway. Be prepared to remain at or above 2,500 ft MSL if directed by ATCT to deconflict from other pattern traffic.

6.6.2.2. Pilots will remain clear of the departure end extended centerline while conducting the MRA to maintain separation from departure traffic.

6.6.2.3. Pilots must be prepared to report Point A/B/C/D for Initial if the ATCT is unable to grant the MRA due to pattern saturation.

6.6.3. Overhead Pattern. Pattern altitude is 1,500 ft MSL, flown west of the airfield. Unless otherwise instructed by ATCT, standard break is over the approach end of runway. Flight lead reports *"five-mile initial,"* see **Attachment 6**.

6.6.3.1. When requesting a straight-in, pilots shall state, *"Request VFR straight-in,"* vs. *"Visual straight-in,"* to avoid confusion with the request for a *"Visual Approach"* (IFR approach).

6.6.4. Re-Entry Pattern. Aircraft carrying straight through initial shall maintain 1,500 ft MSL and turn east to crosswind 1/2NM past departure end of runway. Aircraft re-entering after a low approach or takeoff shall maintain at or below 1,000 ft MSL until 1/2NM past the departure end of runway then turn to an east crosswind and climb to 2,000 ft MSL; see **Attachment 5**. Aircraft will maintain 2,000 ft MSL when crossing North and South Point.

6.6.4.1. After entering crosswind, aircraft fly to North/South Point (depending on runway in use). All aircraft re-entering after a low approach must fly a 2-mile crosswind

prior to turning to North/South Point to de-conflict with aircraft offsetting to the east during SFO approaches or recovering via tactical initial; see **Attachment 5**.

6.6.4.2. Prior to reaching North/South Point, aircraft state intentions (initial or straight-in).

6.6.4.3. If approved for straight-in, aircraft descend to 1,000 ft MSL and proceed to final.

6.6.4.4. If approved for initial, aircraft maintain 1,500 ft MSL and proceed from North/South Point to initial.

6.6.5. VFR Pattern Breakout. Aircraft will climb to 2,000 ft MSL and turn Southwest (SW) bound (for Runway36) or Northwest (NW) bound (for Runway 18). ATCT will issue further instructions.

6.6.6. Rectangular Pattern. Conventional aircraft pattern altitude is 1,000 ft MSL and flown west of the airfield. Fighter/turbojet aircraft pattern altitude is 1,500 ft MSL and flown west of the airfield.

6.6.7. Helicopter Patterns. Pattern altitude is 500 ft MSL.

6.6.7.1. Helicopters shall not overfly the MSA below 1,500 ft MSL.

6.6.7.2. Kunsan AB has no helipads or specially sited areas for helicopters. All taxiways may be utilized for helicopter arrivals and departures.

6.6.7.3. To avoid Gunsan City farming, to the maximum extent possible, helicopter approaches will be vectored for a 5 mi straight in.

6.7. Special Procedures.

6.7.1. Tactical Initial.

6.7.1.1. Weather minimums: 2,500 ft ceiling and 3SM (4800M) visibility.

6.7.1.2. Pattern. Flight lead advises RAPCON during initial contact of their intentions to fly tactical initial. Flight/element leads shall align their initial ground track with the extended runway centerline. Wingmen shall fly line abreast 6,000 ft to the east. Elements in-trail shall maintain 1-1.5NM spacing on preceding element. Flight lead shall fly depicted ground track (See **Attachment 6**) and report, “Five-mile Tac Initial” when established on runway heading and five miles from EOR. Aircraft should use 6 Distance Measuring Equipment (DME) (Runway 36) and 5 DME (Runway 18) when reporting, “Five-mile Tac Initial.” Cross the VFR entry point at and maintain 2,500 ft MSL until five-mile initial, then descend to 1,500 ft MSL. Aircraft will not exceed 400 Knots Indicated Airspeed (KIAS) from VFR entry point to break point). Aircraft shall

break over approach EOR unless ATCT directs otherwise. Maximum number of aircraft per element shall not exceed two or four for the flight.

6.7.1.3. Elements flying straight through initial shall terminate tactical maneuvering after the turn to crosswind and de-conflict from trailing elements on the turn to crosswind.

6.7.2. Practice Airfield Attacks (PAA).

6.7.2.1. Require ATCT approval/coordination. Coordination will be conducted with RAPCON prior to transfer to ATCT.

6.7.2.2. Aircraft will not descend below 1,000 ft AGL, exceed 500 Knots Calibrated Airspeed (KCAS) or use afterburner over airfield.

6.7.2.3. Simulated targets will be west of the control tower (for strafe/pop patterns/dive glides).

6.7.2.4. Aircraft will not fly over the munitions storage area below 1500 ft AGL.

6.7.2.5. Weather will be at least ceiling 3,000 ft /visibility 5 SM.

6.7.2.6. Tower WS will notify ROKAF SOF of practice attacks.

6.7.3. Base Defense/Emergency Close Air Support (ECAS).

6.7.3.1. Contact SOF CH 10 NLT 40NM from Kunsan for air base defense status update.

6.7.3.2. Establish initial support holding patterns at corners of the airspace 11,000-13,000' MSL or as directed by ATC/Cobra/On Site Commander (OSC)/Forward Air Control (FAC). Maintain VFR deconfliction until stack is established.

6.7.3.3. Primary mission is to provide Security Forces with Intelligence, Surveillance and Reconnaissance (ISR) support.

6.7.3.4. Expending ordnance on/near Kunsan requires 8 FW/CC clearance, passed through the SOF. Approval is required per attack pass.

6.7.3.5. Attack axis should be parallel to or away from the fence line for attacks outside base perimeter.

6.7.3.6. Attack axis should be chosen which limits/prevents damage to base infrastructure for on base attacks.

6.7.4. Protection of the Overhead. All aircraft departures, including aircraft conducting low approach, touch and go or missed approach, must remain at or below 1000 ft until past

departure end to protect aircraft recovering via the overhead pattern.

6.7.5. FARP Pattern. The preferred pattern for helicopters transitioning between the designated parking areas on Taxiway H to the Hot Cargo Pad during FARP operations is to circle the field southeast of the MSA. Helicopters shall not cross the runway or extended runway centerline without ATCT approval. Helicopters may air taxi to Taxiway H via Taxiway C.

6.8. Simulated Flame Out Procedures.

6.8.1. Kunsan AB supports locally assigned, Osan AB and all other 8 FW-sponsored aircraft SFOs. All 8 FW-sponsored pilots and/or Osan AB aircraft, will adhere to local guidance, this regulation and **Attachment 6**.

6.8.2. SFOs must have ATCT approval.

6.8.2.1. Aircrew should request an SFO approach with RAPCON on initial contact. Aircrew should include the desired High Key altitude in initial request. If this is not feasible, requests may be relayed to RAPCON by ATCT.

6.8.2.2. No more than four F-16s or two U-2s are allowed in the SFO pattern at once. SFO pattern shall be limited to one type of aircraft. Pilots must maintain visual separation during simultaneous SFO patterns.

6.8.2.2. All F-16 SFO patterns shall terminate in a low approach.

6.8.2.4. When instructed to "Hold at High Key," expect no further radio calls until instructed to "Report Low Key," which is approval for the start of the maneuver.

6.8.2.5. ATCT shall neither clear for takeoff (unless already holding in position on the runway) nor taxi an aircraft onto the runway after an SFO aircraft reports leaving 10 mile Straight-In SFO" or "High/Low Key."

6.8.3. Straight-In SFO Pattern Procedures:

6.8.3.1. Alignment: The SFO begins at a point 10 degrees either side of runway extended centerline and 10 NM from the end of the runway threshold, altitude 10,000 feet MSL.

6.8.3.2. Altitude: Runway 36 - 10,000' MSL. Runway 18 - 10,000' MSL.

6.8.3.3. Pattern Entry: Aircrews shall request "Straight-In SFO" as soon as possible with the RAPCON on initial contact (normally 5 minutes prior to 10 mile Straight-In point) and before entering the Straight-In pattern.

6.8.3.4. Aircrew shall report "10-mile Straight-In SFO."

6.8.3.5. If directed to "Report 5-mile Simulated Flame Out Final," aircrew shall continue

and report “5-mile SFO Final.”

6.8.3.6. If directed to “Hold at 10-mile Straight-In SFO,” aircrew shall state holding altitude, fly a 360° pattern to the west of the runway centerline between 10-15 NM from the runway and report next time reaching the “10-mile Straight-In SFO” position.

6.8.3.7. ATC shall not issue clearance for a Straight-In SFO to Runway 18 when R-97/R-111 is/are active.

6.8.4. Mission Design Series (MDS) Overhead SFO Pattern Procedures:

6.8.4.1. Overhead SFO will normally start at High Key but may start at Low Key. Aircrew shall request ‘High/Low Key’ from ATCT and once approved, enter SFO pattern after completing the option or immediately on departure. Aircrew shall maintain at or below 1,000’ MSL until ½ nautical mile past departure end of runway then start a climbing 360°/180° turn to the west direct High/Low Key.

6.8.4.2. ATCT will direct to report “High Key.” Aircrew shall report "High Key." ATCT directs to “Report Low Key,” aircrew shall continue and report “Low Key.”

6.8.4.3. If ATCT directs to “Hold at High Key,"” aircrew shall state holding altitude and fly a 360° pattern to the west of the runway and report next time reaching “High Key.”

6.8.4.4. If ATCT directs “Hold at Low Key,” aircrew shall maintain at or above 3,000’ MSL, execute a 360° pattern west of the runway and report next time reaching “Low Key”.

6.8.4.5. If ATCT directs “Report Base Key,” aircrew shall continue and report “Base Key.”

6.8.4.6. ATCT shall not authorize aircrew to depart High Key if a fighter/trainer type aircraft with similar final approach speed is between 8 and 2 NM on final approach.

6.8.4.7. If ATCT directs “Break-out,” aircrew shall maintain at or above 3,000’ MSL, turnout to the SW if on RWY 36 or NW if on RWY 18 and await further instructions. U-2s will not orbit at Low Key but instead will break out.

6.8.4.8. Aircrew at initial shall report SFO aircraft “in sight” and maintain visual separation. If aircrew does not report SFO traffic in sight, aircrew at initial may be instructed to offset ½ mile to the east and continue.

6.8.4.9. ATCT shall instruct SFO aircraft to “Hold at High Key, Low Key or breakout” if these traffic conditions cannot be met.

6.8.5. F-16 Overhead SFO:

6.8.5.1. F-16 weather minimums: Ceiling 1,000’ above High/Low Key; 5 miles visibility.

6.8.5.2. High Key: 7,000 - 10,000’ MSL.

6.8.5.3. Low Key: 3,000 - 5,000 MSL.

6.8.5.4. Base Key: 2,000’ MSL minimum.

6.8.5.5. U-2 Overhead SFO:

6.8.5.6. U-2 weather minimums: Day VMC, including the period of civil twilight IAW AFMAN 11-2U-2v3.

6.8.5.7. High Key: 1,100’ - 2,100’ MSL.

6.8.5.8. Low Key: 700’ - 1,000’ MSL.

6.8.5.9. Airspeed: Approximately 90 KIAS.

6.8.5.10. U-2 Emergency Hung Pogo Procedures:

6.8.5.11. VFR hung pogo pattern is 3 miles west of Kunsan at 1,000’ MSL.

6.8.5.12. IFR hung pogo pattern is radar vectors to the west to avoid restricted airspace at 4,000’ MSL or requested altitude. Vectors on west downwind may be limited due to MOA 17/19 activity. Pilot should expect an 8-10 mile intercept to Runway 36 when MOA 19 is active.

6.9. Reduced Same Runway Separation Procedures.

6.9.1. IAW AFMAN 13-204, MAJCOM A3 are responsible for establishing Reduced Same Runway Separation (RSRS) criteria for their specific commands, this information is contained in the AFMAN 11-202V3_PACAFSUP, *Flight Operations*. The following RSRS standards (i.e., less than FAAO JO 7110.65, standard separation) apply to all Pacific Air Force (PACAF) assigned aircraft at PACAF bases where ATC is provided by United States Air Force (USAF) controllers (includes aircraft deployed to Kunsan and identified as temporary/sponsored 8 FW assets). Non-PACAF aircraft or those not sponsored by the 8 FW may participate in RSRS if covered under a letter of agreement (i.e., Joint Letter of Agreement on RSRS at PACAF bases).

6.9.2. Air traffic controllers must see the aircraft involved and determine distances by reference to suitable landmarks (i.e., distance markers, taxiways) for daytime and nighttime.

6.9.3. Revert to nighttime RSRS standards when the RCR is reported between 16 and 12 inclusive, or when RCR is not available and RSC is reported as wet, ice, or snow.

6.9.4. For fighter-type aircraft only, a low approach following a full stop shall use the opposite side of the runway and be 500 ft vertically separated when passing the aircraft on landing roll. Aircraft shall not overfly aircraft on the runway. Responsibility for separation rests with the pilot. Controllers must provide appropriate traffic advisories to all aircraft involved.

6.9.5. Same fighter-type aircraft operations mean the same airframe (e.g., A-10 behind A-10, F-16 behind F-16).

6.9.6. Dissimilar fighter-type aircraft operations mean not the same airframe (e.g., F-16 behind F-15, F-16 behind A-10).

6.9.7. Non-heavy, non-fighter-type aircraft operations mean C-130, C-12, B-737, etc.

6.9.8. RSRS between formation full stops (holding hands) are authorized provided all aircraft involved are the same type aircraft. Separation is measured between the trailing aircraft in the lead formation and the lead aircraft in the trailing formation.

Table 6.1. Daytime RSRS Standards:

PAIRINGS	FS behind TG	FS behind LA	LA behind LA	FS behind FS	LA behind FS	TG behind TG	TG behind LA
Same Fighter-Type	3,000'	3,000'	3,000'	3,000'	6,000'	3,000'	3,000'
Dissimilar Fighter-Type	+	+	+	6,000'	6,000'	+	+
Same Non-Heavy, Non-Fighter Type	+	+	+	6,000'	+	+	+
Same-Type Aircraft Formations	+	+	+	6,000' *7,000'	+	*7,000'	+
Fighter-Type Behind Non-Heavy, Non-Fighter Type	+	+	+	9,000'	+	+	+
Non-Heavy, Non-Fighter Type behind Fighter-type	+	+	+	9,000'	+	+	+
NOTE: + Standard FAAO 7110.65 separation will be applied. * Kadena AB, Japan assigned KC-135 formations not at maximum landing weight.							

***Revert to nighttime RSRS standards when the RCR is reported between 12 and 16 inclusive, or when
RCR is not available and RSC is reported as **ice or snow**.

Table 6.2. Nighttime RSRS Standards:

PAIRINGS	FS behind TG	FS behind LA	LA behind LA	FS behind FS	LA behind FS	TG behind TG	TG behind LA
Fighter-Type	+	+	+	6,000'	9,000'	+	+
Same Non-Heavy, Non-Fighter Type	+	+	+	6,000'	+	+	+
Same-Type Aircraft Formations	+	+	+	6,000'	+	+	+
Fighter-Type Behind Non-Heavy, Non-Fighter Type	+	+	+	9,000'	+	+	+
Non-Heavy, Non-Fighter Type behind Fighter-type	+	+	+	9,000'	+	+	+
NOTE: + Standard FAAO 7110.65 separation will be applied.							

6.9.9. RSRS standards do not apply:

6.9.9.1. To any situation involving an emergency aircraft.

6.9.9.2. To civil aircraft.

6.9.9.3. To air evacuation aircraft.

6.9.9.4. To a touch-and-go behind full stop.

6.9.9.5. To “heavy” aircraft.

6.9.9.6. When RCR is reported less than 12.

6.9.9.7. RSRS is prohibited while ADLS procedures are in effect.

6.10. Intersection Departures. Aircraft may use full runway length or request an intersection departure. Ground Control shall state useable runway length when issuing taxi instructions to aircraft requesting an intersection departure. See **Attachment 15**.

Chapter 7

IFR PROCEDURES

7.1. Radar Traffic Patterns.

7.1.1. The normal radar pattern altitude is 4,000 ft, flown to the East of the airfield.

7.1.2. Circling Maneuvers. Pilots shall circle west of the field. RAPCON shall provide appropriate IFR spacing when an aircraft is authorized a circling maneuver.

7.2. Availability/Restrictions for Surveillance (ASR) Approaches and Precision Approach Radar (PAR) Approaches/Monitoring. Kunsan AB does not have any published ASR approaches and does have a published ROKAF controlled PAR approach. ROKAF PAR approach is not used for radar monitoring.

7.3. Single-Piloted Turbo Jet Procedures.

7.3.1. USAF controllers shall monitor single-piloted turbo jet aircraft conducting a precision or non-precision instrument approach down final IAW FAAO JO 7110.65.

7.3.2. When a nonradar approach will be made, aircraft may be instructed to contact tower when:

7.3.2.1. The reported ceiling is at or above 1,500 feet and visibility is 5 SM or more.

7.3.2.2. The aircraft reports able to proceed by visual reference to the surface

7.3.2.3. At pilot request.

7.3.3. The aircrew shall remain on the last assigned frequency until a landing or low approach has been completed except under the following conditions:

7.3.3.1. When pilot cancels IFR flight plan.

7.3.3.2. In an emergency situation.

7.3.3.3. When an aircraft is cleared for a visual approach. Pilots who are given a frequency change that does not meet the above guidance or if they encounter IMC conditions on final, should request to remain on the current assigned frequency.

7.4. Local Departure Procedures.

7.4.1. Local departure transitions will be IAW Attachment 7.

7.4.2. Transitions**.** The following transitions are clearances that connect to Pack Flight Plans: *LINTA*, *CONAN*, *ENTEL*, *NAMPO*, *OPEDA, ZULU, LOSER and* the *SEMI* Transitions. Pilots filing Pack Flight Plans shall automatically be cleared for the transition corresponding to the first point of the flight plan.

7.4.3. On departure, aircraft shall fly runway heading maintain at or below 1,000 ft until departure end of the runway then climb to clearance altitude. Upon passing 3 DME, aircraft shall start a turn in the shortest direction to the first transition point on the Pack Flight Plans. Radar is required for this local departure procedure.

7.4.4. To ensure separation, the last aircraft of in-trail departures will squawk "subset and altitude" (Mode 3/C-of XX00, where XX is the first two-digits of the flight lead's assigned Mode 3/C transponder code).

7.4.5. When the surveillance radar is out of service, non-radar routing is available.

7.5. Non-Standard Formation Departures.

7.5.1. Aircraft or flights departing Kunsan AB in formation with another aircraft/flight (not on the same Flight Plan) will be handled IAW FAAO JO 7110.65 and FAAO JO 7610.4, *Special Operations*, Aircraft requesting this operation shall comply with the following.

7.5.1.1. Obtain ATC approval to conduct nonstandard formation/Military Authority Assumes Responsibility for Separation of Aircraft (MARSA) operations from Clearance Delivery by using the phrase of *"Request non-standard formation departure with (callsign)".*

7.5.1.2. Reiterate nonstandard formation/MARSA departure intentions with Ground Control upon initial contact.

7.5.1.3. Advise ATCT of element spacing.

7.5.1.4. Once airborne, do not report level at an ATC assigned altitude or within an altitude block until all formation aircraft have attained the assigned altitude/block.

7.5.1.5. When the nonstandard formation/MARSA configuration requires an interval greater than 3NM between the formation leader and the last aircraft in the formation, both the formation leader and the last aircraft will squawk the assigned Mode 3A/C beacon code.

7.5.2. Nonstandard formation/MARSA aircraft will be cleared to the clearance limit.

7.6. Radar Vectors to Initial. Approach control may vector aircraft to VFR Entry Points (see **Attachment 4**, VFR Entry Points*)* or 10 mile initial for sequencing with IFR/VFR traffic. Pilots recovering to Kunsan on an IFR flight plan must cancel IFR prior to the VFR entry points of "Alpha, Bravo, Charlie, or Delta" or 10 mile initial. If unable to cancel IFR prior to these points,

aircraft should recover IFR via an IFR approach procedure. Aircraft shall cross the VFR Entry Point at or above 2,500 ft while proceeding direct to a five-mile initial, then descend to 1,500 ft. Maintain 300 KCAS from the VFR Entry Point to the break point.

7.7. IFR Recovery Procedures.

7.7.1. Aircraft shall contact RAPCON no later than 30 NM from the field with current ATIS, requested approach, type landing and number of aircraft in flight.

7.7.2. Radar In-Trail Recoveries. Pilot initiated only and limited to not more than four aircraft in formation. Upon initial contact, flight lead shall inform RAPCON of number of aircraft in flight and request *"radar trail recovery."* Further details are outlined in the 8 OG, 51 OG, 5th RS Letter of Agreement, for further details.

7.7.2.1. Flights shall maintain standard formation until coordination with ATC for a non-standard trail recovery formation.

7.7.2.2. To ensure separation, the last aircraft of in-trail recoveries will squawk "subset and altitude" (Mode 3/C of XX00, where XX is the first two-digits of the flight lead's assigned Mode 3/CA transponder code and altitude).

7.7.2.3. Radar trail recoveries to simultaneous PAR approaches are not authorized.

7.7.2.4. Abnormal procedures. Trail aircraft losing radar contact on preceding aircraft prior to intercepting a segment of the approach shall inform lead, climb 500 ft above last assigned altitude and obtain a separate clearance from ATC. Subsequent trailing aircraft may, if able, continue the trail recovery. If radar contact is lost after established on a segment of the approach, the approach may be continued if separation can be confirmed by NAVAIDs. In the event of a breakout/go-around, each element shall comply with specific ATC instructions.

7.8. Non-Radar Procedures. In the event Kunsan RAPCON surveillance radar is out of service, the following procedures shall be in effect**:**

7.8.1. Weather permitting and with 8 OG/CC approval, 8 FW aircraft should depart/arrive VFR to the maximum extent possible to avoid significant delays. If the weather is IMC, aircrew are encouraged to remain as a flight to the maximum extent possible and Return to Base (RTB) through established transition points while in Kunsan Approach airspace.

7.8.2. Special Use Airspace. Approach control shall coordinate with the Cobra and ROKAF Master Control and Reporting Center (Watchman) on an "as needed" basis for acquisition/restriction of the following special use airspace Runway 36 in use; MOA 2, MOA 3, MOA 15, MOA 15A, MOA 17 and MOA 19; Runway 18 in use; MOA 2, MOA 3, MOA 15, MOA 15A, MOA 17, R-111 and R-97A/B/C/D/E/F. See **Attachment 10**, *Korean Special Use Airspace (SUA)* and **Attachment 12**.

Chapter 8

EMERGENCY OPERATIONS

8.1. Operation of the Primary Crash Alarm System.

8.1.1. Primary Crash Alarm System (PCAS). The PCAS consists of the following agencies:

8.1.1.1. AMOPS.

8.1.1.2. Fire Emergency Services Flight (Crash) (8 CES/CEF).

8.1.1.3. 8th Medical Group (Ambulance Services/Flight Medicine) (8 MDG).

8.1.1.4. Security Forces Squadron (listen only capability).

8.1.1.5. 8 FW Command Post (listen only capability).

8.1.2. ATCT activates the PCAS whenever an aircraft declares an emergency (real or exercise), ATCT/RAPCON Watch Supervisors or 8 FW/38 FG Liaison deems it necessary, or any of the following conditions are known, reported, suspected or imminent:

8.1.2.1. Aircraft accident on/off base.

8.1.2.2. Hydrazine leak.

8.1.2.3. Cable engagement (except pre-planned engagement).

8.1.2.4. Hot brakes.

8.1.2.5. Aircraft landing with a dragging tail hook.

8.1.2.6. Contaminated aircraft.

8.1.2.7. Confirmed or suspected Emergency Power Unit (EPU) activation.

8.1.2.8. Unauthorized aircraft landing/movement.

8.1.2.9. Activation of the ADLS.

8.1.2.10. Aircraft landing with hung/unsafe ordnance (EXCEPT: BDU-33 training ordnance and hung secure rockets).

8.1.2.11. Any situation critical to aircraft or airfield operations which, in the controller's judgment, requires immediately alerting emergency response agencies.

8.1.2.12. Actual or suspected aircraft with radio failure (NORDO).

8.1.2.12.1. The PCAS does not need to be activated if a NORDO aircraft is information with another aircraft and it can be ascertained through pilot signals that no other emergency exists other than radio failure.

8.1.3. PCAS Activation.

8.1.3.1. ATCT shall relay the following over the PCAS during in-flight or ground emergencies (real or exercise):

8.1.3.1.1. Aircraft callsign and/or tail number if available.

8.1.3.1.2. Aircraft type.

8.1.3.1.3. Nature of emergency.

8.1.3.1.4. Pilot's desires.

8.1.3.2. Time permitting, ATCT will relay the following information:

8.1.3.2.1. Present location.

8.1.3.2.2. Landing runway.

8.1.3.2.3. ETA.

8.1.3.2.4. Wind information.

8.1.3.2.5. Fuel remaining in minutes.

8.1.3.2.6. Number of personnel on board.

8.1.3.2.7. Armament status.

8.1.3.2.8. EPU status (on/off).

8.1.3.2.9. Aircraft is/is not expected to engage barrier.

8.1.4. Alternate PCAS. If the PCAS is inoperable, ATCT will notify AMOPS. AMOPS will activate the Secondary Crash Net (SCN). If that, too, is inoperable, ATCT notifies as follows:

8.1.4.1. AMOPS: Direct line/782-4422/ramp net.

8.1.4.2. 8 CES/CEF: Direct line/782-4471/crash net.

8.1.4.3. 8 MDG: 010-7145-5456 or 8 OMRS/SGXF 782-5945. When activating the PCAS at night (or if the crash control dispatcher requests), ATCT shall illuminate all airfield lighting.

8.1.5. Answering the PCAS:

8.1.5.1. Listen--say nothing unless asked.

8.1.5.2. Copy all information.

8.1.5.3. Do not interrupt or offer any information. Caller will provide all known information and ask "*Any questions?"* when complete. Ask questions pertaining to accuracy only.

8.1.5.4. Hang up when directed to "*Secure the net."*

8.1.6. Daily Checks: Unless there is an emergency in progress, ATCT will check the PCAS between 0800L and 0830L.

8.2. Operation of the Secondary Crash Net

8.2.1. AMOPS activates the Secondary Crash Net (SCN) immediately after ATCT completes PCAS activation; unless situation requires only SCN activation (i.e. weather warnings, Force Protection Condition levels, etc.). AMOPS relays PCAS information verbatim. If AMOPS is made aware of a situation prior to ATCT being aware, AMOPS will contact ATCT to request activation of the PCAS.

8.2.2. The SCN consists of the following agencies:

8.2.2.1. 8 FW/CP (Command Post).

8.2.2.2. 8 CES/CEF (Fire Department).

8.2.2.3. 8 HCOS/SGGE (Ambulance Services); 8 OMRS/SGXF (Flight Medicine).

8.2.2.4. 8 CES/CEX (Emergency Management (EM)) [available only during wing flying]).

8.2.2.5. 8 FW/SE (Wing Safety [available M-F 0800-1700 and scheduled wing flying]).

8.2.2.6. 8 SFS (Base Defense Operations Center (BDOC)).

8.2.2.7. 8 CES/CED (Explosive Ordnance Disposal (EOD) [M-F 0800-1700]).

8.2.2.8. MOCC.

8.2.2.9. Hydrazine Response (Fuels; only available during wing flying).

8.2.2.10. 38 FG/CP (ROKAF Command Post).

8.2.2.11. TA/Crash Recovery [available M-F 0700-2100 and scheduled wing flying].

8.2.2.12. 8 OSS/OSW (Base Weather).

8.2.3. If the SCN is inoperative, AMOPS will notify the following by telephone, in listed order:

8.2.3.1. Command Post.

8.2.3.2. TA/Crash Recovery.

8.2.3.3. Safety.

8.2.3.4. MOCC (have MOCC relay information to Hydrazine Response).

8.2.3.5. Explosive Ordnance Disposal.

8.2.3.6. Hydrazine Response (Fuels).

8.2.3.7. BDOC.

8.2.3.8. Emergency Management.

8.2.3.9. ROKAF.

8.2.3.10. Weather.

8.2.4. Agencies will notify AMOPS at 782-4422 and submit emergency work order with the 8th Communication Squadron, when their SCN is not working/out of service.

8.2.5. Requests for additions/deletions to SCN (excluding those required in AFMAN 13-204V2) must be coordinated through the AFM for OSS/CC approval or disapproval. The SCN is limited to agencies requiring emergency action/response to aircraft incidents/mishaps.

8.2.6. Within the request, include the need for talk back or listen only capability with justification. Agencies must use a noise reduction feature such as a push-to-talk handset. Agencies must fund/provide their own compatible equipment. If an agency moves or gets new equipment, it is the user's responsibility to maintain the noise reduction function.

8.2.7. Answering the SCN:

8.2.7.1. Listen--say nothing unless asked.

8.2.7.2. Copy all information.

8.2.7.3. Do not interrupt or offer any information. Caller will provide all known information and ask "*Any questions?"* when complete. Ask questions pertaining to accuracy only.

8.2.7.4. Hang up when directed to "*Secure the net."*

8.2.8. Daily Checks: **Unless there is an emergency in progress,** AMOPS shall check the SCN prior to 0900L daily. AMOPS will test the alternate SCN the first Monday of every month.

8.2.9. Gunsan Airport will only be notified if their commercial aircraft experience an In-Flight Emergency (IFE) or Ground Emergency or if runway operations are suspended/closed.

8.3. Emergency Response Procedures.

8.3.1. Specific responses to accidents, disasters and aircraft mishaps including designation and responsibilities of the on-scene commander are outlined in the 8 FW, *Mishap Response Plan* and 8 FW OPLAN 32-1, *CE Contingency Response Plan*.

8.3.2. In addition to items in paragraph 8.1 & 8.2, ATCT/AMOPS shall relay the following information over PCAS/SCN when applicable:

8.3.2.1. Disaster grid map coordinates. If unable to determine grid coordinates, use commonly known geographical references.

8.3.3. IFE.

8.3.3.1. Single Frequency Approach (SFA). Available from RAPCON on CH 9 (UHF 268.025). This frequency is utilized at pilot discretion for IFEs requiring simultaneous pilot, SOF, ATC and emergency response coordination. Only ATC agencies may transmit control instructions. RAPCON will continuously monitor CH 9 and notify ATCT and 8 FW/38 FG SOF of imminent IFEs. RAPCON will notify ATCT, 8 FW SOF and 38 FG Liaison when CH 9 is being used for emergency aircraft operations.

8.3.3.2. ATCT shall broadcast, as soon as possible, on all appropriate frequencies (to include emergency frequencies during 8 FW/ROKAF flying), if an IFE affects runway ops. Example: *"Attention all aircraft, Kunsan Tower on Guard, IFE in progress, ETA (time). Expect (length of delay, if known) runway ops suspension."*

8.3.3.3. ATCT shall suspend airborne/ground ops that may interfere with an inbound emergency aircraft or responding ground crews once the emergency aircraft reaches five-mile final.

8.3.3.4. After an aircraft exits runway, it should taxi to the closest EOR spot (e.g., hot brakes, hydrazine, etc.). Once parked, aircraft should contact the senior fire official, callsign "CHIEF 2" on CH 9. CHIEF 2 is in charge of all fire response vehicles.

8.3.3.4.1. Following a SFA, ATCT shall release CH 9 to CHIEF 2 once aircraft stops taxiing.

8.3.3.4.2. If the aircraft is unable to exit runway, ATCT shall authorize CHIEF 2 onto runway. When authorized on runway, CHIEF 2 becomes responsible for all other fire response vehicles on runway and is responsible to report all vehicles off runway. All other agencies must request onto the runway with ATCT.

8.3.3.5. ATCT shall monitor CH 9 while CHIEF 2 has control. ATCT shall return CH 9 to RAPCON upon IFE termination. If able the SOF shall monitor CH 9.

8.3.3.6. CHIEF 2 has sole authority to terminate emergencies and shall advise ATCT of termination time. ATCT shall notify AMOPS and RAPCON of termination. AMOPS shall notify all other agencies via the SCN.

8.3.3.7. AMOPS shall conduct a runway check following all IFEs. The 8 FW/SOF may waive runway FOD checks following 8 FW aircraft IFEs, for emergencies unlikely to involve fluid, parts, or debris shedding.

8.3.4. Ground Emergencies.

8.3.4.1. If an aircraft declares a Ground Emergency, ATCT shall obtain CH 9 from RAPCON, if available and direct the aircraft to contact CHIEF 2 on CH 9. If CH 9 is already in use, ATC and SOF shall coordinate to assign another discrete frequency.

8.3.4.1.1. If the aircraft is unable to exit runway, ATCT shall authorize CHIEF 2 onto runway. When authorized on runway, CHIEF 2 becomes responsible for all other fire response vehicles on runway and is responsible to report all vehicles off runway. All other agencies must request onto the runway with ATCT.

8.3.4.2. PCAS/SCN notification/emergency termination is the same as IFE (See para 8.1. & 8.2.).

8.4. ROKAF Simulated Emergencies. For training purposes and with RAPCON or ATCT approval, the 38 FG may request use of Channel 9 for simulated emergencies. Channel 9 will not be available for training during real-world in-flight emergencies and can be terminated at any time for higher ATC priorities.

8.4.1. Pilots shall request use of Channel 9 with RAPCON or ATCT on the current frequency using the phraseology *"Kunsan Tower/Approach, exercise, exercise, exercise. Request Channel 9 for simulated emergency."*

8.4.2. RAPCON or ATCT shall approve the request and monitor Channel 9 unless otherwise stated with reason.

8.4.3. The 38 FG/SOF or liaison in ATCT may transmit on Channel 9 during simulated emergencies with ATCT Watch Supervisor's permission.

8.5. Quickfreeze Procedures. A procedure initiated when there is suspected FOD or dropped/lost object in the immediate vicinity of aircraft conducting taxing, takeoff or landing operations.

8.5.1. If suspected by Aircraft Maintenance, the Pro-Super/EOR Super, will notify MOCC to alert/initiate Quickfreeze procedures.

8.5.2. Use specific start and end points when initiating a Quickfreeze, e.g. item lost between HAS 1 and South EOR.

8.5.3. MOCC must notify 8 FW/SOF, AMOPS and ATCT of Quickfreeze.

8.5.4. If notification of the Quickfreeze originates through an agency other than the 8 MXG, SOF/ATCT must immediately notify AMOPS and MOCC. MOCC notifies Fighter Generation Squadrons and EOR duty sections of the Quickfreeze.

8.5.5. AMOPS will conduct a check of the CMA, or closest suspect routing point to the CMA and check toward the origination point. AMOPS will notify the sweeper to respond to the suspected area of the dropped/lost object during Quickfreezes based on identified need/observed debris. After checks of the suspected affected areas are complete AMOPS shall report pavement areas identified debris free and/or operations safe.

8.5.6. Maintenance immediately starts search upon initiating Quickfreeze in non-CMAs, emphasizing taxiway centerlines. Use all assets available to conduct the search.

8.5.7. The maintenance unit initiating the Quickfreeze will notify MOCC when sweep is complete. MOCC notifies SOF, ATCT and AMOPS.

8.5.8. Only 8 MXG/CC, 8 MXG/CD, 8 OG/CC or 8 OG/CD may terminate the Quickfreeze when all applicable areas are inspected and the object was recovered or still missing. 8 FW/SOF shall notify ATCT, MOCC and AMOPS of termination of Quickfreeze.

8.5.9. 8 FW/SOF or ATCT will notify aircraft that taxied through the affected areas of possible FOD ingestion.

8.6. External Stores/Live Ordnance Jettison Area Procedures. Aircraft should contact RAPCON for traffic advisories during jettison procedures. See **Attachment 6** Overhead / F-16 SFO Patterns / Controlled Bailout / Jettison Area.

8.6.1. External stores jettison area is located between the KUZ VORTAC 270° and 290° radials between 7 and 15 DME.

8.6.2. Live ordnance jettison area is “CATFISH” (VMC only), a 4-mile radius circle around the KUZ R-307° @ 53 DME.

8.6.3. If able, aircraft should jettison above 3,000 ft AGL.

8.7. Fuel Dumping. The designated fuel dumping area is outbound on the KUZ 270° radial, between 5 and 10 DME, above 3,000 ft.

8.8. Aircraft Arresting System Emergency Engagement.

8.8.1. ATCT shall:

8.8.1.1. Notify RAPCON of engagement or impending engagement.

8.8.1.2. Activate PCAS.

8.8.1.3. Notify RAPCON of changes in cable status.

8.8.1.4. Transmit advisories of impending engagements on Guard.

8.8.2. AMOPS shall notify Barrier Maintenance of all impending real-world (via SCN) and practice engagements.

8.8.3. Barrier Maintenance shall notify ATCT and AMOPS of changes in cable status to include cable setup/reset time. The reset time starts when the aircraft engages the arresting cable.

8.8.3.1. The reset time for an unannounced and/or pre-announced engagement of the BAK-12 is approximately 30 min.

8.8.3.2. The E-5 may take in excess of 4 hours to reset following an engagement. Heavy equipment is required to reset the anchor chain and may not be readily available.

8.8.4. When anticipating a need for an approach-end engagement, aircraft shall advise 8 FW SOF and/or ATC as early as possible.

8.8.5. For all engagements (including practice engagements), pilots should relay their landing gross weight, configuration, engagement ground speed and tail number to the OSC.

8.8.6. Runway operations are automatically suspended following any barrier engagement until AMOPS resumes runway operations.

8.9. Hot Brake Area and Procedures. Aircraft with known/suspected hot brakes shall roll out to end of runway, park in the hot brake area (North/South EOR) and declare a Ground Emergency, see **Attachment 2**.

8.10. Abandonment of Aircraft.

8.10.1. Controlled Bailout Area: From the KUZ R-270º to 290º radials, between 7 and 15 DME.

8.10.2. Ejection: The pilot shall eject IAW MDS guidance see **Attachment 6.**

8.10.3. Aircraft Plotting Procedures: Procedures are in the Kunsan Installation Emergency Management Plan (IEMP) 10-2, RAPCON, ATCT and 8 FW/SOF quick reaction checklists.

8.11. Emergency Locator Transmitter (ELT) Response Procedures. ATCT shall notify 8 FW/CP of suspected ELT signals. 8 FW/CP determines signal source. RAPCON shall notify Incheon (ACC).

8.12. Hung Ordnance Procedures. All aircraft with any type of hung ordnance (secure or unsecured, live, training, or inert) should make straight-in approaches to a full stop. For further information reference 8 FWI 21-102, *Launch and Recovery of Explosive Loaded Aircraft, End of Runway and Hung Ordnance/Jammed Gun Procedures*.

8.12.1. The 8 OG/CC has determined Runway 18 to be advantageous when landing with Hung Ordnance. Aircrew should land Runway 18 if TOLD and runway configuration permit.

8.12.2. Live Ordnance (Secure or Unsecured). Pilots shall declare an emergency and return to Kunsan avoiding populated areas. Under the following circumstances, an IFE or Ground Emergency declaration is not required, but may be declared at the pilot's dissection:

8.12.2.1. Hung Ordnance is training munitions (BDU-33).

8.12.2.2. Hung Ordnance are Hung Rockets (rocket has not moved in the tube) that have been visually confirmed as secure. Pilots will inform ops "Code 3 Hung Secure Rocket." Ops will then notify the maintenance super to have MXS respond to the HCP.

8.12.2.3. If CHIEF 2 declares the hung ordnance safe, aircraft may, with SOF concurrence, contact ground control for taxi to parking.

8.12.4. Hung Live Ordnance (Secure). Aircraft will taxi to north/south EOR to de-arm. Once the aircraft is secure and safe, it will taxi back to parking. If the de-arm crew determines that the situation is unsafe, the Pilot in Command (PIC) will declare a Ground Emergency. ATCT shall direct aircraft to the nearest Hot Cargo Pad. Direct aircraft landing Runway 36 to make 180º turn to the west (if hung munitions are forward firing ordinance). If the hung ordnance is declared safe by CHIEF 2, pilots can continue with normal taxi-back procedures.

8.12.4.1. If Hung Rockets are observed to be unsecure by MXS personnel, a Ground Emergency will be declared.

8.12.5. Hung Live Ordnance (Unsecured). Aircraft landing on Runway 18 will proceed to the Hot Cargo Pad or South EOR. Aircraft landing on Runway 36 will back taxi to Hot Cargo Pad or South EOR.

8.12.6. Hung Gun or Forward Firing Ordnance (Live). Same actions as Hung Live Ordnance (Secure). Make left 180° turn (through west) on Runway 36 to back taxi to Hot Cargo Pad. When on the Hot Cargo pad, keep the nose of the jet pointed west. Follow weapons/Fire Chief instructions. If hung forward firing ordnance (live) or gun can be electrically/mechanically secured, or once weapons confirm hung rockets are secure, the aircraft may taxi back normally.

8.12.6.1. If Forward Firing Ordnance (Live) are Hung Rockets that have been visually confirmed as secure, an IFE or Ground Emergency declaration is not required. An emergency may be declared at the pilot's discretion. Aircraft with secured hung rockets may taxi to park.

8.12.7. Hot Cargo Pad is available for Hung Unsecure ordinance. Aircraft should face West.

8.13. Unsafe Gear. Aircraft with landing gear malfunctions shall stop straight ahead on the runway and be towed off.

8.14. EPU Activation/Suspected Hydrazine Leak. Hydrazine parking areas are at the North and South EORs see **Attachment 2**. The hydrazine response team shall check the aircraft in the EOR.

8.15. Contaminated Aircraft Arrival. Primary parking is the Hot Cargo pad (max 170 ft wingspan), secondary is the north arm/de-arm area and tertiary is the northeast end of Taxiway C. When Runway 36 is in use, ATCT shall back-taxi aircraft to the Hot Cargo Pad.

8.16. Unauthorized Aircraft Movement or Engine Run.

8.16.1. ATCT shall not approve aircraft engine run, engine start or taxi unless ATCT has received at least one of the following:

8.16.1.1. AMOPS notification the aircraft has filed a flight plan.

8.16.1.2. 8 FW approved flying schedule with identifying callsign.

8.16.1.3. Scramble approval from 8 FW/CP, ROKAF 38 FG/CP or AMOPS.

8.16.1.4. Verbal approval from 8 FW/CP, ROKAF 38 FG/CP, AMOPS, 8 FW/SOF or 38 FG/SOF.

8.16.1.5. MOCC notification of engine runs.

8.16.2. Changes to the 8 FW flying schedule (e.g., change to callsigns, takeoff times, tail numbers, cancellations) shall be updated on applicable scheduling programs. Flying squadron's operations desks shall, in turn, immediately notify AMOPS via phone.

8.16.3. In the event of an unauthorized aircraft movement, ATCT shall activate the PCAS.

8.17. Wind Limitations on Control Tower. The maximum wind velocity ATCT can safely withstand is 70 knots (KTS). ATCT personnel will evacuate when winds reach 55 KTS sustained (50 for Runway Supervisory Unit (RSU)) or gusts to 65 KTS). ATCT/RSU shall remain out of service until sustained winds drop below 55/50 kts (respectively).

8.17.1. The Aerodrome will be closed until ATCT has returned to operational capabilities.

8.18. Evacuation of ATC and AMOPS Facilities. Services become limited when ATCT/RAPCON/AMOPS evacuate. ATCT/RAPCON/AMOPS will evacuate for bomb threats, natural/man-made disasters, or at the commanders' or facility chief/supervisor's discretion.

8.18.1. ATCT Evacuation. Evacuation location will be determined based on local conditions and active runway or ADLS.

8.18.1.1. Alternate ATCT Limiting Factors (LIMFACS):

8.18.1.1.1. One approach to a full stop landing.

8.18.1.1.2. Reduced same runway separation not authorized.

8.18.1.1.3. ATIS unavailable.

8.18.1.1.4. One UHF radio for ground and airborne operations. RAPCON shall monitor UHF Local Channel 3 for ROKAF scrambles.

8.18.1.1.5. Landline communications shall be via a cell phone if cellular services are available.

8.18.1.1.6. Tape-recording capability unavailable.

8.18.1.1.7. James Avenue control unavailable.

8.18.1.1.8. Limited light gun capabilities during radio failures.

8.18.1.1.9. BAK-12 control will be conducted by CES Barrier Maintenance.

8.18.1.1.10. Airfield lighting control will be by CE.

8.18.1.1.11. The Kunsan Civil Airport gate will be controlled by GCA.

8.18.1.2. AMOPS shall:

8.18.1.2.1. Direct airfield lighting to report immediately to the lighting vault and stand by for instructions from ATCT. Airfield lighting shall not assume control at the vault without ATCT
Approval. A technician should remain at the vault to set ATCT directed light intensities until ATCT personnel return to the Tower facility.

8.18.1.2.2. Direct 8 CES Barrier Maintenance to report immediately to the approach end BAK-12 and standby for instructions from ATCT. A technician shall remain to lower/raise the cable, as directed by ATCT, until ATCT personnel return to the Tower facility.

8.18.1.2.3. Direct GCA Authority (471-5820) to control the airport gate until further advised. Notify 8 SFS Law Enforcement Desk (782-4944) that GCA Authority has control of gate.

8.18.1.2.4. Direct Base Weather to use Pilot to Metro frequency to pass updates to the alternate ATCT facility.

8.18.2. RAPCON Evacuation. RAPCON evacuates to the ATCT (Bldg. 2829). If ATCT has evacuated personnel will evacuate to AMOPS or as directed by the CCTLR based on local conditions. During RAPCON evacuation no approach or radio services are available. RAPCONs airspace will be given to ICC.

8.18.2.1. Alternate RAPCON LIMFACS:

8.18.2.1.1. Radar service, to include ROKAF PAR unavailable. Non-radar procedures will apply and aircraft will experience delays.

8.18.2.1.2. Practice approaches unavailable.

8.18.2.1.3. Frequencies available: 293.525, 292.65 and 124.1.

8.18.3. AMOPS Evacuations. AMOPS evacuates to the Second floor of ATCT (Bldg. 2829).

8.18.3.1. Alternate AMOPS LIMFACS:

8.18.3.1.1. Communications Available: Phone: 782-4422, e-mail airfieldmanagement.8oss@us.af.mil.

8.18.3.1.2. Flight data terminal unavailable. AMOPS must phone flight plans to Osan Airfield Management and aircrew should anticipate delays.

8.18.3.1.3. Pilot-to-dispatch radio capability unavailable.

8.19. Explosive Detection Military Working Dog (MWD) Teams. If notified of a possible explosive threat aboard an aircraft, ATCT/RAPCON/AMOPS shall inform the Aircraft Commander that a MWD detection team is available.

Chapter 9

TRANSIENT AIRCRAFT SUPPORT

9.1. This chapter outlines services available to transient aircraft upon request. More specific services or changes to procedures outlined within this regulation may require a Letter of Agreement (LOA) or Letter of Procedure (LOP) between 8 OSS and the requesting transient unit.

9.2. Prior Permission Required (PPR).

9.2.1. PPR Procedures. All aircraft (not locally assigned), excluding any civilian aircraft as applicable, sponsored, deployed and TSP units, must obtain a PPR number from AMOPS to land at Kunsan AB. Aircrew should request PPRs 5 days prior to arrival or NLT 24 hrs in advance. Military aircraft may conduct practice approaches without a PPR (to include touch-and-go/stop-and-go/full stop taxi-back). Civil aircraft require a PPR in order to conduct practice approaches and are restricted to low approaches only IAW AFI 10-1001, *Civil Aircraft Landing Permits,* due to legal and financial constraints.

9.2.2. Civil landing permits and PPRs are required for all non-routine civil aircraft landing at Kunsan. Civil landing permits should be coordinated 15-30 days in advance to ensure there are no delays.

9.2.3. Aircraft carrying distinguished visitors (DV) code 6 or higher, aircraft experiencing an emergency, aero medical evacuation or special air missions are also exempt from Official Business Only (OBO) restrictions but are required to obtain a PPR number for tracking and notification.

9.2.3.1. 8 FW/CC may authorize a one-time landing for civilian aeromedical evacuation flights IAW AFI 10-1001.

9.2.4. Aircraft carrying hot cargo in or out of Kunsan AB must request a PPR NLT 5 days prior to mission. Hot cargo operations must be deconflicted from civilian airline operations as much as possible.

9.3. Tactical Arrival training may be conducted during VMC only.

9.4. Night Vision Device (NVD) operations must be accomplished IAW Chapter 11 of this regulation.

9.4.1. Transient NVD operations must not interfere with 8 FW, 38 FG or Gunsan civil operations. ATCT may be required to turn airfield lights on but will provide notice to all operators utilizing NVDs.

9.5. Landing Zone Operations must be conducted IAW Chapter 10 of this regulation.

9.6. In the event of a mishap, 8 FW Mishap Procedures will be applied.

9.7. AMOPS shall provide Airfield Driving Training to transient units IAW DAFI13-213_8FWSUP. For short-term/temporary operations, the Wing Airfield Driving Program Manager will publish and provide additional familiarization training for all units required to operate vehicles on the airfield.

9.8. Certain airframes may not be able to utilize the standard aircraft arresting system configurations. Standard configuration deviations will be handled IAW Chapter 3 of this regulation.

9.9. RPA Operations:

9.9.1. 8 FW-assigned/sponsored, 38 FG and Gunsan civilian aircraft have priority over RPA operations.

9.9.2. RPA aircrew shall contact RAPCON, Kunsan Approach, approximately 30 minutes out from RTB and prior to exiting assigned airspace.

9.9.3. RPAs will recover via the attached Recovery Procedures (Attachments 24 and 25).

9.9.4. RPAs should attempt to fly all traffic patterns to the West of Kunsan AB and should avoid flying over populated areas.

9.9.5. If an approach must be delayed for sequencing, ATCT will direct the aircraft to hold at BENDER at a directed altitude on the 270 radial, right hand turns, 7NM legs.

9.9.6. Arresting system barriers may be lowered IAW Chapter 3 of this regulation.

9.9.7. Kunsan AB does not have RPA tow capabilities; transient units are responsible for all tow requirements.

9.9.8. Units requesting to operate RPA or to use Kunsan AB as an emergency divert base designation shall coordinate a PPR in advance.

9.9.9. RPA operations conducted within Kunsan airspace will be with full aircraft lighting and an operational transponder.

9.9.10. RPA mission commanders, pilots, or SOF will advise ATCT of initiation and completion of flight operations.

9.9.11. RPA operations are prohibited from using Special Visual Flight Rules.

9.9.12. AMOPS shall publish NOTAMs for UAS operations as required.

9.9.13. ATC will separate and sequence RPA as “Category I, Lower Smaller” IAW FAA JO 7110.162 *Consolidated Wake Turbulence.*

9.9.14. UAS operations will not be conducted simultaneously with civil aircraft operations within Kunsan‘s Class C airspace.

9.9.15. The ATIS will reflect when UAS operations are conducted within the Kunsan Class C airspace.

9.9.16. Standard UAS departures will takeoff from the active runway, fly runway heading to 3 DME from KUZ VORTAC, then turn left (departures off Runway 36) or right (departures off Runway 18) to join the KUZ 270 radial to enter the MOA complex.

9.9.17. **Lost Link:**

9.9.17.1. Lost Link is defined as an event where the uplink/command link between the aircraft and the Ground Control Station is lost. If this occurs, the RPA will execute and follow its pre-planned mission to recover back at a pre-designated airfield.

9.9.17.2. The PIC will notify ATC when RPA is Lost Link in transit to the last 6 of the emergency mission, if unable to regain control and remaining option is to crash.

9.9.17.3. RPA shall immediately set transponder to 7400 and declare Lost Link Emergency with last ATC controlling agency.

9.9.17.4. Lost Link on the Ground. Upon a Lost Link condition while on the ground, the RPA will shut down the engine and apply brakes for 5 minutes. After 5 minutes, the brakes will release and the aircraft could begin to roll. Every effort shall be made to expedite the RPA maintenance team's transit to the aircraft to prevent inadvertent movement.

9.9.18. **Lost Link Landing Procedures:**

9.9.18.1. RPAs requesting to perform Lost Link Landing will require 8 OG/CC approval prior to planning Lost Link Landing at Kunsan AB. Approval should be coordinated 1 week in advance with 8 FW/XP.

9.9.18.1.1. ATCT will sterilize the Kunsan Class C airspace to facilitate Lost Link Landing attempts.

9.9.18.1.2 RPAs shall provide AMOPS with their lost link profile and flight path prior to each flight.

9.9.18.2. In the event a Lost Link condition occurs and cannot be resolved, the aircraft may make up to three attempted landings at Kunsan AB as outlined below.

9.9.18.3. The aircraft will route to point BENDER at 10,000 MSL via the emergency mission
from the aircraft's last known position.

9.9.18.4. It will descend to 4,000 MSL enroute to point EKIVA. This point is the first of the
last 6 emergency mission waypoints. Upon reaching EKIVA, the aircraft will immediately proceed to the selected Automatic Takeoff and Landing Capability (ATLC) entry waypoint mission at 4,000 MSL.

9.9.18.5. Once the aircraft is established in the ATLC mission, the aircraft will begin a descent from 4,000 MSL to 1,500 MSL (pattern altitude) following the ground track of the overhead pattern and will attempt to land.

9.9.18.6. Once the aircraft lands, it will come to a stop on the runway and proceed to shut down the engine as well as apply the brakes for 5 minutes. Procedures will be accomplished IAW paragraph 9.9.9.4.

9.9.18.7. If the crew is unable to regain link with the aircraft and all lost link landing attempts
have been exhausted, the aircraft will then proceed to waypoint 5 of the last 6 emergency
waypoints. Emergency mission waypoint 6 will be collocated with ATLC's waypoint 1 for RWY 18 and EKIVA for RWY 36. The aircraft will begin climbing to 4,000 MSL enroute to waypoint 6 in accordance with the published missed approach procedures as defined in the RPA SCAs.

9.9.18.8. The RPA crew will notify Kunsan ATC 30 minutes prior to attempting Lost Link
landing. The RPA crew will inform Kunsan ATC with the programmed landing RWY and the planned flight path should the landing attempt be unsuccessful.

9.9.18.9. RPA crews will, to the greatest extent possible, avoid programming Lost Link Landing flight paths overpopulated areas.

9.9.18.10. Once the aircraft passes waypoint 6 of the last 6, it will proceed back to waypoint 1
of the last 6 emergency waypoints at EKIVA climbing to 4,000 MSL for RWY 18. For RWY 36, waypoints 1 and 6 of the emergency last 6 will be collocated at point EKIVA at 4,000 MSL.

9.9.18.11. Passing point EKIVA, the aircraft will proceed direct to R-105 where waypoints 2/3/4/5 of the emergency mission last 6 will be stacked in a 6 nm diameter orbit. Waypoint 5 of the emergency mission last 6 will have a loiter time of 4,095 minutes (maximum programable loiter time) to ensure the aircraft never departs R-105.

PIC will communicate to all appropriate agencies time based on fuel status. The aircraft will loiter until link is regained or fuel exhaustion occurs.

9.9.18.12. The stacked altitudes for R-105 will be deconflicted from FL160-FL220 by no less
than 1000 feet.

9.10. Transient Alert (TA).

9.10.1. Open Mon-Fri, 0700 - 2100L, or as published. For available services, see *Kunsan AB* in the Airport/Facility Directory section of the *Department of Defense* (*DoD) Pacific, Australasia and Antarctica Enroute Airfield Supplement* Aircraft requiring service must request PPR via AMOPS.

9.10.2. Fleet Servicing is unavailable at Kunsan AB. Aircraft requiring fleet servicing may receive service at Osan AB.

9.11. AMC Engine Runs: Kunsan AB does not have designated AMC engine run areas. The AFM in coordination with TA, may approve engine runs, other than normal starts for taxi, on the Transient Pad, Hot Cargo Pad, Overflow North, Overflow South, or any other airfield pavement areas not provided above. Approval is dependent on aircraft type and percentage of maximum engine power required. Engine runs in these areas may require closure of adjacent pavement areas.

9.12. Wolf Pack & Coyote Airspace.

9.12.1. Non-8 FW or 51 FW assets/aircraft/pilots require Wolf Pack and Coyote airspace procedures academics provided by 8 OG/OGV prior to airspace use. Upon completing academics, 8 OG/OGV will permit 8 OSS/OSO to schedule transient unit's use of Wolf Pack or Coyote Airspace.

9.12.2. Airspace use must be scheduled by the requesting unit's scheduling office and will be coordinated through 8 OSS/OSO 1-7 business days prior to airspace use.

9.12.2.1. 8 OSS/OSO will only schedule transient unit's use of Wolf Pack or Coyote Airspace outside 8 FW flying windows. Transient operations can only be conducted 30 minutes outside of 8 FW scheduled operations in Wolf Pack and Coyote Airspace.

9.12.3. Landing Zone Operations may be utilized by transient units IAW Chapter 10 of this regulation.

Chapter 10

LANDING ZONE OPERATIONS

10.1. Landing Zone (LZ) Program

10.1.1. AOF/CC will appoint Landing Zone Controller (LZC) and/or Landing Zone Safety Officer (LZSO) personnel IAW DAFMAN 13-217, Drop Zone, Landing Zone and Helicopter Landing Zone Operations and applicable supplements (e.g. PACAF_SUP).

10.1.2. LZ equipment is maintained by appointed LZ personnel and owned by AOF/CC.

10.1.2.1. On a quarterly basis, LZ personnel will conduct an equipment inventory with the AOF/CC, including functionality checks and record of equipment status.

10.1.2.2. LZ personnel, in coordination with AOF/CC, will submit necessary equipment budget requests to PACAF/A313 NLT July each FY.

10.2. LZ Coordination

10.2.1. Transient Unit Requests

10.2.1.1. Units planning to Remain Over Night (RON) will submit their request to 8 FW Plans (8FW/XP) at least 60 days prior to the requested date.

10.2.1.2. Transient units that do not intend to RON (e.g. land-refuel-depart in same duty period) will submit their request to 8 OSS/OSAA (AMOPS) at least two weeks prior to the requested date.

10.2.2. AOF/CC and OSS/DO or OSS/CC will approve projected LZ operations in turn.

10.2.3. Upcoming LZ operations will be briefed weekly 8 OG/Maintenance Group (MXG) meeting prior to operations. If no 8 OG/MXG meeting precedes execution, 8 OSS/CC, 8 OSS/DO, or AOF/CC will notify OG/CC prior to execution.

10.2.4. LZ location must be approved by AOF/CC and AFM and will coordinated with Tower, RAPCON and AMOPS at least 24 hours in advance of LZ operations. To the maximum extent possible, all LZ Operations will utilize Runway 36/18. Alternate locations may be approved by AOF/CC and AFM and will be briefed at the OG/MXG meeting.

10.2.5. To the maximum extent practical, all LZ Operations will be conducted outside of 8 FW, Republic of Korea Air Force (ROKAF) 38 FG and Gunsan airport flying windows.

10.2.6. The LZ Team will execute a LZ operations checklist for coordination with (at a minimum): Tower, RAPCON, Fire Department, AMOPS, ROKAF, 8 CES Sweeper and Barrier Maintenance.

10.3. LZ Operations

10.3.1. Prior to LZ Operations:

10.3.1.1. LZ personnel are responsible for configuring the airfield as required. LZ configurations should adhere to DAFMAN 13-217 (and applicable PACAF supplements) standard configurations to the maximum extent practical (i.e. AMP-1, AMP-2, etc.). Set-up times and access should be coordinated with AMOPS and Tower at least one hour prior to execution.

10.3.1.2. Immediately prior to LZ operations, the LZ team will verify the cable configuration.

10.3.1.3. AMOPS will submit an Official Business Only (OBO) NOTAM as soon as possible prior to LZ Operations.

10.3.1.4. When able, a qualified LZC/LZSO safety observer should be positioned in the Tower cab.

10.3.2. During LZ Operations:

10.3.2.1. LZC/LZSO will declare LZ "hot" at the start of operations. When the LZ is "hot," the LZSO will specify the LZ Controlled Movement Area (CMA) specific to the current LZ setup.

10.3.2.2. At the start of LZ Operations, Tower will immediately release control of the Tower Surface Area (TSA) airspace and participating aircraft to LZC/LZSO control. Tower will monitor LZ frequency during LZ operations.

10.3.2.3. RAPCON will notify Tower immediately of any inbound aircraft.

10.3.2.4. Tower will deny non-participating aircraft entry into the TSA. If required (ex: in-flight emergencies or alert missions), Tower will assume control of the TSA and all participating aircraft to sequence all aircraft appropriately.

10.3.2.5. Throughout LZ Operations, all involved personnel are safety observers. If safety concerns or inclement weather arise involved personnel will immediately call "Knock It Off" on frequency or notify Tower via recorded line. In the event of "Knock It Off":

10.3.2.5.1. LZC/LZSO will transfer TSA airspace and aircraft control to Tower and notify Tower of current airfield configuration

10.3.2.5.2. Tower will assume control of the TSA airspace and all aircraft and will execute emergency procedures as required.

10.3.2.5.3. Following the resolution of a "knock-it-off" issues, LZ Operations may resume at the discretion of the Tower Watch Supervisor with LZ Team concurrence. LZ Operations will cease for any subsequent knock-if-offs. The LZ Team will debrief the AOF/CC.

10.3.2.6. LZ teams will ensure that any non-standard airfield configuration equipment (e.g. lighting, panels, DRMs, sandbags, anchoring equipment, etc.) located on the runway surface can be removed within 20 minutes from any time before, during, or after LZ operations. Equipment may be placed on the runway shoulders in case of emergency but must be removed following the conclusion of LZ Operations.

10.3.2.6.1. Arresting gear/Barriers/Cables. To accommodate the alert mission, a minimum of 2 departure end cables will remain strung on runway 36 during LZ operations. Exceptions require 35 OG/CC approval in coordination with 38 FG

10.3.3. After LZ Operations:

10.3.3.1. The LZ Team will declare the LZ "cold" at the conclusion of LZ Operations and will immediately release control of the TSA airspace and participating aircraft to Tower.

10.3.3.2. All LZ equipment will be removed from the runway surface (IAW 3.2.6) when LZ Operations are terminated. AOF/CC may authorize equipment to remain on the airfield so long as it does not interfere with operations and does not exceed 24 hours.

10.3.3.3. AMOPS will conduct a FOD sweep, coordinate for airfield sweeper as necessary and will immediately contact Barrier Maintenance to restring barriers.

10.4. LZO Training Course

10.4.1. On a case-by-case basis, Kunsan AB's LZ Team can train and certify personnel as LZC or LZSO. Training course requests will be coordinated through AOF/CC and/or the NCOIC ATC Training (NATCT). LZ Training Operations will be briefed IAW paragraph 2.3 of this instruction.

10.4.1.1. AOF/CC will maintain current training standards and requirements IAW PACAF approved course curriculum.

10.4.2. LZSO training is limited to members in related aviation or airfield occupations (ex-aviators, Airfield Operations, SERE, etc).

10.4.3. LZ Training courses will be conducted prior to planned LZ Operations to enable certification during planned LZ Operations.

Chapter 11

ALTERNATE DEPARTURE AND LANDING SURFACE OPERATIONS

11.1. General Responsibilities.

11.1.1. 8 FW/CC. Delegates authority for ADLS operations to 8 OG/CC (or designated representative) for wing-assigned aircraft. Retains approval authority for non-8 FW-assigned aircraft.

11.1.1.1. ADLS operations are not in compliance with established runway criteria such as obstructions within imaginary surfaces, obstruction free-zones, airfield markings and lighting standards. Conducting ADLS operations incurs acceptance of these risks.

11.1.1.2. IAW Facilities Criteria 3-260-18F, Air Force Aircraft Arresting Systems (AAS) Installation, Operation and Maintenance (IO&M), the installation commander approves alternate procedures for removing an aircraft from the cable after engagement commonly referred to as a "slingshot." Potential for aircraft damage is high when using these methods; therefore, use these procedures only during contingencies or in-flight emergencies that require rapid removal of an aircraft from a cable.

11.1.2. 8 OG/CC. Directs preparation, activation and deactivation of the ADLS.

11.1.3. 8 OG/CC, 8 MSG/CC, 8 MXG/CC, 8 MDG/CC and 8 WSA/CC. Provide Traffic Control Point (TCP) augmentees IAW Table 11.1.

Table 11.1. check TCP Augmentee Manpower Requirements per 12-Hour Shift

Unit	Manpower Requirement
8 OG	2
8 MSG	5
8 MXG	5
8 MDG	2
WSA	1

11.1.4. AOF/CC or OG WOC Representative. Oversees execution of ADLS operations.

11.1.5. Top 3 and OGV. Provide training on ADLS procedures to aircrew. Training material includes paragraph 11.7. of this regulation and any supplemental material as required.

11.1.6. Safety Observers. During an exercise, ATCT, AMOPS, SOF, Pilot, or other involved party may call “KNOCK IT OFF” to terminate ADLS operations if safety is in question.

11.1.6.1. Termination of ADLS operations will be coordinated with the SOF and executed by ATCT.

11.1.6.2. A hotwash with all involved parties will be conducted to debrief the unsafe situation and capture lessons learned.

11.2. METHODS OF ACTIVATION.

11.2.1. The ADLS may be activated due to an emergent contingency requirement or to support a pre-planned training event.

11.2.1.1. Contingency or Exercise Requirement: 8 OG/CC or their delegate will direct activation via the ADLS Checklist in Command and Control Incident Management Emergency Response Application (C2IMERA) via the WOC.

11.2.1.2. Planned Training: ADLS activation will be approved at the OG/MXG meeting two weeks prior to the desired week of execution. Supporting commanders will be notified at the Wing Stand-Up (Warfighter) meeting two weeks prior to the desired week of execution. Unit tasking requirements (TCP augmentees/radios/transportation, etc.) will be validated during the Wing Stand-Up one week prior to execution.

11.3. DEFINITIONS.

11.3.1. ADLS. Defined as Taxiway C when approved for aircraft departure and/or landing operations.

11.3.1.1. The ADLS is 8,654 feet long by 75 feet wide (see Attachment 2)

11.3.1.2. ADLS 24 threshold is located at N 35° 55.1067’ E 126° 38.4328’

11.3.1.3. ADLS 06 threshold is located at N 35° 54.3237’ E 126° 36.9676’

11.3.2. ADLS CMA. Defined as Taxiway C and 100 feet from the edge of the departure/landing surface.

11.3.3. ADLS Preparation. Steps taken to prepare Taxiway C for ADLS operations.

11.3.4. ADLS Activation. Activation of the ADLS CMA to include sterilization of the ADLS.

11.3.5. ADLS Deactivation. Deactivation of the ADLS CMA and reopening of Taxiway C to normal pedestrian and vehicle traffic.

11.3.6. H-Time. Planned time of ADLS CMA activation. H–Time is written as H –H:MM minutes (time prior to activation) or H +H:MM (time post activation).

11.4. PREPARATION RESPONSIBILITIES.

11.4.1. OG/CC. Direct ADLS preparation through AOF/CC or OG WOC Representative.

11.4.1.1. Set H-time in coordination with AOF/CC or OG WOC Representative based on first expected operations and MAAS install timeline.

11.4.1.2. Notify 38 FG Command Post of H-time.

11.4.2. AOF/CC or OG WOC Representative: Oversees execution of ADLS checklist and coordinates Set H-time with the OG/CC.

11.4.2.1. Set H-time in coordination with 8 OG/CC.

11.4.2.2. Notify SOF, ATCT Watch Supervisor and RAPCON Watch Supervisor of H-time via the recorded line. Include any additional pertinent information as required.

11.4.2.3. Direct AMOPS to execute ADLS preparation procedures.

11.4.2.4. If the EOC/WOC is active, coordinate with the EOC Manager to publish a Senior Staff Directive (SSD) for TCP Reporting time and location.

11.4.3. EOC Director: If the EOC/WOC is activated, initiate TCP augmentee recall through respective Unit Control Centers (UCCs) IAW Table 11.1.

11.4.4. SOF.

11.4.4.1. Direct Fighter Squadron Top 3 to:

11.4.4.1.1. Provide ADLS refresh training during aircrew step briefings. Training should cover guidance found in section 7 and any supplemental training material as required.

11.4.4.1.2. Coordinate Mobile Aircraft Arresting System (MAAS) certification with the MOCC based on AMOPS-established time window.

11.4.5. AMOPS.

11.4.5.1. Activate the SCN to notify all agencies of ADLS preparation and H-time.

11.4.5.1.1. Notify 8 CES/Barrier Maintenance (DSN: 782-4298) of ADLS preparation order and to install the MAAS or configure it to operational status if prepositioned. Direct the BAK-12 to be configured to operational status.

11.4.5.1.2. Notify 8 CES/Airfield Lighting (DSN: 782-4784) of ADLS preparation order and to install the Emergency Airfield Lighting System (EALS), as directed by the OG/CC.

11.4.5.1.3. Contact 8 CS/SCOT Radio (DSN: 782-3278) to obtain land mobile radios (LMRs) for TCP augmentees.

11.4.5.1.4. Contact 8 LRS/LGDDO (DSN: 782-3278) to obtain transportation for TCP augmentees.

11.4.5.2. Publish a NOTAM and revise as required with projected timelines: “ADLS OPERATIONS WILL BE CONDUCTED [TIMES]. ONLY PRIOR COORDINATED PARTICIPATING AIRCRAFT CAN USE ADLS, ALL OTHER AIRCRAFT CAN EXPECT SEQUENCING DELAYS.”

11.4.5.3. Pre-position physical markers and/or barriers along the adjacent aircraft flow openings nearest Taxiway C, in coordination with 8 CES.

11.4.5.4. Coordinate with 8 CES/CEOFP to establish a time window for the MAAS certification.

11.4.5.4.1. Notify AOF/CC and/or OG WOC Representative and SOF of the certification time window.

11.4.5.5. Verify all TCP augmentees have reported, provide training, provide TCP augmentees with LMRs, place at assigned TCP locations and verify two-way communication.

11.4.5.6. Suspend Taxiway C to aircraft operations while the MAAS is being installed.

11.4.6. 8 MXG.

11.4.6.1. Consider relocating aircraft from Juvat and Panton flows due to close proximity to ADLS CMA.

11.4.6.2. Consider stringing ropes across the front of Juvat and Panton flows to mitigate risk for CMA violations.

11.4.7. TCP Augmentees. TCP augmentees will report to AMOPS (Building 2858) or designated location at the specified time for accountability and training.

11.4.8. 8 CES/CEO.

11.4.8.1. Remove equipment and excess materials from the RADR training area located on the approach end of ADLS 24.

11.4.8.2. Place plastic barriers around ADLS at locations determined by AMOPS.

11.4.9. 8 CES/CEOFP Barrier Maintenance.

11.4.9.1. Install MAAS as directed by AMOPS.

11.4.9.1.1. During exercises, MAAS installation may be simulated with 8 OG/CC approval.

11.4.9.1.2. The MAAS requires certification by high-speed aircraft taxi after each installation. All attempts should be made to coordinate certification by high-speed taxi prior to operations commencing.

11.4.9.1.2.1. If the MAAS remains installed, recertification is required annually.

11.4.9.1.2.2. If operationally necessary and IAW AFMAN 32-1040 paragraph 4.4.3., a certification inspection may be performed if directed by

8 OG/CC until a high-speed taxi certification can be performed. Certification inspection does not require ADLS activation.

11.4.9.2. Return the BAK-12 to operational status as directed by AMOPS.

11.4.9.3. Notify AMOPS upon completion of equipment installation.

11.4.9.4. Barrier cables will be strung across the taxiway prior to the ADLS activation phase.

11.4.10. 8 CES/CEOFE Airfield Lighting.

11.4.10.1. At the discretion of 8 OG/CC, install EALS. Initial install may take up to 6 hours.

11.4.10.1.1. The system provides runway edge lights, approach lights, threshold/end, taxiway lights, Precision Approach Path Indicator (PAPI) lights, Distance-To-Go (DTG) marker lights and obstruction lights.

11.4.10.1.2. PAPIs will remain uncertified unless an official flight check is completed. Certification will be invalidated if PAPIs are moved.

11.4.10.2. It may take up to 3 hours to reconfigure the EALS for a runway change.

11.4.10.3. To prevent system damage, aircraft taxiing across the EALS are restricted to locations with cable protectors in place.

11.4.11. 8 CS/SCOT Radio. Provide 12 LMRs for TCP augmentees.

11.4.12. 8 LRS/LGDDO. Provide a 15-pax van or other suitable vehicle(s) to AMOPS for augmentee transportation.

11.5. ACTIVATION RESPONSIBILITIES.

11.5.1. AOF/CC or OG WOC Representative: If required for MAAS certification, activate the ADLS CMA as soon as MAAS installation is completed or at the pre-approved H-Time, whichever is sooner.

11.5.2. 8 OG/CC. Following MAAS certification, direct the ADLS to remain active or to deactivate.

11.5.3. AMOPS.

11.5.3.1. Verify the MAAS is in position, coordinate with Barrier Maintenance, as required, for MAAS certification. Ensure both MAAS and BAK-12 cables are in operational configuration.

11.5.3.2. Verify TCP augmentees have secured the ADLS.

11.5.3.3. Perform final FOD check and verify sterilization of the ADLS.

11.5.3.3.1. When complete, notify ATCT the ADLS is ready for MAAS certification or aircraft operations.

11.5.3.4. Following activation of the Primary Crash Alert System (PCAS), activate the SCN and alert agencies that the ADLS CMA is active.

11.5.3.5. Upon MAAS/BAK-12 certification, conduct post-certification FOD check and notify ATCT when complete.

11.5.4. ATCT.

11.5.4.1. Notify RAPCON and SOF when the ADLS is activated.

11.5.4.2. After AOF/CC or WOC OG Representative reports the ADLS CMA is active, activate the PCAS and state, “ADLS OPERATIONS IN EFFECT, TAXIWAY CHARLIE IS NOW A CONTROLLED MOVEMENT AREA, PARTICIPATING AIRCRAFT OPERATIONS WILL BE CONDUCTED TO ADLS 06/24.”

11.5.4.3. Ensure James Avenue traffic lights are active as required, such as when the ADLS has operations imminent or aircraft are taxing on Taxiway F.

11.5.4.4. Notify RAPCON of activation and direction of ADLS.

11.5.4.5. Broadcast on UHF/VHF frequencies and the Ramp Net once the ADLS is active, “ATTENTION 8TH FIGHTER WING AND 38 FIGHTER GROUP AIRCRAFT/VEHICLES, ALTERNATE DEPARTURE AND LANDING SURFACE OPERATIONS ARE IN EFFECT. TAXIWAY C IS NOW A CONTROLLED MOVEMENT AREA, PARTICIPATING AIRCRAFT OPERATIONS WILL BE CONDUCTED TO ADLS 06/24.”

11.5.4.6. Broadcast, “ADLS OPERATIONS IN EFFECT, PARTICIPATING AIRCRAFT OPERATIONS WILL BE CONDUCTED TO ADLS 06/24” on the Automatic Terminal Information Service (ATIS).

11.5.4.7. As able, authorize ADLS crossings IAW Paragraph 8.

11.5.5. SOF. Coordinate and execute MAAS certification.

11.5.6. RAPCON. Upon ADLS activation notification from ATCT, broadcast on UHF/VHF frequencies and Guard, “ATTENTION ALL 8TH FIGHTER WING AND 38 FIGHTER GROUP AIRCRAFT, ALTERNATE DEPARTURE AND LANDING SURFACE OPERATIONS ARE IN EFFECT. TAXIWAY C IS NOW A LANDING AND DEPARTURE SURFACE FOR PARTICIPATING AIRCRAFT.”

11.5.7. TCP Augmentee. In coordination with AMOPS, block all vehicle, bicycle, personal transportation devices and pedestrian traffic from entering the ADLS CMA. ATCT approval is required for to enter or cross the ADLS, ATCT will authorize movements as able.

11.5.7.1. TCP augmentees will secure the ADLS at the Set H Time, unless directed otherwise by the Airfield Manager or AOF.

11.5.7.2. TCP augmentees will monitor Ramp Net at all times.

11.5.8. Command Post. Announce activation of ADLS via AtHoc and the Giant Voice system.

11.5.8.1. AtHoc Message: “TAXIWAY CHARLIE IS CLOSED TO ALL VEHICLE AND PEDESTRIAN TRAFFIC. ALL ENTRIES OR CROSSINGS OF TAXIWAY CHARLIE ARE LIMITED TO MISSION ESSENTIAL ONLY AND SHOULD EXPECT DELAYS. ALL CROSSINGS WILL BE DONE AT JAMES AVENUE, TAXIWAY PAPA OR TOWWAY GOLF. NON-MISSION ESSENTIAL TRAFFIC MUST USE PERIMETER ROAD OR AVOID THE AREA UNTIL NOTIFIED OF TERMINATION.”

11.5.8.2. Giant Voice Message: “THIS IS WOLF PACK. ALTERNATE LANDING SURFACE OPERATIONS ARE IN EFFECT. TAXIWAY CHARLIE IS NOW THE PRIMARY LANDING SURFACE AND IS CONSIDERED A CONTROLLED MOVEMENT AREA. I SAY AGAIN… WOLFPACK OUT.”

11.5.9. MXG/MOC.

11.5.9.1. Upon activation, inform all MX personnel that the ADLS CMA is activated.

11.5.9.2. Broadcast on applicable channels to all personnel that "ADLS ACTIVATION IS IN EFFECT, TAXIWAY CHARLIE IS NOW A CONTROLLED MOVEMENT AREA, DO NOT ENTER OR CROSS TAXIWAY CHARLIE. AS AUTHORIZED BY TOWER, CROSSINGS WILL BE DONE AT JAMES AVENUE, TAXIWAY PAPA OR TOWWAY GOLF."

11.5.9.3. Provide an available aircraft for MAAS certification, as required.

11.5.10. 8 CES/CEOFP.

11.5.10.1. Support MAAS certification with aircraft engagement.

11.5.10.2. Report any MAAS equipment issues that prevent certification to AMOPS.

11.5.10.3. Return MAAS equipment to operational configuration.

11.6. DEACTIVATION RESPONSIBILITIES.

11.6.1. SOF. Inform AOF/CC or WOC OG Representative and ATCT when ADLS aircraft operations are complete.

11.6.2. AOF/CC or OG WOC Representative.

11.6.2.1. Inform OG/CC of the conclusion of air operations to the ADLS. Request decision on ADLS deactivation and if the MAAS and EAL systems are to remain installed.

11.6.2.2. Direct ATCT to deactivate the ADLS and CMA after 8 OG/CC issues deactivation order.

11.6.2.3. Inform AMOPS of MAAS and EAL systems installation status.

11.6.3. OG/CC. Issue ADLS deactivation order to AOF/CC or WOC OG Representative.

11.6.4. ATCT.

11.6.4.1. Upon AOF/CC or WOC OG Representative notification for ADLS deactivation, notify RAPCON of ADLS deactivation.

11.6.4.2. Activate the PCAS and state, “ADLS DEACTIVATED, OPERATIONS WILL RESUME ON RUNWAY 18/36.”

11.6.4.2.1. Broadcast on all assigned frequencies and Ramp Net, “ADLS DEACTIVATED, RUNWAY 18/36 IN USE.”

11.6.4.3. Remove ADLS information from ATIS broadcast.

11.6.5. RAPCON. After notification of ADLS deactivation, RAPCON shall broadcast on UHF/VHF and Guard frequencies, “ATTENTION ALL 8TH FIGHTER WING AND 38 FIGHTER GROUP AIRCRAFT, ADLS DEACTIVATED, RUNWAY 18/36 IN USE.”

11.6.6. AMOPS.

11.6.6.1. Activate the SCN and notify all applicable agencies.

11.6.6.2. Cancel NOTAM.

11.6.6.3. Remove TCP Augmentees and collect LMRs.

11.6.6.4. Conduct airfield check to ensure return to taxiway configuration and notify ATCT after all checks are complete.

11.6.7. TCP Augmentees. Once ADLS deactivation order is received from ATCT, TCP augmentees will allow normal traffic flow to resume across Taxiway Charlie. Personnel will be collected from checkpoints and released from AMOP’s building (2958).

11.6.8. Command Post. Announce ADLS deactivation via AtHoc and the Giant Voice system:

11.6.8.1. AtHoc Message: “TAXIWAY CHARLIE MAY RESUME NORMAL VEHICLE AND PEDESTRIAN TRAFFIC.”

11.6.8.2. Giant Voice Message: “THIS IS WOLF PACK. ALTERNATE LANDING SURFACE IS DEACTIVATED. CROSSINGS OF TAXIWAY CHARLIE MAY RESUME. I SAY AGAIN… WOLFPACK OUT.”

11.6.9. 8 MXG/MOC. Inform all MX personnel that the ADLS CMA is deactivated.

11.7. AIR TRAFFIC CONTROL / AIRCREW PROCEDURES.

11.7.1. Barrier Certification Engagements.

11.7.1.1. BAK-12: Certification shall be done heading west-bound. The participating aircraft will initiate the high-speed taxi aligned with the eastern portion of the Juvat flows.

11.7.1.2. MAAS: Certification shall be done heading east-bound. The participating aircraft will initiate the high-speed taxi from the Taxiway Charlie Runway 18-36 VFR hold line.

11.7.2. Practice Approaches. Practice approaches shall not be flown to the ADLS without OG/CC approval via the SOF.

11.7.3. Simultaneous Operations. Only prior coordinated participating aircraft are authorized to utilize the ADLS, all other operations must be conducted to Runway 18/36. All aircraft arriving or departing from Kunsan AB during ADLS operations should expect delays due to operational constraints.

11.7.3.1. Separation requirements may dictate ATCT to hold aircraft outside of the Class C and/or the Tower Surface Area.

11.7.4. Formation Flights. Formation flights during ADLS departure and recovery procedures are prohibited. Aircraft will conduct a flight split with RAPCON and establish 5 NM spacing between aircraft no later than initial for Runway 18/36.

11.7.5. Separation. Full ADLS length separation will be afforded to all aircraft.

11.7.6. Weather Requirement. ADLS operations will be conducted in VMC only.

11.7.7. Departure.

11.7.7.1. Pilots should use caution for obstacles and are responsible for obstacle avoidance.

11.7.7.2. Aircrew should avoid overflight of the Gunsan Country Club and populated areas.

11.7.7.3. ADLS 06: Maintain VFR at or below 1,000’ until directed by ATCT. Once 1 NM past departure end, turn right heading 180°. Contact Kunsan Approach on Channel 4 for IFR clearance.

11.7.7.4. ADLS 24: Maintain VFR at or below 1,000’ until directed by ATCT. Once 1 NM past departure end, turn left heading 180°. Contact Kunsan Approach on Channel 4 for IFR clearance.

11.7.8. Recovery.

11.7.8.1. Execute normal VFR pattern entry procedures IAW 8FWI 13-204.

11.7.8.2. Report initial for Runway 18/36. Cross the ADLS and break appropriately for ADLS downwind. Report base. If conditions permit a landing, ATCT will respond: “(AIRCRAFT CALL-SIGN), (WIND), LOW APPROACH/LANDING WILL BE AT YOUR OWN RISK.” Otherwise, ATCT will direct a go-around.

11.7.8.3. Aircraft conducting low approach/go-around will maintain at or below 1,000’ MSL until directed by ATCT.

11.7.9. IFR Pattern Entry procedures.

11.7.9.1. If unable to reach initial using normal VFR pattern entry procedures, pilots may execute an instrument approach to Runway 18/36, maintaining at or above 1,500’ MSL.

11.7.9.2. Once able to establish VFR; cancel IFR and proceed VFR IAW paragraph 7.8.

11.7.9.3. If unable to maintain VFR upon reaching 1,500’ MSL, execute published/issued missed approach instructions.

11.7.10. Taxi Instructions.

11.7.10.1. Departures: ATCT will issue taxi instructions to ADLS 06/24.

11.7.10.2. Expected arrival taxi routes:

11.7.10.2.1. ADLS 24: Aircraft shall taxi to the end, exit into the south overflow (“DV South”) and contact Ground for taxi instructions to park.

11.7.10.2.2. ADLS 06: Aircraft shall taxi to the end and exit Wizard Ramp as able, then contact ground for further taxi instructions.

11.7.10.2.3. ATCT may provide differing taxi routes as required.

11.8.11. AIRCRAFT EMERGENCIES

11.8.11.1. IFEs. If Runway 18/36 is useable, it will be made available for aircraft recovery.

11.8.11.1.1. Emergency Aircraft may utilize the ADLS for recovery if determined to be the safest recovery option. Emergency Aircraft must declare landing intentions.

11.8.11.2. Ground Emergencies.

11.8.11.2.1. Hot Brakes. If the aircraft is not stopped by the arresting cable, the pilot will be directed either to the North/South Overflow or the hammerhead of Taxiway H.

11.8.11.2.2. Hot Guns. The aircraft will be directed as far north or south along Taxiway P as possible, into the North/South EOR or HCP if available. All aircraft will face west.

11.9. VEHICLE OPERATIONS

11.9.1. Preparation Phase. Vehicle, bicycle, personal transportation devices and pedestrian traffic may cross Taxiway C.

11.9.2. Activation Phase.

11.9.2.1. After ADLS Activation and until ADLS Deactivation, all non-essential vehicle, bicycle, personal transportation devices and pedestrian traffic on Taxiway C will cease. Vehicles and personnel without an operational need to cross the ADLS will use perimeter road to circumnavigate the ADLS.

11.9.2.2. ADLS Crossing Procedures:

11.9.2.2.1. At the discretion of ATCT, ADLS crossings may be authorized at James Avenue, Taxiway P and Towway Gulf (TCPs #1-6). See Attachment 2.

11.9.2.2.1.1. ATCT shall broadcast on the Ramp Net, “ADLS CROSSINGS MAY OCCUR AT CPs 1-6, ALL TCPs ACKNOWLEDGE.” TCP Augmentees will acknowledge by stating, “TCP [X].”

11.9.2.2.1.2. AMOPS will stage a vehicle at the intersection of Taxiway P and C to monitor all crossings of the ADLS.

11.9.2.2.1.3. ATCT will authorize bicycle, personal transportation devices and pedestrian traffic by stating, “PTD CROSSINGS PERMITTED AT THIS TIME.”

11.9.2.2.2. ATCT will prohibit crossings by stating, “AIRCRAFT OPERATIONS IMMINENT, ADLS CROSSINGS ARE PROHIBITED, AFLD [X] PROCEED ONTO ADLS AND REPORT ADLS STATUS, ALL TCP AGMENTEES ACKNOWLEDGE.”

11.9.2.2.2.1. TCP Augmentees will immediately cease ADLS crossings and acknowledge by stating, “TCP [X].”

11.9.2.2.2.2. AMOPS will conduct a sweep of the ADLS and as able, report the surface appearing FOD and vehicle free.

11.9.2.2.2.3. Following AMOPS’ report, ATCT may permit operations to occur to the ADLS.

11.9.2.2.3. Deactivation Phase. After ADLS Deactivation, vehicle, bicycle, personal transportation devices and pedestrian traffic may resume normal crossings of Taxiway C.

11.9.2.2.4. Emergencies. Emergency Response Vehicles including Fire Trucks, Ambulances, SFS, AMOPS, EOD and emergency maintenance response units may only access the ADLS with prior ATCT approval.

Chapter 12

MISCELLANEOUS PROCEDURES

12.1. Airfield Operations Board (AOB).

12.1.1. General: IAW AFMAN 13-204V1, the AOB provides a forum for discussing, updating and tracking various activities in support of the base flying missions. This chapter combines AFMAN 13-204 guidance with local procedures to establish board membership and actions.

12.1.2. Frequency: The board is chaired by the 8 OG/CC and will convene at least once per quarter; however, the 8 OG/CC may summon the board anytime. Identified board members are required to attend, if unable a proxy shall be assigned. Additional representatives are encouraged to attend.

12.1.3. Membership:

8 OG/CC (Chairperson)
8 MSG/CC
8 FW/SE
8 FW/CP
8 OG/OGV
35 FS/CC
80 FS/CC
Transient flying units (as required or present for more than 3 months)
8 CES/CC
8 CES/CEI
8 CES/CEO
8 CES/CEN
8 CES/CENM
8 OSS/CC
8 OSS/OSA (Facilitator)
8 OSS/OSW
8 SFS
ROKAF 111 FS/CC
ROKAF 38 FG/SE
Gunsan City Airport Manager

12.1.4. Agenda: Prior to the AOB, 8 OSS/OSA will electronically distribute the agenda, to include date, time, place, mandatory agenda items and other pertinent issues.

12.1.4.1. OPRs should provide updates to 8 OSS/OSA to all open agenda items NLT seven days prior to AOB.

12.1.4.2. Items Requiring Annual Review:

12.1.4.2.1. 1st Quarter: Terminal Instrument Procedures Specialist (TERPS) and Status of Existing Airfield Waivers.

12.1.4.2.2. 2nd Quarter: Local Operating Procedures.

12.1.4.2.3. 3rd Quarter: Aircraft Parking Plan and Annual Self Inspection.

12.1.4.2.4. 4th Quarter: Airfield Certification/Safety Inspection.

12.1.4.2.5. Special Interest Items will be briefed as required.

12.1.4.2.6. 8 CES maintains a waiver for exempting Kunsan AB from Air Installation Compatible Use Zones studies.

12.1.5. 8 OSS/OSA shall publish/distribute the AOB minutes within 20 working days IAW AFMAN 13-204V1.

12.2. NOTAM Procedures. AMOPS is designated as the base NOTAM authority IAW AFMAN 13-204V2. RAPCON is designated as the NOTAM monitoring facility IAW AFMAN13-204V1. AMOPS shall process NOTAMs according to AFI 11-208_IP. The Korean airspace or air base NOTAMs can be found at http://ais.casa.go.kr or https://www.notams.faa.gov/dinsQueryWeb/ and will be used by AMOPS or any pilot filing a Korean air base as an alternate.

12.3. FLIP Accounts/Changes. To establish a FLIP account, change or submit items to be published in a FLIP, or to cancel a FLIP account, contact AMOPS at 782-4422.

12.4. Waivers to Airfield Criteria.

12.4.1. Any construction projects that violate any airfield criteria, during any phase of or upon project completion, must obtain a temporary airfield construction waiver (TACW) and digging permit prior to the start of said project. TACWs must be signed by the 8 FW/CC IAW UFC 3-260-01.

12.4.2. 8 CES must provide a signed copy of the TACW to the AFM prior to starting construction.

12.4.3. TACW requests must be submitted at least 45 days before the scheduled construction start date, or an emergency temporary waiver when 45 days are not possible.

12.4.3.1. Emergency maintenance, repair requirements and routine maintenance activities such as mowing and maintenance of airfield systems are exempt from this requirement; however,
8 CES shall coordinate with AMOPS and 8 FW/SE to ensure implementation of appropriate safety measures including NOTAMs. 8 OSS/OSA shall ensure 8 OG and 8 MXG are prepared for significant airfield construction.

12.4.4. Waivers to criteria for pending airfield contracts must be obtained before construction or when alteration contracts are finalized. For work executed by government personnel, waivers to criteria must be processed and approvals obtained before construction or alteration of facilities begins.

12.5. Official Business Only. During Wing-designated exercises, Kunsan AB will be OBO. AMOPS will disseminate OBO NOTAMS.

12.6. Unusual Aerial Maneuvers. Unusual aerial maneuvers are high-speed passes (to include carrier breaks), hover landings and takeoffs for V-22s over approved surfaces, aerobatic flight, airfield demonstrations, maximum or quick climbs for non-base assigned aircraft, random entry SFO's, etc. F-35B (USMC variant) & other like aircraft (ex AV-8) are prohibited from vertical takeoff and hovering operations. Unless essential to 8 FW flight safety, unusual aerial maneuvers shall not be approved without prior ATC or AMOPS (as required) coordination and 8 OG/CC approval. OPR should make requests to 8 OG/CC NLT 2 weeks in advance.

12.7. Arriving Aero-medical Evacuation (AIREVAC/DUSTOFF) Notification and Response Procedures.

12.7.1. After receiving initial inbound notification, AMOPS shall notify: TA, AFM, AOF/CC, 8 OMRS/SGXF (0800-1700 Mon-Fri) and 8 HCOS/SGGE (After hours 1700-0800 and weekends), 8 SFS, 8 CES/CEF, ATC and 8 FW/CP of ETA, servicing requirements and parking.

12.7.2. Parking: TA Pad (Primary) or intersection of Taxiway E and the Taxiway P (Alternate).

12.7.3. RAPCON shall notify AMOPS when aircraft are 20 miles out. AMOPS relays 20-mile call to TA, 8 FW/CP and 8 MDOS/SGOFG.

12.8. Unscheduled/Unauthorized Aircraft Arrivals.

12.8.1. AOF/CC is the approval authority for determining if an aircraft with no flight plan or PPR will be authorized to land.

12.8.2. When dealing with an unscheduled arrival, ATC shall:

12.8.2.1. Contact AMOPS to determine if a flight plan was filed or PPR was approved or denied.

12.8.2.2. Recommend aircraft contact AMOPS via Pilot-to-Dispatch for coordination (VHF: 132.25; UHF: 247.1).

12.8.3. If AMOPS cannot contact the aircraft, ATC shall pass the following information to AMOPS: Callsign, tail number, type of aircraft, departure point, type of clearance and where the flight plan was filed or when the PPR was requested.

12.8.4. If AMOPS verifies PPR approval, ATC may issue landing clearance.

12.8.5. If AMOPS verifies PPR disapproval, ATC shall not issue landing clearance.

12.8.6. If an aircraft lacking PPR or flight plan lands, ATCT shall activate the PCAS and direct aircraft to hold at Taxiway E or A until the issue is resolved.

12.8.7. AMOPS shall process unauthorized civil landings IAW AFI 10-1001. For unauthorized military landings, AMOPS shall process a PPR and flight rules violation IAW AFMAN 13-204V2 and forward to the violating aircraft's unit commander for action.

12.9. DV Notification Procedures.

12.9.1. Upon receiving notification that a DV will arrive or depart Kunsan AB via airlift, AMOPS shall obtain at least the following information: date, callsign, aircraft type, ETA/ETD, departure point, destination, rank and last name of DV, DV codes or honors, title and Point of Contact (POC) information. AMOPS shall then notify 8 OSS/CC, AOF/CC, AFM, ATCT, RAPCON, Wing Protocol, 8 FW/CP, TRANS, ROKAF CP, TA, 8 SFS and immigrations.

12.9.2. RAPCON shall advise AMOPS of DV aircraft position at 30 flying miles or as soon as possible after radar identification has been established. AMOPS shall pass DV aircraft position to 8 OSS/CC, 8 FW/CP, TRANS, ROKAF CP, TA and 8 SFS. 8 FW/CP shall notify commanders IAW their DV checklists.

12.9.3. ATCT shall notify AMOPS once DV aircraft has landed and AMOPS shall pass required information to appropriate agencies per their checklists.

12.9.4. Time and workload permitting, 8 FW/SOF should notify 8 OG/CC or designated representative upon arrival.

12.9.5. Other base agencies requesting DV aircraft information should contact 8 FW/CP.

12.10. Dangerous/Hazardous Cargo. See **Attachment 15**.

12.10.1. The Hot Cargo Pad is the primary hazardous cargo parking area for NEW 1.1 and 1.2 over 10,000 lbs. The TA Pad is limited to less than 10,000 lbs. NEW 1.3 and unlimited 1.4.

12.10.2. When Runway 36 is in use, ATCT shall direct aircraft to back-taxi to the Hot Cargo Pad or TA Pad depending on type and weight of hazardous material.

12.11. Airfield Photography.

12.11.1. All personnel requesting to take photos on the airfield must have a letter of approval from 8 FW/PA prior to taking any photos on the airfield. Requests should be submitted for approval at least seven days prior to event. 8 FW/PA is authorized to escort media and tour groups who may photograph or videotape. Drivers/vehicles must abide by DAFI13-213_8FWSUP, *Airfield Driving*. 8 FW/PA must notify AMOPS when they will be conducting shoots/events on the airfield.

12.11.2. All personnel assigned to the 8 OSS Airfield Operations Flight and 8 CES are authorized to take photographs for official business on the airfield after coordinating with AMOPS.

12.11.3. Specific procedures and guidelines for airfield photography are identified in 8 FW IDP 31-1, I*ntegrated Defense Plan.*

12.12. NVD Operations. Kunsan can support the unique training requirements of NVD operations in blacked-out airfield conditions.

12.12.1. Scheduling. Requesting units must contact AMOPS or designated representative two weeks in advance to coordinate NVD operations. Advise AMOPS of any obstructions, obstacles, or hazards to be placed on the airfield that may affect the airfield environment. This will allow AMOPS time to issue pertinent NOTAMS. All proposed NVD mission times are coordinated in advance with 8 FW Scheduling. This will help de-conflict operations, eliminate confusion and reduce delays to NVD mission aircraft.

12.12.2. NVD Weather Requirements. All NVD operations shall be conducted in VMC. The pattern weather requirements are 1,500 ft ceiling and 3 miles visibility. Moon illumination requirement is 2.2 millilux or higher.

12.12.3. NVD Taxi Routes and Traffic Pattern Procedures. Aircraft Commander must always comply with exterior lighting requirements. Anti-collision lights may be turned off, safety permitting.

12.12.3.1. There are no restrictions to NVD taxi routes except those listed in Chapter 2 but taxiway lights must be operated IAW FAAO JO 7110.65 prior to non-participating aircraft taxiing.

12.12.3.2. The VFR traffic pattern is right traffic for Runway 18, left traffic for Runway 36. Pattern altitude for both runways is 1000 feet MSL. ATCT will limit the number of aircraft in the VFR pattern to three. Tower controllers are not authorized to use NVDs while controlling aircraft. During blackout operations, ATCT's ability to visually track aircraft and scan the runway and surface area is significantly degraded. Class C service will not be provided, ATCT service is limited to traffic advisories only.

12.12.3.3. Participating aircraft must utilize navigation lights.

12.12.4. Vehicle Operations. Vehicle operations on the CMA should be kept to a minimum during NVD operations. This is to prevent aircraft mission delays and reduce the possibility of runway incursions during reduced airfield lighting configurations. Any operational requests not listed in this operating instruction will be published in an LOP with the effected unit. If vehicle operations are required, vehicles will use parking lights while in transit and turn off all lights when stopped.

12.12.5. Responsibilities.

12.12.5.1 AMOPS shall:

12.12.5.1.1. Inform AOF/CC or ATCT CCTLR of scheduled NVD operations.

12.12.5.1.2. Inform NVD operators of any conflicts to planned operations as soon as they arise.

12.12.5.1.3. Perform a runway and affected taxiway check to ensure all foreign objects, landing zone lights, markers, etc. have been removed after completion/suspension of the NVD operation and prior to any non-participating aircraft using the affected area.

12.12.5.1.4. Cancel associated NOTAMS when no longer required.

12.12.5.2. ATCT shall:

12.12.5.2.1. Advise RAPCON of the aircraft callsign/type and the duration of the NVD operation, i.e. one approach, 15 minutes, etc. and request IFF squawk from RAPCON, unless the NVD operation originates with RAPCON.

12.12.5.2.2. Turn off airfield lighting except the rotating beacon during NVD operations if blackout/no light operations are requested. If a NOTAM is issued to blackout the airfield, the rotating beacon may be turned off.

12.12.5.2.3. Hold non-participating aircraft outside the TSA or in parking. Advise non-participating aircraft of NVD operations.

12.12.5.2.4. Issue ATIS advisory, concerning type of operations being conducted and duration.

12.12.5.2.5. Suspend NVD operations prior to a non-participating IFR arriving aircraft reaching a minimum of 15 flying miles from the airport, a VFR aircraft entering the TSA, or a departing aircraft beginning to taxi. This allows the runway edge and taxiway lights to be turned on IAW FAAO JO 7110.65.

12.12.5.2.6. Suspend NVD operations at any time deemed necessary for safety reasons.

12.12.5.2.7. Advise all NVD participants prior to turning on any airfield lighting. If able, provide this advisory 10 minutes prior.

12.12.5.2.8. Advise AMOPS when operations are complete or suspended so they can check to ensure all FOD has been removed from runways/taxiways before normal operations are resumed.

12.12.5.2.9. Use the following phraseology: "*UNABLE TO ISSUE DEPARTURE/ LANDING/ TOUCH-AND-GO CLEARANCE. DEPARTURE/ LANDING/ TOUCH-AND-GO WILL BE AT YOUR OWN RISK"*

12.12.5.2.10. Tower cab lighting should be kept to the minimum for normal ATCT functions.

12.12.5.3. RAPCON shall:

12.12.5.3.1. Advise ATCT as soon as possible upon receipt of a request from an aircraft to conduct NVD operations.

12.12.5.3.2. Provide/relay to ATCT traffic advisories that will affect participating NVD aircraft outside the TSA.

12.12.6. Emergency and Safety Termination of NVD Operations**.** Any agency may call *"KNOCK IT OFF"* if a safety concern is raised. NVD operations will be terminated if any participating/non-participating aircraft emergency is anticipated or declared.

12.13. Local Aircraft Priorities.

12.13.1. Emergency Aircraft.

12.13.2. Emergency War Order (EWO) Launch.

12.13.3. Scrambles.

12.13.4. Classified Missions.

12.13.5. Silent Launch.

12.13.6. Flight Check.

12.13.7. Gunsan Airport Aircraft.

12.13.8. DV Aircraft.

12.13.9. Practice Scrambles.

12.13.10. Controlled Departures.

12.13.11. Local Exercise Recoveries.

12.13.12. Full Stop Landings.

12.13.13. Local Exercise Launches.

12.13.14. Departures.

12.13.15. Practice Approaches.

12.13.16. Opposite direction practice approaches.

12.13.17. Remotely Piloted Aircraft (RPA)/Unmanned Aerial System (UAS) operations.

12.13.18. ATC has authority to modify local priorities to accommodate real-time needs to expedite the flow of traffic.

12.14. Lost Communications Instructions. Outlines aircraft lost communications and ATC radio failure or unavailability procedures.

12.14.1. 8 FW Aircraft Lost Communications:

12.14.1.1. Aircraft should squawk transponder code 3/A-7600, monitor Approach Control (292.65/124.1), ATCT (292.3/126.5) and Guard.

12.14.1.2. IFR aircraft shall:

12.14.1.2.1. Outside 25 DME from Kunsan AB, aircraft shall:

12.14.1.2.2. Climb/descend to 13,000 ft MSL and proceed direct the Initial Approach Fix (IAF) of the last known active runway.

12.14.1.2.3. Hold as published until takeoff time plus 45 minutes unless otherwise notified.

12.14.1.2.4. Execute the TACAN/ILS approach to last known active runway.

12.14.1.2.5. Check with ATCT for light gun signals on final.

12.14.1.3. Inside 25 DME from Kunsan AB, aircraft shall:

12.14.1.3.1. Maintain last assigned altitude or 4,000 ft MSL, whichever is higher.

12.14.1.3.2. Intercept the KUZ 13 DME arc.

12.14.1.3.3. When established on a segment of the TACAN or localizer, execute the TACAN/ILS approach to the last known active runway.

12.14.1.3.4. Check with ATCT for light gun signals on final.

12.14.2. RAPCON radio failure or radio unavailability procedures vary based on Daegu/Incheon ACC ability to provide IFR services and ACC is unable to provide services below 7,000ft. The following procedures are available:

12.14.2.1. IFR aircraft at or above 7,000' MSL shall:

12.14.2.1.1. All Kunsan AB assigned aircraft unable to recover VFR will be instructed by Daegu/Incheon ACC to enter a 6 DME arc holding pattern off the Kunsan VORTAC. Aircraft will be vertically separated by 1,000ft starting at 7,000ft. Aircraft will remain in the 6 DME arc holding pattern until further instructions are provided by Kunsan Approach Control once airspace control has been resumed.

12.14.2.1.2. All IFR aircraft with destinations other than RKJK will be routed to their destination by Daegu/Incheon ACC until Kunsan Approach Control has resumed airspace control.

12.14.2.2. IFR aircraft at or below 6,000' MSL shall:

12.14.2.2.1. All IFR aircraft unable to recover VFR will utilize 293.525 (Local Channel 4) as a Common Traffic Advisory Frequency (CTAF)/Universal Communications (UNICOM) frequency to enter a 6 DME arc holding pattern off the Kunsan VORTAC. Aircraft will be vertically separated by 1,000ft starting at 3,000ft up to 6,000ft. Aircraft will remain in the 6 DME arc holding pattern until further instructions are provided by Kunsan Approach Control once airspace control has been resumed.

12.14.2.2.2 All IFR aircraft unable to enter a 6 DME arc off the Kunsan VORTAC will utilize 293.525 (Local Channel 4) as a CTAF/UNICOM frequency to de-conflict with other IFR aircraft until reaching 7,000' MSL, then contact Daegu/Incheon ACC.

12.14.3. All 8 FW VFR aircraft during lost communications and RAPCON radio failure shall:

12.14.3.1. Maintain VFR and proceed at the appropriate VFR altitude to the VFR entry point for the last known active runway.

12.14.3.2. Fly initial at 1000 ft MSL and rock wings until departure end of runway.

12.14.3.3. Turn downwind, climb to 1500 ft MSL and configure aircraft for landing.

12.14.3.4. Check with ATCT for light gun signals on base and final.

12.15. Standard Climb-Out Instructions. ATC shall state, *"Execute local climb out"* to abbreviate the following clearance: *Fly runway heading, climb and maintain at or below 1,000 ft until departure end of runway, then climb and maintain 4,000 ft. At 3 DME, turn right/left heading zero-niner-zero.* ATC shall only use abbreviated standard climb-out phraseology to base assigned/sponsored aircraft. See **Attachment 8**.

12.16. Opposite Direction Take-Offs and Landings.

12.16.1. Arrival vs. Arrival. An opposite direction IFR/VFR arrival shall proceed no closer than 10 flying miles from landing threshold before the opposing IFR/VFR aircraft lands.

12.16.2. Arrival vs. Departure. An opposite direction IFR/VFR arrival shall proceed no closer than 10 miles from landing threshold before an opposing departure IFR/VFR aircraft becomes airborne and has turned to ensure required separation.

12.16.3. Departure vs. Arrival. An opposite direction departure shall not take off if an arriving aircraft is within 10 miles of landing threshold.

12.16.4. Opposite Direction Traffic Involving VFR Pattern Aircraft. The aircraft in the VFR traffic pattern shall not be allowed to turn base until the IFR/VFR opposite direction departure is beyond the VFR pattern base leg.

12.17. Breakout/Go Around/Missed Approach.

12.17.1. Breakout instructions shall be issued when aircraft cannot proceed within three miles of the airfield. ATC shall instruct aircraft to climb and maintain 3000 ft, passing 2500 ft turn left/right heading 090 or as coordinated.

12.17.2. Go-around instructions shall be issued when a landing clearance cannot be issued, but when flight over the airfield is possible. ATC shall instruct the aircraft to cross the departure end of the runway at or below 1,000 ft, fly runway heading and then climb to 3,000 ft.

12.17.3. Missed Approach shall be executed IAW the published approach procedure unless ATC issues other instructions.

12.18. Civilian Aircraft Operations.

12.18.1. Kunsan does not have Aero Club operations.

12.18.2. Scheduled Traffic. Memorandum of Understanding (MOU) approved commercial airlines. 8 OG/CC is the approval authority for all proposed flight schedules per "*Joint Committee Memorandum, ROK Request for Continued Limited Joint Use of Kunsan Air Base by Korean Domestic Air Carriers, Task No. 3372."*

12.18.3. Non-Scheduled Traffic. ATCT shall not issue a landing clearance to non-scheduled traffic (except emergencies) unless an approved PPR and civil aircraft landing permit number/aircraft landing authorization number is on file and verified by AMOPS. See AFI 10-1001 for procedures.

12.19. Civil Use of Military NAVAIDs. Civilian aircraft may use NAVAIDs and make practice approaches to a low approach during periods of light flying with approved PPR, provided military aircraft are not delayed.

12.20. Weather Dissemination and Coordination Procedures.

12.20.1. ATCT and RAPCON receive local weather observations and hazardous/severe weather notification via the Airfield Automation System (AFAS). When the AFAS is out of service,
8 OSS/OSW shall relay information via ring line. Additional procedures are identified in 8 FWI 15-101*, Weather Support Procedures.*

12.20.2. AMOPS personnel are responsible for disseminating hazardous/severe weather and lightning information via the secondary crash net. AMOPS will conduct an airfield inspection after the termination of a weather warning. AMOPS will close/suspend any areas on the airfield that present an unsafe condition. AMOPS will issue NOTAMS as required.

12.20.3. Lightning Procedures.

12.20.3.1. Lightning Watch. Informative only and will be issued when lightning is forecast to be within a 5NM radius of the airfield in the next 30 minutes.

12.20.3.2. Lightning Warning. Issued when lightning is observed within a 5NM radius.

12.20.3.3. When there is an active Lightning Warning for observed lighting within 5NM of Kunsan AB, the following restrictions will occur:

12.20.3.3.1. Cease all airfield activity, including refueling and evacuate personnel from the airfield to indoor cover or at a minimum to an airfield vehicle.

12.20.3.3.2. Aircraft will not be armed or de-armed. Aircraft in chocks may remain running or shutdown so personnel may clear the airfield to safety in an expeditious manner.

12.20.3.3.3. Taxiing aircraft will contact the SOF for guidance to either continue taxiing or return to EOR (primary) or parking (secondary).

12.20.3.3.4. Aircraft will not takeoff, land or fly approaches. If airborne, aircraft will hold until approaching divert fuel, then divert.

12.20.3.3.5. The SOF may waive Lighting Within 5NM restrictions as outlined in the interest of flight safety based on situational awareness and the operational risks.

12.20.3.4. AMOPS will close the aerodrome to all air traffic during hazardous weather such as tornadoes or typhoons. AMOPS will issue NOTAMS as required.

12.21. Airfield Snow Removal Operations. 8 OSS/OSA/OSAA are members of the Snow and Ice Control Committee (S&ICC). Specific snow removal/coordination procedures are identified in the Kunsan AB Snow and Ice Control Plan maintained by 8 CES. IAW the Snow and Ice Control Plan, 8 CES is required to coordinate all snow removal operations on the airfield with AMOPS prior to conducting operations, whether they are manual or chemical.

12.21.1. Snow removal priorities should be set prior to snow events to the greatest extent possible based on the flying mission requirements.

12.21.2. Changes to the airfield's snow removal priorities must be requested through AMOPS.

12.22. Local BASH Program Guidelines. Specific procedures and program guidelines are identified in 8 FW BASH PLAN 91-212.

12.23. Bird Watch Conditions (BWC). During normal 8 FW flying operations, the 8 FW SOF declares the BWC. AFM or AMOPS, as AFM designated representatives, declare BWC during all other periods. BWC Phase I & II information can be found in the Flight Information Publications.

12.23.1. BWC Low: Normal bird activity on or above the airfield with a low probability of hazard. Normal flying operations authorized.

12.23.2. BWC Moderate: Increased bird population in locations that represent an increased potential for strike. This condition requires increased vigilance by all agencies/supervisors and caution by pilots. No formation takeoffs/landings. Low approaches are restricted to 500 ft AGL (550 ft MSL).

12.23.3. BWC Severe: High bird population on or immediately above the active runway or other specified location that represents a high potential for strike. Takeoffs and landings by 8 FW aircraft are limited to mission critical operations and must be approved by 8 OG/CC or designated representative.

12.24. SOF Operating from the Control Tower.

12.24.1. 8 FW/SOF represents 8 OG/CC and is the focal point for command and control of 8 FW flight operations. Direct questions about 8 FW/SOF related policies/procedures to 8 OG/OGV. Detailed SOF procedures are outlined in AFI11-418_8FW SUP, *Operations Supervision.*

12.24.2. ROKAF 38 FG/SOF represents 38 FG/CC and is the focal point for command and control of 38 FG flight operations. Direct questions about SOF related policies/procedures to ROKAF 38 FG/CP (782-4025).

12.24.3. 8 FW/SOF shall discuss operations issues only with ATCT Watch Supervisor and RAPCON Watch Supervisor. The 8 FW/SOF may make recommendations/suggestions to ATC based on unique requirements of individual missions or knowledge of the flying schedule.

12.24.4. 8 FW/SOF may use ATC frequencies only with Tower and RAPCON Watch Supervisor approval. Once approved, transmissions will only be for safety of aircraft operation or preserving life or property. IAW AFMAN 13-204, SOFs are prohibited from issuing ATC instructions.

12.25. Drop Zone (DZ) Operations. Parachute Jumping/Equipment Drop procedures. All drops are conducted at the operational unit's own risk. All operations on Kunsan's DZs are conducted IAW the procedures outlined below. Contact the AFM or DARM for the location of Kunsan AB DZs (**Attachment 17**).

12.25.1. Coordinate with AOF through AMOPS NLT 14 days prior to DZ operations.

12.25.2. DZ operations will be conducted in Visual Meteorological Conditions.

12.25.3. Ten minutes prior to DZ operations ATC will sterilize applicable airspace. No take-offs or landings are authorized until completion. On a case-by-case basis, ATC may approve engine starts, tows and taxis.

12.25.4. AMOPS will sterilize the DZ prior to operations.

12.26. Rapid Airfield Damage Repair (RADR) Training.

12.26.1. The primary RADR training area is the 948 ft of pavement on the East end of Taxiway C. The alternate RADR training area is located on the West side of runway 18/36, near the Hot Cargo Pad. 8 CES personnel are authorized access to these areas with prior approval from AMOPS.

12.26.2**.** 8 CES Personnel shall:

12.26.2.1. Coordinate with AMOPS prior to using and/or staging on RADR training areas.
8 CES personnel will utilize perimeter road to the maximum extent possible.

12.26.2.2. Ensure the area is clean and swept after training is complete and advise AMOPS when departing the RADR training area. Items must be removed from the RADR site when no longer required (i.e. no longer than 24hr after use) and must also be removed prior to any planned/unplanned ADLS activations.

12.27. Non-Standard Airfield Configurations. Non-Standard Airfield Markings consist of a unit patch and two red carpets on the transient apron, engine intake safety markings (yellow half circles) located on both arm/de-arm areas and Wolf Pack Flows, DIVE TOSS markings (black border with white filler) on both arm/de-arm areas and "Entry Point" markings throughout the airfield restricted areas.

12.28. 8 FW Scrambles.

12.28.1. Real-world Scrambles. USAF Scramble procedures will be IAW SLAMMER Ops guidance.

12.28.2. Practice Scrambles.

12.28.2.1. Upon initial notification of scramble orders from Command Post, ATCT and RAPCON will key UHF 277.2 in both facilities and monitor through termination of scramble exercise. All operations will be on UHF 277.2 unless equipment/safety deem otherwise.

12.28.2.2. AMOPS will enter flight plan for SLAMMER aircraft immediately after scramble order is given.

12.28.2.3. ATCT will clear the taxi route and coordinate with RAPCON to sterilize the arrival/departure corridor for the scramble operation.

12.28.2.4. Clearance Delivery will issue clearance to SLAMMER aircraft on UHF 277.2 when the aircraft requests the clearance.

12.28.2.5. ATCT will issue taxi and takeoff clearance on UHF 277.2 once the aircraft calls ready.

12.28.2.6. Aircraft will contact RAPCON on UHF 277.2 once airborne.

12.29. ROKAF 38 FG Scrambles.

12.29.1. Real-world Scrambles. Aircraft taxi from alert area via high-speed taxiway to Runway 36 and depart as soon as possible. When the Runway 36 tailwind component is 15

kts or greater, aircraft shall back taxi to Runway 18. Aircraft are ready for takeoff when they call for taxi. ATCT shall issue takeoff clearance immediately unless higher priority traffic dictates otherwise.

12.29.1.1. ROKAF 38 FG/CP shall:

12.29.1.1.1. Notify 8 OSS/OSAT via the direct line and UHF 292.3/ROKAF CH 3 and Airfield Management via direct line at 063-470-4422.

12.29.1.1.2. Relay scramble orders on UHF 292.3/ROKAF CH 3.

12.29.1.2. ATCT shall:

12.29.1.2.1. Upon receipt of real-world scramble notification, prepare the runway for immediate takeoff and suspend all arrivals/departures until scramble aircraft are airborne.

12.29.1.2.2. Notify RAPCON of the scramble and relay callsign, heading and altitude, if known.

12.29.1.2.3. Advise 8 FW SOF that a scramble is in progress.

12.29.1.2.4. Hold VFR aircraft at VFR holding/reporting points or send to RAPCON for holding.

12.29.1.2.5. Relay scramble orders to scramble aircraft when ROKAF 38 FG/CP radio is out of service.

12.29.1.3. RAPCON shall:

12.29.1.3.1. Suspend all approaches until scramble aircraft are airborne. Break out non-emergency aircraft on final approach.

12.29.1.3.2. Hold aircraft as needed.

12.29.2. ROKAF 38 FG Scrambles. Alert aircraft do not conduct practice scrambles. Aircraft shall taxi from ROKAF Pad to active runway and be airborne within 10 minutes of notification.

12.29.2.1. ROKAF 38 FG/CP shall notify ATCT approximately 30 minutes prior to the practice scramble start time with the following information: Callsign, number of aircraft and scramble start time.

12.29.2.2. Practice scramble orders shall be conducted as follows:

12.29.2.2.1. ATCT shall notify RAPCON of the practice scramble and relay callsign, heading and altitude, if known.

12.29.2.2.2. ATCT shall relay scramble orders to scramble aircraft when the ROKAF 38 FG/CP radio is out of service.

12.29.3. Aircraft shall call for taxi and takeoff instructions by broadcasting, *"Tower, (callsign), 2 F-16s, scramble, request taxi.*

12.30. Communication Out Launches/Silent Launch.

12.30.1. Simulated Communications Out (comm-out).

12.30.1.1. 8 OG/CC is the approval authority. Anyone may terminate silent launch for safety of flight.

12.30.1.2. Responsibilities.

12.30.1.2.1. The mission commander shall provide 8 OSS/OSA and 8 FW/SOF strike package information consisting of call-signs, flight size, radio silence time, start/taxi/takeoff times, squawks and direction of turnout via phone or mass briefing.

12.30.1.2.2. ATCT shall coordinate with RAPCON to ensure requested departure clearance is automatically activated for the scheduled takeoff time.

12.30.1.3. Start Procedures.

12.30.1.3.1. Aircraft shall start engines at briefed time.

12.30.1.3.2. Aircraft monitor appropriate ATC frequency, as briefed for each phase of operations (i.e., ground control during taxi and departure control on takeoff), after engine start.

12.30.1.4. Aircraft shall taxi in sequence to the appropriate runway IAW the briefed taxi plan. GC shall broadcast active runway, estimated winds and altimeter as each aircraft approaches Taxiway P from Taxiway C if the ATIS is out-of-service.

12.30.1.5. Takeoff.

12.30.1.5.1. Aircraft ready to takeoff shall taxi up to and hold short of the active runway and watch ATCT for light gun signals.

12.30.1.5.2. ATCT shall signal takeoff clearance with a steady green light. To cancel, ATCT shall signal the aircraft with a steady red light or if necessary, break radio silence and use ATCT or Guard frequency.

12.30.1.5.3. After ATCT issues takeoff clearance, flights shall change to departure control and shall continue to monitor departure control during takeoff and departure.

12.30.1.6. Departure.

12.30.1.6.1. If the airfield is VMC, aircraft shall depart as briefed and contact Cobra when clear of Kunsan's Class C Airspace.

12.30.1.6.2. If the airfield is IMC, aircraft shall fly runway heading until 3 DME, then turn to briefed departure heading. Flights shall use 8 FW standard radar assisted trail departure procedures and communication-in procedures.

12.30.2. Recovery. Recovery shall be communication-in. Normally, aircraft will recover as two-ship flights and establish at least a 10-mile separation between any elements and other formations to help set-up the recovery flow. If other than a two-ship, aircraft should advise RAPCON of number in flight. Flight leads shall obtain ATIS and contact approach control NLT 30 NM from Kunsan AB.

12.30.3. Abnormal Procedures.

12.30.3.1. Aircraft may terminate comm-out anytime by stating, *"Callsign, terminating comm-out."* If the reason for terminating the comm-out launch was temporary, the flight lead may resume the comm-out launch by stating, *"Callsign, resuming comm-out."*

12.30.3.2. Anyone may terminate comm-out to ensure safety of flight of any aircraft.

12.30.3.3. For emergencies, terminate comm-out; ATC shall establish radio contact with all aircraft and assume positive control.

12.31. 38 FG Silent Launch Procedures.

12.31.1 ROKAF 38 FG shall coordinate silent launch exercises/operations with the AOF/CC at least 48-hours in advance (782-5560 or 782-5565). ROKAF 38 FG shall provide callsigns, number of aircraft, initial departure heading and taxi/takeoff times. Aircraft shall squawk Mode 3/A, Code 0310-0315.

12.31.2. ROKAF 38 FG will follow procedures outlined in paragraph 12.30. of this instruction.

12.32. Exercises.

12.32.1. Wing officials must brief AOF/CC at least 48 hours in advance of exercises that involve any ATC facility or the airfield. AOF/CC must approve, in advance, exercises that include removing controllers to alternate facilities or to shelter areas. Consider traffic volume and service limitations when coordinating these exercises.

12.32.2. ATC Watch Supervisors/Senior Controllers must ensure ATC facility participation does not degrade services. Watch Supervisors/Senior Controllers may interrupt or discontinue facility participation in any exercise if flight safety is in question.

12.32.3. During a declared IFE, participation will be discontinued to ensure the safe recovery of emergency aircraft. Exercise may continue following the completion of the IFE. For Ground Emergencies, the Watch Supervisors/Senior Controllers may interrupt or discontinue facility participation.

12.33. Functional Check Flight (FCF). FCF aircraft will normally use the callsign "HI TEST" and request a maximum climb to FL 200 on departure.

12.34. Temporary Prohibited Area Restrictions for BIG TOP Movement. When the ROK President travels in Korea, the airspace surrounding his/her location is classified temporary prohibited airspace and the flight/ground vehicles are referred to as a "Temporary Prohibited Area."

12.34.1. Battle Watch Duty Officer (BWDO) sends Temporary Prohibited Area information to
8 FW/CP and AMOPS. AMOPS shall pass this information to 8 FW/SOF, ATCT, RAPCON, AOF/CC, 35 FS and 80 FS operations desks. AMOPS shall verify receipt by phone and post the message for transient aircrews.

12.34.2. While the Temporary Prohibited Area is within Kunsan airspace, ATC shall hold aircraft and recover only those approved by USFK Senior Operations Duty Officer through 8 FW/SOF or coordinated with AMOPS (e.g., emergency, fuel status). RAPCON shall not vector aircraft closer than 10 miles on either side of the ground track.

12.34.3. Scheduled air carriers are exempt from Temporary Prohibited Area restrictions.

PETER E. KASARSKIS, Colonel, USAF
Commander

Attachment 1

GLOSSARY OF REFERENCES AND SUPPORTING INFORMATION

References

AFPD 11-2, *Aircrew Operations*, 31 Jan 2019
AFPD 13-2, *Air Traffic, Airfield, Airspace and Range Management,* 03 Jan 2019
AFI 10-1001, *Civil Aircraft Landing Permits,* 23 Aug 2018
AFMAN 11-202V3_PACAFSUP, *Flight Operations*, 31 Aug 2023
AFMAN 11-230, *Instrument Procedures*, 25 Jul 2019
DAFMAN 13-201, *Airspace Management,* 10 Dec 2020
DAFI 13-213_8FWSUP, *Airfield Driving*, 30 Mar 2022
AFI 11-208, *Department of Defense Notice to Airmen (NOTAM) System,* 13 Feb 2018
AFMAN 11-2F-16V3, F-*16-Operations Procedures,* 13 Sept 2022
AFI 11-418_8 FWSUP, *Operations Supervision,* 22 Sep 2023
AFMAN 13-204V1, *Management of Airfield Operations,* 22 Jul 2020
DAFMAN 13-204V2, *Airfield Management,* 20 Sep 2024
AFMAN 13-204V3, *Air Traffic Control,* 26 Apr 2024
DAFMAN 13-204V4, *Radar, Airfield, and Weather Systems,* 13 May 2024
AFMAN 32-1040, *Civil Engineering Airfield Infrastructure Systems*, 23 Aug 2019
AFI 32-1015, *Integrated Installation Planning*, 11 Apr 2025
DAFI 91-202, *The Department of the Air Force (DAF) Mishap Prevention Program*, 10 Apr 2024
T.O. 33-1-23, *Equipment Procedures for Obtaining Runway Condition Readings,* 16 Sept 2011
FAAO J.O. 7110.65, *Air Traffic Control,* 20 Feb 2025
FAAO J.O. 7610.4*, Sensitive Procedures and Requirements for Special Operations,* 10 May 2023
FAAO J.O. 7200.23, *Processing of Unmanned Aircraft Systems Requests*, 7 Mar 2023
FAAO 6850.5, *Maintenance of Lighted Navigational Aids*, 05 Feb 2021
FAA AC 150/5340-26, *Maintenance of Airport Visual Aid Facilities,* 20 Jun 2014
UFC 3-260-01, *Airfield and Heliport Planning and Design,* 04 Feb 2019
UFC 3-535-01, *Visual Air Navigation Facilities,* 11 Apr 2017
8 FWI 15-101, *Weather Support Procedures,* 08 Apr 2020
8 FWI 21-102, *Launch and Recovery of Explosive Loaded Aircraft End of Runway Procedures and Hung Ordnance/Jammed Gun Procedures*, 17 Nov 2020
8 FWI 32-2001, *Fire Prevention Program,* 14 May 2020
8 FW Mishap Response Plan, 12 May 2022
8 FW OPLAN 91-212, *Bird/Wildlife Aircraft Strike Hazard (BASH) Plan,* 2 May 2022
8 FW OPLAN 32-1, *CE Contingency Response Plan*, 1 Oct 2024
8 FW IDP 31-1, *Integrated Defense Plan,* 1 Sep 2022

Prescribed Forms

None

Adopted Forms

DD Form 1801, *DOD International Flight Plan*

Abbreviations and Acronyms
AB—Air Base
ACC—Air Control Center
ADLS—Alternate Departure and Landing Surface
AFAS—Airfield Automation System
AFI—Air Force Instruction
AFM—Airfield Manager
AFMAN—Air Force Manual
AFPD—Air Force Policy Directive
AGE—Aerospace Ground Equipment
AGL—Above Ground Level
AIRAD— Air Advisory
ALSF—Approach Light System with Sequenced Flashing Lights
AMC—Air Mobility Command
AMOPS—Airfield Management Operations
AOB—Airfield Operations Board
AOF—Airfield Operations Flight
AOF/CC—Airfield Operations Flight Commander
ARTCC—Air Route Traffic Control Center
ASR—Availability/Restrictions for Surveillance
ATC—Air Traffic Control
ATCT—Air Traffic Control Tower
ATIS—Automatic Terminal Information System
BASH—Bird Aircraft Strike Hazard
BDOC—Base Defense Operations Center
BWC—Bird Watch Condition
BWDO—Battle Watch Duty Officer
CAC—Common Access Card
CAT—Category
CCTLR—Chief Controller
CMA—Controlled Movement Area
CP—Command Post
CTAF—Common Traffic Advisory Frequency
DAFM—Deputy Airfield Manager
DAFMAN—Department of the Air Force Manual
DASR—Digital Airport Surveillance Radar
DME—Distance Measuring Equipment
DoD—Department of Defense
DV—Distinguished Visitor
DZ—Drop Zone
EALS—Emergency Airfield Lighting System
ECAS—Emergency Close Air Support
ECM—Electronic Counter Measures
ELT—Emergency Locator Transmitter

EM—Emergency Management
EOD—Explosive Ordnance Disposal
ETVS—Enhanced Terminal Voice Switch
EPU—Emergency Power Unit
ETA—Estimated Time of Arrival
ETD—Estimated Time of Departure
EWO—Emergency War Order
FAA—Federal Aviation Administration
FAC—Forward Air Control
FAF—Final Approach Fix
FAAO—Federal Aviation Administration Order
FARP—Forward Area Refueling/Re-arming Point
FCF—Functional Check Flight
FL—Flight Level
FLIP—Flight Information Publication
FOD—Foreign Object Damage
FW—Fighter Wing
GCA—Gunsan City Airport
GS—Glide Slope
HAS—Hardened Aircraft Shelters
HIRL—High Intensity Runway Lights
IAF—Initial Approach Fix
IAW—In Accordance With
ICAO—International Civil Aviation Organization
IEMP—Installation Emergency Management Plan
IFE—In-Flight Emergency
IFR—Instrument Flight Rules
ILS—Instrument Landing System
IMC—Instrument Meteorological Conditions
ISR—Intelligence, Surveillance and Reconnaissance
JO—Joint Order
KCAS—Knots Calibrated Airspeed
KIAS—Knots Indicated Airspeed
KTS—Knots
KUZ—Kunsan AB VORTAC
LIMFACS—Limiting Factors
LOA—Letter of Agreement
LOP—Local Operating Procedures
MAAS—Mobile Aircraft Arresting System
MARSA—Military Authority Assumes Responsibility for Separation of Aircraft
MIFRAC—Minimum IFR Altitude Chart
MOA—Military Operations Area
MOCC—Maintenance Operations Control Center
MOU—Memorandum of Understanding
MRA—Minimal Risk Arrival
MSA—Munitions Storage Area


MSL—Mean Sea Level
MWD—Military Working Dog
MVA—Minimum Vectoring Altitude
NAVAID—Navigation Aid
NEW—Net Explosive Weight
NEXRAD—Next Generation Weather Radar
NLT—No Later Than
NM—Nautical Mile
NORDO—No Radio
NOTAM—Notice to Air Missions
NVD—Night Vision Device
NVR—National Airspace System Air Traffic Control Voice Recorder Replacement
OBO—Official Business Only
OI—Operating Instruction
OPR—Office of Primary Responsibility
OSC—On Site Commander
OSS—Operations Support Squadron
PAA—Practice Airfield Attacks
PACAF—Pacific Air Forces
PAPI—Precision Approach Path Indicator
PAR—Precision Approach Radar
PCAS—Primary Crash Alarm System
PIC—Pilot in Command
PMI—Preventive Maintenance Inspection
POC—Point of Contact
POFZ—Precision Obstacle Free Zone
POV—Privately Owned Vehicle
PPR—Prior Permission Required
RAPCON—Radar Approach Control
RAWS—Radar, Airfield and Weather Systems
RCR—Runway Condition Reading
RDS—Records Disposition Schedule
ROKAF—Republic of Korea Air Force
RPA—Remotely Piloted Aircraft
RADR—Rapid Airfield Damage Repair
RSC—Runway Surface Condition
RSRS—Reduced Same Runway Separation
RSU—Runway Supervisory Unit
RTB—Return to Base
RTWS—Radar Threat Warning System
RVR—Runway Visual Range
RWR—Radar Warning Receiver
SA—Situational Awareness
S&ICC—Snow and Ice Control Committee
SCN—Secondary Crash Net
SFA—Single Frequency Approach

SFO—Simulated Flameout
SLR—Slush on Runway
SM—Statute Miles
SOF—Supervisor of Flying
STARS—Standard Terminal Automation Replacement System
SUA—Special Use Airspace
TA—Transient Alert
TACAN—Tactical Air Navigation
TACC—Tanker Airlift Control Center
TACW—Temporary airfield construction waiver
TCW—Tower Control Workstation
TDY—Temporary Duty
TERPS—Terminal Instrument Procedures Specialist
TO—Technical Order
TSA—Tower Surface Area
UAS—Unmanned Aircraft Systems
UFC—Unified Facilities Criteria
UHF—Ultra-High Frequency
UNICOM—Universal Communications
UPS—Uninterruptible Power Supply
USAF—United States Air Force
VFR—Visual Flight Rules
VHF—Very High Frequency
VMC—Visual Meteorological Conditions
VORTAC—VHF Omni-directional Range Tactical Air Navigation
WR—Wet Runway
WS—Watch Supervisor

Attachment 2

TAXI FLOW AND BARRIER LOCATIONS


Figure A2.1. Taxi and Barrier Locations.

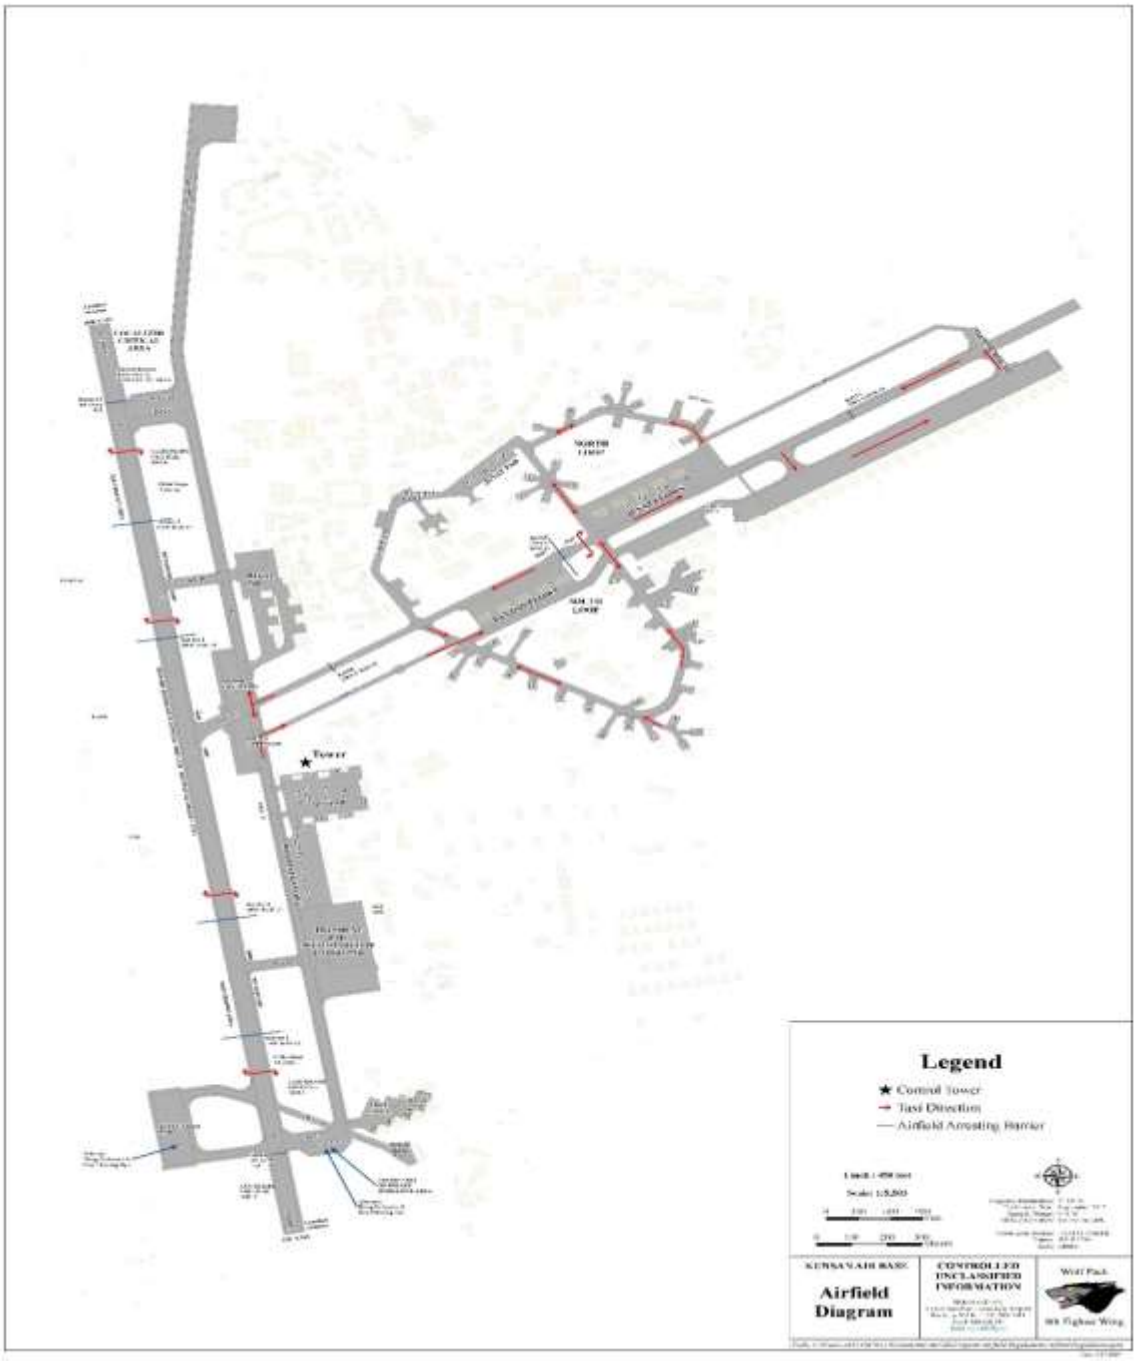


Attachment 3

HOT PITS

Figure A3.1. WOLF PACK FLOWS.

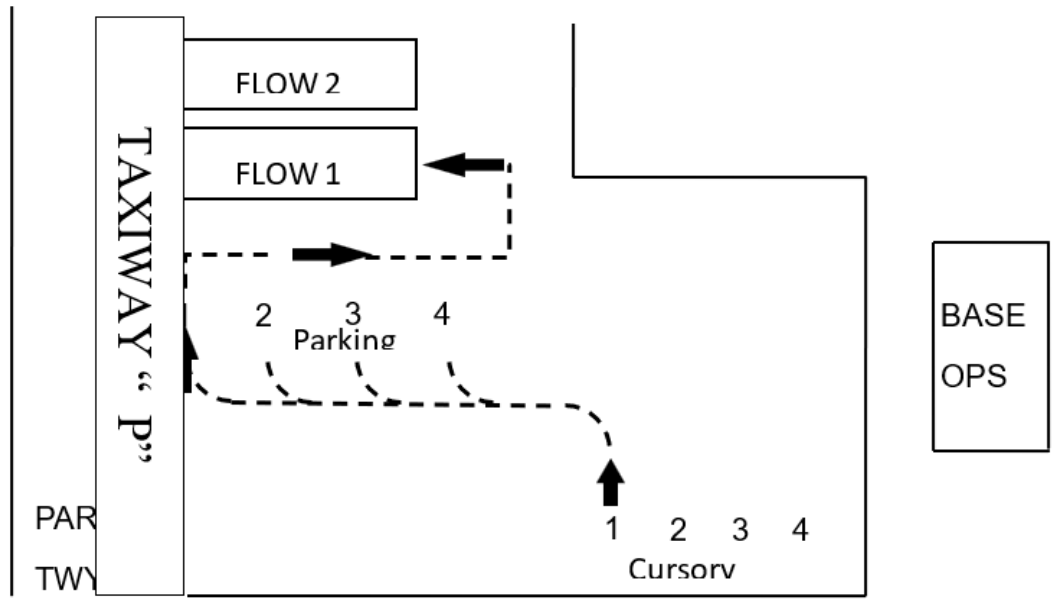


JUVAT / PANTON FLOWS

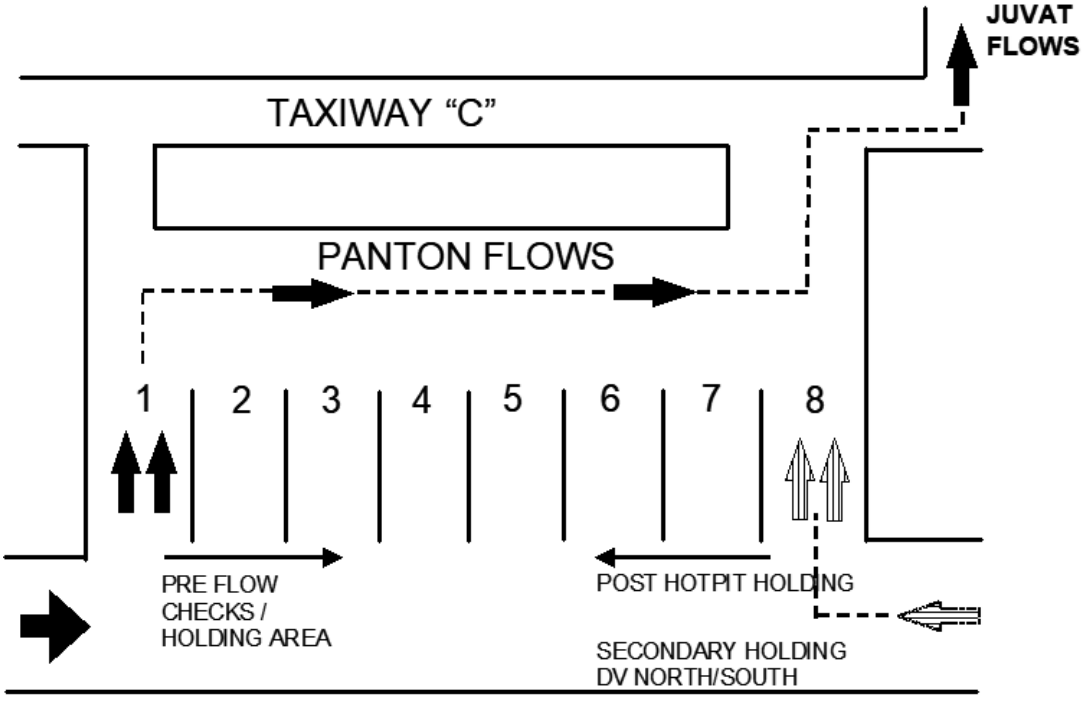

Attachment 4

VFR ENTRY POINTS


Figure A4.1. VFR Entry Points.

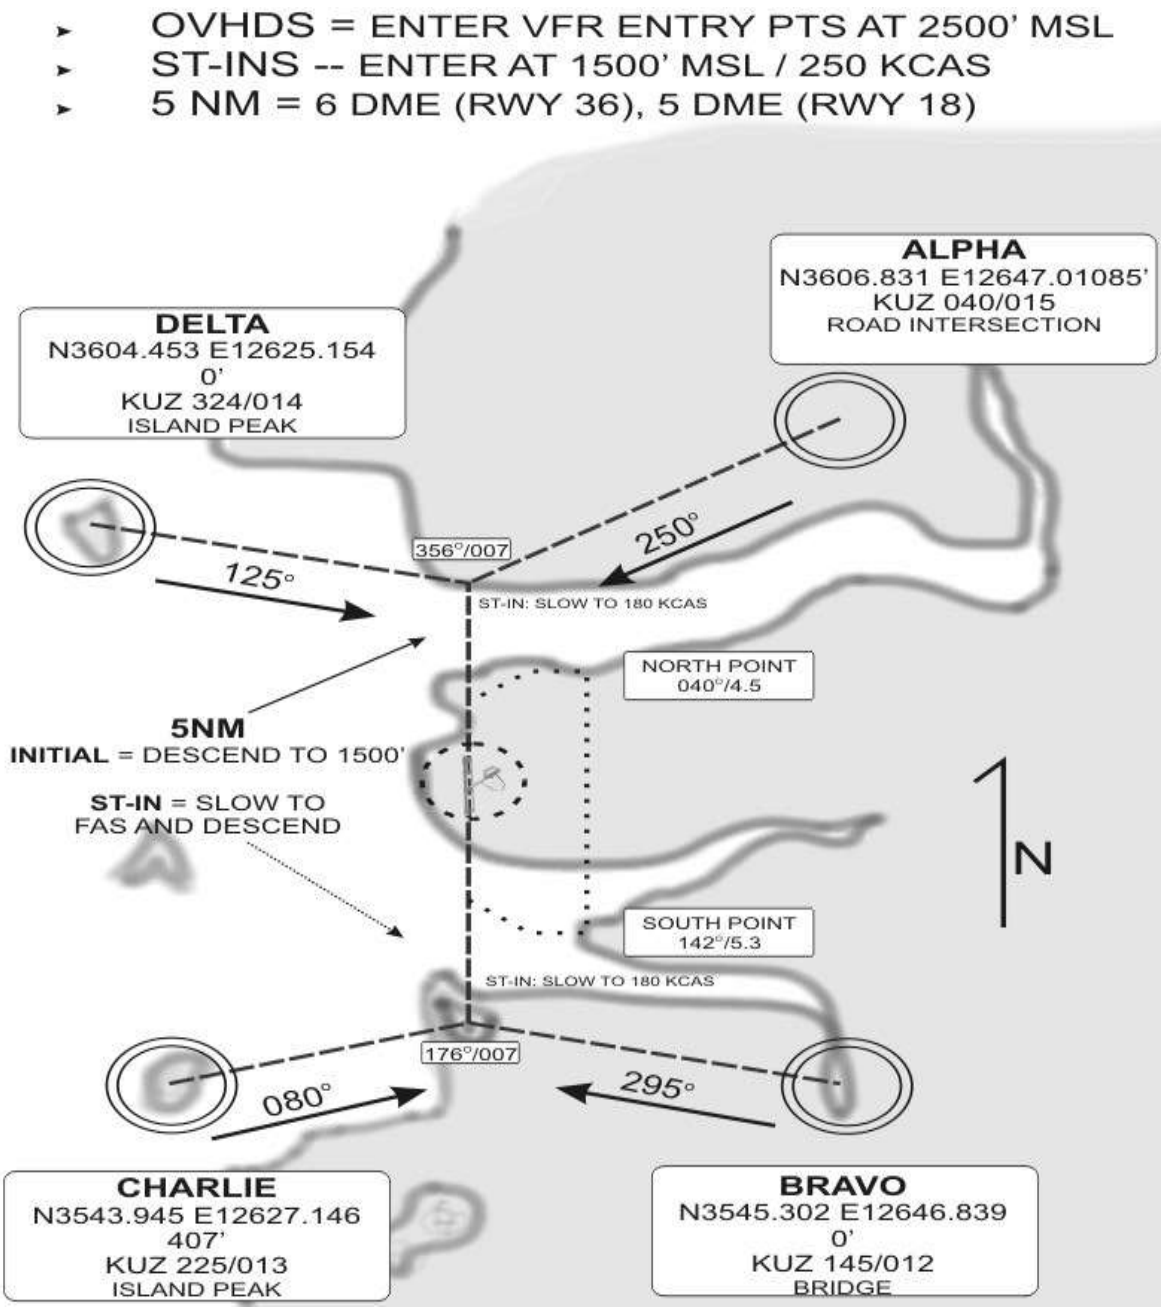

Attachment 5

VFR RE-ENTRY/BREAKOUT PROCEDURES


Figure A5.1. VFR Re-Entry/Breakout Procedures.

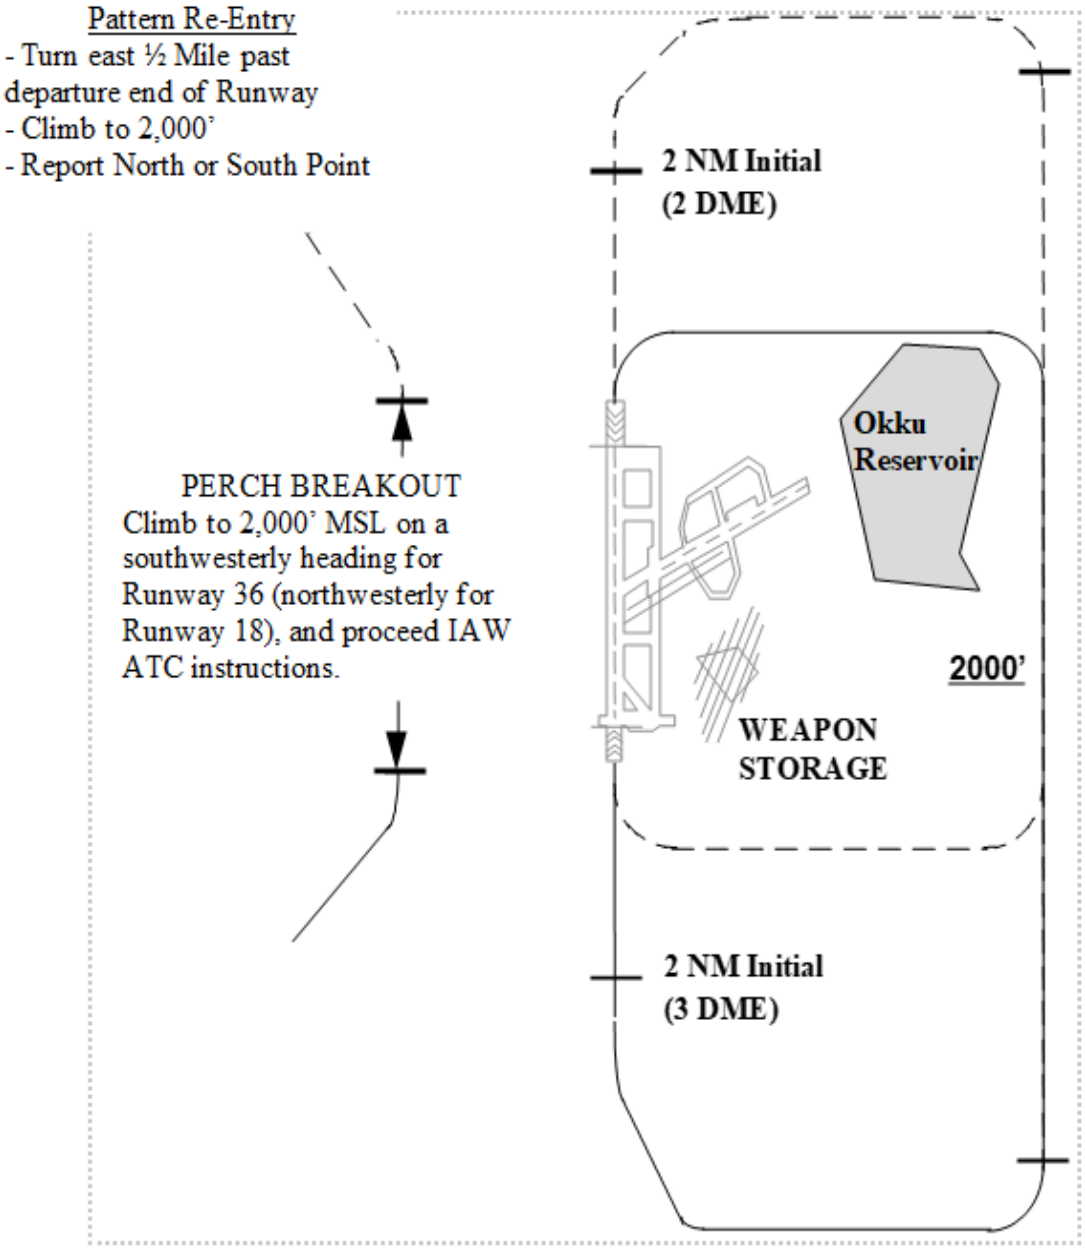

Attachment 6

OVERHEAD / F-16 SFO PATTERNS / CONTROLLED BAILOUT / JETTISON AREA

Figure A6.1. Overhead/F-16 SFO Patterns/Controlled Bailout / Jettison Area.

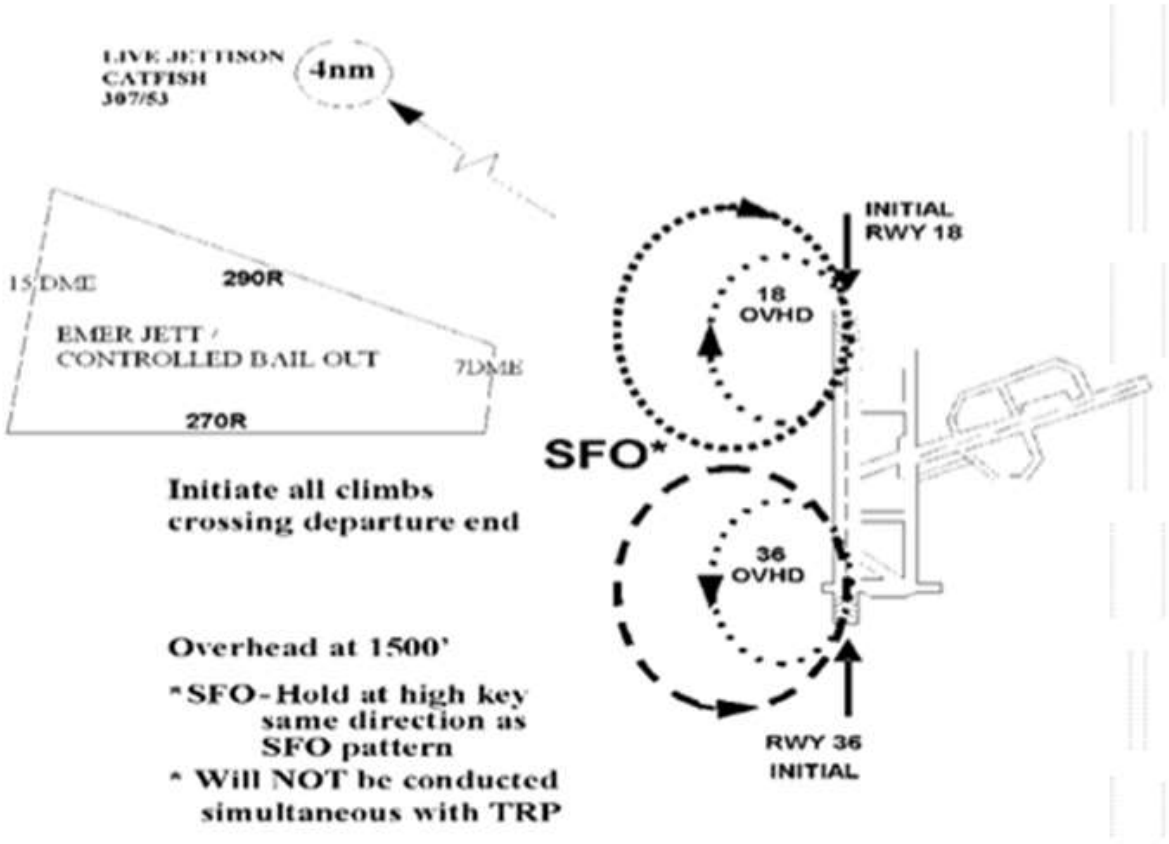

SFO
- AS DEPICTED
- "HOLD AT HIGH KEY"
- FLY 360° OVERHEAD PATTERN TO WEST
- STATE HOLDING ALTITUDE

ST-IN SFO
- REQUEST WITH ATC ON INITIAL CONTACT
- BE WITHIN 10° OF RUNWAY CTRLINE AT 10NM
- CALL "10 MILE STRAIGHT-IN SFO"


**NOTE:* WILL NOT BE CONDUCTED SIMULTANEOUS WITH TACTICAL RECOVERY PROCEDURE

Attachment 7

LOCAL DEPARTURE TRANSITIONS

A7.1. Procedures: Fly runway heading, maintain at or below 1,000 ft MSL until past the departure end of the runway and then climb to clearance altitude. At 3 DME, turn in the shortest direction to the first point on the Pack Flight Plan.


Figure A7.1. Local Departure Transitions.

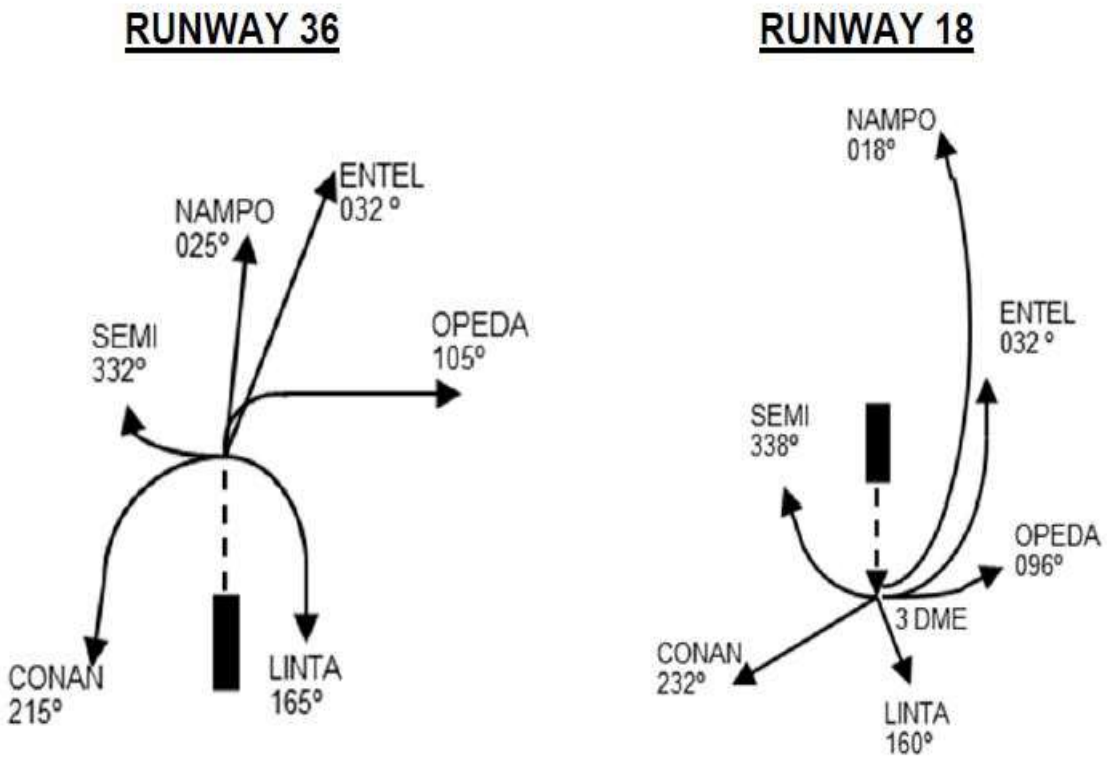

Attachment 8

LOCAL CLIMBOUT

Figure A8.1. Local Climbout.

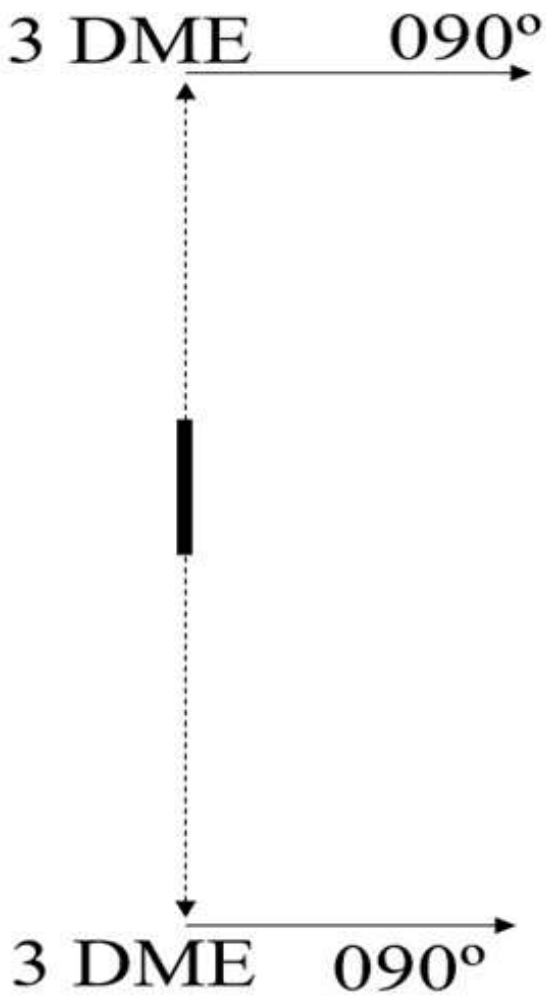

Local Climb-Out for IFR Approaches.
Fly runway heading, climb and maintain at or below 1,000 ft until the departure end of the runway, then climb and maintain 4,000 MSL. At 3 DME, turn east to a 090° heading.


Attachment 9

COMBAT DEPARTURES

A9.1. Inform ground control of Combat Departure request when calling for taxi.

A9.1.1. Arm up chaff and flares prior to takeoff IAW 8 FW Standards (combat only).
A9.1.2. A/B takeoff, stay below 1000’ MSL while accelerating in AB to 400 KCAS.
A9.1.3. Once at 400 KCAS, set pitch as required to climb in AB and maintain 400 KCAS.
A9.1.4. Passing 10000’-11000’, attain a normal climb profile to ATC assigned altitude.
A9.1.5. Establish departure heading by 5 DME and slow to enroute airspeed.

Figure A9.1. Combat Departures.

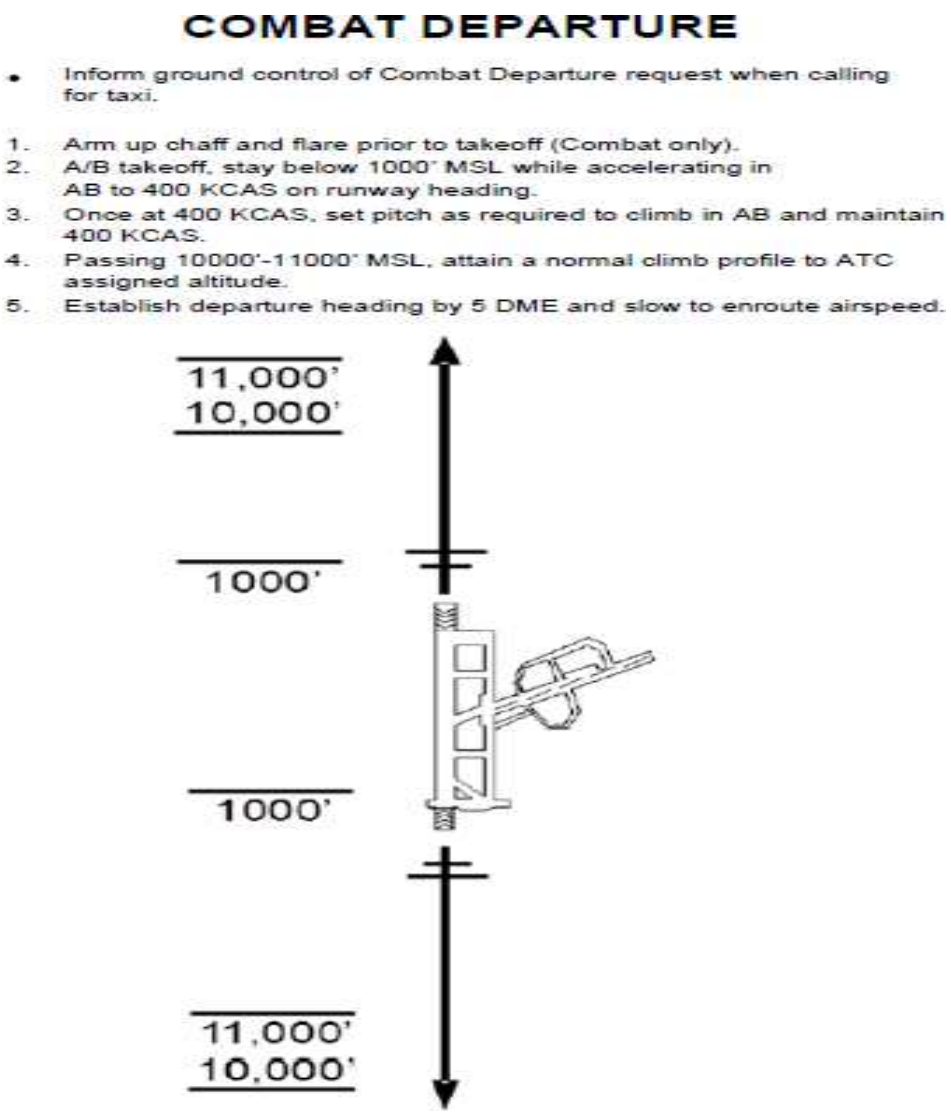


Attachment 10

KOREAN SPECIAL USE AIRSPACE (SUA)

Figure A10.1. Korean Special Use Airspace (SUA) (High).




Figure A10.2. Korean Special Use Airspace (SUA) (Low).

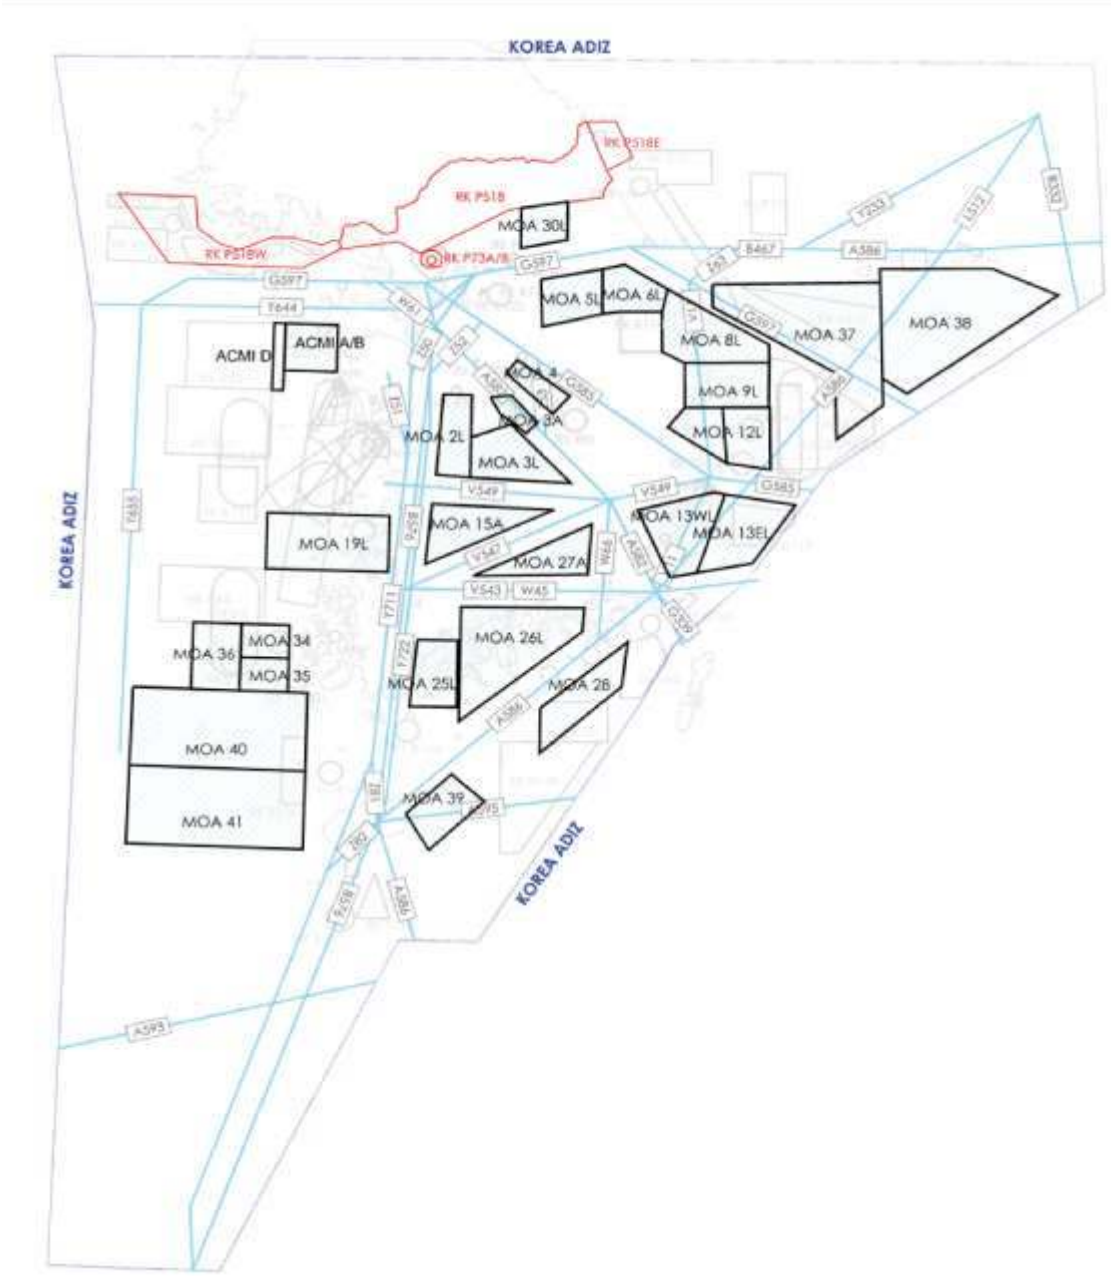

Attachment 11

KUNSAN AIRSPACE


Figure A11.1. Kunsan Airspace.

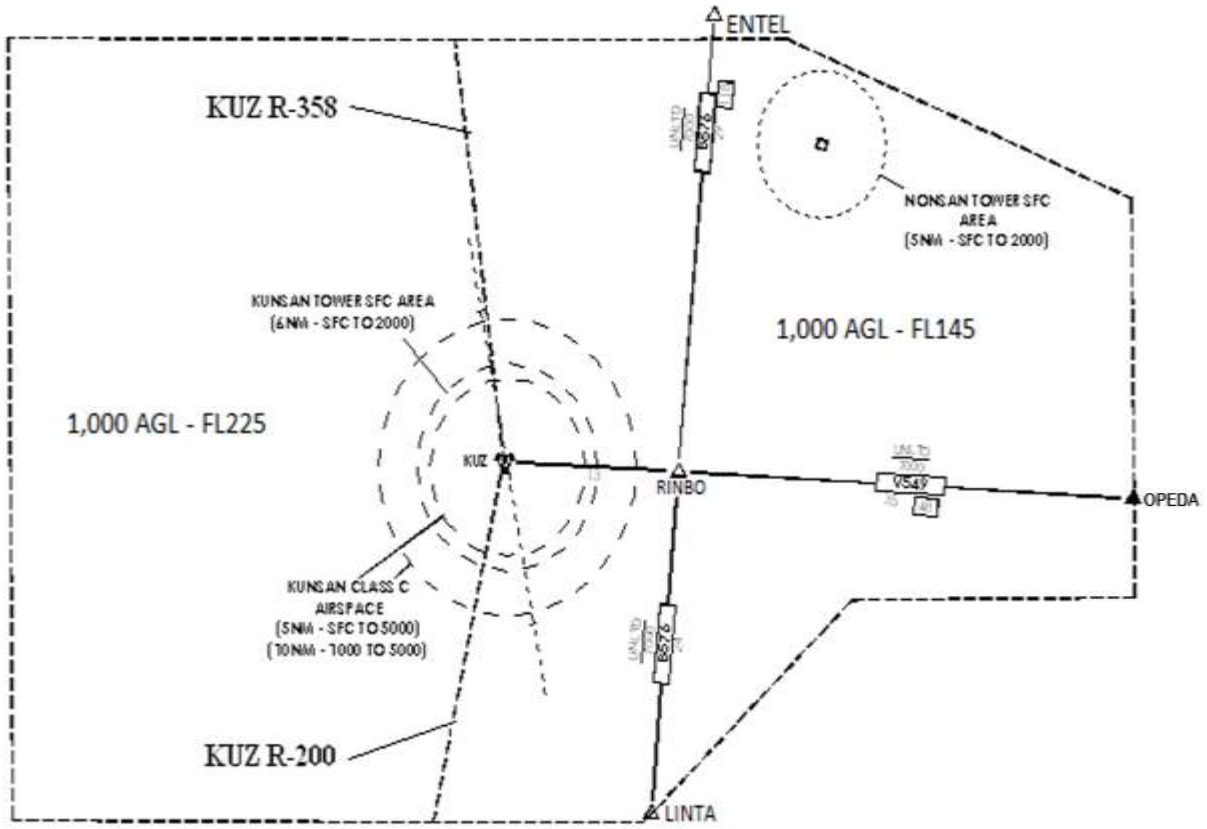

Attachment 12

ADJACENT SPECIAL USE AIRSPACE


Figure A12.1. Adjacent Special Use Airspace.

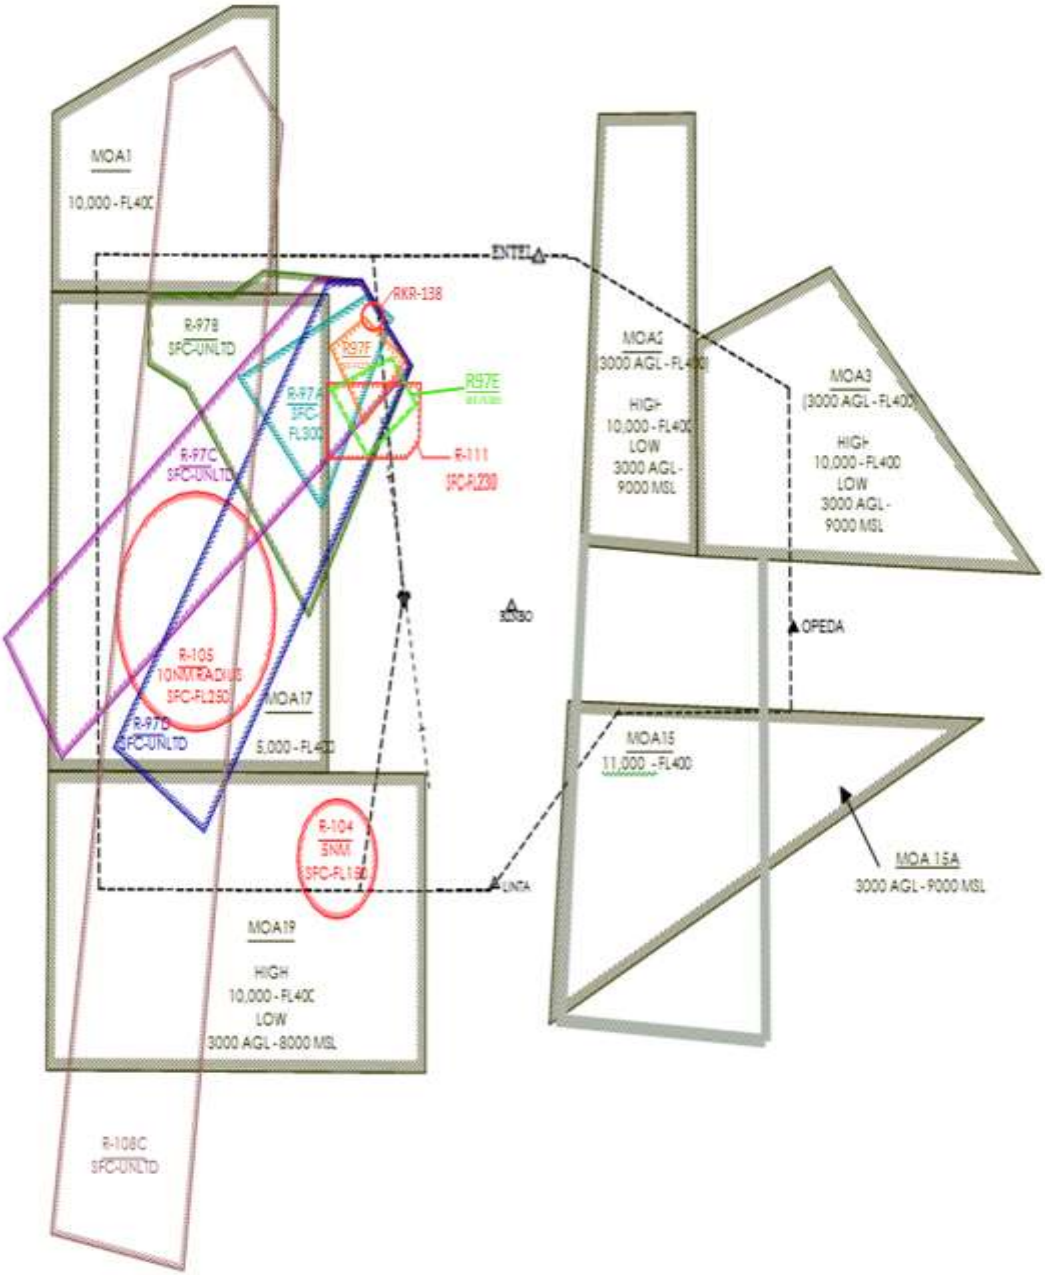

Attachment 13

MINIMUM VECTORING ALTITUDE (MVA) CHART


Figure A13.1. Minimum Vectoring Altitude (MVA) Chart.

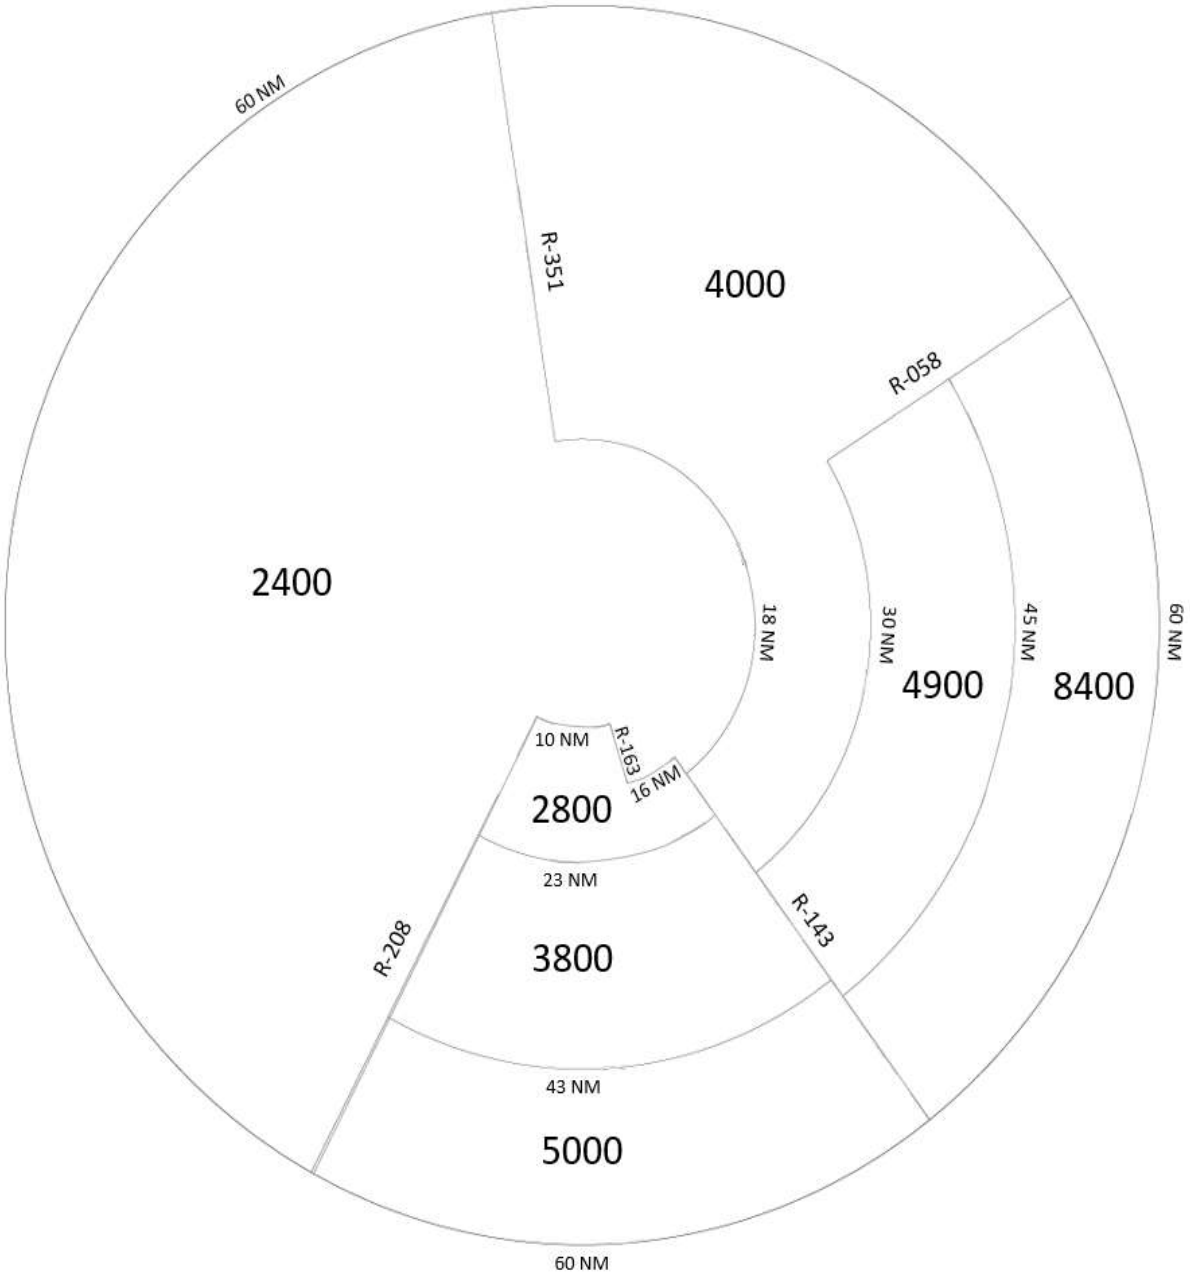

Attachment 14

MINIMUM IFR ALTITUDE CHART (MIFRAC)


Figure A14.1. Minimum IFR Altitude Chart (MIFRAC).

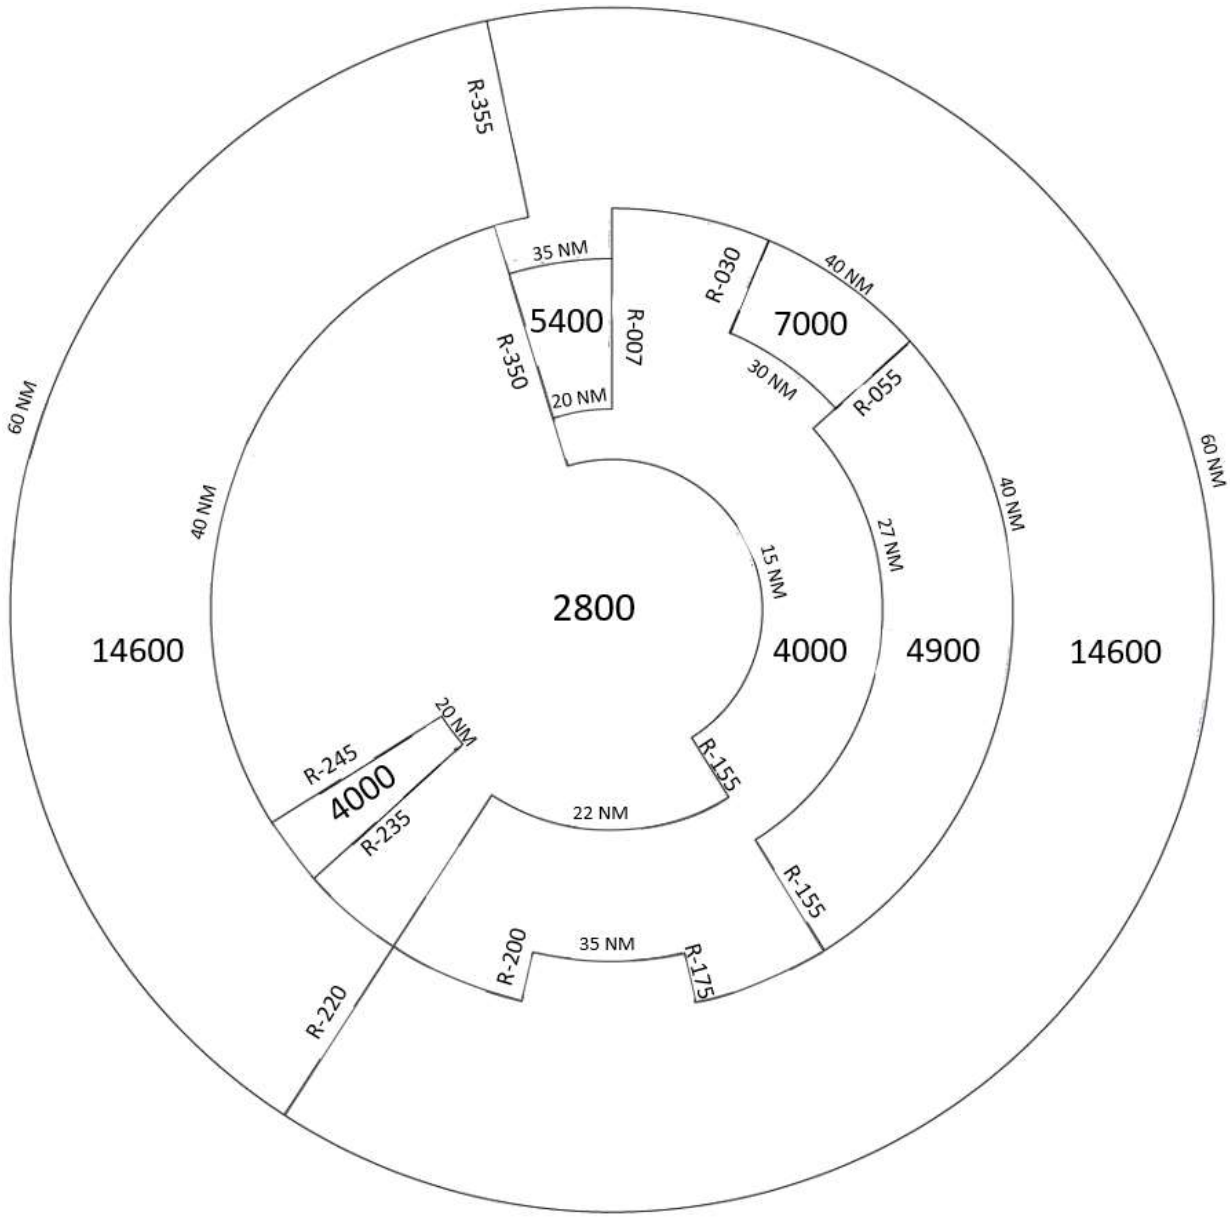

Attachment 15

AIRFIELD DIAGRAM


Figure A15.1. Airfield Diagram.

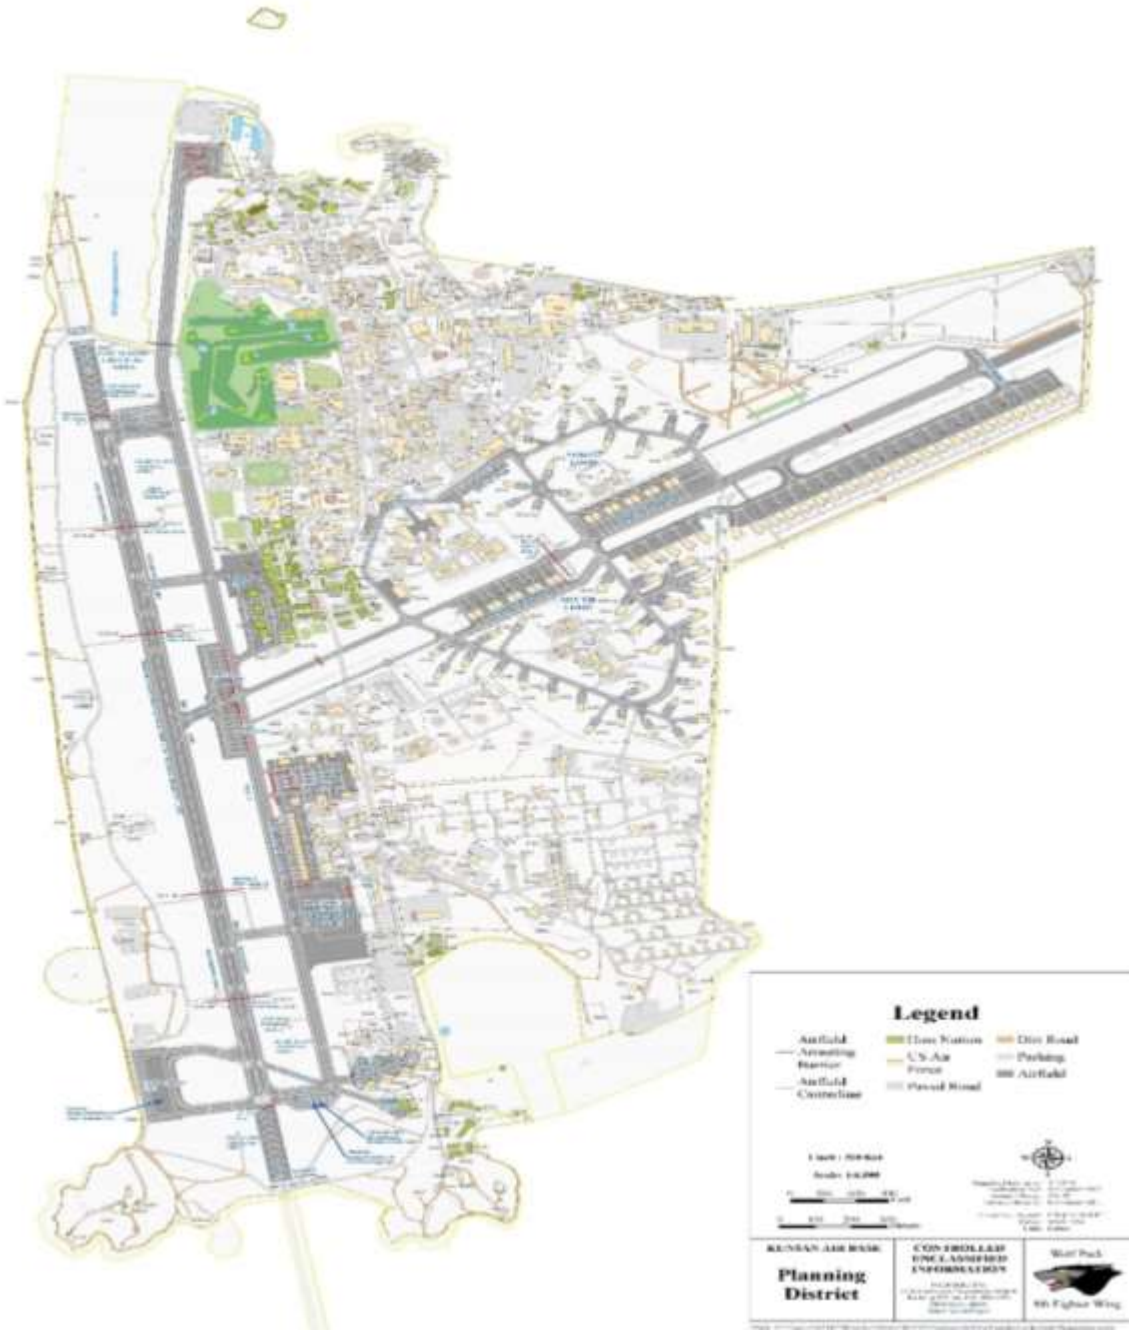

Attachment 16

ALTERNATE LANDING SURFACE (ALS) OPERATIONS


Figure A16.1. Alternate Landing Surface (ALS) Operations.

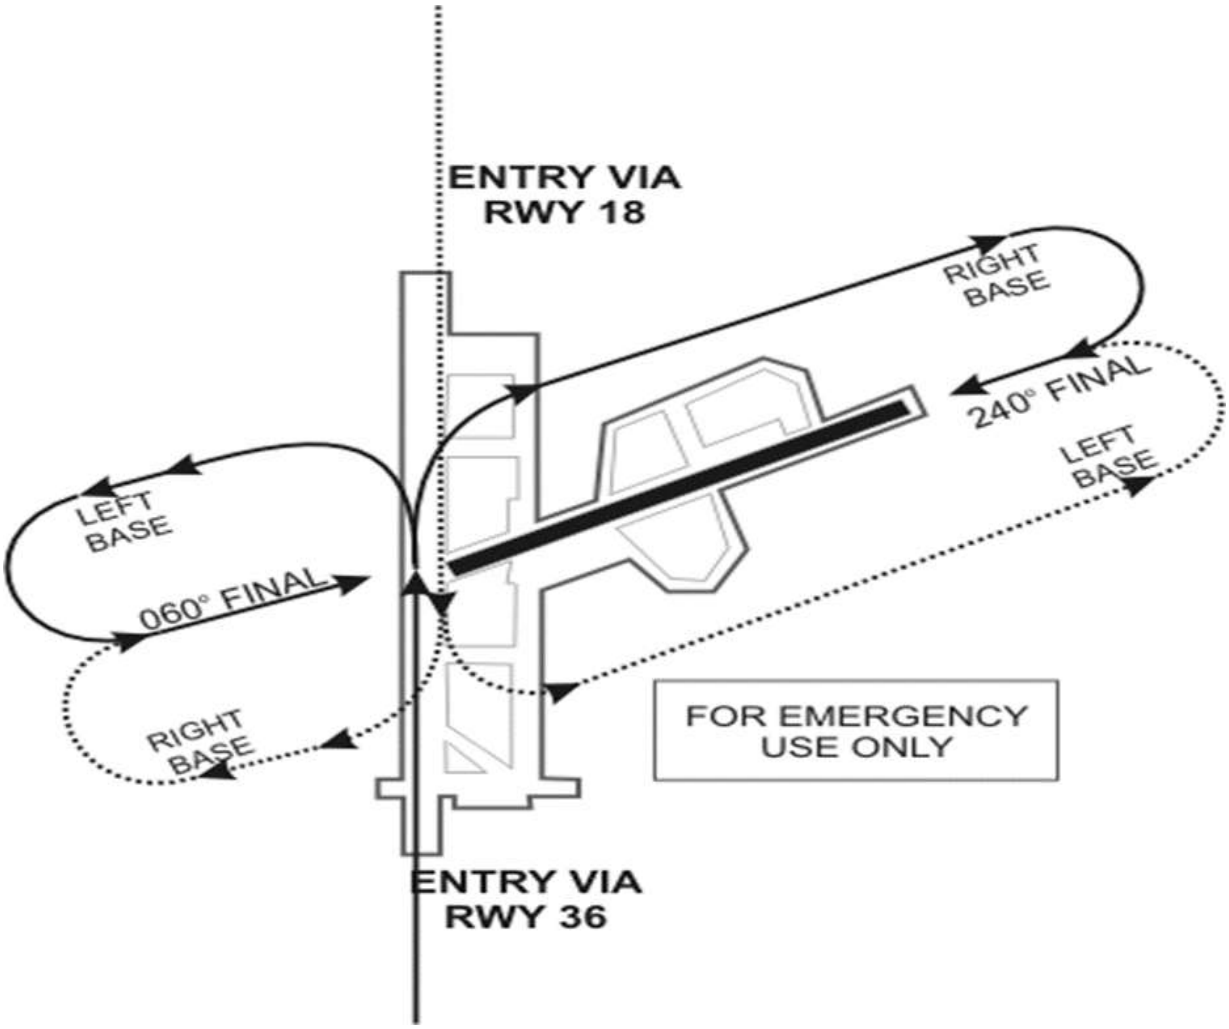

Attachment 17


KUNSAN AB DROP ZONES

Figure A17.1. Kunsan AB Drop Zones.

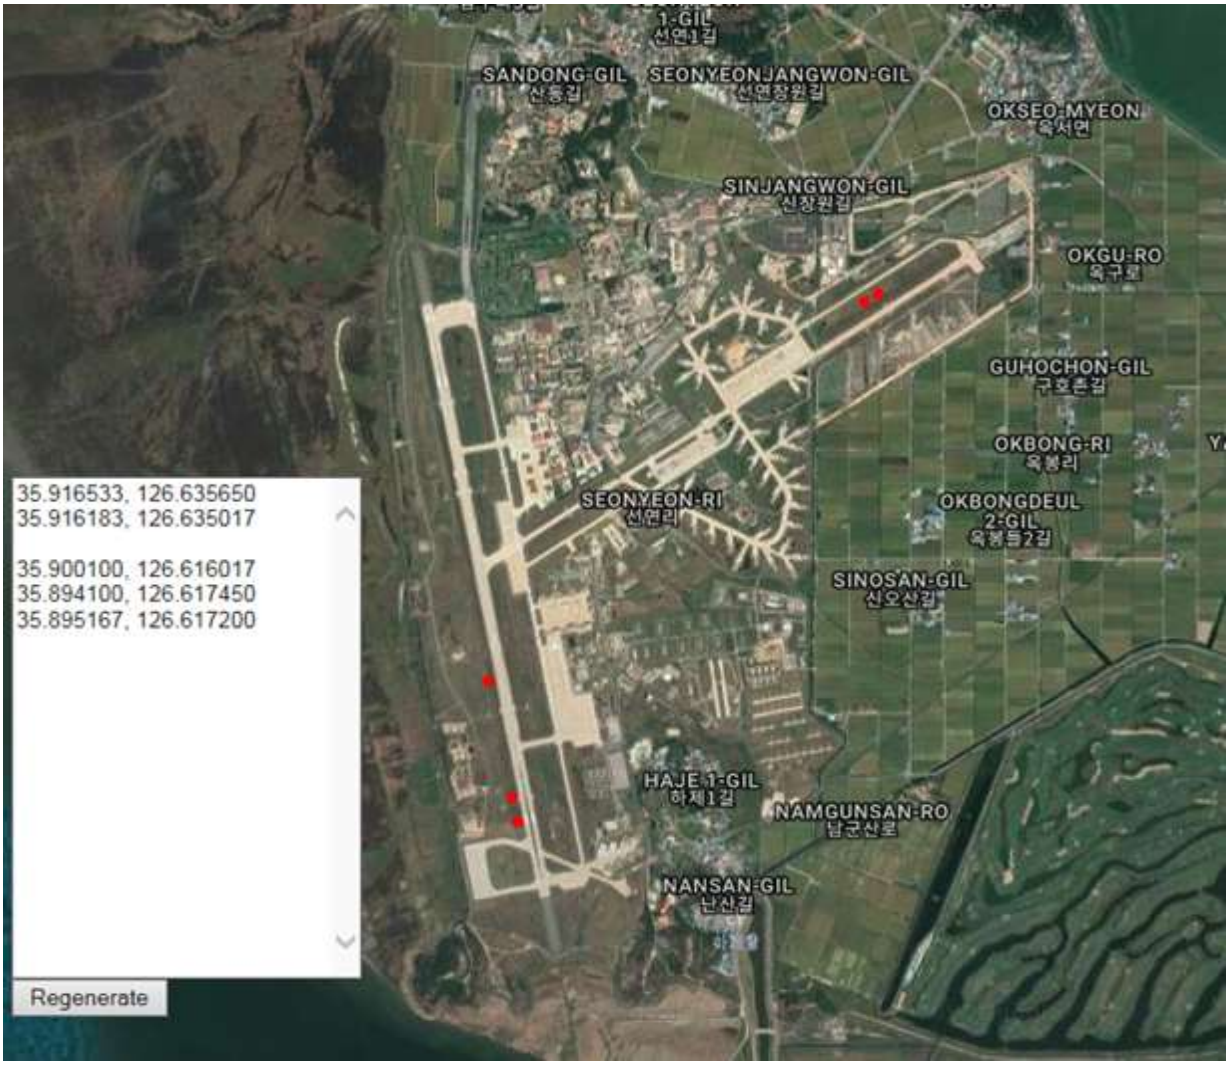

Attachment 18

WOLF PACK AIRSPACE

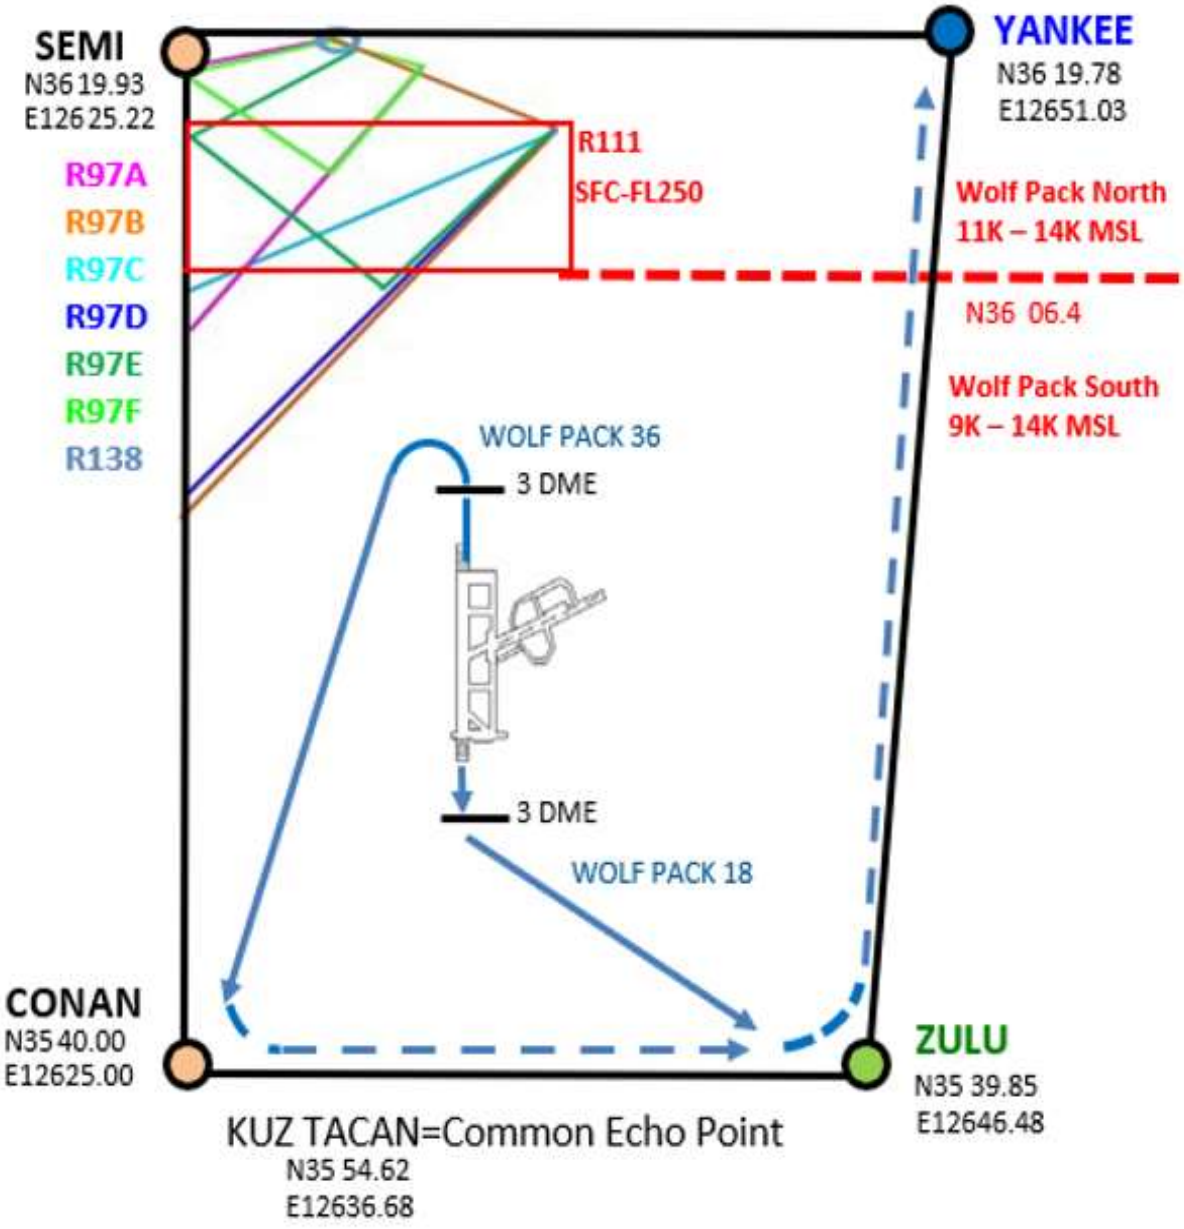

Attachment 19

RAWS EQUIPMENT WIND SPEED AND ICE ACCUMULATION TOLERANCES

DASR *(antenna)*
• Maximum Winds (Operational): 85 knots (98 mph)
• Maximum Winds (Survival): 125 knots (144 mph)
• Maximum Ice Accumulation (Operational): ½ inch

LOCALIZER *(antenna array)*
• Maximum Winds (Survival): 60 knots (70 mph)
• Maximum Ice Accumulation (Operational): ½ inch

GLIDE SLOPE *(antennas)*
• Maximum Winds (Survival): 60 knots (70 mph)
• Maximum Ice Accumulation (Operational): ½ inch

TACAN *(antenna)*
• Maximum Winds (Survival): 86 knots (100 mph)
• Maximum Ice Accumulation (Operational): 1 inch

VOR *(radome)*
• Maximum Winds (Survival): 86 knots (100 mph)
• Maximum Ice Accumulation (Operational): 1 inch

NEXRAD *(radome)*
• Maximum Winds (Operational): 64 knots (74 mph)
• Maximum Winds (Survival): 125 knots (144 mph)
• Maximum Ice Accumulation (Operational): 235 kg/sq meters


FMQ-19 *(wind vane)*
• Maximum Winds (Operational): 85 knots (98 mph)
• Maximum Winds (Survival): 125 knots (144 mph)
• Maximum Ice Accumulation (Operational): ½ inch

RADIO ANTENNAS
• Maximum Winds (Operational): 86 knots (100 mph)
• Maximum Winds (Survival): 130 knots (150 mph)
• Maximum Ice Accumulation (Operational): ½ inch

Attachment 20

MQ-9 EMERGENCY MISSION WITH LOST LINK LAND LOGIC FOR RWY 18


Figure A20.1. RKJK Emergency mission with Lost Link Land Logic for Runway 18.

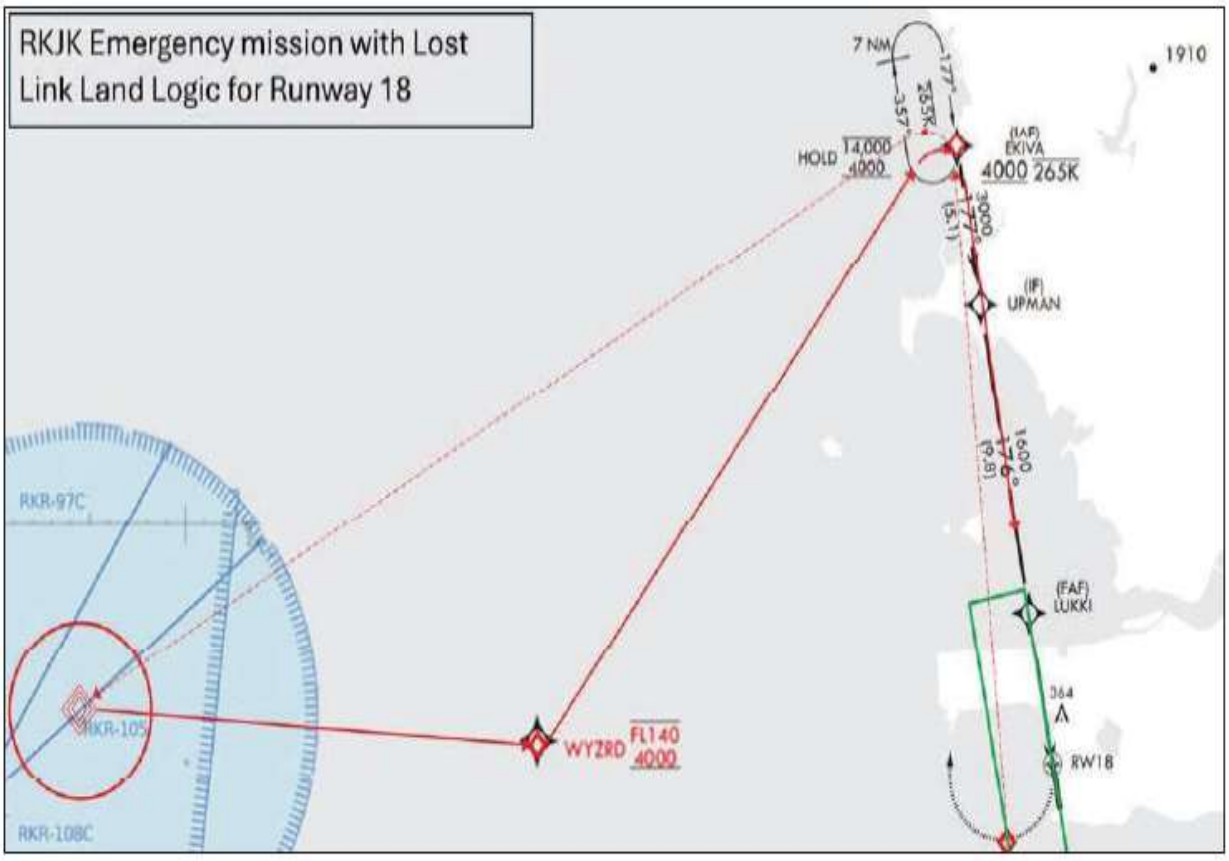

Attachment 21

MQ-9 EMERGENCY MISSION WITH LOST LINK LAND LOGIC FOR RWY 36


Figure A21.1. MQ-9 EMERGENCY MISSION WITH LOST LINK LAND LOGIC FOR RWY 36

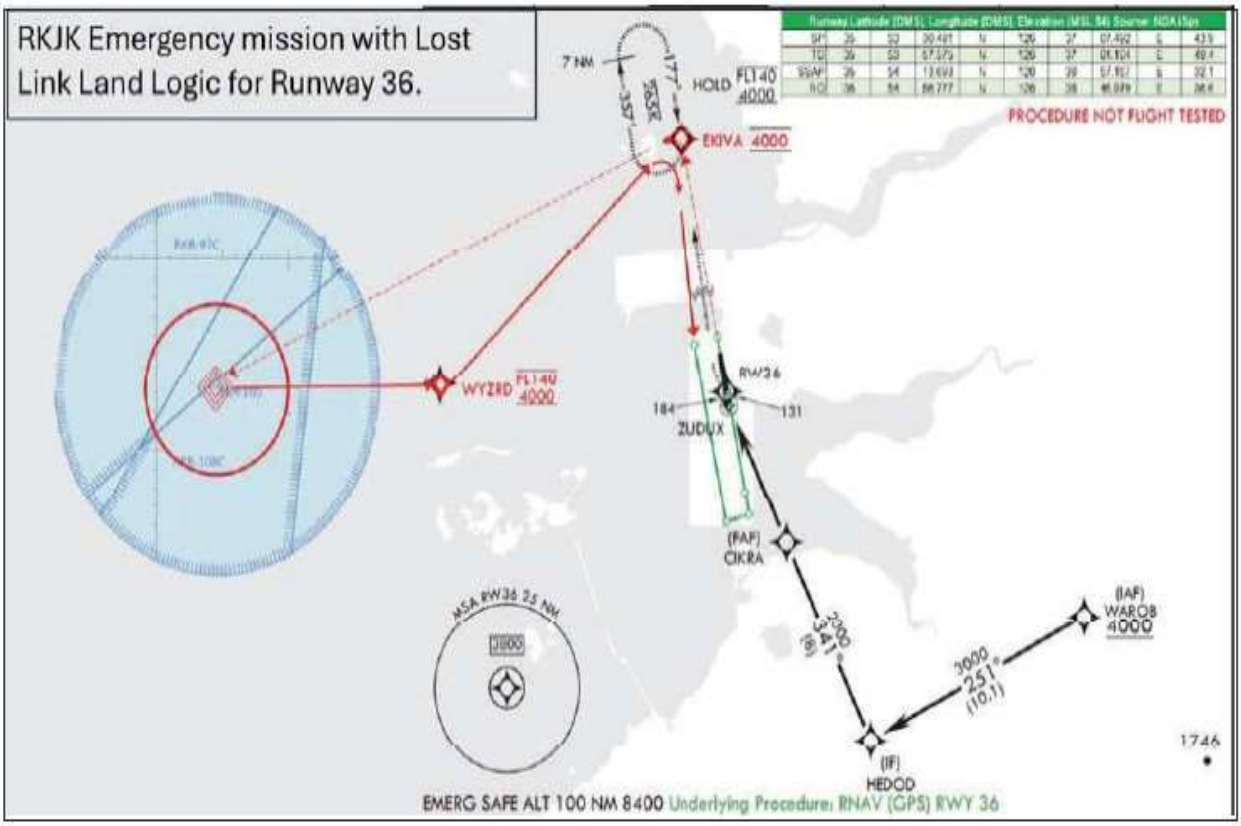

Attachment 22

MOA LOST LINK PROCEDURES


Figure A22.1. MOA LOST LINK PROCEDURES

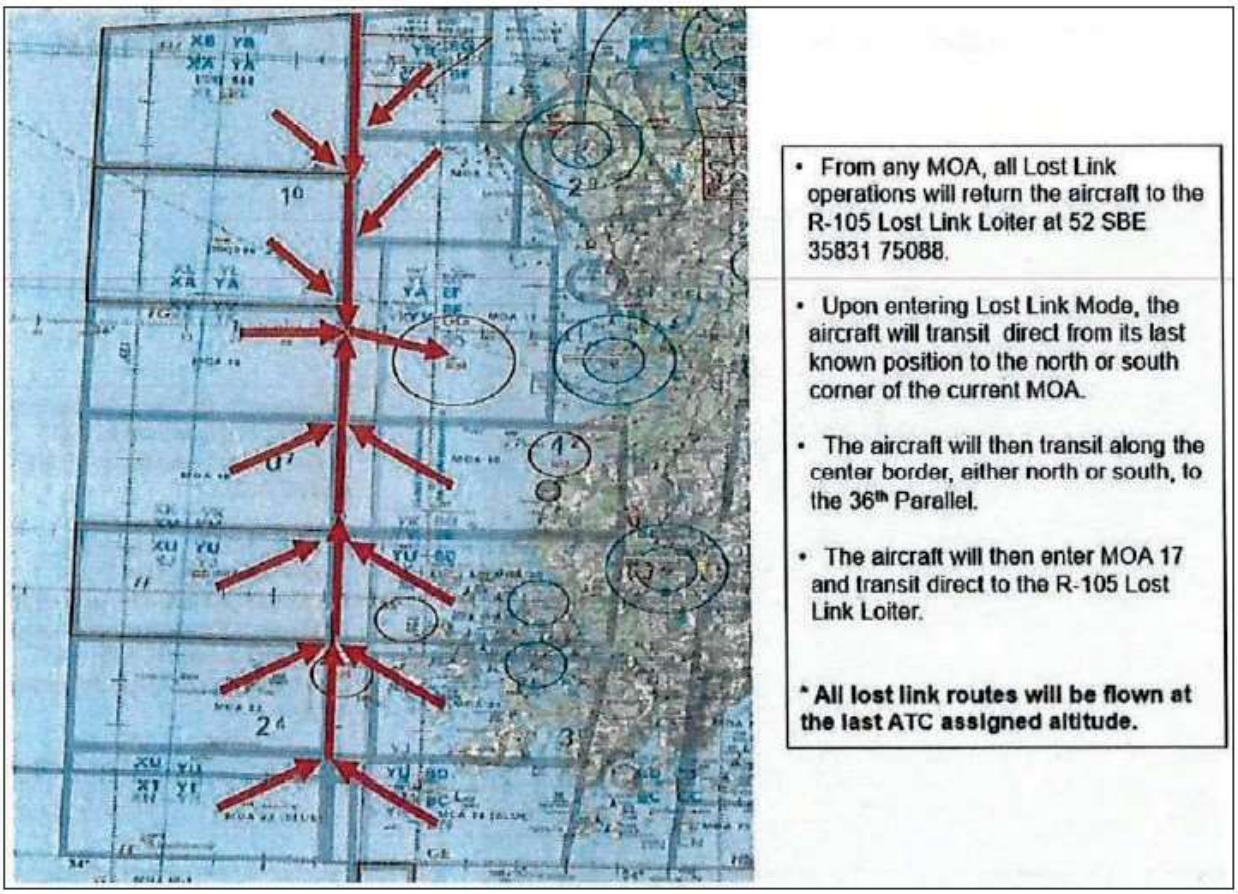

Attachment 23

MQ-9 SCA RWY 18


Figure A23.1. MQ-9 SCA RWY 18.

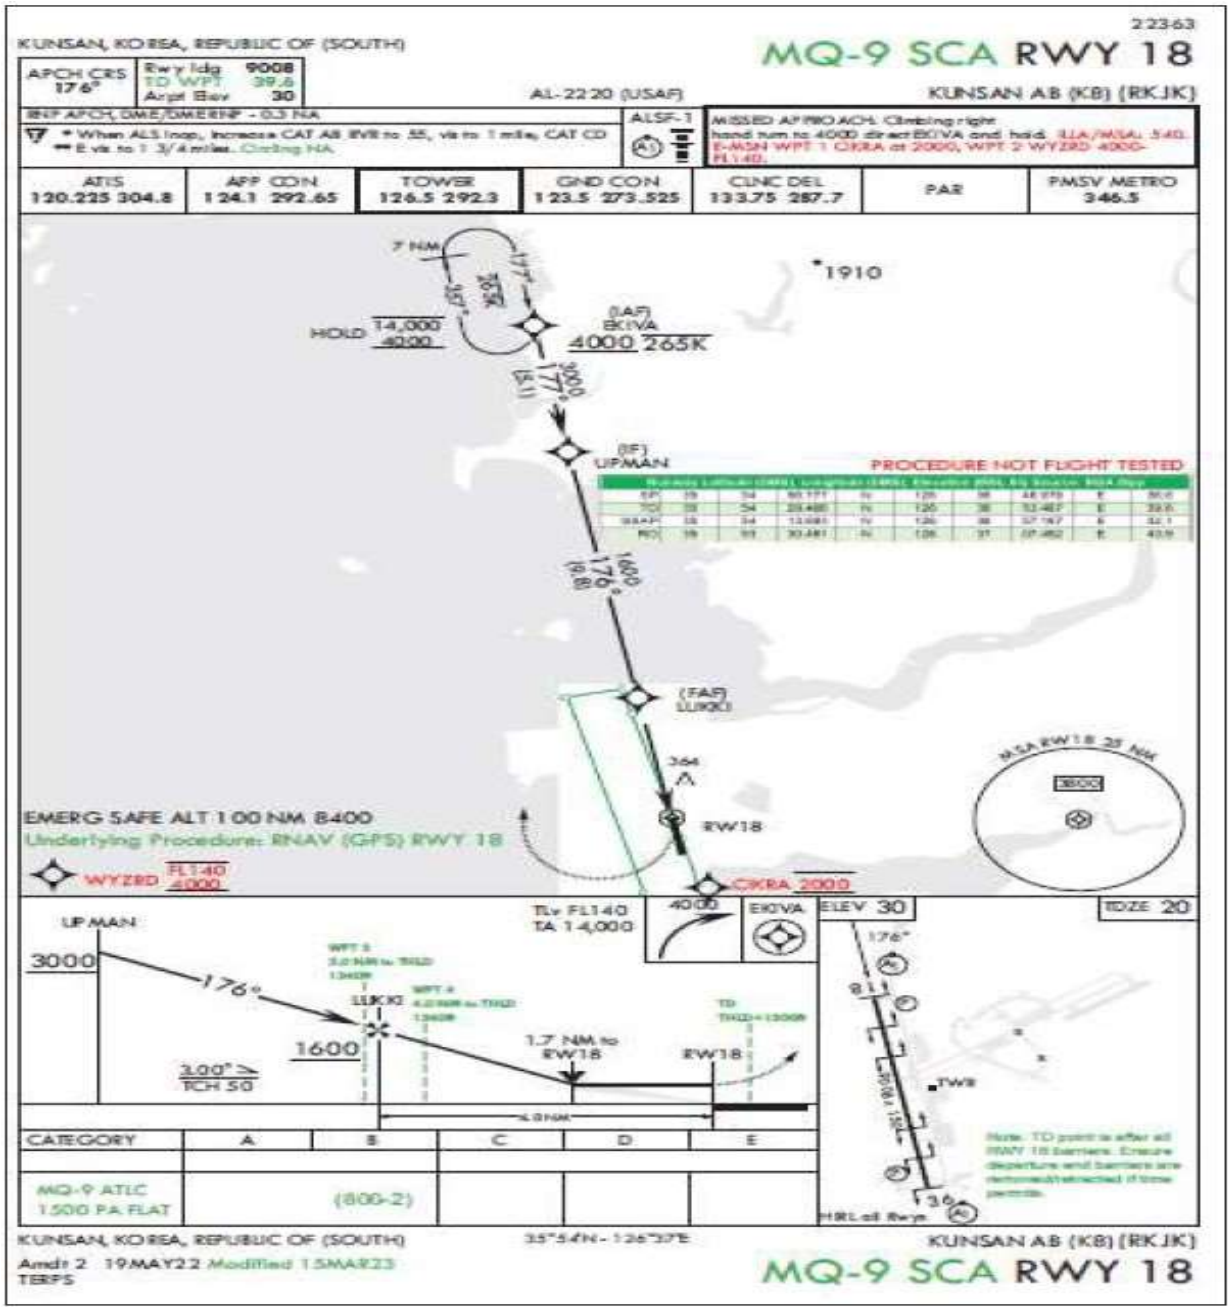

Attachment 24

MQ-9 SCA RWY 36

Figure A24. 1. MQ-9 SCA RWY 36.

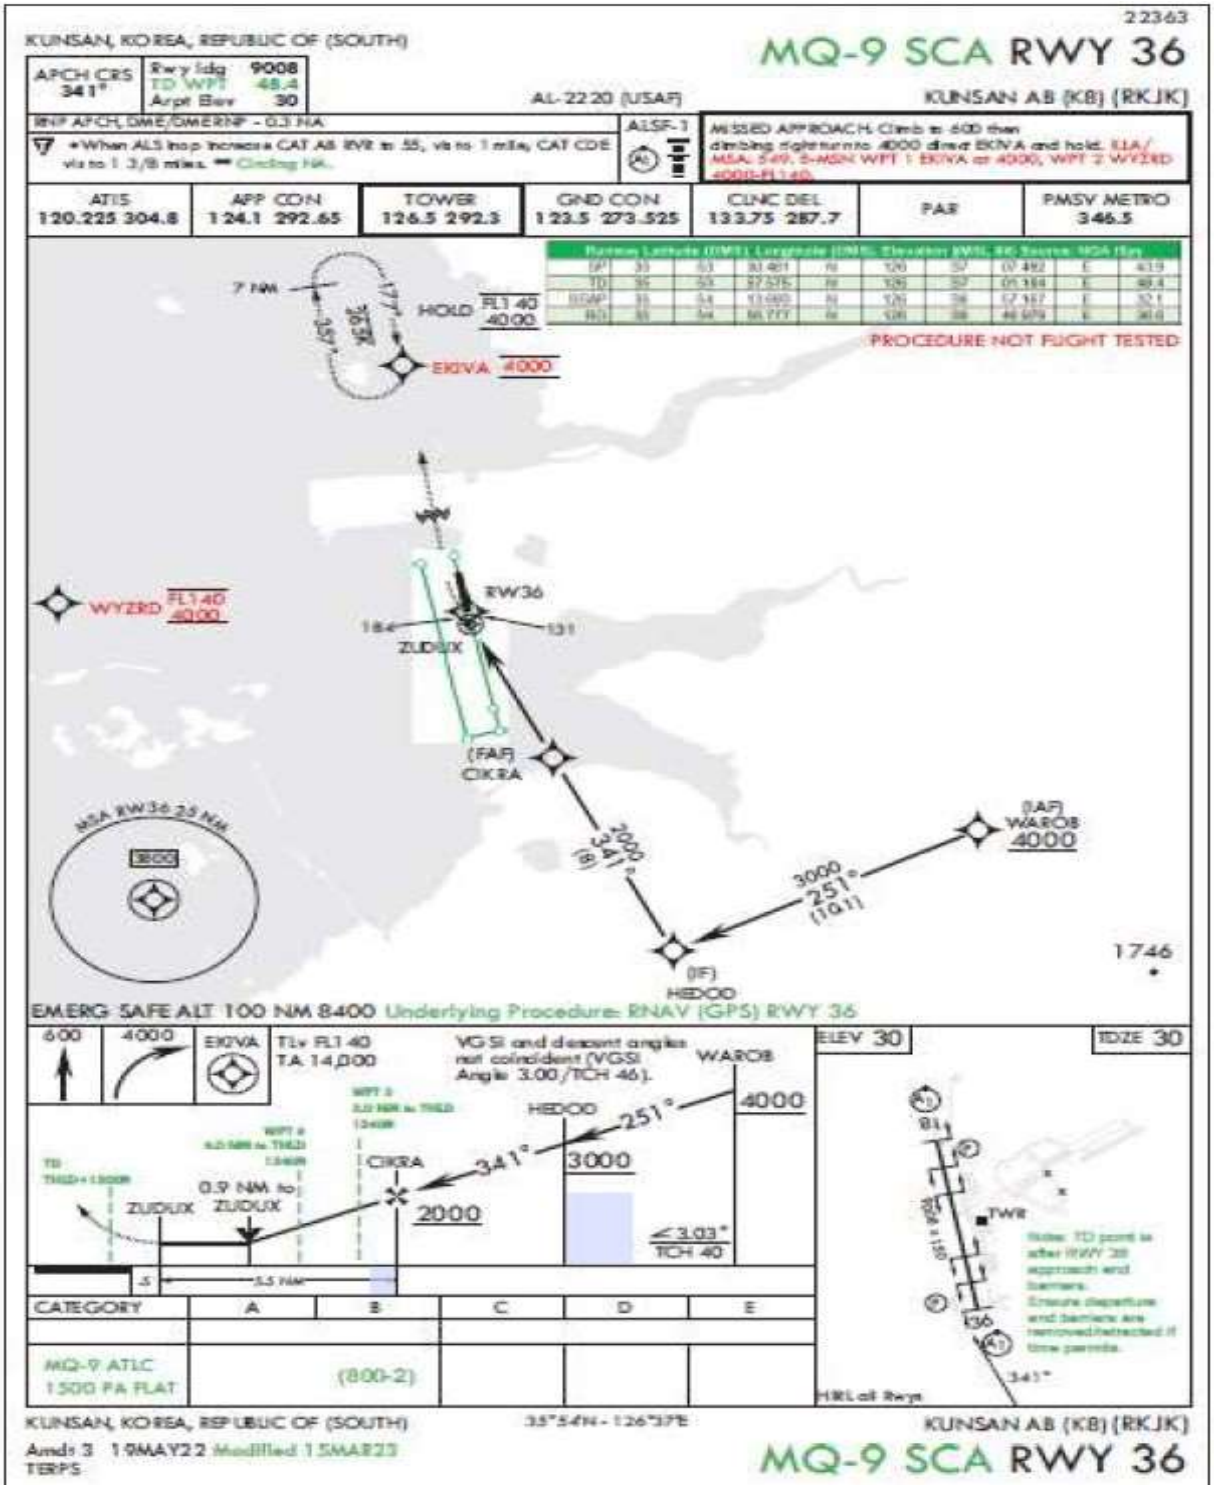

Attachment 25

ADLS OPERATIONS CHECKLIST

	OPR	ACTION	Complete
H –8:00			
PREPARATION	8 OG/CC	Notify AOF/CC or WOC OG Rep of H-time and oversee checklist execution	
		Notify 38 FG Command Post of H-time	
	EOC Director	Initiate TCP Augmentee Recall	
	AOF/CC or OG Rep	Notify SOF, ATCT, RAPCON and AMOPS of H-time	
		Direct AMOPS to execute ADLS preparation procedures	
	SOF	Direct Fighter Squadron Top 3 to include ADLS refresh in step brief	
	AMOPS	Activate SCN for ADLS preparation with H-time	
		Direct 8 CES to install MAAS if not already installed and establish time window for MAAS certification. As directed by OG/CC, install EALS.	
		Notify 8 CS/RADIO & 8 LRS/LGDDO for radio	
		Publish NOTAM	
		Coordinate with 8 CES to place barricades around ADLS	
		Notify AOF/CC or WOC OG Rep and SOF of time window for MAAS certification established by 8 CES/Barrier Maintenance	
	AOF/CC or OG Rep	Set H-Time with OG/CC based on checklist completion and MAAS certification timeline	
		Notify SOF, ATCT, AMOPS and RAPCON of H-time changes as required	
		Coordinate TCP augmentee reporting time	
	SOF	Direct Top 3 to coordinate MAAS certification time with MOC	
	AMOPS	Revise NOTAM as required	
H –1:30 // TCP AUGMENTEE TRAINING			
	AMOPS	Verify TCP reporting and provide training	
H – 0:30 // TCP AUGMENTEE PLACEMENT & STRING BARRIER CABLES			
	AMOPS	Place TCP augmentees at assigned locations & verify two-way communications	
		Direct 8 CES to string MAAS and BAK-12 cables across the ADLS	
H 0:00 / / PREPARATION STEPS COMPLETE; ADLS ACTIVIATION REQUIRED PRIOR TO OPERATIONS FOR MAAS CERTIFICATION			
ADLS CMA ACTIVATION (MAAS	AOF/CC or OG Rep	Direct ATCT to activate the CMA as soon as MAAS is installed, or at the predetermined H-time	
	ATCT	Activate the CMA	
		Direct TCP Augmentees to secure the ADLS and AMOPS to sterilize the CMA	
		Notify RAPCON and SOF that the ADLS CMA is active	
		Activate the PCAS and alert agencies that the ADLS CMA is active	
		Broadcast ADLS active on all frequencies and ATIS	

	AMOPS	Verify TCP augmentees have secured the ADLS		
		Notify ATCT when the ADLS CMA is sterile		
		Activate SCN after the PCAS and alert agencies that the ADLS CMA is active		
		Conduct final FOD check and verify the ADLS is sterilized		
	RAPCON	Broadcast ADLS active on UHF/VHF and Guard frequencies		
	8 FW/CP	Announce ADLS activation via AtHoc & Giant Voice		
	8 MXG/MOC	Notify all Mx personnel of ADLS activation		
	AMOPS	Notify ATCT when ADLS sterilization is complete & ready for MAAS certification		
	SOF	Coordinate and execute MAAS certification with Top 3 and MXG		
	AMOPS	Conduct post-certification FOD check. Notify ATCT when ADLS is ready for aircraft operations		
MAAS CERTIFICATION COMPLETE, ADLS READY FOR FLIGHT OPERATIONS				
DECISION POINT	AOF/CC or OG Rep	Notify 8 OG/CC of MAAS status and ADLS is prepared for ops execution		
	8 OG/CC	ADLS REMAINS ACTIVE (Execute ops)	Recommended for <1 hour before ops	
		DEACTIVATE ADLS (All agencies complete deactivation steps)	Recommended for >1 hour before ops	
H 0:00 / / PREPARATION STEPS COMPLETE; ADLS ACTIVIATION REQUIRED PRIOR TO EXECUTION OF ADLS OPERATIONS				
ADLS ACTIVATION (MAAS CERTIFICATION **NOT** REQUIRED)	AOF/CC or OG Rep	Direct ATCT to activate the CMA at the pre-determined H-time		
	ATCT	Activate the CMA		
		Direct TCP Augmentees to secure the ADLS and AMOPS to sterilize the CMA		
		Notify RAPCON and SOF that the ADLS CMA is active		
		Activate the PCAS and alert agencies that the ADLS CMA is active		
		Broadcast ADLS active on all frequencies and ATIS		
	AMOPS	Verify TCP augmentees have secured the ADLS		
		Notify ATCT when the ADLS CMA is sterile		
	RAPCON	Activate SCN after the PCAS and alert agencies that the ADLS CMA is active		
	8 FW/CP	Conduct final FOD check and verify the ADLS is sterilized		
	RAPCON	Broadcast ADLS active on UHF/VHF and Guard frequencies		
	8 FW/CP	Announce ADLS activation via AtHoc & Giant Voice		
	8 MXG/MOC	Notify all Mx personnel of ADLS activation		
	AMOPS	Notify ATCT when ADLS sterilization is complete & ready for MAAS certification		
	SOF	Coordinate and execute MAAS certification with Top 3 and MXG		
H +0:30 – EXECUTION OF ADLS OPERATIONS				
OPS	SOF	Notify 8 AOF/CC or WOC OG Rep when ADLS operations are complete		

ADLS OPERATIONS TERMINATED			
ADLS DEACTIVATION	AOF/CC or OG Rep	Coordinate with OG/CC for decision to leave the EALS and MAAS installed or to remove the systems. Notify AMOPS of decision.	
	8 OG/CC	Issue de-activation order to AOF/CC & decision on EALS & MAAS	
	AOF/CC or OG Rep	Direct AMOPS to deactivate ADLS	
		Notify ATCT of ADLS deactivation	
	ATCT	Notify RAPCON of ADLS deactivation	
		Activate the PCAS and alert agencies that the ADLS CMA is deactivated	
		Broadcast ADLS deactivation on all frequencies and remove from ATIS	
	AMOPS	Activate SCN to alert agencies that the ADLS CMA is deactivated	
		Cancel NOTAM	
		Remove TCP Augmentees from airfield	
		Remove barricades around ADLS	
		Direct 8 CES to remove arresting cables from ADLS	
	8 FW/CP	Announce ADLS deactivation via AtHoc & Giant Voice	
	8 MXG/MOC	Notify all Mx personnel of ADLS deactivation	

Attachment 26

ADLS OPERATIONS DIAGRAM

Figure A26.1. ADLS Operations Diagram.

