BY ORDER OF THE COMMANDER
JOINT BASE PEARL HARBOR_HICKAM



AIR FORCE INSTRUCTION 13-213

JOINT BASE PEARL HARBOR-HICKAM
Supplement

13 DECEMBER 2018

Nuclear, Space, Missile, Command and Control

AIRFIELD DRIVING

COMPLIANCE WITH THIS PUBLICATION IS MANDATORY

ACCESSIBILITY: Publications and forms are available for downloading or ordering on the e-Publishing website at **www.e-Publishing.af.mil**

RELEASABILITY: There are no releasability restrictions on this publication

---

OPR: 15 OSS/OSAA

Certified by: 15 OSS/CC
(Lt Col Zachary G. Hall)

Supersedes: 15WGI 13-213, 11 July 2013

Pages: 35

This supplement implements AFMAN 24-306, Chapter 12, AFI 91-203, Chapter 24, AFI 13-204 V3 and AFI 13-213, *Airfield Driving*. It establishes procedures for governing all vehicular traffic on Joint Base Pearl Harbor Hickam (JBPEARLHARBOR-HICKAM) airfield. The goal of the Airfield Driving Program is to provide safe ground vehicle operations and pedestrian control on USAF owned and/or operated airfields. It outlines training requirements for all personnel (e.g. military, DoD civilians, contractors, etc.) who, as a part of their job, are required to drive unescorted on an airfield. Refer recommended changes and questions about this publication to the Office of Primary Responsibility (OPR) using the AF Form 847, *Recommendation for Change of Publication*; route the AF Form 847 from the field through the appropriate functional chain of command. Ensure that all records created as a result of processes prescribed in this publication are maintained IAW Air Force Manual (AFMAN) 33-363, *Management of Records*, and are disposed of IAW Air Force Records Information Management System (AFRIMS) Records Disposition Schedule (RDS). Contact supporting records managers as required.

SUMMARY OF CHANGES

This document has been substantially revised and must be completely reviewed. The standards and directives on the following pages have been established for the control of all motor vehicles on the Joint Base Pearl Harbor Hickam (JBPEARLHARBOR-HICKAM) airfield. Only trained

personnel will be assigned duties which involve driving on the airfield. The use of vehicles on the airfield will be limited to the absolute minimum required to accomplish the mission. Motor vehicles present a clear and obvious danger to aircraft and ground personnel. Carelessness, haste, and disregard for established safety standards are the primary sources of aircraft/vehicle collisions, incidents, and personnel injury involving motor vehicles on the airfield. Persons assigned to the airfield or to activities related to the airfield are required to be familiar with the provisions of this supplement, AFI 13-213, *Airfield Driving* and exercise good judgment when encountering situations not addressed during training. Airfield Operating Area (AOA) and Controlled Movement Area (CMA) are used interchangeably.

2.3.1.1 . (Added JBPEARLHARBOR-HICKAM) The Airfield Driving Training Program (ADTP) is an electronic database management system that assists with the management of the ADP.

2.6. **(Added JBPEARLHARBOR-HICKAM) 15th/154th Wing ADPM's.** The 15th/154th Wing ADP are jointly managed by both the 15th/154th Wing ADPM's. Both Wing ADPMs work in tangent and have the ability to inspect and/or train any unit ADPM.

2.6.3.1. **(Added JBPEARLHARBOR-HICKAM) A copy of the ADI, training curriculum, and testing materials for program management can be located on the ADTP website: https://private.amc.af.mil/adtp/Login.aspx**, and/or on the SharePoint: **https://hickam.eis.pacaf.af.mil/15%20OG/OSS/OSA/Airfield%20Management/Forms/AllItems.aspx**.

2.6.5.3.3 . (Added JBPEARLHARBOR-HICKAM) Unit ADPMs must coordinate an extension for their unit's ADP inspection within 30 days of the due date. Failure to complete ADP inspections and/or extension requests will result in a program suspension. Reinstatement of the suspended ADP will require a written request for reinstatement by the unit commander.

2.6.13.1 . (Added JBPEARLHARBOR-HICKAM) Wing/unit ADPMs may utilize the ADTP reports function to monitor and track this requirement.

2.7.1.1 . (Added JBPEARLHARBOR-HICKAM) Schedule training for replacement unit ADPMs with the current unit ADPM at least 30 days prior to relinquishing duties.

2.7.12.1. (Added JBPEARLHARBOR-HICKAM) Use **Attachment 11**, *Sample of Color Vision Testing Results Letter,* to document results and maintain letter in unit Continuity Binder, Tab F.

2.7.13.1 . (Added JBPEARLHARBOR-HICKAM) Members may utilize the ADTP database for all refresher training. Refresher training will be properly documented in the ADTP and a new AF Form 483 will be printed with current dates.

2.7.17.1 . (Added JBPEARLHARBOR-HICKAM) TDY personnel may be trained, monitored, and tracked via paper based materials.

2.7.26 . (Added JBPEARLHARBOR-HICKAM) Develop procedures to ensure in/out processing with the unit ADPM is added to the unit's in/out processing checklist.

2.7.26.1 . (Added JBPEARLHARBOR-HICKAM) Ensure all members are out processed and transferred in ADTP to the gaining MAJCOM and unit.

2.7.27 . (Added JBPEARLHARBOR-HICKAM) Review the ADTP database at least monthly to ensure currency of all unit personnel. During monthly reviews, ensure training is being conducted within allotted timelines as well as the member's requirement/need to drive on the airfield.

2.7.27.1 . (Added JBPEARLHARBOR-HICKAM) ADTP training not complete within 90 days will be deleted from ADTP and the member will be required to start training from the beginning.

2.8. **(Added JBPEARLHARBOR-HICKAM) 15th/154th Wing Airfield Management (AM).** The 15th/154th Wing Airfield Management sections jointly serve as the OPR for the ADTP.

2.11.9.1 . (Added JBPEARLHARBOR-HICKAM) The designated staging area for 647th SFS personnel responding to In-flight/Ground emergencies is the "Kamakahi" vehicle access road adjacent to the Alert Facility Guard Shack. Personnel will stage all response vehicles on the access road in order to not block aircraft movement and will standby until called forward by the Fire Chief or the incident/on-scene commander.

2.11.9.1.1 . (Added JBPEARLHARBOR-HICKAM) If AOA access is required for response to an In-flight/Ground emergency, Fire Department will provide AOA escort.

2.11.10 . (Added JBPEARLHARBOR-HICKAM) 647th SFS ADPMs will train and maintain training paperwork for all JBPEARLHARBOR-HICKAM assigned Security Forces personnel and/or augmentees as outlined in the AFI and this ADI.

2.12.1.1 . (Added JBPEARLHARBOR-HICKAM) 15th Medical Group (15th MDG) provides color vision screening on a walk-in basis for any individual requiring AOA access. Color vision screenings may also be requested by the unit ADPM.

2.12.2.1 . (Added JBPEARLHARBOR-HICKAM) Attachment 11, *Sample of Color Vision Testing Results Letter,* will be used for color vision testing results and/or verification of previous screenings.

2.12.3.1 . (Added JBPEARLHARBOR-HICKAM) The designated staging area for 15th MDG personnel responding to In-flight/Ground emergencies is the "Kamakahi" vehicle access road adjacent to the Alert Facility Guard Shack. Personnel will stage all response vehicles on the access road in order to not block aircraft movement and will standby until called forward by the Fire Chief or the incident/on-scene commander.

2.12.3.2 . (Added JBPEARLHARBOR-HICKAM) If AOA access is required for response to an In-flight/Ground emergency, Fire Department will provide the AOA escort.

2.13. **(Added JBPEARLHARBOR-HICKAM) Navy Facilities (NAVFAC)/154th Wing Civil Engineer Squadron (154th CES).**

2.13.1 . (Added JBPEARLHARBOR-HICKAM) Ensures airfield construction contracts and/or other projects affecting the airfield environment contain airfield driving requirements. Training requirements will be conducted IAW the AFI and this ADI.

2.13.2 . (Added JBPEARLHARBOR-HICKAM) Coordinates with the AFM, Wing ADPM, or NCOIC, Airfield Management Operations for authorization to utilize construction vehicles and/or support equipment on the airfield prior to the start of construction. Any modifications made to initial vehicle requests will need to be re-coordinated.

2.14. **(Added JBPEARLHARBOR-HICKAM) Hickam Ramp Facility (HRF).**

2.14.1 . (Added JBPEARLHARBOR-HICKAM) Provides control tower light gun signals when requested for training purposes.

2.14.2 . (Added JBPEARLHARBOR-HICKAM) Reports any vehicle radio problem areas or visual blind spots to AM.

2.14.3 . (Added JBPEARLHARBOR-HICKAM) Reports any CMA/AOA violations to AM.

2.15. **(Added JBPEARLHARBOR-HICKAM) Distinguished Visitor (DV) Flightline Operations (Protocol).**

2.15.1 . (Added JBPEARLHARBOR-HICKAM) Provide airfield briefings to DV support vehicles that enter/exit the airfield through O'Malley DV gate to DV row parking spots. The briefing will cover items outlined in Attachment 7, *TDY Personnel/Non-Base Assigned Contractors Training Checklist.*

3.2.2.4 . (Added JBPEARLHARBOR-HICKAM) JBPEARLHARBOR-HICKAM has five Airfield Driving Restriction Codes. The applicable code(s) will be placed on an individual's AF Form 483, *Certificate of Competency* (airfield driver's license).

3.2.2.4.1 . (Added JBPEARLHARBOR-HICKAM) Code A – AOA Access (day and/or night).

3.2.2.4.2 . (Added JBPEARLHARBOR-HICKAM) Code B – Hickam Ramp Access (day and/or night).

3.2.2.4.3 . (Added JBPEARLHARBOR-HICKAM) Code D – Daytime Driving (published sunrise to sunset daylight hours only).

3.2.2.4.4 . (Added JBPEARLHARBOR-HICKAM) Code G – HIANG Ramp Access (day and/or night).

3.2.2.4.5 . (Added JBPEARLHARBOR-HICKAM) Code H – Hickam Ramp/HIANG Ramp (day and/or night).

3.2.2.5 . (Added JBPEARLHARBOR-HICKAM) Personnel with Code A (AOA Access) on their license will have it removed in ADTP approximately 45 days prior to their refresher date. The individual will be able to drive on the AOA up until the expiration date. This will ensure refresher requirements are completed annually.

3.2.3.1.1 . (Added JBPEARLHARBOR-HICKAM) Unit ADPMs must maintain a completed Attachment 5 for personnel who do not have access to ADTP.

3.2.3.2.1 . (Added JBPEARLHARBOR-HICKAM) Unit ADPMs must maintain a completed Attachment 6 for personnel who do not have access to ADTP. Otherwise, document Attachment 6 completion in ADTP only.

3.2.3.6 . (Added JBPEARLHARBOR-HICKAM) Individuals that require AOA access will be trained by unit ADPMs, or designated unit trainers. Unit ADPM's must schedule individuals with the Wing ADPMs for AOA certification.

3.2.3.6.1 . (Added JBPEARLHARBOR-HICKAM) Initial AOA training requires a check-ride provided by the unit ADPM, or designated unit trainer, that will include the ability to contact ATCT for approval to enter/exit the AOA and runway, if applicable per unit requirements.

3.2.3.6.2 . (Added JBPEARLHARBOR-HICKAM) The Wing ADPMs will document the completion of AOA training/certification.

3.2.3.7 . (Added JBPEARLHARBOR-HICKAM) All individuals must complete initial airfield drivers training within 90 days of being entered into the ADTP database. Individuals that do not complete training within 90 days will have their ADTP account deleted and must start training from the beginning.

3.2.4.2.1 . (Added JBPEARLHARBOR-HICKAM) Unit ADPMs that utilize ADTP have the authority and will administer/enable Step Three (unit test). Step Four (wing test) will be administered/enabled by Wing ADPMs, or designated representatives. Individuals that remain in Step Four for more than 30 days will be sent back to Step Three. NOTE: The ADTP system will only allow tests to be enabled for a maximum of 72 hours. Once tests are initiated, individuals will have a maximum of one hour to complete the test prior to the ADTP system timing out.

3.2.4.2.1.1 . (Added JBPEARLHARBOR-HICKAM) For individuals who do not have access to ADTP and/or due to system outages, the unit ADPM may administer tests that will be provided by the Wing ADPM. Unit ADPM will annotate all test scores on Attachment 5.

3.2.4.3.4.6 . (Added JBPEARLHARBOR-HICKAM) Unit ADPMs will conduct the practical driving test for all initial Non-AOA drivers. All initial AOA drivers will receive an AOA practical driving test from the Wing ADPM, or designated representative.

3.2.4.3.4.6.1 . (Added JBPEARLHARBOR-HICKAM) The Wing ADPMs, or designated representative, will document the completion of AOA practical driving certification.

3.2.4.3.6 . (Added JBPEARLHARBOR-HICKAM) AOA access requires a closed-book written AOA test. The AOA test will be administered by AM personnel only. AOA written tests will only be scheduled by the unit ADPMs with the Wing ADPM. A score of 90 percent or higher is required to pass the AOA written test.

3.2.4.3.6.1 . (Added JBPEARLHARBOR-HICKAM) The Wing ADPMs, or designated representative, will document the completion of AOA written test.

3.2.4.4.1 . (Added JBPEARLHARBOR-HICKAM) For first time wing failures, individuals will be sent back to Step Three in ADTP. Unit ADPMs (not to be delegated) will provide remedial training and a comprehensive review of failed areas. Unit ADPMs will annotate the remedial training and comprehensive review in the individual's ADTP profile. The wing test will be re-administered/enabled no earlier than three calendar days from the first test failure date.

3.2.4.4.2 . (Added JBPEARLHARBOR-HICKAM) For second time wing failures, individuals will be sent back to Step Three in ADTP. Unit ADPMs (not to be delegated) will provide remedial training and a comprehensive review of failed areas. Unit ADPMs will annotate the remedial training and comprehensive review in the individual's ADTP profile.

3.2.4.4.2.1 . (Added JBPEARLHARBOR-HICKAM) Individuals will be required to provide written justification stating they have received remedial training and are prepared to safely operate a vehicle on the airfield. The written endorsement will be signed by their Flight Commander and provided to the unit ADPM, prior to retesting. The wing test will be re-administered/enabled no earlier than seven calendar days from the second wing test failure date.

3.2.4.4.3 . (Added JBPEARLHARBOR-HICKAM) For first time AOA test failures, individuals will receive remedial training from the unit ADPM (not to be delegated). The AOA test will be re-administered no earlier than seven calendar days from the first AOA test failure date.

3.2.4.4.4 . (Added JBPEARLHARBOR-HICKAM) For second time AOA test failures, individuals will receive remedial training from the unit ADPM (not to be delegated). Unit ADPMs will annotate the remedial training and comprehensive review in the individual's ADTP profile.

3.2.4.4.4.1 . (Added JBPEARLHARBOR-HICKAM) Individuals will be required to provide written justification stating they have received remedial training and are prepared to safely operate a vehicle on the airfield. The written endorsement will be signed by their Squadron Commander and provided to the unit and Wing ADPMs, prior to retesting. The wing test will be re-administered/enabled no earlier than 14 calendar days from the second AOA test failure date.

3.2.4.4.5 . (Added JBPEARLHARBOR-HICKAM) For all third time test failures, individuals will not be allowed to retest and will not be permitted to drive on the airfield.

3.2.7.1.2.1 . (Added JBPEARLHARBOR-HICKAM) Escorts must be trained and certified to drive on the airfield.

3.2.7.2.2.1 . (Added JBPEARLHARBOR-HICKAM) When the ATCT frequency is busy, individuals should wait for a break in radio activity to make their radio call.

3.2.7.2.4 . (Added JBPEARLHARBOR-HICKAM) Vehicles operating in the AOA must be equipped with an overhead rotating/flashing and/or strobe beacon visible for at least one mile.

3.2.7.2.6.1.1 . (Added JBPEARLHARBOR-HICKAM) Vehicle and/or pedestrian call signs are provided in Attachment 15, Table A15.1.

3.2.7.2.8.1 . (Added JBPEARLHARBOR-HICKAM) Using the airfield for convenience is prohibited. Do not use the airfield as a thoroughfare when there are accessible roads on the perimeter area.

3.2.7.2.10 . (Added JBPEARLHARBOR-HICKAM) AOA Ramp and Apron Areas. Military/Government employees from Hickam will not have access to the HNL aircraft parking ramps or aprons unless they have been issued a HNL security badge. Exception: Hickam Fire Department may access HNL parking area when requested by HNL/State Department of Transportation (SDOT) officials or following Primary Crash Circuit (PCC) activation.

3.2.7.2.11 . (Added JBPEARLHARBOR-HICKAM) Signs to alert driver of aircraft push backs are as follows: aircraft belly and dome lights turned on (usually red and blinking), no ground equipment near or attached to the aircraft, loading bridge has been removed, nose wheel chocks removed, or road guards posted.

3.2.7.2.12 . (Added JBPEARLHARBOR-HICKAM) Use fixed landmarks to help identify taxiway locations.

3.2.7.2.12.1 . (Added JBPEARLHARBOR-HICKAM) Taxiway Delta on the North Ramp - Located abeam of Gate #30.

3.2.7.2.12.2 . (Added JBPEARLHARBOR-HICKAM) Taxiway Delta on the South Ramp - Located abeam of the FAA Maintenance Hangar.

3.2.7.2.12.3 . (Added JBPEARLHARBOR-HICKAM) Taxiway Echo on the North Ramp - Located abeam of Gate #18.

3.2.7.2.12.4 . (Added JBPEARLHARBOR-HICKAM) Taxiway Echo on the South Ramp - Located abeam of Hangar GA-1.

3.2.7.2.13 . (Added JBPEARLHARBOR-HICKAM) Vehicles using the ramp roadway to the inter-island terminal must cross two taxiways (Golf and Lima). Use extreme caution when using this area and give way to all aircraft. Inter-island traffic generally exits by Taxiway Lima and enters via Taxiway Golf.

3.2.7.2.14 . (Added JBPEARLHARBOR-HICKAM) Incorrect terminology to include "10" codes, and phrases like "10-4" are not permitted.

3.2.7.4.4.1 . (Added JBPEARLHARBOR-HICKAM) The most current airfield diagram will be uploaded in ADTP.

3.2.7.5.1.1 . (Added JBPEARLHARBOR-HICKAM) Mandatory signs are provided when an instruction must be follow**ed.** A mandatory sign is internally lit and has white inscription on a red background as depicted in **Attachment 10**, **figures A10.1**. and **A10.2**

3.2.7.5.1.2 . (Added JBPEARLHARBOR-HICKAM) Non-mandatory signs are classified as informational and guidance signs. These signs are used as necessary to indicate a specific location, direction, or other useful information. Non-mandatory signs include taxiway location signs, boundary signs, taxiway signs, and runway exit signs as depicted in Attachment 10, figures A10.3. A10.4. A10.5 and A10.6.

3.2.7.5.1.2.1 . (Added JBPEARLHARBOR-HICKAM) Boundary Signs. These signs are used to identify the exit boundary of a runway protected area and instrument holding position protected area. The runway protected area boundary sign has a black inscription that depicts a holding position marking on a yellow background. The instrument holding position protected area boundary sign has a black inscription that depicts the ILS/INST holding position marking on a yellow background. Vehicle operators can use these signs as a guide when to report back to ATCT when they have exited a runway or ILS critical area.

3.2.7.5.1.2.2 . (Added JBPEARLHARBOR-HICKAM) Taxiway Direction sign. These signs have black inscriptions on a yellow background and always contain arrows oriented to the approximate direction of the turn as depicted in Attachment 10, figure A10.3.

3.2.7.5.1.2.3 . (Added JBPEARLHARBOR-HICKAM) Runway Exit Sign. These signs are located prior to a runway/taxiway intersection on the side and in the direction of the exit taxiway. This sign has a black inscription on a yellow background with an arrow oriented to the direction of the exit taxiway as depicted in Attachment 10, figure A10.6.

3.2.7.5.2.1 . (Added JBPEARLHARBOR-HICKAM) Runway Markings. Solid white lines running the length of the runway denote the runway edge. Dashed white lines running down the middle of the runway denote the runway centerline. White numbers at the ends of each runway mark the designation. Note: Runway shoulder markings and chevron markings in the overruns are yellow in color to identify areas along the edge of the runway and overruns not intended for use by aircraft.

3.2.7.5.2.2 . (Added JBPEARLHARBOR-HICKAM) Taxiway and Apron Markings: Solid double yellow lines denote the edge of a taxiway or apron. Single solid yellow line denotes the taxiway/taxi lane centerline as depicted in Attachment 9, figure A9.4.

3.2.7.5.2.3 . (Added JBPEARLHARBOR-HICKAM) Instrument (INST) Hold Position: These markings consist of two solid yellow lines, two feet apart, extending across width of taxiway, connected by pairs of solid yellow lines ten feet apart, on black background. Hold positions will be used during IFR conditions or instrument approach procedures. IFR hold positions protect ILS critical area to ensure an aircraft's instrument reception is not disrupted during flight. Vehicles will stop and remain behind the instrument hold lines and "ILS" signs, and obtain approval from ATCT during instrument flight rules (IFR) weather conditions. Contact ATCT if in doubt. Depicted in Attachment 9, figure A9.2.

3.2.7.5.2.4 . (Added JBPEARLHARBOR-HICKAM) VFR Hold Position: VFR hold positions are located at least 100 feet from the edge of the runway on all taxiways leading to the runway and consist of four parallel yellow stripes perpendicular to the axis of taxiway centerline, extending across taxiway. The two stripes closest to the runway are dashed lines and the other two are solid lines. These lines mark the boundary of the AOA. Vehicles will not cross the runway hold position or proceed onto the runway without first obtaining permission from the ATCT. Depicted in Attachment 9, figure A9.1.

3.2.7.5.2.5 . (Added JBPEARLHARBOR-HICKAM) FAA enhanced hold lines are located on Taxiway Tango, two additional yellow dashed lines are located perpendicular to the existing hold line. Individuals requiring runway access/crossing must stop at this line and receive permission from ATCT prior to proceeding. Depicted in Attachment 9, figure A9.7.

3.2.7.5.2.6 . (Added JBPEARLHARBOR-HICKAM) AOA hold line marking. All individuals must stop at this line and receive permission from ATCT prior to proceeding. AOA hold lines are painted on taxiways and painted yellow. These markings are made up of two lines, one dash line and one solid line. The dashed line is located closest to the runway. Depicted in Attachment 9, figure A9.6.

3.2.7.5.2.6.1 . (Added JBPEARLHARBOR-HICKAM) The AOA hold markings are located on Taxiway V and Taxiways A1-A4 when approaching Honolulu International from Hickam. Depicted in Attachment 9, figure A9.6.

3.2.7.5.2.6.2 . (Added JBPEARLHARBOR-HICKAM) These lines do not have corresponding signage and may be less visible during darkness, rainfall, and other periods of reduced visibility.

3.2.7.5.2.7 . (Added JBPEARLHARBOR-HICKAM) Taxi lane Edge Marking. This marking is used to define the limits of the designated taxi route and ensure appropriate wingtip clearance for aircraft taxiing through the parking aprons. These markings consist of two 6-inch wide broken strips separated by a gap 6-inches wide. The stripes are 15 feet long with gaps of 25 feet between them. Vehicle operators will park or drive vehicles behind this marking when approached by an oncoming aircraft to ensure appropriate wingtip clearance is provided between aircraft taxiing through parking aprons. Depicted in Attachment 9, figure A9.3.

3.2.7.5.2.8 . (Added JBPEARLHARBOR-HICKAM) Restricted Area Marking. Restricted areas are identified by a solid red line on the pavement surface. Entrance is limited to authorized personnel only and the AF Form 1199C must be properly marked, worn and visible. Restricted area entry/exit is made through the Entry Control Points.

3.2.7.5.3.1 . (Added JBPEARLHARBOR-HICKAM) Runway Lighting. The runway consists of runway edge lights, runway end lights, and runway threshold lights, which are used to outline the lateral and longitudinal limits of the usable surface of the runway. Runway edge lights are white in color and define the edge of the runway. Runway threshold lights are green in color to provide positive identification of the beginning of the operational runway surface. Refer to AFI 11-218, paragraphs 3.9.1.–3.9.3., for additional information on these runway lighting systems.

3.2.7.5.3.2 . (Added JBPEARLHARBOR-HICKAM) Taxiway Edge Lights. Taxiway edge lights are used to outline the edges of taxiways during periods of darkness or restricted visibility conditions. These fixtures emit blue light as depicted in Attachment 10, figure A10.8.

3.2.7.5.3.3 . (Added JBPEARLHARBOR-HICKAM) Airfield aprons are lit with white, stadium ballpark lights.

3.2.7.6.1.1 . (Added JBPEARLHARBOR-HICKAM) Vehicle parking areas – 5 miles per hour (maximum).

3.2.7.6.2.1 . (Added JBPEARLHARBOR-HICKAM) Aircraft parking ramps – 15 miles per hour (maximum).

3.2.7.6.3.1 . (Added JBPEARLHARBOR-HICKAM) Airfield access or bypass road – 15 miles per hour (maximum).

3.2.7.6.4.1 . (Added JBPEARLHARBOR-HICKAM) Honolulu Taxiways – 30 miles per hour (maximum).

3.2.7.6.4.2 . (Added JBPEARLHARBOR-HICKAM) JBPEARLHARBOR-HICKAM Taxiways – 15 miles per hour (maximum).

3.2.7.6.4.3 . (Added JBPEARLHARBOR-HICKAM) The centerline areas of the taxiway or taxilanes are reserved as safety lanes and kept clear of vehicles and equipment. The only vehicles authorized to operate on the centerline of a taxiway include, but are not limited to, Airfield Management vehicles, Flight Safety vehicles, airfield sweepers and vehicles towing aircraft. All other vehicles will use taxiway shoulders if available and/or the edge of taxilanes to transit to and from areas on the airfield.

3.2.7.6.5.1 . (Added JBPEARLHARBOR-HICKAM) Runways – 55 miles per hour (maximum).

3.2.7.6.6.1 . (Added JBPEARLHARBOR-HICKAM) Vehicle traffic lanes – 15 miles per hour (maximum).

3.2.7.6.7.1 . (Added JBPEARLHARBOR-HICKAM) Aircraft ground equipment – 15 miles per hour (maximum).

3.2.7.6.7.1.1 . (Added JBPEARLHARBOR-HICKAM) Single maintenance stand towing – 10 miles per hour (maximum).

3.2.7.6.7.1.2 . (Added JBPEARLHARBOR-HICKAM) Multiple maintenance stand towing – 5 miles per hour (maximum).

3.2.7.6.7.2 . (Added JBPEARLHARBOR-HICKAM) Aircraft towing – 5 miles per hour (maximum).

3.2.7.6.8 . (Added JBPEARLHARBOR-HICKAM) Special purpose vehicles (e.g., refueling vehicles) – 10 miles per hour (maximum).

3.2.7.7.1 . (Added JBPEARLHARBOR-HICKAM) No vehicle will be left unattended or drive closer than 25 feet in front of or 200 feet to the rear of any aircraft when the aircraft engines are in operation.

3.2.7.7.2 . (Added JBPEARLHARBOR-HICKAM) Vehicles operating in close proximity to any aircraft (within 25 feet) will not exceed 5 miles per hour (maximum).

3.2.7.7.3 . (Added JBPEARLHARBOR-HICKAM) Vehicles operating in close proximity to any aircraft (within 25 feet) will drive with the vehicle driver's side towards the aircraft.

3.2.7.7.4 . (Added JBPEARLHARBOR-HICKAM) Vehicles will not be operated within 10 feet of any parked aircraft unless the vehicle is required for aircraft ground servicing. The use of a vehicle spotter and pre-positioned chocks are required. The delivery of coffee, meals, etc., does not qualify as ground servicing.

3.2.7.7.5 . (Added JBPEARLHARBOR-HICKAM) Under no circumstance will a vehicle stop in front of, or drive into the path of a moving aircraft with the exception of "guide" or "follow-me" vehicles. No vehicles will be driven between an aircraft and the "follow-me" vehicle.

3.2.7.7.6 . (Added JBPEARLHARBOR-HICKAM) Vehicle operators will yield the right of way to all taxiing/towed aircraft. Under no circumstance will a vehicle operate within 25 feet (minimum) of taxiing/towed aircraft. Vehicles will immediately exit the taxiing path of the aircraft until the aircraft has cleared the area.

3.2.7.7.6.1 . (Added JBPEARLHARBOR-HICKAM) If the minimum taxiing wingtip clearance cannot be met, vehicles are authorized to exit paved surfaces. Prior to returning to paved surfaces, FOD checks will be accomplished.

3.2.7.7.7 . (Added JBPEARLHARBOR-HICKAM) Operators will not drive a vehicle within 50 feet of aircraft fueling or de-fueling operations, unless specifically authorized by a directive.

3.2.7.8.1 . (Added JBPEARLHARBOR-HICKAM) Extreme caution must be used during reverse operations around any aircraft. Vehicles reversing up to an aircraft must have chocks in position and a vehicle spotter and/or marshalling assistance. Vehicles will not operate in reverse in close proximity to an aircraft unless absolutely necessary.

3.2.7.8.2 . (Added JBPEARLHARBOR-HICKAM) All vehicles will be parked with the driver's side of the vehicle perpendicular to the nose of the aircraft (minimum 25 feet distance). Servicing vehicles (e.g., fleet services, refueling vehicles, etc.) may be exempt from this parking requirement during servicing operations.

3.2.7.8.2.1 . (Added JBPEARLHARBOR-HICKAM) Servicing vehicles required to be parked within 10 feet of an aircraft will place parking chocks on the rear wheel (driver's side) with parking brakes applied.

3.2.7.9.1 . (Added JBPEARLHARBOR-HICKAM) All vehicles and/or aircraft ground equipment operating in/or around the airfield are considered mobile obstacles. All other vehicles operating on the airfield must comply with the following:

3.2.7.9.1.1 . (Added JBPEARLHARBOR-HICKAM) Lateral clearance distances from taxiway centerlines to parked or mobile obstacles is 200 feet (minimum). No vehicle will be parked and

left unattended within 200 feet of either side of taxiway centerlines. Exception: Vehicles and/or personnel conducting official business may request approval from either the 15th Wing, Airfield Management and/or 154th Wing, Airfield Management in order to operate within the 200 feet lateral clearance distance of any taxiway centerline.

3.2.7.9.1.2 . (Added JBPEARLHARBOR-HICKAM) Lateral clearance distances from the edge of all parking aprons to fixed or mobile obstacles is 150 feet (minimum) on all Hickam Ramps. Lateral clearance distances from the edge of all parking aprons to fixed or mobile obstacles is 27.5 feet (minimum) on all HIANG Ramps. Note: All fixed obstacles must be coordinated and approved by the 15th Wing, Airfield Manager and/or 154th Wing, Airfield Manager prior to installation.

3.2.7.9.1.3 . (Added JBPEARLHARBOR-HICKAM) Lateral clearance distances from runway centerlines to fixed or mobile obstacles is 1,000 feet (minimum). This area is located within the AOA and radio contact with the ATCT must be established and maintained at all times. When operating within this area, do not park and leave a vehicle or equipment unattended, unless coordinated and approved by the 15th Wing, Airfield Manager and/or 154th Wing, Airfield Manager.

3.2.7.9.1.4 . (Added JBPEARLHARBOR-HICKAM) Mobile aircraft ground equipment will be placed on the airfield in pre designated areas no earlier than three hours prior to an aircraft arrival and must be removed from the airfield no later than three hours after the aircraft departs.

3.2.7.11.1.4 . (Added JBPEARLHARBOR-HICKAM) Vehicles must have a trash can and/or FOD container cleaned out and all loose objects (e.g., bolts, straps, packing materials, cans, etc.) must be secured prior to driving on the airfield.

3.2.7.11.1.5 . (Added JBPEARLHARBOR-HICKAM) If significant FOD is found on the airfield notify Airfield Management Operations (AMOPS) via radio and/or via commercial at (808) 449-0046 or DSN at 315-449-0046. AMOPS will inspect the requested area and contact airfield sweeper, as required.

3.2.7.11.1.6 . (Added JBPEARLHARBOR-HICKAM) Hats are prohibited on the airfield and are considered FOD potential. If a hat is carried onto the airfield, it will be properly secured. Exception: Safety hard hats are authorized in approved construction areas.

3.2.7.12.1 . (Added JBPEARLHARBOR-HICKAM) Utilization of cellular/mobile phones (to include Bluetooth) and vehicle radios are prohibited while driving on the airfield and are considered a driving violation. When required, for official/business use, vehicle operators will park in a safe location prior to utilization. Use of approved devices may impair driving and may prevent recognition of emergency signals, alarms or radio calls.

3.2.7.13.1 . (Added JBPEARLHARBOR-HICKAM) During restricted visibility or night operations, vehicle headlights and emergency flashers will be turned on when operating on any area of the airfield. Note: Vehicle headlights will be turned off if lights are shining towards a moving aircraft however, parking lights or emergency flashers will remain on.

3.2.7.13.1.1 . (Added JBPEARLHARBOR-HICKAM) Vehicles that are required to temporarily park on any area of the airfield are required to turn on their flashing hazard lights and/or parking lights.

3.2.7.13.2 . (Added JBPEARLHARBOR-HICKAM) All vehicles (except responding emergency vehicles) will not operate on the airfield when the visibility is less than 100 feet (minimum).

3.2.7.13.3 . (Added JBPEARLHARBOR-HICKAM) During restricted visibility and/or night operations, airfield drivers maybe instructed by the ATCT to hold short at the IFR hold line located on taxiways leading up to runways. This area may be identified by an IFR hold line sign and/or an IFR hold line marking. IFR hold line markings are identified as two yellow parallel lines separated by a series of vertical lines, which resembles a ladder.

3.2.7.14.1 . (Added JBPEARLHARBOR-HICKAM) During restricted visibility and/or night operations, vehicle daytime running lights will be turned off if lights are shining towards a moving aircraft however, parking lights or emergency flashers will remain on.

3.2.7.15.1 . (Added JBPEARLHARBOR-HICKAM) Motorcycles, mopeds, and/or motorized/non-motorized scooters are prohibited on the airfield. Government issued golf-type carts and/or bicycles/tricycles are permitted on the aircraft parking ramps. Government issued golf-type carts and/or bicycles/tricycles will follow all rules established for all general and special purpose vehicles and be equipped with forward and rear lamps if operated at night. Operators of these modes of transportation are required to complete all airfield driver's training and possess an AF Form 483.

3.2.7.16.1 . (Added JBPEARLHARBOR-HICKAM) Vehicles will not drive over the red carpet located adjacent to spot DV-1 and/or memorial brass plates located adjacent to spot DV-2.

3.2.7.16.2 . (Added JBPEARLHARBOR-HICKAM) Vehicles will not drive over in-ground fuel pits located on aircraft parking spots. The fuel pits are identified with yellow paint.

3.2.7.17.1 . (Added JBPEARLHARBOR-HICKAM) All vehicle traffic lanes located on the airfield will be used to the maximum extent possible.

3.2.7.17.2 . (Added JBPEARLHARBOR-HICKAM) "Kamakahi" access road from Gate 39 to the Alert Facility is not considered part of the airfield. Vehicles utilizing this access road are not required to possess a POV pass for their vehicle.

3.2.7.17.3 . (Added JBPEARLHARBOR-HICKAM) Vehicles utilizing the traffic lane located in front of the Fire Department will give way to all emergency response vehicles. All vehicles must stop and look before crossing in front of the Fire Department.

3.2.7.17.4 . (Added JBPEARLHARBOR-HICKAM) The Hot Cargo Pad is located within the AOA. To access the Hot Cargo Pad via Taxiway Bravo, drivers must be AOA qualified and maintain radio contact with ATCT at all times. Drivers without AOA qualifications, must enter the Hot Cargo Pad via the access road off of Mamala Bay Drive, but must remain outside the AOA at all times.

3.2.7.17.5 . (Added JBPEARLHARBOR-HICKAM) Vehicles that require access to and/or from the 154 ANG side of the airfield will use the access road directly behind the Fighter Alert Facility.

3.2.7.18 . (Added JBPEARLHARBOR-HICKAM) All airfield drivers will conduct refresher training annually, at a minimum. All required refresher training items are located on the ADTP website. Mandatory refresher training at a minimum, will include:

3.2.7.18.4 . (Added JBPEARLHARBOR-HICKAM) Completion of the Wing Airfield Driving Refresher test.

3.2.7.18.5 . (Added JBPEARLHARBOR-HICKAM) AOA refresher training consists of completing all AOA refresher training items in ADTP and passing the AOA test. AOA refresher training is only mandatory for AOA qualified personnel.

3.2.7.18.6 . (Added JBPEARLHARBOR-HICKAM) Individuals who fail their refresher test will be allowed to re-test up to 3 times, no earlier than 3 calendar days from the first failure. Individuals who fail the test four times will have their airfield driving records deleted and be required to reaccomplish training in its entirety.

3.2.7.19.1 . (Added JBPEARLHARBOR-HICKAM) Unit ADPMs will ensure airfield driving operators are aware of visual blind spots. The ATCT has visual blind spots at the following locations: under the fighter aircraft sunshades, Taxiway Echo and North Ramp. Vehicle operators must maintain situational awareness at all times while operating a vehicle on the airfield. There are no radio blind spots on JBPEARLHARBOR-HICKAM airfield. See Attachment 16 Figure A16.1. Hickam Ramp Control Blind Spot.

3.2.7.20 . (Added JBPEARLHARBOR-HICKAM) JBPEARLHARBOR-HICKAM primary emergency response agencies are: Fire Department and Crash Recovery. JBPEARLHARBOR-HICKAM secondary (follow-on/support) response agencies are: Airfield Management, Security Forces, Medical, and Safety. Additional support agencies may be identified and/or requested by the Fire Chief or incident/on-scene commander.

3.2.7.20.1 . (Added JBPEARLHARBOR-HICKAM) Secondary emergency responders will stage response vehicles on the “Kamakahi” vehicle access road adjacent to the Alert Facility Guard Shack. Personnel will stage response vehicles on the access road in order to not block aircraft movement.

3.2.7.20.3 . (Added JBPEARLHARBOR-HICKAM) During an airfield emergency incident, all vehicles not directly involved with the situation will immediately leave the emergency area.

3.2.7.21 . (Added JBPEARLHARBOR-HICKAM) There are no vehicle traffic control devices/lights located on JBPEARLHARBOR-HICKAM airfield.

3.2.7.22 . (Added JBPEARLHARBOR-HICKAM) There are no applicable blackout conditions on JBPEARLHARBOR-HICKAM/Honolulu airfield.

3.2.7.23.1 . (Added JBPEARLHARBOR-HICKAM) One individual may act as an escort for up to five additional vehicles as long as all vehicles remain within 250 feet of each other. The escort vehicle must maintain radio contact with the appropriate radio frequency and some form of contact with all vehicles being escorted while on the airfield.

3.2.7.23.1.1 . (Added JBPEARLHARBOR-HICKAM) If operating in the AOA, the escort vehicle is responsible to request and relay all ATCT driving instructions and communications for the escorted group.

3.2.7.23.2 . (Added JBPEARLHARBOR-HICKAM) Personnel escorting individuals into the restricted areas are responsible for that person and must stay in close proximity to the escorted individual. All escorted personnel must be visible at all times by the escort official and the escort must have escort privileges.

3.2.7.24 . (Added JBPEARLHARBOR-HICKAM) Due to tropical weather conditions, vehicles equipped with supplemental traction devices (tire chains, studded tires, etc.) are prohibited on JBPEARLHARBOR-HICKAM airfield.

3.2.7.25.1 . (Added JBPEARLHARBOR-HICKAM) Personnel driving on the airfield must use caution when driving behind taxiing aircraft, near parked aircraft and/or aircraft with engines running. When aircraft engines are running, or are about to be started, remain 25 feet to the front or 200 feet to the rear (at a minimum) of any aircraft. The recommended safety distance is 500 feet to the rear of any aircraft.

3.2.7.26.1 . (Added JBPEARLHARBOR-HICKAM) Smoking is prohibited on all areas of JBPEARLHARBOR-HICKAM airfield unless in a designated and approved smoking pit location.

3.2.7.27.1 . (Added JBPEARLHARBOR-HICKAM) Jet blast hazard areas will be avoided while in use. The minimum safety distance to the jet blast hazard area is 500 feet.

3.2.7.28 . (Added JBPEARLHARBOR-HICKAM) Procedures to Enter/Exit Airfield Gates and Piggy-Backing Policy.

3.2.7.28.1 . (Added JBPEARLHARBOR-HICKAM) “Piggy Backing” (more than one vehicle following closely behind another vehicle entering or exiting through an ECP or gate) is not permitted due to security and safety concerns. Vehicle operators entering or exiting ECPs and gates must hold in front or behind the gate until the gate is secured to prevent unauthorized vehicle entry into the area.

3.2.7.28.2 . (Added JBPEARLHARBOR-HICKAM) Violators of this policy will be cited and have their airfield driving privileges suspended for 5 duty days.

3.2.7.29 . (Added JBPEARLHARBOR-HICKAM) Procedures for Passengers in vehicles.

3.2.7.29.1 . (Added JBPEARLHARBOR-HICKAM) Passengers may only ride in the bed of a vehicle if all seats are filled in the cab and the bed has been equipped/modified with seatbelts.

3.2.7.30 . (Added JBPEARLHARBOR-HICKAM) Procedures for operating around the Clear Water Rinse Facility (CWRF).

3.2.7.30.1 . (Added JBPEARLHARBOR-HICKAM) Use caution when operating vehicles in and around the CWRF.

3.2.7.30.2 . (Added JBPEARLHARBOR-HICKAM) Operators must obtain clearance, from 647 SFS Base Defense Operations Center (BDOC), to “break red” in order to enter the CRWF from 20 row.

3.2.8.1.1 . (Added JBPEARLHARBOR-HICKAM) Unit Commanders, Unit ADPMs, Airfield Management and Security Forces personnel are authorized to revoke or suspend airfield driving privileges. They will take appropriate disciplinary action depending on severity of violation.

3.2.8.1.2 . (Added JBPEARLHARBOR-HICKAM) The Wing ADPM, Unit ADPM and Unit Commander must be notified in writing when the revocation or suspension occurs.

3.2.8.1.3 . (Added JBPEARLHARBOR-HICKAM) First Non-AOA violation will normally incur a warning (minimum) or up to 30-day suspension of airfield driving privileges. After the

30-day suspension period, reinstatement of airfield driving privileges requires complete retraining and a letter of reinstatement from the individual's flight commander.

3.2.8.1.3.1 . (Added JBPEARLHARBOR-HICKAM) A second Non-AOA violation will result in a 60 day suspension of airfield driving privileges. After the 60-day suspension period, reinstatement of airfield driving privileges requires complete retraining and a letter of reinstatement from the individual's flight commander.

3.2.8.1.4 . (Added JBPEARLHARBOR-HICKAM) The first AOA violation will result in an automatic 30-day airfield driving privilege suspension. After the 30-day suspension period, reinstatement of airfield driving privileges requires complete retraining and a letter of reinstatement from the individual's flight commander.

3.2.8.1.4.1 . (Added JBPEARLHARBOR-HICKAM) A second AOA violation will result in an automatic 90-day suspension period. Reinstatement of airfield driving privileges requires complete retraining and a letter of reinstatement from the individual's squadron commander.

3.2.8.1.5 . (Added JBPEARLHARBOR-HICKAM) A third Non-AOA / AOA violation by the same individual will result in being permanently barred from driving on the airfield.

3.2.8.1.6 . (Added JBPEARLHARBOR-HICKAM) The first runway incursion will result in an automatic 30-day airfield driving privilege suspension. After the 30-day suspension period, reinstatement of airfield driving privileges requires complete retraining and a letter of reinstatement from the individual's squadron commander. In the case of a second runway incursion, the individual will be permanently barred from driving on the airfield.

3.2.8.1.7 . (Added JBPEARLHARBOR-HICKAM) Other violations contained in this instruction (exceeding speed limits, conducting unsafe operations, failure to conduct FOD checks from unpaved to paved surface on airfield, etc) will result in a minimum 5-day suspension of airfield driving privileges and retraining will be handled in a case-by case basis.

3.2.8.2.1 . (Added JBPEARLHARBOR-HICKAM) Upon completion of all training requirements, the Unit Commander will request reinstatement of airfield driving privileges in writing. Note: The Unit ADPM will keep the reinstatement letter on file for 12 months and will send a copy of the reinstatement letter to the Wing ADPM. See **Attachment 13 Table 13.1 Sample Request for Reinstatement of Airfield Driver's License**

3.2.8.3.5 . (Added JBPEARLHARBOR-HICKAM) When made aware of an incident, violation, runway incursion and/or AOA violation, Honolulu ATCT or any agency/person noticing the violation will perform the following actions.

3.2.8.3.5.1 . (Added JBPEARLHARBOR-HICKAM) Notify AM immediately and escort the driver to AMOPs in building 2050.

3.2.8.3.5.2 . (Added JBPEARLHARBOR-HICKAM) If unable to contact the driver either by radio or in person, notify Security Forces Control Center (SFCC). If 647 SFS locates the driver, they will initiate a challenge on the vehicle. If SFS determines an airfield violation took place, they will escort the driver to AM to complete a report. If the driver is unauthorized on the airfield or another security issue is witnessed, SFS will transport the driver to the SFCC and conduct an investigation. Note: If vehicle proceeds into the AOA, SFS will not follow the vehicle into AOA. SFS will immediately notify AM or HRF of the incident/violation.

3.2.8.3.5.3 . (Added JBPEARLHARBOR-HICKAM) If HRF personnel notice a violation, they will notify AM and document the event in their daily events logs.

3.2.8.3.6 . (Added JBPEARLHARBOR-HICKAM) Suspension/revocation of civilian driver's license will automatically result in suspension of an individuals airfield driving privileges.

3.2.8.4.1. **(Added JBPEARLHARBOR-HICKAM)** Personnel who do not complete annual refresher training will have their airfield driving profile deleted in ADTP and/or privileges suspended by the Unit ADPM or Wing ADPM.

3.2.8.5.3 . (Added JBPEARLHARBOR-HICKAM) Personnel may document using **Attachment 14 Table 14.1 Airfield Driving Violations Statement.**

3.2.9.3.1 . (Added JBPEARLHARBOR-HICKAM) Local briefing/training will be good for up to 6 months.

3.2.9.3.2 . (Added JBPEARLHARBOR-HICKAM) AF Form 483 will expire on the date of work completion.

3.2.9.4.1 . (Added JBPEARLHARBOR-HICKAM) Unit ADPMs will provide local training/briefings to TDY personnel, Inspection/Survey Teams and non-base assigned contractors. Unit ADPMs may request assistance from the Wing ADPM as needed.

3.2.9.4.2 . (Added JBPEARLHARBOR-HICKAM) Unit ADPMs will provide a completed Attachment 7 to Airfield Management to process an AF Form 483 prior to the personnel driving on the airfield.

3.2.9.7 . (Added JBPEARLHARBOR-HICKAM) TDY personnel, Inspection/Survey Teams and non-base assigned contractors may be escorted by someone who possesses and AF Form 483 by the sponsoring unit representing them.

3.2.9.8 . (Added JBPEARLHARBOR-HICKAM) Contractors must be escorted in restricted areas unless the area has been designated as a free zone. Escorts must have a line badge and a current and valid AF Form 483 signed by AM.

3.2.9.9 . (Added JBPEARLHARBOR-HICKAM) It is the primary contractor's responsibility to ensure that subcontractors are trained, receive a temporary AF Form 483, Attachment 7 and POV pass, or are escorted by a qualified contractor.

3.2.9.10 . (Added JBPEARLHARBOR-HICKAM) Qualified contractors will meet delivery vehicles at a location off the airfield and escort vehicles to and from the construction site using approved routes. Coordinate and approve hauling operations through AM prior to the operation.

3.2.9.11 . (Added JBPEARLHARBOR-HICKAM) Contractor drivers will comply with provisions of this instruction and driving conditions negotiated at pre-construction meetings, or as stipulated in a Temporary Construction Waiver safety plan. Contractor vehicle operators who violate established provisions may be banned from operating motor vehicles or equipment on the airfield. Replacement drivers are the contractor's responsibility.

3.2.10.1 . (Added JBPEARLHARBOR-HICKAM) All vehicle pass requests will be submitted to the Wing ADPM by a MFR (Attachment 12 Table 12.**1 Sample Permanently/Temporary Privately Owned Vehicle Pass Letter)** for processing and approval. Passes are numbered and color coded for temporary and permanent passes. They must be visible and displayed in the

windshield of the vehicle when the vehicle is on the airfield. All passes are considered controlled items. The responsibility for security and safekeeping of the pass lies with the holder.

3.2.10.1.3.1 . (Added JBPEARLHARBOR-HICKAM) GLVs are vehicles rented or leased by government agencies for an official purpose.

3.2.10.3 . (Added JBPEARLHARBOR-HICKAM) POVs are highly discouraged on Hickam airfield and must be restricted to an absolute minimum for mission essentials operations. POV passes will only be issued if there are no GOV/GLVs available from crew transportation and a non-availability letter is given. POVs will not be authorized to operate in the AOA. Rental vehicles are considered POVs and require a POV Pass.

3.2.10.4 . (Added JBPEARLHARBOR-HICKAM) Permanent POV vehicle passes will be signed for and are only valid for the current calendar year and must be re-validated annually. The vehicle pass will change color to ensure the integrity of the pass is maintained.

3.2.10.5 . (Added JBPEARLHARBOR-HICKAM) Temporary Issued POV Vehicle Passes will expire at the end of the time period for which it was issued.

3.2.10.6 . (Added JBPEARLHARBOR-HICKAM) POV passes will not be discarded. Individuals will return all issued passes to Airfield Management when complete.

3.2.10.7 . (Added JBPEARLHARBOR-HICKAM) All passes are required to be visible when on the airfield and removed when exiting the airfield. Contact the Wing ADPM to replace lost or faded passes.

3.2.10.8 . (Added JBPEARLHARBOR-HICKAM) The POV pass is issued to the operator and/or unit or company and the vehicle.

3.2.10.9 . (Added JBPEARLHARBOR-HICKAM) When requested, the Wing ADPM will provide a list of all permanently and Temporary issued POV vehicle passes with the following information to the 647 SFS Installation Security Section: rank/name, unit, duty phone, make/model, color, and license plate number of the vehicle the POV vehicle pass will be used for. This list will be updated anytime a change is made to the listing.

3.2.12.5 . (Added JBPEARLHARBOR-HICKAM) Pedestrians will not jog on the airfield unless pre-coordinated and approved by the Airfield Manager. This includes flight line road, ramps, taxiways and runways.

WILLIAM H. BURKS, Colonel, USAF
Commander

Attachment 8 (Added)

HONOLULU AIRFIELD DIAGRAM

Figure A8.1. Honolulu Airfield Diagram (See Wing ADPM for most current Diagram).



Figure A8.2. (Added) HICKAM AIRFIELD DIAGRAM (See Wing ADPM for most current Diagram).


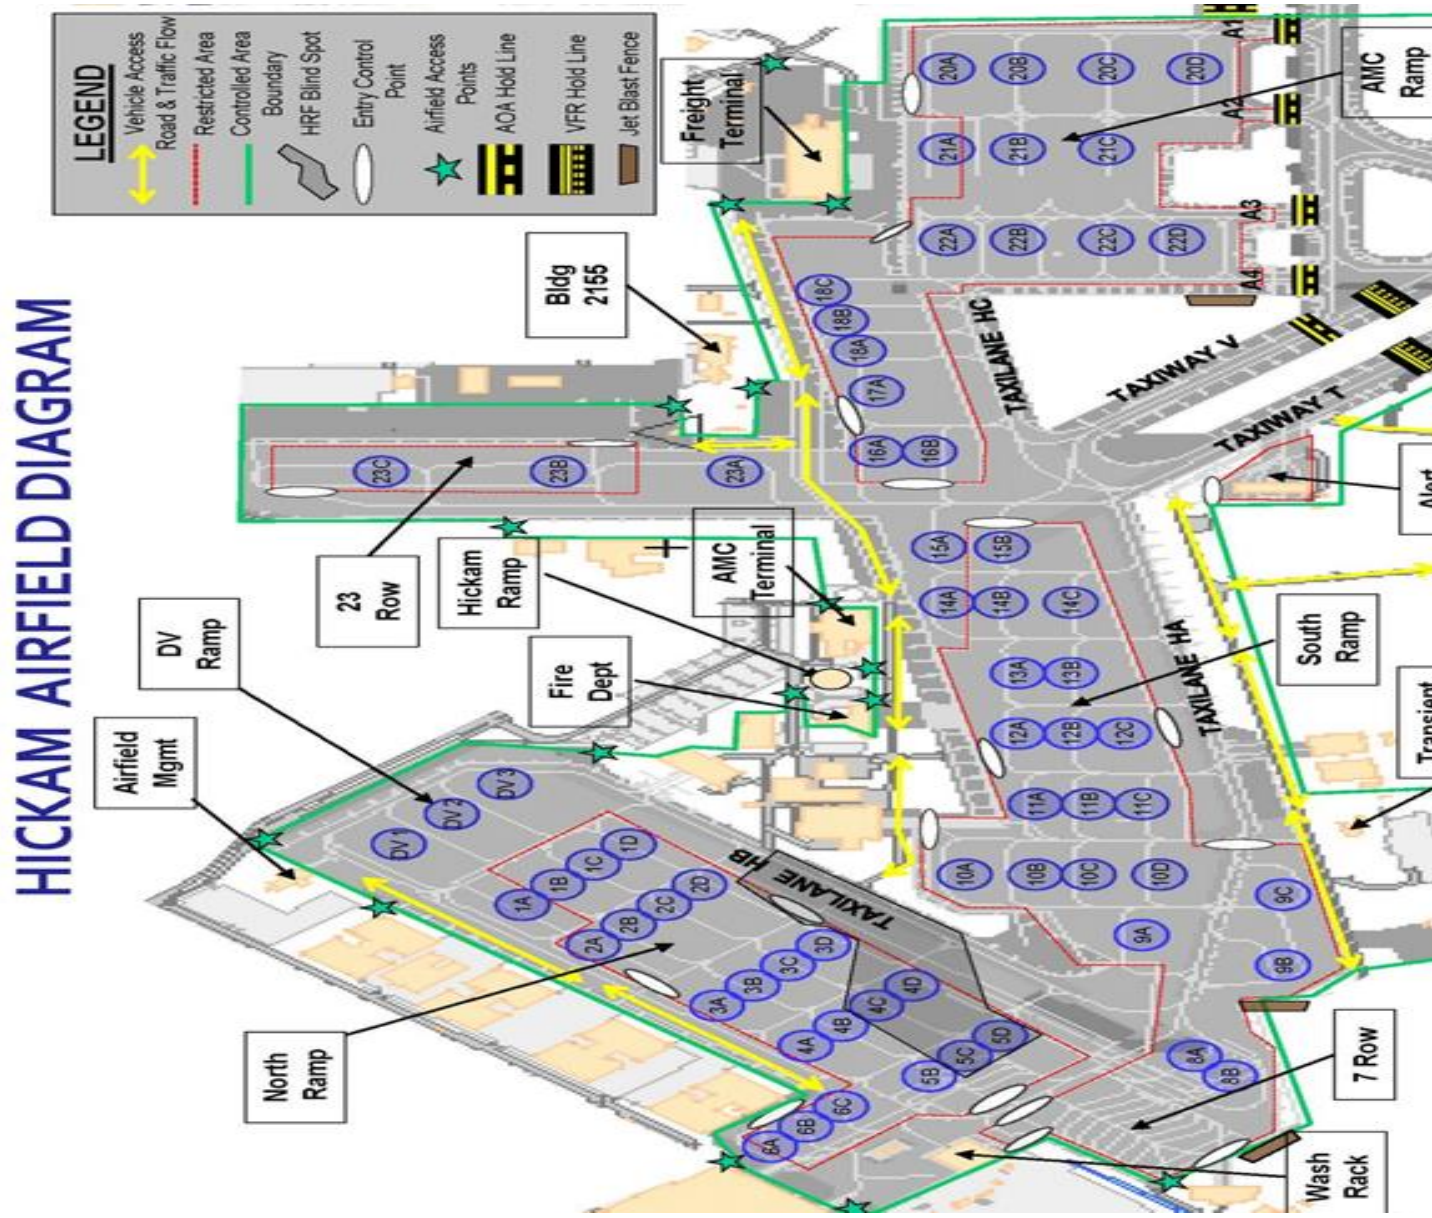


Figure A8.3. (Added) HIANG AIRFIELD DIAGRAM (See Wing ADPM for most current Diagram).

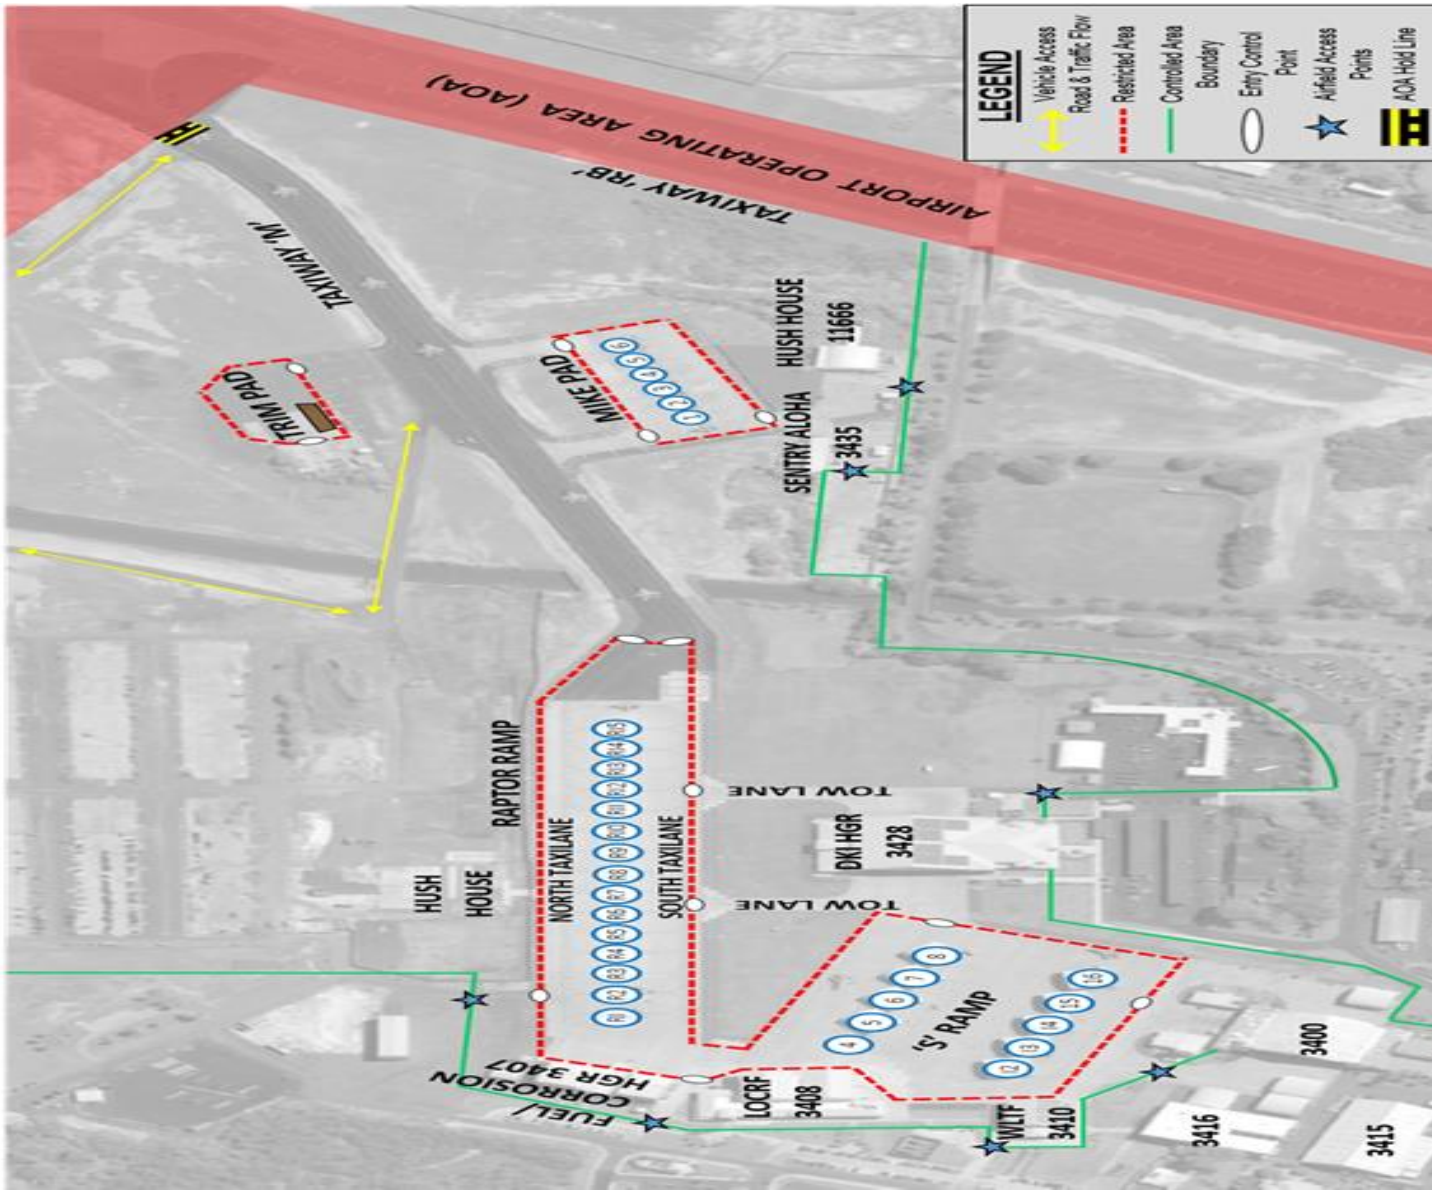

Attachment 9 (Added)

AIRFIELD MARKINGS

Figure A9.1. Runway Hold Position Marking.



Figure A9.2. Instrument INST/ILS Hold Position Marking.



Figure A9.3. Taxilane Edge Marking.



Figure A9.4. Continuous Taxiway Edge Line Marking.




Figure A9.5. Taxiway Centerline Marking.



Figure A9.6. Airfield Operating Area Marking.



Figure A9.7. FAA Enhanced Hold Position Marking.

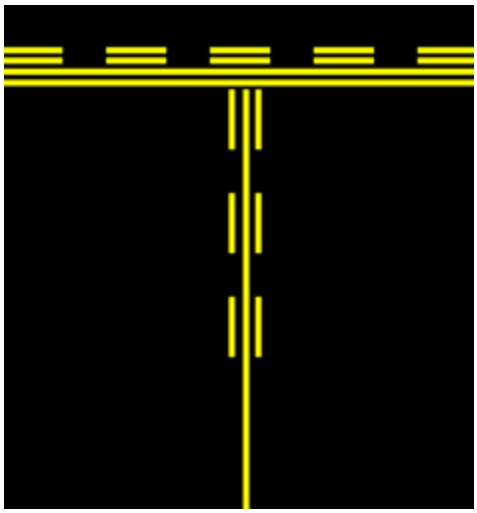

Attachment 10 (Added)

AIRFIELD SIGNS AND LIGHTING

Figure A10.1. Mandatory Runway Hold Position Sign with Taxiway Location Sign.



Figure A10.2. Mandatory Instrument Hold Position Sign at ILS Critical Area with Taxiway Location Sign.



Figure A10.3. Taxiway Direction Sign.



Figure A10.4. Taxiway Direction Sign with Taxiway Location Sign.



Figure A10.5. Boundary Sign for Runway Protection Area with Taxiway location Sign.



Figure A10.6. Runway Exit Sign.



Figure A10.7. Runway Edge Light.



Figure A10.8. Taxiway Edge Light.



Attachment 11 (Added)

COLOR VISION TESTING RESULTS

Table 11.1. Sample of Color Vision Testing Results Letter.

MEMORANDUM FOR: (Your Squadron/Unit) Airfield Driving Program Manager

FROM: Hospital/ Medical Group /Medical Treatment Facility Optometrist/off-base equivalent

SUBJECT: Color Vision Testing Results

1. In accordance with AFI 13-213, 3.2.5. and 15WGI 13-213, the following individual has been administered the color vision test. Results are documented below.

NAME/RANK:

Color Vision Test Results (Satisfactory / Unsatisfactory) _____
(Must distinguish red, green, yellow, white and blue) Print Medical Examiner's Name

_____

(Medical Examiner's Signature/Stamp)

Note: Upon completion of testing, member will return this signed memorandum to her/his Unit Airfield Driving Program Manager for web base system updating.

Attachment 12 (Added)

PERMANENTLY/TEMPORARY PRIVATELY OWNED VEHICLE PASS

Table 12.1. Sample Permanently/Temporary Privately Owned Vehicle Pass Letter.

DATE:

MEMORANDUM FOR 15 OSS/OSAA

FROM:

SUBJECT: Request for Temporary Privately Owned Vehicle Pass

1. I request permission to operate the following vehicle(s) on Joint Base Pearl Harbor-Hickam from _____ to _____. I understand this vehicle pass is valid on the main aircraft parking ramp and is not valid for accessing taxiways, runways or Honolulu Airport.

RANK/NAME	UNIT/COMPANY	PHONE NUMBER
MAKE/MODEL	YEAR	COLOR
LICENSE PLATE	STATE	AF IMT 483 NUMBER

2. Justification:

3. I acknowledge that I can be held responsible for all loss, damage or destruction of government property resulting from my negligence or willful misconduct, as well as that of my agents or employees. I have read, understand, and will comply with the content of the 15 Wing Airfield Driving Instruction.

Commander
Rank/Name, Print & Sign

1st Ind, 15 OSS/OSAA
Approve/Disapprove
Pass Number _____

FIRST M. LAST, Rank USAF
Title

Attachment 13 (Added)

REINSTATEMENT OF AIRFIELD DRIVERS LICENSE

Table A13.1. Sample Request for Reinstatement of Airfield Driver's License.

MEMORANDUM FOR 15 OSS/OSAA Deputy Airfield Manager

FROM:

SUBJECT: Request for Reinstatement of Airfield Driver's License

1. This request is for reinstatement of (Rank, Full Name, i.e., Amn Jon D. Drivefast), Airfield Driver's License. Nature and/or reason for reinstatement).

2. Rank & Last name, i.e., Amn Drivefast{ will be placed back into initial training for reinstatement of license IAW AFI 13-213 and this supplement. Once training has been completed, the Wing ADPM will be notified that all training requirements have been met and (Rank & Last Name, i.e., Amn Drivefast) fully understands his responsibilities and knowledge of driving on the airfield.

3. If you have any questions on this subject, contact my Unit ADPM at (provide number and email).

SIGNATURE BLOCK
Commander

Attachment 14 (Added)

AIRFIELD DRIVING VIOLATIONS STATEMENT

Figure 14.1. Airfield Driving Violations Statement.



AIRFIELD DRIVING VIOLATIONS STATEMENT

NAME/RANK	UNIT/SECTION
DUTY PHONE	CERTIFICATE NUMBER ON AF FORM 843, *CERTIFICATE OF COMPETENCY*
UNIT COMMANDER OR AIRFIELD DRIVING PROGRAM MANAGER (ADPM) NAME	
DATE/TIME OF INCIDENT/VIOLATION	
LOCATION OF INCIDENT/VIOLATION	
DETAILS/NATURE OF INCIDENT/VIOLATION (Continue on Reverse, if necessary.)	
I acknowledge and understand as a result from my negligence or willful misconduct my driving priveleges are suspended pending an investigation of the incident/violation. I understand I will be notified by my Unit ADPM the results of the investigation and the number of days my driving privileges are suspended.	
NAME/RANK	
SIGNATURE Click above to sign	Date

15 WG Form 31, 20130719

AIRFIELD DRIVING VIOLATIONS STATEMENT

DETAILS/NATURE OF INCIDENT/VIOLATION, Continued.

15 WG Form 31, 20130719 (Reverse)

Attachment 15 (Added)

AUTHORIZED VEHICLE CALL SIGNS

Table A15.1. Authorized Vehicular Call Signs.

Call Sign	Assigned Agency
OPS 1	15 OSS/OSA
AIRFIELD 1-3	15OSS/OSAA
WARRIOR1-6	15 WG/LEADERSHIP
MAINTENANCE 1-2	15 MXG LEADERSHIP
HAWK	15 MXG SUPERINTENDENT
ENGINEER 1,2,8,12,14,16	647 CES
AIRFIELD 5	647 CES
EXTERIOR ELECTRIC EE9	647 CES
TA 1-3	15 MXS
MAKO SUPER	15 MXS
CHIEF 1-2	FED FIRE DEPARTMENT
ENGINE 3-4	FED FIRE DEPARTMENT
ARFF 5-8	FED FIRE DEPARTMENT
PREVENTION 9	FED FIRE DEPARTMENT
RESCUE10	FED FIRE DEPARTMENT
MEDIC 11-12	FED FIRE DEPARTMENT
TANKER 13	FED FIRE DEPARTMENT
SQUAD 14	FED FIRE DEPARTMENT
MIKE 7	USAPAT-PFD (C-20)
RAIDER 1-3	735 AMS/MX
RAIDER OPS 1-2	735 AMS/MX
HIANG OPS	154 WG/OSS
MYTAI SOF	199 FS/SOF
MAKO	15 MXS
HICKAM SAFETY	15 WG/SE
MANO 1-3	15 AMXS
MANO 4-6	15 AMXS

SQUAD 16	FED FIRE DEPARTMENT
SUPPLY 1	FED FIRE DEPARTMENT
ROMEO	647 SFS
SECURITY	647 SFS
15 MDG	FLIGHT MED

Table A15.2. The 154 OSS/OSAA Authorized Vehicle Call Signs.

Call Sign	Assigned Agency
HIANG OPS	154 OSS/OSAA
MYTAI SOF	199 FS/SOF
HIANG WARRIOR 1-2	154 MXG LEADERSHIP
POLCAT	154 LRS/LGRF
AERO SUPER	154 MXS/MXMTC (C17-HSC)
AERO 1-3	154 MXS/MXMTC (C17-HSC)
GUARD MOBILE	154 MXS/MXMTC (C17-HSC)
QA SUPER/ QA 4-7	F-22 QA
QA 1-3	KC-135 QA
RAPTOR LEAD/SUPER	F-22 AMXS OIC/NCOIC
RAPTOR PRO/RAPTOR 2	F-22 PROD SUPER
RAPTOR 3-9	F-22 FLIGHT CHIEFS/SUPERS/EOR
ALERT SUPER/RAPTOR ALERT	F-22 ALERT NCOIC/ALERT MECHANICS
SHARK	F-22 WEAPONS EXPEDITOR
ARMAMENT 1-2	F-22 ARMAMENT SHOP
LOAD SUPER	F-22 WEAPONS LOAD SUPERVISOR
LOAD 1-11	F-22 LOAD CREWS
AVIONICS SUPER	F-22 AVIONICS NCOIC
AVIONICS 1-3	F-22 AVIONICS
CRF 1	F-22 COMPONENT FLT OIC
ENG SUPER/ENG 1	F-22 ENGINE NCOIC/ENGINE
SYSTEMS 1	F-22 ACCESSORIES SUPER

FUEL 1/FUEL 2	F-22 FUEL
EGRESS 1/EGRESS 2	F-22 EGRESS
EMF 1	F-22 EQUIP FLT NCOIC
AGE SUPER/AGE 1-4	F-22 AGE NCOIC/ F-22 AGE
STRUCTURAL 1/ STRUCTURAL 3	F-22 STRUCTURAL
METAL 1	F-22 METALS
AMMO SUPER	F-22 MUNITIONS ELEMENT SUPERVISOR
AMMO 2-13	F-22 MUNITIONS LINE DELIVERY/ BUILD UP
TANKER LEAD/SUPER	KC-135 AMXS OIC/ NCOIC
TANKER PRO	KC-135 PROD SUPER
TANKER 1-4	KC-135 CREW CHIEF
EXPEDITE	KC-135 EXPEDITOR
TANKER DOCK SUPER/LEAD	KC-135 INSP DOCK CHIEF/ LEAD
AV 1-3	KC-135 AVIONICS
JET SUPER/ JET 1-2	KC-135 ENG
SYSTEMS 2	KC-135 ACCESSORIES SUPER
FUEL SUPER / FUEL 3-4	KC-135 FUEL
HYD SUPER / HYD 3-4	KC-135 HYDRAULIC
ELEC SUPER / ELEC 3-4	KC-135 ELECTRIC
R&R SUPER / R&R 3	KC-135 R&R
EMF 2	EQUP FLT SUPERVISOR
AGE LEAD/ AGE 5-6	KC-135 AGE
NDI	F-22 / KC-135 NDI
FAB 2	KC-135 FABRICATION SUPER
STRUCTURAL SUPER / STRUCTURAL 2, 4	KC-135 STRUCTURAL
METALS 2-3	KC-135 METALS

Attachment 16 (Added)

HICKAM RAMP CONTROL BLIND SPOTS

Figure A16.1. Hickam Ramp Control Blind Spot.

