BY ORDER OF THE COMMANDER
INCIRLIK AB (USAFE)

DEPARTMENT OF THE AIR FORCE
INSTRUCTION

13-213

INCIRLIK AIR BASE
Supplement

15 NOVEMBER 2022

NUCLEAR, SPACE, MISSILE,
COMMAND, AND CONTROL

AIRFIELD DRIVING

COMPLIANCE WITH THIS PUBLICATION IS MANDATORY

ACCESSIBILITY: Publications and forms are available on the e-Publishing web site at **www.e-publishing.af.mil** for downloading or ordering.

RELEASABILITY: There are no releasability restrictions on this publication.

OPR: 39 OSS/OSAB

Certified by: 39 OSS/CC
(Lt Col Octavio Prieto)

Supersedes: INCIRLIKABI 13-213, 25 June 2018

Pages: 33

(INCIRLIK) This supplement implements Department of the Air Force Instruction (DAFI) 13-213 USAFE-AFAFRICASUP, Airfield Driving. This supplement applies to all United States military and civilian personnel who must conduct ground vehicular operations on the airfield at Incirlik Air Base (AB), Turkey. At Incirlik AB, the office of primary responsibility (OPR) for airfield driving is 39th Operations Support Squadron, Airfield Management (39 OSS/OSAB). This supplement outlines Incirlik AB-specific responsibilities for airfield drivers and airfield driving program management at all levels. Refer recommended changes and questions about this publication to the OPR using Air Force (AF) Form 847, Recommendation for Change of Publication; route AF Forms 847 from the field through the appropriate chain of command. This instruction requires the collection and maintenance of information protected by the Privacy Act of 1974, authorized by 10 U.S.C. 8013, Secretary of the AF. Ensure that all records created as a result of processes prescribed in this publication are maintained in accordance with (IAW) Air Force Instruction (AFI) 33-322, Records Management and Information Governance, and disposed of IAW Air Force Records Information Management System (AFRIMS) Records Disposition Schedule (RDS).

SUMMARY OF CHANGES

(INCIRLIK) This document is substantially revised and should be reviewed in its entirety. It has been updated to comply with the current versions of DAFI 13-213 and DAFI 13-213,

USAFE-AFAFRICASUP, Airfield Driving. Major changes include updating airfield driving procedures, program management procedures, and airfield driving training standards and procedures.

2.3. **(INCIRLIK) 39th Air Base Wing Commander (39 ABW/CC).**

2.4. **(INCIRLIK) 39th Weapons System Security Group Commander (39 WSSG/CC).**

2.7.1. **(INCIRLIK) The 39 ABW/CC delegates appointing the Wing ADPM to the Airfield Operations Flight Commander.**

2.7.16. **(INCIRLIK)** Mission Oriented Protective Posture (MOPP) gear is not authorized while operating a vehicle on the airfield. If a future requirement is identified, the Airfield Driving Training Program will incorporate the requirements.

2.8.3.1. **(INCIRLIK)** Airfield driver training and AF Form 483 issuance will be conducted using the web-based ADTP website; **https://webapps.amc.af.mil/ADTP/Pages/System/Login.aspx?ReturnUrl=%2fADTP%2fPages%2fTrainee%2fHome.aspx**.

2.8.3.2. **(INCIRLIK)** Notify the Wing ADPM or 39 OSS/OSAB of ADTP issues.

2.8.6.1. **(INCIRLIK)** The Unit ADPM will identify which level of access will be granted to vehicle operators. The "access levels" are listed below:

2.8.6.1.1. **(INCIRLIK)** Controlled Movement Area (CMA) access will be annotated with "A" access. "A" access includes the runway, all taxiways, parking ramps and loops.

2.8.6.1.2. **(INCIRLIK)** Personnel who have not been trained for, or do not need access to the airfield at night will be granted DAYTIME ONLY access. DAYTIME ONLY access will be annotated with "B" restriction on the AF Form 483. Personnel with "B" are not authorized access to the CMA. "B" access only includes taxiways Sierra and November, parking ramps and loops during daylight hours only.

2.8.6.1.3. **(INCIRLIK)** Loop only access will be annotated with "C" access. "C" access only includes GOLF, HOTEL and INDIA loops. Personnel with "C" access MAY NOT operate a vehicle in the CMA, taxiways, or parking ramps.

2.8.6.1.4. **(INCIRLIK)** Personnel not requiring access to the CMA will be annotated with "D" access. "D" access only includes taxiways Sierra and November, parking ramps, and loops. Personnel with "D" access MAY NOT operate a vehicle in the CMA.

2.8.12.1. **(INCIRLIK)** Review ADTP quarterly to review status of training and verify personnel listed in the program still have a requirement to drive on the airfield. Ensure processing in/out with the Unit ADPM is added to the unit's or virtual Military Personnel Flight in/out processing checklist.

2.8.14.1. **(INCIRLIK)** Contact 39th Medical Group (39 MDG) to schedule a color vision test. Maintain copy of results until member PCSs. Trainees who fail the color vision test are restricted to daylight driving only.

2.8.15.2. **(INCIRLIK)** Annual refresher training for airfield driving will be documented on reverse side of AF Form 483 automatically via the ADTP website. It is the Unit ADPM's responsibility to ensure all training is complete and signed on the reverse of the AF Form 483.

2.8.25.1. **(INCIRLIK)** Current training references and study materials are available for review and/or download on the ADTP website as well as on the 39 ABW Airfield Driving SharePoint Site.

2.9.4. **(INCIRLIK)** Trainers and certifiers will ensure all training requirements have been completed IAW DAFI 13-213 and this supplement, and annotated accordingly on the ADTP website. The certifier and trainer will verify, validate, and annotate completion of each respective task on the ADTP website as the trainee progresses in training.

2.10.2.1. **(INCIRLIK)** Trainers and certifiers will ensure all training requirements have been completed IAW DAFI 13-213 and this supplement, and annotated accordingly on the ADTP website. The certifier and trainer will verify, validate, and annotate completion of each respective task on the ADTP website as the trainee progresses in training.

2.10.7.1. **(INCIRLIK)** Will not operate on the airfield for the purposes of convenience. Use of perimeter roads and access roads must be used to the maximum extent. Will not cross the runway to gain access to the opposite side of the airfield unless mission specifically dictates or driver is operating a special purpose vehicle that cannot leave the airfield environment.

2.10.9. **(INCIRLIK)** Comply with Foreign Object Debris (FOD) checkpoints (e.g. check tires, secure loose items, properly dispose of FOD, etc.). Must be attentive to FOD hazards at all times while on the airfield. When possible, pick up FOD or notify Airfield Management, who shall respond to the location and/or request sweeper support. All dropped FOD objects (e.g. aircraft parts, tools, nuts, bolts, etc.) shall be turned in to Airfield Management.

2.11. **(INCIRLIK) 39 OSS Airfield Management (39 OSS/OSAB).**

2.12. **(INCIRLIK) 39 OSS Air Traffic Control Tower (39 OSS/OSAT).**

2.13. **(INCIRLIK) 39 ABW Safety (39 ABW/SE).**

2.14. **(INCIRLIK) 39th Security Forces Squadron (SFS).**

2.14.1.1. **(INCIRLIK)** Ensure vehicles driving on the airfield are operated by certified airfield drivers and display a current and valid airfield pass as designed by 39th Operations Support Squadron (39 OSS).

2.14.8.1. **(INCIRLIK)** 39th Security Forces Squadron (39 SFS) personnel responding to in-flight/ground emergencies will not enter or cross the CMA unless specifically requested by the on-scene commander. If called onto the CMA, permission must still be requested from the Air Traffic Control Tower before proceeding onto the runway.

2.15. **(INCIRLIK) 39th Medical Group (39 MDG).**

2.15.2.1. **(INCIRLIK)** 39 MDG personnel responding to in-flight/ground emergencies will not enter or cross the CMA unless specifically requested by the on-scene commander. If called onto

the CMA, permission must still be requested from the Air Traffic Control Tower before proceeding onto the runway.

2.16. **(INCIRLIK) 39th Civil Engineer Squadron (39 CES).**

2.16.1.1. **(INCIRLIK)** Ensure contractor requests for privately owned vehicle/government owned vehicle (POV/GOV) passes are given to Wing ADPM no later than 2 weeks prior to the start of any construction.

2.16.1.2. **(INCIRLIK)** Ensure contractors are on an Entry Authorization Letter for access into restricted and controlled areas of the airfield.

3.1.1. **(INCIRLIK)** Training references and publications are available on the ADTP, as well as the 39 ABW Airfield Driving Program SharePoint website.

3.2.1.1. **(INCIRLIK) Attachment 7** is not required if training is conducted electronically via ADTP/ADTCS. For personnel who do not have access to a government computer, the Unit ADPM will utilize DAFI 13-213 USAFE-AFAFRICASUP, Attachment 7 to document training and certification on all newly assigned or employed/hired personnel; file in TAB D of ADTP binder or 39 ABW Airfield Driving Program SharePoint website.

3.2.2.1. **(INCIRLIK)** Training shall include a review of this supplement, DAFI 13-213 USAFE-AFAFRICASUP, and a 25-question multiple choice exam in the ADTP.

3.3.1.6. **(INCIRLIK)** Upon completion of all training requirements, the Unit ADPM or Unit Trainer will unlock the unit test (step 3) in ADTP. Once the unit test is complete, the Unit ADPM or Unit Trainer must contact Airfield Management to unlock the Wing Test in ADTP (step 4/final exam) via email at **39os.osab@us.af.mil**. Once the member has passed the Wing Test an email must be sent to Airfield Management to verify the members information and pass the member through step 4. Afterwards, the member or Unit ADPM can print their license.

4.2.1.1. **(INCIRLIK)** The CMA includes Runway 05/23, the overruns, Victor Loop, and all paved and unpaved areas within 560 feet of the edge of the runway, and within 1000 ft. from the runway ends. Exception: On Taxiways Alpha North and Echo North, and around the runway ends, the CMA begins laterally 260 ft. from the runway edge. It is designated by nonstandard white CMA markings on the interior taxiways as depicted in **Attachment 15** and **Attachment 3**, **Figure A3.8**). The northeast, southeast, northwest, and southwest, barrier shacks are collocated with the VFR hold line, and can be used as a reference when operating infield. When instrument conditions are in effect, the CMA expands from Taxiway Alpha South onto Taxiway Sierra only, with yellow and black instrument hold lines identifying the holding position for aircraft, vehicles, and pedestrians.

4.2.3.1. **(INCIRLIK)** Vehicle drivers will utilize and monitor the RAMP NET for communication with the ATCT. While Taxiways November (North Parallel) and Sierra (South Parallel) are not within the CMA, airfield drivers are required to monitor the RAMP NET for ATCT notifications regarding aircraft movement.

4.2.5.1. **(INCIRLIK)** Aerodrome/Airfield Saturation. Keep in mind that other parties might be on the Ramp Net or ATCT may be busy with air traffic issues. The U.S. ATCT controllers work very closely with the TurAF controllers and must coordinate for every crossing on the runway. Therefore, know what you are going to say before you call ATCT, limit the number of times you cross the runway, and have patience when communicating over the RAMP NET.

4.3.2.3. **(INCIRLIK)** Vehicle and/or pedestrian call signs are provided in **Attachment 14** of this publication.

4.3.2.3. **(INCIRLIK)** If radio problems occur, exit the CMA immediately and report the radio problem to radio maintenance. DO NOT ENTER OR CROSS ANY RUNWAY OR TAXIWAY IF RADIO FAILURE IS SUSPECTED.

4.5.1.1. **(INCIRLIK)** Mandatory sign (Attachment 3, Figure A3.1.).

4.5.2.1.1. **(INCIRLIK)** Taxiway Direction sign (Attachment 3, Figure A3.2.).

4.5.2.2.1. **(INCIRLIK)** Taxiway Location sign (Attachment 3, Figure A3.3.).

4.5.2.4.1. **(INCIRLIK)** Instrument Landing System (ILS) Critical Area Holding Position Sign (**Attachment 3**, **Figure A3.1**). The inscription "CAT I" is used for protection of the ILS critical area at Taxiway Alpha South and Taxiway Echo North. The ILS critical area sign corresponds with Instrument Holding Position Markings (**Attachment 3**, **Figure A3.7**). When the ILS is being used, it may be necessary to hold a vehicle or aircraft at designated taxiway locations to protect the critical areas. This prevents vehicles and aircraft on the ground from interfering with the ILS signal transmitted to an aircraft on final approach. Vehicle drivers will be instructed by ATCT to hold short of the "INST" holding position on Taxiway Alpha South and Taxiway Echo North when weather conditions fall below a ceiling of 800 feet and/or visibility is less than 2 miles.

4.5.2.5.1. **(INCIRLIK)** Runway Distance Remaining Marker (Attachment 3, Figure A3.4.).

4.5.2.5.2. **(INCIRLIK)** Arresting Gear Marker (Attachment 3, Figure A3.5.).

4.6.1.1. **(INCIRLIK)** Runway Markings (Attachment 3, Figures **A3.14** through **A3.18**).

4.6.2.1. **(INCIRLIK)** Taxiway and Apron Markings (Attachment 3, Figures **A3.9**, **A3.10**, **A3.13**).

4.6.3.1. **(INCIRLIK)** Visual Flight Rules Hold Position (Attachment 3, Figures A3.6.).

4.6.4.1. **(INCIRLIK)** Instrument Hold Position (Attachment 3, Figures A3.7.). See **paragraph 4.5.2.4.1**.

4.6.6. **(INCIRLIK)** Restricted Area Marking. Restricted areas are identified by a solid red line on the pavement surface as depicted in (**Attachment 3**, **Figure A3.11**). Entrance is limited to authorized personnel only and the AF Form 1199C or on Entry Authorization List must be properly marked, worn and visible. Restricted area entry/exit is made through the Entry Control Points (**Attachment 3**, **Figure A3.12**).

4.6.7. **(INCIRLIK)** A vehicle driving lane (**Attachment 3**, **Figure A3.20**) is established adjacent to Bravo and Charlie Ramp. Airfield drivers shall utilize the right lane as on a standard American road. White stop bars markings are established on either side of the Fire Department. All airfield drivers will stop and visually check for emergency response vehicle movement prior to proceeding.

4.6.8. **(INCIRLIK)** Non-Standard White Driving Lanes. Driving lanes on Taxiways Sierra and November are identified by continuous white lines on both sides of the taxiway changing to dashed lines at intersections. Driving lanes are painted 12 feet from the taxiway edge. These driving lanes DO NOT provide wingtip clearance from taxiing aircraft. Drivers must exit the taxiway/taxi track to give way to taxiing aircraft. This includes aircraft being towed. See (**Attachment 3**, **Figure A3.21**) for example of these lines.

4.6.9. **(INCIRLIK)** Aircraft Arresting System Markings (Attachment 3, Figures A3.19.).

4.7.1.1. **(INCIRLIK)** Runway Edge Lights (Attachment 3, Figures **A3.23**, **A3.24**).

4.7.2.1. **(INCIRLIK)** Taxiway Edge Lights (Attachment 3, Figure A3.22.).

4.7.5. **(INCIRLIK)** Obstruction/Construction Lights (Attachment 3, Figure **A3.25**, **A3.26**).

4.7.6. **(INCIRLIK)** Rotating Beacon (Attachment 3, Figure A3.27.).

4.7.7. **(INCIRLIK)** Approach Lights (**Attachment 3**, **Figure A3.28**).

4.7.8. **(INCIRLIK)** Ballpark Light (Attachment 3, Figure A3.29.).

4.7.9. **(INCIRLIK)** Vehicle Control/Runway Guard Lights (Attachment 3, Figure A3.30.).

Table 4.1. (INCIRLIK) Incirlik AB Airfield Driving Speed Limits.

Type	Speed Miles per Hour (MPH)	Speed Kilometers per Hour (KPH)
All Vehicles Within 25 feet of an Aircraft	5	10
Special Purpose Vehicles	10	15
General Purpose Vehicles	15	25
General Purpose Vehicles on Parallel Taxiways	25	40
Any Vehicle Within 200 feet of Parking Aprons	15	25
Emergency Responders, Responding to Emergency	35	60
Towing Aircraft	5	10
Any Vehicle Operating on the Runway	35	60
Traffic Lane Adjacent to Bravo and Charlie Ramps	15	25
Golf, Hotel, and India Loops	15	25

4.9.6. **(INCIRLIK)** Helicopters are considered taxiing when hovering 100 feet or less above the ground or when traversing down a taxiway. Airfield drivers are not allowed to drive under, between or around helicopters hovering 100 feet or less.

4.11. **(INCIRLIK) All vehicles operating in/or around the airfield are considered mobile obstacles.** Vehicles and equipment shall not be left within the minimum clearance areas listed below:

4.11.1.1. **(INCIRLIK)** Taxitrack lateral clearance (Golf, Hotel, India and Victor Loops) is 15m (49.2 feet) from taxitrack centerline.

4.11.2.1. **(INCIRLIK)** The lateral clearance from the parking pads/aprons within Golf, Hotel, India and Victor Loops is 15m (49.2 feet).

4.11.2.2. **(INCIRLIK)** The lateral clearance from Alpha, Bravo, Charlie, Delta, Echo and Foxtrot Ramps, Hardstand (HS) 7-16, 19, and 20 is 35m (115 feet).

4.11.3.1. **(INCIRLIK)** At Incirlik, the runway lateral clearance is 150m (492 feet) from runway centerline.

4.11.4.1. **(INCIRLIK)** Mobile ground support equipment will be placed on the airfield (taxiways, aprons, etc.) no sooner than 3 hours before an arrival and must be moved no later than 3 hours after a departure. When such equipment is not in use, it shall be removed and stored in areas that do not violate aircraft clearance requirements for normal operating routes (marked taxilanes/taxitracks or taxiways) or other imaginary surfaces.

4.17.2.1. **(INCIRLIK)** Bicycles are permitted only in the loop area. Bicycles and drivers require appropriate reflectors and lights.

4.19.1. **(INCIRLIK)** Every vehicle operator or pedestrian operating on the airfield is personally responsible to check for approaching aircraft, visually observe the ATCT, and recognize the location of all runways, taxiway, and aprons. There are no known communications or radio signal problem areas on the airfield. However, the following areas are identified as ATCT visual blind spots: Delta Ramp, Golf, Hotel, India and Victor Loops.

4.20.2.1. **(INCIRLIK)** Primary (initial) emergency response agencies include Fire Department, Airfield Management, and Transient Alert/Crash Recovery. Secondary (follow-on/support) agencies include Security Forces, 39 ABW/Safety, Maintenance, and Medical Group. Tertiary support agencies (e.g. transportation, maintenance, etc.), as determined by the Fire Chief or incident/on-scene commander, are those required to support on-going operations.

4.22. **(INCIRLIK) Blackout operations are currently not authorized at Incirlik AB, therefore the use of Night Vision Devices (NVD) for airfield driving during blackout conditions/operations are not authorized.**

4.23.3. Personnel escorting individuals onto the airfield areas are responsible for that person and must stay within 200 feet of the escorted individual. All escorted personnel must be visible at all times by the escort official, and the escort must have escort privileges. A vehicle driver may act as an escort for 2 or more vehicles on the CMA who are together on or within 250 feet of each other. The escort vehicle is responsible for the group and will relay ATCT control instructions/communication for the group.

4.23.4. **(INCIRLIK)** Requests for CMA access can be made by a single driver for a convoy of vehicles as long as the driver of the first vehicle requesting access onto/across the runway is a "CMA-Access" certified driver. The vehicle operator making the request will clearly state that the request is made for a specific number of vehicles and will report all vehicles off the runway after the last vehicle has passed the Hold Position Marking/VFR Hold-Short Line. An example request is as follows: "GROUND, AIRFIELD 1 PLUS 2 VEHICLES REQUEST PERMISSION TO CROSS RUNWAY 05 FROM ALPHA NORTH TO ALPHA SOUTH, WILL REPORT WHEN ALL VEHICLES ARE OFF THE RUNWAY".

4.28.2.1.3. **(INCIRLIK)** For temporary duty (TDY) personnel with a home station AF Form 483, use DAFI 13-213, USAFE-AFAFRICASUP Attachment 8 for non-CMA access in conjunction with Incirlik SUP Attachment 10 mass briefing checklist to document the local briefing. Use DAFI 13-213_USAFESUP Attachment 7 for CMA access in conjunction with Incirlik Sup **Attachment**

10 mass briefing checklist to document the local briefing. The Unit ADPM may provide a local briefing/training when temporarily assigned personnel, Inspection/Survey Teams and non-base assigned contractors driving route(s) do not require access on or across the CMA.

4.29.6.1. **(INCIRLIK)** Vehicle passes are issued and valid for no more than 12 months expiring 31 October of each year. Pass justification must be re-accomplished upon expiration and prior to re-issuance of annual passes. Vehicle pass colors will change annually upon reissuance. GOV and POV passes are distinguished with either POV or GOV written on the pass.

4.29.7.1. **(INCIRLIK)** Airfield passes shall be turned in to Airfield Management for accountability and/or destruction upon expiration or when no longer required.

4.29.10. **(INCIRLIK)** All passes are required to be legible, recognizable and visible when on the airfield. Contact the Wing ADPM to replace lost or faded passes.

4.29.11. **(INCIRLIK)** Loss or theft of vehicle passes must be reported to the Wing ADPM immediately.

4.31.3. **(INCIRLIK)** If the suspension is for 30 calendar days or fewer, the AF Form 483 will be returned upon proof of reinstatement of driving privileges. Suspensions of more than 30 calendar days will require refresher training prior to return of the AF Form 483.

Table 5.4. (INCIRLIK) Incirlik Specific CMA Access Phraseology.

	Say your full request in the first initial call……
VEHICLE OPERATOR: (Initial call)	*GROUND, OPS 1, REQUEST INTO THE TAXIWAY ECHO NORTH CMA."*
ATC: (Ground's response)	*"OPS 1, GROUND, PROCEED INTO THE TAXIWAY ECHO NORTH CMA, REMAIN OFF RUNWAY AT ALL TIMES, REPORT WHEN OUT."* *Or "OPS 1, GROUND, HOLD SHORT OF THE TAXIWAY ECHO NORTH CMA."*
VEHICLE OPERATOR: (Read back)	*"GROUND, OPS 1, UNDERSTANDS APPROVED INTO THE TAXIWAY ECHO NORTH CMA, WILL REMAIN OFF THE RUNWAY AND WILL REPORT WHEN OUT.* *or* *GROUND, OPS 1 WILL HOLD SHORT OF THE TAXIWAY ECHO NORTH CMA.*

CALVIN B. POWELL, Colonel, USAF
Commander

Attachment 1

GLOSSARY OF REFERENCES AND SUPPORTING INFORMATION

References

(INCIRLIK) 39 ABW BASH PLAN 91-212

(INCIRLIK) AFMAN 32-1040, Civil Engineer Airfield Infrastructure Systems

(INCIRLIK) T.O. 00-33A-1001, General Communications Activities Management Procedures and Practice Requirements

Prescribed Forms

None

Adopted Forms

AF Form 847, Recommendation for Change of Publication

DD Form 2861, Cross-Reference

AF Form 1199C, USAF Restricted Area Badge (Yellow) (Accountable)

AFVA 11-240, USAF Airport Signs and Markings

AFVA 13-222, Runway/Controlled Movement Area (CMA) Procedures

Abbreviations and Acronyms

39 ABW—39th Air Base Wing Commander

39 ABW/CC—39th Air Base Wing Commander

39 ABW/SE—39th Air Base Wing Safety

39 CES—39th Civil Engineer Squadron

39 CES/CC—39th Civil Engineer Squadron Commander

39 MDG—39th Medical Group

39 OSS—39th Operations Support Squadron

39 OSS/OSAB—39th Operations Support Squadron, Airfield Operations Flight

39 SFS—39th Security Forces Squadron

39 WSSG/CC—39th Weapons System Security Group Commander

39 WSSG/CCA—39th Weapons System Security Group Commander's Assistant

39 WSSG/CCE—39th Weapons System Security Group Commander's Executive Assistant

86 SFS—86th Security Forces Squadron

AB—Air Base

ADTP—Airfield Drivers' Training Program

AFFSA—Air Force Flight Standards Agency

AFMAN—Air Force Manual

AFRIMS—Air Force Records Information Management System

AMC—Air Mobility Command

AMOPS—Airfield Management Operations

AOF—Air Field Operations Flight Commander

BASH—Bird/Wildlife Aircraft Strike Hazard

DEROS—Date Eligible to Return from Overseas

DSN—Defense Switched Network

EAL—Entry Authorization List

ETL—Engineering Technical Letter

FOD—Foreign Object Debris

GLV—Government Leased Vehicle

GMV—Government Motor Vehicle

GOV—Government Owned Vehicle

HS—Hardstand

IAW—In Accordance with

KPH—Kilometers Per Hour

M—Meters

MFR—Memorandum for Record

MPH—Miles Per Hours

MX—Maintenance

NLT—No Later Than

PCS—Permanent Change of Station

QA—Quality Assurance

RDS—Records Disposition Schedule

SAV—Staff Assistance Visit

SFS—Security Forces Squadron

TDY—Temporary Duty

TurAF—Turkish Air Force

UADPM—Unit Airfield Driving Program Manager

UFC—Unified Facilities Criteria

USAF—United States Air Force

VMPF—Virtual Military Personnel Flight

Terms

Airfield Restriction "A"—Airfield driver is certified to operate a vehicle inside the CMA, this includes the runway, all taxiways, parking ramps and loops.

Airfield Restriction "B"—Airfield driver has not been trained for or need access to the airfield at night; granted DAYTIME ONLY access.

Airfield Restriction "C"—Airfield driver is certified to operate a vehicle inside Golf, Hotel and India Loops only. Access in not authorized inside the CMA, runway, taxiways, or parking ramps.

Airfield Restriction "D"—Airfield driver is certified to operate a vehicle on all taxiways, parking ramps, and loops. Access in not authorized inside the CMA or on the runway.

Hardstand (HS)—Areas where aircraft are parked, loaded and unloaded and serviced between flights.

Loops (Golf, Hotel, India)—Area on the airfield located north of Taxiway November. Includes aircraft parking surfaces, taxi-tracks for taxiing aircraft from parking to Taxiway November, and numerous airfield facilities.

Major Violation—Airfield driving infractions that results from disobeying ATCT instructions and posted CMA markings. Major Infractions include runway incursions, CMAVs and incidents involving aircraft.

Minor Violation—Airfield driving infractions that results from disobeying standards outlined in AFI or through training. Minor Infractions include but are not limited to, speeding, reckless driving, misuse/abuse of the vehicle, display of poor judgment or behavior or failure to complete training/annual refresher training.

Non Standard CMA Marking—Marking that defined the outer limits of the CMA. Depicted by a white bar with red "STOP" lettering spaced across. This marking is positioned to prevent airfield drivers from entering the CMA. Airfield drivers must contact ATCT for permission to cross this marking.

(INCIRLIK) KBR—Civilian contractors, located on base, which accomplishes airfield projects.

Attachment 3 (INCIRLIK)

AIRFIELD SIGNS, MARKINGS AND LIGHTING

A3.1. Signs. The following sign, markings and lightings are commonly applicable to the Incirlik airfield. Standards are IAW UFC 3-535-01, *Visual Air Navigation Facilities* and ETL 04-2, *Standard Airfield Pavement Marking Schemes.*

A3.1.1. Mandatory Signs. Coloring is Red background with White lettering.

Figure A3.1. Mandatory Airfield Signs





A3.1.2. Information Signs. Coloring can be Yellow background with Black lettering.

Figure A3.2. Information Sign.



A3.1.3. Location Signs. Coloring is Black background with Yellow lettering and border.

Figure A3.3. Information Sign.



A3.1.4. Runway Distance Markers. Coloring is Black background with White lettering. Internally lit for nighttime operations.

Figure A3.4. Runway Distance Marker.



A3.1.5. Arresting Gear Markers. Coloring is Black background with Yellow circle. Internally lit for nighttime operations.

Figure A3.5. Arresting Gear Marker.



A3.2. Markings. Airfield Markings are used to guide pilots to and from the runway, assist with situational awareness, provide the only continuous visual aid and promote safety. Taxiways and Aprons will be marked with retro-reflective yellow painted markings. Runways will be marked with retro-reflective white painted markings.

A3.2.1. VFR Hold Line Marking. This marking is defined by its double dashed and double solid design and is typically located 100 feet to 250 feet from the near edge of the runway.

Figure A3.6. VFR Hold Line Marking.



A3.2.2. Instrument/ILS Hold Line Marking. This marking is defined by a distinct “ladder” design, with the letters “INST” positioned on the side closest to the runway. This marking is positioned to prevent airfield drivers from entering the Glide Slope Critical Area and interfering with an activated ILS.

Figure A3.7. Instrument/ILS Hold Line Marking.



A3.2.3. Non Standard CMA Marking. This marking is defined by a white bar with red “STOP” lettering spaced across. This marking is positioned to prevent airfield drivers from entering the CMA. Airfield drivers must contact ATCT for permission to cross this marking.

Figure A3.8. Non Standard CMA Marking.



A3.2.4. Taxiway Edge Stripes. Yellow in color, these markings denote where the useable taxiway pavement ends and the shoulders begin.

Figure A3.9. Taxiway Edge Stripes.



A3.2.5. Taxiway Centerline. The centerline marking is placed equal distance from the Taxiway Edge Stripes, down the center of the taxiway, for the entire length of the taxiway. At Incirlik AB, drivers must always drive on the right side of the taxiway centerline.

Figure A3.10. Taxiway Centerline.



A3.2.6. Restricted Area Marking. This marking is red in color and is designed to protect a restricted area of the airfield. Personnel must have an authorized restricted area badges (AF Form 1199C) in their position prior to entering a restricted area through a defined entry control point.

Figure A3.11. Restricted Area Marking.



A3.2.7. Entry Control Point Markings. This marking defines an entry control point into a restricted area on an airfield. Personnel must have an authorized restricted area badges (AF Form 1199C) in their position prior to entering a restricted area.

Figure A3.12. Entry Control Point Markings.



A3.2.8. Apron Boundary Markings. Apron boundary markings denote where the apron edge lies and where the shoulder begins. They are often collocated with Restricted Area “red lines”.

Figure A3.13. Apron Boundary Markings.



A3.2.9. Runway Threshold Markings. Threshold markings are placed on both ends of the runway. At Incirlik, they consist of 2 sets of 6, 100 feet long white hash marks placed where the useable portion of the runway meets the overrun. A total of 12 hash marks indicates Incirlik’s runway is 150 feet wide.

Figure A3.14. Runway Threshold Markings.



A3.2.10. Runway Centerline Markings. Runway centerline markings are 100 feet long, white lines placed at 60 feet intervals for the entire length of the runway.

Figure A3.15. Runway Centerline Markings



Figure A3.16. Runway Centerline Markings.



A3.2.11. Runway Edge Stripes. Runway edge stripes are white markings placed along both edges of the runway for the entire length of the runway. They indicate where the runway surface ends and the shoulder begins.

Figure A3.17. Runway Edge Stripes.



A3.2.12. Runway Designator Markings. These markings denote the designation of the runway. At Incirlik, the runway is marked 05 on 1 end and 23 on the other. Designator markings are white block numbers placed between the threshold markings and the first centerline marking from each end of the runway. Below is an example of the Runway 05 designator:

Figure A3.18. Runway Designator Markings.



A3.2.13. Aircraft Arresting System Markings. These markings are 10 feet diameter discs, placed from edge stripe to edge stripe, co-located with the aircraft arresting system. Incirlik has 2 sets; 1 on the west and 1 on the east barrier cable.

Figure A3.19. Aircraft Arresting System Markings.



A3.2.14. Driving Lane Markings. Driving lanes are marked with retro-reflective white paint and are designed to appear as a typical roadway. This type of driving lane is found along B and C Ramps.

Figure A3.20. Driving Lane Markings.



A3.2.15. Driving Lanes. Non-standard driving lane markings are marked with continuous white lines changing to dashed white lines at intersections. They are 12 feet from the edge on both sides of the taxiway or taxi track. They are located in GOLF, HOTEL, and INDIA loops and on Taxiways N and S. These driving lanes DO NOT provide wingtip clearance from taxiing aircraft. Drivers must exit the taxiway/taxi track to give way to taxiing aircraft. This includes aircraft being towed.

Figure A3.21. Driving Lanes.



A3.3. Lighting.

A3.3.1. Taxiway edge lights. These lights define the lateral limits and direction of a taxiing route (Taxiway).

Figure A3.22. Taxiway Edge Lights.



A3.3.2. Runway edge lights. These lights define the lateral and longitudinal limits of the runway surface. These lights provide visual guidance during takeoff and landing operations at night and under low visibility conditions.

Figure A3.23. Runway Edge Lights.



A3.3.3. Runway edge light with split yellow/amber. These lights are identical to runway edge lights, except that the light is half white and half yellow/amber. This light is designed as a visual, cautionary tool to inform aircrews that only 2000 feet of the instrument runway remains. The yellow/amber portion of the light will be facing the approach end of the runway, with the white light facing the departure end of the runway.

Figure A3.24. Runway Edge Light With Split Yellow/Amber.



A3.3.4. Obstruction lights. These red lights are used to define the vertical and horizontal limits of natural or manmade objects which are considered a hazard to air navigation. White lights may also be used on structures less than 200 feet tall with MAJCOM approval; however, these lights shall not be located in clear zones or near the immediate vicinity of the runway(s).

Figure A3.25. Obstruction lights.




A3.3.5. Construction lights. These lights are placed on construction barricades to provide visual aid of the construction area. These lights will be yellow/amber or red in color and will flash at a rate of 55 to 160 flashes per minute.

Figure A3.26. Construction lights.



A3.3.6. Rotating beacon. This lighting system rotates 360 degrees and consists of a single-peaked green light and a double-peaked white light. The purpose of this lighting system is to help pilots identify the airfield. For example, a double-peaked white light represents a military airfield, where a single-peaked white light represents a civil airfield.

Figure A3.27. Rotating Beacon.

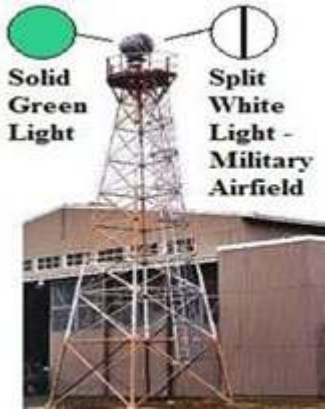

A3.3.7. Approach lights. This complex, multi-colored lighting system provides visual guidance during landing operations at night and under low visibility conditions.

Figure A3.28. Approach Lights.



A3.3.8. Ballpark light. These white lights are used to illuminate large areas, such as a parking apron.

Figure A3.29. Ballpark Light.



A3.3.9. Runway Guard Lights. Also called “wig-wag” lights provide a positive warning to anyone approaching the VFR/INST Hold line that they are about to enter an active runway. You must stop at this line when lights are flashing and request permission to cross/enter the active runway.

Figure A3.30. Runway Guard Lights.



Attachment 10 (INCIRLIK)

AIRFIELD DRIVING TRAINING ROSTER – MASS BRIEFING

Table A10.1. TDY Airfield Driving Training Roster–Mass Briefing

TDY AIRFIELD DRIVING TRAINING ROSTER MASS BRIEFING		
PERSONNEL INFORMATION		
List names of personnel taking part in Incirlik Airfield Training orientation. Any individual not listed shall be prohibited from driving on the Airfield during the duration of the TDY/exercise. This document can be used in conjunction with training requirements outlined in Attachment 7 of DAFI 13-213 USAFE-AFAFRICA SUP for CMA access. This document can also be used in conjunction with training requirements outlined in Attachment 8 of DAFI 13-213 USAFE-AFAFRICA SUP for Non-CMA access.		
Rank, Last Name, First	**CMA/NON CMA**	**Effective Dates of TDY Home Station 483 #**
HOST UNIT CERTIFICATION (Completed by Host Unit upon arrival) **HOST UNIT SUPERVISOR**		
I have received a comprehensive list of all TDY personnel requesting local Airfield Driving Privileges. TDY personnel shall not be authorized driving privileges until local Airfield orientation training has been completed. TDY personnel will not be granted access to the CMA unless they have completed all training and testing requirements outlined in DAFI 13-213 USAFE-AFAFRICASUP and IABI 13-213. TDY personnel shall comply with the Incirlik Airfield Driving Instruction (ADI) and non CMA personnel are fully aware that no vehicle or pedestrian shall enter a runway or other controlled movement areas. Personnel with CMA access understand that no vehicle or pedestrian shall enter the runway or other controlled movement areas without approval from the Air Traffic Control Tower (ATCT). Briefing completion date: _____		
Name (Last, First, MI)	Rank/Grade:	Signature: Date:
WING ADPM or designated representative (*as required*)		
Name (Last, First, MI):	Rank/Grade:	Signature: Date:

Attachment 11 (INCIRLIK)

PRIVATELY OWNED VEHICLE (POV) AND GOVERNMENT LEASED VEHICLE PASS REQUEST FORM

Figure A11.1. Privately Owned Vehicle (POV) Pass Request Form.

DATE

MEMORANDUM FOR 39 OSS/OSAB

FROM: SQUADRON/CC

SUBJECT: Airfield Vehicle Pass Request for (COMPANY NAME) – GOV/GLV/POV

1. The following vehicles (GOV/GLV/POV), requires an airfield vehicle pass in order to access Incirlik Airfield to (Justification). All personnel driving the following GOV, GLV or POV are driver qualified and possess an airfield driver's license IAW DAFI 13-213 USAFE-AFAFRICASUP and the Incirlik Airfield Driving Instruction.

License Plate #	Make	Model	Year	Color	GOV, GLV or POV	CMA or Non-CMA	Airfield Location

2. Airfield Vehicle passes will expire (Effective Period Dates).

3. If you have any questions or concerns regarding this request, please feel free to contact (Owner/User) at DSN 676-XXXX.

Unit CC/or Contractor Representative Name
Duty Title

1st Ind, 39 OSS/OSAB, Airfield Vehicle Pass Request – (GOV/GLV/POV)

MEMORANDUM FOR 39 OSS/OSAB

Approved/Disapproved.

Name, Rank, USAF
Wing Airfield Driving Program Manager

Attachment 12 (INCIRLIK)

SUSPENSION/REVOCATION OF AIRFIELD DRIVING PRIVILEGES – SAMPLE MEMORANDUM FOR RECORD

Figure A12.1. Suspension/Revocation of Airfield Driving Privileges.

DATE

MEMORANDUM FOR 39 XXX/CC

FROM: 39 OSS/OSAB

SUBJECT: Suspension of Airfield Driving Privileges

1. IAW DAFI 13-213 USAFE-AFAFRICASUP paragraph 4.30.2., suspension/revocation of airfield driving privileges occur when qualified airfield vehicle operator exhibits gross or repeated violation of airfield safety or rules, or an overall demonstrated lack of ability on the part of the vehicle operator.

2. The listed vehicle operator has failed to adhere to airfield driving standards. As such, airfield driving privileges have been suspended.

Name/Rank:
Job Title:
Base Assigned or TDY:
Organization/Office Symbol:
483 Certification Number:
Duty Phone: 676-
Unit Airfield Driving Program Manager (Unit ADPM):
Date/Time/Location:
Infraction:

3. Member shall complete airfield driving re-training with Unit ADPM. Unit Commander's written recommendation is required prior to requesting the Wing ADPM reinstate airfield driving privileges.

4. If there are any questions or concerns, please feel free to contact (Rank/Name) at 676-XXXX.

Name, Rank, USAF
Wing Airfield Driving Program Manager

Attachment 13 (INCIRLIK)

RECOMMENDATION FOR REINSTATEMENT OF AIRFIELD DRIVING PRIVILEGES

Figure A13.1. Sample Memorandum for Record.

DATE

MEMORANDUM FOR 39 OSS/OSAB

FROM: (Unit CC/Office Symbol)

SUBJECT: Recommendation for Reinstatement of Airfield Driving Privileges

1. IAW DAFI 13-213 USAFE-AFAFRICASUP 4.31.1., has completed airfield driving re-training and has met the requirements outlined in Chapter 3 to request reinstatement of airfield driving privileges.

2. Member has satisfied my requirements for re-training and has received my approval to seek reinstatement of airfield driving privileges.

3. If you have any questions or concerns regarding this request, please feel free to contact Rank/Name at 676-XXXX.

Name, Rank, USAF
Commander

1st Ind

MEMORANDUM FOR XXX/CC

FROM: 39 OSS/OSAB

SUBJECT: Reinstatement of Airfield Driving Privileges

1. Request for reinstatement of airfield driving privileges is/is not approved.

Name, Rank, USAF
Wing Airfield Driving Program Manager

Attachment 14

APPROVED CALL SIGNS

Table A14.1. LIST OF APPROVED CALL SIGNS.

UNIT	CALL SIGN	JUSTIFICATION
Any Unit	AIRFIELD TRAINER 1	Used for conducting airfield driver's training
39 ABW	Titan 1-4	39 ABW/CC, 39 ABW/CV, 39 MSG/CC, 39 MSG/CV
39 ABW	Safety 1-2	To perform our official duties to include inspecting the airfield, runway and taxiways as well as managing the BASH program
39 CES	Hammer 1	Fire Dept emergency response vehicle
39 CES	Chief 1 - 2	Fire Dept emergency response vehicle
39 CES	Rescue 1-3	Fire Dept emergency response vehicle
39 CES	Crash 4 - 9	Fire Dept emergency response vehicle
39 CES	Engine 12-13	Fire Dept emergency response vehicle
39 CES	Ladder14	Fire Dept emergency response vehicle
39 CES	Tanker 25	Fire Dept emergency response vehicle
39 CES	LP 1	Fire Dept emergency response vehicle
39 CES	Tech 16	Fire Dept emergency response vehicle
39 CES	EOD 1-4	
39 CES/Vectrus	Airfield Lighting Mx 1-3	Required to perform airfield lighting inspections, maintenance, repairs and respond to lighting emergencies; IAW AFI 32-1044/UFC 3-535-01
39 CES/Vectrus	Hazmat	Required by FGS-T C6.3.3.7.2 to summon emergency assistance.
39 CES/Vectrus	Airfield Sweeper or Sweeper 1	24 Hour 7 day a week Sweeper Operations.
39 CES/Vectrus	Barrier 1 -4	Required to perform aircraft arresting system inspections, maintenance, repairs and respond to system emergencies/engagements; IAW AFI 32-1043 USAFE Sup 1/UFC 3-260-18F.
39 CES/Vectrus	ENTOMOLOGY	Required to perform bird control (IAW Incirlik AB instruction 91-212 BASH), stray animal and weed control.
39 CES/Vectrus	CE 9/ALPHA	Required to perform rapid/routine repairs to runway pavements.
39 CES/Vectrus	BARRIER MX 1-2	Required to perform aircraft arresting system inspections, maintenance, repairs and respond to system emergencies/engagements; IAW AFI 32-1043 USAFE Sup 1/UFC 3-260-18F.
39 CES/Vectrus	Survey 1	Required to perform surveys for airfield construction projects

39 CS	Comm 1	Communication support needed out near the flight line. If there is any troubleshooting, or any type of project requiring communications we shall need ch. 5 for inspection purposes access. Per T.O. 00-33A-1001
39 LRS	POL 1 -2	Required to respond to any emergencies pertinent to fuels operations i.e. fuel spills and mechanical problems since they are the flightline supervisors who coordinate ongoing flightline Ops and have the appropriate tools and absorbent material assigned to each vehicle to handle such situations quickly and safely
39 LRS	POL 00, 10, 11, 13, 15, 16, 29, 32, 44-48, 53, 66, 81, 82, 88, 89, 95, 96, 97, 98, 104, 105	Required in order to meet an established 30 minute response time. Refuelers, including 6000 gallon Jet Fuel(JP-8, AVGAS) R-11's and smaller 1200 gallon ground fuel(Mogas/Diesel) C-300/C303's, cannot be dispatched prior to fuel requests from MOCC being called in and with no parking area on the north side for these special-purpose vehicles, driving all the way around perimeter road will break most response times, especially with incoming and outgoing traffic from the entrance gates to the flightline on the northside
39 MDG	Medic 1-3	Required for emergency response and IFEs
39 MDOS	BIO 1	Required for emergency response and IFEs
39 MXS	Bison 1 - 2	SQ Commander/MX Ops officer respond to maintenance mishaps/emergencies.
39 MXS	Bison Chief	Maintenance Superintendent required to respond to maintenance mishaps/emergencies.
39 MXS	Bison Super	Maintenance Production Superintendent required respond to maintenance mishaps/emergencies.
39 MXS	TA Super	Transient Alert NCOIC required to respond to launch/recovery emergencies.
39 MXS	TA 1/2	Transient Alert Follow me trucks provide aircraft launch/recovery.
39 MXS	Recovery 1-3	Transient Alert required for Crash Damage or Disabled Aircraft Recovery (CDDAR).
39 MXS	Raven 1 - 25	Required to perform emergency Nuclear Munitions Transportation.
39 MXS	Osprey 1 - 4	Required for Nuclear Surety operations (NARS).

39 MXS	Shadow	Required to cross CMA in the event of an emergency evacuation from North side of base. Must quickly stand up alternate control. Not permitted to leave through the evacuation point.
39 MXS	Shadow Super	Required to cross CMA in the event of an emergency evacuation from North side of base. Must quickly stand up alternate control. Not permitted to leave through the evacuation point.
39 MXS	Falcon Super	Ammo NCOIC Required to respond to emergency munition deliveries on the flight line.
39 MXS	Falcon 1-25	Required to respond to emergency munition deliveries on the flight line.
39 MXS	AGE Chief	AGE Production Flight Chief required to respond to Age mishaps and emergencies.
39 MXS	AGE Super	AGE Production Superintendent required to respond to Age mishaps and emergencies.
39 MXS	AGE Base	AGE Line Drivers required to deliver age equipment to Aircraft within 15min response time.
39 MXS	Owl 1	Emergency Operations Center Representative required to respond to aircraft mishaps.
39 MXS	AGE 1 - 2	TDY Age Line Drivers required to deliver age equipment to Aircraft within 15min response time.
39 MXS	QA 1 - 7	Respond to FOD/DOP emergencies and perform 39MXS/TDY Airfield driving training.
39 OSS	Hydra 1-2	39 OSS/CC and DO
39 OSS	Ops 1-2	Required to conduct airfield inspections/checks and respond to emergencies; IAW AFI 13-204v3, give tours to other group leadership
39 OSS	Airfield 1-5	Required to conduct airfield inspections/checks and respond to emergencies; IAW AFI 13-204v3
39 OSS	ATCALS 1-10	Required to repair/maintain airfield systems/navigational aids; IAW AFI 13-204v4
39 SFS	Knight 1-10	Various Staff Positions - Flightline Patrol/Emergency Response/Training
39 SFS	Romeo ## , 5B	Response Force - Flightline Patrol/Emergency Response

39 SFS	Whiskey 5-6	Daily Post/Flightline Patrol/Emergency Response
39 SFS	2-Nov	Daily Post/Flightline Patrol/Emergency Response
39 SFS	Sierra 1 - 10	Daily Post/Flightline Patrol/Emergency Response
39 SFS	Blade 1 - 4	Various Staff Positions - Flightline Patrol/Emergency Response/Training
39 SFS	Charlie 1-10	Convoy Patrol/Flightline Patrol/Emergency Response
39 SFS	Delta 1-10	Convoy Patrol/Flightline Patrol/Emergency Response
39 SFS	Victor 1 - 4	Vault Op Patrol/Emergency Response
39 SFS	Guardian 1	Contingency Flight Chief/Emergency Response
39 SFS	Defender Lead 1	Daily Flight Chief/Emergency Response
39 SFS	Police 1 - 4	Daily Police Patrol/Emergency Response
39 WSSG	Surety 1	39 WSSG/CC
414 ERS	Pred Super	Arming/De-arming on CMA as well as towing a/c
414 ERS	Pred Ops	CMA access to provide assistance to maintenance and/or emergencies
414 ERS	Pred Maintenance	Arming/De-arming on CMA as well as towing a/c
414 ERS	Pred 1-2	CMA access to provide assistance to maintenance and/or emergencies
447 EAMXS	Tanker Tow	Required to tow tankers to other side of flightline for maintenance requiring a hangar
447 EAMXS	Mustang 1	Required tug/truck to tow A-10s to 346 for phase
447 EAMXS	Thunder 69	Required Mitsubishi 4 pax-R/R and phase to bring equipment to the other side of the flightline
447 EAMXS	Dragon 1	Required aircraft tug to tow A-10s to additional maintenance locations
728 AMS	Airlift 1-4	Required to perform maintenance in a timely manner to include towing aircraft, diverts and red ball MX
728 AMS	AMC 1 - 3	Required to perform maintenance in a timely manner to include towing aircraft, diverts and red ball MX
728 AMS	Golf 1 -9	Required to perform maintenance in a timely manner to include towing aircraft, diverts and red ball MX

728 AMS	Traffic	Used by Air Terminal Operations Center. Required in order to meet inbound/outbound quick turn aircraft and coordinate aerial port support for these aircraft.
728 AMS	Port Renegade 1-3	Required and used by load teams escorting material handling equipment and cargo across the runway to arriving and departing aircraft. Response times for these missions is usually less than 5 minutes.
728 AMS	Renegade AGE	AGE Line Drivers required to deliver age equipment to Aircraft within 15min response time.
728 AMS	Loader 1 , 2 and 3	Required because vehicle used is a K-loader or forklift that is unable to access base roads. Speed of these vehicles also requires permission to cross active in order to meet quick response times of arriving and departing aircraft.
175 EAMU	Phase	Required to bring equipment to the other side of the flightline
VMA-Q4	Seahawk Mx (Marines)	VMAQ-4 operates out of Hotel Loop. VMAQ-4's requirement to cross the runway would primarily be in the event that 1 of our aircraft requires a stop with the use of the cable. In this event, our maintainers would require access to the runway to tow the aircraft out. We will be supporting 24 hour flight operations, and with aircraft staged in multiple areas, it is necessary for us to have multiple maintainers who can satisfy this requirement, if and when it becomes necessary

Attachment 15

AIRFIELD DIAGRAM

Figure A15.1. Airfield Diagram

