BY ORDER OF THE COMMANDER
DYESS AIR FORCE BASE (AFGSC)

DYESS AIR FORCE BASE
INSTRUCTION

13-204

30 SEPTEMBER 2020

Nuclear, Space Missile, Command and Control

AIRFIELD OPERATIONS AND BASE FLYING PROCEDURES

COMPLIANCE WITH THIS PUBLICATION IS MANDATORY

ACCESSIBILITY: Publications and forms are available on the e-Publishing website at **www.e-publishing.af.mil** for downloading or ordering.

RELEASABILITY: There are no releasability restrictions on this publication.

OPR: 7 OSS/OSA

Certified by: 7 OG/CC
(Col Daniel C. Diehl)

Supersedes: DAFBI 11-250, Airfield Operations and Base Flying Procedures, 16 Apr 2017

Pages: 79

This instruction establishes operational procedures, administrative procedures, and standards for base Air Traffic Control (ATC) services, airspace management, operation of the airfield and associated equipment, local flying, emergency and special procedures. This instruction applies to all personnel assigned or attached to the 7th Bomb Wing (7 BW) and the 317th Airlift Wing (317 AW) as well as all tenant units operating on Dyess Air Force Base. The operational training division will ensure the information in this publication is part of base instrument refresher courses. This instruction also provides guidance outlined in AFPD 13-2, *Air Traffic Control, Airspace, Airfield, and Range Management*, AFI 13-204V2, *Airfield Operations Standardization and Evaluations*, AFI 13-204V3, *Airfield Operations Procedures and Programs*; AFI 13-204V4, *Management of Ground Radar and Airfield Systems;* Federal Aviation Administration Order 7110.65, *Air Traffic Control*; and directives of higher authority. The 7th Operations Support Squadron (7 OSS), Airfield Operations Flight (7 OSS/OSA) is Office of Primary Responsibility (OPR) for this instruction. The 7 OSS/OSA will coordinate changes/revisions to this publication with airfield users and submit the AF IMT 847, *Recommendation for Change of Publication* to MAJCOM publications/forms managers for processing. Ensure all records created as a result of processes prescribed in this publication are maintained IAW AFMAN 33-363, *Management of Records*, and disposed of IAW the Air Force Record Disposition Schedule (RDS) at **https://www.my.af.mil/afrims/afrims/afrims/rds/rds_series.cfm**.

Chapter 1—GENERAL INFORMATION 8

1.1. Airfield Data. 8

Table 1.1. Taxiways/Taxilanes 8

1.2. Runway Selection Procedures..... 9

1.3. Controlled Movement Area (CMA)..... 10

1.4. Airfield Lighting Systems..... 10

1.5. Permanently Closed/Unusable Portions of the Airfield..... 11

1.6. Aircraft Arresting Systems. 11

1.7. Parking Plan/Restrictions..... 11

1.8. Airfield Operations Facilities/Operating Hours/Designated Airspace..... 11

1.9. Local Frequencies/Channelization..... 12

Table 1.2. Local Frequencies/Channelization..... 12

1.10. Air Traffic Control and Landing Systems (ATCALS). 13

Table 1.3. Available NAVAIDS 13

1.11. Transient Alert (TA). 14

1.12. Automatic Terminal Information Service (ATIS) Procedures..... 14

1.13. Aircraft Special Operations Areas/Ramps. 14

1.14. Aircraft Towing Procedures..... 15

1.15. Aircraft Taxiing Requirements/Routes. 15

1.16. Airfield Maintenance 16

1.17. Runway Surface Condition (RSC) and/or Runway Condition Readings (RCR)..... 16

1.18. Procedures/Requirements for Conducting Runway Inspections/Checks..... 16

1.19. Procedures for Opening and Closing the Airfield..... 17

1.20. Procedures for Suspending and Resuming Runway Operations..... 17

1.21. Engine Test/Run-Up Procedures..... 18

1.22. Quiet Hours/Noise Abatement Procedures 19

1.23. Precision Approach Critical Areas..... 19

1.24. Restricted/Classified Areas on the Airfield. 20
1.25. Auxiliary Power for ATCALS Facilities. 20
Chapter 2—FLYING AREAS **21**
2.1. Local Flying Area. 21
2.2. VFR Local Training Area. 21
Chapter 3—VFR PROCEDURES **22**
3.1. VFR Weather Minimums. 22
Table 3.1. VFR Weather Minimums. 22
3.2. VFR Traffic Patterns. 22
Table 3.2. VFR Traffic Patterns. 22
3.3. Special Procedures. 23
3.4. Reduced Same Runway Separation (RSRS) Procedures. 23
Table 3.3. RSRS Standards for AFGS and Locally Assigned Aircraft. 24
Table 3.4. RSRS for Similar Fighter Type Aircraft. 24
Table 3.5. RSRS for Dissimilar Fighter Type Aircraft. 24
3.5. Intersection Departures. 25
3.6. B-1 Visual Approach Procedures. 25
3.7. C-130 Normal Visual Approach Procedures. 26
3.8. C-130 Tactical Visual Approach Procedures. 27
3.9. Landing Zone Procedures. 27
3.10. Marrion Drop Zone Procedures. 30
3.11. Gonzalez Drop Zone Procedures. 32
3.12. Additional VFR Flying Procedures. 32
Chapter 4—IFR PROCEDURES **33**
4.1. Radar Traffic Patterns. 33
4.2. Availability/Restrictions for Approach Surveillance Radar (ASR) Approaches. 33
4.3. Availability/Restrictions for Precision Approach Radar (PAR) Approaches. 33
4.4. Local Departure Procedures. 33
4.5. Radar Vector to Initial Procedures. 33

4.6. Instrument Approaches. 33
4.7. No-Light Minimums. 33
4.8. Integrated Precision Radar Approach (IPRA). 33
Chapter 5—EMERGENCY PROCEDURES **34**
5.1. Operation of the Primary Crash Alarm System (PCAS). 34
5.2. Operation of the Secondary Crash Net (SCN). 34
5.3. Emergency Response Procedures (On/Off-Base). 35
5.4. External Stores Jettison Area Procedures. 35
5.5. Fuel Dumping. 37
5.6. Emergency Arresting/Barrier Gear Procedures. 37
5.7. Hot Brake Area and Procedures. 37
5.8. Abandonment of Aircraft. 37
5.9. Personnel/Crash Locator Beacon Signal/Emergency Locator Transmitters (ELTs). 38
5.10. Hung Ordinance Procedures. 38
5.11. Wind Limitations on Control Tower. 38
5.12. Evacuation of ATC Facility. 38
5.13. Evacuation of AM Facility. 39
5.14. Other Emergency Procedures. 39
5.15. Alternate ATC Facility Procedures. 39
5.16. Alternate AM Facility Procedures. 40
5.17. Dedicated Emergency Frequency. 40
5.18. Visual Check of Landing Gear. 40
5.19. Overdue or Missing Aircraft. 40
5.20. Aborted Takeoff Procedures. 40
5.21. Jettison of Drag Chutes. 40
5.22. Anti-hijack/Unauthorized Aircraft Movement. 41
Chapter 6—ADDITIONAL FLYING PROCEDURES **42**
6.1. Altitude Restricted Low Approach. 42

6.2. Station Keeping Equipment (SKE). 42
6.3. Aerial Displays. 42
6.4. Chaff and Flares. 42
6.5. Combat Off-load/On-load. 42
6.6. Engine Running Crew Change (ERCC). 43
Chapter 7—FLIGHT PLANNING PROCEDURES **44**
7.1. Flight Planning. 44
Chapter 8—MISCELLANEOUS PROCEDURES / PROGRAMS **45**
8.1. Airfield Operations Board (AOB). 45
8.2. NOTAM Procedures. 45
8.3. Flight Information Publication (FLIP) Accounts, Procedures for Requesting Changes. 45
8.4. Prior Permission Requested (PPR) Procedures. 46
8.5. MEDEVAC Notification and Response Procedures. 46
8.6. Unscheduled Aircraft Arrivals. 46
8.7. Distinguished Visitor Notification Procedures. 47
8.8. Dangerous/Hazardous Cargo 47
8.9. Night Vision Device/Night Vision Goggle Operations. 47
8.10. Local Aircraft Priorities. 47
8.11. Lost Communications Procedures. 48
Table 8.1. AFVA 13-221 Control Tower Light Gun Signals. 48
8.12. Standard Climb-Out Instructions. 49
8.13. Opposite Direction Take-Offs and Landings. 49
8.14. Break-out/Go-Around/Missed Approach/Carry Straight Through Procedures. 49
8.15. Civil Aircraft Operations/Authorized Landings. 50
8.16. Civil Use of Military ATCALS. 50
8.17. Aero Club Operations. 50
8.18. Weather Dissemination and Coordination Procedures. 50
8.19. Bird/Wildlife Control. 50

8.20. Bird Watch Conditions (BWCs). 50
8.21. Supervisor of Flying (SOF) Program. 50
8.22. Airfield Photography. 52
8.23. Combat Departure/Arrival Procedures. 52
8.24. Unmanned Aircraft System (UAS) Operation/Procedures. 52
8.25. Model/Remote Controlled Aircraft. 52
8.26. Mid-Air Collision Avoidance (MACA) Program. 52
8.27. Bird Aircraft Strike Hazard (BASH) Program. 53
8.28. Foreign Object Damage (FOD) Program. 53
8.29. Airfield Driving. 53
8.30. Airfield Driving Program (ADP). 53
8.31. Air Installation Compatible Use Zone (AICUZ) Program. 53
8.32. Terminal Instrument Procedures (TERPS) Program. 53
8.33. Local Operating Procedures (LOPs). 53
8.34. Annual Airfield Certification/Safety Inspection (ACSI). 54
8.35. Quarterly Joint Airfield Inspection. 54
8.36. Waivers to Airfield/Airspace Criteria. 54
8.37. Base Exercises. 54
8.38. Protection and Release of Records. 54
8.39. Maintenance Radio Checks. 55
8.40. Unauthorized Civil Aircraft Arrivals. 55
8.41. Fire Pit Operations. 55
8.42. Large Aircraft Infrared Countermeasures (LAIRCM) Operations. 55

Attachment 1—GLOSSARY OF REFERENCES AND SUPPORTING INFORMATION 56

Attachment 2—DYESS AIRFIELD DIAGRAM 62

Attachment 3—LOCAL FLYING AREA 65

Attachment 4—VFR TRAFFIC PATTERNS 66

Attachment 5—DYESS CLASS C SURFACE AREA AND TOWER AREAS 68

Attachment 6—ABILENE APPROACH CONTROL AREA 69

Attachment 7—C-130 VFR PATTERNS 70

Attachment 8—DYESS DROP ZONES 76

Chapter 1

GENERAL INFORMATION

1.1. Airfield Data.

1.1.1. Dyess AFB Identifier and Location: KDYS, N 32 25.24' W 99 51.28'.

1.1.2. Field Elevation: 1790' MSL.

1.1.3. Airfield Gradient and Surrounding Terrain: Runway 16/34 - negligible (increase of 2.60' from south to north). The surrounding terrain is generally flat with low ridges of hills to the southeast, south, and southwest. Elevation of these hills is 2,500' MSL.

1.1.4. Runway and Landing Zones (LZ)

1.1.4.1. Runway 16/34: 13,500' X 300' and is part concrete and part asphalt. 180 degree turns made by aircraft larger than a C-130 should be conducted on the 1000' concrete portion at both ends of the runway. All Distance Remaining Markers (DRMs) except 12/1 and 1/12 are spaced at 1,000' intervals. DRMs 12/1 and 1/12 are located 1,250' from each end of the runway. The runway overruns are 1,000' X 300' and composed of non-load bearing asphalt.

1.1.4.2. Landing Zone (LZ) 163/343 is a landing strip used exclusively for military training. LZ 163/343 is 3,500' X 60' and consists of a semi-prepared surface with 300' X 60' overruns at each end. LZ 163/343 is located 1,450' west of the runway (centerline to centerline) and is connected to the runway via Taxiways Golf and Hotel. LZ 163/343 and connecting taxiways are restricted to C-130 type or smaller aircraft operations. LZ 163/343 may be referred to as "JACKRABBIT LZ".

1.1.4.3. LZ 164/344 is a landing strip used exclusively for military training. LZ 166/344 is 3,498' X 60' and consists of an asphalt surface with 300' x 60' asphalt overruns. LZ 164/344 is located 2,950' west of the runway (centerline to centerline) and 1,440' west of LZ 163/343 (edge to edge). It is connected to the runway by Taxiways Hotel and Juliet. Taxiway Juliet is the parallel taxiway to LZ 164/344. LZ 164/344 and connecting taxiways are restricted to C-130 type or smaller aircraft use only. LZ 164/344 may be referred to as "TYE LZ".

1.1.5. Taxiways/Taxilanes

Table 1.1. Taxiways/Taxilanes

Taxiing Surface Features			
Taxilane/ Taxiway	**Width / Type**	**Taxilane Shoulders**	**Lighting Available**
Alpha	225' Concrete	25' stabilized-asphalt on the west side of the taxilane/taxiway.	Yes

Note: *A portion of Taxiway Alpha was designated a taxilane in 2010 in order to accommodate for the C-130J ramp reconfiguration and be compliant with UFC standards.*			
Taxiway	**Width & Type**	**Taxiway Shoulders**	**Lighting Available**
Bravo	75’ Concrete	50’ stabilized-asphalt on each side of taxiway.	Yes
Charlie	75’ Concrete	50’ stabilized-asphalt on each side of taxiway.	Yes
Delta	75’ Asphalt	25’ stabilized-asphalt on each side of taxiway.	Yes
Echo	75’ Asphalt	50’ stabilized-asphalt on each side of taxiway.	Yes
Foxtrot	75’ Concrete	50’ stabilized-asphalt on each side of taxiway.	Yes
Golf	75’ Asphalt	25’ stabilized-asphalt on each side of taxiway.	No
Note: *During nighttime operations, Taxiway Golf is limited to aircrew using Night Vision Goggles/Night Vision Devices (NVG/NVDs) and maintenance crews conducting approved aircraft tows.*			
Hotel	40’ Asphalt	No shoulders. Special use taxiway to support LZs.	Yes
Juliet	40’ Asphalt	No shoulders	Yes

1.2. Runway Selection Procedures. Runway 16 is the wind calm runway. When wind speed is 5 knots or greater, the runway most nearly aligned with the wind will normally be used. The Watch Supervisor/Senior Controller (WS/SC) is the designated authority for selecting the active runway for aircraft operations. The WS/SC determines the runway in use based on criteria in FAAO JO 7110.65 and this instruction.

1.2.1. Issuing Wind Information. Tower issues wind direction and speed from wind displays IAW FAAO JO 7110.65 and AFI 13-204V3, AFGSC Sup. When wind displays are unavailable, Tower will issue wind information contained in the latest weather observation, prefaced with the term “*WIND ESTIMATED*”. Weather Flight is the authority for determining when winds should be estimated.

1.2.1.1. Tower will coordinate with Weather Flight to select the wind sensors at the approach end of runway unless an operational advantage will result from another setting. Tower will advise aircrew if reported winds are from other than the approach end of runway. This may be accomplished by including information on the Automated Terminal Information Service (ATIS) broadcast.

1.2.1.2. Tower will notify Weather Flight and Abilene (ABI) Approach when it is suspected that the wind equipment is unreliable. Weather Flight will notify Radar Airfield and Weather Systems (RAWS) to establish a job or work order. When the wind equipment is returned to operational status, Weather Flight will notify Tower who will notify ABI Approach.

1.2.2. Windsocks. There are three 15-knot wind socks on the airfield. East of Runway 16/34 and south of Taxiway Bravo; East of Runway 16/34 and south of Taxiway Charlie; East of Runway 16/34 and north of Taxiway Foxtrot.

1.2.3. Runway Change Procedures. Tower will coordinate with ABI Approach prior to implementing runway change procedures. This coordination will resolve any traffic problems associated with the change. Upon changing the runway in use, Dyess Tower will notify ABI Approach, Airfield Management (AM), Weather Flight, Fire Department (FD), Operational Support Specialists (CCT) or Landing Zone Safety Officer (LZSO) and Dyess Command Post (CP). Dyess Tower will broadcast the runway change on all tower and ground control frequencies.

1.3. Controlled Movement Area (CMA). Dyess AFB's CMA consists of Runway 16/34, LZ 163/343, LZ 164/344, overruns, instrument critical areas, Marrion Drop Zone (DZ) and LZ 163 approach corridor. VFR hold lines, instrument hold lines, and hold signs instruct vehicles to contact Tower for permission to enter the CMA. See **Attachment 2**.

1.3.1. During operating hours, Tower controls all movement in the CMA. Vehicles/personnel must obtain permission before entering the CMA. Vehicles operating in the CMA must use beacon lights or hazard/warning flashers and maintain two-way radio communications with Tower. Vehicles will exit the CMA, then notify Tower with their current location. When Tower requests vehicles to exit the CMA, all vehicles will depart immediately to an area located behind the appropriate hold lines.

1.3.1.1. Vehicles operating in or through the CMA must be in radio contact with Tower either on an Ultra High Frequency (UHF) radio, Tower Net, or Ramp Net. Cell phone communication with Tower is for emergency use only.

1.3.1.2. Recall of Vehicles. In the event of a radio failure or out of necessity, Tower will attempt to contact the vehicle using light gun signals. If the vehicle does not respond, Tower will cycle the runway lights from the lowest to highest intensity to signal a loss of radio communication. After observing the runway lights cycle, personnel will attempt to contact Tower while immediately exiting the CMA. If the above procedures fail, Tower will notify AM for assistance escorting the vehicle out of the CMA. **Note:** Refer to AFVA 13-222, Runway/ CMA Procedures, for additional CMA procedures.

1.3.2. During non-operating hours, the CMA is not active and is an uncontrolled movement area. Vehicles/personnel preparing to transition onto the runway/LZs or towing an aircraft on the airfield must contact Dyess CP prior to commencing operations and will report when exiting the area. These actions are accomplished in order for Dyess AFB to maintain proper oversight and safety of personnel and aircraft resources.

1.4. Airfield Lighting Systems. AM and Airfield Lighting (7 CES/CEOFE) are responsible for inspecting airfield and obstruction lighting. Tower has control of the airfield lighting panel and will operate all airfield lighting systems and visual aids IAW FAAO JO 7110.65, AFI 13-204V3, AFGSC Sup, and local OIs for all aircraft operations. The airfield lighting vault/primary airfield lighting panel is located in Building 4101. AM maintains an LOA with 7 CES/CEOFE to address outages and maintenance response times.

1.4.1. Runway 16/34 has U.S. standard high intensity Approach Lights with Sequenced Flashing Lights (ALSF-1s), Precision Approach Path Indicators (PAPIs) and High Intensity Runway Lights (HIRLs). ALSF-1s begin 3,000' from each threshold.

1.4.2. LZ 163/343 has permanent reflective panels and no permanent lighting. Temporary lighting will be placed along LZ 163/343 prior to and during all night operations by the CCT or LZSO. Lighting is either Overt (White) or Covert (Infrared - IR) as requested by the user.

1.4.3. LZ 164/344 has Low Intensity Runway Lights (LIRLs) that are remotely controlled from Tower and has permanent reflective panels. IR lighting on LZ 164/344 is available prior to and during NVG operations.

1.4.4. Rotating Beacon. Dyess AFB's rotating beacon is located 1 mile east of Runway 16/34 atop the water tower. Dyess Tower controls the rotating beacon.

1.4.5. Obstruction Lights. The Marrion Tower obstruction light must be operational during operations to the LZs at night.

1.4.6. DZ Warning Lights. The DZ Warning Lights are located at the Tower. The lights must be illuminated during all air drop and assault landing operations, day and night. The LZSO operates the warning lights while on duty to prevent unauthorized personnel and vehicular crossings during drops and during all assault landings to LZs 163/343 and 164/344.

1.5. Permanently Closed/Unusable Portions of the Airfield. The TYE ramp is marked closed and is unusable for aircraft operations.

1.6. Aircraft Arresting Systems. Dyess AFB does not have arresting gear/barriers.

1.7. Parking Plan/Restrictions. Parking locations for local and transient aircraft are detailed in the 7 BW Master Aircraft Parking Plan. All aircraft will be marshalled along approved taxi lines and parked. Dyess AFB maintains a waiver for Jet Blast clearance on Bravo row.

1.7.1. Local B-1 Parking. B-1 aircraft are parked on Alpha and Bravo rows. Aircraft parking in Alpha row will taxi in via Bravo 17 to the taxilane east of Alpha row to allow aircraft to exit Taxiway Alpha without a Follow-Me. Parking marshallers will be available to assist in the final stages of parking. When final access is blocked, aircraft will be parked on the ramp centerline and backed into the appropriate Alpha row parking spot by a qualified tow team. Aircraft parking on Bravo row may taxi directly to the final parking position, provided marshallers are available to assist in the final parking stages.

1.7.2. Local C-130 Parking. C-130s are parked on Quebec thru X-Ray rows with taxi lines painted to each parking position.

1.7.3. Transient Parking. Marshallers will direct transient aircraft with the Follow-Me vehicle to final parking.

1.8. Airfield Operations Facilities/Operating Hours/Designated Airspace.

1.8.1. Base Operations. The Dyess Base Operations Building 9001 contains the Airfield Operations Flight Commander's (AOF/CC) and Airfield Manager's (AFM) offices, AM section, Flight Planning Room, Aircrew Lounge, Distinguished Visitor's (DV's) Lounge (maintained by Wing Protocol), Weather Flight, and Transient Alert (TA). Refer to the Dyess Airfield Diagram (**Attachment 2**) for Base Operations location and other associated facilities.

1.8.2. Airfield Operating Hours. Dyess airfield and Air Traffic Control (ATC) hours of operation are 24/7 unless otherwise published. Aircrews must use the Instrument Flight Rules (IFR) Supplement and view Notices to Airmen (NOTAMs) for planning purposes.

1.8.2.1. Reduction/Extension of Operating Hours. The 7 OG/CC is the approval authority for airfield closures of 96 hours or less, including days already published closed to support short-notice emergency maintenance requirements or other short-term requirements to include goal/training days and holidays. Upon approval notification, AM will issue NOTAMs as required. Closures lasting greater than 96 hours must be approved my MAJCOM A3 Staff

1.8.2.2. Outside of Published/NOTAM Hours. The 7 OG/CC is the final approval authority for operations outside of published/NOTAM hours and on federal holidays. The 317 AW HHQ missions are supported and are considered mission essential. The 7 OG/CC is the final approval for 317 AW HHQ missions and will notify the 317 AW OG/CC of status.

1.8.2.2.1. Inbound Aircraft. For operations approved outside of published/NOTAM hours the airfield will open 1 hour prior to the scheduled aircraft's estimated time of arrival (ETA). The airfield will close after the last arriving aircraft has parked and shutdown engines.

1.8.2.2.2. Outbound Aircraft. For operations approved outside of published/NOTAM hours, the airfield will open 1 hour prior to the scheduled aircraft's estimated time of departure (ETD). The airfield will close 30 minutes after the last aircraft's departure time in the event the same aircraft needs to return to Dyess. If verbally released by the aircrew, the airfield may be closed 5 minutes after the aircraft's departure.

1.8.3. ATC Facilities/Designation of Airspace. ABI Terminal Radar Approach Control (TRACON) exercises primary control over aircraft on IFR clearances within 35 NM radius of the ABI Very High Frequency Omni-directional Range/Tactical Air Navigation (VORTAC) up to and including 12,000' Mean Sea Level (MSL) (See **Attachment 6**). Dyess Tower is responsible for control of Visual Flight Rules (VFR) traffic from the surface up to 3,500' MSL within 5 NM of the center of Dyess AFB Runway 16/34, including 3 NM extensions up to 3,000'MSL on the arrival and departure ends of the runway. It also extends 5 NM from either side of the runway extended centerline (see **Attachment 5**).Dyess Tower airspace is controlled as Class Charlie airspace.

1.8.3.1. Dyess Tower coordinates with ABI Approach prior to aircraft leaving Dyess Tower's area of responsibility. ATC procedures will be IAW the LOA between ABI Approach Control and Dyess Tower.

1.9. Local Frequencies/Channelization

Table 1.2. Local Frequencies/Channelization

Frequencies			
Dyess Tower	257.675 / 133.0	**Dyess CP (7 BW) (Raymond 37)**	349.4 / 311.0

Dyess Ground	275.8 / 118.35	**7 BW SOF (Foxtrot)**	261.0
Dyess ATIS	269.175	**ABI Departure**	282.3 / 127.2
Pilot-to-Metro	383.25	**Marrion CCT (DZCO/LZSO) (Reaper)**	314.2 / 139.7
Pilot-to-Dispatch (PTD)	372.2 / 139.3	**Dedicated Emergency Frequency (ref Para 7.4)**	339.7

1.10. Air Traffic Control and Landing Systems (ATCALS). Tower is the ATCALS / Navigation Aid (NAVAID) monitoring facility and reports all ATCALS malfunctions, outages, and restorations to AM, RAWS, and ABI Approach. If known, RAWS will provide restoration estimates. Tower will pass restoral estimates to AM and the AOF/CC.

1.10.1. On-base NAVAIDs. Dyess AFB operates a Tactical Air Navigation (TACAN) station and a Category I (CAT I) ILS during airfield hours. It is a dual ILS that serves Runway 16/34. The TACAN No-NOTAM Maintenance Periods (MPs) are listed in the IFR Supplement and **Table 1.3**

1.10.2. Off-base NAVAIDs. Dyess AFB utilizes Abilene's VORTAC, monitored by Fort Worth Center (ZFW), as well the Tuscola Very High Frequency Omni-directional Range/Distance Measuring Equipment (VOR/DME), monitored by ZFW.

1.10.3. Preventive Maintenance Inspection (PMI) Schedule. The PMI schedule is published in the Instrument Flight Rules (IFR) - Supplement FLIP under Dyess AFB. 7 OSS/OSA will coordinate with both 7th and 317th Wing Scheduling to ensure there are no conflicts with flying operations prior to taking down the equipment during the recurring PMI schedule. All requests to take down the equipment outside of the window will be coordinated NLT 1 week in advance via the -165 process.

Table 1.3. Available NAVAIDS

NAVAID	Location	Identification	Bearing / Distance from Field Center	Channel / Frequency
DYESS CAT I ILS	Multiple locations	Runway 16: I - TYY Runway 34: I - DYS	Multiple locations	Runway 16 and 34 share 09.9 MHz
DYESS TACAN	N 32 25.11' W 99 51.42'	DYS	Checkpoints on Taxiways Bravo and Foxtrot	CH 63
ABI VORTAC	N 32 28.88' W 99 51.81'	ABI	DYS 350/ 3.7 NM	113.7 MHz/CH 84
TUSCOLA VOR/DME	N 32 14.14' W 99 49.01'	TQA	DYS 165/ 11.2 NM	111.6 MHz/CH 53

Recurring ATCALS PMI Schedule	
NAVAID	**PMI Days/Times**
DYESS ILS	Mondays – Fridays (0400-0900L)
DYESS TACAN	Mondays – Fridays (0400-0900L)
DALR	Mondays – Fridays (0400-0900L)

1.11. Transient Alert (TA). TA is available during Monday-Friday 0800L-2200L and closed on weekends except for pre-coordinated/approved extensions. TA shall provide all personnel, equipment, tools, materials, supervision, other items and services necessary to perform TA maintenance as detailed in the signed TA Contract.

1.11.1. TA will coordinate with the AFM or designated representative to determine parking location for transient aircraft. The 7th Equipment Maintenance Squadron (7 EMS) oversees the TA contracted personnel. Transient Alert does not service aircraft conducting local missions.

1.11.2. TA Assistance. Transient aircraft will be escorted by a Follow-Me vehicle after exiting the runway and be guided to the designated hold point for post-landing checks. If a TA Follow-Me vehicle is not readily available, Tower will provide progressive taxi instructions to the ramp area, if required. Tower will instruct aircraft to hold at an appropriate point until a follow-me vehicle is in position to guide taxiing into parking. If the aircraft needs to be held at the hold point, Tower will inform the Follow-Me vehicle, otherwise the vehicle will immediately lead the aircraft to parking.

1.11.3. TA is authorized to support local sortie generation flights on T-38 aircraft in support of the 77th Weapons Squadron twice a year, all other requested to support sortie generation flights on non-Dyess aircraft will be at the contractors discretion. Notice must be given at least 14 calendar days in advance to properly schedule manning for these events. Transient aircraft as defined by AFI 21-101 have priority.

1.12. Automatic Terminal Information Service (ATIS) Procedures. The Dyess ATIS is designed to provide aircrews with current runway in use, weather, field advisories, and NOTAMs during airfield operating hours. The ATIS message format is IAW FAA Order (FAAO) JO 7110.65, *Air Traffic Control*. Additional items include pattern restrictions and other data pertinent to operations (i.e.: quiet hours, tower evacuations). Tower will update the most current ATIS information and pass the information to ABI Approach.

1.13. Aircraft Special Operations Areas/Ramps. Arm/De-arm, Hydrazine, Hot Brake areas, and the Hazardous cargo pad are depicted in **Attachment 2**.

1.13.1. B-1 Hot Pit Refueling. The primary B-1 Hot Pit refueling spots are Alpha/Bravo 14 and 22. The alternate B-1 Hot Pit refueling Spots are Alpha/Bravo 15, and 21. E-4B aircraft are approved to hot refuel at primary and alternate parking locations. Hot Pit refueling operations are conducted IAW Dyess AFB Local Checklist for B-1 Hot Refueling as maintained by 7th Component Maintenance Squadron.

1.13.2. Dangerous/Hazardous Cargo. The TA ramp is the primary site for transient aircraft with Hazardous Cargo/Division (HC/D) 1.3 and 1.4, but has several restrictions. This site is

authorized for transient use when the duration is 24 hours or less for refueling, servicing, crew rest or change, or maintenance. If located on TA parking, the aircraft will be kept under constant surveillance and not loaded, unloaded, nor will its explosives be handled.

1.13.3. Forward Area Refueling Point (FARP). Aircrew requesting to conduct FARP operations must contact AM at least 24 hours prior to mission execution to de-conflict operations on the Transient Ramp. AM will coordinate the Transient Ramp use with TA before approving the FARP operations. AM will notify ATC and send a NOTAM for all approved FARP operations. The FARP aircraft will be positioned IAW current FARP survey. **Note:** 317 AW will ensure the FARP survey is current and a copy of the survey is provided to the AFM.

1.14. Aircraft Towing Procedures. The 7 BW MOC and 317 AW MOC will notify Tower via landline of all aircraft towing operation requests. MOC will pass the aircraft tail-number, where the aircraft will tow from/to, and whether the tow operation will access Taxilane Alpha.

1.14.1. 317 AW tow crews utilize the Ground frequency (275.8 / 118.35) to coordinate the start and termination aircraft tows. 7 BW MOC will coordinate the start and termination of tows through 7 BW MOC landline with Tower.

1.14.2. Aircraft tows will yield to taxiing aircraft.

1.14.3. All aircraft tow operations require direct two-way communication with Tower via Tower Net or UHF/VHF radio.

1.14.4. In the event of emergencies or exercises, aircraft tow operations in progress may be instructed by Tower to hold their position for responding emergency vehicles.

1.14.5. During times when Tower is closed, the 7 BW MOC and 317 AW MOC will notify Dyess CP of the beginning and termination of all aircraft tows.

1.15. Aircraft Taxiing Requirements/Routes. The appropriate clearance criteria for aircraft taxiing will be conducted IAW AFI 11-218, *Aircraft Operations and Movement on the Ground.*

1.15.1. General Taxi Procedures. All aircraft movement must be pre-approved by Ground prior to the operation. Aircrews will report the current ATIS code on initial contact/taxi request. If an aircraft or equipment is parked on the adjacent parking spot (e.g. Bravo 2 or Alpha 2), aircraft will not proceed through any other access point until a wing-walker is available to ensure clearance. **Note:** Aircrews will not taxi without Ground's approval.

1.15.1.1. When authorized to taxi from parking, locally assigned aircrews will flash/turn on taxi lights. Aircrews will be marshalled out of the parking spot and will then proceed to Taxilane Alpha and the assigned runway.

1.15.1.2. Aircrews will taxi on taxiway centerlines (stagger taxi is not authorized for local aircraft), avoid sharp/minimum radius turns, and not make turns in excess of 90 degrees within congested areas. Aircrews must use extreme caution on ramps, taxiways and hangar areas for numerous uncontrolled vehicles.

1.15.1.3. Aircrews may make a request with Ground for aircraft taxiing practice in the TA ramp adjacent to Taxilane Alpha and south of Rebound Echo/TA's parking rows. Ground will coordinate with AM for de-confliction with TA. After receiving AM approval, Ground will issue approval to the aircrew. Aircraft shall not proceed to the

ramp without approval from Ground. Aircrew will notify Ground regarding their completion of the practice taxi operations, which will be then passed to AM. **Note:** Aircrew should contact AM at least 24 hours prior to ensure the transient ramp is available for use.

1.15.1.4. During periods of low ceiling/visibility, Tower will issue hold short instructions IAW **para 1.23** of this instruction.

1.15.1.5. In the event of emergencies or exercises, taxiing aircraft may be instructed by Ground to hold their position for responding emergency vehicles.

1.15.2. Taxiway/Taxilane Restrictions. B-52 aircraft are required to enter and exit Runway 16/34 via Taxiway Foxtrot and taxi to/from parking via Taxilane Alpha due to the close proximity of airfield signs on the intersecting taxiways and Taxilane Alpha. Wing walkers will be provided by TA to ensure safe passage to/from the parking location when requested by the aircrew. **Note:** AM must coordinate removal of airfield signs that violate B-52 wingtip clearance.

1.15.3. Heavy Aircraft Jet Blast Avoidance Procedures. Ground will issue a cautionary warning to aircraft (other than a B-1) taxiing behind taxiing B-1s; and to all aircraft taxiing on the B-1 Parking Apron behind aircraft with engines running IAW **para 1.21** of this instruction.

1.15.4. B-1 Aircraft Recovery. Prior to entry into the Dyess traffic pattern, B-1 aircrews will contact Foxtrot and relay sortie effectiveness, weapon status (if applicable), and special requirements, if any. Foxtrot will provide aircrews with traffic pattern/airfield status to include B-1 VFR pattern operations, C-130 DZ operations, C-130 LZ operations, bird watch condition, airfield construction status, and any additional pertinent information.

1.15.5. C-130 Aircraft Recovery. Prior to entry into the Dyess traffic pattern, C-130 aircrews will contact Tower to pass intentions to use the LZ/DZ and any additional pertinent information. If conducting DZ operations, C-130 aircrew will remain in contact with Marrion Tower or Dyess Tower.

1.16. Airfield Maintenance

1.16.1. All airfield maintenance and construction activities that may impact airfield operations must be coordinated through the AFM and/or Deputy AFM (DAFM). Sweeper operations, grass mowing, etc. will be IAW an operations letter between AM and CES for specific operations.

1.16.2. Snow Removal. Dyess does not maintain a Snow and Ice Control plan or equipment.

1.17. Runway Surface Condition (RSC) and/or Runway Condition Readings (RCR). AM determines and reports RSC and RCR IAW AFI 13-204V3, if applicable.

1.18. Procedures/Requirements for Conducting Runway Inspections/Checks.

1.18.1. Daily Airfield Checks. AM will accomplish airfield checks IAW AFI 13-204V3, and applicable supplements.

1.18.2. Landing Zone checks.

1.18.2.1. When the LZSO is present, they will perform a check of LZ 164/344 and LZ 163/343 to ensure suitability for operations (i.e. condition of the field and FOD potential). The LZSO will notify AM via Ramp Net of any discrepancies.

1.18.2.2. When the DZCO is present, they will perform a check of the Marrion DZ to ensure suitability for operations (i.e. condition of the field and FOD potential). The DZCO will notify AM via Ramp Net of any discrepancies.

1.18.3. Other Required Airfield Checks. AM will also perform a check of the primary taxiways and runway after events such as unauthorized aircraft landings, severe weather, natural disaster (e.g., tornado, earthquake etc.), arrivals/departures of wide body (B-747/C-5/B-52) aircraft, helicopter arrivals/departures from the runway, upon any report of a dropped object or bird strike over or near the runway, in-flight emergencies (IFEs), or ground emergencies (GEs) that may affect safe airfield operations. The SOF on duty may waive the need for an airfield check during an IFE and/or GE.

1.18.4. Daily Airfield Inspections. AM will accomplish airfield inspections IAW AFI 13-204V3, and applicable supplements.

1.19. Procedures for Opening and Closing the Airfield.

1.19.1. Opening the Airfield. AM will conduct an airfield opening check before opening the runway IAW AFI 13-204V3. AM will inform Tower and CP of airfield opening, review NOTAMs with Tower, perform opening checklists, verify crash vehicle status with FD, determine the Bird Watch Condition (BWC), and determine RSC prior to flying.

1.19.1.1. Tower will make a broadcast on all Local and Ground frequencies and the Tower Net announcing Tower is open and vehicles must contact Ground for CMA access.

1.19.2. Closing the Airfield. AM will inform CP and Tower of aerodrome closure. For aerodrome closures due to conditions outside of normal closing, AM will execute the appropriate checklist and coordinate/publish the appropriate NOTAM.

1.19.2.1. Tower will make a broadcast over all Local and Ground frequencies and the Tower Net announcing the Control Tower is closed.

1.19.2.2. Runway Closures Due to Construction. Runway closures may occur for an extended period of time due to construction. A NOTAM will be disseminated outlining the closure details. If the closure will occur for more than 90 days, the closure information will be published in the FLIP.

1.20. Procedures for Suspending and Resuming Runway Operations.

1.20.1. The AFM or designated AM representative is the lead authority to suspend runway operations in response to IFEs, FOD, bird conditions, wide body aircraft arrivals/departures, helicopter operations, accidents which constitute a hazard that occur on or near the runway, and other situations that could impact safety. AM also has the authority to impose airfield restrictions (close/suspend and resume airfield, runway or taxiway operations) as well as limiting operations to specific types of aircraft. In the best interest of safety, the SOF may waive the suspension of runway operations. **Note:** For temporary closures related to hazardous weather or airfield incidents, the AOF/CC must promptly notify the 7 OSS/CC, 7 OG/CC, 317 OSS/CC, 317 AW/CC and HQ AFGSC/A3 via email or telephone.

1.20.2. The WS/SC may suspend aircraft operations to the runway for safety reasons.

1.20.3. If an aircraft has an emergency or stops on the runway, the WS/SC will immediately suspend aircraft operations to the runway. AM will resume operations on the runway after a thorough check has been conducted and has concluded it to be FOD free.

1.21. Engine Test/Run-Up Procedures. Prior to any engine run, the Maintenance Operations Centers (MOCs) must get approval from Tower. Maintenance personnel must monitor Ground frequency (275.8 / 118.35) during all engine runs and be prepared to return aircraft to ground idle when directed by Tower for vehicle traffic or taxiing/arriving/departing aircraft.

1.21.1. B-1 Engine Runs. Spots: A6, A12, A13, A17 (Taxilane), A20 (AGE), A23, A24, A25, A26 do not have jet blast deflectors and therefore engine runs are not performed on these spots. Engine runs are also not performed on B17 (Taxilane). All other Alpha and Bravo parking spots may be utilized for engine runs. When the airfield is open, maintenance personnel or aircrews conducting engine runs will not run engines above ground idle without approval from Tower. When the airfield is closed, any B-1 aircraft conducting an engine run will coordinate with Dyess CP. The B-1 aircraft parking apron does not afford distances between parked aircraft and taxiing aircraft to allow for the dissipation of jet blast to acceptable levels. Dyess AFB maintains a waiver for Jet Blast Clearance. **Note:** When the airfield is open, Tower will inform aircraft and vehicles on frequency transitioning behind heavy jet aircraft that engine runs are in progress by stating "*ENGINE RUNS IN PROGRESS AT* (row/location of engine run aircraft)".

1.21.1.1. Engines may be run in all settings. Only one engine at a time may be operated in afterburner setting.

1.21.1.2. During maintenance runs and crew runs, there will be a ground observer with direct communication to the crew. Before any engine "throttle-ups" the operator must have confirmation from the observer that it is clear. During the entire engine run, the observer will inform the operator of any vehicle/personnel passing behind the aircraft. Vehicles driving shall not pass behind an aircraft with engines running without the "go ahead" from the observer. In some cases, Tower may advise the engine operator of the passing vehicle.

1.21.1.3. In the event of emergencies, exercises, or for safety purposes, maintenance or aircrew conducting B-1 engine runs above ground idle on the B-1 Bravo row may be instructed by Tower to return to ground idle for aircraft, emergency vehicles and/or other airfield vehicles. Tower may accomplish this via a blanket broadcast message, *"ATTENTION ALL AIRCRAFT, REDUCE ENGINES TO GROUND IDLE ON ALPHA AND BRAVO ROWS, EMERGENCY RESPONSE ACTIONS IN PROGRESS."*

1.21.1.4. C-130 Engine Run-ups. C-130 engine run-up for maintenance is performed in their designated parking area, unless otherwise coordinated. During runs above ground/flight idle an aircraft may be parked behind the running aircraft. However, the parking spot must be cleared of personnel and non-powered AGE. Engine run-up for departing aircraft will be conducted IAW published flight manual procedures on Taxiways Bravo, Charlie, Echo, and Foxtrot.

1.21.1.5. Noise Concerns. Due to excessive noise and the possibility of misunderstood aircrew read backs to control instructions, C-130J engine runs only up to ground idle may

be performed on parking spots 1 through 3 of Sierra, Tango, Uniform and Victor rows except aircraft parked on Uniform 1. Aircraft located on the transient ramp or on Taxilane Alpha adjacent to the transient ramp will have engine runs limited to less than 80%.

1.21.1.6. Quiet Hours. Standard requests will be coordinated/briefed at the Pre-165 and approved at the -165 meetings. The 7 OSS representative attending the Pre-165 will inform the AOF/CC or AFM of the approved requests. Other requests will be coordinated through the AOF/CC. The AOF/CC will channel requests (not coordinated through the Pre-165) to the 7 OG/CC for approval. Upon approval, AM shall pass quiet hour times to CP, Tower, and both MOCs at least 1 hour before activity commencement and issue appropriate NOTAM. **Note:** NIGHTWATCH, MEDEVAC, SAAM and higher headquarter directed missions are exempt from noise abatement/quiet hour restrictions.

1.22. Quiet Hours/Noise Abatement Procedures . Dyess AFB observes quiet hours daily between 2200L and 0600L. During this period, the east pattern will only be used to de-conflict B-1 aircraft from C-130 aircrews conducting training to the Marrion DZ, LZ 163/343 or LZ 164/344 and to prevent a dangerous situation from developing in the West traffic pattern. Units may conduct engine runs, to include above ground idle, during quiet hours after obtaining approval from the respective MOC. The MOC will limit approval for engine runs to those necessary to complete repairs to achieve "full mission capable" aircraft only.

1.22.1. B-1 crews will avoid flying over the city of Tye when utilizing the West pattern to Runway 34.

1.23. Precision Approach Critical Areas. See depiction in **Attachment 2**.

1.23.1. Protecting the Precision Approach Critical Areas. These areas consist of the glideslope and localizer critical areas. Dyess' instrument hold lines are located on Taxiways Bravo and Foxtrot. When the reported ceiling is less than 800' and/or visibility is less than 2 miles or the Runway Visual Range (RVR) is less than or equal to 2,400', Tower will place an advisory on the ATIS broadcast and hold all aircraft behind the instrument hold lines. During inclement weather, drivers must contact Tower for access to the runway while holding short of the instrument hold lines. Tower may restrict access to those areas based on inclement weather and traffic situation. Airfield vehicle drivers will adhere to AFI 13-213 DYESSAFBSUP, *Airfield Driving*.

1.23.2. Protecting the Precision Obstacle Free Zone (POFZ). The POFZ is an 800' X 200' area centered on the runway centerline, beginning at and extending outward from the runway threshold, designed to protect aircraft flying precision approaches from vehicles and other aircraft when the ceiling is less than 300' or visibility is less than ¾ SM. When Tower instructs aircraft to hold behind the instrument hold lines during inclement weather conditions listed in **Para 1.23.1**, the POFZ is protected.

1.23.3. Protecting the Obstacle Clearance Surface (OCS). The OCS normally begins 200' from the landing threshold point measured along the final approach course centerline and extends to the final approach fix IAW AFMAN 11-226 (I). The OCS sloping surface slightly overlaps the hammerhead of Taxiway Bravo and the hammerhead of Taxiway Foxtrot. When weather drops below 800' ceiling and 2 miles visibility, the OCS must be protected from aircraft. Tower will place an advisory on the ATIS that the hammerheads are unavailable for

taxiing purposes due to inclement weather. Tower will remove this advisory once weather conditions improve.

1.24. Restricted/Classified Areas on the Airfield. All Protection Level 1, 2 or 3 resources as identified in AFI 31-101, *The Air Force Installation Security Program*, will be parked in established restricted areas. The Rebound Echo portion of the Transient Aircraft Apron is restricted when occupied.

1.25. Auxiliary Power for ATCALS Facilities. Both the Dyess TACAN and ILS facilities have generators. For monthly generator power checks, 7 CES will need approval from the AOF/CC or designated representative before changing any facility to or from backup power.

Chapter 2

FLYING AREAS

2.1. Local Flying Area. The Dyess AFB local flying area is defined as Lancer Military Operating Area (MOA) and a 150 NM circle around Dyess AFB (Attachment 3). The C-130 instrument and functional check flight area is defined by direct lines between San Angelo, El Dorado, Rocksprings, Goldthwaite, Paint Rock and back to San Angelo at an altitude below Flight Level (FL) 180. The VFR corridor is the 180 degree radial of the ABI VORTAC.

2.2. VFR Local Training Area. The C-130 Low Altitude Tactical Navigation area is a 100 NM radius of the ABI VORTAC at an altitude of 300 to 1,500' Above Ground Level (AGL). The C-130 maneuver area is between the ABI VORTAC 260 degree and 300 degree radials, from 10 to 30 DME, at an altitude of 7,000' to 9,000' MSL.

2.2.1. Local Flying Area Restrictions.

2.2.1.1. Explosive Ordinance Disposal (EOD) Range. This range is located 1.5 miles northeast of airfield at N 32° 26.379' W 099° 49.412' (MGRS 14S MA 22585 89467). EOD personnel will notify AM of proposed EOD range activity using the "EOD Range Worksheet" in order for a NOTAM to be published. EOD will then notify Tower when ready, and state the duration the range will be hot. During times Dyess Tower owns Class C airspace, Tower will advise EOD of delays due to current aircraft operations, notify the SOF of EOD activity, broadcast range information on the ATIS, and advice aircraft to avoid overflying the EOD range. When range operations are complete, EOD will notify AM and Tower that the range is cold; the NOTAM and ATIS can be updated at that time. Definitions used: Open - EOD personnel setting up the range for future explosive activity; Cold - Range is closed for explosive activity; Hot - Range in use for explosive operations. Note: During times when Abilene Tower controls Class C airspace, additional coordination is required.

2.2.1.2. Dyess-assigned aircrews should, whenever possible, avoid flying through Sheppard MOA (at or below FL 230) and Brownwood MOA. This does not preclude the use of these areas for work when properly coordinated with the FAA and area controller.

2.2.1.3. When Runway 34 is in use, B-1 aircrews will delay all turns for initial takeoff and patterns until north of Interstate 20 or 2.5 DME referenced from Dyess TACAN for noise abatement. This restriction applies to all takeoffs, even when visual cutoff has been requested and approved.

Chapter 3

VFR PROCEDURES

3.1. VFR Weather Minimums.

3.1.1. WS/SC will determine the available traffic patterns. The pattern selection will be based on weather, airfield lighting, ATCALS, and visibility restrictions hampering Tower's ability to sequence traffic. When weather deteriorates, aircrew on VFR transition flights in the local traffic patterns should contact Tower for a change of flight plan or to terminate the flight.

3.1.2. When VFR traffic patterns status changes, WS/SC will notify ABI Approach.

Table 3.1. VFR Weather Minimums.

Pattern	Runway 16/34	LZ 163/343	LZ 164/344
Rectangular	Ceiling: 1,700' AGL Visibility: 3SM	Ceiling: 1,700' AGL Visibility: 3SM	Ceiling: 1,500' AGL Visibility: 3SM
Overhead	Ceiling: 2,200' AGL Visibility: 3 SM	Ceiling: 2,200' AGL Visibility: 3 SM	Ceiling: 2,200' AGL Visibility: 3 SM
Note: When ceiling is less than 1,700' AGL, LZ 163/343 pattern may be entered by a rectangular pattern from the main runway with Tower's approval			

3.2. VFR Traffic Patterns.

3.2.1. Traffic will use the UHF Tower frequency 257.675 / 133.0 whenever possible to facilitate more efficient/safe pattern operations. Aircrews may request, or may be directed to, either the left or right patterns. When Marrion DZ, LZ 163/343 or LZ 164/344 is active, B-1 aircrews will be directed to fly the East pattern, if necessary.

3.2.2. B-1 VFR Pattern Operations. B-1 VFR Pattern Operations will be in effect any time 2 or more B-1 aircraft are in the Dyess VFR traffic pattern. This will be initiated by the SOF and the SOF will relay this information to both B-1 and C-130 aircrews to facilitate traffic pattern de-confliction. When B-1 VFR Pattern Operations are in effect, C-130 aircrew accomplish approaches to the LZ, use ABI Airport or other airports for transition work, depart the Dyess pattern or expect Dyess AFB local priorities to be in effect reference 8.10.1 for approaches to Runway 16/34. **Note:** WS/SC retains responsibility for overall aircraft operations.

3.2.3. C-130 DZ Operations. C-130 DZ Operations will be in effect any time a C-130 is established inbound on the run-in heading and No Later Than (NLT) 10 NM from the DZ.

Table 3.2. ***VFR Traffic Patterns.***

Pattern	Runway 16/34	LZ 163/343	LZ 164/344
Rectangular	Altitude: 3,000' MSL	Altitude: 3,000'	Altitude: 2,500' MSL
Overhead	Altitude: 3,500' MSL	Altitude: 3,500'	Altitude: 3,500' MSL

B-1 Closed	Altitude: 3,000’ MSL	N/A	N/A
B-1 Outside Straight-In	Altitude: 3,000’ MSL	N/A	N/A
C-130 Closed	Altitude: 3,000' MSL	Altitude: 3,000'	Altitude: 2,500' MSL
C-130 Highspeed Downwind	Altitude: 3,000’ MSL	Altitude: 3,000' MSL	Altitude: 2,500' MSL
Note: For the rectangular pattern, fighter-type aircraft may be instructed by Tower to fly at 3,500’ MSL when operationally advantageous.			

3.3. Special Procedures.

3.3.1. Overhead Pattern Protection.

3.3.1.1. When directed by Tower, aircrews will maintain at or below 3,000’ MSL until passing departure end of runway to protect the Overhead Pattern. Tower may issue 2,500’ MSL if a heavy aircraft is in the overhead.

3.3.1.2. Transient aircrews will be issued pertinent restrictions with departure instructions/climb-out/go-around procedures, when warranted.

3.3.2. Helicopters. Helicopters will normally depart from the runway. Departures from the transient ramp and taxiways may be permitted, provided there is at least 200’ clearance from any other stationary aircraft; the helicopter will not fly over any personnel, aircraft or populated portion of the base; and Tower has the helicopter in sight. In addition, apply separation and phraseology specified in FAAO JO 7110.65. Due to FOD concerns, hover checks will be conducted over paved surfaces.

3.3.3. Paradrop Operations. Refer to **Para 3.10** of this instruction.

3.3.4. Crop Dusting. Crop dusting companies shall contact Dyess Tower and inform of projected operations IAW *Aerial Applicator Aircraft and Texas Boll Weevil Eradication Foundation, Inc.* LOA. Crop dusting companies will provide Tower the aircraft tail number, type and color. A specific time block to conduct operations within a specified area, and a way to reach the aircraft. Tower will approve or disapprove operations within Dyess Class C based on known traffic conditions. Tower will notify Dyess CP and 7 SFS with the time/location of crop dusting operations when crop dusting occurs in the vicinity of Dyess AFB. Tower will obtain control of Dyess Class C and advise the ABI TRACON of all crop dusting operations. Tower shall terminate crop dusting operations when safety becomes a concern.

3.3.5. Unusual Maneuvers. Unusual maneuvers other than those contained in this instruction and other local operating procedures require 7 OG/CC and higher headquarters approval (to include appropriate coordination with the FAA).

3.4. Reduced Same Runway Separation (RSRS) Procedures. RSRS is authorized for all AFGSC and locally assigned aircraft.

3.4.1. Any aircrew or air traffic controller may refuse RSRS when safety of flight may be jeopardized.

3.4.2. Aircrews are responsible for wake turbulence separation when maintaining visual separation or operating under VFR. When IFR or under ATC instructions, Tower must ensure wake turbulence separation exists.

Table 3.3. ***RSRS Standards for AFGS and Locally Assigned Aircraft.***

Scenarios	C-130 Behind C-130 Daytime / Nighttime	C-130 Behind B-1 Daytime / Nighttime	B-1 Behind C-130 Daytime / Nighttime	B-1 Behind B-1 Daytime / Nighttime
FS Behind FS/LA/TG	5,000'	8,000'	See Other	8,000'
TG Behind LA/TG	5,000'	N/A	N/A	8,000'
LA Behind FS/LA	5,000'	8,000'	N/A	See Other
Other			FS Behind a LA = 8000'	LA Behind a LA = 8,000'
Note: FS – Full Stop; LA – Low Approach; TG – Touch & Go				

Table 3.4. RSRS for Similar Fighter Type Aircraft.

		Lead Aircraft		
		FS	TG	LA
Trail Aircraft	FS	3000' or 6000' behind a formation landing	3000'	3000'
	TG	6000' if Day, VFR, Dry*	3000'	3000'
	LA	3000'*	6000'	3000'

NIGHT: 6,000' is the minimum spacing for all similar night operations if ATC can safely determine distances; otherwise standard FAAO 7110.65 separation standards will apply.
*For all situations involving LA or TG behind FS, aircraft will not overfly aircraft on the runway. Responsibility for ensuring compliance rests with the pilot.
RSRS is measured between the trailing aircraft in the lead flight and the lead aircraft in the trailing flight.

Table 3.5. RSRS for Dissimilar Fighter Type Aircraft.

		Lead Aircraft		
		FS	TG	LA
Trail Aircraft	FS	6000' or 8000' behind a formation landing	6000'	6000'

	TG	6000’ if Day, VFR, Dry*	6000’	6000’
	LA	6000’*	6000’	6000’
NIGHT: 8,000’ is the minimum spacing for all dissimilar night operations if ATC can safely separate aircraft; otherwise standard FAAO 7110.65 separation standards will apply. *For all situations involving LA or TG behind FS, aircraft will not overfly aircraft on the runway. Responsibility for ensuring compliance rests with the pilot. RSRS is measured between the trailing aircraft in the lead flight and the lead aircraft in the trailing flight.				

3.5. Intersection Departures. Refer to the airfield diagram in **Attachment 2**.

3.5.1. Tower may initiate and approve intersection takeoff. Aircrews requesting intersection departures should be aware that more restrictive wake turbulence separation criteria apply.

3.5.2. Aircrews are responsible to determine that sufficient runway length is available to permit a safe takeoff and retain the prerogative to use the full runway length or select a different intersection. Aircrews will advise Tower of their intentions.

3.6. B-1 Visual Approach Procedures.

3.6.1. B-1 aircrews will enter the VFR traffic pattern via instrument approach, visual straight in, or initial to the active runway.

3.6.2. Overhead Pattern:

3.6.2.1. Aircrews will receive radar vectors to the overhead entry point (initial). Dyess Tower or ABI Approach will specify the entry point (3-5 mile initial). Within the VFR pattern, entry point will be a 3-5 NM initial while remaining within Dyess Class C surface area. Aircrews will coordinate with Tower if requesting other than a 3-5 NM entry point and/or departing Dyess Class C surface area. **Note:** Aircraft that intercept the ILS glide path prior to the final approach fix are a potential conflict with aircraft in the visual pattern proceeding to initial at 3,500' MSL. The ILS glide path crosses 3,500’ MSL at about 7 DME on the approach.

3.6.2.2. Unless otherwise directed, aircrews (single ship) will initiate their break turn NLT midfield for protection of the overhead pattern. Formations will break as appropriate for spacing or as directed by Tower.

3.6.2.3. B-1 Formations. Upon initial radio contact with Dyess Tower, B-1 formations will request direction of break. Tower will reply with "Expect left/right break." After reporting 3 mile initial, Tower should not change the direction of break, unless for safety of flight. If it is not possible to have a formation break in the expected direction, Tower should give carry-through instructions.

3.6.3. B-1 Closed:

3.6.3.1. The closed pattern is flown at 3,000’ MSL (see **Attachment 4**).

3.6.3.2. Aircrews requesting this pattern must contact Tower with “Request Left/Right Closed” and fly IAW applicable T.O. guidance for inside straight-in pattern

3.6.3.3. Daytime only: Aircrews may request closed pattern at 3,500' MSL in order to fly the overhead ground track and practice the turn to final from the perch point. The climbing turn will normally be flown with 1/2 flaps. This can be requested by stating "Request Left/Right Closed, 3,500".

3.6.4. B-1 Outside Straight-In Pattern:

3.6.4.1. The outside straight-in pattern is flown at 3,000' MSL at approximately 250-275 KIAS with a 3-5 NM final from the threshold (see **Attachment 4**).

3.6.4.2. Aircrews requesting this pattern must contact Tower for an "outside straight-in" and obtain specific approval if requesting a "no flap" pattern.

3.6.4.3. B-1 aircrews may fly either Left or Right patterns. When Marrion DZ, LZ 163/343 or LZ 164/344 is active, B-1 aircrew will be directed to fly the East pattern to the main runway, if necessary. In the event the Marrion DZ, LZ 163/343 or LZ 164/344 is active and the East pattern is unavailable, Tower will advise the aircrews to climb to 3,000' MSL before turning crosswind and maintain at or above 3,000' MSL until turning to final.

3.6.4.4. In order to remain within Dyess-controlled airspace, aircrews operating in the East outside straight-in pattern will remain west of Winters Freeway (US 83/84), unless required for safety of flight.

3.7. C-130 Normal Visual Approach Procedures.

3.7.1. C-130 aircrews should call Tower prior to reaching a 15 NM reporting point (FALCON, VOLUNTEER, LONGHORN, NITANY, or SOONER) and request entry into the VFR pattern. Entry altitude is at or above 3,500' MSL. Tower will direct C-130 aircrews to a specific 5 NM reporting point (RAZORBACK, AGGIE, HURRICANE, SEMINOLE, RATTLER). Aircraft will descend to 3,000' MSL within Dyess Class C. If not approved, or communication has not been established, C-130 aircrews will hold outside the 15 NM reporting point (Refer to **Para 7.11** for Lost Communications procedures)

3.7.1.1. Once inside 15 NM, but prior to entry into the VFR pattern, Tower may instruct C-130 aircrews to re-enter at the VFR reporting point. C-130 aircrews will fly back to the 15 NM VFR reporting point and request entry into the VFR pattern IAW **Para 4.9.1**

3.7.2. Once entry is approved, C-130 aircrews will report at the 5 NM reporting point prior to entering the VFR pattern.

3.7.3. When B-1 VFR pattern operations are in effect, Tower will only authorize C-130 aircrews to enter the VFR pattern via AGGIE or SEMINOLE for a downwind recovery.

3.7.4. C-130 Downwind Recovery. C-130 aircrews will make a 45-degree entry to the mid-field downwind as required. The downwind recovery is flown at 3,000' MSL for LZ 163/343 and 2,500' MSL for LZ 164/344.

3.7.5. C-130 Closed Pattern. The C-130 closed pattern will be flown at 3,000' MSL (2,500' MSL for LZ 164/344). Depending on runway availability, C-130 aircrews may execute closed patterns to Runway 16/34, LZ 163/343 or LZ 164/344.

3.8. C-130 Tactical Visual Approach Procedures.

3.8.1. C-130 Tactical Visual Approach Procedures will be conducted IAW Abilene ATC, *317th Airlift Wing and Dyess AFB Tower Letter of Agreement-"Tactical Approach Procedures at Dyess Air Force Base."*

3.8.2. C-130 Tactical Abeam Pattern. The C-130 tactical abeam pattern will normally be initiated from HURRICANE. Pattern entry is perpendicular to the runway/LZ to which the approach is being made. C-130 aircrews will normally enter the pattern at 500' AGL and begin maneuvering after crossing over the landing area. **Note:** The C-130 Tactical Abeam Pattern is not authorized during B-1 VFR pattern operations to avoid crossing the main runway centerline. C-130 aircrew will remain North of the tower if landing Runway 16 and South of the tower if landing Runway 34.

3.8.3. C-130 Tactical Teardrop Pattern. The C-130 tactical teardrop pattern will normally be initiated from RATTLER or RAZORBACK. Pattern entry is opposite the direction of landing traffic. C-130 aircrews will normally enter the pattern at 500' AGL with a circling maneuver begun within 1.5 NM from the approach end of the landing runway. See **Attachment 8 Figure 8.4** **Note:** The C-130 Tactical Teardrop Pattern is not authorized during B-1 VFR pattern operations to avoid opposite direction traffic conflicts.

3.8.4. C-130 Tactical Steep Pattern. The C-130 tactical steep pattern is a high overhead approach and will normally be initiated from RATTLER or RAZORBACK. Pattern entry altitude is normally no lower than 4,000' AGL with aircraft beginning descent during the first 180 degree turn to the requested runway/LZ. This approach can also be conducted for opposite direction landing. Entry altitude will be included in the request. See **Attachment 7**.

3.8.5. C-130 Tactical Straight-In Pattern. The C-130 tactical straight-in pattern will normally be initiated from RATTLER or RAZORBACK. This pattern may be done in addition to a high-speed descent at or below 12,000' MSL with coordination from ABI and Tower.

3.9. Landing Zone Procedures.

3.9.1. The 317 AW utilizes LZ 163/343 and LZ 164/344 for tactical training purposes. Non-base assigned tactically qualified aircrews may also use LZ 163/343 and LZ 164/344 after advanced coordination and briefings with the 317 OSS/OSK. The 317 OSS/OSK will also advise AM of authorized non-base assigned aircraft conducting operations to the landing zones.

3.9.1.1. The condition of the landing surface area is determined by AM. AM will accomplish subsequent checks of the LZs IAW AFI 13-204V3.

3.9.1.2. AM will perform the lighting checks of the LZs and will coordinate repairs for lighting outages/concerns with 7 CES/CEOFE.

3.9.2. LZ Tactical Landing Zone Training. Tactical landing zone training may be accomplished on LZ 163/343 or LZ 164/344 under VFR conditions. IFR departures are allowed under VFR conditions. LZ 163/343 and LZ 164/344 are useable when wet, crews will determine landing and takeoff ability during wet conditions. Nighttime aircraft operations are allowed on LZ 164/344. Nighttime operations to LZ 163/343 require a LZCO/LZSO who will mark LZ 163/343 with tactical lighting. **Note 1:** The maximum number of C-130s in the LZ patterns is four for normal training operations. For inspections,

AFGSC Aircrew Stan/Eval visits and wing/squadron exercises, the number of scheduled operations will be determined by the 317 OG/CC. These requirements will be coordinated with Tower prior to exercise initiation. **Note 2:** Over-flight of the city of Tye is authorized when tactical operations dictate.

3.9.2.1. Touch & Gos are prohibited on the LZs. VFR departures are allowed.

3.9.2.2. LZ 163/343 pattern altitude is 3,000' MSL. LZ 164/344 pattern altitude is 2,500' MSL.

3.9.2.3. LZ 163/343 weather minimums are 1,700' ceiling and 3 SM visibility. LZ 164/344 weather minimums are 1,500' ceiling and 3 SM visibility.

3.9.2.4. LZCO/LZSO Communications. Primary communications will be via Dyess Tower UHF, Tower Net or portable radio.

3.9.2.5. LZ Terms:

3.9.2.5.1. *"LZ (163/343/164/344) Open"* – This signifies the LZ is free of personnel/equipment and the surface condition is acceptable for landings. When the LZ is closed, Tower will not allow any aircraft to operate on the LZ. Tower or LZCO/LZSO or DZCO may direct the status of "LZ (163/343/164/344) Closed" at any time to perform a LZ check. If the Marrion DZ is in use, aircraft/vehicle/personnel operations will **NOT** be allowed onto the LZs and Golf Taxiway.

3.9.2.5.2. *"LZ (163/343/164/344) Your Control"* – This term is used for communications between Tower and LZCO/LZSO or DZCO. Once the LZCO/LZSO or DZCO gives control of the LZs to Tower, Tower may allow aircraft to operate/conduct approaches. This term also signifies that the LZCO/LZSO or DZCO has determined that LZs are clear of FOD and personnel/equipment is removed and the surface status condition is acceptable for operations. Prior to departing the area, the LZCO/LZSO or DZCO will notify AM of any discrepancies.

3.9.2.5.3. Terminology between ATC and Aircrew. LZ 164/344 may be referred to as "TYE LZ". LZ 163/343 may be referred to as "JACKRABBIT LZ".

3.9.2.6. Aircraft Recoveries from LZ 163/343:

3.9.2.6.1. Aircrews may make turnarounds on the surface of LZ 163/343, Taxiway Golf or Taxiway Hotel (not the Tye Ramp).

3.9.2.6.2. Aircrews are NOT required to complete a FOD check of the aircraft on Taxiways Golf or Hotel prior to crossing or proceeding on the main runway and/or LZ 163/343.

3.9.2.7. Transitioning to and from LZ 164/344:

3.9.2.7.1. When departing the main runway for entry into the LZ 164/344 traffic pattern, aircrews will climb straight ahead to 3,000' MSL if Marrion DZ, LZ 163/343, or LZ 164/344 is active. Aircrews will ensure receipt of "closed traffic" approval from Tower before turning westbound.

3.9.2.7.2. Aircrews will enter the LZ 164/344 traffic pattern from closed traffic or from a point on the downwind leg abeam the departure end of the strip. The entry leg will normally be at a 45 degree angle at an altitude of 2,500' MSL.

3.9.2.7.3. Aircrews will maintain the boundaries of the LZ airspace when operating on LZ 164/344.

3.9.2.7.4. Aircrews will control the base to final turn to avoid violating the final approach zone of LZ 163/343 and main runway.

3.9.2.7.5. Aircrews will contact Tower for approval prior to entering the 3,000' pattern for LZ 163/343 or main runway. Prior to departing LZ 164/344, the aircrews will notify Tower if the next pattern is planned to the main runway.

3.9.3. Landing Zone Responsibilities:

3.9.3.1. LZSO Responsibilities. If the LZCO/LZSO position is utilized, the LZCO/LZSO will notify AM when LZ 163/343 and/or LZ 164/344 inspection is complete, the landing zone is free of FOD/equipment and the surface conditions are suitable for landings.

3.9.3.1.1. Pass the nighttime airfield lighting check status to AM.

3.9.3.1.2. Ensure vehicles, equipment, and personnel remain at least 100' from the edge of LZ 163/343 and/or LZ 164/344 when open. Vehicles and personnel within 100' of the active LZ will contact/continue to maintain communications with Tower and/or Marrion LZCO/LZSO or DZCO via the Tower Net.

3.9.3.1.3. Notify Tower when leaving LZ 163/343 and/or LZ 164/344 to ensure the LZ has reverted back to the control of Tower.

3.9.3.2. Tower Responsibilities: Tower retains ATC responsibility for all aircraft and vehicles operating on and around LZ 163/343 and LZ 164/344. These areas are within the CMA.

3.9.3.2.1. Tower coordinates opposite direction tactical recoveries with ABI Approach, traffic permitting.

3.9.3.2.2. Tower will terminate or delay operations as necessary when deteriorating weather conditions or other circumstances jeopardize the safety of the LZ operations.

3.9.3.3. AM Responsibilities. AM will complete daily serviceability checks of all LZ lighting. AM will annotate a status check of the LZs and airfield lighting checks from the LZCO/LZSO or DZCO. AM will ensure LZ 163/343 and LZ 164/344 are free of obstructions during the initial morning airfield checks and/or airfield inspection.

3.9.3.4. FD Responsibilities. FD will provide Crash/Fire/Rescue vehicle and personnel IAW applicable directives.

3.9.3.5. CP Responsibilities. When scheduled, 317 OSS/OSK will notify Dyess CP of intended LZ operations.

3.9.3.5.1. During B-1 VFR pattern operations, the SOF may direct through the WS/SC to direct C-130s to accomplish LZ pattern operations.

3.10. Marrion Drop Zone Procedures. Coordination/de-confliction between B-1 and C-130 operations will be accomplished before/during the 7 BW Pre-165 meeting to the max extent possible. The 317 OSS/OSO will schedule all airdrops for Marrion DZ once de-conflicted and will notify AM IAW FAR Part 105 NLT 24 hours in advance of scheduled personnel and Instrument Meteorological Conditions (IMC) airdrops for NOTAM distribution. Changes to the schedule will be passed to Tower and AM immediately.

3.10.1. Communications. The primary frequency for Marrion DZCO is UHF 314.2. The primary frequency for Tower during Marrion tactical drops is UHF 257.675 with VHF backup on 133.0. Coordination will occur with the Tower via Tower Net. Commercial telephones, UHF frequency 275.8 or VHF 118.35 will be used as alternates. C-130 aircraft operating on the Marrion DZ will monitor Tower and Marrion DZCO frequencies.

3.10.2. Drop Zone Terms:

3.10.2.1. "*Marrion DZ Open*" – Term to signify that airdrops are authorized in the Marrion Drop Zone and that LZ 163/343 and LZ 164/344 and Taxiways Golf, Hotel and Juliet will be closed to other aircraft operations. The DZCO must notify Tower at least 10 minutes prior to any intended airdrop operation. Tower will ensure no other aircraft enter the lateral dimensions of the DZ which includes Taxiway Golf.

3.10.2.2. "*Airdrops in Progress*" – Term used by DZCO to inform Tower that the airdrop is underway and could impact aircraft operations on Runway 16/34. All landing surfaces (Runway 16/34, LZ 163/343 and LZ 164/344) are suspended and Taxiways Golf, Hotel and Juliet will be closed to aircraft operations.

3.10.2.3. "*Airdrops Complete*" – Term used by DZCO to inform Tower that the airdrop is complete. The DZCO will also conduct a FOD check of Taxiway Golf, if impacted. Runway 16/34 and Taxiway Golf status will revert to open unless DZCO advises otherwise.

3.10.2.4. "*Marrion DZ Closed*" – When the Marrion DZ is closed, airdrops are not allowed in the area. LZ 163/343 and LZ 164/344 will not be used until the DZCO has notified Tower that the LZs are open.

3.10.2.5. "*LZs Your Control*" – Refer to **para 3.9.2.5.3** **Note 1:** If any confusion arises on the status of the DZ or LZs between the DZCO, LZCO/LZSO and Tower, the status of the drop zone will be "closed." LZ 163/343 and LZ 164/344 will also remain closed to other aircraft operations. **Note 2:** The status of the DZ and LZs will be passed from the DZCO to Tower. **Note 3:** During personnel and equipment airdrops, C-130 aircraft tow operations to Taxiway Golf are not authorized. If a C-130 aircraft is already positioned on Taxiway Golf for maintenance, the 317 OG/CC may waive the calibration operations on Taxiway Golf to occur during the airdrops. **Note 4:** *Refer to the High Altitude Low Opening (HALO) /High Altitude High Opening (HAHO) Parachute Procedures at Dyess Air Force Base* LOA between 317 OG, 7 OG, and ABI TRACON for additional C-130 HALO/HAHO Procedures.

3.10.3. Drop Zone Responsibilities:

3.10.3.1. DZCO/DZSO Responsibilities. The DZCO/DZSO will be present for all airdrops. The DZCO/DZSO will be located in the DZ area one hour prior to the first arrival and the last to leave for all airdrop operations.

3.10.3.1.1. The DZCO/DZSO is responsible for opening/closing the drop zones and allowing aircraft to perform airdrop operations there. When a DZCO/DZSO is present at the Marrion DZ, they may also perform the duties of the LZCO/LZSO (if certified).

3.10.3.1.2. Ensure airdrop recovery vehicles, equipment and personnel remain at least 100' from edges of LZ 163/343 and LZ 164/344 when the Marrion DZ is "closed". Vehicles and personnel that must approach within 100' of LZ 163/343 and LZ 164/344 will contact Tower, DZCO/DZSO or LZCO/LZSO via the Tower Net or Marrion Tower frequencies for permission.

3.10.3.1.3. Ensure that CFR equipment and any other unauthorized vehicles are off the DZ at least 10 minutes prior to any airdrops.

3.10.3.1.4. Turn on warning lights along the perimeter road to prevent unauthorized personnel and vehicular crossing when Marrion DZ is occupied by the DZCO or LZCO/LZSO.

3.10.3.1.5. The DZCO/DZSO shall inform Tower when last jumper is on the ground.

3.10.3.2. FD Responsibilities. IAW AFI 32-2001 and Technical Implementation Guide 403, fire vehicles must be able to respond within 5 minutes to all areas in the response zone (active runways and landing zones). FD is not required to position a vehicle on the west side of the runway prior to and during LZ operations.

3.10.3.3. Aircrew Responsibilities.

3.10.3.3.1. Notify Tower of static line personnel airdrops at Marrion DZ on initial contact or at least 10 minutes prior to departing Dyess AFB. Aircrews will provide the estimated jump time and number of jumpers to Tower. Aircrews will also advise Tower if an opposite direction traffic run-in to the DZ is requested.

3.10.3.3.2. Advise Tower on initial contact prior to conducting the inbound run-in to release jumpers. Aircrews will monitor Tower UHF during the run- in to receive any necessary ATC instructions. The formation lead is responsible for obtaining and maintaining direct radio communications with the DZCO/DZSO. If radio communications between the DZCO/DZSO and the formation lead cannot be obtained or maintained, aircrews will not conduct the airdrop.

3.10.3.3.3. Execute an immediate breakout to the west when directed while on approach to the DZ and remain in formation.

3.10.3.3.4. Advise Tower when jumpers have departed the aircraft and the actual number of jumpers. Example: "*(CALL SIGN), SIX JUMPERS AWAY*."

3.10.3.3.5. Coordinate equipment drop procedures with Tower.

3.10.3.4. Tower Responsibilities. **Note:** Tower retains ATC responsibility for all aircraft operating in the Marrion DZ. Tower is responsible for

3.10.3.4.1. Ensure the DZCO/DZSO has opened the DZ prior to allowing aircraft to use the DZ. Tower will terminate or delay operations as necessary when deteriorating weather conditions or other circumstances jeopardize the safety of the DZ operations.

3.10.3.4.2. Coordinate with DZCO/DZSO and ABI TRACON prior to permitting aircraft to conduct airdrops. **Note:** The DZCO/DZSO will be in direct radio communications with the aircrew conducting the airdrop and will be providing advisories to the aircrew. Aircrews will monitor Tower frequency for control instructions.

3.10.3.4.3. Advise ABI TRACON of C-130 aircraft operations (except SKE) when aircraft are at IP North/South, if they have not already been advised.

3.10.3.5. AM Responsibilities. AM will issue a NOTAM for all drops.

3.10.3.6. Tower retains the option to discontinue a formation drop at any point up to the tactical airdrop 1 minute advisory (a point approximately 2.2 NM from the DZ point of impact). If a formation breakout is required, Tower will use the following phraseology: "*(FORMATION CALL SIGN), BREAKOUT TO THE WEST*" and provide additional instructions to facilitate traffic separation. Expect radar vectors under IFR control.

3.10.3.7. Aircrews may be directed by Tower to discontinue the run-in at any point up to the 1 minute advisory (a point approximately 2.2 NM from the DZ point of impact). **Note:** During periods of Abilene radar outages, aircrews will report to Tower at North Initial Point (IP) or South IP for clearance into the Tower airspace with the number of aircraft in formation, type of release (VIS or SKE) and recovery following drop. The North IP for Marrion DZ is a point 21.8 NM north of the DZ on DZ centerline. The South IP is a point 16.8 NM south of the DZ on the DZ centerline.

3.10.4. C-130 aircrews will fly either the Marrion DZ 153 or Marrion DZ 342 run-in. DZ operations will be in effect when C-130 aircrews are within 10 NM of Marrion DZ and are established on the run-in heading. Based on C-130 run-in airspeeds, it will take approximately 4 minutes from the 10 NM point until release.

3.10.4.1. Marrion DZ 153. The C-130 IP is designated as the ABI 326/018 at a run-in heading of 153 degrees.

3.10.4.2. Marrion DZ 342. The C-130 IP is designated as the ABI 162/019 at a run-in heading of 342 degrees.

3.11. Gonzalez Drop Zone Procedures. Gonzalez DZ will only be used during Air Shows. 317 OSS/OSO will coordinate with the AOF/CC to use the modified Marrion DZ procedures. Marrion DZ procedures will be used during Gonzalez DZ operations.

3.12. Additional VFR Flying Procedures.

3.12.1. VFR to IFR Procedures. Aircrews that request IFR handling after a VFR pattern must notify Tower at least one pattern ahead of time for coordination. Aircrews operating from LZ 163/343 and LZ 164/344 may obtain IFR clearance prior to departure.

3.12.2. VFR Departures. Aircrews departing VFR will request VFR flight following through AM in the form of a flight plan.

Chapter 4

IFR PROCEDURES

4.1. Radar Traffic Patterns. ABI Approach controls the radar traffic pattern to Dyess AFB. Radar traffic pattern is normally to the west of Dyess AFB at 4000' MSL

4.2. Availability/Restrictions for Approach Surveillance Radar (ASR) Approaches. ABI Approach controls the ASR approach into Dyess AFB. The availability of the ASR approach is based on ABI Approach's current manning.

4.3. Availability/Restrictions for Precision Approach Radar (PAR) Approaches. A PAR approach is not available at Dyess AFB.

4.4. Local Departure Procedures. Aircraft departing Dyess AFB on an IFR clearance will depart on a runway heading at 4000' (unless issued otherwise) IAW routes and altitudes as specified in the published and filed departure procedures or via radar vectors with ABI Approach.

4.4.1. IFR aircraft may request a radar-vectored departure to a high/low altitude fix. Aircrews should not file VFR to a transition fix in order to expedite departure.

4.4.2. Base-assigned C-130 aircrews are authorized to file and fly the Coleman, Nugen or Noodle departure procedures for local training purposes only

4.5. Radar Vector to Initial Procedures. ABI Approach will vector aircraft requesting radar vectors to initial no closer than 7 NM from the runway unless otherwise coordinated with Tower and will transfer radio communications before the aircraft enters Dyess' airspace.

4.6. Instrument Approaches. Instrument approaches to Runway 16/34 are published in the FLIP Terminal High and Low-Altitude Instrument Approach Procedures. IFR circling procedures are not authorized to LZs 163/343 and 164/344. Aircrew may cancel IFR and transition to the LZs under VFR. **Note 1:** Aircraft on circling approaches typically circle west of the airfield; however, ATC may permit circling to the east during IFR conditions to safely complete a full-stop landing. **Note 2:** Aircraft that intercept the ILS glide path prior to the final approach fix are a potential conflict with aircraft in the visual pattern proceeding to initial at 3,500' MSL.

4.7. No-Light Minimums. No-light minimums are published on approach plates in the FLIP. AM will issue NOTAMs when no-light minimums are in effect.

4.8. Integrated Precision Radar Approach (IPRA). 317 AW owned C-130J aircraft may fly IPRAs IAW current AFMAN 11-2C-130JV3 requirements and with a valid approach plate**.**

Chapter 5

EMERGENCY PROCEDURES

5.1. Operation of the Primary Crash Alarm System (PCAS).

5.1.1. Tower operates the PCAS. The PCAS will be tested Monday through Friday between 0730L – 0800L and if open on weekends/holidays, the PCAS will be tested within the first hour of airfield operations. All agencies shall report line clarity and operating initials. Tower maintains results of the PCAS daily check. Tower will call agencies if they are unable to answer the PCAS. Users will report malfunctions to RAWS.

5.1.2. PCAS Agencies. The following agencies have two-way communications on the PCAS: AM, FD, and 7th Medical Group [MDG – Aerospace Medicine, the Medical Information Center (MIC) and Medical Control Center (MCC)]. 7 BW MOC has receive only capabilities. The 7 OG/CC is the approval authority for requested changes to the PCAS agency list.

5.1.3. Phone Discipline. All parties remain on the PCAS line until Tower terminates the call with the words "*SECURE THE NET*". Emergency data can change frequently. This procedure prevents additional time consuming notifications.

5.1.4. Reasons for PCAS activation:

5.1.4.1. Mishap, In-Flight or Ground Emergencies (IFEs or GEs).

5.1.4.2. External Stores Jettison.

5.1.4.3. Unauthorized Landings.

5.1.4.4. Unauthorized Taxi/Movement (Anti-hijacking).

5.1.4.5. Hot Brakes.

5.1.4.6. Hung Ordinance.

5.1.4.7. Tower Evacuations.

5.1.4.8. Hangar Alarms (At FD's Request).

5.1.4.9. Base Disaster (At FD's Request).

5.1.4.10. Practice Disaster Exercise. Tower will preface and terminate all exercise messages with "*EXERCISE, EXERCISE, EXERCISE.*"

5.1.4.11. When requested by an aircraft, aircrew member, SOF, AM, Dyess CP, FD or the WS/SC. **Note:** The PCAS is not activated to relay non-emergency related data (e.g. FPCON changes, Emergency Operations Center (EOC) recalls). Agencies must utilize other available means (e.g. contact AM for SCN activation, giant voice).

5.2. Operation of the Secondary Crash Net (SCN).

5.2.1. AM is the sole activation authority of the SCN.

5.2.2. SCN Agencies. The following agencies have two-way communications with AM on the SCN: FD, 7 BW/CP, 7 BW/MOC, 317 AW/MOC, 7 MDG, 7 SFS, 7 CES/Readiness and

7 OSS/ Weather Flight. Only those agencies that require immediate response to protect/preserve life, limb, and/or property will be on the SCN. Requests for additions/deletions must be coordinated through the AFM and forwarded to the 7 OG/CC for approval/ disapproval.

5.2.3. Reasons for SCN Activation. The SCN will be activated IAW AFI 13-204V3.

5.3. Emergency Response Procedures (On/Off-Base). Aircrew, SOF or ATC may declare an aircraft emergency. The following covers responses during IFEs/GEs. **Note:** The SOF on duty may waive the need for an airfield check during an IFE and/or GE.

5.3.1. Dyess Tower Responsibilities:

5.3.1.1. Activate the PCAS and relay the following information, if available: nature of emergency, aircraft identification and type, aircrew's desires, personnel on board, distance, fuel remaining, ETA, landing runway, wind and type of explosive or hazardous cargo.

5.3.1.2. Suspend aircraft operations to Runway 16/34 (or aircraft operations to landing zones operations as applicable).

5.3.1.3. Contact FD, via Crash Net, of pertinent emergency information, including a report when the emergency becomes the next aircraft to land.

5.3.1.4. Notify Dyess CP and SOF of any potential situation that may jeopardize the safety of other aircraft as a result of an arriving emergency aircraft (time permitting).

5.3.1.5. Provide AM immediate access to the runway for after-landing FOD/safety check.

5.3.1.6. Resume aircraft operations to Runway 16/34 upon completion of the runway check/concurrence by AM.

5.3.2. AM Responsibilities:

5.3.2.1. Activate the SCN and relay information passed from the PCAS. In the event of an SCN outage, AM will contact the Dyess CP to relay emergency information.

5.3.2.2. Suspend runway operations once the aircraft has landed.

5.3.2.3. Position the AM vehicle at the approach end of the runway in use and request Tower approval for runway access after emergency aircraft arrives.

5.3.2.4. Resume runway operations upon completion of runway check if conditions are safe.

5.3.3. Incident Commander (IC) Responsibilities: Act as the first official in response to any on or off base aircraft emergencies. If recovery operations (i.e., towing) are required, the crash recovery supervisor will be in charge of the ground operations. **Note:** The IC is usually the Senior Fire Official (SFO) responsible for the ground response to an aircraft emergency until the emergency is terminated, or it is safe for the crash recovery crew to take charge of the aircraft. The IC directs the EOC to support the Installation Control Center (ICC).

5.4. External Stores Jettison Area Procedures. These procedures apply to all aircraft in the vicinity of Dyess AFB or in contact with Tower, which have declared an emergency and have a

jettison requirement. Aircrew will jettison IAW procedures outlined in the Flight Manual or 11N series technical orders for the type aircraft and stores involved.

5.4.1. Designation of Jettison Area. Marrion DZ on the extreme west side of Dyess AFB is designated as the primary jettison area. All stores and equipment, internal and external, will be jettisoned over this area.

5.4.2. Prior to jettison, the aircrew will inform Tower of the type of stores to be jettisoned.

5.4.3. Tower will relay jettison information via the PCAS.

5.4.4. AM will pass jettison information over the SCN and notify the following: AFM, 7 BW/SEW, Marrion Tower, Defense Reutilization Marketing Office (if stores other than munitions are to be jettisoned) and 7 SFS Law Enforcement (LE) Desk (when jettison becomes certain).

5.4.5. VFR Jettison Procedures (Day or Night).

5.4.5.1. Tower Responsibilities:

5.4.5.1.1. Make a visual check of the jettison area and NAVAID sites, for any personnel, vehicle or equipment. If any are sighted, attempt to delay the jettison and take action to have the area evacuated by advising Marrion CCT or AM.

5.4.5.1.2. Advise all aircraft in the local area to remain clear of the traffic pattern until advised.

5.4.5.1.3. Determine if the aircrew intends to request radar vectors to the drop point. If so, instruct aircrew to contact ABI Approach. ABI Approach will vector VFR aircraft IAW FAAO JO 7110.65.

5.4.5.1.4. Describe the jettison area to the aircrew as a 175 degree magnetic course from the north overrun of Runway 16/34 at a minimum altitude of 3,000' MSL. Jettison will be made abeam Taxiway Charlie in order for stores to land in jettison area.

5.4.5.1.5. If the stores are not jettisoned on the first pass, instruct the aircrew to proceed on a 160 degree heading for at least 4 NM. The aircrew may then maneuver for another jettison attempt, exercising caution to avoid over flying populated areas.

5.4.6. IFR Jettison Procedures (Day or Night).

5.4.6.1. Tower Responsibilities:

5.4.6.1.1. Make a visual check of jettison area and NAVAID sites for any personnel, vehicle or equipment. If any are sighted, attempt to delay the jettison and take action to have the area evacuated by advising Marrion Tower or AM.

5.4.6.1.2. Coordinate approach and jettison with ABI Approach for radar-assisted jettison.

5.4.6.1.3. Additional Procedures for Radar Outage. If requested, ATC will describe the jettison area to the aircrew as "*track outbound from the ABI VORTAC on the 166 DEGREE radial at a minimum altitude of 3,000' MSL and jettison at 4 NAUTICAL miles from the ABI VORTAC*." Aircraft will track outbound on the 166 degree radial

and climb to 4,000' MSL, and then contact the ABI Approach for further instructions. **Note:** To prevent confusion, Tower will stress the use of the ABI VORTAC and not the DYS TACAN.

5.4.6.1.4. The aircrew will keep Tower informed of position and jettison status until ABI Approach assumes control.

5.4.7. Other Jettison Procedures.

5.4.7.1. Crash Fire Response (CFR) personnel and equipment will establish positions from where they can proceed to the impact point with minimum delay when jettisoned stores are of an explosive or flammable nature. These positions will not be closer to the Marrion DZ than the western edge of the parking ramp, but not including Taxilane Alpha.

5.5. Fuel Dumping. If emergency fuel dumping is required, the aircrew will inform Dyess CP and the ATC controlling agency of position, time, altitude, heading, and amount of fuel to be dumped.

5.5.1. The emergency fuel dump area is located between 30 thru 80 DME while established on the ABI VORTAC 220 degree radial. Altitudes are from 10,000' MSL to FL200.

5.5.2. Aircrew retain the prerogative to dump fuel elsewhere in cases where expeditious action is required in the interest of safety.

5.6. Emergency Arresting/Barrier Gear Procedures. Dyess AFB does not have arresting gear/barriers.

5.7. Hot Brake Area and Procedures.

5.7.1. Tower will direct landing aircraft with suspected or actual hot brakes to the "HOT BRAKE" area, the hammerhead taxiways at the end of the landing runway.

5.7.2. Aircraft with hot brakes anywhere on the airfield other than the runway will immediately notify Ground and hold their position. Aircraft will not taxi past or near aircraft with hot brakes.

5.7.3. The alternative "HOT BRAKE" area for LZ 163/343 and LZ 164/344 are Taxiways Juliet and Hotel.

5.8. Abandonment of Aircraft. The PCAS will be activated for an aircraft bail-out/crash.

5.8.1. Controlled Bailout. When an aircraft is preparing to crash off/on base, Tower will obtain position/heading from ABI Approach. If aircrew determines an abandonment of aircraft is necessary, controllers will describe the bailout area as "*165 DEGREE MAGNETIC COURSE FROM THE ABILENE VORTAC*." Aircrew will accomplish a controlled bailout over the north end of Runway 16/34.

5.8.2. Ejection. Aircrew will determine the need to eject from their aircraft.

5.8.3. Plotting Aircraft Coordinates. After receiving the location of the abandoned aircraft from FD or other designated agency (e.g., Dyess CP) Tower will plot and broadcast aircraft coordinates over the PCAS and AM will ring out SCN with that information.

5.9. Personnel/Crash Locator Beacon Signal/Emergency Locator Transmitters (ELTs).

5.9.1. ELT tests may be conducted during the first 5 minutes of the hour for three sweeps. If Tower detects continuous ELT signals outside of the 5 minute window, Tower will notify AM and Fort Worth ARTCC. AM will notify Dyess CP.

5.9.2. AM will advise TA if transient aircraft are on the ramp to check for an ELT. In the absence of TA services, AM will contact transient aircrew to conduct a check of their aircraft. AM will then notify Tower whether or not the source has been found.

5.9.3. Dyess CP will contact the 7 BW MOC and 317 AW MOC to check for a possible source in an aircraft or other areas. Dyess CP will then contact AM whether or not the source is found.

5.9.4. Tower will not activate the PCAS unless the ELT resulted from an aircraft mishap in the local area or aircrew ejecting from an aircraft in the local area.

5.10. Hung Ordinance Procedures. Hung ordnance is any failed attempt to fire or release ordnance, or any known or suspected gun malfunction. The PCAS will be activated for hung ordnance/hot guns.

5.10.1. Aircraft with hung ordinance (including forward firing) can expect radar vectors away from heavily populated areas and will avoid over-flying populated areas. If radar vectors are not available, aircraft can expect alternate instructions or clearance. Aircraft will conduct a straight-in full stop landing. **Note:** Aircraft will not fly VFR patterns with hung ordnance.

5.10.2. Tower will direct all aircraft with hung ordnance/hot guns to hold at the arm/dearm areas at Taxiways Bravo or Foxtrot facing approximately 230 degrees Southwest, until stores can be assured of being in a safe condition (Ref **Attachment 2**).

5.10.3. If stores are determined to be in an unsafe condition, aircraft will have its parking brakes set, aircraft shutdown, and evacuated until Explosive Ordinance Disposal (EOD) can render the munitions safe. Only EOD, not the Weapons Loaders, can declare the munitions safe.

5.11. Wind Limitations on Control Tower. The 7 OG/CC determines the continued need for ATC services when winds reach 55 knots. When the wind velocity exceeds 65 knots (75 mph), Tower will be evacuated.

5.12. Evacuation of ATC Facility.

5.12.1. The WS/SC will direct evacuation of Tower when:

5.12.1.1. A tornado is within 10 miles and moving toward the base.

5.12.1.2. Wind speeds exceed 65 knots (75 mph).

5.12.1.3. Any natural or manmade disaster or equipment failure renders the Tower unusable.

5.12.1.4. Any other condition that could endanger personnel (bomb threat, fires, etc.).

5.12.2. In the event of actual or simulated tower evacuation, Tower will:

5.12.2.1. Activate the PCAS, advise agencies that the tower is being evacuated and state the reason. AM will activate the SCN.

5.12.2.2. Notify ABI Approach of facility evacuation.

5.12.2.3. Broadcast twice on all frequencies that the tower is being evacuated.

5.12.2.4. Direct airborne aircraft to contact ABI Approach.

5.12.2.5. Direct taxiing aircraft to hold their position and contact Dyess CP to advise of intentions and receive instructions.

5.12.2.6. Advise AM to NOTAM the airfield closed until Tower services are resumed.

5.12.2.7. Broadcast an advisory on the ATIS, time permitting.

5.12.3. Time permitting, Tower personnel will evacuate to 317 AW auditorium (Bldg 4216), unless otherwise directed. If time does not permit, personnel will proceed to the 4th floor or ground floor of the tower. The 317 AW shall provide the cipher lock code for Bldg 4216 to the Tower CCTLR upon request.

5.12.4. When Tower has been evacuated, runway operations are suspended. Routine engine ground operation and towing operations will cease.

5.12.5. Tower Re-Opening Procedures. WS/SCs will make a determination when to resume operations in the Tower after coordination with appropriate agencies

5.12.5.1. AM shall activate SCN to announce Tower's relocation back to Tower.

5.12.5.2. Tower will call CES/UCC at 696-4154 to inspect the Tower for possible structural damage following severe weather/high wind evacuation or as required.

5.13. Evacuation of AM Facility. Evacuation will be accomplished when notified to evacuate the building or conditions dictate an evacuation (fire, bomb threat, or toxic corridor). In the event of an evacuation AM will:

5.13.1. Notify Tower (Hotline, DSN 461-3713, or DSN 461-1400).

5.13.2. Activate the SCN and disseminate: "*AM and Weather personnel are evacuating. AM will be on the Tower Net until set up at the alternate location*."

5.13.3. Notify Fort Worth ARTCC, time permitting.

5.13.4. Notify building personnel to evacuate the building.

5.14. Other Emergency Procedures.

5.14.1. Simulated Flame-outs (SFOs)/Precautionary Approaches. SFOs operations and precautionary approaches are not authorized for Dyess AFB base assigned aircraft.

5.14.2. Dangerous/Hazardous Cargo. When aircraft carrying hazardous cargo declare an emergency, Tower will relay all known hazardous cargo information from the aircrews to AM. Tower will direct landing aircraft to the hammerhead taxiways at the end of the landing runway. The IC will determine further movement of the aircraft.

5.15. Alternate ATC Facility Procedures. Dyess AFB has no alternate ATC facility.

5.16. Alternate AM Facility Procedures. The alternate AM facility is the ATC Tower, Bldg 4300. **Note:** The Weather Flight will also be relocating to the same location as AM personnel.

5.16.1. Upon relocating, AM will provide the new AM contact information/location to Tower, the agencies on the SCN activation log and Fort Worth ARTCC.

5.16.2. AM Responsibilities:

5.16.2.1. Monitor the Ramp Net.

5.16.2.2. When cleared to return to primary facility, have Dyess CP ring the SCN and relay that AM is returning to primary facility Bldg. 9001.

5.16.2.3. Ring out the SCN upon arrival into Bldg 9001 and advise that AM has returned to normal operations. Contact Tower, Ft. Worth ARTCC and any other agencies that apply to advise of normal operations.

5.17. Dedicated Emergency Frequency. The dedicated emergency frequency is UHF 339.7. The guidance for the dedicated emergency frequency is listed in the *7th Operations Group, 317th Airlift Wing, and 7th Mission Support Group Discrete Aircraft Emergency Frequency Procedures LOA*.

5.18. Visual Check of Landing Gear. In the event an aircraft experiences a landing gear malfunction of any type, a tower flyby may be executed, weather permitting, to allow observation of the aircraft. The SOF or an instructor pilot qualified in the type aircraft experiencing difficulty may be dispatched to Tower. The Tower controller will transmit any information the SOF or instructor pilot desires and will identify the source.

5.18.1. The flyby will normally be made at 300' AGL (2,100' MSL) and midway between the main ramp and the runway in the direction of normal traffic.

5.18.2. After determination has been made, tower controllers will transmit to the aircraft, the apparent status of the landing gear.

5.19. Overdue or Missing Aircraft. An aircraft is overdue when it has failed to arrive within 30 minutes of ETA and communications cannot be established or location of the aircraft cannot be determined after an extended search.

5.19.1. For overdue aircraft, AM will request assistance in locating a missing aircraft from Tower, ABI Approach, Fort Worth ARTCC, Dyess CP, TA, aircraft flying squadron (if known), and transmit a message over the Aeronautical Information System Replacement (AISR). Agencies will notify AM whether the aircraft has been located or not.

5.19.2. If AM is unable to locate the missing aircraft, they will initiate an extended search by requesting assistance from Fort Worth Flight Service Station (FSS) and AF Rescue Coordination Center**.**

5.20. Aborted Takeoff Procedures. Aircrews will state intentions to Tower in the event of aborted takeoff as soon as practical advising reason for abort and request assistance as necessary. Aircrews will clear the runway at the first available, suitable taxiway, T.O. procedures permitting. Aircrew will coordinate with the SOF for further actions.

5.21. Jettison of Drag Chutes. Aircrew will state intentions to Tower prior to the jettison of drag chutes, time permitting. Tower will advise the aircrew that chute-packing capabilities are

not available. Tower will contact AM to coordinate the retrieval of the drag chute. When TA is unavailable, AM will notify 7 BW/MOC (461-1959) to retrieve the drag chute. Approach and drag chutes used for landing will be jettisoned on Taxiways Bravo or Foxtrot, as appropriate.

5.22. Anti-hijack/Unauthorized Aircraft Movement. Tower will activate the PCAS and relay all available information in the event of an unscheduled aircraft engine start that cannot be verified, an aircraft taxiing without prior permission, or notification that a hijacked aircraft has or is expected to land at Dyess AFB. Aircraft anti-theft/anti-hijacking is covered in detail in the 7th Bomb Wing OPLAN 510-11, *Preventing and Resisting Aircraft Piracy (Hijacking)*

Chapter 6

ADDITIONAL FLYING PROCEDURES

6.1. Altitude Restricted Low Approach. Tower may clear an aircraft for a restricted low approach over personnel or over a preceding landing or taxiing aircraft. Tower will not clear an aircraft for an altitude restricted low approach over aircraft in takeoff position. Tower will inform personnel on runway/overrun of the restricted low approach aircraft and altitude, time permitting. Tower will also follow procedures in AFI 13-204V3.

6.2. Station Keeping Equipment (SKE). The procedures for SKE run-ins are found in the *Abilene Air Traffic Control Tower, 317th Airlift Group and Dyess AFB LOA*.

6.3. Aerial Displays. ATC will not approve unscheduled aerial displays, nonstandard approaches, paradrops, or any other non-standard operation. Requests for such maneuvers will be referred to 7 OG/CC via the AOF/CC, 7 OG/OGV or 317 AW/OGV.

6.3.1. Fly-bys. Scheduled fly-by operations supporting base ceremonies must be authorized by the 7 BW/CC. Coordination will be accomplished with the AOF/CC at least 24 hours in advance.

6.3.2. Except as listed in 8.21.1.2., under no conditions shall non-ATC agencies be authorized to broadcast on ATC frequencies.

6.3.3. High-Speed Passes. High-speed passes along Runway 16/34 are authorized IAW the Certificate of Waiver of Authorization issued by the FAA. Aircrew will operate aircraft strictly within the special provisions outlined in the issued certificate by the FAA.

6.3.3.1. Tower retains the authority to disapprove the high-speed pass at any time based upon traffic conditions or flight safety. Tower will not approve high-speed passes when the reported visibility at Dyess AFB is less than 5 SMs.

6.3.3.2. High-speed passes are not afforded any special handling/priority unless associated with an approved function. The SOF will be responsible to prioritize aircraft conducting high-speed passes based on safe pattern activity.

6.3.3.3. The SOF will be present in Tower prior to any high-speed pass being approved. The SOF will also ensure all participants are thoroughly briefed on special rules and manner/order of events prior to the high-speed pass.

6.4. Chaff and Flares. Aircrews returning from missions expending chaff and flare will set all dispenser systems to a SAFE/standby setting prior to entering the traffic pattern. Chaff and flares may be loaded or downloaded anywhere on the airfield except inside hangars or nose docks.

6.5. Combat Off-load/On-load. The primary combat off-load/on-load area is located on Taxiway Hotel adjacent to the Tye Ramp. The secondary location is on the TA ramp adjacent to Taxilane Alpha and south of Rebound Echo/TA's parking rows. Aircrew must contact AM 24 hours prior to mission execution if requiring the Transient Ramp. AM will coordinate with TA to de-conflict operations. **Note:** The Transient Ramp cannot be used for convenience. Aircrews will contact Ground for approval of combat off-load/on-load operations. Ground will alert AM for coordination with TA and for a visual sweep of the ramp. Aircrew will exercise extreme vigilance when conducting combat off-loads/on-loads and will ensure cargo is not left on the

ramp or taxiway for an extended period of time (longer than 20 minutes). Aircrews will notify Ground at the completion of the operations, for relay to AM.

6.6. Engine Running Crew Change (ERCC). ERCCs may be accomplished at Rebound Echo (northwest corner of the transient ramp), Taxiways Bravo, Charlie or Foxtrot, the B-1 parking ramp, or Spots 3 or 4 on all rows of the C-130 parking ramp. The SOF will determine and select the location to conduct an ERCC with coordination from the WS/SC. Aircrews will be issued instructions from the Ground on where to park for the ERCC. On coming and off going crews will act as safety observers. ATC will notify AM of crews completing an ERCC on the northwest corner of the transient ramp to ensure there is no conflict with transient aircraft.

6.6.1. Rebound Echo ERCC. Aircrews will park the aircraft facing south on Rebound Echo and not block the taxi route on Taxilane Alpha. Minimum power settings will be used on the transient parking ramp.

Chapter 7

FLIGHT PLANNING PROCEDURES

7.1. Flight Planning. All aircraft departing Dyess AFB must file a flight plan. Base-assigned aircrew shall not depart until a flight plan is e-filed with local flying squadrons to include local training flights. Dyess AFB assigned aircraft maintain a LOA with AM for flight planning procedures. All aircrew and flying unit operations desks will ensure flight plans are filed IAW General Planning, the flight planning LOA and AFI 13-204V3.

7.1.1. Original flight plans will not be accepted telephonically or over radio.

7.1.2. Tower is responsible for producing and reporting traffic count data as required.

7.1.3. Transient Aircrews. Flights originating at Dyess AFB with a local or CONUS route will use DD Form 175, *Military Flight Plan.* Military international flights will use DD Form 1801, *DoD International Flight Plan*. DD Form 175s will be submitted at least 1 hour prior to departure time. DD Form 1801s will be submitted at least 2 hours prior to departure time. When possible, DD Form 1801s will be submitted 24 hours in advance to ensure any problems are resolved in a timely manner. Flight plans will include an authorized signature in the approving authority block. Incomplete flight plans will not be processed until all required information is provided. IFR flight plans will be automatically closed upon landing. Transient aircraft not participating in Dyess AFB exercises must file flight plans in person with AM.

Chapter 8

MISCELLANEOUS PROCEDURES / PROGRAMS

8.1. Airfield Operations Board (AOB). The AOB provides a forum for discussing, updating and tracking various activities associated with support of the flying mission. The AOB will convene quarterly. The AOF/CC is the focal point for scheduling the AOB, preparing the agenda and recording the meeting minutes. The AOF/CC will distribute the agenda to board membership prior to the scheduled meeting so attendees have time to prepare their particular discussion items. The AOF/CC will disseminate AOB minutes, within 20 workdays from the time the AOB convenes, to all board members and the commander of the represented base agencies, to command level, MAJCOM and the Air Force Representative (AFREP) of the servicing FAA region. Note: The 7th Bomb Wing Vice Wing Commander (7 BW/CV) chairs the AOB. The AOB chairman responsibility can be delegated no lower than the 7th Operations Group Commander (7 OG/CC). The Board Membership will include personnel from the following units: 7 OG/CC, 317 AW/CC, 7 MSG/CC, 489 BG/CC, 9 BS/CC, 28 BS/CC, 39 AS/CC, 40 AS/CC, 77 WPS/CC, 337 TES/CC, 345 BS/CC, 7 BW/CP, 7 BW/PA, 7 BW/SE, 317 AW/SE, 317 AW/OGV, 7 OG/OGV, 7 CONS, 7 SFS, 7 AMXS, 317 AMXS, 317 OSS/OSO, 7 OSS/CC, 317 OSS/CC, 7 OSS/OSA, 7 OSS/OSAA, 7 OSS/OSAT, 7 OSS/OSAM, 7 OSS/OSR, 7 OSS/OSW (Weather Flight), 7 CES/CC, 7 CES/CEAO, 7 CES/CEPT, 7 CES/CEF and Abilene TRACON Manager.

8.2. NOTAM Procedures. Tower is the primary NOTAM monitoring facility. AM is the secondary monitoring facility. AM is responsible for disseminating all NOTAM information. HQ ACC/A3AO is the Series V NOTAM authority and issues NOTAMS that affect instrument procedures at Dyess.

8.2.1. Agencies responsible for maintenance or construction near airfield pavements, lighting, or NAVAIDs shall coordinate such activities with the AFM who will inform AM to disseminate NOTAMs.

8.2.2. Tower shall report all NAVAID malfunctions, outages and restorations to AM, RAWS and ABI Approach. **Note:** Dyess AFB NOTAM procedures supplement AFI (I) 11-208_IP and the Department of Defense NOTAM System.

8.3. Flight Information Publication (FLIP) Accounts, Procedures for Requesting Changes.

8.3.1. The Primary or Alternate AM FLIP Monitors are responsible for the ordering or requisitioning of FLIP for base assigned units not having their own National Geospatial Agency (NGA) account.

8.3.2. Each agency/unit that is a subaccount holder requiring FLIP will submit their requirements in writing to AM. Any unit that exceeds the DOD FLIP Basis of Distribution as outlined in the NGA Catalog of Maps, Charts and Related Products, Section 4, must justify all excess IAW NGA Catalog. FLIP Sub-account Holders are required to revalidate their requirements annually.

8.3.3. FLIP Web Pages: Foreign Clearance Guide **www.fcg.pentagon.mil**; NGA **http://www.nima.mil/portal/site/nga01/** and FAA Advisory Circulars **http://www.faa.gov**.

8.3.4. AM FLIP Monitor will contact agencies on the distribution listing when pubs are ready for pickup and annotate date and time contacted. The preferred method is through email. Publications not picked up seven days after the second notification shall go back to stock.

8.3.5. AM FLIP Monitor prepares and coordinates non-procedural FLIP changes with appropriate local agencies before submitting IAW General Planning, **Chapter 11**. The AFM approves non-procedural FLIP change requests. AM initiates NOTAM action for non-procedural FLIP changes, as necessary.

8.3.6. The NAMO ensures currency of airfield restriction data when published in the AFGSC Airfield Suitability Restrictions Report (ASRR) and coordinates changes when required with HQ AFGSC/A3AS. Any ASRR restrictions will be sent to 7 OG/OGV and 317 OG/OGV for review by the NAMO or AFM prior to submitting to HQ AFGSC/A3AS.

8.4. Prior Permission Requested (PPR) Procedures. PPR numbers are issued to transient aircrews requesting to transition Dyess AFB. PPR numbers are not to be given out earlier than 7 days prior to the proposed date, or later than 24 hours prior to the proposed date. PPR numbers are valid +/- 30 minutes of proposed arrival times. Aircraft that arrive +/- 30 minutes outside of the arrival time without coordinating a PPR change with AM are considered cancelled.

8.4.1. AM is responsible for contacting TA to verify parking and TA's services (when an aircrew contacts AM during duty hours requesting a PPR number). PPR numbers consist of the date, chronological number and the issuer's initials, ex: 12-01-ST, 15-04-MP. AM will complete appropriate checklist on all transient aircraft requiring support from base agencies. AM will also coordinate transportation for transient aircrew when requested.

8.4.2. If an aircrew cancels their flight, AM will contact TA and any other involved agencies. **Note:** Aircrews violating an airfield restriction (PPR/Official Business Only (OBO)/Quiet Hours) shall complete a PPR Violation form. OBO indicates the airfield is closed to all transient military aircraft for obtaining routine services such as fueling, passenger drop off or pickup, practice approaches, parking, etc., unless specified in the NOTAM. For further guidance on PPR and OBO, please refer to IFR Supplement.

8.5. MEDEVAC Notification and Response Procedures. AM is designated the only base agency for coordinating of military air evacuation or civilian air ambulance flights.

8.5.1. Tower will advise AM of arriving MEDEVAC aircraft and relay information requested by pilot. Tower will advise AM, via landline to pass load messages.

8.5.2. AM will notify FD and 7 MDG of the following for inbound MEDEVAC flights: type aircraft, total number of personnel on board, and status of patients (numbers of ambulatory/litter).

8.5.3. Tower will advise AM of all inbound MEDEVACs NLT 10 NM from the runway. AM will notify FD immediately thereafter.

8.6. Unscheduled Aircraft Arrivals. Military/DoD contract aircraft arrivals not prior-coordinated with AM are considered "unscheduled."

8.6.1. Tower will relay information regarding unscheduled aircraft arrivals to AM as soon as possible after notification of the inbound aircraft.

8.6.2. Tower will pass the following information to AM: (1) Aircraft's Departure Station, (2) Aircraft Call Sign, (3) Type Aircraft and (4) Pilot's Intentions. AM will document the arrival on the PPR violation form.

8.7. Distinguished Visitor Notification Procedures. DV aircraft will be afforded priority as much as possible during aircraft arrival/departure.

8.7.1. IAW AFI 13-204V3, Tower notifies AM only once about the location of the DV arrivals. Specifically, Tower will make a "15 miles to fly" notification call to AM. This duty is secondary to providing ATC services.

8.7.2. Transient aircraft information is located on the AM SharePoint page. DV arrival/departure information is located on the Prior Permission Required Log located at **https://usaf.dps.mil/teams/DyessAFB/7bw/ops_grp/7oss/OSA/OSAA/SitePages/Home.aspx**.

8.8. Dangerous/Hazardous Cargo . Aircrew requesting to land at Dyess AFB with hazardous cargo will provide AM with the HC/D, Net Explosive Weight and other aircraft information. AM will review the approved Explosive Site Plans provided by 7 BW/SEW (Weapons). FD and 7 BW/SEW will be notified on HC/D 1.3 or 1.4 explosives not covered under AFJI 11-204, *Operational Procedures for Aircraft Carrying Hazardous Materials.*

8.9. Night Vision Device/Night Vision Goggle Operations. Lights out operations are conducted at Dyess AFB. These operations are de-conflicted at the 7 BW Pre-165 scheduling meeting. Minimums for these operations are published in the FLIPs. A NOTAM will be sent when these operations are in effect.

8.10. Local Aircraft Priorities. ATC services will be prioritized accordingly. Priorities listed in FAAO JO 7110.65 and AFJI 11-204 supersede local aircraft priorities.

8.10.1. Dyess AFB Local Priorities:

8.10.1.1. Emergency Aircraft.

8.10.1.2. STRATCOM Missions (TACAMO, GIANT SHOT, etc.).

8.10.1.3. HHQ Directed Missions with Controlled Departure Times (CDTs).

8.10.1.4. DV Aircraft Arrivals/Departures.

8.10.1.5. C-130 on Drop Zone Actual Release in Direction of Traffic Flow.

8.10.1.6. Training Aircraft with CDTs.

8.10.1.7. Normal Aircraft Departures.

8.10.1.8. Practice Approaches by Dyess-Assigned Aircraft.

8.10.1.8.1. B-1 IFR Arrivals.

8.10.1.8.2. B-1 VFR Pattern Approaches.

8.10.1.8.3. C-130 IFR Arrivals.

8.10.1.8.4. C-130 VFR Pattern Approaches.

8.10.1.8.5. After coordination with the WS/SC, the SOF may modify priorities in **paragraph 8.10.1** based on B-1 and C-130 training requirements. Local B-1 aircrews will check-in with the SOF on UHF 261.0.

8.10.1.9. Transient Practice Approaches. **Note:** Flight check aircraft is provided special handling in order to expedite the inspection of NAVAIDs. Tower will clear the flight check aircraft according to the aircrews' request as soon as practical. Tower will not ask the flight check aircrew to deviate from their planned action except to preclude an emergency situation.

8.11. Lost Communications Procedures. These procedures will be utilized to alert Tower and complete a landing at Dyess when primary radio communications are lost. At this point, the aircraft will be considered No Radio (NORDO).

8.11.1. Aircrew will make every effort to contact Tower or ABI Approach through use of secondary radios and squawk 7600/7700 as appropriate. VOR receivers will be tuned to emergency frequency 121.5 for receipt of instructions unless needed for navigation purposes. If communications cannot be established with any ATC agency and landing must be accomplished, the following procedures will apply:

8.11.2. IFR. Aircrew will follow "Two Way Radio Failure Procedures" outlined in the FLIPs.

8.11.3. VFR. Aircrew will overfly the airfield no less than 4,500' MSL to determine the landing direction by observing other aircraft departures/landings or one of the airfield wind socks.

8.11.3.1. Aircrew will enter and fly a normal traffic pattern up to final approach. After completing the final approach turn, fly a course parallel to the runway at a minimum altitude of 3,000' MSL.

8.11.3.2. Aircrew will rock the aircraft wings at approximately 1 NM prior to reaching a point abeam the tower. Aircrew will continue to rock the aircraft wings until Tower acknowledges the loss of communications via light gun signals. Aircraft landing lights should be flashed to alert Tower at night.

8.11.3.3. Tower will transmit landing instructions utilizing emergency frequencies in addition to transmitting on standard tower frequencies. Tower will utilize light gun signals to the aircraft to issue proper landing instructions.

Table 8.1. AFVA 13-221 Control Tower Light Gun Signals.

COLOR AND TYPE OF SIGNAL	MEANING
STEADY GREEN	CLEARED TO LAND CLEARED FOR TAKEOFF
FLASHING GREEN	RETURN FOR LANDING CLEARED TO TAXI
STEADY RED	GIVE WAY TO AIRCRAFT STOP

FLASHING RED	AIRPORT UNSAFE CLEAR RUNWAY
FLASHING WHITE	RETURN TO STARTING POINT ON AIRPORT
ALTERNATING RED AND GREEN	GENERAL WARNING SIGNAL EXERCISE EXTREME CAUTION

8.12. Standard Climb-Out Instructions. Standard climb out procedures for aircraft departing Dyess AFB is fly runway heading and maintain 4000' MSL.

8.13. Opposite Direction Take-Offs and Landings. All opposite direction arrivals including practice approaches/departures will be coordinated between Tower and ABI Approach. Except for emergency/precautionary and/or flight inspection aircraft, first priority will be given to traffic approaching the primary runway.

8.13.1. When aircraft request opposite direction operations, Tower will consider other traffic in the pattern and coordinate with the ABI Approach prior to approval.

8.13.2. When an aircraft on an opposite direction approach has completed the approach, the published missed approach shall be executed unless clearance for a landing has been approved or other instructions have been given by Tower or ABI Approach.

8.13.3. Opposite direction traffic shall be controlled IAW Letter of Agreement, *Control, Coordination, and Separation Procedures*, between ABI Approach and Dyess AFB Tower.

8.13.3.1. Arrival Versus Arrival. Tower shall not allow an opposite direction arrival to cross the landing threshold or an aircraft in the VFR pattern to turn on final when an IFR arrival is within 10 NM of the active runway

8.13.3.2. Departure Versus Arrival. All opposite direction departures shall be coordinated with ABI Approach prior to the aircraft taxiing to the runway to be used. IFR/VFR departures will not be released when an opposite direction approach is within 10 NM from runway.

8.13.4. The WS/SC may offer approaches to the inactive runway if weather conditions permit its use or upon aircrew request, as long as traffic to the active runway is not disrupted. **Note:** Examples of conditions: tailwinds less than 5 knots, runway in use is below published minimums, NAVAID outage, variable wind conditions, etc.

8.13.5. Arrivals Versus Departures/Low Approach/Touch-and-Go. An opposite direction IFR arrival will not be permitted within 10 NM of the runway until the IFR departure, low approach, or touch-and-go has departed/turned and is no longer a factor. **Note:** Simultaneous VFR operations at the LZs are authorized IAW FAAO JO 7110.65 whenever the opposite direction traffic is conducting VFR operations to the main runway, or visual separation is provided by Tower. Aircraft operating under these conditions must remain at least 1,400' from the other runway's extended centerline. These operations are not authorized at night.

8.14. *Break-out/Go-Around/Missed Approach/Carry Straight Through Procedures.*

8.14.1. Breakouts. Breakouts may be initiated for an IFR aircraft located 5 NM or more from the runway. In the event of a breakout, the aircraft shall not be allowed to continue an

approach. ATC may issue *"FLY RUNWAY HEADING, CLIMB AND MAINTAIN 4,000 FEET"* as breakout instructions to aircraft; however, ATC will not use the term "breakout" in their radio transmissions. Tower or ABI Approach may initiate breakout procedures at any time.

8.14.2. Go Arounds. A go-around is normally initiated for aircraft inside of 5 NM from the runway. Tower initiates a go-around whenever an aircraft cannot be permitted to continue an approach to the landing threshold. In the event of a go-around, the aircraft may be issued alternate climb-out instructions.

8.14.3. Missed Approach. If aircraft is operating under IFR or is unable to maintain VFR, the aircraft will execute a missed approach and return to ABI Approach.

8.14.4. Carry Straight Through. When on initial, aircraft directed to *"CARRY STRAIGHT THROUGH"* will not initiate a break turn and will coordinate with Tower for further requests.

8.15. Civil Aircraft Operations/Authorized Landings. Civil aircraft operations at Dyess AFB will be conducted IAW AFI 10-1001, *Civil Aircraft Landing Permit*s. The 7 BW/CC has delegated the authority for the processing and approving of landing permits to the AFM and DAFM (or their designated AM representative). For events other than the Dyess Open House, the AFM and DAFM will up-channel the status of pending landing permits to the AOF/CC. The AOF/CC will notify the 7 OSS/CC.

8.16. Civil Use of Military ATCALS. Civil aircraft are authorized to make practice instrument approaches at Dyess AFB. Civil aircraft conducting practice approaches are not authorized to land at Dyess (this includes stop-and-goes/touch-and-goes). Civil aircraft practice approaches are restricted to periods of light traffic as determined by the WS/SC. Tower may terminate practice approaches at any time.

8.17. Aero Club Operations. Dyess AFB does not have aero club operations.

8.18. Weather Dissemination and Coordination Procedures. Tower will issue weather information (to include hazardous and severe weather) to aircrew via the ATIS and to airfield drivers via the RAMP NET. The SOF or the Dyess CP will advise Tower when either a weather or operational recall of airborne aircraft due to weather or other concerns is required. Refer to DYESSAFBI 15-101, *Weather Support Procedures*.

8.19. Bird/Wildlife Control. Refer to DYESSAFB OPLAN 91-212 for local Bird/Aircraft Strike Hazard (BASH) program guidelines.

8.20. Bird Watch Conditions (BWCs). The SOF is responsible for raising and lowering the BWC while on duty. IAW DAFB OPLAN 91-212 Annex C para 3.1 AM has the authority to declare BWC while the SOF is not on duty. Due to the SOF no longer working primarily in the Tower Cab they have a decreased awareness of bird/wildlife activity on the airfield. While SOF is not working in the Tower Cab, AM becomes the focal point for declaring BWC. In addition to their duties outlined in DAFB OPLAN 91-212 AM will also notify SOF, if on duty, of BWC condition changes. BWC will be raised and lowered IAW DYESSAFB OPLAN 91-212.

8.21. Supervisor of Flying (SOF) Program. The purpose of the SOF program is to maintain a safe and efficient terminal airspace environment. When on duty, the SOF is a Group-level position and is the direct representative of the 7 OG/CC. Decision authority is delegated to this

position to accomplish the mission as the SOF is the focal point for coordinating and maximizing efficient flying operations. 7th Operations Group Standardization and Evaluation (7 OG/OGV) is the OPR for this program. The SOF Program will be conducted IAW AFI 11-418, *Operations Supervision* and any incorporating changes. The SOF communicates with B-1 and C-130 aircrews when on-duty. The SOF will coordinate requests and traffic pattern priorities with the Dyess Tower Watch Supervisor/Senior Controller (WS/SC), but not the line controllers. The SOF does not perform or direct ATC functions, however, the SOF can and should coordinate with the WS/SC to facilitate better training of 7 BW and 317 AW aircraft. The SOF may coordinate with the WS/SC to redirect/restrict aircraft from VFR traffic patterns if they conflict with local training priorities.

8.21.1. SOF Responsibilities.

8.21.1.1. Notify Dyess Tower when on-duty, if not in the Tower. Directs/coordinates all questions, concerns, or inputs to the WS/SC. Questions concerning ATC policies should be directed to the Chief Controller (CCTLR) or AOF/CC. The SOF, however, will relay all equipment outages associated with the SOF position to the WS/SC for repair actions.

8.21.1.2. Request to relay information to an aircraft on any ATC assigned frequency will be made to the WS/SC. If the SOF deems that the information is too technical, and after coordination with the WS/SC, the SOF may communicate directly with an aircraft on an ATC assigned frequency for which the WS/SC has over-key ability. When this occurs, advisory instructions must be limited to that essential for flight safety and the prevention of a mishap.

8.21.1.3. Advise the WS/SC of weather recalls and diverts.

8.21.1.4. Provide the WS/SC with the data on emergency aircraft, as it becomes available. This data could include: nature of emergency, aircraft call sign, number of people onboard the aircraft, ordinance information, fuel status and fuel remaining in time, position and/or ETA, special requirements (pinning gear, stopping on runway, etc.) and pilots' desires.

8.21.1.5. Assist ATC to the maximum extent possible in recovering or diverting wing aircraft in event of a tower evacuation.

8.21.1.6. Monitor Local and Ground Control positions via headset in order to preclude excessive coordination. Prior to exiting Tower, the SOF will ensure the SOF work area is clean and deselect all frequencies and positions being monitored.

8.21.2. WS/SC Responsibilities.

8.21.2.1. Overall OPR for managing traffic patterns, applying aircraft sequencing or separation standards, determining IFR versus VFR airfield status, opening/closing tower patterns and determining the runway in use.

8.21.2.2. Brief the SOF on any changes to the airfield or equipment including pertinent weather information that may affect flying operations.

8.21.2.3. Log and track all equipment outages associated with the SOF position.

8.21.2.4. Direct the SOF to the CCTLR or AOF/CC for any questions or concerns about ATC/airfield policies or procedures.

8.21.2.5. Coordinate with the SOF to use the SOF multi-channel radio during equipment outages. Conversely, the SOF may also request use of tower multi-channel radio/telephones when necessary.

8.22. Airfield Photography. All personnel must coordinate with 7 BW/PA before taking photographs in the airfield environment. 7 BW/PA will notify AM, SFS and appropriate MOC prior to authorizing the event with the following information: Name and rank of the photographer, purpose, date and time of authorized activity and for unofficial photography, who issued the photo pass. 7 BW/PA is the only authority for granting photography passes. Any unauthorized personnel taking photographs must be reported to 7 SFS who has the discretion to confiscate cameras and/or film used during the event. **Note:** All 7 BW/PA, AM and 436 TRS Multimedia personnel are authorized to take photos on the airfield during the performance of official duties and are not required to notify 7 SFS and/or 7 BW/PA. Contractors may take photos of contracted work IAW the airfield waiver and must get all photos approved by AM.

8.23. Combat Departure/Arrival Procedures. B-1 combat departure/arrival procedures will be conducted IAW *Combat Departure and Arrival Procedures* Letter of Agreement between 7 BW, Fort Worth Air Route Traffic Control Center (ARTCC) and ABI TRACON.

8.24. Unmanned Aircraft System (UAS) Operation/Procedures. Dyess AFB does not have UAS aircraft assigned to it.

8.24.1. Tower does not approve Commercial/Certified Operator/Public (Fire/Police/Law) or other non-model aircraft (Business) operators to operate within Tower's airspace. Requestors must visit **WWW.FAA.GOV/UAS** and apply for the appropriate permissions through the website.

8.24.2. UAS operating as public aircraft, the authority to operate is the Certificate of Waiver Authorization or as specified in a Memorandum of Agreement/LOA, between the using agency and FAA Headquarters. Operations will be conducted IAW any COA's, MOA's or LOA's.

8.25. Model/Remote Controlled Aircraft. Modelers and Hobbyists are required to contact Tower if operating within 5 statute miles of the airfield. If Tower deems the operation poses no hazard, they will acknowledge the notification (Tower will not use the word "Approved" IAW FAAO 7200.23A) and complete the USAF sUAS/Model Aircraft Request Checklist. If the Tower determines that the operation would endanger the safety of the national airspace system, Tower will deny the operation and state the reason for denial.

8.26. Mid-Air Collision Avoidance (MACA) Program. The purpose of this program is to highlight the potential for mid-air collisions in the local flying environment and to provide aircrews advice and tips on how to avoid them. 7th Bomb Wing Safety (7 BW/SE) is the OPR for this program IAW AFI 91-202, *The US Air Force Mishap Prevention Program.* Specific actions for Dyess AFB are found in AFI 91-202, DYESSAFBSUP, *The US Air Force Mishap Prevention Program*. **Note:** 7 BW/SEF (Flying) will advise the AOF/CC of all scheduled visits to local airports so ATC/Airfield Management (AM) representatives may attend. 7 BW/SEF will also report each visit to airports, Fixed-Base Operators (FBOs) and/or flying schools at the AOB. 7 BW/SEF will notify the AOF/CC when upcoming quarterly safety meetings are scheduled so that AOF representatives may attend.

8.27. Bird Aircraft Strike Hazard (BASH) Program. The purpose of the BASH program is to minimize the bird/wildlife strike hazard to aircraft and to clarify wing bird strike inspection and reporting procedures. 7 BW/SE is the OPR for this program. BASH procedures and BWC are located in DYESSAFB OPLAN 91-212, *Bird Aircraft Strike Hazard (BASH) Program*.

8.28. Foreign Object Damage (FOD) Program. The purpose of the FOD program is to enhance safety of Air Force personnel and equipment by removal of foreign objects through education, prevention measures, and control techniques. The FOD Manager (7 CMS/CVF) is the OPR for this program and conducts procedures IAW AFI 21-101, *Aircraft and Equipment Maintenance Management*. **Note:** For Wing FOD walks, Runway 16/34 and LZs 163/343 and 164/344 operations will be suspended by a NOTAM.

8.29. Airfield Driving. The 7 BW/CC has delegated authority to implement changes to procedures outlined in DAFBI 13-213, *Airfield Driving* to the OG/CC. Additionally, reinstatement of airfield driving privileges, following a CMAV, will be approved by the OG/CC. The Wing Airfield Driving Program Manager may waive retesting time requirements for members failing the airfield driving test.

8.30. Airfield Driving Program (ADP). The purpose of the ADP is to control vehicle and pedestrian operations on the airfield. The Deputy Airfield Manager (DAFM) is the OPR for this program. Airfield driving procedures are derived from AFI 13-213, *Airfield Driving*. This regulation discusses the responsibilities of AM, airfield agency and unit commander for controlling vehicle and pedestrian operations on the airfield.

8.31. Air Installation Compatible Use Zone (AICUZ) Program. The purpose of the AICUZ program is to promote the public health and safety through the local adoption of compatible land use controls and to protect the operational capability of the installation. 7th Civil Engineer Squadron (7 CES) is the OPR for this program. 7 CES conducts studies for noise, accident potential zones, clear zones and safety IAW AFI 32-7063, *Air Installation Compatible Use Zone Program*.

8.32. Terminal Instrument Procedures (TERPS) Program. The purpose of the TERPS program is to provide safe terminal procedures for aircraft operating to and from military and civil airports. The main considerations include criteria for obstacle clearance, descent/climb gradients and landing minimums. HQ ACC/A3AO is the OPR for this program. TERPS-related concerns may be reported to the AOF/CC or Tower WS/SC for coordination.

8.33. Local Operating Procedures (LOPs). AOF/CC is responsible for ensuring LOPs are developed which define procedures and responsibilities for services provided by the AOF. LOPs are also maintained between the 7 OSS and several on/off-base agencies to ensure proper coordination for activities impacting the airfield and/or ATC facility. The AOF/CC will annually review Letters of Agreement (LOA) in the 1st Quarter, Operational Plans (OPLANs) and Operational Letters in the 2nd Quarter, Memorandum of Understanding (MOU) and OIs in the 3rd Quarter and Delegation Letters in the 4th Quarter.

8.33.1. The following documents are examples of LOPs: LOAs, Operations Letters, Operating Instructions (OIs), OPLANs and Base Directives or Instructions. LOP's are accessible to all AOF personnel and are located in the AOF shared drive.

8.33.2. Base and unit level instructions with ATC or AM taskings will be coordinated through AOF/CC and forwarded to HQ AFGSC/A3OA for review/approval.

8.33.3. 7 OSS/OSR (Airspace Manager) will maintain and review airspace LOAs and Certificates of Authorization file locations annually or when appropriate IAW AFI 13-201, *Airspace Management*, AFGSC Sup 1. These LOAs are located in the 7 OSS/OSR's office IAW AFI 11-202V3, *General Flight Rules*, AFGSC Sup 1.

8.34. Annual Airfield Certification/Safety Inspection (ACSI). An annual inspection is completed by the AFM, 7 CES and 7 BW/SE to determine the airfield's condition as required by USAF infrastructures and safety requirements. The AFM is the OPR for the annual inspections. The 7 OG/CC, 7 MSG/CC, AFM, 7 CES and 7 BW/SE shall review and coordinate on the annual inspection staff package prior to 7 BW/CC's endorsement IAW AFI 13-204V2. Results will be briefed at the AOB.

8.35. Quarterly Joint Airfield Inspection. AM will host joint inspection IAW AFI 13-204V3 AFGSCSUP.

8.36. Waivers to Airfield/Airspace Criteria.

8.36.1. CE, SE, ATC, HQ AFFSA, TERPS and AM conduct an annual review of waivers to airfield and airspace standards. 7 CES/CEAO maintains the approved base airfield waivers; a current copy of airfield waivers is kept in the AM office. 7 CES/CEAO and AM coordinate on all permanent, temporary and construction waivers.

8.36.2. Construction will not begin without an approved temporary airfield waiver. The temporary waiver shall establish a specific safety plan IAW Unified Facilities Criteria (UFC) 3-260-01, *Airfield and Heliport Planning and Design* to ensure safe operations during construction activity. 7 BW/CC must approve all temporary construction waivers 45 days prior to construction start date. In addition, a detailed FOD plan will be included in the temporary construction waiver.

8.36.3. 7th Contracting Squadron (7 CONS) is responsible for ensuring contracts for airfield construction meet UFC 3-260-01, contain safety and marking guidance found in Engineering Technical Letter (ETL) 94-1, *Standard Airfield Pavement Marking Schemes*; AC 150/5340-1, *Standards for Airport Markings*; and AC 150/5370-2, *Operational Safety on Airports During Construction.* 7 CONS will also hold meetings at least 1 month prior to airfield projects. The following agencies will be present: AOF/CC or designated representative, AM, 7 BW/SEF, 317 OG/SEF, FD and contractor(s). The following agencies are recommended to be present: 317 OSS/OSO, 317 AMXS, 7 AMXS and 7 SFS.

8.37. Base Exercises. All exercise scenarios that involve the AOF personnel, airfield, or any ATC facilities shall be planned with the AFM and ATC Chief Controller. The AOF/CC and AFM must be briefed at least 48 hours in advance of exercise start. Minimum information required includes the time of exercise, affected airfield area, facilities to include ATCALS and their degree of involvement. The WS/SC may interrupt or discontinue Tower's participation in any exercise for safety reasons. Controllers must not wear a gas mask during facility operations while under simulated threat conditions. The WS/SC will direct controllers IAW AFI 13-204V3 and AFI 13-204V3 AFGSCSUP. IAW AFI 13-204V3, exercises will not be executed on the airfield without prior coordination with the AFM.

8.38. Protection and Release of Records. The AOF/CC is responsible for all ATC and AM records. The AOF/CC is also the custodian for all ATC recording tapes/transcripts and will handle requests/release of information IAW AFI 13-204V3.

8.39. Maintenance Radio Checks. To shorten radio transmissions on ATC frequencies, maintenance personnel will use "Eight Ball" when conducting radio checks with Tower. **Example:** "*DYESS GROUND, EIGHT BALL".* Tower will respond "*EIGHT BALL, LOUD AND CLEAR*" or respond as appropriate.

8.40. Unauthorized Civil Aircraft Arrivals. The procedures for unauthorized civil aircraft arrivals/landings (unauthorized aircraft movement) are detailed in the 7 BW Installation Defense Plan Annex 17 Appendix M.

8.41. Fire Pit Operations. 7 CES/CEF, Fire Emergency Services, is the OPR for fire pit operations/training. The pit is used only during periods of minimal or no flying. 7 CES/CEF will make notifications as required by current regulations and coordination with AM, Dyess CP, Tower, Weather Flight, CSC, 7 BW/MOC and 317 AW/MOC. 7 CES/CEF will notify above agencies again 30 minutes prior to starting and upon termination of fire pit operations. 7 CES/CEF will also notify AM prior to start any construction or repair activities at the fire pit. Tower will notify ABI TRACON upon start and termination of fire pit operations

8.42. Large Aircraft Infrared Countermeasures (LAIRCM) Operations. Testing of the LAIRCM system will be conducted with Tower approval on all C-130 parking spots, and IAW 317 AW OI 21-139, *LAIRCM Laser Operation Procedures*.

JOSE E. SUMANGIL, Colonel, USAF
Commander, 7th Bomb Wing

Attachment 1

GLOSSARY OF REFERENCES AND SUPPORTING INFORMATION

References

7 BW Master Aircraft Parking Plan (MAPP), 9 December 2012

7 BW OPLAN 510-11 (Anti-Hijacking), *Preventing and Resisting Aircraft Piracy (Hijacking),* 12 March 2013

AFI 10-1001, *Civil Aircraft Landing Permits,* 22 August 2018

AFI 11-202 Vol 3/AFGSC Sup 1, *General Flight Rules,* 8 July 2019

AFJI 11-204, *Operational Procedures for Aircraft Carrying Hazardous Materials,* 11 November 1994

AFI 11-218, *Aircraft Operations and Movement on the Ground,* 4 April 2019

AFI 11-2B-1 Vol 3, *B-1 Operations Procedures*, 11 September 2017

AFI 11-418, *Operations Supervision,* 3 October 2015

AFI 13-204, Vol 2, *Airfield Operations Standardization and Evaluations,* 1 September 2010

AFI 13-204, Vol 3, *Airfield Operations Procedures and Programs,* 1 September 2010

AFI 13-204, Vol 3, AFGSC Sup, *Airfield Operations Procedures and Programs,* 20 May 2016

AFI 13-204, Vol 4, *Management of Ground Radar and Airfield Systems,* 18 January 2017

AFI 13-213, *Airfield Driving Instruction,* 1 June 2011

AFI 21-101, *Aircraft and Equipment Maintenance Management,* 20 May 2015

AFI 32-7063, *Air Installation Compatible Use Zone Program,* 18 December 2015

AFMAN 33-363, *Management of Records,* 1 March 2008

AFMAN 91-201, *Explosives Safety Standards,* 20 March 2017

AFI 91-202, *The US Air Force Mishap Prevention Program,* 24 June 2015

AFI 91-202, DYESSAFBSUP, *The US Air Force Mishap Prevention Program*, 20 August 2013

AFPD 13-2, *Air Traffic Control, Airfield, Airspace and Range Management,* 3 January 2019

AFVA 13-221, *Control Tower Light Gun Signals,* 6 January 2010

AFVA 13-222, *Runway/Controlled Movement Area (CMA) Procedures,* 30 July 2009

DYESS AFB Instruction (DYESSAFBI) 15-101, *Weather Support Procedures,* 28 April 2016

DYESSAFB OPLAN 91-212, *Bird Aircraft Strike Hazard (BASH) Program,* 31 October 2016

FAAO JO 7110.65, *Air Traffic Control,* 15 August 2019

UFC 3-260-01, *Airfield and Heliport Planning and Design,* 4 February 2019

UFC 3-535-01, *Visual Air Navigation Facilities,* 11 April 2017

Prescribed Forms

There were no prescribed forms

Abbreviations and Acronyms

ACSI—Airfield Certification/Safety Inspection

ADP—Airfield Driving Program

ADPM—Airfield Driving Program Manager

AFB—Air Force Base

AFI—Air Force Instruction

AFM—Airfield Manager

AGE—Aerospace Ground Equipment

AGL—Above Ground Level

AICUZ—Air Installation Compatible Use Zone

AIS—Aeronautical Information System

AM—Airfield Management

AOB—Airfield Operations Board

AOF—Airfield Operations Flight

ARTCC—Air Route Traffic Control Center

AS—Airlift Squadron

ASR—Airport Surveillance Radar

ATC—Air Traffic Control

ATCALS—Air Traffic Control and Landing Systems

ATIS—Automatic Terminal Information Service

BASH—Bird Aircraft Strike Hazard

BS—Bomb Squadron

BW—Bomb Wing

BWC—Bird Watch Condition

CAT—Category

CBT—Computer Based Training

CC—Commander

CCTLR—Chief Controller

CDT—Controlled Departure Time

CE—Civil Engineering

CFR—Crash Fire Rescue

CMA—Controlled Movement Area

CP—Command Post

CSC—Central Security Control

CTAF—Common Traffic Advisory Frequency

DAFM—Deputy Airfield Manager

DOD—Department of Defense

DME—Distance Measuring Equipment

DUATS—Direct User Access Terminal System

DV—Distinguished Visitor

DZ—Drop Zone

DZCO—Drop Zone Control Officer

ECC—Emergency Communications Center

ELT—Emergency Locator Transmitter

EOC—Emergency Operations Center

EOD—Explosive Ordinance Disposal

ERCC—Engine Run Crew Change

ETD—Estimate Time of Departure

EOC—Emergency Operations Center

ETL—Engineering Technical Letter

FAA—Federal Aviation Administration

FAAO—Federal Aviation Administration Order

FAR—Federal Aviation Regulation

FD—Fire Department

FLIP—Flight Information Publication

FOD—Foreign Object Damage

FSS—Flight Service Station

GE—Ground Emergency

GOV—Government Operated Vehicle

HIRL—High Intensity Runway Light

IAW—In Accordance With

IC—Incident Commander

ICC—Installation Control Center

IFE—In-Flight Emergency

IFR—Instrument Flight Rules

ILS—Instrument Landing System

IP—Initial Point

IR—Infrared

KIAS—Knots Indicated Air Speed

LAIRCM—Large Aircraft Infrared Countermeasures

LE—Law Enforcement

LMR—Land Mobile Radio

LOA—Letter of Agreement

LOP—Local Operating Procedure

LZ—Landing Zone

LZSO—Landing Zone Safety Officer

MACA—Mid-Air Collision Avoidance

MARSA—Military Authority Assumes Responsibility for Separation of Aircraft

MDG—Medical Group

MEDEVAC—Medical Evacuation

MOC—Maintenance Operations Center

MP—Maintenance Period

MSL—Mean Sea Level

NAVAID—Navigational Aid

NCOIC—Non-Commissioned Officer In Charge

NEW—Net Explosive Weight

NLT—No Later Than

NM—Nautical Mile

NOAA—National Oceanic and Atmospheric Administration

NOTAM—Notice to Airmen

NVG—Night Vision Goggle

OBO—Official Business Only

ODO—Operations Duty Officer

OG—Operations Group

OPLAN—Operations Plan

OPR—Office of Primary Responsibility

PA—Public Affairs

PAPI—Precision Approach Path Indicator

PAR—Precision Approach Radar

PCAS—Primary Crash Alarm System

POV—Privately Owned Vehicle

PPR—Prior Permission Required

PTD—Pilot to Dispatch

RAWS—Radar Airfield and Weather Systems

RCR—Runway Condition Reading

RDS—Records Disposition Schedule

REIL—Runway End Identifier Light

RSC—Runway Surface Condition

RSRS—Reduced Same Runway Separation

SAAM—Special Assignment Airlift Mission

SC—Senior Controller

SCN—Secondary Crash Network

SE—Safety

SFO—Senior Fire Officer

SFS—Security Forces Squadron

SFL—Sequencing Flashing Lights

SKE—Station Keeping Equipment

SOF—Supervisor of Flying

TA—Transient Alert

TACAN—Tactical Air Navigation

TERPS—Terminal Instrument Procedures

UAO—Uncontrolled Airfield Operations

UFC—Unified Facilities Criteria

UHF—Ultra High Frequency

VFR—Visual Flight Rules

VHF—Very High Frequency

VMC—Visual Meteorological Conditions


VORTAC—Very High Frequency Omni-Directional Radio Range Tactical Air Navigation

WS—Watch Supervisor

Attachment 2

DYESS AIRFIELD DIAGRAM


Figure A2.1. DYESS Airfield Diagram.

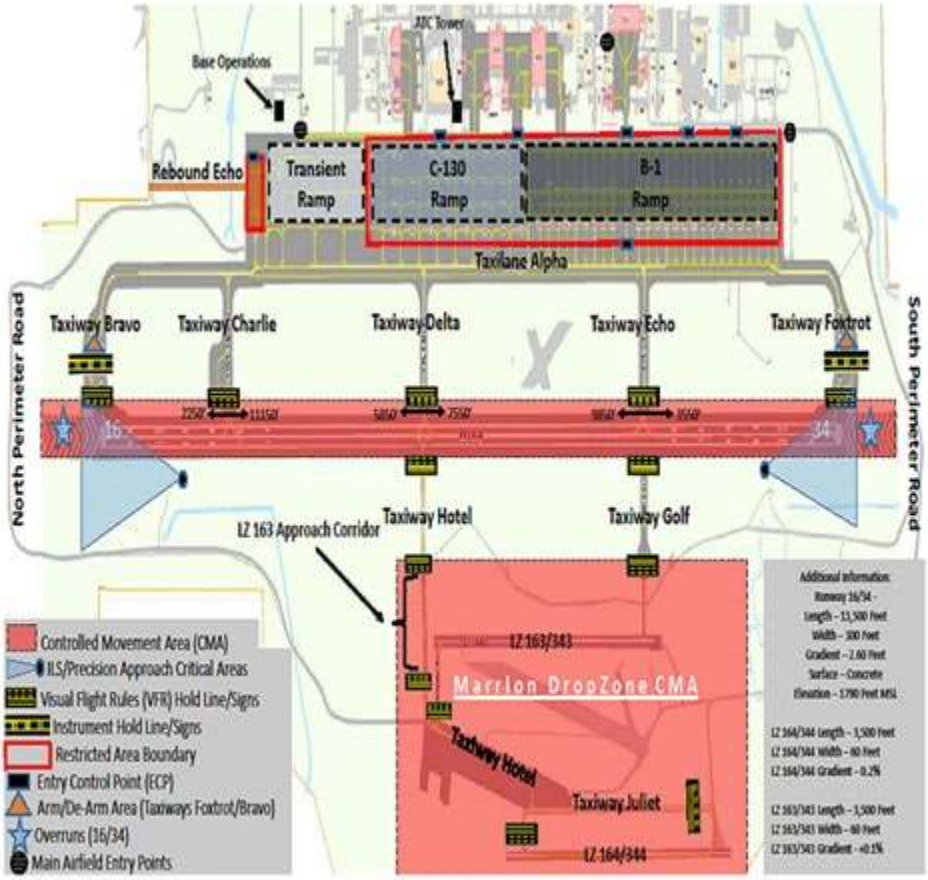

Note: The primary runway for DYESS AFB is Runway 16.

DIAGRAM NOT TO SCALE

Figure A2.2. DYESS Airfield Diagram.

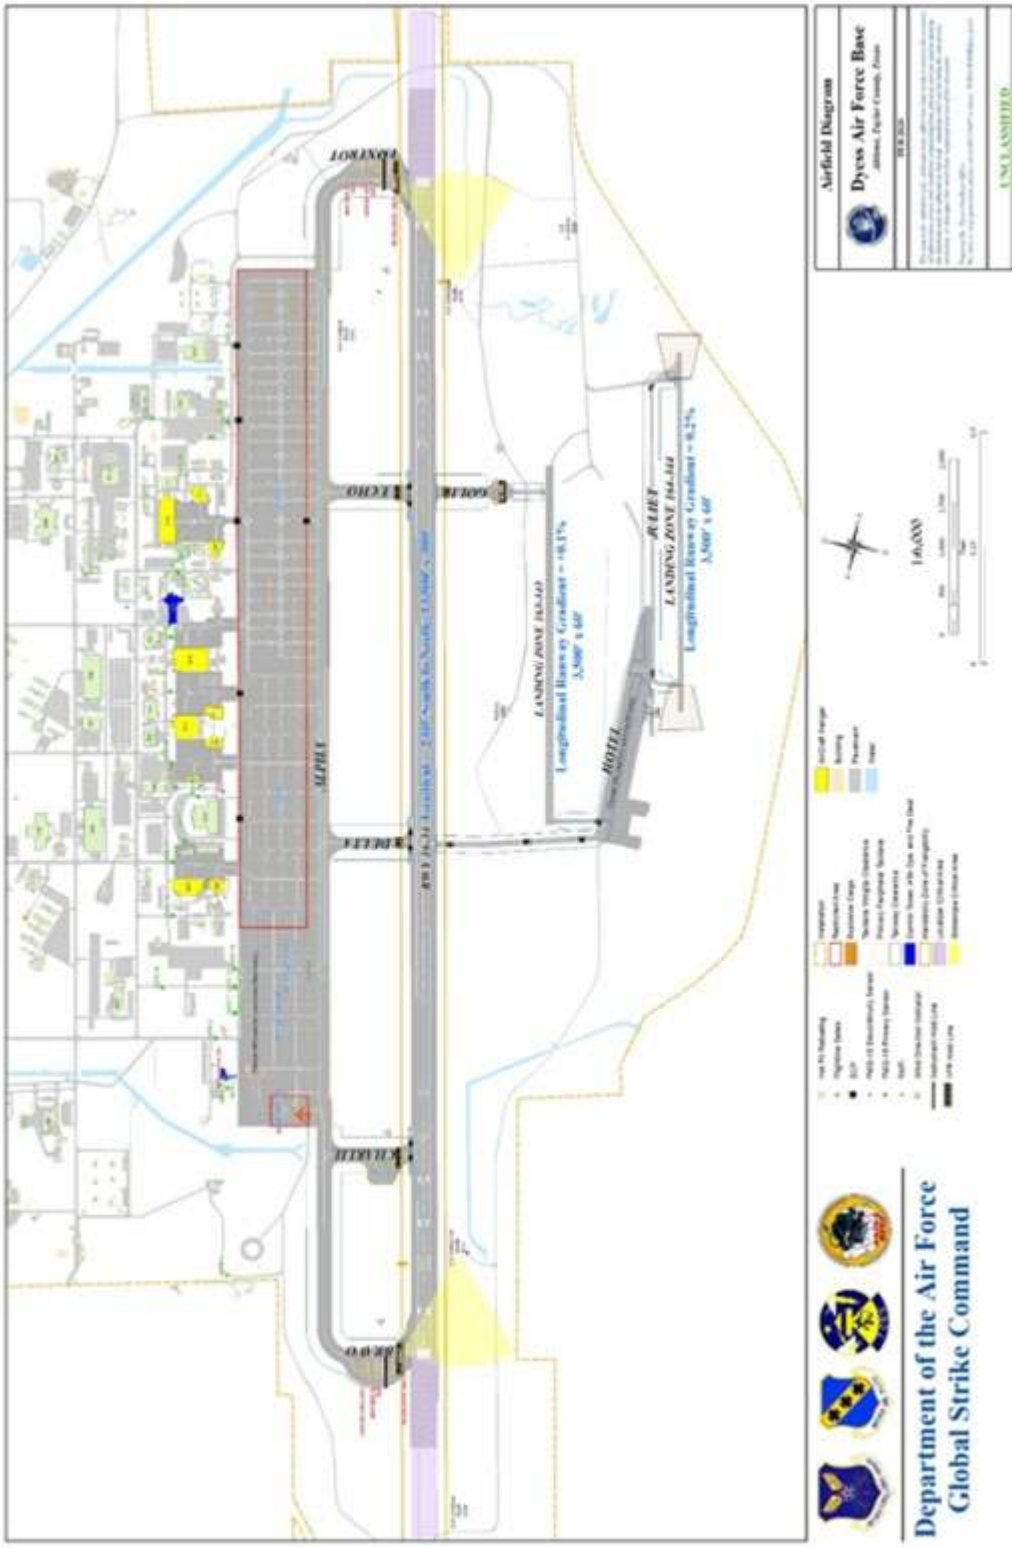

Note: DIAGRAM NOT TO SCALE

Attachment 3

LOCAL FLYING AREA

Figure A3.1. 150 NM DYESS Local Flying Area.




Note: DIAGRAM NOT TO SCALE

Attachment 4

VFR TRAFFIC PATTERNS

Figure A4.1. VFR Traffic Patterns.

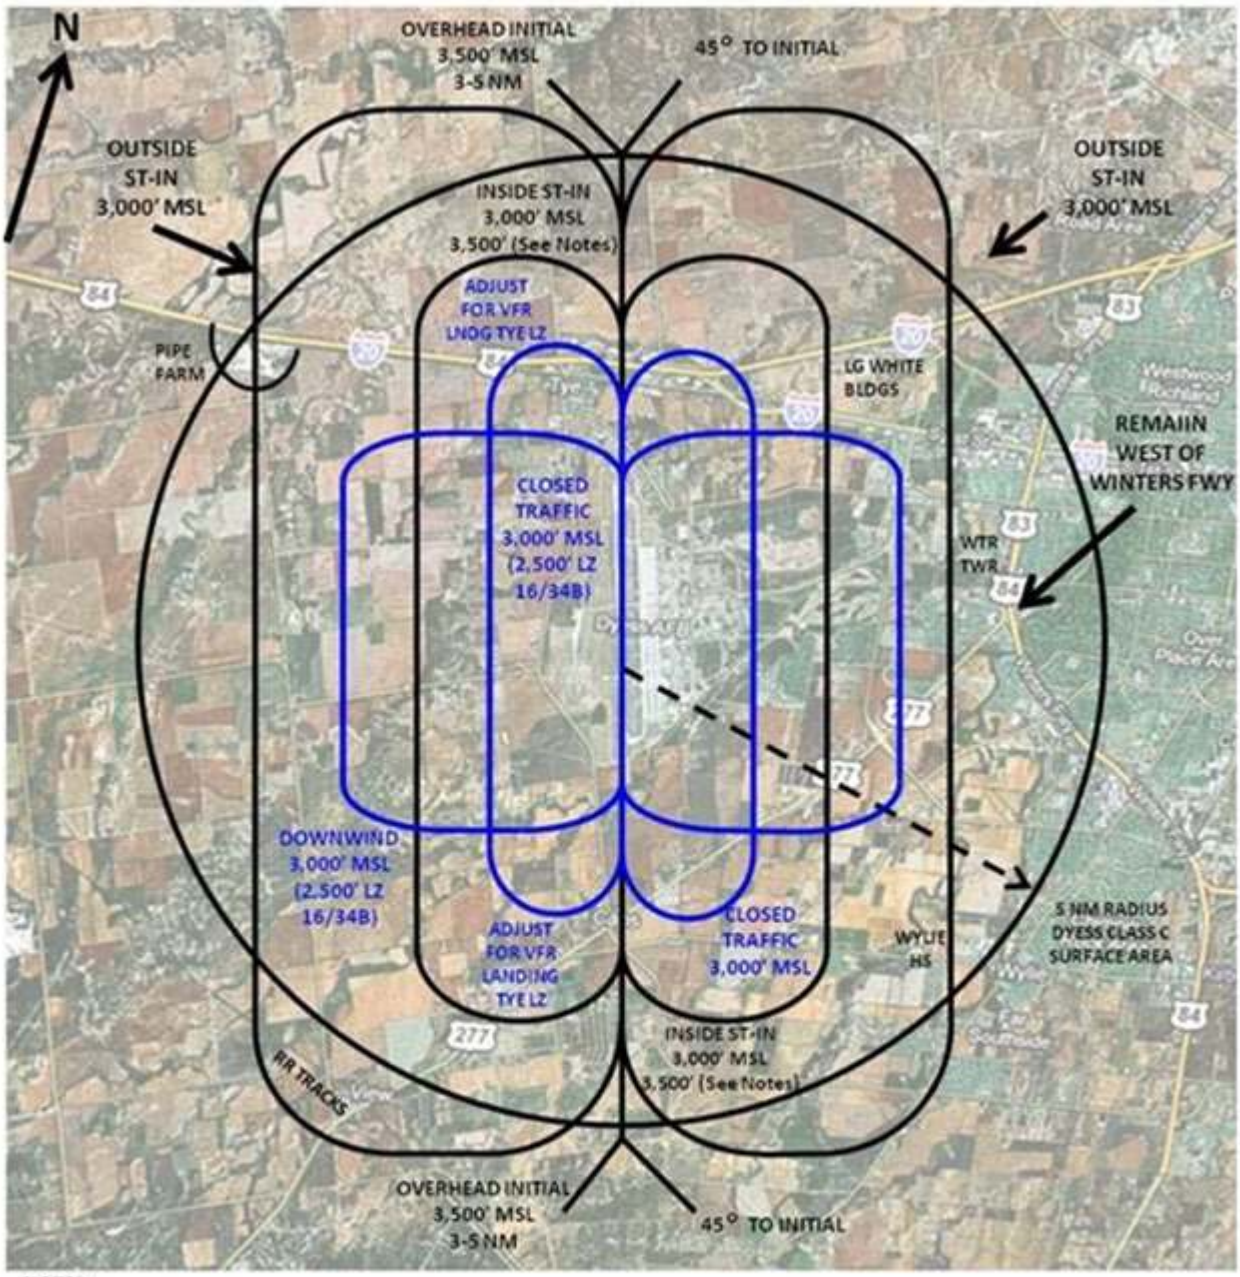


NOTES:
- OVERHEAD PITCH POINTS, START CLOSED/RECTANGULAR PATTERN POINTS ARE NOT DEPICTED. ONLY DOWNWIND, BASE & FINAL LEGS ARE DEPICTED
- B-1 AIRCREW MAY REQUEST 3,500' INSIDE STRAIGHT-IN PATTERNS DAY ONLY
- BLUE INDICATES C-130 PATTERNS
- DOWNWIND ENTRY FOR RWY 16/34 AND LZ 16A/34A: 3,000' MSL
- DOWNWIND ENTRY FOR LZ 16B/34B: 2,500' MSL

Note: DIAGRAM NOT TO SCALE

Attachment 5

DYESS CLASS C SURFACE AREA AND TOWER AREAS

Figure A5.1. DYESS Class C Surface Area and Tower Areas.

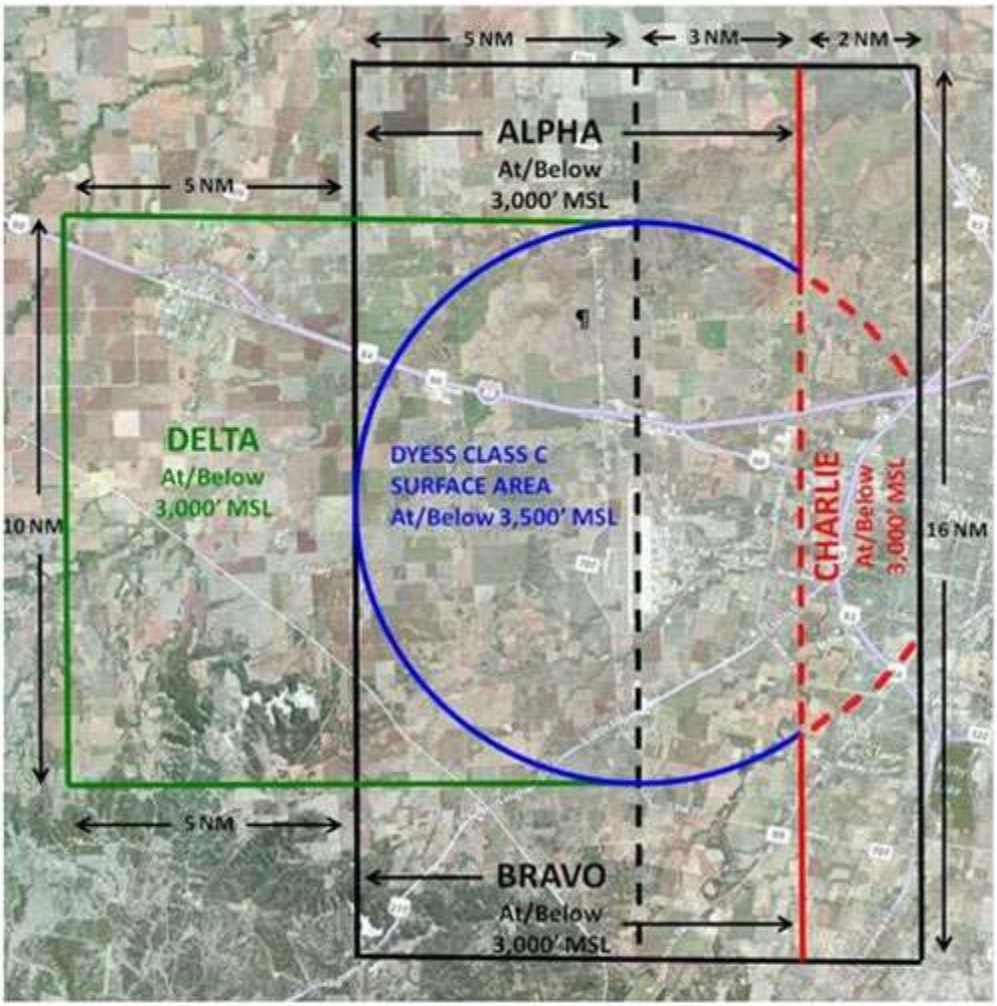

DYESS CLASS "C" SURFACE AREA – At or below 3500 ft MSL. May be used by Dyess Tower without coordination when Dyess Tower has control of the DYS Class "C" Surface Area.

ALPHA - At or below 3,000 ft MSL. May be used by Dyess Tower without coordination if Dyess Tower has assumed control of the DYS Class "C" Surface Area.

BRAVO - At or below 3,000 ft MSL. May be used by Dyess Tower without coordination if Dyess Tower has assumed control of the DYS Class "C" Surface Area.

CHARLIE - At or below 3,000 ft MSL. May be used by Dyess Tower after Dyess Tower has assumed control of the DYS Class "C" Surface Area and coordination has been accomplished with ABI Approach.


DELTA - At or below 3,000 ft MSL. May be used by Dyess Tower without coordination if Dyess Tower has assumed control of the DYS Class "C" Surface Area.

Note: DIAGRAM NOT TO SCALE

Attachment 6

ABILENE APPROACH CONTROL AREA

Figure A6.1. ABILENE APPROACH CONTROL AREA

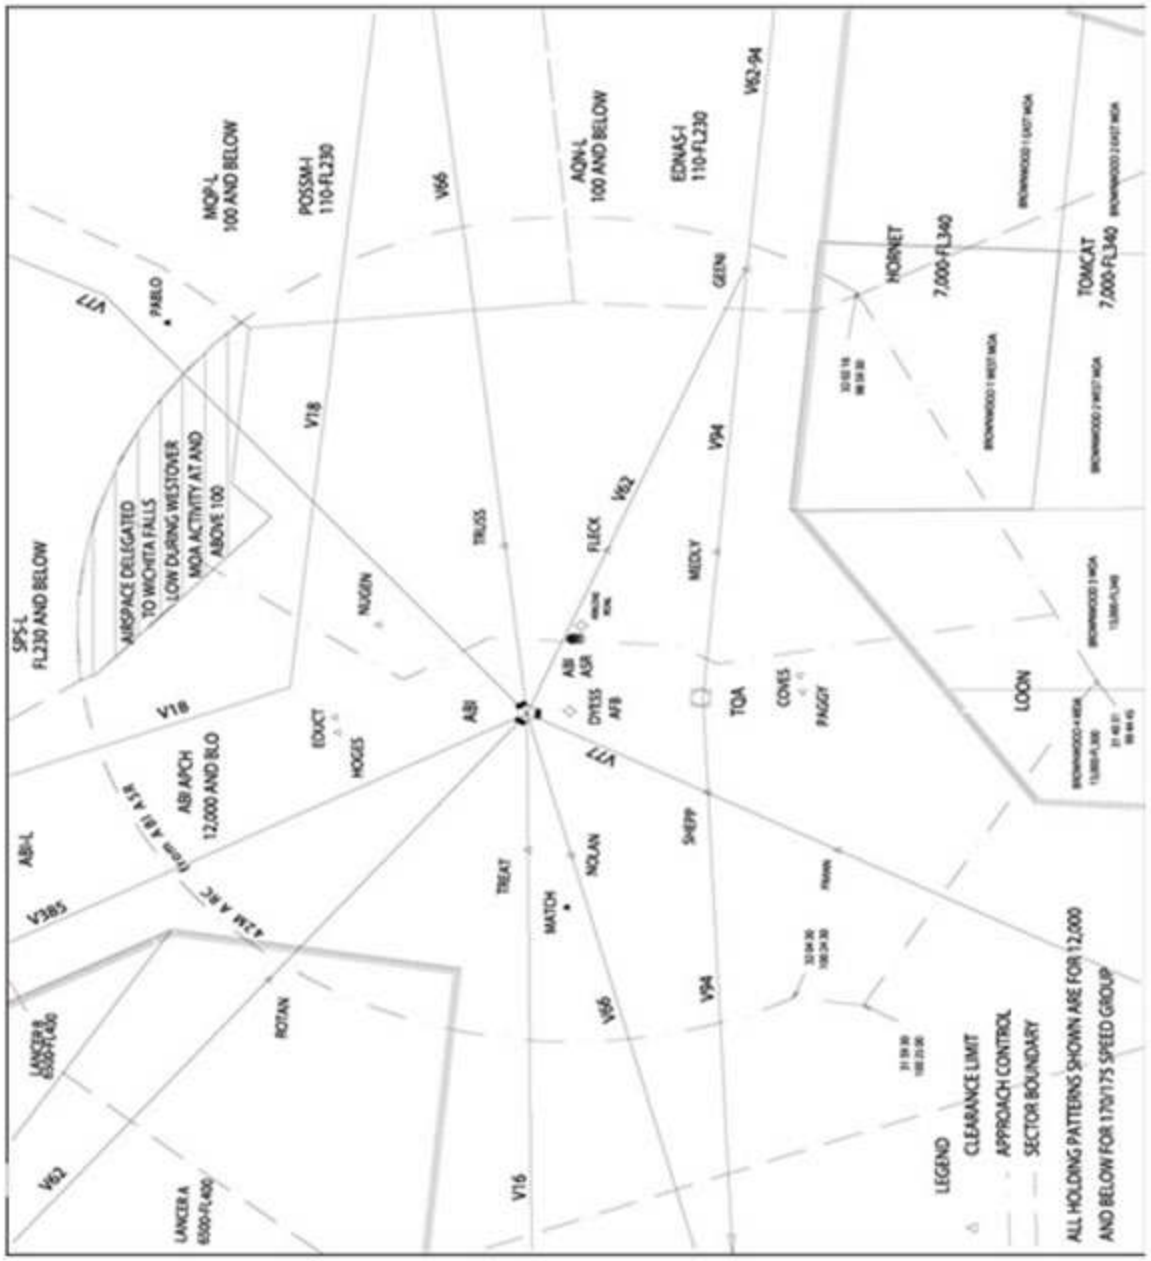

Note: DIAGRAM NOT TO SCALE

Attachment 7

C-130 VFR PATTERNS

Figure A7.1. C-130 VFR Patterns.


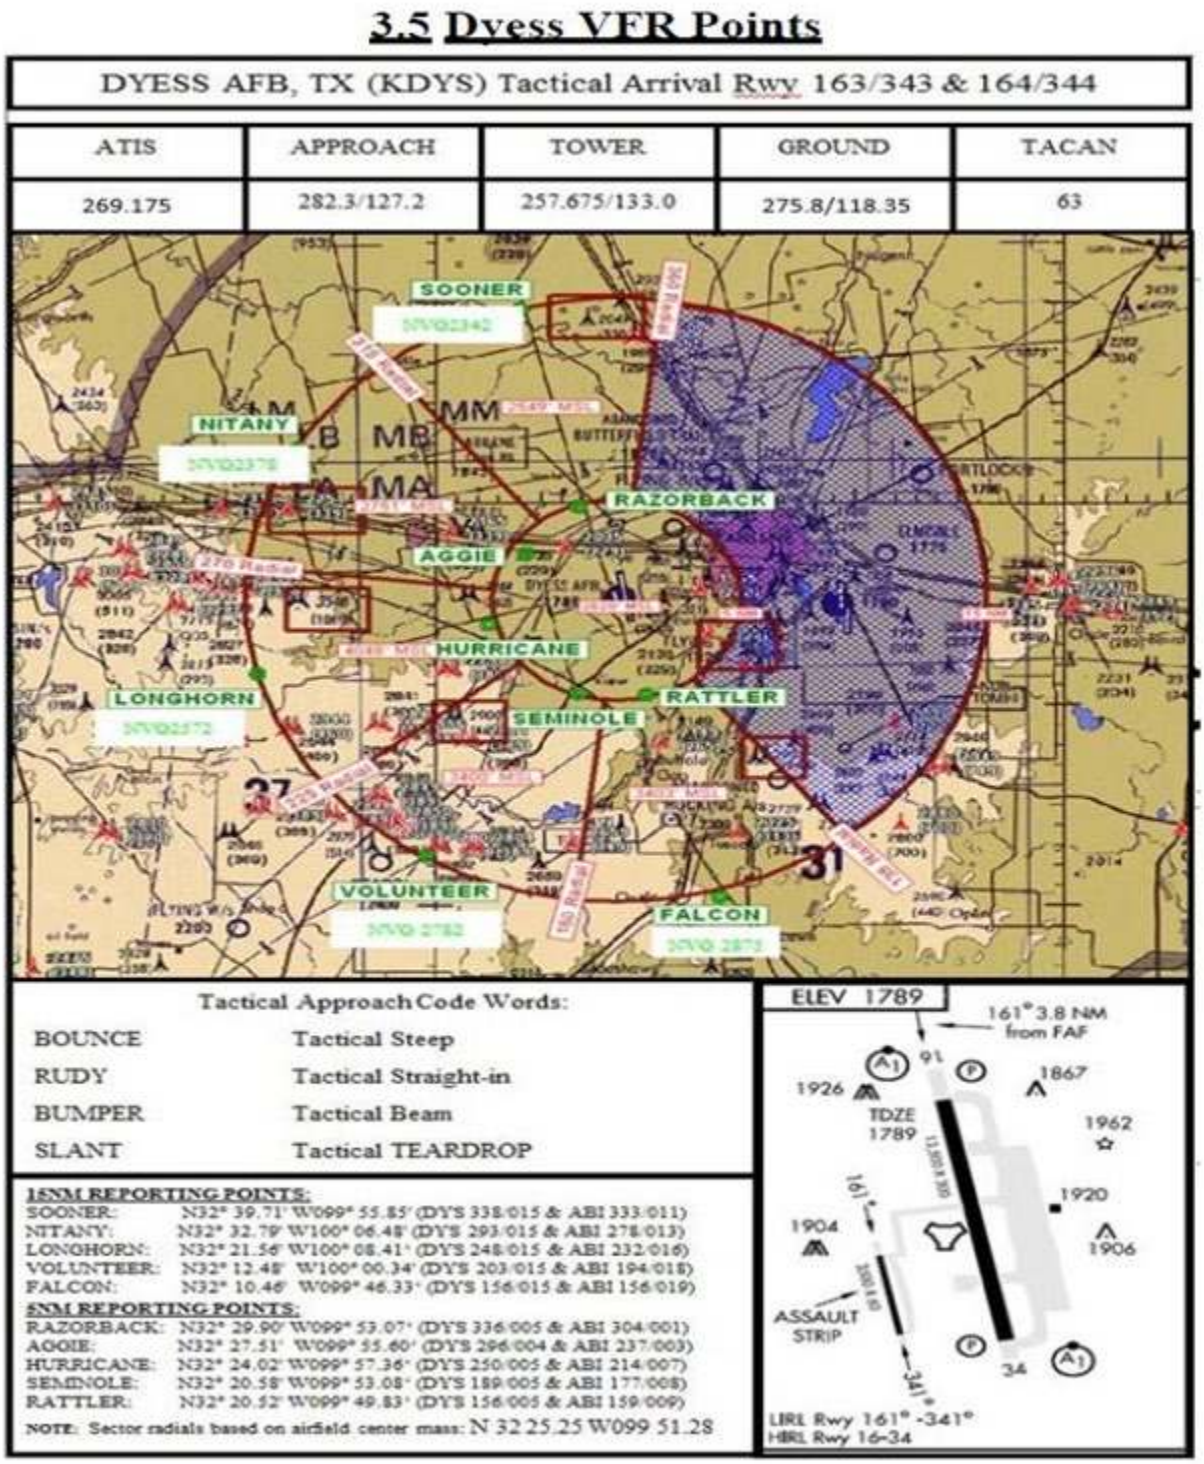


Figure A7.2. C-130 MARRION DZ Ground Track.




Note: DIAGRAM NOT TO SCALE

Figure A7.3. C-130 Downwind Recovery.

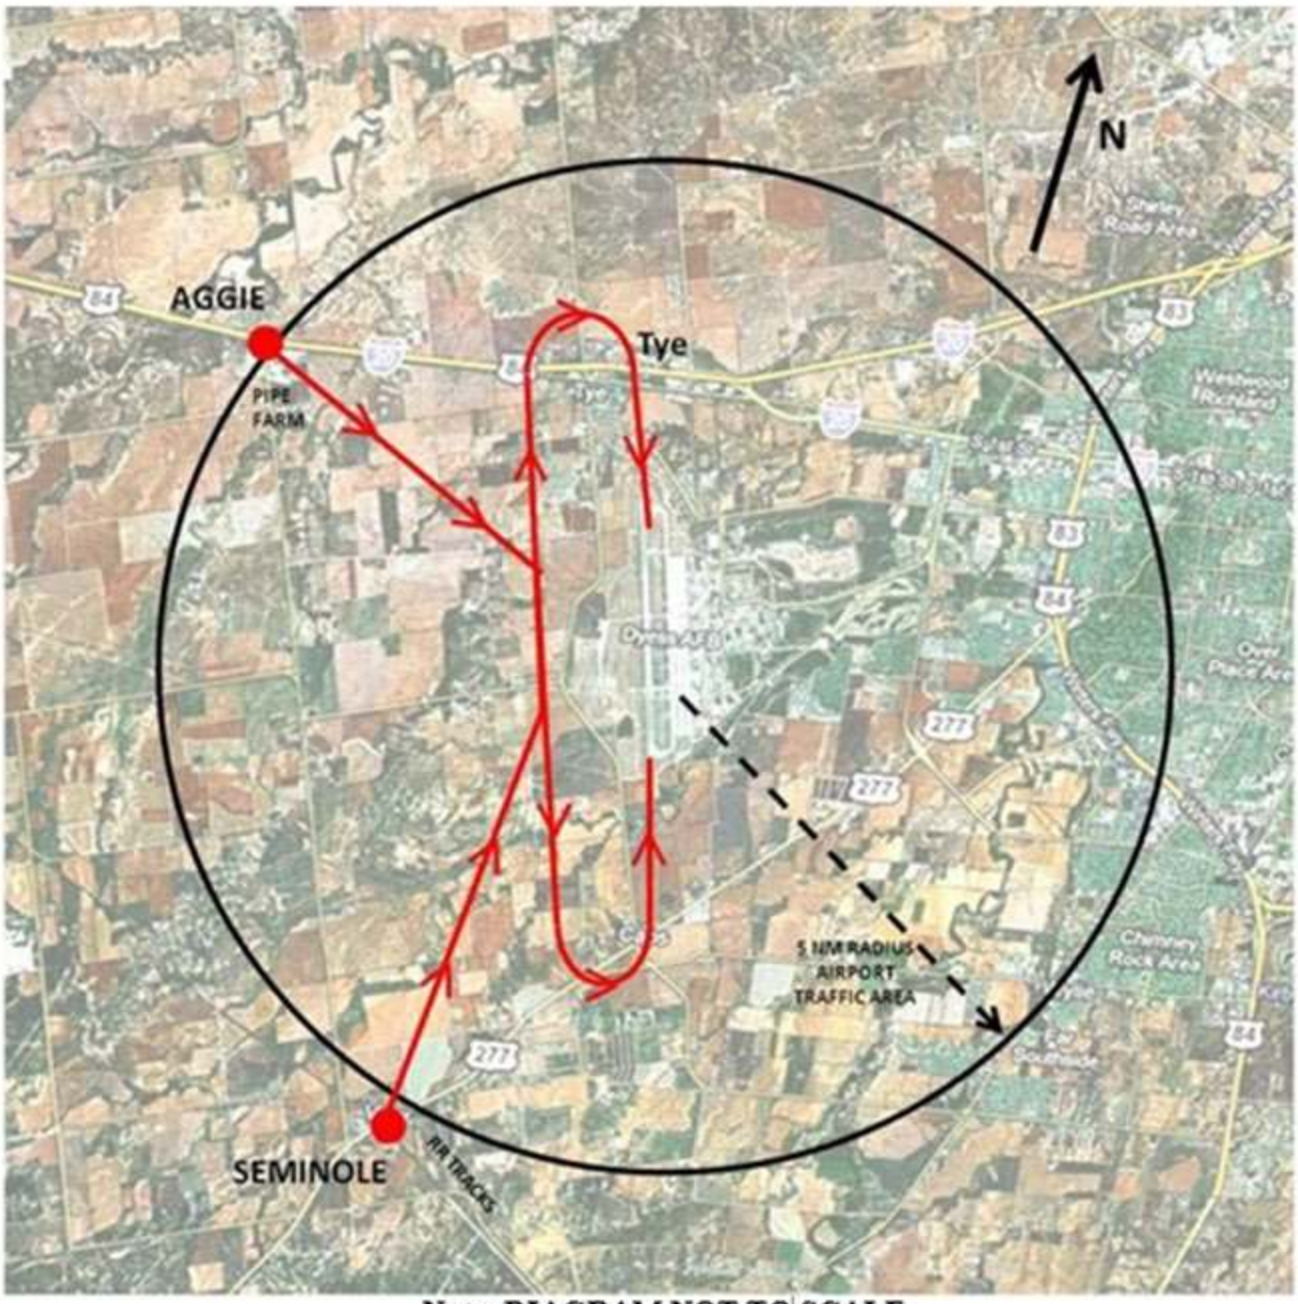


Note: DIAGRAM NOT TO SCALE

Figure A7.4. C-130 Tactical Teardrop Pattern.

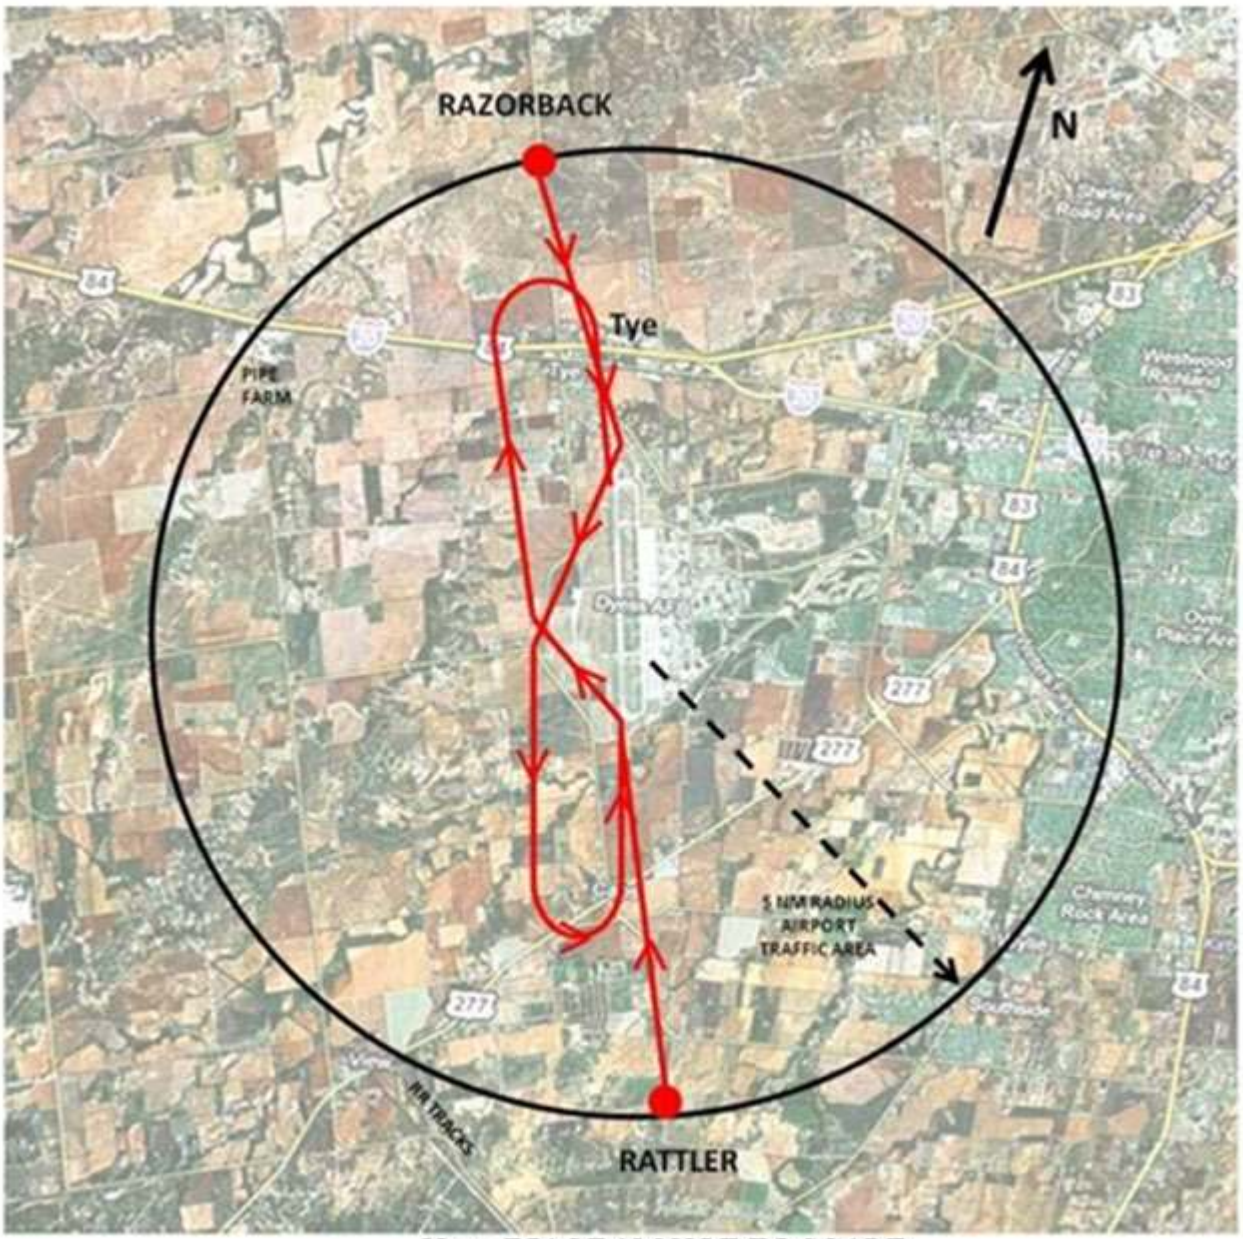

Note: DIAGRAM NOT TO SCALE

Figure A7.5. C-130 Tactical Steep Pattern.

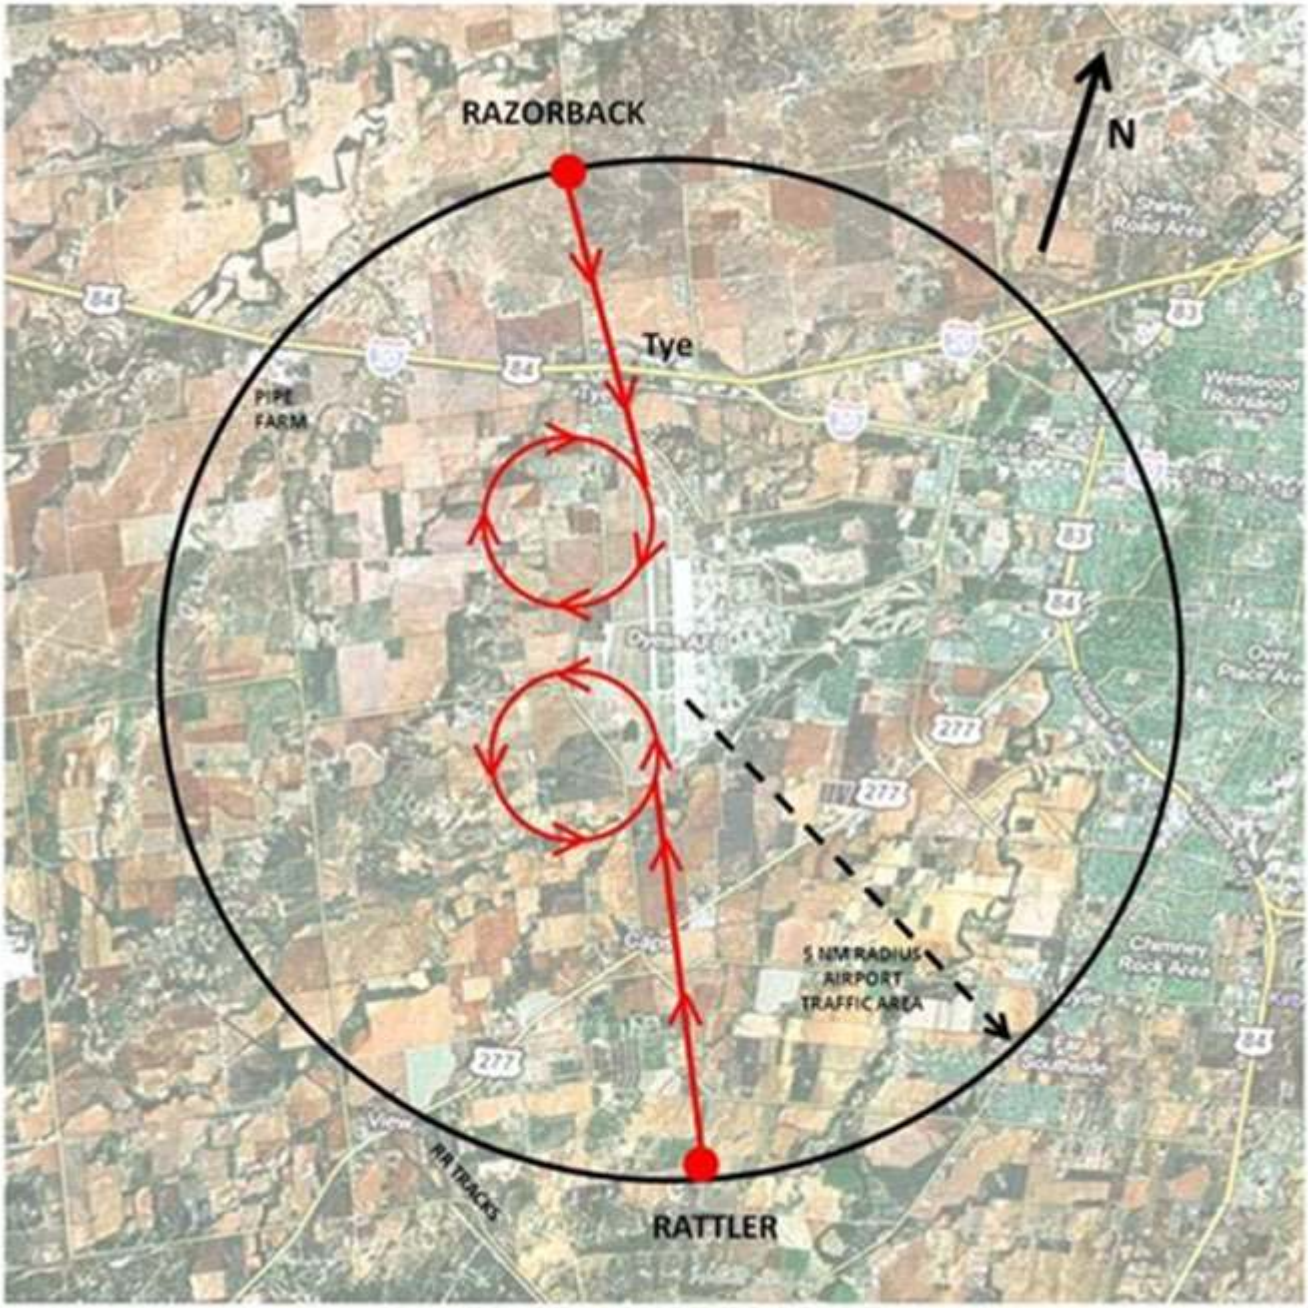

Note: DIAGRAM NOT TO SCALE

Figure A7.6. C-130 Tactical Abeam Approach.



Note: DIAGRAM NOT TO SCALE

Attachment 8

DYESS DROP ZONES

Figure A8.1. Marrion DZ 153

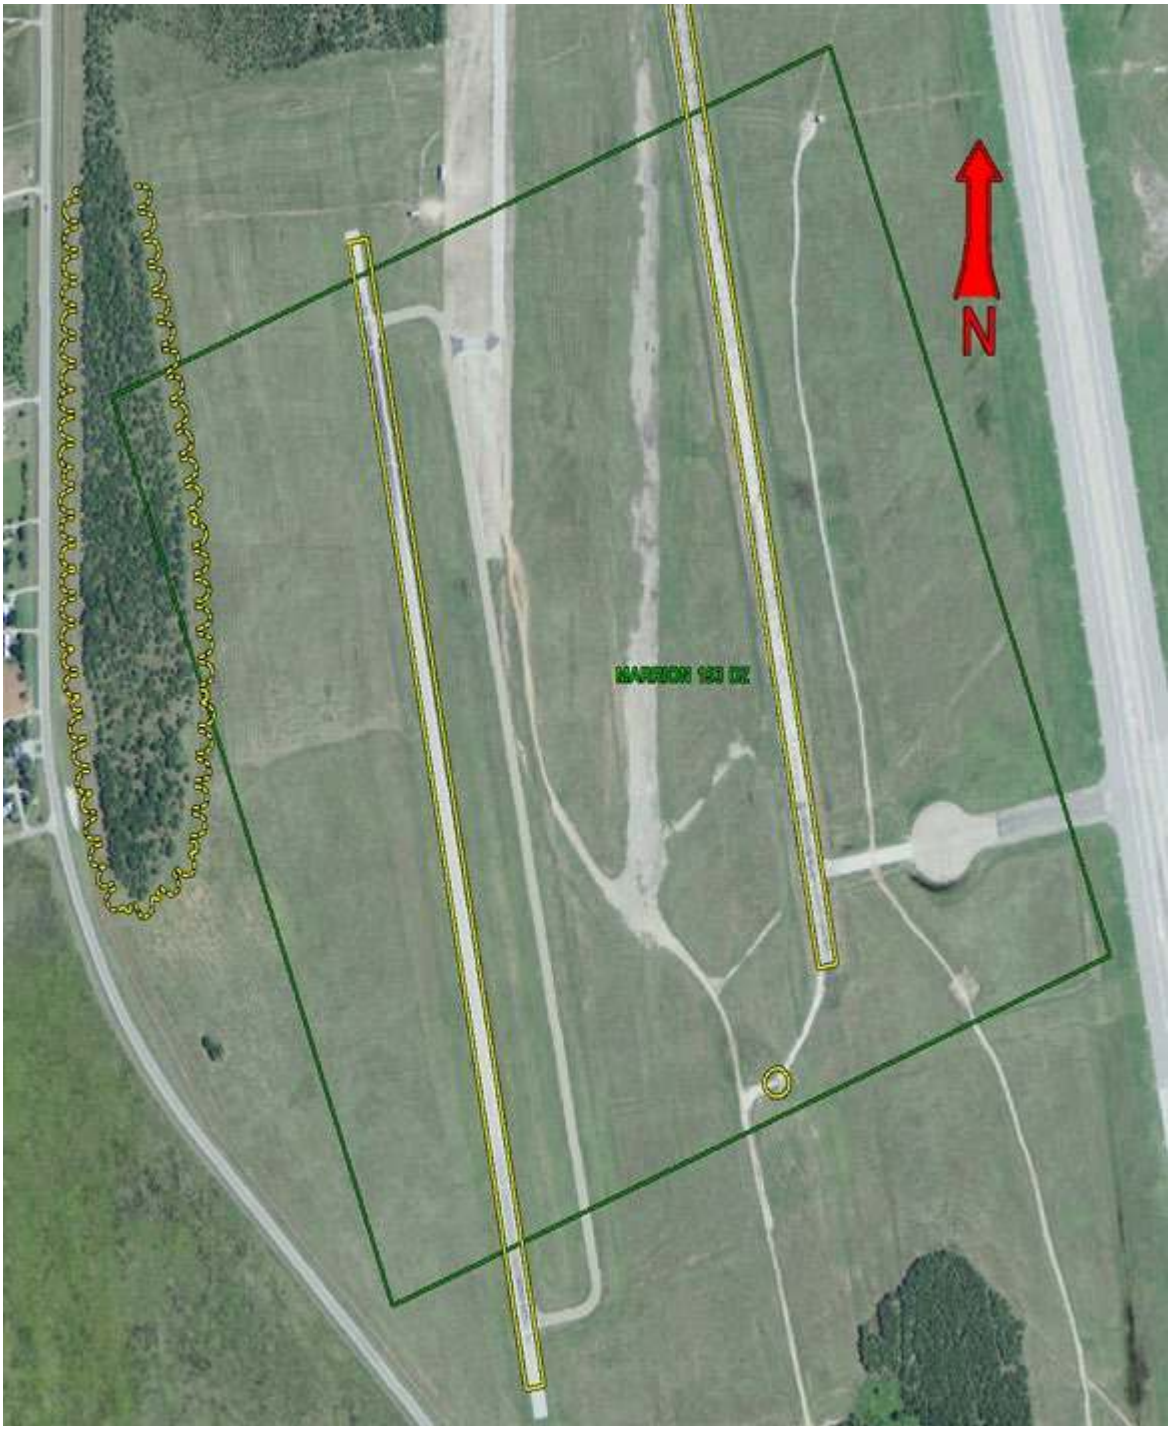


Figure A8.2. Marrion DZ 342



Figure A8.3. Gonzalez DZ 344



Figure A8.4. Gonzalez DZ 164

