

II

GEOGRAPHICAL INDEX

(1)	Miscellaneous	
(2)	United Kingdom and Ireland	2.13 – 2.70
(3)	North Russia, Norway, The Færoe Islands and Iceland	2.71 – 2.78
(4)	Baltic Sea and Approaches	2.79 – 2.122
(5)	North Sea and North and West Coasts of Denmark, Germany, Netherlands and Belgium	2.123 – 2.137
(6)	France and Spain, North and West Coasts, and Portugal	2.138 – 2.154
(7)	North Atlantic Ocean	2.155 – 2.161
(8)	Mediterranean and Black Seas	2.162 – 2.221
(9)	Africa, West Coast and South Atlantic	2.222 – 2.231
(10)	Africa, South and East Coasts, and Madagascar	2.232 – 2.239
(11)	Red Sea, Arabia, Iraq and Iran	2.240 – 2.270
(12)	Indian Ocean, Pakistan, India, Sri Lanka, Bangladesh and Burma	2.271 – 2.307
(13)	Malacca Strait, Singapore Strait and Sumatera	2.308 – 2.321
(14)	China Sea with its West Shore and China	2.322 – 2.369
(15)	Japan	2.370 – 2.402
(16)	Korea and the Pacific Coasts of Russia	2.403 – 2.410
(17)	Philippine Islands, Borneo and Indonesia except Sumatera	2.411 – 2.447
(18)	Australia and Papua New Guinea	2.448 – 2.475
(19)	New Zealand	2.476 – 2.479
(20)	Pacific Ocean	2.480 – 2.488
(21)	Aleutian Islands, Alaska and West Coast of North America including Mexico	2.489 – 2.492
(22)	West Coasts of Central and South America	2.493 – 2.503
(23)	Antarctica	2.504 – 2.505
(24)	East Coast of South America and The Falkland Islands	2.506 – 2.548
(25)	Caribbean Sea, West Indies and the Gulf of Mexico	2.549 – 2.589
(26)	East Coast of North America and Greenland	2.590 – 2.606

TEMPORARY AND PRELIMINARY NOTICES

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025

Notice No.	Page	Notice No.	Page	Notice No.	Page
3852(T)/07	2.370	968(T)/15	2.378	5218(T)/17	2.383
2050(T)/09	2.370	1444(T)/15	2.378	5220(T)/17	2.383
2051(T)/09	2.370	2493(T)/15	2.378	5395(T)/17	2.271
2667(T)/09	2.370	2773(T)/15	2.411	5441(P)/17	2.448
3043(T)/09	2.370	3163(T)/15	2.378	5518(P)/17	2.243
3781(T)/09	2.370	3298(T)/15	2.378	5635(T)/17	2.448
4209(T)/09	2.371	3467(T)/15	2.493	5712(T)/17	2.165
4523(T)/09	2.371	3552(T)/15	2.379	6023(T)/17	2.383
5469(T)/09	2.371	3929(T)/15	2.379	144(T)/18	2.384
6128(T)/09	2.371	4168(T)/15	2.379	209(T)/18	2.232
2781(T)/10	2.371	877(P)/16	2.322	576(T)/18	2.232
3116(T)/10	2.372	884(T)/16	2.506	1076(T)/18	2.403
3611(T)/10	2.372	1182(T)/16	2.240	1277(T)/18	2.222
5507(T)/10	2.372	1407(T)/16	2.322	1401(P)/18	2.308
526(T)/11	2.372	1773(T)/16	2.379	1507(T)/18	2.384
785(T)/11	2.372	2586(T)/16	2.549	1609(T)/18	2.384
2285(T)/11	2.372	2681(P)/16	2.590	1613(T)/18	2.384
3253(T)/11	2.373	2682(P)/16	2.592	1614(T)/18	2.384
4931(T)/11	2.373	3085(T)/16	2.379	1763(T)/18	2.550
640(T)/12	2.373	3206(T)/16	2.322	2060(T)/18	2.232
938(T)/12	2.162	3546(T)/16	2.403	2263(T)/18	2.493
4644(T)/12	2.71	3938(T)/16	2.448	2951(T)/18	2.271
5697(T)/12	2.373	4211(T)/16	2.162	3056(T)/18	2.323
58(T)/13	2.374	4258(P)/16	2.549	3252(T)/18	2.404
1029(T)/13	2.374	4281(P)/16	2.240	3336(T)/18	2.71
2427(T)/13	2.403	4292(P)/16	2.549	3440(T)/18	2.165
2692(T)/13	2.374	4666(T)/16	2.550	3655(P)/18	2.506
2831(T)/13	2.374	5105(P)/16	2.241	4188(T)/18	2.404
2832(T)/13	2.375	5194(T)/16	2.162	4192(T)/18	2.404
3137(T)/13	2.375	5264(T)/16	2.379	4193(T)/18	2.404
3234(T)/13	2.240	5398(T)/16	2.162	4195(T)/18	2.411
3833(T)/13	2.375	6211(P)/16	2.550	4628(T)/18	2.550
3834(T)/13	2.375	6268(T)/16	2.380	4669(T)/18	2.165
3835(T)/13	2.375	491(T)/17	2.322	4673(P)/18	2.310
4132(T)/13	2.375	720(P)/17	2.493	4723(T)/18	2.449
4133(T)/13	2.376	782(T)/17	2.380	4792(T)/18	2.480
5219(T)/13	2.376	784(T)/17	2.380	4924(P)/18	2.232
196(T)/14	2.376	955(T)/17	2.403	4956(P)/18	2.507
397(T)/14	2.13	1015(T)/17	2.506	5095(T)/18	2.385
679(T)/14	2.480	1395(T)/17	2.380	5180(P)/18	2.138
1933(T)/14	2.403	1509(T)/17	2.381	5227(T)/18	2.411
2746(T)/14	2.403	1907(T)/17	2.381	5260(T)/18	2.323
2751(T)/14	2.376	2047(T)/17	2.381	5368(T)/18	2.385
2916(T)/14	2.376	2048(T)/17	2.382	5486(T)/18	2.385
3693(T)/14	2.376	2363(P)/17	2.242	5701(T)/18	2.386
4183(T)/14	2.376	2444(T)/17	2.382	5983(T)/18	2.551
4399(P)/14	2.504	2822(T)/17	2.242	210(T)/19	2.233
4687(T)/14	2.377	3276(T)/17	2.550	212(T)/19	2.405
4735(P)/14	2.222	3534(P)/17	2.448	403(T)/19	2.234
4963(T)/14	2.377	3559(P)/17	2.242	559(T)/19	2.386
5209(T)/14	2.377	3738(P)/17	2.162	637(T)/19	2.311
5218(T)/14	2.322	3958(T)/17	2.382	659(P)/19	2.551
5236(T)/14	2.240	4214(T)/17	2.382	835(P)/19	2.323
5470(T)/14	2.377	4482(T)/17	2.382	859(T)/19	2.386
5725(T)/14	2.377	4847(T)/17	2.383	867(T)/19	2.405
5727(T)/14	2.378	5216(T)/17	2.383	949(T)/19	2.551

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
972(T)/19	2.551	6397(P)/19	2.166	5550(P)/20	2.412
994(P)/19	2.243	6398(T)/19	2.411	5580(P)/20	2.138
1191(P)/19	2.449	6402(P)/19	2.79	5637(P)/20	2.326
1355(T)/19	2.386	6406(T)/19	2.166	5964(T)/20	2.80
1489(T)/19	2.411	6566(T)/19	2.235	6028(P)/20	2.245
1646(P)/19	2.243	6699(P)/19	2.244	6035(T)/20	2.413
1659(T)/19	2.165	207(T)/20	2.553	6064(P)/20	2.414
1895(T)/19	2.551	318(T)/20	2.386	6104(T)/20	2.326
1937(T)/19	2.243	444(P)/20	2.594	6121(T)/20	2.387
2025(T)/19	2.507	630(P)/20	2.553	6122(T)/20	2.387
2078(P)/19	2.271	679(T)/20	2.166	6158(P)/20	2.414
2106(P)/19	2.271	969(P)/20	2.554	6232(T)/20	2.451
2208(T)/19	2.243	1055(T)/20	2.554	6269(T)/20	2.326
2345(T)/19	2.405	1111(T)/20	2.554	6272(T)/20	2.493
2363(P)/19	2.449	1232(P)/20	2.508	6303(P)/20	2.275
2410(T)/19	2.386	1352(T)/20	2.166	165(T)/21	2.312
2578(P)/19	2.507	1534(P)/20	2.481	219(T)/21	2.555
2582(P)/19	2.507	1543(T)/20	2.411	234(P)/21	2.556
2589(T)/19	2.234	1635(T)/20	2.166	276(T)/21	2.237
2590(T)/19	2.234	1660(T)/20	2.325	359(T)/21	2.71
2591(T)/19	2.234	1733(T)/20	2.450	384(T)/21	2.168
2592(T)/19	2.235	1818(T)/20	2.554	706(T)/21	2.489
2626(T)/19	2.449	2024(P)/20	2.312	751(T)/21	2.326
2630(P)/19	2.493	2058(P)/20	2.554	833(P)/21	2.415
2660(T)/19	2.323	2164(P)/20	2.273	877(P)/21	2.222
2745(T)/19	2.551	2204(T)/20	2.387	1059(T)/21	2.168
2822(T)/19	2.79	2211(T)/20	2.555	1171(T)/21	2.388
2869(P)/19	2.272	2225(P)/20	2.325	1276(T)/21	2.276
3109(T)/19	2.323	2227(P)/20	2.450	1278(T)/21	2.405
3202(P)/19	2.244	2294(T)/20	2.222	1310(T)/21	2.223
3258(P)/19	2.450	2356(T)/20	2.481	1320(T)/21	2.327
3392(P)/19	2.552	2620(T)/20	2.325	1324(P)/21	2.223
3604(P)/19	2.165	2884(T)/20	2.138	1435(T)/21	2.327
3861(T)/19	2.272	3127(P)/20	2.244	1470(T)/21	2.327
3977(T)/19	2.552	3175(T)/20	2.273	1471(P)/21	2.328
4086(T)/19	2.552	3403(P)/20	2.555	1474(T)/21	2.556
4141(T)/19	2.324	3503(T)/20	2.274	1541(T)/21	2.388
4267(T)/19	2.272	3553(T)/20	2.236	1646(P)/21	2.556
4290(T)/19	2.79	3590(P)/20	2.412	1783(T)/21	2.556
4326(P)/19	2.272	3609(T)/20	2.450	1850(T)/21	2.388
4676(T)/19	2.312	3867(T)/20	2.325	1897(T)/21	2.405
4737(P)/19	2.324	3997(P)/20	2.412	1919(P)/21	2.451
4909(T)/19	2.552	4149(P)/20	2.138	2009(P)/21	2.415
4952(T)/19	2.507	4268(P)/20	2.555	2042(T)/21	2.328
5223(T)/19	2.272	4378(P)/20	2.274	2220(P)/21	2.416
5363(T)/19	2.273	4436(T)/20	2.387	2221(T)/21	2.482
5373(T)/19	2.273	4508(T)/20	2.326	2269(P)/21	2.276
5385(T)/19	2.324	4813(P)/20	2.326	2417(P)/21	2.168
5444(P)/19	2.553	4952(T)/20	2.555	2447(T)/21	2.388
5467(T)/19	2.165	4958(T)/20	2.555	2620(T)/21	2.276
5627(T)/19	2.324	5074(T)/20	2.387	2670(T)/21	2.168
5880(T)/19	2.386	5235(T)/20	2.167	3082(P)/21	2.80
5962(T)/19	2.155	5237(T)/20	2.167	3430(P)/21	2.557
6060(P)/19	2.312	5242(T)/20	2.244	3513(P)/21	2.328
6063(T)/19	2.405	5433(P)/20	2.481	3518(P)/21	2.276
6161(P)/19	2.235	5448(P)/20	2.167	3579(T)/21	2.557
6384(T)/19	2.480	5545(T)/20	2.450	3602(T)/21	2.139

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
3623(P)/21	2.245	1320(T)/22	2.139	4077(P)/22	2.482
3760(T)/21	2.388	1329(T)/22	2.157	4217(T)/22	2.561
3767(T)/21	2.389	1444(T)/22	2.157	4224(T)/22	2.493
3775(T)/21	2.328	1452(P)/22	2.246	4276(T)/22	2.278
3886(P)/21	2.169	1487(T)/22	2.277	4280(T)/22	2.139
3926(T)/21	2.557	1494(T)/22	2.313	4288(T)/22	2.494
4062(P)/21	2.557	1530(P)/22	2.330	4294(P)/22	2.421
4104(T)/21	2.245	1534(T)/22	2.559	4295(T)/22	2.336
4128(T)/21	2.169	1556(T)/22	2.406	4297(T)/22	2.336
4145(P)/21	2.558	1602(T)/22	2.452	4327(T)/22	2.494
4253(T)/21	2.558	1662(T)/22	2.13	4560(T)/22	2.390
4263(T)/21	2.169	1699(P)/22	2.509	4657(P)/22	2.15
4366(T)/21	2.389	1755(T)/22	2.277	4716(P)/22	2.278
4414(T)/21	2.169	1774(T)/22	2.406	4751(P)/22	2.249
4619(T)/21	2.451	1834(P)/22	2.420	4792(T)/22	2.171
4677(T)/21	2.169	1841(T)/22	2.237	4798(P)/22	2.421
4687(P)/21	2.313	1938(T)/22	2.389	4815(T)/22	2.139
4767(T)/21	2.328	2002(T)/22	2.170	4829(T)/22	2.391
4847(T)/21	2.508	2043(P)/22	2.452	4864(T)/22	2.139
4848(P)/21	2.418	2153(T)/22	2.559	4882(T)/22	2.561
4851(T)/21	2.329	2159(T)/22	2.277	4921(T)/22	2.406
4897(T)/21	2.558	2219(T)/22	2.510	4928(T)/22	2.406
4899(T)/21	2.558	2220(T)/22	2.560	4954(T)/22	2.82
4905(T)/21	2.389	2248(T)/22	2.277	4962(T)/22	2.422
5014(T)/21	2.389	2266(T)/22	2.277	4968(P)/22	2.223
5114(T)/21	2.451	2280(T)/22	2.277	4993(T)/22	2.422
5164(T)/21	2.558	2299(T)/22	2.390	5085(T)/22	2.171
5172(T)/21	2.170	2352(T)/22	2.13	5134(T)/22	2.313
5378(T)/21	2.452	2375(T)/22	2.330	31(T)/23	2.453
124(P)/22	2.223	2416(T)/22	2.223	104(T)/23	2.313
237(T)/22	2.276	2482(T)/22	2.331	221(T)/23	2.82
239(P)/22	2.504	2560(T)/22	2.390	223(T)/23	2.171
379(P)/22	2.559	2567(T)/22	2.71	244(P)/23	2.336
390(T)/22	2.420	2721(T)/22	2.14	291(P)/23	2.171
430(T)/22	2.155	2867(T)/22	2.14	330(T)/23	2.391
460(P)/22	2.452	2946(T)/22	2.14	393(T)/23	2.278
474(P)/22	2.155	3009(T)/22	2.453	397(P)/23	2.594
515(P)/22	2.329	3056(T)/22	2.278	419(P)/23	2.123
517(T)/22	2.406	3071(P)/22	2.421	432(P)/23	2.15
520(P)/22	2.170	3251(P)/22	2.560	433(T)/23	2.406
578(T)/22	2.330	3259(P)/22	2.72	437(T)/23	2.16
597(P)/22	2.246	3261(T)/22	2.476	438(T)/23	2.16
598(T)/22	2.330	3372(P)/22	2.248	452(T)/23	2.172
800(T)/22	2.420	3375(T)/22	2.14	459(P)/23	2.16
835(T)/22	2.389	3381(P)/22	2.15	485(P)/23	2.561
1061(P)/22	2.559	3427(T)/22	2.406	490(P)/23	2.561
1064(P)/22	2.246	3631(T)/22	2.560	526(T)/23	2.407
1073(T)/22	2.13	3632(T)/22	2.278	593(T)/23	2.407
1108(T)/22	2.13	3643(T)/22	2.390	671(T)/23	2.72
1111(P)/22	2.82	3656(T)/22	2.561	734(T)/23	2.249
1116(P)/22	2.508	3744(P)/22	2.510	747(T)/23	2.82
1118(T)/22	2.170	3759(T)/22	2.421	754(T)/23	2.453
1200(P)/22	2.508	3875(T)/22	2.15	755(T)/23	2.562
1246(T)/22	2.509	3924(T)/22	2.331	810(P)/23	2.489
1258(T)/22	2.559	3935(P)/22	2.331	826(T)/23	2.391
1274(T)/22	2.170	3977(T)/22	2.390	840(T)/23	2.336
1288(T)/22	2.330	4054(T)/22	2.335	886(T)/23	2.223

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
897(T)/23	2.391	2749(P)/23	2.510	4154(T)/23	2.18
899(P)/23	2.595	2767(T)/23	2.83	4159(T)/23	2.250
902(T)/23	2.17	2802(T)/23	2.83	4162(T)/23	2.18
906(T)/23	2.172	2821(T)/23	2.494	4179(P)/23	2.280
910(T)/23	2.224	2841(P)/23	2.174	4198(T)/23	2.392
952(T)/23	2.453	2866(T)/23	2.238	4222(P)/23	2.339
1055(T)/23	2.336	2870(T)/23	2.83	4253(T)/23	2.18
1114(P)/23	2.562	2876(T)/23	2.476	4268(T)/23	2.570
1131(T)/23	2.454	2878(T)/23	2.73	4288(T)/23	2.177
1223(P)/23	2.249	2974(T)/23	2.84	4298(T)/23	2.73
1233(T)/23	2.249	3006(P)/23	2.279	4320(P)/23	2.424
1334(T)/23	2.391	3078(T)/23	2.279	4402(P)/23	2.483
1379(P)/23	2.510	3080(P)/23	2.280	4404(P)/23	2.483
1512(T)/23	2.454	3105(P)/23	2.337	4406(T)/23	2.18
1520(P)/23	2.123	3109(T)/23	2.224	4422(T)/23	2.424
1526(T)/23	2.279	3129(T)/23	2.455	4449(T)/23	2.250
1558(T)/23	2.337	3186(T)/23	2.423	4450(T)/23	2.84
1559(P)/23	2.422	3241(T)/23	2.569	4461(P)/23	2.124
1578(T)/23	2.279	3268(T)/23	2.140	4470(P)/23	2.494
1591(T)/23	2.82	3269(T)/23	2.224	4523(T)/23	2.281
1596(P)/23	2.510	3270(T)/23	2.280	4531(P)/23	2.512
1663(T)/23	2.83	3299(T)/23	2.338	4556(T)/23	2.339
1722(T)/23	2.250	3304(P)/23	2.510	4565(P)/23	2.424
1741(T)/23	2.172	3307(T)/23	2.494	4581(P)/23	2.571
1750(T)/23	2.595	3367(T)/23	2.338	4599(P)/23	2.512
1761(T)/23	2.224	3371(P)/23	2.476	4602(P)/23	2.512
1782(T)/23	2.454	3388(T)/23	2.570	4603(P)/23	2.596
1804(T)/23	2.17	3389(T)/23	2.338	4627(T)/23	2.281
1822(P)/23	2.562	3419(P)/23	2.511	4644(T)/23	2.281
1881(P)/23	2.313	3421(P)/23	2.511	4647(T)/23	2.281
1905(T)/23	2.565	3424(P)/23	2.511	4652(T)/23	2.178
1965(T)/23	2.337	3426(P)/23	2.511	4665(T)/23	2.282
1992(P)/23	2.566	3433(T)/23	2.392	4715(T)/23	2.339
2051(T)/23	2.454	3437(T)/23	2.280	4723(T)/23	2.282
2094(P)/23	2.566	3497(T)/23	2.338	4787(T)/23	2.392
2146(P)/23	2.567	3498(T)/23	2.423	4892(T)/23	2.339
2152(P)/23	2.568	3514(T)/23	2.407	4968(T)/23	2.282
2168(P)/23	2.423	3520(P)/23	2.238	4979(P)/23	2.18
2237(T)/23	2.454	3527(P)/23	2.177	4982(T)/23	2.178
2381(T)/23	2.391	3534(T)/23	2.570	5060(T)/23	2.85
2391(T)/23	2.279	3561(P)/23	2.512	39(T)/24	2.282
2438(P)/23	2.17	3613(T)/23	2.455	120(T)/24	2.238
2487(T)/23	2.124	3625(T)/23	2.17	212(T)/24	2.85
2488(T)/23	2.83	3635(T)/23	2.177	225(P)/24	2.513
2490(P)/23	2.224	3687(T)/23	2.140	236(P)/24	2.225
2495(T)/23	2.423	3698(P)/23	2.177	242(T)/24	2.19
2502(T)/23	2.172	3783(P)/23	2.225	260(T)/24	2.340
2503(P)/23	2.173	3826(T)/23	2.570	266(P)/24	2.85
2506(T)/23	2.174	3827(T)/23	2.280	326(T)/24	2.19
2519(T)/23	2.337	3835(T)/23	2.280	410(T)/24	2.455
2539(T)/23	2.407	3910(P)/23	2.424	412(T)/24	2.455
2547(T)/23	2.391	3920(P)/23	2.140	428(T)/24	2.513
2572(T)/23	2.569	3963(T)/23	2.84	482(T)/24	2.19
2605(P)/23	2.423	4012(T)/23	2.596	502(P)/24	2.19
2659(T)/23	2.72	4029(T)/23	2.177	515(T)/24	2.20
2681(T)/23	2.72	4105(T)/23	2.225	550(T)/24	2.476
2743(T)/23	2.83	4153(T)/23	2.494	555(T)/24	2.250

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
565(T)/24	2.20	1761(P)/24	2.226	2690(P)/24	2.574
619(T)/24	2.250	1825(P)/24	2.340	2711(P)/24	2.575
775(T)/24	2.20	1838(T)/24	2.86	2747(T)/24	2.253
789(T)/24	2.20	1851(T)/24	2.456	2763(P)/24	2.514
829(T)/24	2.21	1879(P)/24	2.341	2790(P)/24	2.514
905(T)/24	2.250	1939(T)/24	2.87	2877(P)/24	2.497
931(T)/24	2.456	1941(T)/24	2.342	2897(T)/24	2.457
942(P)/24	2.340	1975(T)/24	2.572	2898(T)/24	2.457
957(T)/24	2.407	2009(T)/24	2.572	2915(T)/24	2.394
980(T)/24	2.392	2015(P)/24	2.496	2973(P)/24	2.126
981(T)/24	2.456	2027(P)/24	2.572	2996(T)/24	2.343
982(T)/24	2.456	2095(T)/24	2.394	3021(P)/24	2.343
1084(T)/24	2.483	2115(T)/24	2.125	3034(T)/24	2.394
1100(T)/24	2.393	2121(T)/24	2.125	3053(T)/24	2.313
1171(T)/24	2.125	2133(P)/24	2.282	3089(P)/24	2.344
1189(P)/24	2.513	2173(T)/24	2.125	3103(T)/24	2.427
1203(P)/24	2.513	2183(T)/24	2.342	3188(T)/24	2.181
1219(T)/24	2.21	2184(T)/24	2.283	3239(P)/24	2.314
1221(P)/24	2.21	2186(T)/24	2.87	3256(P)/24	2.23
1223(T)/24	2.21	2189(T)/24	2.87	3296(T)/24	2.394
1225(T)/24	2.571	2228(T)/24	2.457	3339(P)/24	2.23
1267(T)/24	2.425	2291(T)/24	2.226	3376(T)/24	2.88
1301(T)/24	2.571	2295(T)/24	2.596	3377(T)/24	2.344
1357(T)/24	2.251	2296(T)/24	2.87	3387(T)/24	2.345
1359(T)/24	2.571	2297(T)/24	2.408	3420(T)/24	2.88
1369(T)/24	2.425	2299(P)/24	2.342	3440(P)/24	2.514
1380(T)/24	2.85	2318(T)/24	2.180	3442(T)/24	2.457
1387(P)/24	2.158	2319(T)/24	2.180	3444(T)/24	2.497
1403(T)/24	2.21	2320(T)/24	2.180	3445(T)/24	2.345
1414(T)/24	2.393	2339(P)/24	2.342	3454(T)/24	2.126
1421(T)/24	2.407	2348(T)/24	2.394	3459(T)/24	2.515
1436(P)/24	2.22	2383(T)/24	2.180	3463(T)/24	2.575
1442(T)/24	2.85	2405(T)/24	2.180	3464(T)/24	2.497
1451(T)/24	2.340	2444(T)/24	2.343	3465(P)/24	2.345
1453(T)/24	2.282	2460(T)/24	2.491	3475(P)/24	2.253
1479(T)/24	2.73	2465(P)/24	2.426	3477(P)/24	2.515
1488(T)/24	2.178	2474(T)/24	2.283	3494(P)/24	2.515
1490(T)/24	2.86	2488(P)/24	2.427	3500(T)/24	2.500
1500(T)/24	2.572	2510(T)/24	2.22	3519(P)/24	2.515
1517(P)/24	2.425	2513(P)/24	2.22	3526(P)/24	2.283
1522(T)/24	2.140	2528(P)/24	2.251	3622(P)/24	2.476
1530(T)/24	2.141	2544(P)/24	2.125	3634(P)/24	2.345
1546(T)/24	2.86	2566(T)/24	2.126	3655(T)/24	2.141
1550(T)/24	2.179	2570(T)/24	2.87	3671(T)/24	2.408
1557(T)/24	2.393	2585(T)/24	2.483	3683(T)/24	2.73
1588(T)/24	2.141	2594(T)/24	2.141	3686(T)/24	2.226
1614(T)/24	2.86	2604(T)/24	2.504	3698(P)/24	2.142
1616(P)/24	2.426	2635(T)/24	2.181	3704(T)/24	2.142
1618(T)/24	2.282	2643(T)/24	2.313	3708(T)/24	2.142
1621(T)/24	2.340	2652(P)/24	2.23	3722(P)/24	2.575
1622(T)/24	2.179	2661(P)/24	2.514	3723(T)/24	2.575
1640(T)/24	2.179	2667(T)/24	2.88	3728(P)/24	2.253
1700(T)/24	2.393	2670(P)/24	2.573	3730(P)/24	2.576
1712(T)/24	2.572	2671(T)/24	2.23	3734(P)/24	2.596
1734(T)/24	2.141	2672(P)/24	2.251	3749(T)/24	2.457
1736(T)/24	2.141	2673(T)/24	2.88	3764(T)/24	2.24
1742(T)/24	2.340	2688(T)/24	2.252	3767(T)/24	2.181

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
3799(T)/24	2.315	4540(T)/24	2.90	5043(P)/24	2.286
3861(T)/24	2.238	4544(T)/24	2.253	5097(T)/24	2.144
3883(T)/24	2.181	4547(P)/24	2.284	5104(P)/24	2.430
3884(T)/24	2.181	4567(P)/24	2.519	5106(T)/24	2.26
3892(T)/24	2.181	4569(P)/24	2.519	5109(P)/24	2.484
3923(T)/24	2.408	4570(P)/24	2.520	5128(T)/24	2.26
3929(P)/24	2.483	4572(P)/24	2.520	5137(T)/24	2.90
3943(T)/24	2.24	4573(P)/24	2.520	5141(T)/24	2.395
3984(T)/24	2.458	4637(T)/24	2.143	5152(P)/24	2.430
3988(T)/24	2.458	4639(P)/24	2.428	5164(P)/24	2.183
4004(T)/24	2.283	4659(T)/24	2.254	5187(P)/24	2.524
4007(P)/24	2.24	4677(T)/24	2.159	5188(P)/24	2.524
4103(T)/24	2.89	4700(T)/24	2.182	5199(P)/24	2.524
4118(P)/24	2.73	4702(T)/24	2.347	5208(P)/24	2.524
4119(T)/24	2.89	4707(T)/24	2.408	5221(T)/24	2.26
4131(T)/24	2.576	4708(P)/24	2.182	5236(T)/24	2.144
4143(T)/24	2.24	4734(T)/24	2.347	5239(P)/24	2.525
4161(P)/24	2.24	4736(T)/24	2.347	5319(P)/24	2.287
4207(T)/24	2.315	4742(T)/24	2.348	5323(P)/24	2.432
4215(P)/24	2.516	4755(P)/24	2.428	5328(P)/24	2.183
4221(T)/24	2.126	4763(T)/24	2.394	5359(P)/24	2.186
4227(T)/24	2.182	4766(T)/24	2.395	5384(P)/24	2.254
4228(P)/24	2.516	4769(P)/24	2.520	5426(T)/24	2.395
4233(T)/24	2.576	4775(P)/24	2.521	5434(P)/24	2.91
4234(T)/24	2.576	4799(T)/24	2.25	5435(P)/24	2.500
4253(T)/24	2.346	4803(T)/24	2.25	5453(T)/24	2.91
4259(P)/24	2.517	4829(P)/24	2.484	5459(T)/24	2.458
4262(P)/24	2.517	4830(P)/24	2.286	5466(P)/24	2.526
4264(P)/24	2.517	4831(P)/24	2.429	5467(T)/24	2.433
4265(T)/24	2.253	4832(P)/24	2.26	5484(P)/24	2.576
4271(P)/24	2.346	4833(P)/24	2.458	5489(T)/24	2.459
4276(P)/24	2.346	4836(T)/24	2.521	5492(P)/24	2.349
4280(P)/24	2.518	4850(P)/24	2.348	5495(P)/24	2.577
4282(T)/24	2.89	4853(T)/24	2.348	5502(T)/24	2.577
4285(T)/24	2.477	4854(T)/24	2.408	5528(P)/24	2.526
4288(T)/24	2.346	4859(P)/24	2.521	5533(P)/24	2.526
4325(T)/24	2.284	4860(P)/24	2.521	5571(T)/24	2.350
4329(T)/24	2.427	4861(P)/24	2.522	5576(P)/24	2.226
4339(P)/24	2.518	4871(P)/24	2.348	5579(T)/24	2.395
4341(T)/24	2.284	4882(T)/24	2.90	5593(P)/24	2.577
4366(P)/24	2.518	4883(T)/24	2.348	5600(T)/24	2.227
4369(P)/24	2.73	4898(T)/24	2.143	5616(T)/24	2.144
4370(P)/24	2.519	4901(T)/24	2.349	5620(T)/24	2.91
4372(P)/24	2.519	4903(T)/24	2.597	5659(P)/24	2.527
4377(T)/24	2.346	4908(T)/24	2.144	5665(P)/24	2.255
4394(T)/24	2.25	4918(P)/24	2.597	5675(P)/24	2.485
4407(P)/24	2.347	4919(T)/24	2.315	5696(T)/24	2.194
4419(P)/24	2.428	4921(P)/24	2.349	5714(T)/24	2.27
4421(T)/24	2.127	4931(T)/24	2.429	5720(P)/24	2.27
4445(T)/24	2.25	4936(T)/24	2.409	5722(T)/24	2.27
4447(P)/24	2.25	4942(P)/24	2.349	5743(P)/24	2.287
4472(T)/24	2.143	4949(T)/24	2.254	5751(T)/24	2.27
4479(P)/24	2.315	4966(P)/24	2.522	5756(T)/24	2.194
4488(T)/24	2.284	5006(P)/24	2.316	5757(T)/24	2.145
4504(T)/24	2.182	5007(P)/24	2.523	5767(P)/24	2.477
4513(T)/24	2.89	5014(P)/24	2.523	5803(T)/24	2.459
4526(T)/24	2.90	5040(P)/24	2.524	5815(T)/24	2.485

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
5834(T)/24	2.350	469(P)/25	2.196	1022(T)/25	2.258
5855(T)/24	2.27	471(P)/25	2.127	1023(T)/25	2.29
5876(T)/24	2.194	481(P)/25	2.256	1030(P)/25	2.531
5884(T)/24	2.316	489(T)/25	2.28	1064(P)/25	2.29
5909(T)/24	2.227	499(T)/25	2.434	1066(T)/25	2.127
5925(P)/24	2.238	502(T)/25	2.598	1079(T)/25	2.460
5927(T)/24	2.28	514(P)/25	2.434	1087(T)/25	2.435
5932(P)/24	2.527	527(P)/25	2.288	1090(T)/25	2.227
5944(T)/24	2.91	560(T)/25	2.92	1096(P)/25	2.31
5948(T)/24	2.91	572(T)/25	2.485	1110(T)/25	2.460
5956(T)/24	2.395	583(T)/25	2.486	1116(T)/25	2.31
5957(T)/24	2.395	590(T)/25	2.351	1120(T)/25	2.146
5968(P)/24	2.527	593(T)/25	2.196	1121(T)/25	2.353
5980(T)/24	2.288	624(P)/25	2.529	1125(T)/25	2.409
5982(T)/24	2.350	632(T)/25	2.256	1127(P)/25	2.486
5983(T)/24	2.194	637(P)/25	2.529	1128(T)/25	2.31
29(T)/25	2.74	649(P)/25	2.530	1130(T)/25	2.198
32(P)/25	2.491	654(P)/25	2.578	1135(P)/25	2.258
34(P)/25	2.527	657(P)/25	2.530	1136(T)/25	2.354
40(T)/25	2.92	663(T)/25	2.351	1153(T)/25	2.396
62(T)/25	2.92	671(T)/25	2.256	1167(T)/25	2.93
92(T)/25	2.597	676(T)/25	2.598	1168(T)/25	2.159
96(T)/25	2.350	689(P)/25	2.530	1174(T)/25	2.198
115(P)/25	2.145	693(T)/25	2.435	1179(P)/25	2.32
117(P)/25	2.255	694(P)/25	2.530	1183(T)/25	2.578
119(T)/25	2.459	695(P)/25	2.257	1198(T)/25	2.228
125(T)/25	2.459	732(T)/25	2.351	1201(T)/25	2.94
127(T)/25	2.459	743(T)/25	2.93	1210(T)/25	2.198
128(T)/25	2.459	761(P)/25	2.531	1214(T)/25	2.94
132(P)/25	2.28	776(T)/25	2.196	1216(T)/25	2.94
139(T)/25	2.92	777(T)/25	2.257	1219(T)/25	2.259
142(P)/25	2.460	781(P)/25	2.351	1221(P)/25	2.461
162(T)/25	2.577	782(T)/25	2.93	1226(T)/25	2.127
179(T)/25	2.433	808(T)/25	2.396	1229(T)/25	2.146
186(T)/25	2.194	815(P)/25	2.74	1243(P)/25	2.32
221(T)/25	2.433	816(P)/25	2.75	1263(P)/25	2.461
238(T)/25	2.578	838(P)/25	2.352	1270(T)/25	2.94
252(T)/25	2.145	839(T)/25	2.257	1271(T)/25	2.128
256(T)/25	2.127	842(T)/25	2.352	1274(T)/25	2.198
257(T)/25	2.145	845(T)/25	2.352	1284(T)/25	2.198
277(T)/25	2.433	851(T)/25	2.196	1287(T)/25	2.259
281(T)/25	2.350	856(T)/25	2.75	1291(T)/25	2.94
289(T)/25	2.146	867(T)/25	2.598	1312(T)/25	2.128
290(T)/25	2.92	869(T)/25	2.460	1321(T)/25	2.199
299(P)/25	2.528	881(T)/25	2.289	1330(T)/25	2.128
302(T)/25	2.492	882(T)/25	2.353	1337(T)/25	2.435
311(P)/25	2.351	883(T)/25	2.353	1339(P)/25	2.33
316(P)/25	2.434	884(T)/25	2.353	1340(T)/25	2.33
339(T)/25	2.195	886(T)/25	2.196	1343(T)/25	2.146
359(T)/25	2.195	898(T)/25	2.353	1347(P)/25	2.128
380(P)/25	2.578	921(P)/25	2.578	1353(P)/25	2.34
388(T)/25	2.288	930(T)/25	2.196	1359(T)/25	2.259
409(T)/25	2.195	941(T)/25	2.353	1369(P)/25	2.531
414(T)/25	2.255	955(T)/25	2.289	1386(T)/25	2.579
415(T)/25	2.146	1018(T)/25	2.29	1395(T)/25	2.95
443(P)/25	2.528	1019(T)/25	2.93	1401(P)/25	2.531
468(T)/25	2.500	1021(T)/25	2.197	1403(T)/25	2.316

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
1407(T)/25	2.316	1936(P)/25	2.36	2343(P)/25	2.148
1408(T)/25	2.316	1938(P)/25	2.37	2352(P)/25	2.40
1429(T)/25	2.409	1946(T)/25	2.462	2365(T)/25	2.99
1439(T)/25	2.354	1947(T)/25	2.462	2369(P)/25	2.40
1451(T)/25	2.579	1951(T)/25	2.148	2381(T)/25	2.99
1505(P)/25	2.147	1952(T)/25	2.260	2389(T)/25	2.99
1517(T)/25	2.435	1965(T)/25	2.579	2392(P)/25	2.537
1521(T)/25	2.199	1970(P)/25	2.38	2395(P)/25	2.262
1541(T)/25	2.461	1986(T)/25	2.148	2403(T)/25	2.358
1548(T)/25	2.95	1988(T)/25	2.229	2409(T)/25	2.359
1550(T)/25	2.199	1990(P)/25	2.534	2414(T)/25	2.359
1557(T)/25	2.96	2000(T)/25	2.39	2416(T)/25	2.599
1560(P)/25	2.354	2001(T)/25	2.200	2485(T)/25	2.359
1563(P)/25	2.435	2002(T)/25	2.39	2500(T)/25	2.41
1568(T)/25	2.356	2006(P)/25	2.435	2501(T)/25	2.99
1570(T)/25	2.34	2008(P)/25	2.580	2516(P)/25	2.129
1572(T)/25	2.259	2028(T)/25	2.201	2518(P)/25	2.583
1583(T)/25	2.356	2031(T)/25	2.201	2521(P)/25	2.439
1599(T)/25	2.199	2032(T)/25	2.357	2553(T)/25	2.463
1600(T)/25	2.356	2038(T)/25	2.39	2554(T)/25	2.77
1601(P)/25	2.289	2042(T)/25	2.97	2575(T)/25	2.477
1602(T)/25	2.199	2043(P)/25	2.535	2586(T)/25	2.99
1613(P)/25	2.259	2044(T)/25	2.97	2589(T)/25	2.100
1646(P)/25	2.532	2049(T)/25	2.76	2591(T)/25	2.130
1656(T)/25	2.34	2052(T)/25	2.317	2592(P)/25	2.41
1676(P)/25	2.129	2057(T)/25	2.462	2594(T)/25	2.599
1677(T)/25	2.34	2059(T)/25	2.463	2623(T)/25	2.290
1678(T)/25	2.461	2072(P)/25	2.317	2624(T)/25	2.42
1680(T)/25	2.486	2101(T)/25	2.148	2627(T)/25	2.599
1683(P)/25	2.34	2121(P)/25	2.536	2628(T)/25	2.42
1687(T)/25	2.129	2132(T)/25	2.39	2631(T)/25	2.202
1694(T)/25	2.461	2159(T)/25	2.260	2634(T)/25	2.359
1713(T)/25	2.200	2162(T)/25	2.148	2635(P)/25	2.77
1715(T)/25	2.35	2170(P)/25	2.358	2636(T)/25	2.409
1716(T)/25	2.148	2176(P)/25	2.536	2644(T)/25	2.477
1718(T)/25	2.148	2177(T)/25	2.582	2651(P)/25	2.290
1730(P)/25	2.35	2180(T)/25	2.583	2664(T)/25	2.360
1747(T)/25	2.35	2181(T)/25	2.358	2667(P)/25	2.42
1762(P)/25	2.532	2183(T)/25	2.97	2669(P)/25	2.130
1763(P)/25	2.397	2184(T)/25	2.98	2679(T)/25	2.100
1766(T)/25	2.200	2187(P)/25	2.201	2680(P)/25	2.130
1775(T)/25	2.200	2189(T)/25	2.98	2693(T)/25	2.239
1788(P)/25	2.228	2191(P)/25	2.436	2695(T)/25	2.239
1795(P)/25	2.159	2192(P)/25	2.537	2696(T)/25	2.149
1800(T)/25	2.96	2197(T)/25	2.463	2698(T)/25	2.239
1820(P)/25	2.228	2201(T)/25	2.463	2703(T)/25	2.160
1822(P)/25	2.533	2211(T)/25	2.201	2706(T)/25	2.149
1853(P)/25	2.356	2254(T)/25	2.463	2709(P)/25	2.202
1860(T)/25	2.228	2262(T)/25	2.98	2710(P)/25	2.131
1870(T)/25	2.96	2269(T)/25	2.98	2725(P)/25	2.537
1871(T)/25	2.579	2272(T)/25	2.261	2727(T)/25	2.464
1882(T)/25	2.229	2278(T)/25	2.261	2728(T)/25	2.100
1890(P)/25	2.200	2319(P)/25	2.436	2730(T)/25	2.291
1906(T)/25	2.290	2331(T)/25	2.358	2735(T)/25	2.464
1908(P)/25	2.357	2335(T)/25	2.261	2738(T)/25	2.464
1909(P)/25	2.76	2338(T)/25	2.76	2740(P)/25	2.439
1934(T)/25	2.96	2339(P)/25	2.76	2741(T)/25	2.131

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
2752(P)/25	2.262	3226(T)/25	2.361	3822(P)/25	2.362
2762(T)/25	2.149	3230(T)/25	2.318	3840(T)/25	2.104
2774(T)/25	2.43	3238(T)/25	2.398	3843(T)/25	2.49
2801(T)/25	2.262	3241(T)/25	2.150	3852(T)/25	2.49
2803(T)/25	2.537	3242(T)/25	2.361	3856(T)/25	2.77
2809(T)/25	2.360	3243(T)/25	2.361	3857(P)/25	2.49
2812(P)/25	2.291	3254(T)/25	2.583	3860(T)/25	2.207
2815(T)/25	2.203	3264(T)/25	2.102	3861(P)/25	2.541
2816(T)/25	2.203	3268(P)/25	2.132	3863(P)/25	2.207
2817(T)/25	2.203	3281(T)/25	2.467	3865(T)/25	2.208
2823(T)/25	2.291	3282(T)/25	2.467	3867(T)/25	2.229
2824(T)/25	2.360	3309(P)/25	2.206	3877(T)/25	2.151
2827(P)/25	2.537	3318(T)/25	2.206	3878(P)/25	2.49
2843(P)/25	2.204	3339(T)/25	2.263	3880(T)/25	2.50
2867(P)/25	2.263	3357(T)/25	2.362	3881(P)/25	2.50
2874(T)/25	2.540	3363(P)/25	2.443	3883(P)/25	2.584
2881(T)/25	2.398	3392(P)/25	2.443	3884(P)/25	2.50
2904(T)/25	2.204	3394(T)/25	2.263	3887(T)/25	2.265
2905(T)/25	2.100	3402(T)/25	2.293	3889(T)/25	2.104
2908(T)/25	2.486	3405(P)/25	2.207	3893(P)/25	2.77
2912(T)/25	2.101	3431(T)/25	2.45	3894(T)/25	2.409
2917(T)/25	2.101	3433(P)/25	2.45	3897(T)/25	2.444
2920(T)/25	2.101	3436(T)/25	2.468	3899(P)/25	2.105
2921(T)/25	2.77	3441(P)/25	2.468	3904(T)/25	2.151
2923(P)/25	2.440	3460(P)/25	2.46	3906(T)/25	2.151
2927(T)/25	2.77	3463(P)/25	2.540	3907(T)/25	2.160
2940(T)/25	2.101	3468(T)/25	2.583	3912(T)/25	2.265
2941(P)/25	2.43	3470(P)/25	2.318	3914(T)/25	2.293
2967(T)/25	2.464	3471(P)/25	2.318	3915(T)/25	2.444
2978(P)/25	2.45	3472(P)/25	2.319	3916(T)/25	2.208
2983(P)/25	2.442	3473(P)/25	2.541	3918(T)/25	2.208
2997(T)/25	2.204	3476(T)/25	2.102	3922(T)/25	2.208
3076(T)/25	2.360	3493(P)/25	2.319	3927(T)/25	2.208
3079(P)/25	2.464	3505(T)/25	2.468	3930(T)/25	2.209
3080(P)/25	2.318	3522(T)/25	2.399	3934(T)/25	2.209
3082(P)/25	2.205	3523(T)/25	2.399	3936(T)/25	2.293
3086(P)/25	2.292	3530(T)/25	2.103	3937(P)/25	2.541
3087(T)/25	2.101	3531(T)/25	2.103	3939(P)/25	2.319
3089(T)/25	2.102	3534(T)/25	2.103	3963(T)/25	2.362
3097(P)/25	2.149	3559(P)/25	2.468	3990(T)/25	2.399
3098(T)/25	2.131	3560(T)/25	2.468	3991(T)/25	2.363
3101(T)/25	2.239	3570(T)/25	2.468	4001(P)/25	2.209
3128(T)/25	2.442	3597(P)/25	2.263	4011(T)/25	2.541
3130(T)/25	2.150	3608(T)/25	2.46	4016(T)/25	2.50
3132(T)/25	2.131	3610(T)/25	2.399	4017(T)/25	2.51
3134(T)/25	2.102	3615(P)/25	2.104	4026(T)/25	2.105
3137(P)/25	2.540	3617(T)/25	2.207	4027(T)/25	2.320
3140(T)/25	2.150	3633(T)/25	2.150	4031(T)/25	2.160
3141(T)/25	2.160	3678(T)/25	2.362	4032(P)/25	2.542
3173(P)/25	2.132	3696(T)/25	2.469	4033(T)/25	2.78
3175(P)/25	2.600	3704(T)/25	2.264	4038(T)/25	2.584
3190(T)/25	2.205	3712(T)/25	2.362	4039(T)/25	2.106
3199(T)/25	2.205	3758(T)/25	2.151	4041(P)/25	2.294
3205(T)/25	2.45	3759(P)/25	2.46	4044(T)/25	2.132
3214(P)/25	2.540	3770(P)/25	2.47	4046(T)/25	2.294
3217(T)/25	2.361	3774(T)/25	2.319	4048(P)/25	2.542
3221(T)/25	2.467	3802(T)/25	2.151	4049(T)/25	2.363

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
4050(T)/25	2.265	4450(T)/25	2.400	4685(P)/25	2.112
4051(P)/25	2.51	4473(T)/25	2.108	4688(P)/25	2.113
4052(T)/25	2.106	4474(T)/25	2.108	4689(T)/25	2.60
4053(T)/25	2.444	4475(T)/25	2.584	4695(P)/25	2.113
4076(P)/25	2.53	4485(T)/25	2.57	4696(T)/25	2.113
4079(T)/25	2.133	4497(P)/25	2.444	4697(T)/25	2.61
4086(T)/25	2.106	4498(T)/25	2.108	4698(T)/25	2.114
4088(P)/25	2.229	4500(T)/25	2.109	4699(T)/25	2.114
4119(T)/25	2.400	4501(T)/25	2.543	4700(T)/25	2.114
4128(T)/25	2.469	4502(T)/25	2.152	4701(P)/25	2.134
4185(P)/25	2.54	4503(P)/25	2.500	4702(T)/25	2.61
4191(T)/25	2.600	4528(P)/25	2.366	4706(T)/25	2.114
4192(T)/25	2.229	4534(P)/25	2.298	4707(T)/25	2.61
4198(T)/25	2.230	4536(T)/25	2.57	4708(T)/25	2.61
4202(T)/25	2.151	4538(T)/25	2.469	4710(P)/25	2.62
4210(T)/25	2.133	4540(P)/25	2.58	4711(P)/25	2.115
4235(P)/25	2.54	4558(T)/25	2.109	4712(T)/25	2.445
4250(T)/25	2.133	4560(T)/25	2.58	4713(T)/25	2.217
4251(T)/25	2.55	4562(P)/25	2.543	4714(P)/25	2.504
4252(T)/25	2.107	4572(T)/25	2.400	4719(T)/25	2.266
4254(T)/25	2.107	4573(T)/25	2.400	4721(P)/25	2.544
4255(T)/25	2.133	4580(T)/25	2.487	4759(P)/25	2.487
4256(T)/25	2.152	4581(T)/25	2.298	4766(T)/25	2.585
4263(P)/25	2.55	4582(T)/25	2.299	4768(T)/25	2.160
4265(P)/25	2.107	4585(T)/25	2.299	4773(T)/25	2.153
4266(T)/25	2.107	4586(T)/25	2.110	4775(P)/25	2.470
4275(P)/25	2.294	4605(T)/25	2.58	4791(P)/25	2.134
4278(P)/25	2.55	4609(T)/25	2.543	4792(P)/25	2.585
4294(T)/25	2.486	4610(T)/25	2.58	4794(T)/25	2.153
4298(T)/25	2.469	4612(T)/25	2.58	4800(T)/25	2.134
4301(T)/25	2.469	4613(T)/25	2.110	4801(T)/25	2.470
4305(T)/25	2.297	4614(P)/25	2.59	4804(T)/25	2.115
4307(T)/25	2.210	4616(T)/25	2.299	4813(T)/25	2.470
4308(P)/25	2.56	4619(T)/25	2.216	4814(T)/25	2.487
4313(T)/25	2.56	4625(T)/25	2.444	4819(T)/25	2.153
4314(T)/25	2.363	4626(P)/25	2.501	4825(T)/25	2.153
4315(T)/25	2.152	4627(P)/25	2.217	4826(T)/25	2.410
4317(T)/25	2.152	4628(P)/25	2.543	4887(P)/25	2.445
4320(T)/25	2.160	4629(P)/25	2.217	4902(T)/25	2.62
4326(T)/25	2.400	4631(P)/25	2.543	4905(P)/25	2.366
4327(T)/25	2.400	4633(T)/25	2.544	4914(T)/25	2.585
4347(T)/25	2.363	4635(P)/25	2.300	4918(P)/25	2.544
4348(T)/25	2.133	4639(P)/25	2.605	4921(P)/25	2.487
4349(P)/25	2.210	4643(T)/25	2.59	4925(T)/25	2.217
4350(P)/25	2.543	4646(T)/25	2.59	4947(T)/25	2.478
4352(T)/25	2.444	4649(T)/25	2.152	4955(P)/25	2.504
4371(P)/25	2.56	4650(T)/25	2.110	4963(P)/25	2.585
4385(T)/25	2.265	4652(P)/25	2.584	4964(T)/25	2.367
4386(T)/25	2.364	4653(P)/25	2.445	4987(T)/25	2.134
4387(P)/25	2.298	4654(P)/25	2.501	4989(T)/25	2.135
4390(T)/25	2.409	4656(T)/25	2.111	4998(T)/25	2.266
4392(T)/25	2.365	4657(P)/25	2.59	4999(T)/25	2.115
4404(P)/25	2.210	4663(T)/25	2.320	5000(T)/25	2.367
4412(T)/25	2.365	4665(T)/25	2.320	5001(T)/25	2.501
4413(P)/25	2.365	4674(T)/25	2.300	5032(T)/25	2.115
4429(T)/25	2.365	4681(P)/25	2.111	5034(T)/25	2.445
4441(P)/25	2.56	4683(P)/25	2.112	5035(P)/25	2.266

NUMERICAL INDEX OF NOTICES IN FORCE ON 19th DECEMBER 2025 (continued)

Notice No.	Page	Notice No.	Page	Notice No.	Page
5036(T)/25	2.501	5418(P)/25	2.65	5677(P)/25	2.121
5049(P)/25	2.267	5420(T)/25	2.548	5679(T)/25	2.589
5050(T)/25	2.62	5421(T)/25	2.502	5680(P)/25	2.68
5080(T)/25	2.300	5423(P)/25	2.118	5682(T)/25	2.219
5095(P)/25	2.217	5424(T)/25	2.218	5683(P)/25	2.548
5105(T)/25	2.62	5434(T)/25	2.503	5685(P)/25	2.320
5106(T)/25	2.63	5439(T)/25	2.478	5700(P)/25	2.478
5107(T)/25	2.116	5441(T)/25	2.488	5707(T)/25	2.137
5109(T)/25	2.116	5444(T)/25	2.230	5712(T)/25	2.478
5120(T)/25	2.586	5450(P)/25	2.268	5739(P)/25	2.305
5136(T)/25	2.470	5461(T)/25	2.401	5741(P)/25	2.478
5138(T)/25	2.471	5462(T)/25	2.401	5751(T)/25	2.68
5140(T)/25	2.471	5463(T)/25	2.401	5760(T)/25	2.473
5151(T)/25	2.300	5468(P)/25	2.119	5767(T)/25	2.137
5152(T)/25	2.446	5469(P)/25	2.135	5777(T)/25	2.474
5181(P)/25	2.116	5470(T)/25	2.65	5778(P)/25	2.474
5185(P)/25	2.547	5471(T)/25	2.503	5779(T)/25	2.474
5186(T)/25	2.547	5473(T)/25	2.503	5782(T)/25	2.474
5204(T)/25	2.63	5496(P)/25	2.66	5784(T)/25	2.606
5207(T)/25	2.401	5521(P)/25	2.218	5785(T)/25	2.137
5208(T)/25	2.401	5522(P)/25	2.66	5787(T)/25	2.69
5209(T)/25	2.487	5524(P)/25	2.587	5788(T)/25	2.446
5216(T)/25	2.301	5526(P)/25	2.446	5790(P)/25	2.219
5217(T)/25	2.218	5528(P)/25	2.135	5791(P)/25	2.220
5224(T)/25	2.268	5531(T)/25	2.135	5792(T)/25	2.122
5225(P)/25	2.547	5534(P)/25	2.66	5796(P)/25	2.69
5226(T)/25	2.446	5536(T)/25	2.119	5800(T)/25	2.447
5229(P)/25	2.301	5551(T)/25	2.473	5804(P)/25	2.161
5230(T)/25	2.587	5559(T)/25	2.473	5813(P)/25	2.269
5245(T)/25	2.117	5564(T)/25	2.402	5833(T)/25	2.231
5251(T)/25	2.471	5568(T)/25	2.135	5837(P)/25	2.369
5256(T)/25	2.471	5569(T)/25	2.119	5844(P)/25	2.321
5257(T)/25	2.471	5570(T)/25	2.473		
5258(T)/25	2.472	5572(T)/25	2.67		
5263(T)/25	2.472	5573(P)/25	2.605		
5285(T)/25	2.135	5577(P)/25	2.67		
5299(T)/25	2.63	5578(T)/25	2.473		
5303(T)/25	2.587	5582(T)/25	2.368		
5313(T)/25	2.64	5583(T)/25	2.368		
5314(T)/25	2.64	5587(T)/25	2.120		
5315(P)/25	2.64	5592(T)/25	2.269		
5317(T)/25	2.64	5594(T)/25	2.120		
5318(T)/25	2.154	5595(T)/25	2.230		
5332(T)/25	2.401	5596(T)/25	2.503		
5342(P)/25	2.118	5597(T)/25	2.503		
5349(T)/25	2.118	5599(T)/25	2.219		
5350(T)/25	2.230	5619(T)/25	2.588		
5354(P)/25	2.367	5635(T)/25	2.473		
5363(T)/25	2.268	5645(T)/25	2.589		
5379(P)/25	2.118	5646(P)/25	2.67		
5380(T)/25	2.304	5648(T)/25	2.68		
5381(T)/25	2.304	5649(T)/25	2.68		
5385(P)/25	2.488	5652(P)/25	2.136		
5405(P)/25	2.218	5657(T)/25	2.269		
5410(T)/25	2.65	5667(P)/25	2.120		
5413(P)/25	2.502	5672(T)/25	2.136		
5414(P)/25	2.368	5676(T)/25	2.548		

(2) UNITED KINGDOM AND IRELAND

397(T)/14 IRELAND - West Coast - Light-beacons. Pontoon.

Source: Commissioners of Irish Lights

- Two yellow light-beacons have been established in the following positions (OSI Datum), to mark a pontoon:

<i>Position</i>	<i>Characteristic</i>
54° 38'·050N., 8° 26'·577W.	Fl(2)Y.5s
54° 38'·067N., 8° 26'·538W.	Fl.Y.5s

Chart affected — 2792**1073(T)/22 CHANNEL ISLANDS - Guernsey - Buoyage. Measuring instruments.**

Source: Guernsey Harbours Notice 26/20

- Marine mammal monitoring instruments, marked by white buoys, have been established in the following positions:

49° 27'·600N., 2° 31'·400W.
49° 26'·900N., 2° 31'·600W.

- Former Notice 4385(T)/20 is cancelled.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 807 — 808 — 3140 — 3654**1108(T)/22 SCOTLAND - West Coast - Buoyage.**

Source: Peel Ports Clydeport Notice 3/22

- Due to dredging works in the approaches to Clydeport Greenock Ocean Terminal, the following light-buoys have been temporarily moved to the following positions:

<i>Characteristic</i>	<i>Designation</i>	<i>New Position</i>
*Fl.R.2s	No 4	55° 57'·439N., 4° 45'·449W.
Fl.R.2s	No 12	55° 57'·008N., 4° 44'·935W.

- The light-buoy, Fl.G.5s, in position 55° 57'·065N., 4° 45'·242W. has been moved to 55° 57'·085N., 4° 45'·270W.
- *Former Notice 1468(T)/21 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1994 — 5610_3**1662(T)/22 CHANNEL ISLANDS - Guernsey - Light-beacon.**

Source: Guernsey Harbour Authority

- The Roustel light-beacon, Q.8m7M, in position 49° 29'·23N., 2° 28'·79W., has been severely damaged, is currently off-station, and the light has been extinguished.
- Mariners are advised to navigate with caution in the area and maintain a 50m-wide berth.
(WGS84 DATUM)

Charts affected — 807 — 808 — 3654 — 5604_10 — 5604_9**2352(T)/22 WALES - North Coast - Wrecks. Buoy.**

Source: Holyhead Port Authority

- Two dangerous wrecks exist in the vicinity of position 53° 19'·396N., 4° 38'·533W.
- *These wrecks are marked by an isolated danger light-buoy, Fl(2)10s.
- Mariners are advised to navigate with caution in the area.
- Former Notice 1667(T)/20 is cancelled.
(ETRS89 DATUM)
* Indicates new or revised entry

Chart affected — 1413

2721(T)/22 SCOTLAND - East Coast - Wind turbine. Light.

Source: Cromarty Firth Port Authority

1. * A wind turbine hull structure, KIN-01, is being temporarily stored, in position 57° 41'·030N., 4° 04'·526W.
2. A navigational light, Fl.Y.5s3M, marks each corner of the structure.
3. Mariners are advised to navigate with caution in the area.
4. * Former Notice 4557(T)/21 is cancelled.
* Indicates a new or revised entry.
(ETRS89 DATUM)

Charts affected — 1077 — 1889**2867(T)/22 SCOTLAND - East Coast - Dredging area. Depths. Works.**

Source: UKHO

1. Dredging works are taking place in the area bounded by the following positions:
57° 40' .831N. , 2° 57' .711W.
57° 40' .824N. , 2° 57' .637W.
57° 40' .814N. , 2° 57' .569W.
57° 40' .838N. , 2° 57' .480W.
57° 40' .828N. , 2° 57' .471W.
57° 40' .803N. , 2° 57' .538W.
57° 40' .803N. , 2° 57' .578W.
57° 40' .808N. , 2° 57' .636W.
57° 40' .810N. , 2° 57' .634W.
57° 40' .813N. , 2° 57' .643W.
57° 40' .808N. , 2° 57' .649W.
57° 40' .814N. , 2° 57' .716W.
2. Depths less than charted exist in the entrance to the harbour.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. Former Notice 3795(T)/21 is cancelled.
(ETRS89 DATUM)

Charts affected — 1462 — 5617_18**2946(T)/22 ENGLAND - East Coast - Buoy. Wreck.**

Source: PD Teesport Limited Notice 40/22

1. A red light-buoy, *Q.W.*, marking a wreck has been established, within the River Tees, in position 54° 34'·86N., 1° 12'·06W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Chart affected — 2566**3375(T)/22 WALES - North Coast - Works. Submarine pipeline. Lights.**

Source: Conwy County Borough Council

1. Beach nourishment works are taking place in Colwyn Bay within the area bounded by the following positions:
53° 18'·73N., 3° 44'·28W.
53° 19'·07N., 3° 43'·92W.
53° 19'·07N., 3° 41'·53W.
53° 18'·48N., 3° 41'·76W.
53° 17'·81N., 3° 43'·33W.
2. A pipeline, consisting of a sinker line and floating pipeline, will be temporarily installed joining the following positions:
53° 18'·35N., 3° 43'·98W.
53° 18'·78N., 3° 43'·47W.
53° 18'·98N., 3° 43'·31W.
3. The floating pipeline will be marked by three white lights with a range of 3 miles.

3375(T)/22 WALES - North Coast - Works. Submarine pipeline. Lights. (continued)

- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1978 — 5609_13

3381(P)/22 WALES - West Coast - Marine farm. Buoyage. Works.

Source: Car-Y-Mor and Cambrian Offshore

- A new marine farm is being installed, with limits marked by yellow special light-buoys, *Fl.5s*, in the following positions:

51° 52'·40N., 5° 18'·75W.
 51° 52'·39N., 5° 18'·66W.
 51° 52'·32N., 5° 18'·79W.
 51° 52'·31N., 5° 18'·70W.
 51° 52'·24N., 5° 18'·82W.
 51° 52'·23N., 5° 18'·73W.

- Works are taking place within *Ramsey Sound* to recover a seabed tidal energy device, in an area bounded by the following positions:

51° 53'·02N., 5° 19'·95W.
 51° 53'·09N., 5° 19'·17W.
 51° 52'·72N., 5° 18'·92W.
 51° 52'·25N., 5° 19'·07W.
 51° 52'·28N., 5° 19'·84W.
 51° 52'·66N., 5° 19'·70W.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when works are complete.
(ETRS89 DATUM)

Charts affected — 1478 — 1973 — 5620_7 — 5620_8 — 5620_9

3875(T)/22 ENGLAND - South Coast - Works.

Source: Lymington Harbour Notice 9/22

- Harbour works are taking place within an area bounded by the following positions:

50° 45'·428N., 1° 31'·751W.
 50° 45'·431N., 1° 31'·727W.
 50° 45'·391N., 1° 31'·704W.
 50° 45'·386N., 1° 31'·730W.
 50° 45'·398N., 1° 31'·742W.

- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2021 — 5600_4

4657(P)/22 ENGLAND - South Coast - General information.

Source: King's Harbour Master Portsmouth

- With effect from 10th September 2022, Queen's Harbour Master Portsmouth (QHM) will be known as King's Harbour Master Portsmouth (KHM). All references to QHM should be replaced by KHM.
- These changes will be updated in the next New Edition.

Charts affected — 2022 — 2628 — 5600_13

432(P)/23 IRELAND - West Coast - Quay. Works. Dredging area.

Source: Department of Transport Notice 77/22

- Quay construction works and dredging are taking place at Killybegs Harbour in the vicinity of North Quay (54° 37'·853N., 8° 26'·400W.)
- Mariners are advised to navigate with caution in the area.

432(P)/23 IRELAND - West Coast - Quay. Works. Dredging area. (continued)

3. Charts will be updated when works are complete.
(ETRS89 DATUM)

Charts affected — 2702 — 2792

437(T)/23 CHANNEL ISLANDS - Alderney - Beacon.

Source: Guernsey Harbours Notice 26/21 and UKHO

1. The unlit north cardinal beacon in position 49° 43'·482N., 2° 12'·059W. is missing.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 3815(T)/21 is cancelled.
4. *NOTE: Content of Notice unchanged, re-issued to include Chart 5604_8
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2845 — 5604_8

438(T)/23 IRELAND - South Coast - Buoy.

Source: Port of Waterford Notice 8/20 and UKHO

1. Yellow special light-buoys, *Fl.Y.6s*, for data monitoring, have been established in the following positions:

52° 16'·00N., 6° 58'·74W.
52° 15'·55N., 7° 02'·10W.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 3728(T)/20 is cancelled.
4. *NOTE: Content of Notice unchanged, re-issued to include Chart 5622_4
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 2046 — 5622_4

459(P)/23 WALES - West Coast - Depths.

Source: British Government Survey and UKHO

1. Recent survey information has shown that numerous depths less than charted exist between Strumble Head and Saint David's Head. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
5m	52° 01'·88N., 5° 04'·55W.
4·2m	52° 00'·59N., 5° 05'·42W.
23m	52° 00'·29N., 5° 07'·14W.
7·6m	51° 59'·89N., 5° 05'·65W.
28·5m	51° 59'·48N., 5° 18'·33W.
18·6m	51° 58'·87N., 5° 06'·41W.
16·4m	51° 58'·20N., 5° 20'·01W.
10·8m	51° 58'·19N., 5° 07'·64W.
5·2m	51° 57'·83N., 5° 07'·54W.
11·7m	51° 57'·83N., 5° 20'·34W.
18·6m	51° 57'·82N., 5° 10'·00W.
34m	51° 57'·76N., 5° 15'·75W.
13·8m	51° 57'·63N., 5° 09'·60W.
29·5m	51° 57'·61N., 5° 13'·15W.
8·9m	51° 57'·40N., 5° 20'·97W.
11·3m	51° 57'·20N., 5° 11'·42W.
32m	51° 56'·51N., 5° 19'·18W.
9·4m	51° 56'·31N., 5° 22'·77W.
4·5m	51° 56'·18N., 5° 14'·40W.
18·6m	51° 55'·94N., 5° 15'·88W.
24·5m	51° 55'·79N., 5° 16'·66W.
5·2m	51° 55'·68N., 5° 15'·01W.
29·5m	51° 55'·10N., 5° 19'·67W.
30m	51° 54'·88N., 5° 21'·42W.

2. Mariners are advised to navigate with caution in the area.

459(P)/23 WALES - West Coast - Depths. (continued)

- *These and other changes will be included in the next New Editions of Charts 1178, 1410, 1482, 1973, 5621_2, 5620_2, 5620_3, 5620_7, and 5620_8
- *Former Notice 5234(P)/21 is cancelled.
- *NOTE: Content of Notice unchanged, re-issued to include Charts 5620_2, 5620_3, 5620_7, and 5620_8.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1178 — 5620_3 — 5621_2**902(T)/23 SCOTLAND - West Coast - Works. Berth.**

Source: Caledonian Maritime Assets Ltd

- Works are taking place in the vicinity of Scalasaig Pier in position 56° 04'·129N., 6° 11'·051W.
- During the duration of the works, the North Berth remains closed.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Chart affected — 2474**1804(T)/23 ENGLAND - South Coast - Buoy. Automatic Identification System.**

Source: National Oceanography Centre

- The yellow light-buoy, *Fl(5)Y.20s EI*, and associated Automatic Identification System, *AIS*, in position 50° 02'·60N., 4° 22'·50W. is off station until further notice.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 442 — 1267 — 2655 — 2656 — 5602_1**2438(P)/23 ENGLAND - South Coast - Restricted areas.**

Source: DEFRA

- Highly Protected Marine Areas (HPMAs) in English waters have been designated in the following areas:

Dolphin Head

50° 11'·18N., 1° 00'·00W.
 50° 16'·89N., 0° 26'·10W.
 50° 09'·46N., 0° 24'·97W.
 50° 07'·43N., 0° 30'·08W.
 50° 08'·40N., 1° 00'·08W.

Allonby Bay

54° 47'·24N., 3° 29'·29W.
 54° 46'·08N., 3° 25'·97W.
 54° 43'·89N., 3° 28'·85W.
 54° 44'·26N., 3° 29'·91W.
 54° 44'·33N., 3° 30'·86W.
 54° 45'·28N., 3° 33'·01W.
 54° 46'·48N., 3° 31'·50W.

North East of Farnes Deep

55° 51'·93N., 0° 46'·75W.
 55° 52'·40N., 0° 27'·93W.
 55° 38'·90N., 0° 26'·95W.
 55° 38'·43N., 0° 45'·58W.

- Management measures including byelaws will be notified by the Marine Management Organisation in due course.
- Charts will be updated when full details are available.
(ETRS89 DATUM)

Charts affected — 268 — 1192 — 1346 — 1407 — 2013 — 2182A — 2182B — 2450 — 2613 — 2656 — 2675 — 5500 — 5604_1 — 5605_1 — 5613_15 — 5615_2 — 5615_23**3625(T)/23 SCOTLAND - West Coast - Marina. Light.**

Source: Lochmaddy Marina

- Due to extensive damage, the Lochmaddy Marina has been closed until further notice.

3625(T)/23 SCOTLAND - West Coast - Marina. Light. (continued)

- The light, Fl.R.3s2.5m2M, in position 57° 35'·780N., 7° 09'·499W., has been temporarily extinguished.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 2825 — 5616_24**4154(T)/23 ENGLAND - South Coast - Beacon. Buoy.**

Source: Poole Harbour Commissioners Notice 25/23

- The unlit beacon in position 50° 42'·258N., 1° 59'·869W. is reported as submerged. It is marked by a yellow buoy.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2611 — 5601_11**4162(T)/23 SCOTLAND - West Coast - Light. Works.**

Source: Northern Lighthouse Board Notice 07/2023

- The range of the light in position 56° 58'·15N., 6° 40'·84W. has been temporarily reduced to 12 miles due to the ongoing refurbishment works of the Hyskeir lighthouse.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1127 — 1795 — 1796 — 2635 — 5616_12 — 5616_13 — 5616_14 — 5616_27**4253(T)/23 SCOTLAND - Shetland Islands - Light.**

Source: Northern Lighthouse Board 8/23

- The range of the light at Sumburgh Head, in position 59° 51'·23N., 1° 16'·50W. has been temporarily reduced to 12 miles.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 219 — 1119 — 1239 — 2182C — 3283**4406(T)/23 SCOTLAND - West Coast - Lights. Beacons.**

Source: KHM Clyde NM 32/23

- The sectored lights on beacons 7N and 8N in the following positions are reported as temporarily discontinued.
56° 00'·055N., 4° 45'·358W.
55° 59'·088N., 4° 44'·205W.
- The passing lights which mark both structures are still operational.
7N: Oc.G.6s6m3M
8N: Fl.Y.3s6m3M
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1994 — 2000 — 5610_3**4979(P)/23 ENGLAND - East Coast - Works. Pontoon.**

Source: Port of Great Yarmouth Notice 31/23

- Works are taking place at Berth 1, 52° 34'·516N., 1° 44'·031E.
- Construction of additional pontoon facilities are taking place in the vicinity of position 52° 34'·413N., 1° 44'·033E.
- Mariners are advised to navigate with caution in the area.
- Charts will be updated when works are complete.
(ETRS89 DATUM)

Charts affected — 1534 — 5614_4 — 5614_5

242(T)/24 IRELAND - West Coast - Buoy.

Source: Irish Maritime Administration

1. A yellow spherical buoy, *Fl.20s*, has been established in position 53° 03'·43N., 9° 45'·45W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2173 — 3338 — 3339**326(T)/24 ENGLAND - South Coast - Scientific instruments.**

Source: KHM Plymouth 61/23

1. Scientific instruments have been temporarily established on the seabed, until February 2024, in the following positions:
50° 20'·834N., 4° 09'·563W.
50° 21'·987N., 4° 11'·621W.
2. They will reduce the charted depth by approximately 1m.
3. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 30 — 871 — 1901 — 1902 — 1967 — 5602_14 — 5602_15 — 5602_16 — 5602_17**482(T)/24 ENGLAND - East Coast - Obstruction.**

Source: Perenco UK

1. An obstruction exists in position 52° 56'·60N., 2° 07'·56E., extending approximately 6m from the seabed.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 106 — 1408 — 1503**502(P)/24 IRELAND - West Coast - Depths. Drying heights.**

Source: Irish Geological Survey

1. Recent survey information has shown that numerous depths and drying heights less than charted exist between Mweenish Island and North Sound. The most significant are as follows:

Depth	Position
Drying 0·5m	53° 17'·64N., 9° 51'·66W.
10·6m	53° 16'·95N., 9° 52'·22W.
7·7m	53° 16'·59N., 9° 51'·87W.
7·9m	53° 16'·89N., 9° 51'·67W.
3·9m	53° 17'·04N., 9° 51'·48W.
4·9m	53° 17'·03N., 9° 51'·22W.
4·7m	53° 16'·46N., 9° 51'·31W.
2m	53° 16'·56N., 9° 51'·14W.
5·5m	53° 16'·49N., 9° 50'·86W.
0·1m	53° 16'·64N., 9° 50'·71W.
Drying 0·4m	53° 16'·74N., 9° 50'·51W.
0·5m	53° 16'·87N., 9° 49'·67W.
3·3m	53° 16'·79N., 9° 50'·06W.
5·8m	53° 16'·32N., 9° 50'·32W.
6·7m	53° 16'·02N., 9° 50'·09W.
3·2m	53° 16'·09N., 9° 49'·71W.
1m	53° 16'·03N., 9° 49'·04W.
1·5m	53° 16'·44N., 9° 48'·18W.
12·1m	53° 15'·35N., 9° 47'·93W.
3·1m	53° 16'·16N., 9° 47'·03W.
13·3m	53° 14'·14N., 9° 46'·62W.
4·5m	53° 17'·06N., 9° 46'·14W.
3·6m	53° 17'·08N., 9° 45'·85W.
2·4m	53° 17'·59N., 9° 45'·72W.
1·5m	53° 17'·15N., 9° 45'·70W.
7·4m	53° 16'·07N., 9° 43'·83W.

2. Mariners are advised to navigate with caution in the area.

502(P)/24 IRELAND - West Coast - Depths. Drying heights. (continued)

3. These changes will be included in the next New Edition of Charts 1820, 2096, 2709, 3339.
(ETRS89 DATUM)

Charts affected — 1820 — 2096 — 2709 — 3339

515(T)/24 ENGLAND - East Coast - Works.

Source: Port of London Authority

1. *Works are in progress at London Gateway Container Terminal, in an area bounded by the following positions:

51° 30'·228N., 0° 28'·060E.
51° 30'·072N., 0° 28'·114E.
51° 30'·196N., 0° 29'·233E.
51° 30'·158N., 0° 29'·243E.
51° 30'·162N., 0° 29'·298E.
51° 30'·090N., 0° 29'·320E.
51° 29'·938N., 0° 27'·979E.
51° 30'·217N., 0° 27'·873E.
51° 30'·237N., 0° 28'·016E.
51° 30'·229N., 0° 28'·022E.
51° 30'·226N., 0° 28'·028E.
51° 30'·224N., 0° 28'·029E.
51° 30'·222N., 0° 28'·038E.

2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 1496(T)/23 is cancelled.
* Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1186 — 5606_8

565(T)/24 IRELAND - East Coast - Buoyage.

Source: Irish Maritime Organisation

1. Two wave buoys, *Fl(5)Y.20s*, have been deployed, until further notice, in positions:

52° 15'·489N., 6° 19'·815W.
52° 15'·79N., 6° 20'·41W.

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1772 — 1787 — 5621_11 — 5621_15

775(T)/24 SCOTLAND - Shetland Islands - Buoy.

Source: Scottish Sea Farms

1. A yellow wave monitoring buoy has been deployed in position 60° 20'·92N., 0° 55'·16W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 3282 — 3284

789(T)/24 IRELAND - South Coast - Buoyage.

Source: Port of Cork

1. Special purpose light-buoys have been established as follows:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl.Y.5s</i>	<i>WQ 1</i>	51° 49'·38N., 8° 16'·66W.
<i>Fl(2)Y.5s</i>	<i>WQ 2</i>	51° 50'·49N., 8° 19'·76W.
<i>Fl(3)Y.5s</i>	<i>WQ 3</i>	51° 53'·22N., 8° 22'·24W.
<i>Fl(4)Y.10s</i>	<i>WQ 4</i>	51° 54'·09N., 8° 24'·26W.

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1773 — 1777 — 5622_10 — 5622_11 — 5622_12

829(T)/24 ENGLAND - South Coast - Works. Buoyage.

Source: King's Harbour Master Portsmouth

1. Works are taking place in the vicinity of Ryde Pier, in an area bounded by the following positions:

50° 44'·33N., 1° 09'·80W.
 50° 44'·29N., 1° 09'·80W.
 50° 44'·29N., 1° 09'·70W.
 50° 43'·99N., 1° 09'·65W.
 50° 43'·99N., 1° 09'·62W.
 50° 44'·33N., 1° 09'·68W.

2. Lit and unlit yellow pillar buoys have been established in the following positions:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl.Y.5s</i>	<i>Westerly Buoy</i>	50° 44'·31N., 1° 09'·78W.
	<i>Central Buoy</i>	50° 44'·32N., 1° 09'·75W.
	<i>Easterly Buoy</i>	50° 44'·32N., 1° 09'·72W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 2036 — 5600_13**1219(T)/24 ENGLAND - East Coast - Wreck.**

Source: Peel Ports London Medway

1. A dangerous wreck, with a least depth of 1·6m, has been reported in approximate position 51° 23'·623N., 0° 30'·244E.
2. Mariners are advised to navigate with caution in the area.
3. Former Notice 1891(T)/23 is cancelled.
(ETRS89 DATUM)

Charts affected — 1835 — 2482 — 5606_11**1221(P)/24 ENGLAND - South Coast - Wreck.**

Source: Maritime and Coastguard Agency

1. A non-dangerous wreck has been reported in position 50° 11'·27N., 3° 58'·49W.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(ETRS89 DATUM)

Charts affected — 442 — 1613 — 2655 — 5602_1 — 5602_6 — 5604_2**1223(T)/24 ENGLAND - South Coast - Works.**

Source: King's Harbour Master Plymouth

1. Piling and demolition works are taking place within Millbay Docks (50° 21'·855N., 4° 09'·330W.).
2. Mariners are requested to maintain a safe distance and minimise wash when passing vessels engaged in operations.
3. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1901 — 1967 — 5602_15 — 5602_16**1403(T)/24 ENGLAND - South Coast - Buoy.**

Source: Southern Water

1. The light-buoy, *Fl(5)Y.20s*, in position 50° 46'·57N., 0° 59'·49W. is reported off station. The lower half of the mooring remains in situ.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2037 — 2045 — 3418 — 5600_16 — 5600_17 — 5600_3

1436(P)/24 SCOTLAND - Shetland Islands - Works. Submarine pipeline. Manifolds.

Source: Shell UK Limited

1. Work is taking place in the Victory Gas field.
2. Submarine pipeline laying operations are taking place until August 2024, joining the following positions:

60° 56'·04N., 2° 14'·01W.
60° 56'·28N., 2° 10'·76W.
60° 58'·10N., 1° 54'·61W.
60° 50'·00N., 1° 48'·18W.

3. Manifolds will be installed in the following positions.

60° 50'·00N., 1° 48'·18W.
60° 58'·10N., 1° 54'·61W.

4. Work will continue until the end of 2025.
5. Charts will be updated when full details become available.
6. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 219 — 1233 — 1239 — 2182C — 2182D

2510(T)/24 SCOTLAND - Shetland Islands - Scientific instruments. Buoyage.

Source: Scottish Sea Farms

1. Scientific instruments, marked by red spherical buoys, have been established on the seabed in the following positions:

60° 25'·67N., 0° 47'·27W.
60° 21'·95N., 0° 55'·59W.
60° 20'·68N., 0° 56'·58W.
60° 19'·87N., 0° 58'·03W.
60° 20'·11N., 1° 06'·22W.

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 3282 — 3284

2513(P)/24 IRELAND - South Coast - Submarine power cable.

Source: Jan De Nul

1. A submarine power cable is being laid joining the following approximate positions:

52° 10'·63N., 6° 49'·85W.
52° 10'·83N., 6° 48'·65W.
52° 08'·68N., 6° 47'·28W.
52° 03'·72N., 6° 46'·97W.
52° 00'·97N., 6° 43'·38W.
51° 54'·53N., 6° 38'·51W.
51° 52'·52N., 6° 35'·59W.
51° 45'·51N., 6° 29'·93W.
51° 42'·36N., 6° 21'·25W.
51° 40'·76N., 6° 06'·00W.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
4. Former Notice 2559(P)/23 is cancelled.
(ETRS89 DATUM)

Charts affected — 1121 — 1123 — 1178 — 2049 — 5620_1 — 5621_14 — 5621_18 — 5621_2 — 5622_1

2652(P)/24 SCOTLAND - Shetland Islands - Depths.

Source: UKHO

- Depths less than charted exist within Scalloway Harbour. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
8·4m	60° 07'·898N., 1° 17'·104W.
8·2m	60° 07'·914N., 1° 17'·063W.
1·9m	60° 07'·967N., 1° 16'·244W.
3·1m	60° 08'·061N., 1° 16'·164W.
0·6m	60° 08'·177N., 1° 16'·156W.

- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Chart affected — 3294**2671(T)/24 IRISH SEA - Buoy. Automatic Identification System.**

Source: Marine Space, EnBW and BP

- A yellow light-buoy, *Fl(5)Y.20s*, and associated Automatic Identification Systems, *AIS*, has been established in position 53° 40'·05N., 3° 53'·49W.
- Mariners are advised to navigate with caution in the area.
- Former notice 1302(T)/24 is cancelled.
(ETRS89 DATUM)

Charts affected — 1826 — 5613_1**3256(P)/24 SCOTLAND - West Coast - Depths. Drying heights.**

Source: mv Lode

- Recent survey information has shown that numerous depths and drying heights less than charted, exist around Neist Point and within Moonen Bay. The most significant are:

<i>Depth</i>	<i>Position</i>
16·9m	57° 25'·79N., 6° 47'·33W.
6·3m	57° 25'·55N., 6° 47'·32W.
7·5m	57° 24'·10N., 6° 44'·36W.
7·6m	57° 23'·74N., 6° 44'·22W.
<i>Drying Height</i>	<i>Position</i>
0·7m	57° 25'·22N., 6° 47'·35W.

- Mariners are advised to navigate with caution in the area and consult the ENC and local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 1757 — 1795 — 5616_10 — 5616_11 — 5616_12**3339(P)/24 IRELAND - West Coast - Depths.**

Source: rv Lir

- *Depths significantly less than charted exist between Slyne Head and Ballinaleama Bay, the approaches to Roundstone, and Cashla Bay. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
0·9m	53° 24'·00N., 10° 14'·59W.
5·6m	53° 23'·57N., 10° 14'·27W.
3·8m	53° 23'·89N., 10° 10'·93W.
1·7m	53° 24'·73N., 10° 09'·67W.
*6·6m	53° 21'·90N., 9° 58'·44W.
*6·1m	53° 20'·86N., 9° 55'·37W.
*6·6m	53° 20'·64N., 9° 54'·92W.
*5·6m	53° 17'·67N., 9° 54'·82W.
*3·6m	53° 17'·59N., 9° 53'·07W.
*3·4m	53° 14'·93N., 9° 33'·90W.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.

3339(P)/24 IRELAND - West Coast - Depths. (continued)

- Former Notice 2701(P)/24 is cancelled.

*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1820 — 2096 — 2708 — 2709 — 3339

3764(T)/24 ENGLAND - South Coast - Buoy.

Source: Plymouth Marine Laboratory

- A lyellow pillar light-buoy, *Fl(5)Y.20s*, has been established in position 50° 16'·20N., 4° 12'·95W.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 442 — 1267 — 1613 — 1900 — 5602_13 — 5602_4 — 5602_6

3943(T)/24 SCOTLAND - Orkney Islands - Wreck.

Source: HM Coastguard UK

- A dangerous wreck exists in position 58° 55'·42N., 2° 47'·70W.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Chart affected — 2250

4007(P)/24 ENGLAND - East Coast - Jetty. Works.

Source: Peel Ports Group Ltd

- Jetty replacement works are taking place, in an area bounded by the following positions:

51° 24'·169N., 0° 31'·577E.
51° 24'·159N., 0° 31'·631E.
51° 24'·128N., 0° 31'·618E.
51° 24'·148N., 0° 31'·562E.
51° 24'·149N., 0° 31'·563E.
51° 24'·150N., 0° 31'·564E.
51° 24'·153N., 0° 31'·569E.
51° 24'·157N., 0° 31'·572E.
51° 24'·161N., 0° 31'·573E.
51° 24'·165N., 0° 31'·574E.
51° 24'·167N., 0° 31'·576E.

- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1835 — 2482 — 5606_11

4143(T)/24 SCOTLAND - Orkney Islands - Platform. Chains and anchors.

Source: Dana Petroleum

- A lit platform, Western Isles, has been established in position 58° 54'·22N., 3° 07'·69W.
- Associated anchors and chains remain on the seabed and extend up to 800m from the position stated above.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 35 — 2249

4161(P)/24 ENGLAND - West Coast - Depths. Wreck.

Source: mv Lode & UKHO.

- Depths less than charted exist within the approaches to Morecambe Bay. The most significant depth is 0·1m in position 53° 53'·80N., 3° 06'·82W.
- *The wreck of SS Lyra has shifted to position 53° 55'·13N., 3° 06'·82W., with a drying height of 0·6m.
- Mariners are advised to navigate with caution in the area.

4161(P)/24 ENGLAND - West Coast - Depths. Wreck. (continued)

4. * Former Notice 2562(P)/24 is cancelled.
(ETRS89 DATUM)

Charts affected — 1320 — 1826 — 1981 — 2010 — 5613_1 — 5613_10 — 5613_9

4394(T)/24 ENGLAND - West Coast - Perch. Buoy.

Source: Preston City Council

1. The 8.5 mile lit perch, in position 53° 43'·61N., 2° 56'·78W., has been reported severely damaged and likely to be submerged other than at low tide.
2. *A starboard-hand green buoy, *Fl. G. 5s*, currently marks the damaged perch.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. *Former Notice 1081(T)/22 is cancelled.
*Indicates new or revised entry.
(ETRS89 DATUM)

Charts affected — 1981 — 5613_8

4445(T)/24 ENGLAND - East Coast - Restricted area.

Source: Port of Tyne Notice 33/24

1. A restricted area, entry prohibited, has been established bounded by the following positions:
54° 59'·271N., 1° 26'·930W.
54° 59'·278N., 1° 26'·955W.
54° 59'·357N., 1° 26'·881W.
54° 59'·350N., 1° 26'·856W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1934 — 5615_21

4447(P)/24 IRELAND - West Coast - Depths.

Source: rv Galtee

1. Depths less than charted exist within the approaches to Westport Bay. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
5.1m	53° 48'·568N., 9° 43'·939W.
7.4m	53° 48'·165N., 9° 43'·792W.
8.2m	53° 48'·35N., 9° 45'·17W.
10.7m	53° 47'·86N., 9° 44'·56W.
11.8m	53° 48'·56N., 9° 44'·53W.

2. Mariners are advised to navigate with caution in the area.
3. These changes will be included in the next New Editions of charts 2057, 2667, and 2420.
(ETRS89 DATUM)

Charts affected — 2057 — 2420 — 2667

4799(T)/24 ENGLAND - East Coast - Buoy.

Source: Peel Ports London Medway Notice 10/24

1. The mooring buoy in position 51° 25'·470N., 0° 41'·978E. has been replaced by an orange marker buoy until further notice.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1185 — 1834 — 2482 — 5606_10 — 5606_11

4803(T)/24 SCOTLAND - West Coast - Lights.

Source: Northern Lighthouse Board Notices 09/24 & 10/24

1. The light at Corsewall Point, in position 55° 00'·42N., 5° 09'·57W. has been temporarily amended to Fl(5)30s33m12M.
2. The range of the light at Girdle Ness, in position 57° 08'·341N., 2° 02'·911W. has been temporarily reduced to 12 miles.

4803(T)/24 SCOTLAND - West Coast - Lights. (continued)

- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 210 — 1121 — 1404 — 1409 — 1446 — 2182B — 2182C — 2198 — 2199 — 2635 — 2724 — 5610_16 — 5610_17 — 5612_24 — 5613_23 — 5617_16 — 5617_4

4832(P)/24 SCOTLAND - North Coast - General information. Radio reporting lines.

Source: International Maritime Organization

- To improve safety of navigation and reduce the risk of marine environmental pollution, a new IMO recognised ship reporting system, "IN THE PENTLAND FIRTH (PENTREP)", comes into force at 0000 UTC on 1 December 2024.
- The existing ship reporting system will be replaced by the expanded recognised ship reporting system set out below. The ship reporting system, PENTREP, is operated by Shetland MRCC of the United Kingdom using the callsign "Shetland Coastguard".
- All ships of 300 gross tonnage and upwards should participate in the system.
- Western Limit

Position

- | | |
|---|---------------------------|
| 1 | 58° 40'·30N., 3° 22'·60W. |
| 2 | 58° 46'·58N., 3° 22'·67W. |

- Northern Limit

Position

- | | |
|---|---------------------------|
| 2 | 58° 46'·58N., 3° 22'·67W. |
| 3 | 58° 46'·58N., 3° 17'·35W. |
| 4 | 58° 46'·56N., 3° 13'·21W. |
| 5 | 58° 44'·16N., 3° 04'·33W. |
| 6 | 58° 43'·79N., 2° 57'·66W. |

- Eastern Limit

Position

- | | |
|---|---------------------------|
| 7 | 58° 44'·12N., 2° 55'·10W. |
| 8 | 58° 40'·60N., 2° 52'·50W. |
| 9 | 58° 38'·65N., 3° 01'·47W. |

- See Admiralty List of Radio Signals for full details of reporting requirements (this will be updated in November 2024).
- These changes will be included in New Edition of Charts 1954, 2581 and 2162 to be published late 2024.
(ETRS89 DATUM)

Charts affected — 115 — 219 — 1239 — 1942

5106(T)/24 ENGLAND - South Coast - Buoy.

Source: Teignmouth Harbour Commission Notice 13/24

- The light-buoy, *Fl.Y.5s*, in position 50° 31'·97N., 3° 27'·77W. is temporarily unlit.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2454 — 3315 — 5601_2 — 5602_8

5128(T)/24 IRELAND - South Coast - Scientific instrument.

Source: Irish Maritime Administration

- A scientific instrument has been deployed on the seabed until approximately September 2025 in position 51° 33'·50N., 8° 37'·80W.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2092 — 2424 — 5622_7 — 5623_18

5221(T)/24 SCOTLAND - East Coast - Scientific instruments. Buoyage.

Source: Argyll Aquaculture

- Scientific instruments, marked by 4 lit special buoys, *Fl.Y.5s*, have been established in the water column within a 50m radius of position: 57° 41'·68N., 2° 37'·50W.

5221(T)/24 SCOTLAND - East Coast - Scientific instruments. Buoyage. (continued)

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 115 — 222 — 1409 — 5617_6 — 5617_7

5714(T)/24 SCOTLAND - Caledonian Canal - Works.

Source: Scottish Canals

1. The Caledonian Canal (56° 50'·50N., 5° 07'·45W., 57° 29'·45N., 4° 15'·85W.) will be closed to through traffic, from 3 November 2024 until 24 March 2025, to allow essential engineering works to take place.
2. During this period, navigation of some sections of the canal will be possible, within winter operating hours.
3. Contact the Caledonian Canal Office by email no less than 48 hours prior to the intended date of travel – caledonian@scottishcanals.co.uk.
(ETRS89 DATUM)

Charts affected — 1078 — 1791 — 2372 — 2380 — 5611_23 — 5617_12 — 5617_19 — 5617_20 — 5617_21

5720(P)/24 IRELAND - South Coast - Works. Quay.

Source: Port of Cork Notice 14/24

1. Quay extension works are taking place, in an area bounded by the following positions:
 51° 50'·18N., 8° 19'·50W.
 51° 50'·24N., 8° 19'·38W.
 51° 50'·23N., 8° 19'·34W.
 51° 50'·15N., 8° 19'·47W.
2. Mariners are advised to keep clear of the construction area at all times and consult the local port authorities for the latest information.
3. Charts will be updated when works are complete.
(ETRS89 DATUM)

Charts affected — 1773 — 1777 — 5622_10 — 5622_11

5722(T)/24 WALES - North Coast - Buoy.

Source: Menter Môn

1. A yellow super buoy, *Fl(5)Y.20s*, has been deployed in position 53° 17'·65N., 4° 42'·93W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1413 — 1970 — 1977 — 5609_10 — 5609_5

5751(T)/24 ENGLAND - East Coast - Buoy.

Source: Port of Boston Notice 48/24

1. The isolated danger light-buoy, *Fl(2)10s*, in position 53° 01'·53N., 0° 25'·66E., is reported off station.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 108 — 1190 — 5614_8 — 5614_9

5855(T)/24 ENGLAND - East Coast - Buoy.

Source: Port of London Authority

1. The starboard-hand lateral buoy, *Fl.G.5s Mid Swatch*, has been temporarily moved.

Former Position

51° 28'·67N., 0° 44'·15E.

New Position

51° 28'·87N., 0° 43'·32E.

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1185 — 3683 — 5606_7 — 5606_8 — 5606_9

5927(T)/24 ENGLAND - South Coast - Buoy. Works. Restricted area.

Source: King's Harbour Master, Portsmouth

- * A special mark light-buoy, *Fl.Y.5s No 1*, has been temporarily established, marking the seaward limit of the Southsea Coastal Scheme works, in position 50° 46'·935N., 1° 05'·935W.
- * A restricted area, entry prohibited, has been established, bounded by the following positions:
 - 50° 46'·674N., 1° 05'·134W.
 - 50° 46'·619N., 1° 05'·128W.
 - 50° 46'·635N., 1° 05'·363W.
 - 50° 46'·724N., 1° 05'·556W.
 - 50° 46'·776N., 1° 05'·623W.
 - 50° 46'·935N., 1° 05'·935W.
 - 50° 46'·977N., 1° 05'·853W.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Charts will be updated when works are complete.
- * Former Notice 4267(T)/24 is cancelled.
* Indicates new or revised entry.
(ETRS89 DATUM)

Charts affected — 2625 — 2631 — 5600_12**132(P)/25 ENGLAND - South Coast - Precautionary area.**

Source: King's Harbour Master, Portsmouth

- A precautionary area has been established, joining the following positions:
 - 50° 45'·101N., 1° 04'·948W.
 - 50° 45'·441N., 1° 05'·456W.
 - 50° 45'·819N., 1° 05'·564W.
 - 50° 46'·204N., 1° 05'·674W.
 - 50° 46'·658N., 1° 06'·149W.
 - 50° 46'·979N., 1° 06'·485W.
 - 50° 47'·227N., 1° 06'·635W.
 - 50° 47'·310N., 1° 06'·646W.
 - 50° 47'·389N., 1° 06'·661W.
 - 50° 47'·637N., 1° 06'·821W.
 - 50° 47'·678N., 1° 06'·687W.
 - 50° 47'·417N., 1° 06'·586W.
 - 50° 47'·214N., 1° 06'·396W.
 - 50° 47'·076N., 1° 06'·238W.
 - 50° 46'·771N., 1° 05'·809W.
 - 50° 46'·659N., 1° 05'·648W.
 - 50° 46'·460N., 1° 05'·395W.
 - 50° 46'·042N., 1° 05'·254W.
 - 50° 45'·618N., 1° 05'·127W.
- For further information, see www.royalnavy.mod.uk/khm/portsmouth.
- These changes will be included in a New Edition of Charts 2036, 2037, 2625, 2629 and 2631 to be published early 2025.
(ETRS89 DATUM)

Charts affected — 5600_13 — 5600_17**489(T)/25 ENGLAND - East Coast - Buoy.**

Source: Orsted

- * A yellow wave light-buoy, *Q(5)Y.20s4M*, has been established in position 52° 58'·39N., 1° 07'·11E.
- Mariners are advised to navigate with caution in the area.
- * Former Notice 3587(T)/24 is cancelled.
* Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 108 — 1190 — 1503 — 5614_7 — 5614_8

1018(T)/25 ENGLAND - South Coast - Light.

Source: Fowey Harbour Commissioners Local Notice to Mariners 2025/02

1. Fowey Lighthouse, LFl.WR.5s28m11M/9M, in position 50° 19'·63N., 4° 38'·83W. is temporarily extinguished.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 31 — 148 — 442 — 1267 — 2655 — 5602_1 — 5602_2 — 5602_7**1023(T)/25 ENGLAND - South Coast - Buoy.**

Source: Newhaven Port and Properties Ltd

1. The light-buoy, *Q.R*, in position 50° 45'·80N., 0° 00'·44E. is temporarily unlit.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1652 — 2450 — 2451 — 5605_4**1064(P)/25 SCOTLAND - West Coast - Depths, Rocks.**

Source: mv Northern Wind and mv Lode

1. Recent survey information has shown that numerous depths less than charted exist in the approaches to Kinlochbervie, and between Cape Wrath and Stoer Head. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
11·8m	58° 36'·19N., 5° 01'·34W.
* 3·2m	58° 28'·08N., 5° 07'·08W.
15·2m	58° 28'·01N., 5° 06'·02W.
24m	58° 27'·91N., 5° 05'·72W.
25·5m	58° 27'·55N., 5° 04'·88W.
13·6m	58° 27'·51N., 5° 05'·56W.
12·5m	58° 27'·37N., 5° 05'·71W.
1·5m	58° 27'·187N., 5° 05'·006W.
9m	58° 27'·072N., 5° 05'·363W.
23·5m	58° 27'·03N., 5° 06'·47W.
7·1m	58° 27'·03N., 5° 05'·78W.
1m	58° 26'·90N., 5° 05'·44W.
23·5m	58° 26'·79N., 5° 06'·16W.
4·2m	58° 26'·68N., 5° 05'·54W.
24m	58° 26'·59N., 5° 06'·60W.
5·9m	58° 26'·43N., 5° 06'·22W.
6·3m	58° 26'·34N., 5° 06'·96W.
15·5m	58° 26'·27N., 5° 07'·26W.
15·7m	58° 26'·09N., 5° 07'·84W.
27m	58° 24'·39N., 5° 09'·85W.
13·9m	58° 24'·39N., 5° 09'·15W.
23·5m	58° 23'·51N., 5° 11'·74W.
12·3m	58° 23'·40N., 5° 11'·93W.
9·2m	58° 23'·36N., 5° 10'·28W.

1064(P)/25

SCOTLAND - West Coast - Depths. Rocks. (continued)

2. and

<i>Depth</i>	<i>Position</i>
27m	58° 23'·33N., 5° 12'·70W.
2·9m	58° 23'·33N., 5° 10'·56W.
8·0m	58° 23'·22N., 5° 12'·24W.
4·7m	58° 23'·21N., 5° 10'·04W.
3·7m	58° 23'·24N., 5° 09'·11W.
3·6m	58° 22'·77N., 5° 09'·80W.
3m	58° 22'·26N., 5° 11'·29W.
49m	58° 20'·31N., 5° 18'·37W.
97m	58° 21'·10N., 5° 25'·76W.
73m	58° 18'·77N., 5° 24'·92W.
31m	58° 16'·20N., 5° 26'·17W.
1·3m	58° 15'·88N., 5° 22'·67W.
1·3m	58° 15'·77N., 5° 22'·73W.
2·4m	58° 15'·76N., 5° 22'·89W.
1·4m	58° 15'·41N., 5° 23'·45W.
2·8m	58° 15'·17N., 5° 23'·77W.
19·4m	58° 15'·16N., 5° 24'·30W.
2·7m	58° 14'·92N., 5° 23'·97W.

3. and

<i>Depth</i>	<i>Position</i>
8·3m	58° 27'·90N., 5° 05'·25W.
0·4m	58° 27'·95N., 5° 04'·64W.
6·6m	58° 27'·73N., 5° 04'·63W.
6·5m	58° 28'·91N., 5° 07'·74W.
4·1m	58° 28'·26N., 5° 08'·45W.
* 27·6m	58° 28'·14N., 5° 08'·67W.
* 27·1m	58° 27'·12N., 5° 07'·08W.
* 15·4m	58° 26'·73N., 5° 07'·49W.
* 25·3m	58° 26'·39N., 5° 09'·06W.
* 16·4m	58° 25'·70N., 5° 08'·09W.
* 4·7m	58° 25'·18N., 5° 07'·35W.
* 7·6m	58° 25'·22N., 5° 07'·15W.
* 16·9m	58° 25'·27N., 5° 06'·43W.
* 6·7m	58° 24'·00N., 5° 03'·77W.
* 22·4m	58° 24'·83N., 5° 07'·15W.
* 24·1m	58° 24'·99N., 5° 08'·30W.
* 21·5m	58° 24'·88N., 5° 08'·48W.
* 25·2m	58° 24'·65N., 5° 09'·28W.

4. Rocks are reported to exist as follows:

<i>Water level</i>	<i>Position</i>
Dries 0·2m	58° 25'·03N., 5° 05'·69W.
Awash	58° 25'·95N., 5° 07'·05W.

5. Mariners are advised to navigate with caution in the area.

6. Charts will be updated when full details are available.

7. *Former Notice 778(P)/25 is cancelled.

*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1785 — 1794 — 2502 — 2503 — 2504 — 2720

1096(P)/25 ENGLAND - East Coast - Depths.

Source: mv Mintaka and fpv Morven

1. *Recent survey information has shown that numerous depths less than charted exist in the vicinity of Hewett Ridges and Leman Bank. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
19m	52° 56'·18N., 2° 07'·30E.
13·4m	52° 56'·48N., 2° 06'·89E.
14·5m	52° 56'·08N., 2° 07'·03E.
6·9m	52° 57'·75N., 2° 03'·24E.
7·3m	52° 58'·06N., 2° 02'·76E.
7·5m	52° 58'·33N., 2° 02'·28E.
11·7m	52° 59'·71N., 1° 59'·26E.
13m	52° 59'·49N., 1° 57'·85E.
17·6m	53° 07'·62N., 1° 56'·47E.
7·7m	53° 06'·70N., 1° 58'·51E.
7·2m	53° 05'·40N., 2° 02'·30E.
15·4m	53° 05'·22N., 2° 03'·92E.
14·1m	53° 01'·82N., 2° 10'·31E.
* 9·3m	52° 55'·69N., 2° 10'·44E.
* 7·4m	52° 54'·42N., 2° 11'·50E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
4. *Former Notice 997(P)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 105 — 106 — 1503 — 1504**1116(T)/25 WALES - North Coast - RoRo. Works. Restricted area.**

Source: Stena Line Ports Ltd

1. Works are in progress at Ro-Ro Terminals 3 and 5. A restricted area has been established, bounded by the following positions:

53° 19'·091N., 4° 37'·270W.
 53° 19'·093N., 4° 37'·277W.
 53° 19'·150N., 4° 37'·350W.
 53° 19'·300N., 4° 37'·220W.
 53° 19'·230N., 4° 36'·930W.
 53° 19'·100N., 4° 37'·060W.
 53° 19'·064N., 4° 37'·178W.
 53° 19'·067N., 4° 37'·185W.

2. Vessels are prohibited from entering this area unless given express consent from the local port authorities.
3. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1413 — 2011 — 5609_11 — 5609_12**1128(T)/25 ENGLAND - South Coast - Obstructions.**

Source: Ministry of Defence

1. Numerous objects tethered up to 20m above the seabed exist within an area bounded by the following positions:

50° 17'·0N., 4° 21'·4W.
 50° 16'·0N., 4° 21'·4W.
 50° 16'·0N., 4° 23'·0W.
 50° 17'·0N., 4° 23'·0W.

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 148 — 442 — 1267 — 1613 — 5602_4

1179(P)/25 ENGLAND - Bristol Channel - Depths.

Source: British Government

1. *Recent survey information has shown that depths may be up to 2m shoaler than charted within the vicinity of Bideford Bay bounded by the following positions:

50° 59'·41N., 4° 22'·14W.
 51° 00'·20N., 4° 22'·94W.
 51° 01'·01N., 4° 22'·57W.
 51° 02'·92N., 4° 22'·21W.
 51° 05'·89N., 4° 20'·75W.
 51° 09'·55N., 4° 19'·47W.
 51° 09'·73N., 4° 15'·45W.
 51° 09'·38N., 4° 12'·83W.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
4. *Former Notice 5708(P)/24 is cancelled.
 *Indicates new or revised entry
 (ETRS89 DATUM)

Charts affected — 1160 — 1164 — 1179 — 5608_1 — 5608_4 — 5608_5

1243(P)/25 SCOTLAND - Shetland Islands - Depths.

Source: mv Northern Wind and mv Northern Storm

1. * Recent survey information has shown that numerous depths less than charted exist in the area outside of Fladdabister, Bressay, Mousa and the Stepping Stones. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
1·4m	60° 08'·14N., 1° 03'·77W.
9·3m	60° 08'·02N., 1° 03'·78W.
7·2m	60° 07'·15N., 1° 03'·98W.
1·6m	60° 06'·45N., 1° 04'·34W.
18·4m	60° 04'·36N., 1° 12'·21W.
8·7m	60° 03'·69N., 1° 12'·23W.
4·5m	60° 03'·21N., 1° 11'·61W.
4·9m	60° 10'·61N., 1° 04'·17W.
14·9m	60° 10'·30N., 1° 02'·81W.
51m	60° 13'·95N., 0° 59'·94W.
41m	60° 14'·93N., 0° 58'·93W.
53m	60° 15'·66N., 0° 56'·60W.
63m	60° 17'·53N., 0° 54'·02W.
3·7m	60° 02'·96N., 1° 11'·79W.
18·1m	59° 58'·33N., 1° 12'·07W.
*54m	60° 11'·49N., 1° 02'·31W.
*62m	60° 13'·38N., 1° 03'·02W.
*51m	60° 14'·26N., 1° 00'·88W.
*42m	60° 14'·46N., 1° 00'·15W.
*47m	60° 14'·94N., 0° 59'·44W.
*49m	60° 15'·69N., 0° 58'·91W.
*53m	60° 17'·29N., 0° 56'·72W.
*42m	60° 19'·56N., 0° 52'·39W.
*70m	60° 19'·21N., 0° 44'·81W.

2. Mariners are advised to navigate with caution in the area.
3. These changes will be included in the next New Editions of Charts 1119, 1233, 3272 and 3283.
4. *Former Notice 5929(P)/24 is cancelled.
 *Indicates new or revised entry
 (ETRS89 DATUM)

Charts affected — 1119 — 1233 — 3272 — 3282 — 3283 — 3284

1339(P)/25 ENGLAND - South East Coast - Submarine cable. Works.

Source: Global Marine Group

1. Submarine cable laying works are taking place between North Foreland and Oostende, along a line joining the following positions:

51° 22'·73N., 1° 26'·80E.
 51° 23'·45N., 1° 29'·81E.
 51° 23'·15N., 1° 32'·74E.
 51° 23'·55N., 1° 33'·52E.
 51° 23'·55N., 1° 36'·37E.
 51° 23'·75N., 1° 38'·91E.
 51° 22'·61N., 1° 43'·78E.
 51° 22'·72N., 1° 45'·28E.
 51° 22'·45N., 1° 48'·39E.
 51° 22'·53N., 2° 03'·45E.
 51° 22'·63N., 2° 06'·71E.
 51° 22'·36N., 2° 08'·59E.
 51° 22'·53N., 2° 12'·70E.
 51° 21'·80N., 2° 14'·73E.
 51° 21'·37N., 2° 17'·93E.
 51° 21'·59N., 2° 22'·00E.
 51° 22'·47N., 2° 27'·09E.
 51° 22'·27N., 2° 28'·42E.
 51° 22'·23N., 2° 32'·09E.
 51° 21'·27N., 2° 33'·95E.
 51° 20'·89N., 2° 40'·56E.
 51° 21'·28N., 2° 41'·97E.
 51° 21'·00N., 2° 44'·40E.
 51° 17'·38N., 2° 47'·99E.
 51° 13'·57N., 2° 53'·85E.

2. Charts will be updated when works are complete.
3. This change will be included in a New Edition of Chart 1607.
4. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 323 — 1406 — 1610 — 1630 — 1828 — 2449 — 5605_1 — 5605_11 — 5606_1 — 5606_4 — 5607_1 — BE 11 — BE 102

1340(T)/25 ENGLAND - East Coast - Scientific instruments. Buoyage.

Source: Durham Wildlife Trust

1. Numerous scientific instruments, marked by yellow light-buoys, have been established in the vicinity of 54° 49'·20N., 1° 16'·31W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 152 — 5615_5

1353(P)/25 ENGLAND - East Coast - Works. Submarine cable.

Source: Scottish Power Renewables

1. Submarine cable laying works are taking place between East Anglia Three Offshore Wind Farm and a site NE of Felixstowe, along a line joining the following positions:

52° 00'·02N., 1° 25'·40E.
 51° 59'·62N., 1° 26'·45E.
 52° 00'·39N., 1° 31'·01E.
 52° 04'·18N., 1° 37'·24E.
 52° 05'·33N., 1° 43'·47E.
 52° 07'·88N., 1° 49'·56E.
 52° 13'·38N., 2° 18'·29E.
 52° 13'·70N., 2° 26'·10E.
 52° 17'·77N., 2° 26'·96E.
 52° 20'·82N., 2° 30'·40E.
 52° 20'·88N., 2° 34'·48E.
 52° 27'·14N., 2° 35'·84E.
 52° 27'·62N., 2° 44'·99E.
 52° 38'·93N., 2° 45'·08E.
 52° 40'·24N., 2° 51'·74E.

2. Charts will be updated when works are complete.
3. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1406 — 1408 — 1610 — 1630 — 1631 — 2052 — 2182A — 2693 — 5614_25

1570(T)/25 SCOTLAND - Shetland Islands - Scientific instruments. Buoy.

Source: Shell UK Ltd

1. Scientific measuring instruments, marked by a yellow buoy, have been established in position 60° 59'·80N., 1° 54'·00W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 219 — 1233 — 1239 — 2182C — 2182D

1656(T)/25 SCOTLAND - Shetland Islands - Light.

Source: Northern Lighthouse Board Notice 5/25

1. The range of the light at Esha Ness, in position 60° 29'·36N., 1° 37'·65W. has been temporarily reduced to 12 miles.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 219 — 1233 — 1239 — 2182C — 2182D — 3281

1677(T)/25 ENGLAND - South Coast - Depths.

Source: KHM Portsmouth, NAVWARN 17/25

1. Recent survey information has shown that numerous depths less than charted exist between King's stairs and Watering Island, in the entrance to the North Camber in the vicinity of 50° 48'·052N., 1° 06'·683W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 2629 — 2631 — 5600_12

1683(P)/25 SCOTLAND - Shetland Islands - Depths.

Source: mv Northern Storm and mv Northern Wind

1. Recent survey information has shown that numerous depths less than charted exist between Swart Skerry and Sumburgh Head. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4·4m	59° 53'·31N., 1° 16'·10W.
3·6m	59° 52'·83N., 1° 16'·14W.
2·2m	59° 51'·46N., 1° 16'·08W.

1683(P)/25 SCOTLAND - Shetland Islands - Depths. (continued)

2. Mariners are advised to navigate with caution in the area.
3. These changes will be included in the next New Edition of Charts 1119 and 3283.
(ETRS89 DATUM)

Charts affected — 1119 — 3283**1715(T)/25 SCOTLAND - West Coast - Buoyage.**

Source: Comhairle Nan Eilean Siar

1. Light-buoys on the approach to Ardvénish 57° 00'·055N., 7° 24'·001W. are reported extinguished or unreliable.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Chart affected — 2770**1730(P)/25 SCOTLAND - Shetland Islands - Depths.**

Source: mv Northern Storm, mv Northern Wind and mv Lode

1. *Recent survey information has shown that numerous depths less than charted exist between Wester Sound approaches and Skelda Ness. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
20·2m	60° 11'·45N., 1° 34'·01W.
29·5m	60° 11'·56N., 1° 33'·53W.
23·5m	60° 11'·35N., 1° 33'·35W.
33m	60° 11'·02N., 1° 33'·00W.
31m	60° 10'·81N., 1° 33'·02W.
34m	60° 10'·53N., 1° 32'·70W.
14m	60° 10'·63N., 1° 31'·76W.
28m	60° 10'·06N., 1° 31'·36W.
41m	60° 08'·36N., 1° 29'·43W.
39m	60° 07'·92N., 1° 28'·65W.
39m	60° 06'·66N., 1° 26'·71W.
*2·4m	60° 11'·83N., 1° 36'·26W.

2. Mariners are advised to navigate with caution in the area.
3. These changes will be included in the next New Edition of Charts 1119, 1233, 3281, 3283 and 3295.
4. *Former Notice 1273(P)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1119 — 1233 — 3281 — 3283 — 3295**1747(T)/25 SCOTLAND - West Coast - Buoy.**

Source: Peel Ports

1. The conical light-buoy, *Fl.G.5s*, in position 55° 38'·213N., 4° 49'·692W. is reported off station.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1866 — 2491

1936(P)/25 SCOTLAND - Shetland Islands - Depths.

Source: mv Northern Wind, mv Northern Storm and mv Lode

1. Recent survey information has shown that numerous depths less than charted exist in the area surrounding the Isle of Noss and along the east coast of Bressay. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4·3m	60° 06'·36N., 1° 04'·28W.
12·1m	60° 06'·59N., 1° 04'·13W.
3·3m	60° 07'·07N., 1° 03'·97W.
6·8m	60° 07'·24N., 1° 03'·90W.
16·9m	60° 07'·97N., 1° 03'·74W.
12·7m	60° 08'·11N., 1° 03'·65W.
2·2m	60° 08'·30N., 1° 03'·52W.
9·3m	60° 08'·47N., 1° 03'·07W.
4·2m	60° 08'·92N., 1° 02'·99W.
4·1m	60° 09'·20N., 1° 02'·71W.
9·1m	60° 09'·29N., 1° 02'·84W.
18·8m	60° 09'·48N., 1° 02'·72W.
3·8m	60° 09'·65N., 1° 04'·35W.
1·8m	60° 09'·80N., 1° 03'·64W.
3·9m	60° 10'·26N., 1° 02'·97W.
7·9m	60° 09'·32N., 1° 02'·34W.
3·8m	60° 09'·19N., 1° 01'·99W.
4·1m	60° 09'·15N., 1° 01'·33W.
9m	60° 09'·19N., 1° 01'·26W.
28·2m	60° 09'·21N., 1° 00'·89W.
14·4m	60° 09'·16N., 1° 00'·42W.
4m	60° 08'·80N., 1° 00'·12W.
24·8m	60° 08'·78N., 0° 59'·99W.
28·1m	60° 08'·69N., 0° 59'·87W.

2. and

28·4m	60° 08'·55N., 0° 59'·98W.
11m	60° 08'·52N., 1° 00'·16W.
3·5m	60° 08'·25N., 1° 00'·35W.
14·6m	60° 08'·23N., 1° 00'·27W.
11·7m	60° 08'·00N., 1° 00'·52W.
6·4m	60° 07'·91N., 1° 00'·55W.
16·7m	60° 07'·78N., 1° 00'·71W.
10·7m	60° 07'·83N., 1° 00'·96W.
8·9m	60° 07'·94N., 1° 01'·43W.
16·8m	60° 07'·88N., 1° 01'·46W.
9m	60° 08'·04N., 1° 01'·58W.
4·4m	60° 08'·28N., 1° 01'·83W.
17·8m	60° 08'·30N., 1° 02'·04W.
13·6m	60° 08'·58N., 1° 02'·42W.
8·6m	60° 08'·63N., 1° 02'·52W.

3. Mariners are advised to navigate with caution in the area.
 4. These changes will be included in the next New Edition of Chart 3272.
 (ETRS89 DATUM)

Chart affected — 3272

1938(P)/25 SCOTLAND - Shetland Islands - Depths. Drying heights.

Source: mv Northern Wind, mv Northern Storm and mv Lode

1. Recent survey information has shown that numerous depths and drying heights less than charted exist in the area outside of Aith Wick, Mail and Tros Wick. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
43m	60° 04'·88N., 1° 05'·78W.
3·9m	60° 04'·74N., 1° 12'·54W.
11m	60° 03'·16N., 1° 11'·79W.
3·5m	60° 03'·04N., 1° 12'·02W.
3m	60° 02'·76N., 1° 11'·83W.
16·4m	60° 02'·58N., 1° 10'·45W.
17·9m	60° 02'·49N., 1° 10'·17W.
25·5m	60° 02'·42N., 1° 07'·89W.
6·6m	60° 02'·14N., 1° 10'·07W.
36m	60° 01'·08N., 1° 10'·97W.
26m	60° 01'·68N., 1° 12'·73W.
26m	60° 01'·23N., 1° 12'·67W.
23·6m	60° 01'·13N., 1° 12'·58W.
16·5m	60° 01'·14N., 1° 13'·15W.
20·9m	60° 00'·67N., 1° 12'·81W.
3m	60° 00'·53N., 1° 13'·11W.
5·1m	59° 55'·74N., 1° 15'·98W.
5·2m	59° 55'·17N., 1° 16'·22W.
17m	59° 55'·08N., 1° 16'·44W.
11·9m	59° 55'·02N., 1° 16'·79W.
8·2m	59° 54'·88N., 1° 16'·78W.
13·7m	59° 54'·55N., 1° 16'·01W.
4·6m	59° 54'·26N., 1° 16'·04W.
16m	59° 54'·01N., 1° 16'·20W.

2.

<i>Drying Height</i>	<i>Position</i>
0·2m	60° 04'·51N., 1° 12'·64W.

3. Mariners are advised to navigate with caution in the area.
4. These changes will be included in the next New Editions of Charts 3272 and 3283. (ETRS89 DATUM)

Charts affected — 3272 — 3283

1970(P)/25 SCOTLAND - Shetland Islands - Depths.

Source: mv Northern Wind, mv Northern Storm and mv Lode

1. Recent survey information has shown that numerous depths less than charted exist in the area outside of Levenwick. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
6·7m	59° 58'·703N., 1° 12'·894W.
2·3m	59° 58'·849N., 1° 12'·851W.
2·8m	59° 59'·292N., 1° 13'·107W.
9m	59° 59'·265N., 1° 13'·169W.
8·7m	59° 59'·426N., 1° 13'·323W.
7·8m	59° 59'·387N., 1° 13'·646W.
7·6m	59° 59'·239N., 1° 13'·723W.
3·2m	59° 59'·155N., 1° 13'·868W.
8·2m	59° 59'·017N., 1° 13'·789W.
16m	59° 58'·990N., 1° 13'·752W.
4·7m	59° 58'·884N., 1° 13'·922W.
4m	59° 58'·923N., 1° 14'·372W.
2·6m	59° 58'·964N., 1° 14'·546W.
18m	59° 59'·040N., 1° 14'·911W.
8·7m	59° 59'·354N., 1° 14'·756W.
8·2m	59° 59'·468N., 1° 15'·096W.
3·3m	59° 59'·533N., 1° 15'·292W.
8·9m	59° 59'·403N., 1° 15'·335W.
1m	59° 59'·418N., 1° 15'·421W.
4·5m	59° 59'·140N., 1° 15'·631W.
8·7m	59° 59'·200N., 1° 15'·857W.
8·9m	59° 59'·287N., 1° 16'·013W.
3·6m	59° 59'·177N., 1° 16'·189W.
8·6m	59° 59'·152N., 1° 16'·071W.

2.

3·5m	59° 59'·089N., 1° 16'·084W.
7·2m	59° 58'·944N., 1° 16'·030W.
2·5m	59° 58'·908N., 1° 16'·056W.
3·6m	59° 58'·845N., 1° 16'·081W.
1m	59° 58'·805N., 1° 16'·103W.
8·5m	59° 58'·825N., 1° 16'·038W.
3·2m	59° 58'·741N., 1° 15'·992W.
2·7m	59° 58'·678N., 1° 15'·966W.
7·5m	59° 58'·692N., 1° 15'·903W.
7·2m	59° 58'·683N., 1° 15'·367W.
7·2m	59° 58'·654N., 1° 15'·285W.
6·7m	59° 58'·551N., 1° 15'·179W.
3·8m	59° 58'·415N., 1° 15'·219W.
4m	59° 58'·362N., 1° 15'·233W.
5·8m	59° 58'·214N., 1° 15'·327W.
16·4m	59° 58'·148N., 1° 15'·342W.
15·8m	59° 58'·043N., 1° 15'·425W.
1·6m	59° 58'·147N., 1° 15'·520W.
0·3m	59° 58'·198N., 1° 15'·530W.
16·9m	59° 56'·997N., 1° 14'·789W.
5m	59° 57'·063N., 1° 14'·861W.
8·3m	59° 57'·144N., 1° 14'·880W.
3·9m	59° 57'·217N., 1° 14'·972W.
8·7m	59° 57'·162N., 1° 15'·184W.
5·9m	59° 57'·096N., 1° 15'·611W.

3.

2·4m	59° 57'·042N., 1° 15'·721W.
5·8m	59° 56'·989N., 1° 15'·801W.

4. Mariners are advised to navigate with caution in the area.

1970(P)/25 SCOTLAND - Shetland Islands - Depths. (continued)

5. These changes will be included in the next New Edition of Charts 3283 and 3294.
(ETRS89 DATUM)

Charts affected — 3283 — 3294

2000(T)/25 ENGLAND - Bristol Channel - Scientific instruments. Buoyage.

Source: Swansea University

1. Scientific instruments, marked by red surface buoys, have been established until mid-September 2025 in the area bounded by the following positions:

51° 14'·07N., 3° 10'·73W.
51° 14'·19N., 3° 10'·02W.
51° 13'·88N., 3° 09'·89W.
51° 13'·77N., 3° 10'·59W.

2. Mariners are requested to maintain distance and avoid anchorage within the area. Consult local port authorities for the latest information.
3. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1151 — 1152 — 5608_13

2002(T)/25 SCOTLAND - Orkney Islands - Buoyage.

Source: Leask Marine

1. Unlit white spherical buoys have been established, until further notice, in the following positions:

58° 50'·130N., 3° 11'·201W.
58° 50'·112N., 3° 11'·225W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Chart affected — 2568

2038(T)/25 ENGLAND - West Coast - Works. Lights. Piles.

Source: Port of Liverpool, NM 12/25

1. Upgrade works to the Woodside Ferry Terminal are currently taking place in the vicinity of position
53° 23'·754N., 3° 00'·473W.
2. Lights, Fl.G.3s, have been temporarily established on piles in the following positions:

53° 23'·757N., 3° 00'·496W.
53° 23'·734N., 3° 00'·479W.

3. Mariners are advised to navigate with caution in the area and consult the local port authority for the latest information.
(ETRS89 DATUM)

Charts affected — 3490 — 5613_5

2132(T)/25 SCOTLAND - West Coast - Scientific instruments. Buoyage.

Source: Marine and Fisheries, Scottish Government

1. Acoustic monitoring instruments, extending approximately 3m from the seabed, have been temporarily established within an area bounded by the following positions:

57° 21'·56N., 5° 36'·85W.
57° 21'·37N., 5° 36'·42W.
57° 20'·68N., 5° 38'·55W.
57° 20'·97N., 5° 38'·81W.

2. and

57° 21'·46N., 5° 34'·50W.
57° 21'·46N., 5° 34'·20W.
57° 21'·25N., 5° 34'·24W.
57° 21'·25N., 5° 34'·55W.

2132(T)/25 SCOTLAND - West Coast - Scientific instruments. Buoyage. (continued)

3. Acoustic monitoring instruments, marked by surface buoys, have been temporarily established within an area bounded by the following positions:

57° 24'·48N., 5° 28'·49W.
 57° 24'·05N., 5° 27'·57W.
 57° 23'·77N., 5° 27'·58W.
 57° 24'·30N., 5° 28'·72W.

4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (ETRS89 DATUM)

Charts affected — 2209 — 2528 — 5616_18 — 5616_4

2352(P)/25 SCOTLAND - Shetland Islands - Works.

Source: BAM Nuttall Limited

1. Dredging and construction works are taking place around Fair Isle Ferry Terminal in the area bounded by the coastline and a line joining the following positions:

59° 32'·248N., 1° 36'·318W.
 59° 32'·338N., 1° 36'·248W.

2. Mariners are advised to navigate with caution in the area.
 3. Chart will be updated when works are complete. (ETRS89 DATUM)

Chart affected — 3299

2369(P)/25 ENGLAND - South Coast - Submarine cable. Works.

Source: Global Marine

1. Submarine cable laying operations are taking place between Newhaven and Cayeux-sur-Mer, joining the following positions:

50° 46'·972N., 0° 04'·003E.
 50° 45'·132N., 0° 03'·822E.
 50° 44'·322N., 0° 04'·198E.
 50° 42'·026N., 0° 04'·266E.
 50° 39'·090N., 0° 03'·829E.
 50° 38'·443N., 0° 04'·177E.
 50° 37'·808N., 0° 04'·035E.
 50° 36'·458N., 0° 05'·219E.
 50° 35'·845N., 0° 07'·373E.
 50° 35'·455N., 0° 08'·197E.
 50° 34'·703N., 0° 12'·362E.
 50° 34'·547N., 0° 13'·249E.
 50° 34'·073N., 0° 17'·636E.
 50° 34'·155N., 0° 19'·764E.
 50° 33'·584N., 0° 22'·122E.
 50° 33'·199N., 0° 25'·869E.
 50° 32'·969N., 0° 26'·767E.
 50° 33'·008N., 0° 29'·404E.
 50° 33'·963N., 0° 32'·232E.
 50° 33'·980N., 0° 34'·604E.
 50° 34'·447N., 0° 37'·664E.
 50° 34'·461N., 0° 39'·130E.
 50° 34'·486N., 0° 41'·689E.
 50° 34'·128N., 0° 44'·589E.
 50° 33'·064N., 0° 47'·369E.

2369(P)/25 ENGLAND - South Coast - Submarine cable. Works. (continued)

2.

50° 32'·995N., 0° 48'·715E.
 50° 21'·216N., 0° 59'·975E.
 50° 20'·069N., 1° 03'·477E.
 50° 19'·209N., 1° 12'·400E.
 50° 18'·244N., 1° 15'·145E.
 50° 17'·124N., 1° 17'·336E.
 50° 16'·033N., 1° 19'·775E.
 50° 13'·715N., 1° 21'·797E.
 50° 10'·700N., 1° 29'·347E.

3. Mariners are to maintain a clearance distance of 250m from cable laying operations.
4. Mariners are advised to navigate with caution in the area.
5. Charts will be updated when works are complete.
(ETRS89 DATUM)

Charts affected — 2451 — 2675 — 5605_1**2500(T)/25 ENGLAND - South Coast - Obstruction. Buoy.**

Source: University of Southampton

1. A seabed mounted frame, marked by a yellow light-buoy, *Fl(5)Y.20s*, has been established in position
50° 44'·01N., 0° 54'·18W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2037 — 2045 — 5600_17 — 5600_3 — 5605_3**2592(P)/25 SCOTLAND - Shetland Islands - Depths.**

Source: mv Northern Storm, mv Northern Wind and mv Lode

1. Recent survey information has shown that numerous depths less than charted exist around Little Havra, Lady's Holm, in West Voe, Lang Sounds, Clift Sound, St Ninian's Isle and Bay of Scousbough. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
2·5m	60° 07'·26N., 1° 16'·82W.
8·5m	60° 06'·13N., 1° 17'·09W.
12·7m	60° 05'·83N., 1° 17'·19W.
0·8m	60° 05'·86N., 1° 18'·29W.
1·7m	60° 05'·31N., 1° 19'·33W.
1·5m	60° 03'·68N., 1° 19'·95W.
8·2m	60° 02'·36N., 1° 22'·13W.
2·4m	60° 02'·00N., 1° 18'·66W.
2·2m	60° 01'·66N., 1° 22'·56W.
7·7m	60° 01'·59N., 1° 19'·57W.
2·7m	60° 01'·56N., 1° 19'·35W.
5·8m	60° 01'·26N., 1° 22'·49W.
2·9m	60° 01'·29N., 1° 21'·66W.
1·6m	60° 01'·20N., 1° 19'·90W.
2·1m	60° 01'·16N., 1° 19'·86W.
6·7m	60° 01'·10N., 1° 19'·90W.
3m	60° 01'·03N., 1° 19'·84W.
3·2m	60° 00'·83N., 1° 19'·40W.
4·1m	60° 00'·61N., 1° 19'·92W.
3·9m	60° 00'·55N., 1° 20'·14W.
3m	60° 00'·55N., 1° 19'·62W.
4·3m	60° 00'·41N., 1° 20'·30W.
10·7m	60° 00'·27N., 1° 20'·47W.
3·6m	60° 00'·05N., 1° 20'·68W.

2592(P)/25 SCOTLAND - Shetland Islands - Depths. (continued)

2. and

<i>Depth</i>	<i>Position</i>
15·3m	59° 59'·91N., 1° 21'·78W.
9·7m	59° 58'·39N., 1° 22'·06W.
3m	59° 59'·06N., 1° 21'·29W.
5·5m	59° 57'·05N., 1° 20'·64W.
2·2m	59° 51'·21N., 1° 16'·81W.
2·3m	59° 51'·10N., 1° 19'·34W.
4·1m	59° 52'·04N., 1° 19'·46W.
7·4m	59° 52'·00N., 1° 20'·16W.
4·3m	59° 54'·64N., 1° 23'·65W.
18·5m	59° 54'·55N., 1° 24'·74W.
*4·9m	59° 52'·38N., 1° 20'·07W.
*8·6m	59° 52'·50N., 1° 19'·84W.

3. Mariners are advised to navigate with caution in the area.
4. These changes will be included in the next New Edition of Charts 1119, 3283, 3294 and 3295.
5. *Former Notice 2379(P)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1119 — 3283 — 3294 — 3295**2624(T)/25 ENGLAND - South Coast - Scientific instruments. Buoyage.**

Source: Chichester Harbour Conservancy Notice 9/25

1. Scientific instruments, marked by yellow buoys, have been established on the seabed in the following positions:

50° 48'·24N., 0° 56'·43W.
 50° 48'·14N., 0° 56'·41W.
 50° 48'·04N., 0° 56'·37W.
 50° 48'·47N., 0° 53'·55W.
 50° 48'·57N., 0° 53'·39W.
 50° 48'·61N., 0° 53'·17W.

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 3418 — 5600_20**2628(T)/25 IRELAND - East Coast - Scientific instruments. Buoyage.**

Source: Belfast Harbour Commissioners

1. Turbidity monitoring equipment, marked by yellow buoys, *Fl.Y.5s*, have been established in the following positions:

54° 38'·167N., 5° 52'·333W.
 54° 37'·467N., 5° 53'·233W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 1752 — 5612_13**2667(P)/25 SCOTLAND - North Coast - Submarine cable.**

Source: SSE

1. A submarine cable is being laid between Orkney and Dounreay, joining the following positions:

58° 34'·61N., 3° 46'·02W.
 58° 43'·84N., 3° 39'·68W.
 58° 47'·02N., 3° 33'·60W.
 58° 54'·63N., 3° 29'·26W.
 58° 56'·12N., 3° 26'·87W.
 58° 57'·612N., 3° 20'·048W.

2667(P)/25 SCOTLAND - North Coast - Submarine cable. (continued)

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 35 — 219 — 1239 — 1954 — 2162 — 2249 — 2568

2774(T)/25 SCOTLAND - East Coast - Scientific instruments.

Source: Marine Scotland

1. Subsurface scientific instruments, extending up to 2 metres from the seabed have been established in the following positions:

Designation

BH_1
BH_2
BH_3
BH_4
BH_5

Position

57° 49'·13N., 3° 46'·63W.
57° 48'·94N., 3° 44'·91W.
57° 48'·63N., 3° 42'·72W.
57° 48'·33N., 3° 40'·32W.
57° 47'·89N., 3° 38'·46W.

2. and

Designation

BH_6
BH_7
BH_8
BH_9
BH_10

Position

57° 47'·21N., 3° 37'·77W.
57° 46'·73N., 3° 37'·18W.
57° 46'·35N., 3° 36'·69W.
57° 45'·92N., 3° 36'·14W.
57° 45'·53N., 3° 35'·55W.

3. and

Designation

BH_11
BH_12
BH_13
BH_14
BH_15

Position

57° 45'·13N., 3° 35'·15W.
57° 44'·74N., 3° 34'·53W.
57° 44'·35N., 3° 34'·12W.
57° 43'·96N., 3° 33'·69W.
57° 43'·65N., 3° 33'·10W.

4. and

Designation

BH_16
BH_17
BH_18
BH_19

Position

57° 43'·37N., 3° 32'·48W.
57° 43'·02N., 3° 31'·98W.
57° 42'·79N., 3° 31'·27W.
57° 42'·50N., 3° 30'·66W.

5. and

Designation

CP_1
CP_2
CP_3
CP_4
CP_5
CP_6

Position

57° 35'·15N., 4° 04'·54W.
57° 35'·27N., 4° 04'·86W.
57° 35'·39N., 4° 05'·19W.
57° 35'·52N., 4° 05'·52W.
57° 35'·64N., 4° 05'·85W.
57° 35'·77N., 4° 06'·18W.

6. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 115 — 223 — 1077 — 1078 — 5617_10 — 5617_8 — 5617_9

2941(P)/25 IRELAND - North Coast - Depths.

Source: Londonderry Port and Harbour Commissioners

1. Recent survey information has shown that numerous depths less than charted exist between Londonderry and Lough Foyle. The most significant are as follows:

2941(P)/25 IRELAND - North Coast - Depths. (continued)

2. Rosses Bay:

<i>Depth</i>	<i>Position</i>
2·8m	55° 00'·314N., 7° 19'·033W.
2·7m	55° 00'·464N., 7° 18'·871W.
3·3m	55° 00'·555N., 7° 18'·748W.
3·8m	55° 00'·669N., 7° 17'·873W.
5·4m	55° 00'·668N., 7° 17'·714W.
16m	55° 01'·077N., 7° 17'·613W.

3. Strathfoyle:

<i>Depth</i>	<i>Position</i>
14·8m	55° 01'·298N., 7° 17'·581W.
9·6m	55° 01'·710N., 7° 17'·048W.
12·8m	55° 01'·951N., 7° 16'·819W.
13·4m	55° 02'·095N., 7° 16'·572W.
9·2m	55° 02'·287N., 7° 16'·278W.

4. Lisahally Terminal:

<i>Depth</i>	<i>Position</i>
9·2m	55° 02'·453N., 7° 16'·021W.
10·4m	55° 02'·523N., 7° 15'·964W.
5·6m	55° 02'·757N., 7° 15'·584W.
7·6m	55° 02'·679N., 7° 15'·153W.
8·3m	55° 02'·845N., 7° 14'·972W.

5. The Great Bank:

<i>Depth</i>	<i>Position</i>
2·1m	55° 08'·028N., 7° 09'·474W.

6. North Middle Bank:

<i>Depth</i>	<i>Position</i>
6·7m	55° 08'·865N., 7° 06'·623W.
2·9m	55° 09'·019N., 7° 06'·347W.
9·9m	55° 09'·651N., 7° 05'·880W.
4·2m	55° 09'·671N., 7° 05'·541W.
6·9m	55° 10'·070N., 7° 04'·892W.
9·9m	55° 10'·366N., 7° 04'·065W.
7·6m	55° 09'·934N., 7° 03'·972W.
7·6m	55° 10'·123N., 7° 03'·402W.
11m	55° 10'·236N., 7° 03'·315W.

7. McKinney's Bank:

<i>Depth</i>	<i>Position</i>
5·7m	55° 10'·329N., 7° 02'·135W.
6m	55° 10'·762N., 7° 01'·013W.
15m	55° 10'·904N., 7° 01'·180W.

8. Magilligan Point:

<i>Depth</i>	<i>Position</i>
12m	55° 11'·73N., 6° 58'·82W.

9. The Tuns:

<i>Depth</i>	<i>Position</i>
5·7m	55° 11'·91N., 6° 57'·18W.
4·1m	55° 12'·08N., 6° 56'·46W.
5·3m	55° 12'·28N., 6° 55'·75W.

10. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

11. These changes will be included in New Editions of Charts 2510, 2511, 5612_22 and 5612_23 to be published late 2025.
(ETRS89 DATUM)

Charts affected — 5612_22 — 5612_23

2978(P)/25 ENGLAND - Bristol Channel - Depths.

Source: m/v Northern Gale

- Depths less than charted exist around Culver Sand, Bristol Channel. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
3·5m	51° 18'·12N., 3° 14'·12W.
3·8m	51° 18'·08N., 3° 14'·36W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (ETRS89 DATUM)

Charts affected — 1152 — 1179 — 5608_12 — 5608_13 — 5608_3**3205(T)/25 SCOTLAND - West Coast - Buoy.**

Source: Bakkafrost Scotland

- A lit yellow wave monitoring buoy, *FL.Y*, has been deployed in position 55° 41'·19N., 5° 46'·92W.
- Mariners are advised to navigate with caution in the area. (ETRS89 DATUM)

Charts affected — 2168 — 2475 — 2724 — 5610_19 — 5611_2 — 5611_3**3431(T)/25 ENGLAND - East Coast - Works. Lights.**

Source: ABP Ipswich

- Maintenance works are taking place at Orwell Bridge.
- Light, *F.Y*, in position 52° 01'·62N., 1° 09'·86E. has been extinguished and a *F.R* traffic light, not visible within 80m, has been established in position on the bridge above.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (ETRS89 DATUM)

Charts affected — 2693 — 5607_7**3433(P)/25 SCOTLAND - West Coast - Bridges. Works. Vertical clearances. Legends.**

Source: Peel Ports

- Mariners are advised that there are changes to vertical bridge clearance heights between 55° 55'·426N., 4° 28'·076W. and 55° 51'·181N., 4° 14'·917W., as follows:

<i>Bridge Name</i>	<i>Former Clearance (metres)</i>	<i>New Clearance (metres)</i>
Erskine Bridge	54	52·5
Govan-Partick Footbridge	3·7	4·1
Science Centre Footbridge	3·0	3·1
Bell's Bridge	3·3	3·4
Clyde Arc Bridge	4·7	4·8
Kingston Bridge	19	19·3

- Additional changes to bridge names and vertical bridge clearance heights between 55° 55'·426N., 4° 28'·076W. and 55° 51'·181N., 4° 14'·917W., as follows:

<i>Position</i>	<i>Bridge Name</i>	<i>Clearance (metres)</i>
55° 53'·353N., 4° 23'·573W.	Renfrew to Yorker Bridge	4·0
55° 51'·342N., 4° 15'·541W.	Central Station Bridge	5·6
55° 51'·333N., 4° 15'·471W.	Glasgow Bridge	4·8
55° 51'·301N., 4° 15'·333W.	South Portland St Bridge	3·9
55° 51'·229N., 4° 15'·071W.	Victoria Bridge	5·0
55° 51'·188N., 4° 14'·967W.	St Enoch Bridge	7·2

- Legend 'Swing bridge under construction', near 55° 53'·353N., 4° 23'·573W., is no longer in force as works are complete.
- If any vessels transiting under Erskine Bridge, expects to be within 3·5m of charted vertical clearance, then Clydeport Marine Department must be consulted in advance on 01475 886317, 01475 886320 or clydemarinemanagers@peelports.com as additional planning will be required.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for additional information.

3433(P)/25 SCOTLAND - West Coast - Bridges. Works. Vertical clearances. Legends. (continued)

6. These changes will be included in the next New Edition of Chart 2007.
(ETRS89 DATUM)

Chart affected — 2007

3460(P)/25 SCOTLAND - West Coast - Submarine cables. Works.

Source: SSEN

1. A submarine cable is being laid between the Isles of Mull and Iona, joining the following positions:

56° 20'·51N., 6° 23'·11W.
56° 20'·61N., 6° 22'·80W.
56° 20'·64N., 6° 22'·40W.
56° 20'·62N., 6° 22'·02W.
56° 20'·48N., 6° 21'·54W.

2. Cable works are taking place between the Isles of Tiree and Coll within an area bounded by the following positions:

56° 32'·72N., 6° 44'·64W.
56° 32'·88N., 6° 44'·00W.
56° 33'·14N., 6° 43'·39W.
56° 33'·73N., 6° 42'·38W.
56° 34'·19N., 6° 41'·93W.
56° 34'·03N., 6° 41'·83W.
56° 33'·47N., 6° 42'·25W.
56° 32'·91N., 6° 43'·06W.
56° 32'·62N., 6° 44'·54W.

3. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1778 — 2169 — 2171 — 2474 — 2617 — 2771 — 5611_10 — 5611_11 — 5611_13 — 5611_26 — 5611_8

3608(T)/25 WALES - South Coast - Buoy. Wave recorder.

Source: Milford Haven Port Authority

1. *A yellow wave light-buoy *Fl.Y.2·5s*, has been established in position 51° 39'·696N., 5° 06'·939W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. *Former notice 2629(T)/25 is cancelled.
*indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 2878 — 3273 — 3274 — 5620_11

3759(P)/25 SCOTLAND - North Coast - Depths.

Source: mv Northern Wind, mv Lode and mv Northern Storm

1. *Recent survey information has shown that numerous depths less than charted exist between Dunnet Head and Duncansby Head, including the Island of Stroma. The most significant of these are as follows:

<i>Depth</i>	<i>Position</i>
2·5m	58° 40'·32N., 3° 22'·35W.
1·5m	58° 39'·56N., 3° 21'·05W.
18·3m	58° 39'·46N., 3° 15'·95W.
1·8m	58° 39'·31N., 3° 15'·60W.
1·4m	58° 39'·40N., 3° 15'·26W.
18·6m	58° 39'·63N., 3° 15'·24W.
17·1m	58° 39'·82N., 3° 11'·79W.
5·4m	58° 39'·86N., 3° 11'·42W.
2·1m	58° 39'·45N., 3° 12'·99W.
*5·4m	58° 41'·05N., 3° 07'·84W.
*4·8m	58° 38'·80N., 3° 07'·16W.
*2·7m	58° 41'·60N., 3° 06'·60W.
*2·3m	58° 40'·24N., 3° 06'·35W.

2. Mariners are advised to navigate with caution in the area.

3759(P)/25 SCOTLAND - North Coast - Depths. (continued)

3. *Charts will be updated when full details are available.
4. *Former Notice 5797(P)/24 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 2162 — 2581

3770(P)/25 SCOTLAND - Shetland Islands - Depths. Rocks. Drying heights.

Source: British Government Survey

1. Recent survey information has shown that numerous depths less than charted exist between Rumble Holm and Boddam.
The most significant are as follows:
2. Rumble Holm

<i>Depth</i>	<i>Position</i>
24·1m	60° 19'·058N., 0° 54'·123W.
44m	60° 17'·184N., 0° 55'·835W.

3. Score Head to Rules Ness

<i>Depth</i>	<i>Position</i>
30·9m	60° 12'·415N., 1° 04'·078W.
3m	60° 11'·511N., 1° 03'·882W.
2·3m	60° 11'·261N., 1° 04'·136W.
8·3m	60° 11'·102N., 1° 04'·286W.
4·4m	60° 10'·876N., 1° 04'·293W.
14·2m	60° 10'·710N., 1° 04'·213W.
1·9m	60° 10'·584N., 1° 04'·223W.
6·9m	60° 10'·539N., 1° 04'·050W.
26·7m	60° 10'·522N., 1° 03'·873W.
32m	60° 10'·454N., 1° 02'·796W.
3·6m	60° 10'·443N., 1° 04'·084W.
29m	60° 10'·380N., 1° 03'·356W.
3·9m	60° 10'·250N., 1° 02'·815W.
18·4m	60° 10'·207N., 1° 02'·677W.
10·8m	60° 10'·167N., 1° 03'·376W.
2·5m	60° 10'·156N., 1° 04'·199W.
14·1m	60° 10'·023N., 1° 04'·138W.
3·8m	60° 10'·000N., 1° 03'·338W.
4·1m	60° 09'·972N., 1° 04'·244W.
3·3m	60° 09'·969N., 1° 02'·661W.
5·7m	60° 09'·839N., 1° 03'·661W.
4·2m	60° 09'·752N., 1° 02'·862W.
13·5m	60° 09'·749N., 1° 04'·261W.
0·5m	60° 09'·593N., 1° 02'·933W.

4. Isle of Noss

<i>Depth</i>	<i>Position</i>
1m	60° 09'·128N., 1° 02'·859W.
40m	60° 09'·076N., 0° 59'·787W.
6m	60° 08'·959N., 1° 00'·138W.
1·1m	60° 08'·936N., 1° 02'·993W.
1·1m	60° 08'·643N., 1° 00'·140W.
5·4m	60° 08'·613N., 1° 02'·400W.
3·9m	60° 08'·501N., 1° 00'·191W.
1·7m	60° 08'·288N., 1° 01'·806W.
9m	60° 08'·217N., 1° 00'·294W.
1·3m	60° 08'·048N., 1° 00'·481W.
0·3m	60° 07'·869N., 1° 00'·824W.
6·6m	60° 07'·836N., 1° 00'·954W.

5. Green Head to Bard Head

<i>Depth</i>	<i>Position</i>
7·1m	60° 07'·554N., 1° 03'·892W.
10·2m	60° 06'·594N., 1° 04'·139W.

3770(P)/25 SCOTLAND - Shetland Islands - Depths. Rocks. Drying heights. (continued)

6. The Skeo to Helli Ness

<i>Depth</i>	<i>Position</i>
8m	60° 05'·411N., 1° 12'·302W.
23·6m	60° 05'·133N., 1° 12'·117W.
1·1m	60° 04'·425N., 1° 12'·581W.
11·8m	60° 04'·420N., 1° 12'·396W.
1·6m	60° 04'·298N., 1° 12'·381W.
9m	60° 04'·163N., 1° 12'·335W.
14m	60° 04'·010N., 1° 12'·225W.
28·5m	60° 03'·814N., 1° 11'·864W.
10·8m	60° 03'·594N., 1° 11'·850W.
4·5m	60° 03'·460N., 1° 11'·937W.
14·6m	60° 02'·986N., 1° 10'·753W.
20·8m	60° 02'·922N., 1° 11'·045W.
32m	60° 02'·904N., 1° 08'·630W.
47m	60° 02'·795N., 1° 07'·572W.
3·6m	60° 02'·721N., 1° 11'·542W.
0·6m	60° 02'·557N., 1° 10'·430W.
10·5m	60° 02'·379N., 1° 10'·086W.

7. Lamba Taing

<i>Depth</i>	<i>Position</i>
10·4m	60° 00'·988N., 1° 13'·324W.
19·1m	60° 00'·933N., 1° 12'·794W.

8. No Ness to Clumly Baas

<i>Depth</i>	<i>Position</i>
1·1m	59° 58'·310N., 1° 12'·269W.
29·8m	59° 58'·207N., 1° 12'·424W.
6·6m	59° 58'·330N., 1° 12'·533W.
4·6m	59° 58'·435N., 1° 12'·687W.
7m	59° 58'·811N., 1° 12'·920W.
2·7m	59° 59'·124N., 1° 13'·099W.
1·8m	59° 59'·626N., 1° 13'·388W.
3·7m	59° 59'·290N., 1° 13'·775W.
1m	59° 59'·201N., 1° 14'·497W.
1m	59° 59'·342N., 1° 14'·665W.
10·5m	59° 59'·419N., 1° 15'·059W.
0·8m	59° 59'·551N., 1° 15'·334W.
0·7m	59° 59'·665N., 1° 15'·348W.
13·1m	59° 58'·752N., 1° 15'·556W.
26·9m	59° 58'·123N., 1° 15'·231W.
19·3m	59° 57'·673N., 1° 15'·241W.
1·7m	59° 57'·632N., 1° 15'·315W.
1·5m	59° 57'·205N., 1° 15'·133W.
9·2m	59° 57'·195N., 1° 14'·880W.
1·5m	59° 57'·192N., 1° 15'·440W.
3·2m	59° 57'·097N., 1° 14'·890W.
16·8m	59° 57'·084N., 1° 15'·510W.
11m	59° 57'·019N., 1° 15'·677W.
9·1m	59° 56'·949N., 1° 15'·748W.

9. Fogal Taing to Boddam

<i>Depth</i>	<i>Position</i>
18·1m	59° 56'·078N., 1° 15'·399W.
1m	59° 55'·114N., 1° 17'·178W.

10. Rocks, which cover and uncover, are reported to exist as follows:

Dries 0·2m	60° 07'·500N., 1° 03'·999W.
Dries 0·5m	59° 59'·602N., 1° 13'·236W.
Drying height unknown	59° 57'·196N., 1° 15'·079W.

11. Mariners are advised to navigate with caution in the area.

3770(P)/25 SCOTLAND - Shetland Islands - Depths. Rocks. Drying heights. (continued)

12. These changes will be included in the next New Edition of Charts 1119, 1233, 3272, 3282, 3283, 3284 and 3294.
(ETRS89 DATUM)

Charts affected — 1119 — 1233 — 3272 — 3282 — 3283 — 3284 — 3294

3843(T)/25 SCOTLAND - Shetland Islands - Scientific instruments. Buoyage.

Source: Shetland Islands Council Notice 10/25

1. Scientific instruments, marked by 2 unlit white buoys, have been established on the seabed in the following positions:
60° 34'·72N., 1° 18'·98W.
60° 31'·18N., 1° 19'·90W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 3281 — 3282 — 3298

3852(T)/25 SCOTLAND - North Coast - Light.

Source: Northern Lighthouse Board Notice 10/25

1. The range of the light at Dunnet Head, in position 58° 40'·29N., 3° 22'·58W. has been temporarily reduced to 12 miles.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 219 — 1239 — 1954 — 2162 — 2182C

3857(P)/25 IRELAND - North East Coast - Depths.

Source: British Government

1. Recent survey information has shown that depths less than charted exist in the North Channel. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
118m	55° 11'·55N., 5° 5'·79W.
48m	55° 14'·94N., 5° 3'·25W.
81m	55° 12'·82N., 5° 4'·05W.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(ETRS89 DATUM)

Charts affected — 2126 — 2199 — 2798 — 5610_14 — 5612_17

3878(P)/25 SCOTLAND - West Coast - Submarine cable. Works.

Source: SSEN

1. Cable works are taking place within an area bounded by the following positions:

56° 38'·32N., 5° 26'·31W.
56° 38'·59N., 5° 25'·88W.
56° 38'·18N., 5° 25'·30W.
56° 36'·97N., 5° 26'·10W.
56° 36'·42N., 5° 27'·38W.
56° 36'·14N., 5° 28'·65W.
56° 36'·12N., 5° 29'·77W.
56° 36'·26N., 5° 29'·69W.
56° 36'·52N., 5° 28'·01W.
56° 37'·90N., 5° 26'·28W.

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2171 — 2379 — 2389 — 5611_20

3880(T)/25 SCOTLAND - Caledonian Canal - Buoy.

Source: The Northern Lighthouse Board

1. A water quality measuring buoy, *Fl.Y.5s*, has been established in the following position: 57° 15'·17N., 4° 31'·48W.
2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1791 — 5617_19 — 5617_20**3881(P)/25 IRELAND - South Coast - Submarine cable. Works.**

Source: Nexans

1. Submarine cable laying works are taking place between Youghal Bay, Ireland, and Ile de Batz, France, until 2027, joining the following positions:

 51° 56'·046N., 7° 51'·597W.
 51° 54'·306N., 7° 49'·465W.
 51° 50'·953N., 7° 47'·451W.
 51° 47'·831N., 7° 44'·867W.
 51° 39'·358N., 7° 50'·295W.
 49° 42'·996N., 6° 47'·085W.
 49° 24'·379N., 6° 05'·372W.
 49° 14'·892N., 5° 51'·418W.
 49° 01'·065N., 5° 16'·086W.
 48° 45'·341N., 4° 23'·345W.
 48° 45'·281N., 4° 10'·785W.
 48° 44'·754N., 4° 07'·823W.
 48° 44'·204N., 4° 06'·932W.
 48° 43'·411N., 4° 06'·403W.
 48° 41'·682N., 4° 06'·581W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts will be updated when works are complete.
(ETRS89 DATUM)

Charts affected — 2 — 1123 — 2026 — 2049 — 2071 — 2565 — 2647 — 2648 — 2649 — 2655 — 2675 — 5622_1 — 5622_2 — 5622_6**3884(P)/25 SCOTLAND - West Coast - Submarine cable. Obstruction. Works. Virtual aid to navigation.**

Source: Flex Marine Power

1. A submarine cable laying operations are taking place in the vicinity of:

 55° 49'·54N., 6° 06'·22W.
 55° 49'·57N., 6° 06'·15W.
 55° 49'·57N., 6° 06'·05W.
 55° 49'·54N., 6° 06'·00W.
 55° 49'·49N., 6° 06'·01W.
 55° 49'·41N., 6° 05'·97W.
 55° 49'·23N., 6° 05'·76W.
 55° 49'·17N., 6° 05'·74W.
2. An obstruction exists in position 55° 49'·17N., 6° 05'·74W.
3. Works will be marked by a virtual AIS AtoN 'located' approximately 25m to the east broadcasting to vessels as a virtual East Cardinal Mark.
4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Chart affected — 2481**4016(T)/25 WALES - South Coast - Buoy.**

Source: Milford Haven Port Authority

1. A yellow spherical buoy, *Fl(5)Y.20s*, has been deployed, until April 2026, in position 51° 40'·741N., 5° 11'·407W.

4016(T)/25 WALES - South Coast - Buoy. (continued)

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 2878 — 3273 — 5620_11

4017(T)/25 SCOTLAND - East Coast - Works. Bridge.

Source: BEAR Scotland Ltd

- Maintenance work is taking place at Cromarty Bridge, centred on position 57° 37'·192N., 4° 21'·826W.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Chart affected — 1890

4051(P)/25 IRELAND - West Coast - Depths. Drying heights.

Source: INFOMAR

- Recent survey information has shown that numerous depths less than charted exist between Brinlack Point and Boylagh Bay. The most significant are as follows:
- Brinlack Point to Inishsirrer

Depth

8·5m
5m
3·8m
6·5m
4·3m
5·9m

Position

55° 08'·07N., 8° 18'·49W.
55° 07'·99N., 8° 18'·13W.
55° 07'·92N., 8° 18'·45W.
55° 07'·92N., 8° 18'·59W.
55° 07'·83N., 8° 18'·28W.
55° 07'·73N., 8° 18'·68W.

- Inishsirrer to Gola

Depth

14·1m
15m
4·4m
3·8m
6·7m
5·7m
8·3m
8m
5·4m
3m
3·1m

Position

55° 07'·53N., 8° 21'·21W.
55° 07'·21N., 8° 23'·51W.
55° 06'·84N., 8° 23'·41W.
55° 06'·80N., 8° 23'·20W.
55° 06'·70N., 8° 22'·74W.
55° 06'·58N., 8° 23'·45W.
55° 06'·58N., 8° 20'·88W.
55° 06'·21N., 8° 20'·85W.
55° 05'·86N., 8° 21'·63W.
55° 05'·55N., 8° 21'·25W.
55° 05'·48N., 8° 21'·00W.

- Gola and Inishfree

Drying height

0·0m

Depth

4·8m
7·9m
1m

Position

55° 04'·44N., 8° 21'·58W.

Position

55° 04'·40N., 8° 21'·34W.
55° 04'·24N., 8° 21'·54W.
55° 04'·20N., 8° 20'·50W.

4051(P)/25 IRELAND - West Coast - Depths. Drying heights. (continued)

5. Inishfree and Inishfree Bay

<i>Depth</i>	<i>Position</i>
6·1m	55° 04'·12N., 8° 23'·17W.
12·4m	55° 03'·89N., 8° 23'·29W.
7·9m	55° 03'·47N., 8° 22'·97W.
16·4m	55° 03'·42N., 8° 23'·21W.
10·6m	55° 03'·22N., 8° 22'·96W.
2·8m	55° 03'·19N., 8° 22'·35W.
5·6m	55° 03'·00N., 8° 22'·28W.
10·9m	55° 02'·86N., 8° 23'·82W.
5·9m	55° 02'·75N., 8° 24'·27W.
8·7m	55° 02'·71N., 8° 23'·74W.
1·9m	55° 02'·63N., 8° 24'·27W.
7·1m	55° 02'·61N., 8° 22'·49W.
8·4m	55° 02'·56N., 8° 24'·17W.
4·8m	55° 02'·56N., 8° 23'·34W.
3m	55° 02'·42N., 8° 24'·37W.
2·6m	55° 02'·32N., 8° 24'·15W.

6. Owey Island and Rosses Bay

<i>Depth</i>	<i>Position</i>
19m	55° 04'·01N., 8° 27'·29W.
18·7m	55° 03'·45N., 8° 28'·15W.
*13·7m	55° 03'·43N., 8° 27'·89W.
*16m	55° 03'·26N., 8° 27'·77W.
*2·2m	55° 02'·99N., 8° 27'·62W.
*1·9m	55° 02'·99N., 8° 27'·88W.
6·9m	55° 02'·78N., 8° 26'·58W.
4·6m	55° 02'·76N., 8° 26'·43W.
2·3m	55° 02'·58N., 8° 26'·13W.
5·5m	55° 02'·42N., 8° 26'·30W.
13·5m	55° 02'·31N., 8° 27'·65W.
5·7m	55° 02'·15N., 8° 26'·43W.
16·4m	55° 02'·13N., 8° 27'·69W.
6m	55° 02'·00N., 8° 26'·40W.
12·9m	55° 01'·87N., 8° 26'·94W.
5·3m	55° 01'·73N., 8° 26'·85W.
10·2m	55° 01'·45N., 8° 27'·16W.
9·4m	55° 01'·40N., 8° 27'·59W.
5·1m	55° 00'·85N., 8° 25'·14W.
1·6m	55° 00'·81N., 8° 25'·02W.
3·6m	55° 00'·71N., 8° 26'·33W.
2·4m	55° 00'·71N., 8° 25'·53W.
2·9m	55° 00'·60N., 8° 26'·27W.
14·2m	55° 00'·31N., 8° 29'·80W.

7.

<i>*Drying height</i>	<i>Position</i>
2·3m	55° 03'·58N., 8° 26'·73W.

4051(P)/25 IRELAND - West Coast - Depths. Drying heights. (continued)

8. *Aran Island to Boyleagh Bay

<i>Depth</i>	<i>Position</i>
10m	54° 58'·58N., 8° 34'·34W.
14·5m	54° 58'·54N., 8° 34'·36W.
2·7m	54° 58'·35N., 8° 33'·25W.
3·4m	54° 58'·33N., 8° 33'·01W.
2·5m	54° 58'·30N., 8° 31'·88W.
3m	54° 58'·25N., 8° 32'·24W.
14·9m	54° 58'·23N., 8° 33'·20W.
17·5m	54° 58'·20N., 8° 33'·25W.
8·2m	54° 58'·17N., 8° 32'·15W.
8m	54° 58'·06N., 8° 31'·94W.
15·8m	54° 57'·13N., 8° 32'·06W.
15·7m	54° 56'·99N., 8° 32'·09W.
11·8m	54° 56'·43N., 8° 31'·83W.
7·1m	54° 55'·23N., 8° 29'·27W.
5·9m	54° 54'·31N., 8° 28'·79W.
*9·8m	55° 00'·80N., 8° 34'·07W.
*19·7m	54° 58'·78N., 8° 34'·72W.

9. South Sound of Arran Channel Approach

<i>Depth</i>	<i>Position</i>
0·4m	54° 57'·61N., 8° 28'·48W.
<i>Drying height</i>	<i>Position</i>
0·0m	54° 57'·69N., 8° 28'·60W.

10. Mariners are advised to navigate with caution in the area.

11. These changes will be included in the next New Editions of Charts 1879 and 1883.

12. Chart 2723, 2725, 2752 and 2792 will be updated by Notice to Mariners.

13. *Former Notice 3538(P)/25 is cancelled.

*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1879 — 1883**4076(P)/25 SCOTLAND - Orkney Islands - Depths. Drying heights.**

Source: Orkney Islands Council

1. Recent survey information has shown that numerous depths and drying heights less than charted exist within Scapa Flow and Kirkwall Bay. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
9·3m	59° 01'·286N., 2° 57'·862W.
1·7m	59° 00'·743N., 3° 02'·307W.
3·9m	58° 56'·387N., 3° 15'·744W.
5·4m	58° 56'·330N., 3° 15'·550W.
9·9m	58° 56'·272N., 3° 15'·201W.
6·2m	58° 52'·85N., 2° 55'·30W.
18·5m	58° 51'·511N., 3° 06'·480W.
0·1m	58° 49'·967N., 3° 08'·943W.

2. These changes will be included in the next New Edition of Charts 35, 1553, 2162, 2249, 2568, 2581 and 2584.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Charts affected — 35 — 1553 — 2162 — 2249 — 2568 — 2581 — 2584

4185(P)/25 SCOTLAND - North Coast - Depths.

Source: mv Lode and mv Northern Wind

- Recent survey information has shown that depths less than charted exist between Ushat Head and Hoy. The most significant of these are as follows:

<i>Depth</i>	<i>Position</i>
2·2m	58° 51'·75N., 3° 22'·92W.
16·5m	58° 37'·21N., 3° 37'·95W.
8·6m	58° 37'·35N., 3° 33'·85W.
4·4m	58° 37'·18N., 3° 22'·03W.
1·9m	58° 37'·13N., 3° 21'·88W.

- *And between Holborn Head and Dunnet Head:

<i>Depth</i>	<i>Position</i>
* 2·1m	58° 36'·02N., 3° 31'·42W.
* 3·9m	58° 36'·26N., 3° 30'·71W.
* 8·9m	58° 36'·53N., 3° 29'·87W.
* 3·0m	58° 36'·69N., 3° 28'·60W.
* 3·7m	58° 36'·79N., 3° 28'·18W.
* 7·5m	58° 36'·74N., 3° 26'·99W.
* 2·4m	58° 36'·74N., 3° 26'·32W.
* 1·9m	58° 36'·35N., 3° 25'·52W.
* 3·8m	58° 36'·30N., 3° 24'·82W.
* 8·9m	58° 36'·36N., 3° 24'·27W.
* 1·4m	58° 37'·39N., 3° 22'·43W.
* 1·6m	58° 37'·73N., 3° 23'·10W.
* 3·6m	58° 38'·00N., 3° 24'·05W.
* 2·8m	58° 38'·27N., 3° 24'·73W.
* 4·2m	58° 38'·37N., 3° 24'·94W.
* 7·7m	58° 39'·04N., 3° 25'·01W.
* 8·6m	58° 39'·47N., 3° 24'·77W.
* 4·8m	58° 40'·04N., 3° 23'·93W.

- Mariners are advised to navigate with caution in the area.
- *Former Notice 3585(P)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1954 — 2162 — 2249**4235(P)/25 IRELAND - North Coast - Depths. Rocks.**

Source: mv Keary

- Depths less than charted exist around Tor Rocks and Inishtrahull. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
1·2m	55° 26'·65N., 7° 15'·60W.
3·1m	55° 25'·72N., 7° 14'·97W.
4·6m	55° 25'·63N., 7° 14'·50W.
11·2m	55° 26'·64N., 7° 15'·83W.
16·3m	55° 27'·08N., 7° 14'·07W.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when works are complete.
(ETRS89 DATUM)

Charts affected — 2723 — 2811 — 5612_2

4251(T)/25 ENGLAND - East Coast - Restricted area.

Source: Sizewell C Harbour Authority

1. A restricted area has been established bounded by the coast and the following positions:

52° 12'·0N., 1° 37'·4E.
 52° 12'·8N., 1° 37'·4E.
 52° 12'·8N., 1° 38'·4E.
 52° 12'·7N., 1° 40'·1E.
 52° 12'·0N., 1° 40'·1E.

2. Commercial, service, and construction vessels are prohibited from entering this area without permission of the Harbour Master.
(ETRS89 DATUM)

Charts affected — 1543 — 5614_1**4263(P)/25 ENGLAND - South West Coast - Wreck.**

Source: XOCEAN

1. A non-dangerous wreck, depth 87m, exists in position 50° 28'·8N., 7° 46'·4W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1123 — 2649**4278(P)/25 ENGLAND - West Coast - Depths. Drying heights.**

Source: Gloucester Harbour Trustees

1. Recent survey information has shown that numerous depths and drying heights less than charted exist between Dun Sands and Sharpness Point. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
8·7m	51° 34'·95N., 2° 41'·23W.
-0·6m	51° 35'·16N., 2° 41'·08W.
-0·2m	51° 35'·32N., 2° 40'·82W.
-0·6m	51° 35'·69N., 2° 39'·74W.
11·1m	51° 36'·56N., 2° 37'·82W.
7·8m	51° 36'·59N., 2° 38'·01W.
1·6m	51° 36'·98N., 2° 38'·46W.
-1·2m	51° 37'·03N., 2° 38'·47W.
4·3m	51° 37'·12N., 2° 38'·27W.
-1·9m	51° 37'·15N., 2° 38'·32W.
6·5m	51° 37'·24N., 2° 38'·91W.
-0·6m	51° 37'·26N., 2° 38'·22W.
3·9m	51° 37'·29N., 2° 38'·05W.
1·9m	51° 37'·48N., 2° 38'·81W.
1·7m	51° 37'·63N., 2° 38'·72W.
4·3m	51° 38'·15N., 2° 38'·20W.
3·4m	51° 39'·07N., 2° 37'·21W.
-0·5m	51° 39'·32N., 2° 36'·87W.
1·7m	51° 40'·56N., 2° 33'·36W.
1·9m	51° 40'·82N., 2° 32'·76W.
0·6m	51° 41'·43N., 2° 30'·45W.
1·4m	51° 41'·92N., 2° 30'·13W.
0·0m	51° 43'·179N., 2° 29'·284W.
-0·2m	51° 43'·44N., 2° 29'·52W.
0·7m	51° 43'·449N., 2° 29'·256W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. These and other changes will be included in the next New Edition of Charts 1166, 5608_18 & 5608_21.
(ETRS89 DATUM)

Charts affected — 1166 — 5608_18 — 5608_21

4308(P)/25 IRELAND - North Coast - Depths.

Source: R.V. LIR

- Recent survey information has shown that depths less than charted exist around Tory Island. The most significant of these are as follows:

<i>Depth</i>	<i>Position</i>
1·9m	55° 16'·64N., 8° 15'·07W.
4·5m	55° 15'·80N., 8° 15'·55W.
3·1m	55° 15'·57N., 8° 13'·72W.
2·4m	55° 15'·53N., 8° 11'·40W.
2·7m	55° 09'·66N., 8° 17'·18W.

(ETRS89 DATUM)

Chart affected — 2752**4313(T)/25 SCOTLAND - Shetland Islands - Scientific instruments.**

Source: Scottish Sea Farms

- Scientific instruments, marked by pink and orange floats, have been established on the seabed in the following positions:

60° 23'·47N., 1° 05'·29W.
60° 23'·54N., 1° 05'·41W.

- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 3282 — 3284**4371(P)/25 ENGLAND - South Coast - Wreck.**

Source: mv Northern Gale

- The least depth over the wreck in position 50° 34'·61N., 2° 33'·99W. is reported to be 19·1m.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2454 — 2615 — 3315 — 5601_3 — 5601_4**4441(P)/25 SCOTLAND - West Coast - Depths. Depth information. Obstruction.**

Source: mv Northern Gale and mv Northern Remote

- Recent survey information has shown that depths less than charted exist within the vicinity of Boreray, St Kilda. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
63m	57° 53'·79N., 8° 31'·88W.
65m	57° 53'·60N., 8° 29'·28W.
60m	57° 53'·29N., 8° 28'·83W.
64m	57° 52'·37N., 8° 31'·33W.
61m	57° 51'·83N., 8° 32'·00W.
23·3m	57° 51'·73N., 8° 30'·62W.
48m	57° 51'·56N., 8° 29'·69W.
39m	57° 51'·18N., 8° 27'·91W.
34m	57° 51'·09N., 8° 28'·01W.
59m	57° 51'·09N., 8° 31'·04W.
47m	57° 51'·05N., 8° 32'·82W.
47m	57° 50'·66N., 8° 27'·55W.
60m	57° 50'·42N., 8° 29'·05W.
50m	57° 49'·84N., 8° 28'·47W.
18·3m	57° 53'·01N., 8° 30'·14W.
38m	57° 52'·98N., 8° 29'·63W.
36m	57° 52'·77N., 8° 30'·03W.
34m	57° 52'·37N., 8° 28'·92W.
19·7m	57° 51'·59N., 8° 28'·86W.

4441(P)/25 SCOTLAND - West Coast - Depths. Depth information. Obstruction. (continued)

2. Recent survey information has shown that depths less than charted exist within the vicinity of Soay, St Kilda. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
71m	57° 52'·51N., 8° 38'·04W.
70m	57° 51'·03N., 8° 39'·78W.
56m	57° 50'·28N., 8° 39'·11W.
21·2m	57° 50'·07N., 8° 38'·83W.

3. Recent survey information has shown that depths less than charted exist within the vicinity of Hirta, St Kilda. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
60m	57° 51'·44N., 8° 34'·83W.
50m	57° 49'·98N., 8° 34'·13W.
13·9m	57° 49'·54N., 8° 35'·73W.
29m	57° 49'·37N., 8° 36'·02W.
18·6m	57° 49'·34N., 8° 35'·82W.
40m	57° 48'·43N., 8° 36'·90W.
61m	57° 47'·91N., 8° 35'·11W.
38m	57° 47'·79N., 8° 34'·91W.
38m	57° 47'·64N., 8° 34'·52W.
43m	57° 47'·63N., 8° 34'·23W.
33m	57° 47'·49N., 8° 33'·81W.
45m	57° 47'·44N., 8° 33'·88W.
73m	57° 47'·38N., 8° 38'·99W.
58m	57° 46'·35N., 8° 34'·77W.
43m	57° 49'·80N., 8° 33'·92W.
43m	57° 49'·72N., 8° 33'·60W.
43m	57° 49'·59N., 8° 33'·41W.
44m	57° 49'·31N., 8° 33'·26W.
44m	57° 48'·81N., 8° 32'·66W.

4. *An obstruction, depth 1·2m, is reported to exist in position 57° 48'·60N., 8° 34'·11W.
5. Recent survey information has shown that depths less than charted exist within the vicinity of Levenish, St Kilda. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
6·5m	57° 47'·55N., 8° 31'·49W.
7·1m	57° 47'·54N., 8° 31'·56W.
61m	57° 47'·74N., 8° 29'·71W.
14·9m	57° 47'·60N., 8° 30'·81W.

6. Mariners are advised to navigate with caution in the area.
7. Charts will be updated when full details are available.
8. *Former Notice 3351(P)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1128 — 2524 — 2635 — 2721 — 2722

4485(T)/25 IRELAND - East Coast - Lights. Bridge. Works.

Source: Warrenpoint Harbour Authority & Carlingford Lough Commission Notice 13/25

1. A temporary supplementary light, Iso.WRG.2s10m2M, has been established in position 54° 06'·373N., 6° 16'·508W.
2. Light, Iso.4s15m2M, in position 54° 06'·463N., 6° 16'·688W. is obscured due to bridge construction works.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Chart affected — 2800

4536(T)/25 ENGLAND - East Coast - Buoy. Depths. Leading line.

Source: Port of Berwick

1. *A temporary Port Lateral buoy, *Fl.R.3s*, has been established to mark the edge of a shifting sand bank in position 55° 45'·900N., 1° 59'·570W.

4536(T)/25 ENGLAND - East Coast - Buoy. Depths. Leading line. (continued)

- Depths significantly shoaler than charted exist within this area.
- The charted leading line of 207° is no longer accurate and should not be used until clear and past.
- Mariners are advised to navigate with additional caution and consult the local port authority for further information prior to entry.
- *Former Notice 3073(T)/23 is cancelled.
*Indicates new or revised entry.
(ETRS89 DATUM)

Chart affected — 1612**4540(P)/25 ENGLAND - East Coast - Depths.**

Source: mv Northern Storm

- Depths less than charted exist in the vicinity of Long Sand Head. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
11·7m	51° 48'·89N., 1° 39'·54E.
17·9m	51° 48'·85N., 1° 38'·01E.
*12·5m	51° 48'·44N., 1° 37'·44E.
*11·5m	51° 48'·33N., 1° 38'·15E.
*13·5m	51° 48'·35N., 1° 38'·35E.
*13·4m	51° 48'·54N., 1° 38'·68E.

- Mariners are advised to navigate with caution in the area.
- *Charts will be updated when full details are available.
- *Former Notice 3706(P)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1975 — 2052 — 2692**4560(T)/25 SCOTLAND - East Coast - Scientific instrument.**

Source: Port of Aberdeen

- An unmarked scientific instrument has been established on the seabed in the following position:
57° 08'·169N., 2° 02'·167W.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 210 — 1446 — 5617_16 — 5617_4**4605(T)/25 ENGLAND - South Coast - Scientific instrument.**

Source: Falmouth Harbour Authority Notice 22/2025

- Metocan equipment has been deployed in position 50° 09'·110N., 5° 02'·094W. until the end of December 2025.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 32 — 5602_5**4610(T)/25 ENGLAND - South Coast - Buoy.**

Source: King's Harbour Master, Portsmouth

- The *Mary Rose* yellow light-buoy, *Fl.Y.5s*, in position 50° 45'·803N., 1° 06'·218W. is reported off station.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2036 — 2037 — 2625 — 5600_13**4612(T)/25 SCOTLAND - West Coast - Wreck.**

Source: Peel Ports

- A dangerous wreck with depth 10·8m exists in position 55° 43'·930N., 4° 57'·002W.

4612(T)/25 SCOTLAND - West Coast - Wreck. (continued)

- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1867 — 1907 — 2131 — 2221 — 2491 — 5610_11 — 5610_9

4614(P)/25 ENGLAND - South Coast - Depths.

Source: mv Northern Gale

- Recent survey information has shown that depths less than charted exist W of Needles Channel. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
8·1m	50° 39'·84N., 1° 37'·48W.
9·3m	50° 39'·78N., 1° 37'·56W.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when surveying activities are complete.
(ETRS89 DATUM)

Charts affected — 2035 — 2045 — 2615 — 5600_2 — 5600_5 — 5601_5

4643(T)/25 IRELAND - South Coast - Buoyage.

Source: Department of Transport, Ireland Notice 41/25 and EirGrid

- *The following yellow light-buoys, *Fl(5)Y.20s*, buoys have been established:

<i>Designation</i>	<i>Position</i>
ETN-MB001	51° 56'·00N., 7° 22'·08W.
ETN-MB002	51° 59'·02N., 7° 06'·21W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- *Former Notice 4253(T)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1121 — 1123 — 2049 — 5621_14 — 5622_1 — 5622_2

4646(T)/25 ENGLAND - South Coast - Works. Buoyage.

Source: Lymington Harbour Authority

- *Boiler Marsh restoration works are taking place in the area bounded by the following positions:

50° 44'·68N., 1° 30'·45W.
50° 44'·76N., 1° 30'·15W.
50° 44'·98N., 1° 30'·23W.
50° 44'·88N., 1° 30'·51W.

- Special buoys have been temporarily established in the following positions:

50° 44'·782N., 1° 30'·437W.
50° 44'·80N., 1° 30'·25W.

- *Existing special buoys in the vicinity are subject to change.
- Mariners are advised to navigate with caution in the area.
- *Former Notice 5854(T)24 is cancelled.
(ETRS89 DATUM)

Charts affected — 2021 — 2035 — 5600_4 — 5600_7

4657(P)/25 SCOTLAND - Shetland Islands - Depths.

Source: British Government Survey

- Recent survey information has shown that numerous depths less than charted exist between Strom Ness and Grutness Voe. The most significant are as follows:

4657(P)/25 SCOTLAND - Shetland Islands - Depths. (continued)

2. Strom Ness to Burga Stacks

<i>Depth</i>	<i>Position</i>
34m	60° 11'·47N., 1° 35'·78W.
5·6m	60° 11'·45N., 1° 35'·35W.
9·8m	60° 11'·27N., 1° 33'·12W.
9·2m	60° 10'·76N., 1° 32'·51W.

3. Clift Sound Bridge

<i>Depth</i>	<i>Position</i>
2·8m	60° 07'·65N., 1° 16'·36W.

4. Stream Sound to West Voe of Quarff

<i>Depth</i>	<i>Position</i>
7·3m	60° 05'·93N., 1° 17'·44W.
2m	60° 05'·85N., 1° 18'·24W.
11·8m	60° 05'·75N., 1° 17'·49W.
18·8m	60° 05'·49N., 1° 17'·43W.

5. Voe of North House to Ness of Ireland

<i>Depth</i>	<i>Position</i>
9·2m	60° 03'·60N., 1° 18'·93W.
2·8m	60° 03'·37N., 1° 20'·17W.
9·1m	60° 03'·04N., 1° 19'·26W.
5·7m	60° 02'·46N., 1° 21'·70W.
27·8m	60° 02'·35N., 1° 22'·80W.
12·9m	60° 01'·78N., 1° 19'·52W.
28·5m	60° 01'·54N., 1° 23'·06W.
6·9m	60° 01'·33N., 1° 19'·74W.
1·9m	60° 01'·29N., 1° 21'·63W.
25·8m	60° 01'·03N., 1° 22'·37W.
4·7m	60° 00'·89N., 1° 19'·82W.
47m	60° 00'·00N., 1° 22'·56W.

6. Sweyn Holm to Coar Holm

<i>Depth</i>	<i>Position</i>
36m	59° 57'·88N., 1° 22'·32W.
22·8m	59° 57'·83N., 1° 21'·17W.

7. Garth Wick to Grutness Voe

<i>Depth</i>	<i>Position</i>
1·4m	59° 53'·85N., 1° 19'·94W.
31m	59° 53'·11N., 1° 22'·09W.
0·1m	59° 52'·95N., 1° 16'·78W.
2·7m	59° 52'·82N., 1° 19'·08W.
1·8m	59° 52'·81N., 1° 16'·16W.
9·6m	59° 52'·81N., 1° 15'·96W.
1·8m	59° 52'·72N., 1° 19'·08W.
1m	59° 52'·70N., 1° 18'·87W.
5m	59° 52'·69N., 1° 19'·58W.
29·4m	59° 52'·40N., 1° 21'·35W.
3·6m	59° 52'·34N., 1° 19'·60W.
29·8m	59° 52'·13N., 1° 20'·69W.

8. Mariners are advised to navigate with caution in the area.

9. These changes will be included in the next New Edition of Charts 1119, 3281, 3283, 3294 and 3295. (ETRS89 DATUM)

Charts affected — 1119 — 3281 — 3283 — 3294 — 3295**4689(T)/25 ENGLAND - East Coast - Buoyage.**

Source: ABP Humber Notice 136/25

1. The light float, *VQ(6)+LFL.10s6M, South East Chequer*, in position 53° 33'·36N., 0° 12'·86E. has been replaced by a South Cardinal light-buoy, *VQ(6)+LFL.10s* until further notice.

4689(T)/25 ENGLAND - East Coast - Buoyage. (continued)

- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 104 — 107 — 5614_14 — 5614_15

4697(T)/25 ENGLAND - East Coast - Buoyage.

Source: Harwich Haven Authority Notice 78/25

- Temporary buoyage and moorings will be installed on the north side of the Parkeston Anchorage to mark the storage of floating pipes in the vicinity of the area bounded by the following positions:

 $51^{\circ} 57' \cdot 064\text{N.}, 1^{\circ} 14' \cdot 148\text{E.}$
 $51^{\circ} 57' \cdot 207\text{N.}, 1^{\circ} 14' \cdot 147\text{E.}$
 $51^{\circ} 57' \cdot 224\text{N.}, 1^{\circ} 14' \cdot 797\text{E.}$
 $51^{\circ} 57' \cdot 099\text{N.}, 1^{\circ} 14' \cdot 796\text{E.}$
- These are expected to be in place until the end of March 2026.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 1491 — 2693 — 5607_7

4702(T)/25 ENGLAND - South Coast - Piles. Works. Pontoons.

Source: Lymington Harbour Commissioners Notice 25/25

- Temporary re-piling works are taking place in the area bounded by:

 $50^{\circ} 45' \cdot 458\text{N.}, 1^{\circ} 32' \cdot 014\text{W.}$
 $50^{\circ} 45' \cdot 469\text{N.}, 1^{\circ} 31' \cdot 995\text{W.}$
 $50^{\circ} 45' \cdot 359\text{N.}, 1^{\circ} 31' \cdot 832\text{W.}$
 $50^{\circ} 45' \cdot 349\text{N.}, 1^{\circ} 31' \cdot 849\text{W.}$
- Pontoons will be moving around the marina and may transit the main navigation channel of the river.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2021 — 5600_4

4707(T)/25 ENGLAND - East Coast - Works. Light. Buoyage.

Source: Trinity House

- Re-engineering works are taking place at Coquet lighthouse.
- The sectored light in position $55^{\circ} 20' \cdot 033\text{N.}, 1^{\circ} 32' \cdot 384\text{W.}$ has been temporarily amended to Fl(3)20s9M visible through 360° . The red sectors are temporarily extinguished.
- The following light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>QR</i>	<i>Pan Bush</i>	Can Red	$55^{\circ} 20' \cdot 730\text{N.}, 1^{\circ} 33' \cdot 400\text{W.}$
<i>Fl(2)R5s</i>	<i>Hauxley Head</i>	Can Red	$55^{\circ} 19' \cdot 394\text{N.}, 1^{\circ} 31' \cdot 740\text{W.}$
<i>Fl(3)R10s</i>	<i>Cresswell</i>	Can Red	$55^{\circ} 14' \cdot 80\text{N.}, 1^{\circ} 29' \cdot 00\text{W.}$
<i>Q</i>	<i>Coquet Flat</i>	North Cardinal, Pillar	$55^{\circ} 20' \cdot 860\text{N.}, 1^{\circ} 32' \cdot 830\text{W.}$

- These works are expected to be completed by October 2026.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 156 — 1192 — 1627 — 2182A — 2182B — 5615_2 — 5615_20 — 5615_23 — 5615_6 — 5615_7

4708(T)/25 SCOTLAND - West Coast - Scientific instruments. Buoyage.

Source: Scottish Sea Farms

- Two scientific instruments have been temporarily established on the seabed. They are marked by unlit yellow spherical buoys in the following positions:

 $56^{\circ} 38' \cdot 92\text{N.}, 6^{\circ} 05' \cdot 75\text{W.}$
 $56^{\circ} 38' \cdot 93\text{N.}, 6^{\circ} 05' \cdot 57\text{W.}$

4708(T)/25 SCOTLAND - West Coast - Scientific instruments. Buoyage. (continued)

- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2171 — 2392 — 5611_15

4710(P)/25 SCOTLAND - East Coast - Works. Wind farm. Buoyage. Restricted area. Submarine cable.

Source: Inch Cape Offshore Limited

- *Work has commenced on the construction of Inch Cape Offshore Wind Farm. The main Wind Farm Array work area is marked by light-buoys in the following positions:

<i>Buoy Type</i>	<i>Designation</i>	<i>Light Characteristic</i>	<i>Position</i>
North Cardinal	<i>N1</i>	<i>Q AIS</i>	56° 35'·90N., 2° 09'·45W.
Special Mark	<i>SM1</i>	<i>Fl.Y.5s</i>	56° 32'·68N., 2° 08'·88W.
Special Mark	<i>SM2</i>	<i>Fl.Y.5s</i>	56° 29'·01N., 2° 09'·17W.
East Cardinal	<i>E1</i>	<i>VQ(3)5s AIS</i>	56° 27'·64N., 2° 02'·22W.
*Special Mark	<i>SM3</i>	<i>Fl.Y.5s</i>	56° 25'·90N., 2° 04'·13W.
South Cardinal	<i>S1</i>	<i>Q(6)+LFl.15s</i>	56° 24'·90N., 2° 07'·92W.
South Cardinal	<i>S2</i>	<i>VQ(6)+LFl.10s AIS</i>	56° 25'·09N., 2° 14'·00W.
Special Mark	<i>SM4</i>	<i>Fl.Y.5s</i>	56° 27'·50N., 2° 16'·92W.
West Cardinal	<i>W1</i>	<i>VQ(9)10s AIS</i>	56° 30'·29N., 2° 18'·00W.
Special Mark	<i>SM5</i>	<i>Fl.Y.5s</i>	56° 32'·89N., 2° 17'·01W.
Special Mark	<i>SM6</i>	<i>Fl.Y.5s</i>	56° 35'·06N., 2° 15'·20W.
*Wave Rider		<i>Fl(5)Y.20s</i>	56° 32'·26N., 2° 11'·50W.

- All vessels should navigate with caution in the area. A safety zone of 500 metres becomes operational around the turbines under construction.
- Cable laying operations will be conducted between the new wind farm and a site west of Cockenzie
55° 58'·08N., 2° 58'·54W.
- *These changes will be included in New Editions of Charts 190, 1407, 1409, 5615_3 and 5617_2 to be published early 2026.
- *Charts 175, 734, 735, 5615_9, 5615_10, 5615_11, 5615_12 and 5617_1 will be updated by Notice to Mariners.
- *Former Notice 1760(P)/25 is cancelled.
- *Indicates new or revised entry.
(ETRS89 DATUM)

Charts affected — 175 — 734 — 735 — 2182B — 5615_10 — 5615_11 — 5615_12 — 5615_23 — 5615_3 — 5615_9 — 5617_1 — 5617_2

4902(T)/25 ENGLAND - South Coast - Buoy.

Source: Yarmouth Harbour Commissioners Notice 9/25

- The Red Can light-buoy, *Fl.R.2s*, in position 50° 42'·62N., 1° 29'·95W. is reported off station.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 2035 — 5600_7

5050(T)/25 ENGLAND - East Coast - Wreck.

Source: Peel Ports London Medway Notice 41/25

- A dangerous wreck exists in position 51° 23'·46N., 0° 29'·99E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 1835 — 2482 — 5606_11 — 5606_12

5105(T)/25 ENGLAND - East Coast - Foul.

Source: ScottishPower Renewables, EA2 NM 003/25

- A lost anchor and chain have been reported in position 52° 18'·15N., 1° 42'·50E.

5105(T)/25 ENGLAND - East Coast - Foul. (continued)

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1504 — 1543 — 1610 — 5614_1

5106(T)/25 IRELAND - East Coast - Marina. Works. Piles. Pontoon.

Source: Belfast Harbour Commissioners Notice 19/25

1. Marina expansion works, including piling, pontoon installation, and associated marine construction activities, will take place within Belfast Harbour Marina in the vicinity of position 54° 36'·294N., 5° 54'·798W. between November 2025 and January 2026.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 1752 — 5612_13

5204(T)/25 CELTIC SEA - UK Sector - Scientific instruments.

Source: Celtic Sea Power Limited

1. Scientific instruments attached to subsurface moorings have been established in the following positions:

51° 39'·37N., 6° 03'·48W.
 51° 37'·12N., 5° 42'·13W.
 51° 30'·68N., 5° 25'·32W.
 51° 22'·44N., 5° 07'·59W.
 51° 26'·86N., 6° 09'·99W.
 51° 22'·54N., 5° 48'·69W.
 51° 18'·65N., 5° 26'·93W.
 51° 13'·16N., 5° 08'·98W.
 51° 14'·72N., 6° 19'·90W.
 51° 09'·03N., 5° 59'·99W.
 51° 08'·10N., 5° 35'·06W.
 51° 03'·36N., 5° 17'·83W.
 51° 00'·42N., 6° 32'·79W.
 50° 57'·75N., 6° 09'·49W.
 50° 49'·89N., 5° 48'·92W.
 50° 48'·39N., 5° 29'·04W.
 50° 41'·05N., 6° 17'·36W.
 50° 37'·72N., 5° 52'·04W.
 50° 24'·26N., 6° 15'·94W.
 50° 46'·1N., 6° 43'·6W.
 50° 26'·7N., 6° 41'·6W.

2. The moorings extend upwards from the seabed by 5 metres and have no surface markers.
3. Mariners are advised to navigate with caution in the area.
4. *Former Notice 4718(T)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 1123 — 1178 — 2049 — 2565 — 5603_1 — 5603_15 — 5608_2 — 5620_3 — 5621_2

5299(T)/25 ENGLAND - South Coast - Wreck. Buoyage.

Source: Trinity House

1. A dangerous wreck exists in position 50° 45'·42N., 1° 24'·74W.
2. Emergency wreck marking buoys have been established in the following positions:

*50° 45'·39N., 1° 24'·90W.
 *50° 45'·45N., 1° 24'·58W.

3. Mariners are advised to navigate with caution in the area.
4. *Former Notice 4477(T)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 2035 — 2036 — 2045 — 5600_2 — 5600_7

5313(T)/25 SCOTLAND - East Coast - Scientific instruments. Moorings. Buoy.

Source: Ardersier Port (Scotland) Ltd

1. Scientific instruments attached to subsurface moorings have been established in the following positions:

<i>Designation</i>	<i>Position</i>
23-1	57° 36'·07N., 4° 02'·52W.
23-2	57° 36'·05N., 4° 02'·49W.
26-1	57° 36'·22N., 3° 58'·70W.
26-2	57° 36'·19N., 3° 58'·66W.
140-1	57° 36'·55N., 4° 01'·04W.
140-2	57° 36'·55N., 4° 00'·99W.

2. The moorings extend upwards from the seabed by 6 metres and have no surface markers, except for scientific instrument '26-1', whose position is marked by a small orange buoy.
3. *Former Notice 2360(T)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 223 — 1077 — 5617_10 — 5617_9**5314(T)/25 SCOTLAND - West Coast - Scientific instruments.**

Source: Scottish Sea Farms

1. Scientific instruments, marked by buoys, have been established on the seabed in the following positions:

58° 02'·42N., 5° 28'·00W.
 58° 01'·61N., 5° 27'·38W.
 58° 01'·19N., 5° 27'·37W.
 58° 01'·44N., 5° 26'·12W.

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1794 — 2501**5315(P)/25 SCOTLAND - West Coast - Depths. Wreck.**

Source: mv Northern Gale

1. Recent survey information has shown that numerous depths less than charted exist within Luce Bay. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
17·1m	54° 37'·89N., 4° 53'·68W.
14·2m	54° 38'·23N., 4° 53'·65W.
18·4m	54° 38'·73N., 4° 51'·27W.
18·4m	54° 40'·44N., 4° 46'·28W.
17·4m	54° 41'·08N., 4° 46'·33W.

2. A non-dangerous wreck, depth 56m exists in position 54° 44'·22N., 5° 04'·16W.
3. Charts will be updated when full details are available.
4. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1411 — 1826 — 2093 — 2094 — 2198 — 2724 — 5610_17 — 5612_1 — 5612_11 — 5613_19 — 5613_2**5317(T)/25 CHANNEL ISLANDS - Jersey - Scientific instruments.**

Source: Ports of Jersey Notice 16/25 and SHOM

1. Acoustic sensors, extending approximately 0·5m from the seabed have been deployed in positions:

49° 12'·69N., 1° 59'·57W.
 49° 13'·53N., 1° 55'·51W.
 49° 14'·44N., 1° 51'·01W.
 49° 11'·58N., 1° 50'·65W.
 *49° 16'·00N., 1° 45'·83W.

2. Mariners are advised to navigate with caution in the area.

5317(T)/25 CHANNEL ISLANDS - Jersey - Scientific instruments. (continued)

3. *Former Notice 4607(T)/25 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 1138 — 2669 — 3655 — 5604_13 — 5604_16 — 5604_4 — 5604_5

5410(T)/25 ENGLAND - East Coast - Buoy. Scientific instruments.

Source: Scottish Power

1. *A special light-buoy, *Fl(5)Y.20s*, has been established in position 52° 39'·17N., 2° 52'·33E.
 2. Subsurface scientific instruments, have been established in the following positions:

52° 42'·18N., 2° 56'·79E.
 52° 41'·09N., 2° 53'·96E.
 52° 38'·51N., 2° 53'·96E.
 52° 37'·24N., 2° 51'·79E.
 52° 37'·04N., 2° 52'·85E.
 52° 36'·67N., 2° 52'·56E.
 52° 35'·70N., 2° 50'·92E.
 52° 35'·32N., 2° 50'·71E.

3. The instruments extend upwards from the seabed by 2·5 metres and have no surface markers.
 4. Mariners are requested to maintain a minimum distance of 500m from the instruments.
 5. Mariners are advised to navigate with caution in the area.
 6. *Former Notice 1963(T)/25 is cancelled.
 *Indicates new or revised entry.
 (ETRS89 DATUM)

Charts affected — 1504 — 1631

5418(P)/25 IRELAND - East Coast - Depth information. Wreck.

Source: mv Northern Gale

1. Recent survey information has shown that depths less than charted exist south of Ardglass Bank. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
* 19·6m	54° 11'·35N., 5° 35'·83W.
26·4m	54° 09'·82N., 5° 35'·43W.
* 22·2m	54° 09'·71N., 5° 34'·47W.

2. *A wreck with least depth 48m exists in position 54° 01'·17N., 5° 38'·62W.
 3. Mariners are advised to navigate with caution in the area.
 4. Charts will be updated when full details are available.
 5. *Former Notice 3249(P)/25 is cancelled.
 *Indicates new or revised entry
 (ETRS89 DATUM)

Charts affected — 44 — 1411 — 2093 — 5612_1 — 5612_3 — 5612_4

5470(T)/25 SCOTLAND - Orkney Islands - Buoy.

Source: Scottish Sea Farms

1. An unlit yellow wave monitoring buoy has been established in position 58° 59'·60N., 2° 46'·86W.
 2. Former Notice 3853(T)/25 is cancelled.
 3. Mariners are advised to navigate with caution.
 (ETRS89 DATUM)

Charts affected — 2250 — 2584

5496(P)/25 ENGLAND - East Coast - Depths.

Source: m/v Northern Storm and m/v Lode

- Recent survey information has shown that depths less than charted exist within Beadnell Bay. The most significant is as follows:

<i>Depth</i>	<i>Position</i>
13·7m	55° 32'·61N., 1° 35'·99W.

- Recent survey information has shown that depths less than charted exist within Warkworth Harbour. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
10·5m	55° 21'·244N., 1° 33'·515W.
21·3m	55° 21'·338N., 1° 31'·998W.
9·8m	55° 20'·398N., 1° 31'·907W.
14·8m	55° 20'·552N., 1° 32'·084W.
17·0m	55° 18'·618N., 1° 31'·383W.
25·8m	55° 19'·492N., 1° 31'·074W.

- Recent survey information has shown that depths less than charted exist within Cambois Bay. The most significant is as follows:

<i>Depth</i>	<i>Position</i>
10·9m	55° 09'·44N., 1° 29'·53W.

- * Recent survey information has shown that depths less than charted exist within Hauxley Haven. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
1·3m	55° 19'·234N., 1° 32'·060W.
1·3m	55° 19'·119N., 1° 32'·026W.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when surveying activities are complete.
- * Former Notice 4911(P)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Charts affected — 156 — 1627 — 5615_20 — 5615_6 — 5615_7**5522(P)/25 ENGLAND - East Coast - Depths. Wreck.**

Source: mv Northern Storm

- Recent survey information has shown that depths less than charted exist East of Black Halls Point. The most significant is as follows:

<i>Depth</i>	<i>Position</i>
18·9m	54° 45'·42N., 1° 12'·51W.

- The least depth over the wreck in position 54° 48'·83N., 1° 13'·81W. is reported to be 22·07m.
- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
(ETRS89 DATUM)

Charts affected — 152 — 1191 — 1192 — 2567 — 5615_1 — 5615_5**5534(P)/25 SCOTLAND - West Coast - Depths. Wrecks.**

Source: Mintaka I

- Recent survey information has shown that depths less than charted exist south and east of Ailsa Craig. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
27m	55° 12'·26N., 5° 06'·13W.
*26m	55° 16'·12N., 4° 55'·73W.

5534(P)/25 SCOTLAND - West Coast - Depths. Wrecks. (continued)

2. *A wreck exists in the following position:

<i>Depth</i>	<i>Position</i>
29m	55° 14'·40N., 4° 58'·17W.

3. *The least depths over the following charted wrecks have been amended to:

<i>Depth</i>	<i>Position</i>
35m	55° 12'·93N., 5° 11'·88W.
39m	55° 13'·04N., 5° 15'·01W.

4. Mariners are advised to navigate with caution in the area.

5. Charts will be updated when full details are available.

6. Former Notice 5119(P)/25 is cancelled.

*Indicates new or revised entry.

(ETRS89 DATUM)

Charts affected — 2126 — 2199 — 2724 — 5610_14 — 5610_15 — 5610_16 — 5610_17 — 5610_19

5572(T)/25 ENGLAND - East Coast - Buoy. Obstruction.

Source: Sizewell C Harbour Authority

1. A temporary orange buoy, *Fl.1.5s*, has been established in position 52° 13'·42N., 1° 40'·98E. to mark an obstruction which may extend up to 4m above the seabed.
2. Mariners are advised to maintain a clearance of 200 metres from the buoy until further notice.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (ETRS89 DATUM)

Charts affected — 1504 — 1543 — 1610 — 5614_1

5577(P)/25 ENGLAND - East Coast - Depths. Obstructions.

Source: Port of Blyth

1. Depths less than charted exist within the Port of Blyth. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4·6m	55° 08'·484N., 1° 31'·225W.
4·2m	55° 08'·451N., 1° 31'·167W.
5·4m	55° 08'·418N., 1° 31'·223W.
0·4m	55° 08'·269N., 1° 31'·248W.
3·6m	55° 07'·126N., 1° 29'·810W.

2. Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
2·5m	55° 08'·216N., 1° 31'·230W.
4·5m	55° 08'·199N., 1° 31'·231W.
2·3m	55° 07'·236N., 1° 29'·721W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

4. These changes will be included in the next New Edition of Charts 1626 and 5615_19.

(ETRS89 DATUM)

Charts affected — 1626 — 5615_19

5646(P)/25 SCOTLAND - East Coast - Works. Wind farm. Buoyage. Lights.

Source: Moray West Offshore Windfarm

1. Construction works on the Moray West Offshore Wind Farm in position 58° 04'·49N., 3° 02'·63W. are now complete; buoyage marking the construction area has been removed.
2. The wind farm is marked by Fl.Y and Aero Mo(W)R lights on the outer turbines.
3. These changes will be included in a New Edition of Chart 115 to be published early 2026.
4. Mariners are advised to navigate with caution in the area.
5. Charts 222, 223, 5617_7, 2182B and 2182C will be updated by Notice to Mariners. (ETRS89 DATUM)

Chart affected — 115

5648(T)/25 SCOTLAND - East Coast - Scientific instruments. Moorings.

Source: The Scottish Association for Marine Science

1. Acoustic monitoring instruments attached to seabed moorings have been established in the following positions:

57° 37'·57N., 1° 38'·96W.

57° 51'·34N., 2° 03'·77W.

57° 50'·58N., 2° 42'·65W.

2. The moorings extend upwards from the seabed by up to 6 metres and have no surface markers.
3. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 213 — 222 — 5617_5 — 5617_6 — 5617_7**5649(T)/25 ENGLAND - East Coast - Buoy.**

Source: Port of Sunderland

1. The Port-side Lateral light-buoy, *Q.R.*, in position 54° 55'·176N., 1° 21'·157W. is reported off station.
(ETRS89 DATUM)

Charts affected — 1627 — 5615_18**5680(P)/25 ENGLAND - East Coast - Depths.**

Source: British Government Survey

1. Recent survey information has shown that numerous depths less than charted exist within Lowestoft North Road, approaches to Lowestoft and Stanford Channel. The most significant are as follows:

Depth

8·8m

6·4m

4·9m

3·3m

13·7m

8m

1·5m

1·2m

1·8m

2·1m

3·1m

Position

52° 29'·88N., 1° 46'·73E.

52° 29'·02N., 1° 47'·77E.

52° 28'·50N., 1° 45'·81E.

52° 28'·48N., 1° 47'·81E.

52° 28'·36N., 1° 48'·27E.

52° 28'·08N., 1° 47'·95E.

52° 27'·72N., 1° 47'·80E.

52° 27'·48N., 1° 47'·61E.

52° 27'·22N., 1° 47'·27E.

52° 26'·62N., 1° 46'·69E.

52° 26'·39N., 1° 47'·16E.

2. These changes will be included in New Edition of Charts 1535, and 5614_3 to be published early 2026.
3. Charts 1543, and 5614_2 will be updated by Notice to Mariners.
4. Former Notice 4704(P)/25 is cancelled.
5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 1535 — 5614_3**5751(T)/25 ENGLAND - South Coast - Works. Pontoons. Piles. Lights.**

Source: Newhaven Port and Properties Ltd Notice 20/25

1. Refurbishment works are taking place in Newhaven Marina in the vicinity of position 50° 47'·172N., 0° 03'·207E.
2. Pontoons will be temporary removed whilst some piles remain in situ.
3. Navigation lights usually situated on the end of the visitors pontoon A and B will be replaced with temporary lights located on the piles.
4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(ETRS89 DATUM)

Charts affected — 2154 — 5605_13

5787(T)/25 ENGLAND - Bristol Channel - Scientific instruments. Buoyage.

Source: Hinkley Point C

1. Scientific measuring instruments marked by yellow light-buoys, *Fl(5)Y.20s*, have been established, until further notice, in the following positions:

51° 13'·75N., 3° 11'·03W.

51° 13'·98N., 3° 09'·48W.

2. Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 1151 — 1152 — 5608_13**5796(P)/25 ENGLAND - Bristol Channel - Depths.**

Source: Bristol Port Company

1. Recent survey information has shown that numerous depths less than charted exist within King Road. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4·5m	51° 31'·29N., 2° 43'·03W.
3·7m	51° 31'·22N., 2° 43'·19W.
4·9m	51° 31'·16N., 2° 42'·89W.
4·9m	51° 31'·14N., 2° 43'·06W.
3·2m	51° 31'·06N., 2° 43'·28W.
4·7m	51° 31'·03N., 2° 43'·17W.
4·4m	51° 30'·92N., 2° 43'·30W.
2·3m	51° 30'·80N., 2° 43'·63W.
1·6m	51° 30'·77N., 2° 44'·09W.
1·4m	51° 30'·74N., 2° 44'·21W.
4·2m	51° 30'·72N., 2° 43'·58W.
2·1m	51° 30'·71N., 2° 43'·96W.
1·1m	51° 30'·70N., 2° 44'·30W.
2m	51° 30'·69N., 2° 43'·76W.
0·2m	51° 30'·63N., 2° 44'·55W.
3·9m	51° 30'·62N., 2° 43'·75W.
0·9m	51° 30'·59N., 2° 44'·33W.
0·9m	51° 30'·58N., 2° 43'·05W.
0·1m	51° 30'·56N., 2° 44'·74W.
1·4m	51° 30'·54N., 2° 44'·55W.
4·9m	51° 30'·53N., 2° 43'·92W.
2·7m	51° 30'·50N., 2° 44'·15W.
0·5m	51° 30'·50N., 2° 44'·91W.
0·8m	51° 30'·50N., 2° 45'·75W.
1·5m	51° 30'·48N., 2° 44'·75W.
0·6m	51° 30'·47N., 2° 45'·22W.
1·2m	51° 30'·44N., 2° 45'·41W.
1·7m	51° 30'·43N., 2° 45'·15W.
1m	51° 30'·43N., 2° 45'·84W.
1·5m	51° 30'·39N., 2° 46'·05W.
1·9m	51° 30'·36N., 2° 45'·89W.
2·8m	51° 30'·24N., 2° 46'·14W.
4·5m	51° 30'·15N., 2° 46'·16W.
4·6m	51° 30'·15N., 2° 46'·62W.
8m	51° 30'·11N., 2° 45'·10W.
5·7m	51° 30'·10N., 2° 45'·61W.
7·8m	51° 30'·09N., 2° 45'·28W.
6·7m	51° 30'·08N., 2° 46'·82W.
7·3m	51° 30'·08N., 2° 46'·16W.
6·9m	51° 30'·08N., 2° 46'·43W.
10·3m	51° 30'·05N., 2° 45'·33W.
9·5m	51° 30'·05N., 2° 45'·67W.
7·4m	51° 30'·05N., 2° 45'·91W.
13·1m	51° 30'·02N., 2° 45'·50W.

5796(P)/25 ENGLAND - Bristol Channel - Depths. (continued)

14·4m	51° 29'·98N., 2° 45'·96W.
14·8m	51° 29'·92N., 2° 46'·44W.
14·9m	51° 29'·83N., 2° 46'·92W.
14·1m	51° 29'·81N., 2° 46'·41W.
5·7m	51° 29'·53N., 2° 47'·17W.
6m	51° 29'·50N., 2° 47'·37W.

- 2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- 3. These changes will be included in a New Edition of Charts 1166, 1176, 1859, 5608_16, 5608_18 and 5608_20. (ETRS89 DATUM)

Charts affected — 1166 — 1176 — 1859 — 5608_16 — 5608_18 — 5608_20



(3) NORTH RUSSIA, NORWAY, THE FÆROE ISLANDS AND ICELAND

4644(T)/12 RUSSIA - Barents Sea Coast - Buoyage.

Source: Russian Notices 44/5459(T)/11, 29/4366/12, 36/5219(T)-5221(T)/12, 36/5223(T)-5225(T)/12

1. The buoyage through Gulyayevskiye Koshki (69° 00'·0N., 55° 40'·0E.) to Nar'yan-Mar (67° 45'·0N., 53° 12'·0E.) is almost entirely missing or temporarily extinguished. Some temporary buoyage has been established. Areas affected are Pechorskaya Guba, its north and east approaches and Reka Pechora.
2. Mariners are advised to navigate with caution and contact the port authority for the most recent information.
3. Former Notice 3621(T)/12 is cancelled.

Chart affected — 2961

3336(T)/18 RUSSIA - Barents Sea Coast - Jetties.

Source: Russian Notice 25/3322(T)/18

1. A submerged jetty with a width of 12m and at a depth of 3·2m, has been temporarily established, joining the following positions:
69° 00'·12N., 33° 03'·33E.
69° 00'·09N., 33° 03'·31E.
2. The floating jetty, in position 68° 58'·86N., 33° 01'·86E. is missing.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2966

359(T)/21 NORWAY - North Coast - Buoy.

Source: Norwegian Notice 22/63233(T)/20

1. A yellow *ODAS* buoy has been established in position 72° 29'·3N., 20° 08'·1E. until further notice.
(WGS84 DATUM)

Chart affected — 2683

2567(T)/22 NORWEGIAN SEA - Svalbard - Measuring instruments.

Source: ENC's NO2A3220, NO2A4020 and NO1A3000

1. Unmarked subsurface *ODAS* measuring instruments have been established in the following positions:

<i>Position</i>	<i>Depth Below Surface</i>	<i>Largest Scale Chart</i>
76° 26'·3N., 13° 56'·7E.	800m	3137
72° 03'·2N., 14° 43'·6E.	100m above the seabed	2683
78° 29'·2N., 2° 28'·5W.	149m	4010

2. Vessels trawling are requested to maintain a safe distance.
3. Former Notice 4398(T)/20 is cancelled.
(WGS84 DATUM)

Charts affected — 2683 — 3137 — 4010

3259(P)/22 NORWAY - North Coast - Offshore installation. Submarine power cable. Works.

Source: UKHO

1. A submarine power cable is being laid between Melkøy and Johan Castberg field, joining the following positions:

70° 41'·32N., 23° 35'·29E.

70° 52'·79N., 23° 28'·41E.

71° 01'·37N., 23° 44'·00E.

71° 04'·08N., 23° 47'·27E.

71° 06'·00N., 23° 45'·19E.

71° 06'·80N., 23° 45'·45E.

71° 07'·62N., 23° 44'·00E.

71° 11'·09N., 23° 31'·97E.

71° 31'·00N., 22° 48'·06E.

72° 20'·03N., 20° 52'·17E.

72° 26'·17N., 20° 30'·22E.

72° 28'·40N., 20° 16'·64E.

2. Subsea marine installation activities are taking place in connection with the development of the Johan Castberg field, within an area bounded by the following positions:

72° 33'·0N., 20° 03'·0E.

72° 33'·0N., 20° 27'·0E.

72° 13'·8N., 20° 27'·0E.

72° 23'·0N., 20° 05'·0E.

3. Mariners are advised to navigate with caution in the area.
4. Former Notice 2498(P)/21 is cancelled.
5. NOTE: Content of Notice unchanged, re-issued to include Chart 2352 and remove Chart 2315 (WGS84 DATUM)

Chart affected — 2683**671(T)/23 RUSSIA - Barents Sea Coast - Buoy.**

Source: Russian Notice 36/3934(T)/22

1. The following mooring buoy has been moved from 69° 10'·33N., 33° 29'·32E. to 69° 10'·81N., 33° 29'·71E., until further notice.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 2966**2659(T)/23 ICELAND - Light.**

Source: Icelandic Notice 11/67(T)/22

1. The light sectors of the Æðey light, in position 66° 05'·5N., 22° 39'·6W. have been reported as unreliable, as they do not match the chart and the List of lights.
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Chart affected — 2898**2681(T)/23 ICELAND - Light.**

Source: Icelandic Notice 11/68(T)/22

1. The light sectors of the Arnarnes light, in position 66° 05'·9N., 23° 02'·3W. have been reported as unreliable, as they do not match the chart and the List of lights.
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Chart affected — 2898

2878(T)/23 ICELAND - Buoyage.

Source: Icelandic Notice 1/10(T)/23

1. The following scientific buoys, red balloons with reflective marking, have been established:

DesignationLækjarbót
Trostansfjörður**Position**65° 48'·5N., 23° 47'·8W.
65° 38'·1N., 23° 25'·6W.

2. Mariners are advised to navigate with caution.
(WGS84 DATUM)

Chart affected — 2898**4298(T)/23 NORWAY - West Coast - Well.**

Source: Norwegian Notice 16/72231(T)/23

1. An abandoned wellhead exists in position 64° 16'·0N., 5° 15'·5E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1429**1479(T)/24 RUSSIA - Barents Sea Coast - Buoy.**

Source: Russian Notice 46/4810(T)/23

1. An Isolated Danger buoy, *Fl(2)5s*, has been deployed, until further notice, in position 69° 03'·69N., 33° 08'·57E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2966**3683(T)/24 RUSSIA - Barents Sea Coast - Buoy.**

Source: Russian Notice 13/1186(T)/24

1. The yellow conical light-buoy, *Fl*, in position 73° 00'·6N., 43° 50'·2E. is reported missing.
(WGS84 DATUM)

Chart affected — 2683**4118(P)/24 NORWAY - West Coast - Works. Submarine pipelines.**

Source: Norwegian Notice 9/74439(P)/24

1. Works are taking place involving pipelines and protective infrastructure features, within an area bounded by the following positions:

63° 32'·0N., 5° 22'·0E.
63° 32'·0N., 5° 24'·0E.
63° 29'·0N., 5° 24'·0E.
63° 29'·0N., 5° 22'·0E.

2. The operating vessel has reduced manoeuvrability.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1428 — 1429 — 2182D**4369(P)/24 NORWAY - North Coast - Submarine cable. Works.**

Source: Norwegian Notice 10/74640(P)/24

1. Submarine cable laying activities are taking place, joining the following positions:

70° 41'·3N., 23° 35'·3E.
70° 41'·4N., 23° 34'·3E.
70° 41'·6N., 23° 32'·9E.
70° 42'·2N., 23° 32'·0E.
70° 42'·9N., 23° 31'·5E.
70° 43'·2N., 23° 32'·3E.

4369(P)/24 NORWAY - North Coast - Submarine cable. Works. (continued)

70° 45'·4N., 23° 38'·2E.
 70° 45'·9N., 23° 39'·0E.
 70° 46'·4N., 23° 39'·0E.
 70° 47'·0N., 23° 38'·8E.
 70° 47'·5N., 23° 38'·0E.
 70° 48'·0N., 23° 37'·1E.
 70° 49'·3N., 23° 33'·6E.
 70° 49'·7N., 23° 32'·5E.
 70° 50'·2N., 23° 31'·5E.
 70° 51'·8N., 23° 29'·7E.
 70° 53'·0N., 23° 29'·0E.
 70° 53'·9N., 23° 29'·2E.
 70° 55'·5N., 23° 31'·9E.
 70° 55'·8N., 23° 33'·1E.
 70° 56'·5N., 23° 35'·2E.
 70° 58'·3N., 23° 37'·9E.
 70° 59'·7N., 23° 41'·2E.
 71° 01'·4N., 23° 44'·0E.
 71° 03'·0N., 23° 46'·4E.

 71° 04'·1N., 23° 47'·4E.
 71° 06'·0N., 23° 45'·0E.
 71° 10'·8N., 23° 21'·5E.
 71° 34'·3N., 21° 13'·6E.

2. Mariners are advised to navigate with caution in the area.
3. Chart 2352 will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 2352**29(T)/25 NORWAY - West Coast - Obstructions.**

Source: Norwegian Notice 19/75982(T)/24

1. Obstructions exist in position 65° 44'·0N., 7° 33'·8E.
(WGS84 DATUM)

Chart affected — 1430**815(P)/25 NORWAY - West Coast - Submarine pipelines. Submarine cables. Works.**

Source: Norwegian Notice 23/76467(P)/24

1. Submarine pipeline and cable laying operations are taking place, joining the following positions:

66° 00'·6N., 7° 48'·5E.
 65° 58'·5N., 7° 46'·2E.
 65° 57'·6N., 7° 45'·9E.
 65° 56'·8N., 7° 44'·4E.
 65° 48'·1N., 7° 35'·8E.
 65° 47'·7N., 7° 34'·8E.
 and
 65° 49'·3N., 7° 44'·4E.
 65° 49'·4N., 7° 40'·7E.
 65° 48'·1N., 7° 35'·8E.
 and
 65° 52'·0N., 7° 22'·7E.
 65° 48'·1N., 7° 35'·8E.
 and
 *65° 48'·1N., 7° 35'·8E.
 *65° 46'·3N., 7° 35'·4E.
 *65° 44'·2N., 7° 33'·9E.
 *65° 42'·6N., 7° 35'·5E.
 *65° 41'·9N., 7° 38'·8E.
 *65° 43'·1N., 7° 37'·9E.

2. Mariners are advised to navigate with caution in the area.

815(P)/25 NORWAY - West Coast - Submarine pipelines. Submarine cables. Works. (continued)

3. *Former Notice 3462(P)/24 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 1430

816(P)/25 NORWAY - West Coast - Works. Submarine cables.

Source: Norwegian Notice 24/76601(P)/24

1. Submarine cable laying operations are taking place, joining the following positions:

60° 22'·4N., 5° 42'·6E.
 60° 22'·2N., 5° 41'·3E.
 60° 20'·7N., 5° 40'·2E.
 60° 20'·3N., 5° 38'·8E.
 60° 16'·6N., 5° 37'·1E.
 60° 15'·1N., 5° 34'·3E.
 60° 14'·5N., 5° 34'·9E.
 60° 11'·3N., 5° 33'·9E.
 60° 07'·1N., 5° 29'·1E.
 60° 05'·1N., 5° 19'·8E.
 60° 00'·0N., 5° 20'·0E.
 59° 58'·0N., 5° 16'·6E.
 59° 58'·1N., 5° 15'·1E.
 59° 56'·6N., 5° 04'·9E.
 59° 56'·2N., 4° 40'·5E.
 and
 59° 56'·3N., 5° 19'·8E.
 59° 58'·0N., 5° 16'·6E.

2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 1427 — 2182C — 4140

856(T)/25 NORWEGIAN SEA - Measuring instruments.

Source: Danish Notice 49/1212(T)/24 and Faroese Maritime Authority Notice 1(T)/25

1. Measuring equipment has been deployed in the following positions:

63° 36'·2N., 8° 51'·1W.
 63° 39'·7N., 8° 39'·8W.
 63° 43'·1N., 8° 28'·9W.
 63° 46'·5N., 8° 17'·9W.
 63° 50'·0N., 8° 06'·5W.
 63° 53'·4N., 7° 55'·4W.
 63° 56'·7N., 7° 44'·9W.
 64° 00'·0N., 7° 33'·9W.
 64° 04'·0N., 7° 04'·2W.
 64° 07'·2N., 6° 34'·0W.

2. The measuring equipment are deployed at various depths.
 3. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 245 — 2897 — 4101

1909(P)/25 NORWEGIAN SEA - Submarine pipeline. Submarine cable. Buoy.

Source: Norwegian Notice 4/77075(P)/25

1. Submarine pipeline and cable laying operations are taking place, joining the following positions:

67° 01'·7N., 5° 18'·4E.
67° 00'·9N., 5° 38'·5E.
67° 00'·6N., 6° 08'·7E.
67° 01'·2N., 6° 22'·3E.
67° 02'·3N., 6° 29'·3E.
67° 02'·3N., 6° 33'·8E.
67° 05'·3N., 6° 52'·2E.
67° 04'·2N., 7° 04'·0E.

2. A yellow spherical Waverider buoy, *Fl(5)Y.20s*, is deployed, in position 67° 00'·7N., 5° 18'·6E.
3. Mariners are advised to navigate with caution in the area.
4. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 1430 — 4101**2049(T)/25 NORWAY - West Coast - Submarine pipeline. Works. Precautionary areas.**

Source: Norwegian Notice 5/77255(T)/25

1. In connection with pipeline installation operations which are taking place in the Troll oil field, circular precautionary areas have been established, radius 400m, centred on the following positions:

60° 45'·0N., 3° 35'·3E.
60° 45'·7N., 3° 33'·5E.
60° 47'·8N., 3° 32'·2E.
60° 49'·0N., 3° 31'·2E.

2. Precautionary areas, have been established bounded by the following positions:

60° 46'·3N., 3° 32'·8E.
60° 46'·2N., 3° 32'·3E.
60° 46'·9N., 3° 31'·8E.
60° 47'·0N., 3° 32'·3E.
and
60° 49'·8N., 3° 30'·6E.
60° 50'·5N., 3° 32'·0E.
60° 50'·2N., 3° 32'·6E.
60° 49'·5N., 3° 31'·2E.

3. Within these areas, all fishing with bottom gear is to be avoided.
4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1427 — 2182C — 2182D**2338(T)/25 NORWAY - West Coast - Buoy.**

Source: Norwegian Notice 6/77458(T)/25

1. A yellow ODAS light-buoy, *Fl(5)Y.20s*, has been established in position 65° 06'·7N., 6° 44'·1E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1429 — 1430 — 4101**2339(P)/25 NORWEGIAN SEA - Offshore installation.**

Source: Norwegian Notice 6/77441(P)/25

1. A subsea template is planned to be installed in position 67° 01'·6N., 5° 18'·2E.
(WGS84 DATUM)

Chart affected — 4101

2554(T)/25 NORWAY - West Coast - Buoyage.

Source: Norwegian Notice 5/77238(T)/25 and Norwegian SDO T and P 7/25

1. Yellow spherical ODAS waverider buoys, *Fl(5) Y 20s*, have been deployed in the following positions:

65° 53'·6N., 7° 39'·3E.

65° 47'·8N., 7° 37'·7E.

65° 44'·2N., 7° 36'·4E.

65° 53'·1N., 7° 42'·5E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1430 — 4101

2635(P)/25 NORWAY - West Coast - Works. Submarine pipeline.

Source: Norwegian Notice 8/77597(P)/25

1. Pipeline laying operations are taking place, joining the following positions:

60° 42'·8N., 3° 30'·1E.

60° 42'·1N., 3° 28'·8E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1427

2921(T)/25 NORWAY - West Coast - Buoy.

Source: Norwegian Notice 9/77644(T)/25

1. A yellow spherical waverider light-buoy, *Fl(5)Y.20s ODAS*, has been established in position 66° 03'·1N., 8° 00'·4E.
2. The buoy has a drift circle radius of 700m.
(WGS84 DATUM)

Charts affected — 1430 — 4101

2927(T)/25 NORWAY - West Coast - Buoy.

Source: Norwegian Notice 9/77497(T)/25

1. A yellow *ODAS* buoy, *Fl(5)Y.20s*, has been established in position 65° 28'·3N., 7° 10'·5E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1430 — 4101

3856(T)/25 RUSSIA - Barents Sea Coast - Buoy.

Source: Russian Notice 22/2326(T)/25

1. A North cardinal buoy, *Q*, has been established in position 69° 03'·27N., 33° 05'·42E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2966

3893(P)/25 NORWAY - West Coast - Submarine cable.

Source: Norwegian Notice 12/78125(P)/25

1. A submarine cable is being laid, joining the following positions:

65° 25'·7N., 7° 08'·2E.

65° 31'·0N., 7° 12'·1E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1430 — 4101

4033(T)/25 NORWAY - West Coast - Buoy.

Source: Norwegian Notice 13/78180(T)/25

1. A yellow ODAS light-buoy, *Fl(5)Y.20s*, has been established in position 65° 12'·4N., 6° 25'·0E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1429 — 1430 — 4101



(4) BALTIC SEA AND APPROACHES

2822(T)/19 SWEDEN - West Coast - Depths.

Source: Swedish Notice 754/14020(T)/19

- Depths less than charted exist within the vicinity of position 57° 41'·400N., 11° 49'·390E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 857 — 858**4290(T)/19 RUSSIA - Baltic Sea Coast - Mooring buoys.**

Source: Russian Notice 30/3657(T)/19

- Mooring buoys have been established in the following positions:

59° 48'·60N., 27° 23'·67E. (2 buoys)

59° 48'·50N., 27° 23'·77E. (2 buoys)

(WGS84 DATUM)

Chart affected — 2264**6402(P)/19 BALTIC SEA - Submarine pipelines.**

Source: Nord Stream 2 and Danish Notice 45/740(P)/19

- Submarine pipeline works are taking place, on the Nord Stream 2 gas pipeline, linking Germany and Russia.
- The works to establish two parallel gas pipelines, are taking place on and in the vicinity of a line joining the following positions:

59° 32'·61N., 28° 05'·54E.

59° 32'·32N., 27° 56'·81E.

59° 44'·12N., 27° 06'·93E.

59° 51'·34N., 26° 57'·95E.

60° 02'·55N., 26° 15'·05E.

59° 54'·34N., 25° 54'·61E.

59° 54'·57N., 25° 04'·22E.

59° 38'·60N., 23° 51'·56E.

59° 14'·14N., 21° 07'·29E.

58° 53'·45N., 20° 26'·48E.

58° 34'·18N., 20° 07'·90E.

58° 15'·06N., 20° 07'·84E.

56° 32'·60N., 18° 50'·10E.

56° 20'·23N., 18° 35'·25E.

56° 14'·68N., 18° 07'·08E.

55° 39'·17N., 16° 27'·15E.

*55° 31'·95N., 15° 44'·70E.

*55° 30'·85N., 15° 43'·31E.

*55° 20'·13N., 15° 44'·37E.

*54° 51'·03N., 15° 23'·44E.

*54° 47'·23N., 15° 15'·26E.

*54° 40'·99N., 14° 48'·96E.

*54° 40'·28N., 14° 33'·64E.

*54° 37'·10N., 14° 29'·15E.

54° 33'·04N., 14° 09'·28E.

54° 32'·21N., 14° 03'·92E.

54° 23'·03N., 13° 51'·78E.

54° 20'·50N., 13° 49'·46E.

54° 10'·52N., 13° 36'·33E.

54° 08'·92N., 13° 38'·55E.

- Mariners are advised to navigate with caution in the vicinity of the works area.
- Charts will be updated when works are complete.

6402(P)/19 BALTIC SEA - Submarine pipelines. (continued)

5. Former Notice 5453(P)/18 is cancelled.

* Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 2018 — 2248 — 2264 — 2816 — 2817

5964(T)/20 FINLAND - South Coast - Spoil ground.

Source: Finnish Notice 29/226(T)/20

1. A spoil ground has been established, within an area bounded by the following positions:

60° 08'·71N., 24° 55'·74E.

60° 08'·78N., 24° 55'·63E.

60° 08'·79N., 24° 55'·66E.

60° 08'·94N., 24° 55'·66E.

60° 08'·95N., 24° 55'·75E.

60° 08'·78N., 24° 55'·81E.

60° 08'·73N., 24° 55'·85E.

(WGS84 DATUM)

Charts affected — 2218 — 3818

3082(P)/21 BALTIC SEA - Submarine cable.

Source: Russian Notices 11/1099/21 and 13/1312/21, Finnish Notice 1/1/21 and Swedish Notice 841/15506/21.

1. A submarine cable has been laid joining the following positions:

59° 30'·9N., 28° 04'·9E.

59° 31'·2N., 28° 00'·9E.

59° 31'·4N., 27° 59'·9E.

59° 31'·4N., 27° 58'·9E.

59° 32'·5N., 27° 52'·9E.

59° 33'·4N., 27° 49'·5E.

59° 33'·5N., 27° 48'·9E.

59° 35'·1N., 27° 42'·9E.

59° 37'·3N., 27° 33'·9E.

59° 38'·9N., 27° 24'·9E.

59° 43'·0N., 26° 55'·9E.

59° 44'·1N., 26° 52'·9E.

59° 44'·7N., 26° 52'·5E.

59° 52'·0N., 26° 38'·1E.

59° 52'·4N., 26° 36'·9E.

59° 57'·8N., 26° 25'·9E.

59° 58'·4N., 26° 25'·3E.

59° 59'·4N., 26° 22'·9E.

60° 00'·0N., 26° 20'·9E.

60° 00'·2N., 26° 20'·9E.

60° 00'·5N., 26° 20'·1E.

59° 59'·7N., 26° 16'·6E.

59° 58'·8N., 26° 08'·8E.

59° 57'·1N., 26° 04'·4E.

3082(P)/21 BALTIC SEA - Submarine cable. (continued)

2.

59° 53'·6N., 25° 58'·0E.
 59° 52'·7N., 25° 55'·4E.
 59° 52'·7N., 25° 40'·5E.
 59° 53'·0N., 25° 37'·7E.
 59° 53'·2N., 25° 18'·8E.
 59° 53'·2N., 25° 17'·7E.
 59° 53'·6N., 25° 10'·9E.
 59° 52'·6N., 24° 58'·9E.
 59° 51'·5N., 24° 53'·1E.
 59° 51'·0N., 24° 48'·8E.
 59° 50'·4N., 24° 47'·3E.
 59° 50'·3N., 24° 45'·8E.
 59° 46'·6N., 24° 33'·6E.
 59° 44'·2N., 24° 24'·0E.
 59° 41'·3N., 24° 12'·0E.
 59° 38'·6N., 24° 00'·5E.
 59° 33'·6N., 23° 27'·4E.
 59° 31'·9N., 23° 12'·1E.
 59° 31'·9N., 23° 10'·3E.
 59° 30'·9N., 23° 06'·5E.
 59° 30'·7N., 23° 04'·3E.
 59° 29'·1N., 22° 57'·2E.
 59° 27'·8N., 22° 44'·8E.
 59° 23'·6N., 22° 19'·6E.

3.

59° 23'·8N., 22° 17'·4E.
 59° 26'·9N., 22° 14'·0E.
 59° 27'·1N., 22° 11'·7E.
 59° 26'·0N., 22° 07'·1E.
 59° 24'·1N., 21° 56'·3E.
 59° 22'·4N., 21° 44'·3E.
 59° 21'·9N., 21° 42'·4E.
 59° 17'·1N., 21° 08'·2E.
 59° 14'·7N., 21° 01'·2E.
 59° 13'·4N., 20° 59'·0E.
 59° 10'·2N., 20° 56'·2E.
 59° 06'·7N., 20° 46'·5E.
 59° 05'·3N., 20° 43'·6E.
 58° 57'·3N., 20° 28'·8E.
 58° 55'·2N., 20° 26'·4E.
 58° 44'·5N., 20° 14'·2E.
 58° 42'·9N., 20° 14'·7E.
 58° 40'·8N., 20° 20'·0E.
 58° 39'·4N., 20° 20'·6E.
 57° 59'·0N., 20° 00'·1E.
 57° 35'·0N., 19° 37'·7E.
 57° 26'·4N., 19° 31'·6E.
 57° 10'·0N., 19° 28'·5E.
 57° 00'·9N., 19° 37'·4E.
 56° 44'·8N., 19° 28'·7E.

4. These changes will be included in the next New Editions of Charts 2075 and 2817 to be published mid 2021.
5. Mariners are advised to navigate with caution in the area.
6. Former Notice 666(P)/21 is cancelled.
(WGS84 DATUM)

Chart affected — 2817

1111(P)/22 DENMARK - Islands - Restricted areas. Buoyage. Works.

Source: Danish Notices 6/92(P)/22 and 8/129(P)/22

1. In connection with the construction of the Fehmarn Belt tunnel, restricted areas, entry prohibited, marked by special light-buoys, *Fl(2+1)Y.15s* and *Fl(3)Y.10s* have been established between the following positions:

54° 38'·58N., 11° 21'·69E.

54° 30'·00N., 11° 14'·07E.

2. The positions of the restricted areas and associated light-buoys will change as the works progress.
3. For the latest information, mariners should contact VTS Fehmarn Belt on VHF Channel 68.
4. Former Notice 5404(P)/21 is cancelled.
(WGS84 DATUM)

Chart affected — 2106**4954(T)/22 LATVIA - Buoyage.**

Source: Latvian Notices 7/131(T)-132(T)/22

1. The following light-buoys have been temporarily withdrawn:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>LFl.10s</i>	'J'	Safe water buoy	57° 01'·37N., 23° 55'·22E.
<i>Fl.Y.5s</i>	<i>ODAS</i>	Special purpose buoy	57° 01'·25N., 23° 54'·83E.

(WGS84 DATUM)

Chart affected — 2859**221(T)/23 SWEDEN - East Coast - Maximum authorised draught. Berths. Depth.**

Source: Swedish Notice 942/17316(T)/22

1. The maximum authorised draught for vessels calling at Sölvesborg Hamn, berth no. 57 and no. 58 in position 56° 01'·846N., 14° 34'·595E. is 6·0m.
2. Mariners are advised to navigate with caution in the area and consult local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2856**747(T)/23 POLAND - Explosive dumping ground.**

Source: Polish Notice 35/442(T)/22

1. Explosives have been reported within an area bounded by the following positions:

54° 35'·06N., 18° 38'·36E.

54° 37'·21N., 18° 36'·02E.

54° 37'·80N., 18° 39'·27E.

54° 37'·57N., 18° 40'·59E.

54° 36'·83N., 18° 41'·64E.

54° 35'·75N., 18° 42'·14E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2040 — 2688**1591(T)/23 RUSSIA - Baltic Sea Coast - Buoy.**

Source: Russian Notice 41/4506(T)/22

1. The following west-cardinal light-buoy has been temporarily moved:

<i>Characteristic</i>	<i>Former Position</i>	<i>New Position</i>
<i>Q(9)15s</i>	54° 41'·318N., 20° 11'·481E.	54° 41'·366N., 20° 11'·403E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 1917

1663(T)/23 SWEDEN - East Coast - Maximum authorised draught. Depth.

Source: Swedish Notice 959/17598/23

1. The maximum permissible draught in the approach to the Port of Slite in the vicinity of position 57° 42'·5N., 18° 48'·8E. is reduced to 7·1m until further notice.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 798**2488(T)/23 DENMARK - Islands - Restricted areas. Obstructions. Submarine pipeline.**

Source: Danish Notices 17/395-396(T)/23

1. Due to obstructions on the seabed in connection with damage of the gas pipeline, restricted areas have been established within a distance of 1 nautical mile of the following positions:

55° 32'·12N., 15° 42'·17E.
55° 32'·02N., 15° 41'·96E.
and
54° 52'·62N., 15° 24'·52E.
2. Anchoring, fishing and seabed activities are not recommended in these areas.
3. Mariners are advised to navigate with caution. (WGS84 DATUM)

Charts affected — 2018 — 2816**2743(T)/23 ESTONIA - Buoy.**

Source: Estonian Notice 5/65(T)/23

1. An ODAS light-buoy, *Fl(5)Y.20s*, has been established in position 59° 40'·78N., 24° 23'·66E. (WGS84 DATUM)

Charts affected — 2241 — 2248**2767(T)/23 POLAND - Measuring instrument. Buoy.**

Source: Polish Notice 48/595(T)/22

1. A measuring instrument, marked by a yellow spherical light-buoy, *Fl(5)Y.20s*, has been established in position 54° 50'·34N., 17° 50'·33E. (WGS84 DATUM)

Charts affected — 2018 — 2040**2802(T)/23 ESTONIA - Buoy.**

Source: Estonian Notice 5/74(T)/23

1. An ODAS light-buoy, *Fl(5)Y.20s*, has been established in position 57° 42'·80N., 23° 33'·51E. (WGS84 DATUM)

Chart affected — 2215**2870(T)/23 POLAND - Works.**

Source: Polish Notice 1/9(T)/23

1. Construction works are taking place along Nabrzeże Indyjskie, between the following positions:

54° 32'·039N., 18° 32'·295E.
54° 31'·746N., 18° 31'·504E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 2636

2974(T)/23 POLAND - Restricted area. Works.

Source: Polish Notices 16/200(T)/23 and 24/297(T)/23

1. A restricted area, entry prohibited, has been established within and surrounding Port Zewnątrzny:

53° 55'·889N., 14° 16'·648E.
 53° 55'·923N., 14° 16'·603E.
 53° 56'·300N., 14° 16'·786E.
 53° 55'·869N., 14° 18'·105E.
 53° 55'·071N., 14° 18'·145E.

2. Construction and dredging works are taking place, in an area bounded by the following positions:

53° 55'·644N., 14° 17'·266E.
 53° 55'·483N., 14° 17'·348E.
 53° 55'·380N., 14° 17'·474E.
 53° 55'·334N., 14° 17'·609E.
 53° 55'·345N., 14° 17'·758E.
 53° 55'·297N., 14° 17'·744E.
 53° 55'·207N., 14° 17'·503E.
 53° 55'·307N., 14° 17'·105E.
 53° 55'·339N., 14° 17'·107E.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Charts affected — 2453 — 2677**3963(T)/23 DENMARK - East Coast - Submarine pipelines. Buoyage.**

Source: Danish Notice 36/840(T)/23

1. Pipelines, consisting of submerged and floating sections exist within an area bounded by the following positions:

*56° 31'·94N., 10° 51'·56E.
 *56° 30'·58N., 10° 51'·98E.
 *56° 29'·43N., 10° 52'·64E.
 *56° 28'·92N., 10° 53'·59E.
 *56° 28'·47N., 10° 54'·63E.
 *56° 28'·47N., 10° 55'·80E.
 *56° 31'·92N., 10° 55'·80E.

2. *The ends of each pipeline are marked by special light-buoys, *Fl.Y.5s*. Charted depths above the submarine pipelines are reduced by varying amounts.
3. Vessels are asked to exercise caution and avoid the area of Gjerrild Bugt if possible.
4. *Former Notice 747(T)/19 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 2108**4450(T)/23 POLAND - Works. Quay.**

Source: Polish Notices 35-36/429(T)-430(T)/23

1. Wharf reconstruction works are taking place in the vicinity of position 54° 32'·403N., 18° 31'·529E., and within an area bounded by the following positions:

54° 32'·567N., 18° 31'·082E.
 54° 32'·522N., 18° 31'·082E.
 54° 32'·521N., 18° 30'·968E.
 54° 32'·722N., 18° 30'·142E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 2636

5060(T)/23 DENMARK - Islands - Depth.

Source: Danish Notice 40/946(T)/23

1. A depth of approximately 1·5m exists in position 55° 16'·328N., 9° 53'·106E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2592**212(T)/24 SWEDEN - East Coast - Vertical clearance.**

Source: Swedish Notice 994/18192(T)/23

1. The vertical clearance at Skurubron bridge, in position 59° 18'·84N., 18° 13'·30E., has been temporarily reduced to 29m.
2. Former Notice 4172(T)/23 is cancelled.
(WGS84 DATUM)

Chart affected — 820**266(P)/24 DENMARK - East Coast - Quay. Works. Depths. Lights.**

Source: Danish Notice 51/1230(P)/23

1. Quay construction works are taking place between positions:
55° 33'·565N., 9° 45'·174E.
55° 33'·502N., 9° 45'·068E.
55° 33'·482N., 9° 44'·852E.
2. Depths of 2·5m have been reported within the works area, bounded by the following positions:
55° 33'·549N., 9° 45'·201E.
55° 33'·512N., 9° 45'·210E.
55° 33'·473N., 9° 45'·154E.
55° 33'·457N., 9° 45'·094E.
55° 33'·438N., 9° 44'·960E.
55° 33'·436N., 9° 44'·874E.
55° 33'·442N., 9° 44'·863E.
55° 33'·462N., 9° 44'·839E.
55° 33'·478N., 9° 44'·828E.
3. Lights, Fl.R.3s, in position 55° 33'·487N., 9° 44'·857E., and Fl.G.3s, in position 55° 33'·535N., 9° 44'·953E., have been extinguished.
4. Work vessels can be contacted on VHF channel 12 and 16.
5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 900**1380(T)/24 RUSSIA - Baltic Sea Coast - Lights.**

Source: Russian Notice 38/4029(T)/23

1. A light, Fl.R.3s2M, has been established in position 59° 57'·318N., 30° 11'·130E.
2. A light, Fl.G.3s2M, has been established in position 59° 57'·263N., 30° 11'·166E.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2364 — 2395**1442(T)/24 ESTONIA - Foul.**

Source: Estonian Notice 11/164(T)/23

1. A lost anchor has been reported to exist in approximate position 59° 29'·5N., 24° 35'·2E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2227 — 2241 — 2248

1490(T)/24 FINLAND - South Coast - Works. Buoy.

Source: Finnish Notice 32/230(T)/23

1. Harbour works are taking place within an area bounded by the following positions:

60° 08'·76N., 24° 55'·36E.

60° 09'·10N., 24° 55'·81E.

60° 08'·74N., 24° 55'·94E.

60° 08'·66N., 24° 55'·52E.

2. *A special buoy with X shape topmark, has been deployed, until further notice, in position 60° 08'·81N., 24° 55'·89E.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. *Former Notice 4379(T)/21 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2218 — 3818**1546(T)/24 RUSSIA - Baltic Sea Coast - Dolphin. Berths. Lights.**

Source: Russian Notice 51/5281(T)/23

1. New Dolphin berths have been established, joining the following positions:

59° 57'·377N., 30° 10'·795E.

59° 57'·408N., 30° 10'·706E.

and

59° 57'·292N., 30° 11'·330E.

59° 57'·313N., 30° 11'·228E.

2. The berths are lit by lights, Fl.Y.5s2M at each end.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2364**1614(T)/24 POLAND - Buoyage. Measuring instruments.**

Source: Polish Notice 2/14(T)/24

1. Survey gauges marked by yellow light-buoys, Fl.Y.3s have been established in the following positions:

54° 31'·63N., 18° 34'·10E.

54° 31'·98N., 18° 34'·11E.

2. Unlit survey gauges have been established in the following positions:

54° 32'·77N., 18° 35'·35E.

54° 33'·43N., 18° 36'·72E.

54° 34'·34N., 18° 37'·72E.

(WGS84 DATUM)

Chart affected — 2688**1838(T)/24 FINLAND - West Coast - Virtual aid to navigation.**

Source: Finnish Notice 1/8(T)/24

1. A virtual aid to navigation (V-AIS), with west cardinal topmark, has been established in position 61° 38'·506N., 21° 24'·338E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2164 — 3830

1939(T)/24 LITHUANIA - Buoyage. Restricted areas.

Source: Lithuanian Nav Warnings 97(T)/23, 99(T)/23 and ENC LT282001

- Survey gauges, marked by red and white buoys with safety zones 0·25M radius, exist in the following positions:

56° 01'·59N., 20° 13'·17E.
 55° 59'·16N., 20° 13'·17E.
 55° 56'·74N., 20° 13'·18E.
 56° 01'·59N., 20° 17'·49E.
 55° 59'·17N., 20° 17'·50E.
 56° 01'·59N., 20° 21'·82E.
 55° 59'·17N., 20° 21'·82E.
 56° 01'·59N., 20° 26'·15E.

- Trawling within a 1M radius of these positions is prohibited.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2048 — 2231 — 2288 — 2816

2186(T)/24 POLAND - Restricted area.

Source: Polish Notice 5/72(T)/24

- A restricted area, entry prohibited, has been established bounded by the following positions:

54° 50'·29N., 17° 53'·10E.
 54° 50'·23N., 17° 54'·09E.
 54° 49'·44N., 17° 53'·87E.
 54° 49'·24N., 17° 52'·90E.
 (WGS84 DATUM)

Charts affected — 2018 — 2040

2189(T)/24 BALTIC SEA - Buoyage. Light-beacon.

Source: Polish Notice 6/88(T)/24

- Survey gauges, marked by light-buoys and light-beacon, have been established in the following positions:

<i>Characteristic</i>	<i>Designation</i>	<i>Type</i>	<i>Position</i>
Fl.Y.10s	LK-M1	Yellow beacon with X-shape topmark	54° 48'·41N., 17° 47'·45E.
Fl.Y.8s	MHM LK1	Yellow conical buoy with X-shape topmark	54° 48'·97N., 17° 46'·90E.
Fl.Y.5s	MHM LK2	Yellow conical buoy with X-shape topmark	54° 49'·87N., 17° 46'·89E.

(WGS84 DATUM)

Charts affected — 2018 — 2040

2296(T)/24 POLAND - Measuring instruments. Buoyage.

Source: Polish Notice 9/124(T)/24

- Measuring instruments, marked by yellow light-buoys, *Fl(5)Y.20s IBW PAN*, have been established in the following positions:

* 54° 45'·11N., 18° 34'·64E.
 * 54° 50'·98N., 18° 20'·10E.

- Former Notice 5098(T)/22 is cancelled.
 * Indicates new or revised entry.
 (WGS84 DATUM)

Chart affected — 2688

2570(T)/24 ESTONIA - Scientific instrument. Restricted area.

Source: Estonian Notice 4/67(T)/24

- An unmarked, underwater scientific equipment has been established in position 59° 27'·74N., 24° 42'·98E.

2570(T)/24 ESTONIA - Scientific instrument. Restricted area. (continued)

2. Restricted area, anchoring and fishing prohibited, radius 0.2M, has been established centred on the above position.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2227**2667(T)/24 POLAND - Buoy.**

Source: Polish Notice 19/260(T)/24

1. A special purpose light-buoy, *Fl.Y.3s*, has been deployed, until further notice, in position 54° 23'·97N., 18° 48'·83E.
(WGS84 DATUM)

Charts affected — 2040 — 2688**2673(T)/24 POLAND - Measuring instruments.**

Source: Polish Notice 15/206(T)/24

1. Measuring instruments have been established on the seabed in the following positions:

54° 40'·20N., 18° 54'·25E.

54° 31'·27N., 18° 45'·44E.

54° 48'·67N., 17° 42'·69E.

54° 53'·70N., 17° 33'·00E.

54° 46'·23N., 16° 20'·70E.

53° 59'·00N., 14° 16'·68E.

(WGS84 DATUM)

Charts affected — 2014 — 2015 — 2018 — 2040 — 2288 — 2679 — 2688**3376(T)/24 POLAND - Measuring instruments.**

Source: Polish Notice 19/276(T)/24

1. Measuring instruments have been established on the seabed in the following positions:

55° 00'·08N., 17° 59'·79E.

55° 13'·74N., 17° 55'·41E.

55° 06'·11N., 17° 45'·58E.

55° 09'·97N., 17° 41'·67E.

55° 00'·57N., 17° 42'·01E.

55° 02'·70N., 17° 39'·09E.

55° 05'·59N., 17° 37'·40E.

54° 59'·73N., 17° 36'·90E.

55° 02'·81N., 17° 35'·64E.

54° 49'·16N., 17° 33'·58E.

55° 12'·09N., 17° 21'·99E.

55° 04'·84N., 17° 19'·74E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040 — 2816**3420(T)/24 SWEDEN - East Coast - Obstruction. Buoyage.**

Source: Swedish Notice 1021/18544(T)/24

1. An obstruction, marked by light buoys, exists in the approximate position of 59° 27'·158N., 16° 19'·168E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 802

4103(T)/24 RUSSIA - Baltic Sea Coast - Works.

Source: Russian Notice 20/1941(T)/24

1. Construction works are taking place, in an area bounded by the following positions:

59° 40'·51N., 28° 24'·73E.

59° 40'·91N., 28° 24'·60E.

59° 40'·91N., 28° 24'·80E.

59° 40'·51N., 28° 24'·93E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2698**4119(T)/24 POLAND - Explosive dumping ground.**

Source: Polish Notice 23/330(T)/24

1. Explosives have been reported in the following position 55° 03'·10N., 17° 40'·29E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040**4282(T)/24 POLAND - Buoyage.**

Source: Polish Notice 29/399(T)/24

1. The following light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.Y.4s</i>	<i>IMGW-METEO 2 ODAS</i>	Spar	55° 05'·50N., 16° 28'·00E.
<i>Fl(5)Y.20s</i>	<i>IMGW-METEO 1 ODAS</i>	Spar	54° 33'·50N., 15° 15'·00E.

2. Former Notice 3331(T)/23 is cancelled.
(WGS84 DATUM)

Charts affected — 2014 — 2018**4513(T)/24 SWEDEN - West Coast - Measuring instruments. Depths.**

Source: Swedish Notice 1031/18689/24

1. Measuring equipment has been established on the seabed in the following positions:

<i>Depth</i>	<i>Position</i>
11·5m	55° 40'·53N., 13° 00'·29E.
10·1m	55° 39'·54N., 12° 53'·49E.
16m	55° 43'·72N., 12° 55'·80E.
10·8m	55° 44'·32N., 12° 48'·88E.
13·5m	55° 47'·97N., 12° 53'·21E.
18m	55° 47'·85N., 12° 46'·49E.
50m	55° 51'·45N., 12° 45'·07E.
20·3m	55° 53'·43N., 12° 41'·46E.
20·7m	55° 53'·88N., 12° 43'·77E.
20m	55° 55'·56N., 12° 40'·71E.
10m	55° 58'·27N., 12° 44'·63E.
10m	55° 59'·034N., 12° 39'·139E.
34m	55° 59'·923N., 12° 41'·963E.
8·5m	56° 04'·06N., 12° 39'·49E.
8·5m	56° 06'·49N., 12° 35'·61E.
18m	56° 08'·95N., 12° 32'·24E.
24m	56° 11'·07N., 12° 28'·44E.
24m	56° 13'·09N., 12° 23'·01E.
12·6m	56° 15'·93N., 12° 29'·88E.
26·5m	56° 18'·00N., 12° 23'·76E.
25·5m	56° 17'·93N., 12° 31'·21E.
23m	56° 17'·89N., 12° 37'·98E.

4513(T)/24 SWEDEN - West Coast - Measuring instruments. Depths. (continued)

7·1m	56° 14'·16N., 12° 45'·23E.
14m	56° 18'·01N., 12° 44'·77E.
21·5m	56° 21'·66N., 12° 37'·75E.
21m	56° 24'·91N., 12° 34'·25E.
27m	56° 26'·88N., 12° 31'·35E.
25m	56° 21'·52N., 12° 30'·96E.

- The equipment should not obstruct vessels, however, seabed activities, including trawling and anchoring, should be avoided in the area.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 876 — 903 — 2108 — 2115 — 2594 — 2595

4526(T)/24 ESTONIA - Restricted area.

Source: Estonian Notice 6/109(T)/24

- A restricted area, anchoring, trawling and diving prohibited, has been established bounded by the following positions:
58° 40'·72N., 22° 46'·42E.
58° 40'·73N., 22° 47'·56E.
58° 40'·18N., 22° 47'·61E.
58° 40'·17N., 22° 46'·43E.
(WGS84 DATUM)

Chart affected — 2075

4540(T)/24 ESTONIA - Obstruction. Restricted area.

Source: Estonian Notice 6/103(T)/24

- An obstruction exists in position 59° 36'·25N., 24° 34'·04E.
- A minefield, anchoring, diving and fishing prohibited area, has been established, radius 0·5M, centred on the obstruction.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2227

4882(T)/24 POLAND - Buoy.

Source: Polish Notice 34/443(T)/24

- A yellow spar light-buoy, X-shaped topmark, *Fl.Y.4s ODAS*, has been established in position 55° 00'·14N., 17° 40'·53E.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040

5137(T)/24 FINLAND - Saaristomeri - Buoy.

Source: Finnish Notice 19/168(T)/24 and ENC FI4EIJUF

- An ODAS buoy, *Fl(5)Y.20s*, has been deployed, until further notice, in position 60° 15'·20N., 21° 57'·16E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3824 — 3825 — 3899

5434(P)/24 FINLAND - West Coast - Bridge. Works.

Source: Finnish Notice 17/145(T)/24

1. Bridge construction works are taking place between Riutunkari in Oulu and Huikku on Hailuoto Island in an area bounded by the following positions:

65° 02'·44N., 25° 03'·91E.
 65° 02'·25N., 25° 06'·36E.
 65° 02'·13N., 25° 07'·37E.
 65° 01'·55N., 25° 08'·99E.
 65° 01'·24N., 25° 10'·33E.
 65° 00'·50N., 25° 11'·85E.
 65° 00'·49N., 25° 11'·69E.
 65° 01'·17N., 25° 10'·17E.
 65° 01'·49N., 25° 08'·89E.
 65° 02'·05N., 25° 07'·31E.
 65° 02'·19N., 25° 06'·32E.
 65° 02'·36N., 25° 03'·84E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2098 — 3863**5453(T)/24 SWEDEN - East Coast - Depths.**

Source: Swedish Notice 1040/18653(T)/24

1. Depths of 3m exist within an area bounded by the following positions:

58° 44'·57N., 17° 01'·16E.
 58° 44'·53N., 17° 01'·24E.
 58° 44'·53N., 17° 01'·21E.
 58° 44'·54N., 17° 01'·19E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 843**5620(T)/24 POLAND - Buoy.**

Source: Polish Notice 39/489(T)/24

1. A special light-buoy, *Fl. Y. 3s MW-2*, has been deployed in position 54° 24'·00N., 18° 50'·00E.
(WGS84 DATUM)

Chart affected — 2688**5944(T)/24 POLAND - General information.**

Source: Polish Notice 41/513(T)/24

1. A survey gauge has been established on the seabed in position 54° 50'·00N., 18° 40'·00E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2688**5948(T)/24 POLAND - Explosive dumping ground.**

Source: Polish Notice 25/348(T)/24

1. Explosives exist on the seabed in position 54° 59'·26N., 17° 33'·98E.
2. Mariners are advised to navigate with extreme caution in the area.
3. *Former Notice 3391(T)/24 is cancelled.
* Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040 — 2816

40(T)/25 ESTONIA - Buoy.

Source: Estonian Notice 11/181(T)/24

1. An *ODAS* buoy has been deployed, until further notice, in position $57^{\circ} 57' \cdot 42\text{N.}$, $23^{\circ} 58' \cdot 28\text{E.}$ (WGS84 DATUM)

Charts affected — 2215 — 2816 — 2817**62(T)/25 SWEDEN - East Coast - Virtual aid to navigation. Light. Wreck.**

Source: Swedish Notice 1044/18931(T)/24

1. A virtual aid to navigation (V-AIS) and light, *Y*, marking an uncharted wreck, has been established in position $59^{\circ} 26' \cdot 10\text{N.}$, $17^{\circ} 19' \cdot 98\text{E.}$
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Chart affected — 810**139(T)/25 POLAND - Submarine pipeline. Buoy.**

Source: Polish Notice 45/556(T)/24

1. A submarine pipeline has been inserted, joining the following positions:
 $53^{\circ} 36' \cdot 22\text{N.}$, $14^{\circ} 35' \cdot 80\text{E.}$
 $53^{\circ} 36' \cdot 17\text{N.}$, $14^{\circ} 35' \cdot 58\text{E.}$
2. A yellow conical buoy has been inserted in position $53^{\circ} 36' \cdot 12\text{N.}$, $14^{\circ} 35' \cdot 49\text{E.}$
3. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Chart affected — 2678**290(T)/25 POLAND - Works. Port development.**

Source: Polish Notice 49/601(T)/24

1. Construction works are taking place within the Północny port limit, bounded by the following positions:
 $54^{\circ} 23' \cdot 325\text{N.}$, $18^{\circ} 43' \cdot 293\text{E.}$
 $54^{\circ} 23' \cdot 339\text{N.}$, $18^{\circ} 43' \cdot 315\text{E.}$
 $54^{\circ} 23' \cdot 345\text{N.}$, $18^{\circ} 43' \cdot 303\text{E.}$
 $54^{\circ} 23' \cdot 513\text{N.}$, $18^{\circ} 43' \cdot 557\text{E.}$
 $54^{\circ} 23' \cdot 411\text{N.}$, $18^{\circ} 43' \cdot 936\text{E.}$
 $54^{\circ} 23' \cdot 397\text{N.}$, $18^{\circ} 43' \cdot 925\text{E.}$
 $54^{\circ} 23' \cdot 392\text{N.}$, $18^{\circ} 43' \cdot 933\text{E.}$
 $54^{\circ} 23' \cdot 231\text{N.}$, $18^{\circ} 43' \cdot 689\text{E.}$
 $54^{\circ} 23' \cdot 280\text{N.}$, $18^{\circ} 43' \cdot 594\text{E.}$
 $54^{\circ} 23' \cdot 218\text{N.}$, $18^{\circ} 43' \cdot 500\text{E.}$
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Charts affected — 2637 — 2688**560(T)/25 POLAND - Buoyage.**

Source: Polish Notice 50/612(T)/24

1. Special pillar light-buoys, *Fl.Y.3s*, have been established in the following positions:
 $53^{\circ} 24' \cdot 617\text{N.}$, $14^{\circ} 36' \cdot 485\text{E.}$
 $53^{\circ} 24' \cdot 545\text{N.}$, $14^{\circ} 36' \cdot 490\text{E.}$
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Chart affected — 2452

743(T)/25 POLAND - Buoyage. Automatic Identification Systems.

Source: Polish Notice 49/598(T)/24

1. The following light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	Special pillar	55° 05'·21N., 17° 38'·91E.
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	Special pillar	55° 01'·50N., 17° 39'·19E.
<i>Q</i>		North Cardinal pillar	55° 06'·82N., 17° 39'·15E.
<i>Q</i>		North Cardinal pillar	55° 06'·80N., 17° 44'·38E.
<i>Q(3)10s</i>		East Cardinal pillar	55° 05'·30N., 17° 46'·41E.
<i>Q(3)10s</i>		East Cardinal pillar	55° 03'·77N., 17° 42'·98E.
<i>Q(3)10s</i>		East Cardinal pillar	55° 01'·80N., 17° 42'·99E.
<i>Q(6)+LFl.15s</i>		South Cardinal pillar	54° 59'·96N., 17° 40'·90E.
<i>Q(6)+LFl.15s</i>		South Cardinal pillar	54° 58'·88N., 17° 36'·04E.
<i>Q(9)15s</i>		West Cardinal pillar	55° 00'·11N., 17° 33'·92E.
<i>Q(9)15s</i>		West Cardinal pillar	55° 02'·56N., 17° 34'·43E.
<i>Q(9)15s</i>		West Cardinal pillar	55° 05'·01N., 17° 36'·01E.

2. Automatic Identification Systems, *AIS*, have been established at all light-buoys listed in paragraph 1 (above).
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040**782(T)/25 POLAND - Buoyage.**

Source: Polish Notice 50/609(T)/24

1. Yellow spar light-buoys, *Fl.Y.5s*, have been established in the following positions:

<i>Position</i>
55° 05'·85N., 17° 37'·41E.
55° 06'·37N., 17° 45'·58E.
55° 03'·08N., 17° 35'·65E.
55° 02'·96N., 17° 39'·10E.
54° 59'·99N., 17° 36'·89E.
55° 00'·84N., 17° 42'·00E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040**1019(T)/25 FINLAND - Saaristomeri - Pier. Works.**

Source: Finnish Notice 34/267(T)/24

1. Pier construction works are taking place, in an area bounded by the following positions:

60° 26'·360N., 22° 13'·200E.
60° 26'·190N., 22° 13'·130E.
60° 26'·150N., 22° 12'·990E.
60° 26'·170N., 22° 12'·960E.
60° 26'·230N., 22° 13'·070E.
60° 26'·350N., 22° 13'·150E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3825**1167(T)/25 DENMARK - East Coast - Works. Bridge. Vertical clearance.**

Source: Danish Chart Correction 50/484/24

1. Maintenance works are taking place at Lillebælt West Bridge (55° 31'·05N., 9° 42'·58E.)
2. The works are being carried out from platforms which will reduce the vertical clearance by approximately 4m.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 900 — 2106 — 2592

1201(T)/25 POLAND - Buoy.

Source: Polish Notice 1/1(T)/25

1. The following light-buoy has been moved:

<i>Characteristic</i>	<i>Designation</i>	<i>Former Position</i>	<i>New Position</i>
<i>LFl.G.6s</i>	<i>MW-27</i>	54° 21'·243N., 18° 41'·015E.	54° 21'·261N., 18° 41'·208E.

2. Former Notice 4800(T)/23 is cancelled.
(WGS84 DATUM)

Chart affected — 2637**1214(T)/25 DENMARK - Islands - Depths.**

Source: Danish Notice 8/117(T)/25

1. Depths of 4·5m in the turning basin, have been reported in the vicinity of position, 54° 34'·06N., 11° 55'·84E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2601**1216(T)/25 POLAND - Measuring instruments.**

Source: Polish Notice 1/13(T)/25

1. Survey gauges have been installed on the seabed, in an area bounded by following positions:

53° 39'·60N., 14° 31'·50E.
 53° 40'·60N., 14° 28'·45E.
 53° 41'·35N., 14° 25'·50E.
 53° 42'·40N., 14° 22'·40E.
 53° 44'·43N., 14° 16'·36E.
 53° 45'·23N., 14° 16'·22E.
 53° 48'·20N., 14° 16'·50E.
 53° 51'·71N., 14° 17'·20E.
 53° 52'·00N., 14° 21'·30E.
 53° 51'·90N., 14° 25'·74E.
 53° 59'·94N., 14° 45'·73E.
 53° 40'·46N., 14° 32'·44E.
 53° 39'·92N., 14° 32'·00E.
 (WGS84 DATUM)

Charts affected — 2024 — 2025 — 2453 — 2677 — 2678 — 2679**1270(T)/25 POLAND - Buoy.**

Source: Polish Notices 21/254(T)/23 and 1/2(T)/25

1. An ODAS buoy, *Fl(5)Y.20s*, has been deployed in position 54° 38'·86N., 18° 37'·88E.
2. Former Notice 3086(T)/23 is cancelled.
(WGS84 DATUM)

Charts affected — 2040 — 2688**1291(T)/25 SWEDEN - East Coast - Obstructions. Depth.**

Source: Swedish Notice 1056/19031(T)/25

1. Recent survey information has shown that obstructions and a depth less than charted exist in the fairway to Hallstavik in the following positions:

<i>Feature</i>	<i>Depth</i>	<i>Position</i>
Depth	7m	60° 08'·35N., 18° 33'·01E.
Obstruction	2·4m	60° 05'·82N., 18° 34'·83E.
Obstruction	7·1m	60° 05'·81N., 18° 34'·89E.

1291(T)/25 SWEDEN - East Coast - Obstructions. Depth. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 889

1395(T)/25 POLAND - Bridge. Buoyage.

Source: Polish Notice 2/27(T)/25

1. The shipping passage at Most Siennicki Bridge in position 54° 21'·306N., 18° 40'·630E. is closed.
2. Yellow light buoys have been placed on both sides of the bridge to mark the closure.
(WGS84 DATUM)

Chart affected — 2637

1548(T)/25 POLAND - Measuring instruments. Depth.

Source: 50/608(T)/24

1. Measuring instruments with depth, 30m, have been established in the following positions:

54° 54'·85N., 19° 08'·07E.

*55° 19'·95N., 17° 23'·30E.

2. Measuring instruments have been established on the seabed in the following positions:

54° 26'·71N., 19° 01'·42E.

54° 33'·73N., 18° 44'·19E.

54° 07'·62N., 14° 25'·94E.

53° 57'·58N., 14° 15'·54E.

54° 58'·29N., 18° 19'·17E.

54° 54'·02N., 17° 48'·53E.

54° 50'·71N., 17° 18'·28E.

54° 46'·73N., 16° 47'·97E.

54° 42'·62N., 16° 17'·77E.

54° 44'·69N., 16° 32'·86E.

54° 31'·80N., 16° 06'·34E.

54° 16'·63N., 15° 25'·22E.

54° 12'·19N., 14° 55'·52E.

54° 29'·43N., 19° 30'·79E.

54° 51'·32N., 18° 37'·56E.

54° 18'·60N., 14° 36'·81E.

55° 12'·10N., 17° 42'·05E.

55° 05'·22N., 18° 00'·67E.

54° 53'·43N., 16° 29'·30E.

55° 10'·90N., 16° 22'·10E.

55° 04'·22N., 16° 40'·93E.

54° 57'·49N., 16° 59'·66E.

55° 08'·23N., 17° 11'·45E.

3. and

55° 01'·42N., 17° 30'·11E.

54° 27'·52N., 15° 36'·39E.

54° 20'·96N., 15° 55'·01E.

54° 38'·39N., 15° 47'·66E.

54° 49'·25N., 15° 59'·04E.

55° 00'·08N., 16° 10'·51E.

54° 34'·04N., 15° 17'·67E.

54° 23'·04N., 15° 04'·77E.

54° 29'·56N., 14° 47'·78E.

55° 29'·25N., 17° 34'·16E.

55° 40'·31N., 17° 47'·45E.

55° 33'·41N., 18° 06'·27E.

55° 22'·77N., 17° 54'·11E.

55° 15'·86N., 18° 12'·76E.

55° 21'·69N., 16° 33'·78E.

55° 25'·73N., 17° 04'·51E.

1548(T)/25 POLAND - Measuring instruments. Depth. (continued)

4. Mariners are advised to navigate with caution in the area
5. * Former Notice 4896(T)/24 is cancelled.
* Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2014 — 2015 — 2018 — 2040 — 2048 — 2677 — 2679 — 2688

1557(T)/25 DENMARK - Islands - Works. Submarine cables.

Source: Danish Notice 11/184(T)/25

1. Cable works are being carried out in an area around lines through the following positions:

55° 44'·40N., 12° 35'·10E.
 55° 44'·02N., 12° 37'·19E.
 55° 43'·92N., 12° 37'·67E.
 55° 43'·35N., 12° 39'·35E.
 55° 42'·92N., 12° 39'·50E.
 55° 42'·48N., 12° 39'·41E.
 55° 42'·24N., 12° 39'·36E.
 55° 41'·81N., 12° 39'·10E.
 55° 41'·52N., 12° 38'·25E.
 55° 41'·40N., 12° 37'·55E.
 55° 41'·32N., 12° 37'·52E.
 and
 55° 43'·47N., 12° 37'·38E.
 55° 43'·78N., 12° 37'·18E.
 55° 44'·01N., 12° 37'·19E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 903 — 2115 — 2594 — 2595

1800(T)/25 DENMARK - Islands - Depth.

Source: Danish Notice 10/171(T)/25

1. A depth of 8·0m has been reported in the entrance to Nakskov Fjord, between the following positions:

54° 51'·79N., 10° 56'·35E.
 54° 50'·99N., 10° 58'·80E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2597

1870(T)/25 POLAND - Buoyage.

Source: Polish Notice 9/95(T)/25

1. ODAS light-buoys, have been established in the following positions:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl(5)Y.20s</i>	<i>SWM-116 ODAS</i>	Spar	54° 49'·88N., 17° 52'·03E.
<i>Fl(5)Y.20s</i>	<i>SWM-115 ODAS</i>	Spar	55° 05'·30N., 17° 05'·77E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040

1934(T)/25 DENMARK - Islands - Channel depths.

Source: Danish Notice 15/249(T)/25

1. Depths of 4m exist within the dredged Nyt Løb channel, between the following positions:

54° 52'·14N., 12° 09'·05E.
 54° 50'·06N., 12° 10'·94E.

1934(T)/25 DENMARK - Islands - Channel depths. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2115**2042(T)/25 POLAND - Wind farm. Works. Buoyage.**

Source: Polish Notices 52/631(T)/24, 1/2(T)/25, 1/12(T)/25 and 10/119(T)/25

- Wind farm construction works are taking place, until late August 2025, within an area, marked by cardinal light-buoys, bounded by the following positions:

55° 02'·09N., 17° 33'·10E.
 55° 06'·65N., 17° 37'·30E.
 55° 06'·65N., 17° 46'·27E.
 55° 04'·94N., 17° 46'·66E.
 55° 05'·11N., 17° 43'·09E.
 55° 00'·30N., 17° 43'·09E.
 54° 59'·66N., 17° 38'·89E.
 54° 58'·66N., 17° 33'·85E.

- Mariners are advised to navigate with caution in the area.
- Former Notices 1206(T)/25 and 817(P)/25 are cancelled.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040**2044(T)/25 POLAND - Restricted area.**

Source: Polish Notice 10/110(T)/25

- A restricted area, entry prohibited, has been established, until mid-August 2025, bounded by the following positions:

54° 34'·98N., 16° 49'·41E.
 54° 34'·77N., 16° 48'·12E.
 54° 36'·47N., 16° 47'·52E.
 54° 36'·80N., 16° 50'·14E.
 54° 35'·27N., 16° 50'·70E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2014**2183(T)/25 POLAND - Buoyage.**

Source: Polish Notice 12/136(T)/25

- Survey gauges, marked by yellow pillar-buoys, have been established in the following positions:

54° 47'·86N., 17° 31'·45E.
 55° 06'·65N., 17° 45'·48E.
 55° 05'·11N., 17° 43'·09E.
 55° 02'·95N., 17° 43'·10E.
 55° 00'·08N., 17° 41'·53E.
 54° 59'·33N., 17° 37'·12E.
 55° 01'·22N., 17° 33'·29E.
 55° 04'·12N., 17° 34'·97E.
 55° 06'·65N., 17° 39'·97E.
 55° 04'·12N., 17° 38'·24E.
 55° 01'·59N., 17° 39'·34E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040

2184(T)/25 POLAND - Buoyage.

Source: Polish Notice 12/137(T)/25

1. Survey gauges, marked by yellow special pillar-buoys, *Fl.Y.5s*, have been established in the following positions:

55° 05'·73N., 17° 11'·29E.
55° 02'·10N., 17° 00'·29E.
55° 06'·24N., 17° 00'·28E.
55° 03'·71N., 17° 30'·00E.
55° 05'·39N., 17° 24'·43E.
55° 03'·19N., 17° 18'·05E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040**2189(T)/25 LITHUANIA - Buoy.**

Source: Lithuanian Nav Warning 22/25

1. A yellow ODAS buoy, with safety zone 50m radius, has been established, until further notice, in position
55° 43'·82N., 21° 02'·88E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2040 — 2048 — 2276**2262(T)/25 DENMARK - Islands - Depths.**

Source: Danish Notice 19/325(T)/25

1. *Reduced depths of 2·8m have been reported in the channel between Middelgrund and Lynetteholm in an area bounded by the following positions:

*55° 42'·502N., 12° 39'·015E.
*55° 42'·303N., 12° 39'·067E.
*55° 42'·142N., 12° 39'·038E.
*55° 41'·882N., 12° 38'·684E.
*55° 41'·792N., 12° 39'·432E.
*55° 42'·501N., 12° 39'·435E.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 1469(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 903 — 2594 — 2595**2269(T)/25 SWEDEN - East Coast - Works. Bridge. Lights. Boom. Buoyage.**

Source: Swedish Notice 1066/19257(T)/25

1. Maintenance works are taking place at Essingebron Bridge (59° 19'·41N., 17° 59'·93E.) Mariners are requested as they pass under the bridge to do so without causing a swell.
2. The work includes barges marked with fixed white and flashing yellow lights.
3. Protective booms and special spar buoys mark the area in the following positions:

59° 19'·41N., 17° 59'·89E.
59° 19'·43N., 17° 59'·92E.
59° 19'·40N., 17° 59'·97E.
59° 19'·39N., 17° 59'·94E.
4. Contact with work personal can be established via VHF channels 68 and 16. Supervisors can be contacted by phone +46 (0)73 93 93 205, +46 (0)76 17 24 984 or +46 (0)70 53 12
5. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 811

2365(T)/25 ESTONIA - Works. Dredging area. Buoyage. Lights.

Source: Estonian Notices 4/44(T)-46(T)/25

1. Dredging works are taking place within Miinisadam.
2. The following buoys have been temporarily established:

<i>Buoy Type</i>	<i>Position</i>
Starboard spar buoy	59° 27'·45N., 24° 43'·65E.
Port spar buoy	59° 27'·43N., 24° 43'·70E.

3. The following lights have been temporarily moved:

<i>Characteristic</i>	<i>Former Position</i>	<i>New Position</i>
Fl(3)G.8s3M	59° 27'·50N., 24° 43'·43E.	59° 27'·44N., 24° 43'·62E.
Fl(3)R.8s3M	59° 27'·48N., 24° 43'·49E.	59° 27'·42N., 24° 43'·70E.

4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2227**2381(T)/25 DENMARK - Islands - Works. Bridge. Vertical clearance.**

Source: Danish Notice 20/378(T)/25

1. Bridge maintenance works are taking place at the Langelandsbroen bridge, in position 54° 56'·86N., 10° 42'·47E.
2. During the works, the vertical clearance will be reduced in the side spans by 1m and periodically be reduced by approx. 7m in the passage span.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2597**2389(T)/25 POLAND - Buoyage.**

Source: Polish Notice 14/158(T)/25

1. ODAS light-buoys, *Q.Y.*, have been established in the following positions:

54° 24'·47N., 15° 07'·70E.
 54° 27'·22N., 15° 01'·93E.
 54° 31'·94N., 15° 15'·03E.
 (WGS84 DATUM)

Chart affected — 2014**2501(T)/25 SWEDEN - East Coast - Bridge. Works.**

Source: Swedish Notice 1067/19254(T)/25

1. Maintenance works are taking place at Nockebybron Bridge (59° 19'·66N., 17° 54'·54E.).
2. Mariners are advised to navigate with caution and are requested to reduce their speed when passing the works.
(WGS84 DATUM)

Chart affected — 810**2586(T)/25 SWEDEN - West Coast - Bridge. Works. Horizontal clearance.**

Source: Swedish Notice 1068/19264(T)/25

1. Sedimentation west of Hisingsbron bridge in position 57° 42'·930N., 11° 58'·040E., has reduced the horizontal clearance.
2. Vessels maximum beam clearance approaching from Frihamnspiren is 13·4 meters.
3. The maximum vessel draught is reduced to 5·4 meters.
4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 857

2589(T)/25 SWEDEN - West Coast - Fouls. Measuring instruments.

Source: Swedish Notice 1068/19295(T)/25

1. Fouls exist in positions 58° 27'·1N., 10° 33'·4E. and 58° 28'·6N., 10° 28'·8E.
2. Measuring instruments have been placed on the seafloor, reducing available depth by a maximum of 2·5 metres.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1402**2679(T)/25 POLAND - Restricted area.**

Source: Polish Notice 1/4(T)/25 and ENC PL4MAP36

1. *A circular restricted area, entry prohibited, radius 500m, has been established centred on 53° 58'·27N., 14° 19'·80E.
2. *Former Notice 1269(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 2679**2728(T)/25 ESTONIA - Buoyage.**

Source: Estonian Notice 5/71(T)/25

1. The following light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl. Y. 5s</i>	<i>ODAS</i>	spar	57° 59'·26N., 22° 53'·99E.
<i>Fl. Y. 5s</i>	<i>ODAS</i>	spar	57° 57'·81N., 22° 54'·11E.
<i>Fl. Y. 5s</i>	<i>ODAS</i>	spar	57° 56'·66N., 22° 56'·68E.
<i>Fl. Y. 5s</i>	<i>ODAS</i>	spar	58° 01'·76N., 22° 57'·97E.
<i>Fl. Y. 5s</i>	<i>ODAS</i>	spar	57° 55'·44N., 22° 59'·05E.
<i>Fl. Y. 5s</i>	<i>ODAS</i>	spar	58° 00'·23N., 23° 01'·22E.
<i>Fl. Y. 5s</i>	<i>ODAS</i>	spar	57° 58'·25N., 23° 04'·64E.
<i>Fl. Y. 5s</i>	<i>ODAS</i>	spar	57° 55'·94N., 23° 08'·40E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2215 — 2816 — 2817**2905(T)/25 POLAND - Works.**

Source: Polish Notice 17/196(T)/25

1. Seabed works are taking place in the vicinity of a line joined by the following positions:

54° 49'·01N., 17° 51'·35E.
 54° 51'·59N., 17° 51'·10E.
 54° 52'·02N., 17° 50'·45E.
 54° 51'·92N., 17° 48'·14E.
 54° 51'·71N., 17° 41'·51E.
 54° 53'·61N., 17° 33'·85E.
 55° 00'·00N., 17° 31'·91E.
 55° 03'·03N., 17° 15'·22E.

2. Mariners are to keep clear of the works area.
(WGS84 DATUM)

Charts affected — 2014 — 2018

2912(T)/25 POLAND - Measuring instruments.

Source: Polish Notices 17/191(T)-192(T)/25

1. Measuring instruments, have been established on the seabed in the following positions:

Position

54° 32'·36N., 18° 58'·09E.

54° 32'·31N., 18° 57'·89E.

54° 32'·21N., 18° 52'·39E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2688**2917(T)/25 ESTONIA - Measuring instrument.**

Source: Estonian Notice 5/65(T)/24

1. An underwater measuring device, *ODAS*, exists in position 59° 39'·72N., 25° 29'·07E.
2. An anchoring and fishing prohibited area has been established, radius 321m (0·2M), centred on the above position.
(WGS84 DATUM)

Chart affected — 2248**2920(T)/25 ESTONIA - Buoyage.**

Source: Estonian Notice 5/67(T)/25

1. The following light-buoys have been established:

Characteristic	Designation	Buoy Type	Position
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	pillar	57° 49'·10N., 21° 44'·29E.
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	pillar	57° 53'·59N., 21° 40'·57E.
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	pillar	57° 58'·00N., 21° 45'·58E.
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	pillar	58° 00'·83N., 21° 54'·21E.
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	pillar	58° 02'·75N., 21° 25'·28E.
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	pillar	58° 03'·33N., 21° 39'·39E.
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	pillar	58° 06'·37N., 21° 52'·24E.
<i>Fl(5)Y.20s</i>	<i>ODAS</i>	pillar	58° 08'·20N., 21° 25'·05E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2059 — 2226**2940(T)/25 FINLAND - South Coast - Buoy.**

Source: Finnish Notice 12/78(T)/25

1. A yellow *ODAS* spar buoy, X-shape topmark, *Fl(5)Y.20s*, has been established in position 60° 07'·55N., 26° 20'·16E.
(WGS84 DATUM)

Charts affected — 2248 — 3814**3087(T)/25 FINLAND - South Coast - Fairway.**

Source: Finnish Notice 11/86(T)/25

1. *The section of fairway joining positions 60° 10'·40N., 25° 00'·55E. and 60° 10'·28N., 25° 00'·35E. is closed to vessel traffic.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. *Former Notice 3140(P)/24 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 2218 — 3818

3089(T)/25 DENMARK - East Coast - General information.

Source: Danish Notice 19/323(T)/25

1. USV testing is being carried out in an area bounded by the following positions:

55° 29'·90N., 9° 36'·06E.
 55° 30'·48N., 9° 36'·22E.
 55° 30'·47N., 9° 37'·27E.
 55° 30'·71N., 9° 37'·49E.
 55° 30'·71N., 9° 37'·81E.
 55° 30'·42N., 9° 38'·26E.
 55° 29'·93N., 9° 38'·24E.

2. The USV's can be contacted on VHF channel 16.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 900**3134(T)/25 DENMARK - East Coast - Depths.**

Source: Danish Notice 22/419(T)/25

1. Depths as shoal as 6m exist in an area south of Boels Plade between positions:

56° 37'·03N., 10° 30'·06E.
 56° 37'·11N., 10° 27'·75E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2108**3264(T)/25 SWEDEN - East Coast - Submarine pipeline. Works.**

Source: Swedish Notice 1074/19391(T)/25

1. Submarine survey works are taking place, on the Nord Stream 2 gas pipeline, along a line joining the following positions:

55° 32'·2N., 15° 44'·7E.
 55° 39'·1N., 16° 26'·2E.
 56° 15'·0N., 18° 06'·8E.
 56° 20'·5N., 18° 34'·1E.
 58° 52'·0N., 20° 25'·0E.

2. Mariners are advised to navigate with caution in the vicinity of the works area.
(WGS84 DATUM)

Charts affected — 798 — 2018 — 2048 — 2054 — 2055 — 2059 — 2073 — 2075 — 2288 — 2816 — 2817**3476(T)/25 SWEDEN - East Coast - Bridges. Works.**

Source: Swedish Notice 1076/19370(T)/25

1. Works are taking place at Hjulstabron bridge, in position 59° 31'·890N., 17° 00'·450E.
2. Passage is possible during times for bridge opening but point of passage may alter. Mariners are advised to pay attention to current signage at the site.
3. Bridge opening procedures for commercial traffic:
 Bridge opening will take place every day, throughout the day after an order has been made to the Bridge Guard. Orders must be made with three calls to the Bridge Guard on VHF channel 68 or by telephone +46 (0)171449082.
 - First call is to be made 90 minutes before planned passage.
 - Second call is to be made 20-30 minutes before planned passage.
 Westbound vessels, the second call is made at traffic reporting point 25 in position: 59° 31'·56N., 17° 06'·51E.
 Eastbound vessels the second call is made at traffic reporting point 26 in position: 59° 28'·74N., 16° 55'·16E.
 - Third call is to be made 10 minutes before planned passage, at which time the bridge guard will confirm whether the bridge opening can begin or not.

3476(T)/25 SWEDEN - East Coast - Bridges. Works. (continued)

4. Bridge opening for pleasure crafts:

Pleasure crafts will only be able to pass under the Hjulsta Bridge in the open fairway passage in connection with the bridge opening. The bridge opening will take place daily at the following times (LT): 09.00-09.10, 12.00-12.10, 15.00-15.10, 18.00-18.10, 21.00-21.10.

Pleasure crafts will be able to pass in connection with bridge openings ordered by commercial traffic.
(WGS84 DATUM)

Charts affected — 802 — 803

3530(T)/25 SWEDEN - East Coast - Swept areas.

Source: Swedish Notice 1077/19440(T)/25

1. Significant changes to swept depth areas have been found by a survey in the port of Klintehamn.
2. The affected swept depths are as follows:

<i>Location</i>	<i>Old Swept Area (2017) depth</i>	<i>New Swept area depth</i>	<i>Position</i>
Quay 1 and 2: Betkajen	4.9m	4.6m	57° 23'·310N., 18° 11'·340E.
Quay 3: Lanthamnskajen	5.9m	5.5m	57° 23'·300N., 18° 11'·200E.
Quay 4: Donnerkajen	6.7m	6.2m	57° 23'·250N., 18° 10'·900E.

3. Mariners are advised to navigate with caution in the area and contact the local port authority for the latest information by visiting the following website: <http://www.sjofartsverket.se/en/services/pilotage/Pilot-area-Kalmar/>.
(WGS84 DATUM)

Chart affected — 2054

3531(T)/25 SWEDEN - West Coast - Marine farm. Obstructions.

Source: Swedish Notice 1077/19441(T)/25

1. Floating obstructions associated with a marine farm have been reported in Stigfjorden 58° 04'·70N., 11° 36'·30E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 870

3534(T)/25 POLAND - Works.

Source: Polish Notice 15/175(T)/25 and UKHO

1. Survey works are in progress, until the 31st December 2025, within areas bounded by the following positions:

54° 32'·93N., 18° 56'·99E.
54° 32'·97N., 18° 59'·30E.
54° 31'·89N., 18° 59'·36E.
54° 31'·85N., 18° 57'·04E.

2. and

55° 25'·06N., 17° 32'·07E.
55° 10'·20N., 17° 31'·13E.
55° 10'·39N., 17° 21'·72E.
55° 12'·87N., 17° 21'·86E.
55° 13'·04N., 17° 12'·44E.
55° 22'·95N., 17° 12'·99E.
55° 22'·78N., 17° 22'·45E.
55° 25'·26N., 17° 22'·60E.

3. and

54° 57'·18N., 19° 00'·53E.
54° 57'·22N., 19° 13'·46E.
54° 51'·83N., 19° 13'·70E.
54° 51'·83N., 19° 18'·00E.
54° 41'·05N., 19° 18'·45E.
54° 41'·05N., 19° 05'·60E.
54° 46'·44N., 19° 05'·35E.
54° 46'·38N., 19° 01'·06E.

3534(T)/25 POLAND - Works. (continued)

4. Explosive ordnance disposal may take place at any time within these areas.
5. Mariners are advised to navigate with caution in the area.
6. *Former Notice 2533(T)/25 is cancelled.
7. *NOTE: Content of Notice unchanged, re-issued to include Chart 2688.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040 — 2688**3615(P)/25 GERMANY - Baltic Coast - Submarine cables.**

Source: UKHO

1. Submarine power cables are being laid, joining the following positions:

54° 49'·04N., 13° 40'·63E.
 54° 49'·22N., 13° 41'·65E.
 54° 48'·64N., 13° 42'·99E.
 54° 45'·54N., 13° 56'·14E.
 and
 54° 49'·26N., 13° 53'·95E.
 54° 49'·13N., 13° 55'·26E.
 54° 46'·26N., 13° 56'·21E.
 54° 45'·54N., 13° 56'·14E.

2. Charts will be updated when works are complete.
3. *Former Notice 1866(P)/21 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2014 — 2018**3840(T)/25 SWEDEN - East Coast - Restricted area. Works. Piles. Boom. Buoyage. Lights.**

Source: Swedish Notice 1080/19448(T)/25

1. A restricted area has been established bounded by the following positions:

59° 18'·915N., 18° 06'·485E.
 59° 18'·936N., 18° 06'·524E.
 59° 18'·937N., 18° 06'·560E.
 59° 18'·903N., 18° 06'·582E.
 59° 18'·886N., 18° 06'·504E.

2. The area is closed to maritime traffic due to works.
3. Steel sheet piles and booms will be laid out in the water, marked with flashing lights. The work area is also marked with yellow buoys and lighting in the dark.
4. Mariners are advised to keep well clear and navigate with caution.
(WGS84 DATUM)

Charts affected — 811 — 820**3889(T)/25 POLAND - Precautionary areas.**

Source: Polish Notice 31/356(T)/25

1. Environmental research is being carried out, until 30th June 2028, within areas bounded by the following positions:

55° 01'·83N., 16° 57'·72E.
 55° 03'·59N., 16° 53'·00E.
 55° 04'·03N., 16° 49'·44E.
 55° 06'·63N., 16° 46'·37E.
 55° 06'·99N., 16° 46'·44E.
 55° 07'·09N., 16° 47'·27E.
 55° 07'·58N., 16° 50'·58E.
 55° 07'·96N., 16° 55'·36E.
 55° 07'·90N., 16° 56'·48E.

3889(T)/25 POLAND - Precautionary areas. (continued)

2. and

54° 57'·08N., 17° 17'·37E.
 55° 00'·64N., 17° 15'·60E.
 55° 02'·02N., 17° 17'·65E.
 54° 59'·81N., 17° 30'·26E.
 54° 57'·72N., 17° 24'·57E.
 54° 57'·49N., 17° 22'·63E.
 54° 57'·42N., 17° 21'·35E.

3. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 2014 — 2018 — 2816**3899(P)/25 DENMARK - East Coast - Works. Restricted area. Buoyage.**

Source: Danish Notice 30/586(P)/25

- Maintenance works are taking place in Nordhavn at berth 39.
- A restricted area, entry prohibited, marked by special light buoys, has been established bounded by the following positions:

55° 27'·295N., 12° 11'·858E.
 55° 27'·296N., 12° 11'·860E.
 55° 27'·310N., 12° 11'·794E.
 55° 27'·328N., 12° 11'·711E.
 55° 27'·328N., 12° 11'·703E.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
 (WGS84 DATUM)

Chart affected — 2595**4026(T)/25 POLAND - Buoyage.**

Source: Polish Notice 26/291(T)/25

- The following light-buoys, *Fl.Y.2s*, have been established:

<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>FS1</i>	Special	54° 23'·81N., 18° 44'·29E.
<i>FS2</i>	Special	54° 24'·12N., 18° 45'·75E.
<i>FS3</i>	Special	54° 24'·00N., 18° 46'·22E.
<i>FS4</i>	Special	54° 23'·70N., 18° 46'·42E.
<i>FS5</i>	Special	54° 23'·55N., 18° 46'·23E.

(WGS84 DATUM)

Charts affected — 2637 — 2688

4039(T)/25 POLAND - Works. Buoyage.

Source: Polish Notice 22/248(T)/25

1. Construction works are taking place, in an area bounded by the following positions:

54° 24'·147N., 18° 45'·565E.
54° 24'·001N., 18° 46'·214E.
54° 23'·658N., 18° 46'·411E.
54° 23'·548N., 18° 46'·177E.
54° 23'·693N., 18° 46'·167E.
54° 23'·721N., 18° 46'·137E.
54° 23'·762N., 18° 46'·147E.
54° 23'·879N., 18° 45'·974E.
54° 23'·932N., 18° 45'·640E.
54° 23'·928N., 18° 45'·362E.
54° 23'·909N., 18° 45'·289E.
54° 23'·922N., 18° 45'·201E.
54° 23'·653N., 18° 45'·098E.
54° 23'·623N., 18° 45'·034E.
54° 23'·810N., 18° 44'·287E.
54° 24'·093N., 18° 45'·255E.

2. The construction area will be marked with special yellow buoys.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2637 — 2688**4052(T)/25 DENMARK - East Coast - Bridge. Works. Vertical clearance.**

Source: Danish Notice 25/466(T)/25

1. Maintenance works are taking place at West Lillebælt Bridge 55° 31'·051N., 9° 42'·577E.
2. The works are being carried out from a mobile platform which reduces the vertical clearance by 4m.
3. *The platforms can be moved with 2 days notice, if contacted by phone +45 27 88 27 69 or +45 41 72 81 14.
4. Mariners are advised to navigate with caution in the area.
5. *Former Notice 1277(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 900 — 2106 — 2592**4086(T)/25 FINLAND - South Coast - Works. Lights.**

Source: Finnish Notice 21/176(T)/25

1. Construction works are taking place, in an area bounded by the following positions:

60° 08'·80N., 24° 54'·54E.
60° 08'·84N., 24° 54'·54E.
60° 08'·92N., 24° 54'·63E.
60° 08'·86N., 24° 54'·94E.
60° 08'·79N., 24° 54'·87E.

2. The area is marked with special lit marks.
3. Work teams can be contacted on VHF channels 9, 67 and 71.
4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2218 — 3818

4252(T)/25 ESTONIA - Buoyage.

Source: : Estonian Notice 8/136(T)/25

- The following ODAS light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl. Y. 2s</i>	<i>ODAS</i>	Spar	57° 59'·73N., 23° 01'·59E.
<i>Fl. Y. 2s</i>	<i>ODAS</i>	Spar	57° 59'·19N., 23° 01'·61E.
<i>Fl. Y. 2s</i>	<i>ODAS</i>	Spar	57° 58'·66N., 23° 02'·64E.
<i>Fl. Y. 2s</i>	<i>ODAS</i>	Spar	57° 58'·67N., 23° 03'·65E.

(WGS84 DATUM)

Charts affected — 2215 — 2817**4254(T)/25 ESTONIA - Buoyage.**

Source: Estonian Notice 8/127(T)/25

- The following ODAS light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl. Y. 2s</i>	<i>ODAS</i>	Spar	57° 59'·93N., 21° 47'·85E.
<i>Fl. Y. 2s</i>	<i>ODAS</i>	Spar	58° 00'·47N., 21° 47'·86E.
<i>Fl. Y. 2s</i>	<i>ODAS</i>	Spar	58° 01'·02N., 21° 46'·86E.
<i>Fl. Y. 2s</i>	<i>ODAS</i>	Spar	58° 01'·02N., 21° 45'·84E.

(WGS84 DATUM)

Charts affected — 2059 — 2817**4265(P)/25 SWEDEN - East Coast - Bird sanctuaries. Restricted areas.**

Source: Swedish Notice 1083/19500/25

- Bird sanctuaries, with entry prohibited restrictions between 1st Apr-31st Jul have been established around the islands in the following positions:

<i>Island</i>	<i>Position</i>
Sör Bränngr	60° 35'·12N., 17° 36'·55E.
	60° 35'·66N., 17° 37'·63E.
Hättan	60° 35'·67N., 17° 42'·05E.
Kniven	60° 36'·67N., 17° 41'·89E.
Trutbådan	60° 19'·00N., 18° 37'·53E.
Norrsk	60° 17'·57N., 18° 51'·37E.
Medbåden	60° 16'·93N., 18° 52'·65E.
Understens-Viten	60° 16'·81N., 18° 53'·58E.
Öster-and Väster Svantklubben	60° 16'·80N., 18° 50'·36E.
	60° 16'·94N., 18° 51'·26E.
Kniven	60° 16'·90N., 18° 51'·83E.

- Mariners are advised to navigate with caution in the area.
- These changes will be included in the next New Editions of Charts 889 and 891.

(WGS84 DATUM)

Charts affected — 889 — 891**4266(T)/25 SWEDEN - East Coast - Quay. Works. Buoyage.**

Source: Swedish Notice 1083/19516(T)/25

- Quay renovation works are being carried out in the Port of Kalmar, between quay 28 and quay 29.
- The following light-buoys have been established marking the work area:

<i>Buoy Type</i>	<i>Position</i>
Yellow spar	56° 39'·475N., 16° 21'·989E.
Yellow spar	56° 39'·477N., 16° 22'·000E.
Yellow spar	56° 39'·480N., 16° 22'·016E.

4266(T)/25 SWEDEN - East Coast - Quay. Works. Buoyage. (continued)

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2843**4473(T)/25 SWEDEN - East Coast - Works. Marina.**

Source: Swedish Notice 1085/19554(T)/25

1. Marina works are taking place in the vicinity of position 56° 00'·589N., 14° 50'·131E.
2. The marina will remain mostly open during the period of the works.
(WGS84 DATUM)

Chart affected — 2856**4474(T)/25 SWEDEN - East Coast - Works. Berths. Buoyage.**

Source: Swedish Notice 1085/19477(T)/25

1. Works are taking place between berths 4 and 8 in the vicinity of position 58° 37'·400N., 16° 14'·700E.
2. The works area is marked by buoyage.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 847**4498(T)/25 POLAND - Works.**

Source: Polish Notice 26/324(T)/25

1. Construction works are taking place in Port Północny within an area bounded by the following positions:
54° 23'·653N., 18° 45'·098E.
54° 23'·922N., 18° 45'·201E.
54° 23'·932N., 18° 45'·640E.
54° 23'·879N., 18° 45'·975E.
54° 23'·762N., 18° 46'·147E.
54° 23'·693N., 18° 46'·167E.
54° 22'·620N., 18° 46'·193E.
54° 22'·612N., 18° 46'·009E.
54° 23'·656N., 18° 45'·103E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2637 — 2688

4500(T)/25 POLAND - Measuring instruments.

Source: Polish Notices 24/267(T)/25 and 25/280(T)/25

1. Measuring instruments have been established on the seabed in the following positions:

Position

54° 31'·83N., 15° 06'·45E.
54° 29'·38N., 15° 09'·00E.
54° 31'·81N., 15° 12'·46E.
54° 34'·68N., 15° 18'·16E.
54° 33'·21N., 15° 19'·03E.
54° 30'·48N., 15° 16'·48E.
54° 28'·05N., 15° 11'·63E.
54° 26'·38N., 15° 18'·40E.
54° 28'·99N., 15° 21'·18E.
54° 26'·45N., 15° 08'·47E.
54° 24'·95N., 15° 13'·68E.
54° 23'·00N., 15° 08'·94E.
54° 24'·50N., 15° 04'·91E.
54° 30'·22N., 15° 01'·78E.
54° 28'·20N., 15° 05'·51E.
54° 26'·13N., 15° 03'·65E.
54° 38'·86N., 15° 35'·96E.
54° 26'·64N., 15° 40'·11E.
54° 19'·78N., 15° 07'·66E.
54° 33'·59N., 15° 04'·07E.
54° 19'·62N., 15° 24'·10E.
54° 27'·14N., 14° 59'·14E.
54° 27'·84N., 14° 47'·73E.

2. and

54° 35'·19N., 14° 45'·19E.
54° 22'·48N., 15° 07'·61E.
54° 30'·07N., 15° 10'·37E.
54° 26'·22N., 15° 18'·77E.
54° 26'·54N., 14° 59'·53E.

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2014 — 2015 — 2816

4558(T)/25 SWEDEN - South Coast - Works.

Source: Swedish Notice 1086/19491(T)/25

1. Work is currently underway in the canal Falsterbokanalen, in the vicinity of position 55° 24'·29N., 12° 56'·34E., by the works vessel, Fyrbjörn.
2. It is possible to pass through the canal, but the works may result in limited access due to reduced navigable width.
3. Mariners are advised to navigate with caution through the canal.
(WGS84 DATUM)

Chart affected — 2595

4586(T)/25 SWEDEN - East Coast - Maximum authorised draughts.

Source: Swedish Notices 1081/19471/25, 1082/19510/25 and 1086/19587/25

- Maximum permissible draughts have been reduced in the Port of Visby, until further notice as follows:

<i>Location</i>	<i>Maximum permissible draught reduced to</i>	<i>In the vicinity of position</i>
*Yttre hamnen	7·0m	57° 38'·100N., 18° 16'·600E.
*Inre hamnen	6·1m	57° 38'·230N., 18° 16'·910E.
*Oil quay "Oljekaj"	6·5m	57° 38'·020N., 18° 16'·422E.
*Quay 1	4·9m	57° 38'·189N., 18° 17'·061E.
*Quay 2	4·9m	57° 38'·229N., 18° 17'·164E.
*Quay 4	6·0m	57° 38'·312N., 18° 17'·081E.
*RoRo quay 7	6·5m	57° 37'·944N., 18° 16'·565E.
*Quay 10	4·9m	57° 38'·260N., 18° 17'·097E.
Swept area at quay 14	9·25m	57° 37'·750N., 18° 16'·050E.
*Quay 14	8·7m	57° 37'·779N., 18° 16'·014E.
Swept area at quay 15	8·7m	57° 37'·810N., 18° 16'·090E.
*Quay 15	8·5m	57° 37'·793N., 18° 16'·023E.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- *Former Notice 4095(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 798**4613(T)/25 POLAND - Buoyage.**

Source: Polish Notice 29/328(T)/25

- Yellow conical light-buoys, *Fl.Y.4s*, have been established in the following positions:

Position
 54° 23'·500N., 18° 43'·550E.
 54° 23'·400N., 18° 43'·933E.
 54° 23'·350N., 18° 44'·083E.
 Former Notice 4199(T)/25 is cancelled.
 (WGS84 DATUM)

Chart affected — 2637**4650(T)/25 FINLAND - South Coast - Dredged area. Works. Lights.**

Source: Finnish Notice 24/197(T)/25

- Dredging works are taking place in the area off Sompasaari Sumparn in the vicinity of position 60° 10'·5N., 24° 58'·5E.
- The area is partially enclosed by a floating boom with signal lights.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2218 — 3818

4656(T)/25 POLAND - Buoyage.

Source: Polish Notices 31/347(T)/25 and 36/407(T)/25

1. The following special light-buoys, *Fl. Y.2s*, have been established:

<i>Designation</i>	<i>Position</i>
<i>FS6</i>	54° 23'·27N., 18° 46'·18E.
<i>FS7</i>	54° 22'·91N., 18° 46'·19E.
<i>FS8</i>	54° 22'·62N., 18° 46'·20E.
<i>FS9</i>	54° 22'·61N., 18° 46'·00E.
<i>FS10</i>	54° 23'·03N., 18° 45'·95E.
<i>FS11</i>	54° 23'·46N., 18° 45'·89E.
<i>FS12</i>	54° 23'·54N., 18° 45'·45E.
<i>WK1</i>	54° 22'·63N., 18° 46'·08E.
<i>WK2</i>	54° 22'·63N., 18° 46'·17E.
<i>WK3</i>	54° 22'·58N., 18° 46'·17E.
<i>WK4</i>	54° 22'·58N., 18° 46'·08E.

2. The following unlit special buoys have been established:

<i>Designation</i>	<i>Position</i>
<i>MR1</i>	54° 23'·25N., 18° 45'·76E.
<i>MR2</i>	54° 23'·25N., 18° 45'·40E.
<i>MR3</i>	54° 23'·71N., 18° 44'·28E.
<i>MR4</i>	54° 24'·43N., 18° 44'·97E.
<i>MR5</i>	54° 24'·54N., 18° 45'·28E.
<i>MR6</i>	54° 24'·63N., 18° 45'·61E.
<i>MR7</i>	54° 24'·66N., 18° 45'·95E.
<i>MR8</i>	54° 24'·25N., 18° 46'·69E.
<i>MR9</i>	54° 24'·08N., 18° 46'·92E.
<i>MR11</i>	54° 23'·89N., 18° 47'·10E.
<i>MR12</i>	54° 23'·69N., 18° 46'·96E.
<i>MR13</i>	54° 23'·39N., 18° 46'·42E.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2637 — 2688**4681(P)/25 DENMARK - Islands - Depths.**

Source: Danish Chart 103

1. Recent survey information has shown that numerous depths less than charted exist between Elsehoved and Kalundborg.
The most significant are as follows:

<i>Depth</i>	<i>Position</i>
13·6m	55° 11'·24N., 10° 54'·89E.
12·3m	55° 12'·13N., 10° 55'·95E.
7·9m	55° 18'·43N., 11° 07'·14E.
17·1m	55° 26'·60N., 11° 00'·53E.
10·9m	55° 32'·87N., 10° 53'·09E.
6·5m	55° 33'·49N., 10° 34'·56E.
11·7m	55° 34'·64N., 10° 31'·15E.
7·9m	55° 38'·59N., 10° 50'·82E.
7·5m	55° 38'·49N., 10° 36'·17E.

2. Mariners are advised to navigate with caution in the area.
3. These and other changes will be included in the next New Edition of Chart 2106.
(WGS84 DATUM)

Chart affected — 2106

4683(P)/25 DENMARK - Islands - Depths. Wrecks.

Source: Danish Chart 141

1. A recent hydrographic survey has shown that numerous depths less than charted exist in the vicinity of Korsør and Samso. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
7·9m	55° 18'·43N., 11° 07'·14E.
7·4m	55° 22'·66N., 11° 04'·81E.
23·5m	55° 32'·66N., 10° 48'·21E.
10·9m	55° 32'·87N., 10° 53'·09E.
15·7m	55° 33'·46N., 10° 54'·16E.
10·8m	55° 33'·55N., 10° 42'·98E.
6·5m	55° 33'·49N., 10° 34'·56E.
12·6m	55° 34'·19N., 10° 32'·95E.
22m	55° 34'·47N., 10° 54'·20E.
7·9m	55° 35'·55N., 10° 42'·95E.
7·5m	55° 38'·49N., 10° 36'·17E.
19·7m	55° 38'·09N., 10° 42'·04E.
7·9m	55° 38'·59N., 10° 50'·82E.
4·6m	55° 45'·27N., 10° 56'·94E.
13·6m	55° 49'·02N., 10° 50'·99E.
15m	55° 49'·52N., 11° 01'·39E.

2. A wreck with depth 21m exists in position 55° 31'·08N., 10° 49'·66E.
3. A wreck with depth 20·1m exists in position 55° 48'·10N., 10° 53'·76E.
4. Mariners are advised to navigate with caution in the area.
5. These and other changes will be included in the next New Edition of Chart 2596.
(WGS84 DATUM)

Chart affected — 2596**4685(P)/25 DENMARK - Islands - Depths.**

Source: Danish Chart 128

1. A recent hydrographic survey has shown that numerous depths less than charted exist within the vicinity of Samsø Bælt and Route T. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
16·5m	56° 20'·71N., 11° 21'·66E.
18·3m	56° 20'·06N., 11° 07'·96E.
19·7m	56° 16'·61N., 11° 07'·98E.
19·2m	56° 09'·93N., 11° 26'·62E.
11·6m	56° 02'·95N., 11° 12'·27E.
5·9m	56° 02'·85N., 11° 14'·30E.
24m	55° 53'·96N., 10° 59'·29E.
5·4m	55° 50'·85N., 11° 04'·60E.
11·3m	55° 50'·20N., 10° 52'·53E.
8·3m	56° 05'·26N., 10° 47'·19E.
9·9m	56° 18'·59N., 11° 17'·00E.

2. Mariners are advised to navigate with caution in the area.
3. These and other changes will be included in the next New Edition of Chart 2589.
(WGS84 DATUM)

Chart affected — 2589

4688(P)/25 DENMARK - Islands - Depths.

Source: Danish Chart 112

1. A recent hydrographic survey has shown that numerous depths less than charted exist in the vicinity of Samsø Bælt and Hjelm Banke. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
8·2m	56° 06'·69N., 10° 49'·16E.
7·4m	56° 06'·30N., 10° 48'·59E.
8·3m	56° 05'·26N., 10° 47'·19E.
12·1m	56° 05'·71N., 10° 50'·45E.
15·7m	56° 05'·03N., 10° 47'·20E.
10·8m	56° 04'·15N., 10° 48'·75E.
20·3m	56° 04'·05N., 10° 47'·47E.
11·3m	55° 50'·20N., 10° 52'·53E.
13·6m	55° 49'·04N., 10° 50'·95E.
20·7m	56° 06'·16N., 10° 47'·87E.

2. Mariners are advised to navigate with caution in the area.
3. These and other changes will be included in the next New Edition of Chart 2590.
(WGS84 DATUM)

Chart affected — 2590**4695(P)/25 DENMARK - Islands - Depths. Wrecks.**

Source: Danish Chart 102

1. A recent hydrographic survey has shown that numerous depths less than charted exist in the vicinity of Samsø Bælt and Route T. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
14·9m	56° 26'·10N., 11° 20'·30E.
24m	56° 25'·27N., 11° 18'·33E.
18·1m	56° 23'·11N., 11° 26'·70E.
19·9m	56° 21'·34N., 11° 16'·05E.
18·3m	56° 20'·07N., 11° 07'·89E.
11·4m	56° 17'·05N., 11° 14'·65E.
19·2m	56° 09'·96N., 11° 26'·62E.
7·9m	55° 53'·76N., 10° 57'·44E.
11·3m	55° 50'·20N., 10° 52'·44E.
5·4m	55° 50'·85N., 11° 04'·62E.

2. New wrecks have been identified, and existing wrecks have been amended. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
25m	56° 30'·05N., 11° 42'·03E.
22m	56° 17'·64N., 11° 08'·67E.
Non dangerous wreck	56° 04'·00N., 11° 09'·80E.
15·2m	56° 01'·93N., 11° 10'·17E.
17·7m	55° 49'·03N., 10° 54'·13E.
13·2m	56° 03'·73N., 11° 10'·83E.

3. Mariners are advised to navigate with caution in the area.
4. These and other changes will be included in the next New Edition of Chart 2108.
(WGS84 DATUM)

Chart affected — 2108**4696(T)/25 SWEDEN - East Coast - Works. Berths.**

Source: Swedish Notice 1087/19601(T)/25

1. Works, including diving operations, are taking place at berths 10 and 11, in the vicinity of position
57° 38'·26N., 18° 17'·06E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 798

4698(T)/25 SWEDEN - East Coast - Fairway.

Source: 1087/19343(T)/25

1. The fairway through the lock 'Hammarbyslussen', in the vicinity of 59° 18'·20N., 18° 04'·74E., will be closed between 14th November 2025 and 12th December 2025 for all maritime traffic.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 811 — 820**4699(T)/25 SWEDEN - West Coast - Works. Berths.**

Source: Swedish Notice 1087/19611(T)/25

1. Works, including diving operations, are taking place at berths 60-63 in Frölandshamnen, and within the following area:
58° 20'·306N., 11° 52'·217E.
58° 20'·273N., 11° 52'·258E.
58° 20'·117N., 11° 51'·832E.
58° 20'·159N., 11° 51'·769E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 869**4700(T)/25 SWEDEN - West Coast - Buoy.**

Source: Swedish Notice 1087/19583(T)/25

1. The special purpose light buoy, *Fl(5) Y 20s ODAS*, in position 57° 39'·071N., 11° 43'·703E., has been temporarily withdrawn.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 857 — 858**4706(T)/25 POLAND - Measuring instruments.**

Source: Polish Notice 34/388(T)/25

1. * Measuring instruments have been established on the seabed in the following positions:

54° 50'·70N., 17° 24'·79E.
 54° 45'·59N., 17° 14'·74E.
 54° 47'·51N., 17° 31'·03E.
 54° 49'·48N., 17° 09'·17E.
 54° 41'·23N., 17° 01'·12E.
 55° 05'·63N., 17° 11'·29E.
 55° 02'·00N., 17° 00'·31E.
 55° 06'·13N., 17° 00'·29E.
 55° 03'·60N., 17° 30'·01E.
 55° 05'·28N., 17° 24'·43E.
 55° 03'·09N., 17° 18'·05E.
 55° 14'·72N., 16° 46'·09E.
 55° 12'·58N., 17° 47'·07E.
 55° 15'·78N., 17° 39'·49E.
 55° 17'·15N., 17° 02'·88E.
 * 55° 12'·93N., 17° 30'·05E.
 * 55° 16'·70N., 17° 15'·96E.

2. Mariners are advised to navigate with caution in the area.
3. * Former Notice 4913(T)/24 is cancelled.
* Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040

4711(P)/25 POLAND - Quay. Works. Depths.

Source: ENC PL5SWINO

- Changes to charted detail have taken place within the port of Świnoujście.
- Quay construction works have been completed. The extended quay now joins the following positions:

53° 53'·33N., 14° 16'·72E.
 53° 53'·32N., 14° 16'·71E.
 53° 53'·56N., 14° 16'·12E.
 53° 53'·57N., 14° 16'·13E.

- Depths less than charted exist. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
14·2m	53° 54'·89N., 14° 16'·77E.
5·8m	53° 54'·58N., 14° 16'·06E.
3·8m	53° 52'·71N., 14° 16'·84E.
3·4m	53° 52'·58N., 14° 16'·88E.
12·4m	53° 52'·46N., 14° 16'·50E.
12·2m	53° 52'·03N., 14° 16'·61E.
5·2m	53° 51'·99N., 14° 16'·88E.
5·7m	53° 51'·89N., 14° 16'·81E.
12·2m	53° 51'·82N., 14° 16'·71E.

- Mariners are advised to navigate with caution in the area and consult the local port authority for the latest information.
- These and other changes will be included in the next New Editions of Charts 2453 and 2677.
(WGS84 DATUM)

Chart affected — 2677**4804(T)/25 SWEDEN - East Coast - Buoy. Automatic Identification System.**

Source: Swedish Notice 1087/19584(T)/25

- The special purpose light buoy, *Fl(5) Y 20s*, and associated *AIS* in position 58° 46'·14N., 17° 47'·32E., has been temporarily withdrawn.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 864**4999(T)/25 RUSSIA - Baltic Sea Coast - Works.**

Source: Russian Notice 38/3988(T)/25

- Underwater technical works are taking place, within an area bounded by the coastline and the following positions:

59° 57'·54N., 30° 12'·74E.
 59° 57'·85N., 30° 12'·47E.
 59° 58'·47N., 30° 11'·85E.
 59° 58'·49N., 30° 11'·83E.
 59° 58'·50N., 30° 11'·82E.
 59° 58'·93N., 30° 11'·43E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2364 — 2395**5032(T)/25 SWEDEN - East Coast - Works. Horizontal clearance. Bridge. Fairway.**

Source: Swedish Notice 1089/19344(T)/25

- Maintenance works are taking place at Danviksbron Bridge, in position 59° 18'·82N., 18° 06'·28E.
- *The horizontal clearance of the fairway at the bridge is limited to 17m.

5032(T)/25 SWEDEN - East Coast - Works. Horizontal clearance. Bridge. Fairway. (continued)

3. *Restrictions are as follows:

Duration

October 31st 2025, 00:00 – November 13th 2025, 24:00

November 14th 2025, 00:00 – December 12th 2025, 24:00

December 13th 2025, 00:00 – December 23rd 2025, 24:00

December 24th 2025, 00:00 – April 26th 2026, 24:00

Details

Partial closure with non-operable bridge

Full closure, fairway completely closed

Partial closure with non-operable bridge

Partial closure

4. Mariners are advised to navigate with caution in the area.

5. *Former Notice 5288(T)/24 is cancelled.

*Indicates new or revised entry

(WGS84 DATUM)

Chart affected — 811

5107(T)/25 DENMARK - Islands - Works.

Source: Danish Notice 38/770(T)/25

1. Geophysical survey works are taking place at Østbroen (East Bridge), within an area bounded by the following positions:

55° 20'·31N., 10° 59'·51E.

55° 21'·09N., 11° 05'·63E.

55° 20'·79N., 11° 05'·51E.

55° 20'·01N., 10° 59'·62E.

2. All vessels conducting the works can be contacted on VHF Channel 16.

3. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Charts affected — 938 — 2106 — 2596

5109(T)/25 FINLAND - South Coast - Fairway. Works.

Source: Finnish Notice 27/211(T)/25

1. Geotechnical seabed surveys are taking place in the fairway in the approaches to Valko, within an area bounded by the following positions:

60° 24'·18N., 26° 17'·36E.

60° 22'·96N., 26° 17'·68E.

60° 19'·64N., 26° 20'·63E.

60° 19'·13N., 26° 21'·62E.

60° 18'·72N., 26° 20'·50E.

60° 19'·33N., 26° 19'·69E.

60° 22'·61N., 26° 16'·87E.

60° 24'·09N., 26° 16'·47E.

2. Vessels are advised to navigate with caution in the area and are requested to reduce their speed when approaching and passing the works vessels.

(WGS84 DATUM)

Charts affected — 2256 — 2263 — 3814

5181(P)/25 LITHUANIA - Quay. Works. Restricted area. Dredging area. Depths.

Source: Lithuanian Chart 660710, ENC LT660710 and Lithuanian Notices 8/127(P)/25, 8/129(P)/25, 9/138(P)/25 and 9/143(P)/25

1. Numerous changes to charted detail have taken place within the port of Klaipeda.

5181(P)/25 LITHUANIA - Quay. Works. Restricted area. Dredging area. Depths. (continued)

2. Quay extension works are taking place, joining the following positions:

55° 42'·49N., 21° 07'·39E.
 55° 42'·45N., 21° 07'·28E.
 55° 42'·41N., 21° 07'·31E.
 55° 42'·41N., 21° 07'·30E.
 55° 42'·40N., 21° 07'·27E.
 55° 42'·40N., 21° 07'·26E.
 55° 42'·58N., 21° 07'·14E.
 55° 42'·59N., 21° 07'·18E.
 55° 42'·59N., 21° 07'·19E.
 55° 42'·49N., 21° 07'·31E.

3. A restricted area has been established in the vicinity of the works, within which construction and dredging are taking place, bounded by the following positions:

55° 42'·48N., 21° 07'·40E.
 55° 42'·44N., 21° 07'·31E.
 55° 42'·41N., 21° 07'·33E.
 55° 42'·38N., 21° 07'·25E.
 55° 42'·33N., 21° 07'·22E.
 55° 42'·46N., 21° 07'·11E.
 55° 42'·61N., 21° 07'·03E.
 55° 42'·59N., 21° 07'·11E.
 55° 42'·60N., 21° 07'·15E.
 55° 42'·59N., 21° 07'·16E.

4. *Dredging and construction works are taking place within an area bounded by the following positions:

55° 39'·47N., 21° 08'·66E.
 55° 39'·47N., 21° 08'·63E.
 55° 39'·46N., 21° 08'·63E.
 55° 39'·45N., 21° 08'·59E.
 55° 39'·66N., 21° 08'·54E.
 55° 39'·68N., 21° 08'·57E.
 55° 39'·69N., 21° 08'·61E.
 55° 39'·66N., 21° 08'·61E.

5. Depths less than charted exist. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
16m	55° 43'·67N., 21° 05'·34E.
13·4m	55° 43'·39N., 21° 06'·13E.
14·2m	55° 43'·31N., 21° 06'·29E.
10·6m	55° 42'·66N., 21° 07'·01E.
11·8m	55° 41'·37N., 21° 08'·08E.
11·7m	55° 41'·33N., 21° 08'·12E.
13·5m	55° 41'·04N., 21° 08'·28E.
13·5m	55° 40'·89N., 21° 08'·45E.
14·2m	55° 40'·19N., 21° 08'·76E.
14·5m	55° 40'·07N., 21° 08'·79E.
14·4m	55° 39'·89N., 21° 08'·85E.
10·9m	55° 39'·00N., 21° 09'·35E.

6. Mariners are advised to navigate with caution in the area and consult the local port authority for the latest information.

7. *These and other changes will be included in a New Edition of Chart 2276 to be published early 2026.

8. *Former Notice 4589(P)/25 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 2276

5245(T)/25 SWEDEN - West Coast - Maximum authorised draught.

Source: Swedish Notice 1091/19677/25

1. The maximum recommended draft for vessels accessing the Port of Landskrona, 55° 51'·6N., 12° 49'·6E., is reduced, and vessels bound for the quays will be assigned new maximum drafts.

5245(T)/25 SWEDEN - West Coast - Maximum authorised draught. (continued)

- For information on currently valid guidelines and restrictions, please visit: <https://www.sjofartsverket.se/en/services/pilotage/malmoe-pilot-area/recommendations-and-restrictions/>
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 876**5342(P)/25 FINLAND - West Coast - Fairways. Swept area. Buoyage.**

Source: Finnish Notices 29/222-223/25 and 29/227/25

- Significant changes to fairways, swept depths and buoyage have taken place within and in the approaches to the port of Vaasa 63° 05'·23N., 21° 33'·10E.
- The fairway has been widened and lateral buoyage marking the channel has been moved accordingly.
- Mariners are advised to navigate with caution in the area and contact the local port authority for the latest information.
- Former Notice 1029(T)/25 is cancelled. (WGS84 DATUM)

Charts affected — 2612 — 3839**5349(T)/25 SWEDEN - East Coast - Maximum authorised draught. Quays. Depth.**

Source: Swedish Notice 1092/19646/25

- The maximum recommended draft for vessels accessing Storugns harbour, 57° 50'·57N., 18° 48'·00E., is reduced, and vessels bound for the quays will be assigned a new maximum draft of 5·8m.
- For information on currently valid guidelines and restrictions, please visit: <https://www.sjofartsverket.se/en/services/pilotage/Pilot-area-Kalmar/Guideline-values-and-restrictions/>
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 798**5379(P)/25 SWEDEN - West Coast - Wreck.**

Source: : Swedish Chart 9331

- A dangerous wreck exists in position 58° 14'·30N., 11° 25'·05E. (WGS84 DATUM)

Charts affected — 853 — 869**5423(P)/25 POLAND - Works. Dredging area. Depths. Buoyage. Lights.**

Source: Polish Notice 36/408/25

- Terminal construction works have been completed in the vicinity of position 54° 23'·052N., 18° 43'·584E.
- Dredging works have been undertaken to the east of the Deepwater Container Terminal Gdańsk, within the area bounded by the following positions:
 - 54° 23'·432N., 18° 43'·831E.
 - 54° 23'·384N., 18° 43'·794E.
 - 54° 23'·228N., 18° 44'·115E.
 - 54° 23'·201N., 18° 44'·124E.
 - 54° 23'·108N., 18° 44'·011E.
 - 54° 22'·827N., 18° 43'·586E.
 - 54° 22'·757N., 18° 43'·728E.
 - 54° 22'·929N., 18° 44'·346E.
 - 54° 22'·938N., 18° 44'·413E.
 - 54° 22'·920N., 18° 44'·426E.
 - 54° 23'·020N., 18° 44'·777E.
 - 54° 23'·055N., 18° 44'·759E.
 - 54° 23'·125N., 18° 44'·503E.
 - 54° 23'·304N., 18° 44'·337E.
- The area is now significantly deeper with no depths shoaler than 15·6m.

5423(P)/25 POLAND - Works. Dredging area. Depths. Buoyage. Lights. (continued)

4. The following light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.R.3s</i>	<i>GTC-10</i>	Port hand lateral buoy	54° 23'·540N., 18° 43'·538E.
<i>Fl.R.3s</i>	<i>GTC-8</i>	Port hand lateral buoy	54° 23'·419N., 18° 43'·987E.
<i>Fl.G.3s</i>	<i>GTC-7</i>	Starboard hand lateral buoy	54° 23'·517N., 18° 44'·064E.
<i>Fl.Y.3s</i>	<i>F-5</i>	Special buoy	54° 23'·084N., 18° 44'·884E.
<i>Q</i>	<i>BH</i>	North cardinal buoy	54° 22'·765N., 18° 43'·736E.

5. The light, Fl.Y.6s7m3M, in position 54° 23'·218N., 18° 43'·499E. has been withdrawn.

6. Lights have been established in the following positions:

<i>Characteristic</i>	<i>Position</i>
Fl.Y.2s1M	54° 23'·135N., 18° 43'·958E.
Fl.Y.2s1M	54° 23'·113N., 18° 44'·016E.
Fl.Y.2s1M	54° 22'·823N., 18° 43'·579E.

7. These changes will be included in a New Edition of Chart 2637 to be published early 2026.

8. Chart 2688 will be updated by Notice to Mariners.

9. Former Notice 4318(T)/25 is cancelled.
(WGS84 DATUM)

Chart affected — 2637

5468(P)/25 LITHUANIA - Submarine cable. Works. Buoyage.

Source: Lithuanian Nav warning 78/25 and ENC LT660710

1. Submarine cable laying works are taking place, joining the following positions:

55° 39'·745N., 21° 08'·185E.
55° 39'·575N., 21° 08'·088E.
55° 39'·294N., 21° 08'·101E.
55° 38'·540N., 21° 08'·871E.

2. Special light buoys, *F.R.*, have been established along the cable.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

4. Chart 2276 will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 2276

5536(T)/25 SWEDEN - West Coast - Works. Dredging area. Floodlight. Buoyage. Swept area.

Source: Swedish Notices 1083/19339(T)/25 and 1093/19715(T)/25

1. Dredging works are taking place in the entrance to the Port of Falkenberg in an area bounded by the following positions:

56° 52'·904N., 12° 27'·794E.
56° 53'·377N., 12° 28'·421E.
56° 53'·276N., 12° 28'·707E.
56° 52'·812N., 12° 28'·030E.

2. *The floodlight, in position 56° 53'·034N., 12° 28'·170E. has been extinguished.

3. The buoyage in the entrance, marking the 7m swept area, may be temporarily moved during this time.

4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

5. *Former Notice 4289(T)/25 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 874

5569(T)/25 SWEDEN - East Coast - Breakwater. Works.

Source: Swedish Notice 1094/19723(T)/25

1. Breakwater extension works are taking place in Kastellholmen in the vicinity of position 59° 19'·39N., 18° 05'·43E.

5569(T)/25 SWEDEN - East Coast - Breakwater. Works. (continued)

- Mariners are advised to navigate with caution in the area and consult the local port authorities on VHF channel 73 or 16 and phone +46 (0) 72 533 3437 for the latest information.
(WGS84 DATUM)

Charts affected — 811 — 820

5587(T)/25 SWEDEN - South Coast - Measuring instruments.

Source: Swedish Notice 1094/19730(T)/25

- Measuring instruments have been established on the seabed in the following positions:

55° 24'·60N., 12° 44'·53E.
 55° 20'·73N., 12° 45'·54E.
 55° 21'·90N., 13° 46'·47E.
 55° 05'·87N., 13° 42'·58E.
 55° 08'·26N., 13° 57'·66E.
 55° 25'·77N., 14° 16'·61E.
 55° 32'·51N., 14° 29'·53E.
 55° 43'·23N., 14° 15'·58E.
 55° 50'·57N., 14° 27'·50E.
 55° 54'·77N., 14° 31'·70E.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 259 — 958 — 2014 — 2015 — 2018 — 2115 — 2595 — 2816 — 2856

5594(T)/25 POLAND - Works.

Source: Polish Notice 42/464(T)/25

- Geophysical works are taking place in the area bounded by the following positions:

54° 48'·04N., 17° 45'·18E.
 54° 51'·26N., 17° 42'·77E.
 54° 52'·28N., 17° 48'·95E.
 54° 48'·78N., 17° 50'·33E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2014 — 2018 — 2040

5667(P)/25 DENMARK - Islands - Works. Buoyage. Depths. Coastline. Light. Restricted area.

Source: Danish Notices 42/853/25, 44/898/25, 46/929/25, 47/954/25, 47/961/25, 48/985/25 and ENC DK5RONNE

- Significant changes to depths, aids to navigation and coastline are taking place within the port of Rønne.
- *An entry prohibited limit marked by seven unlit spar buoys, seven lit spar buoys, *Fl(3)Y.30s* and a starboard hand spar buoy, *Q.G* have all been deleted, along the following bounded positions:

55° 05'·487N., 14° 40'·693E.
 55° 05'·532N., 14° 40'·786E.
 55° 05'·559N., 14° 40'·778E.
 55° 05'·681N., 14° 40'·581E.
 55° 05'·674N., 14° 40'·493E.
 55° 05'·645N., 14° 40'·439E.

- *The extension of the outer mole has been completed joining the following positions:

55° 05'·526N., 14° 40'·758E.
 55° 05'·659N., 14° 40'·545E.

- *A light, *Fl(1+4)G.5s* has been established in position 55° 05'·653N., 14° 40'·556E.

- *Work has now been completed, and moles have been removed in the following positions:

55° 05'·797N., 14° 41'·316E.
 55° 05'·830N., 14° 41'·228E.

and

*55° 05'·670N., 14° 41'·237E.

5667(P)/25 DENMARK - Islands - Works. Buoyage. Depths. Coastline. Light. Restricted area. (continued)

*55° 05'·702N., 14° 41'·188E.

6. *Several lit and unlit buoys have been deleted in the following positions:

<i>Characteristic</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl(3)Y.10s</i>	spar buoy, with x-shape topmark	55° 05'·544N., 14° 41'·048E.
Unlit	spar buoy, with x-shape topmark	55° 05'·538N., 14° 41'·090E.
Unlit	spar buoy, with x-shape topmark	55° 05'·531N., 14° 41'·130E.
<i>Fl.R.5s</i>	spar buoy, with cylinder topmark	55° 05'·516N., 14° 41'·217E.
<i>Q.G</i>	spar buoy, with cone point up topmark	55° 05'·694N., 14° 41'·163E.
<i>Fl(3)Y.10s</i>	spar buoy, with x-shape topmark	55° 05'·711N., 14° 41'·200E.
<i>Q.R</i>	can buoy	55° 05'·750N., 14° 41'·110E.

7. *Mariners are advised to navigate with caution in the area as extensive changes have taken place and consult the local port authority for the latest information.
8. *The chart will be updated when full details are known.
9. *Former Notices 3200(P)/25 and 4940(P)/25 are cancelled.
(WGS84 DATUM)

Chart affected — 958

5677(P)/25 ESTONIA - Buoyage. Depths. Harbour limits. Light. Rock. Obstructions.

Source: Estonian Charts 930 and 931

1. Extensive changes have taken place within the approaches to the ports of Tallinn and Vanasadam. The most significant of these are listed below:
2. East Cardinal buoys have been established in the following positions:

<i>Position</i>
59° 27'·04N., 24° 44'·94E.
59° 26'·92N., 24° 45'·01E.

3. Depths less than charted exist within the ports of Tallinn and Vanasadam. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
5m	59° 29'·43N., 24° 42'·65E.
2·3m	59° 28'·21N., 24° 41'·14E.
2·8m	59° 26'·638N., 24° 45'·807E.
7·9m	59° 26'·663N., 24° 46'·336E.
8·6m	59° 26'·731N., 24° 46'·434E.

4. The following harbour limits have been established:

<i>Name</i>	<i>Position</i>
Noblessner	59° 27'·18N., 24° 44'·10E.
	59° 27'·33N., 24° 44'·17E.
	59° 27'·51N., 24° 44'·30E.
	59° 27'·54N., 24° 44'·09E.

5. and

<i>Name</i>	<i>Position</i>
Lennusadam	59° 27'·11N., 24° 44'·42E.
	59° 27'·40N., 24° 44'·60E.
	59° 27'·51N., 24° 44'·30E.

6. The following light has been amended:

<i>Former Characteristic</i>	<i>New Characteristic</i>	<i>Position</i>
Fl.7s7m3M	Fl.7s7m2M	59° 27'·60N., 24° 43'·13E.

7. A rock, depth 23·2m, exists in position 59° 27'·88N., 24° 47'·39E.
8. Obstructions exists in the following positions:

<i>Depth</i>	<i>Position</i>
17·4m	59° 27'·34N., 24° 47'·09E.
7·2m	59° 28'·40N., 24° 44'·07E.
11·6m	59° 28'·37N., 24° 44'·21E.

9. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

5677(P)/25 ESTONIA - Buoyage. Depths. Harbour limits. Light. Rock. Obstructions. (continued)

10. These changes will be included in a New Edition of Chart 2227 to be published early 2026.
(WGS84 DATUM)

Chart affected — 2227

5792(T)/25 POLAND - Measuring instruments.

Source: Polish Notices 26/321(T)/25 and 36/410(T)/25

1. Measuring instruments have been established on the seabed in the following positions:

Position

54° 53'·01N., 16° 46'·08E.

54° 58'·68N., 16° 32'·64E.

55° 03'·21N., 16° 52'·36E.

55° 06'·50N., 16° 55'·69E.

55° 06'·79N., 16° 47'·77E.

55° 17'·54N., 17° 06'·13E.

*55° 07'·78N., 16° 56'·41E.


2. Mariners are advised to navigate with caution in the area.

3. *Former Notice 4333(T)/25 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 2014 — 2018

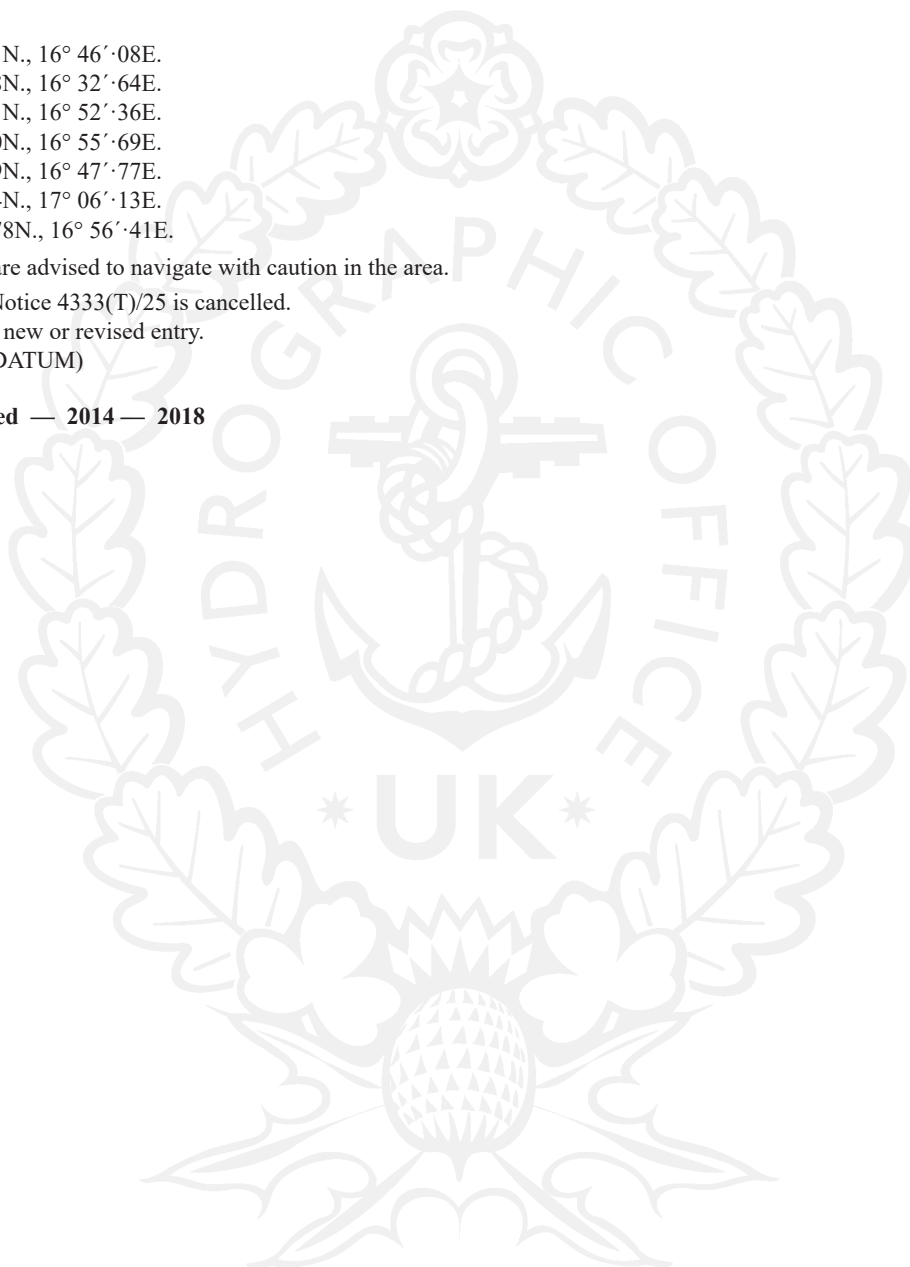

(5) NORTH SEA AND NORTH AND WEST COASTS OF
DENMARK, GERMANY, NETHERLANDS AND BELGIUM

419(P)/23 NETHERLANDS - Submarine power cable.

Source: Netherlands Notice 50/421(P)/18 and UKHO

1. A submarine power cable has been laid, joining the following positions:

53° 26'·58N., 6° 52'·38E.
 53° 27'·09N., 6° 52'·75E.
 53° 29'·84N., 6° 42'·62E.
 53° 32'·70N., 6° 39'·37E.
 53° 36'·22N., 6° 33'·39E.
 53° 36'·51N., 6° 28'·76E.
 53° 42'·71N., 6° 33'·10E.
 53° 54'·83N., 6° 28'·82E.
 53° 57'·92N., 6° 24'·78E.
 54° 13'·34N., 6° 25'·10E.
 54° 31'·09N., 6° 31'·32E.
 54° 48'·65N., 7° 02'·98E.
 54° 49'·14N., 7° 08'·03E.
 55° 10'·77N., 7° 52'·16E.
 55° 23'·06N., 8° 24'·28E.

2. Charts will be updated when full details are available.
3. *Former Notice 1049(P)/20 is cancelled.
4. *NOTE: Content of Notice unchanged, re-issued to include Chart 5614_25
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 2182B — 5614_25

1520(P)/23 NORTH SEA - United Kingdom Sector - Works. Wind farm. Buoyage. Restricted area. Submarine cable.

Source: Specialist Marine Consultants Ltd

1. * Construction of the Dogger Bank B Offshore Wind Farm has commenced. The main Wind Farm Array work area is marked by light-buoys as follows:

<i>Buoy Type</i>	<i>Designation</i>	<i>Light Characteristic</i>	<i>Position</i>
North Cardinal	<i>N1</i>	<i>Q</i>	55° 04'·82N., 1° 31'·46E.
North Cardinal	<i>N2</i>	<i>VQ</i>	55° 06'·29N., 1° 40'·49E.
North Cardinal	<i>N3</i>	<i>VQ</i>	55° 06'·39N., 1° 51'·77E.
East Cardinal	<i>E1</i>	<i>VQ(3)5s</i>	54° 52'·12N., 1° 52'·17E.
South Cardinal	<i>S1</i>	<i>VQ(6)+LFl.10s</i>	54° 51'·97N., 1° 28'·94E.
West Cardinal	<i>W1</i>	<i>VQ(9)10s</i>	55° 03'·90N., 1° 28'·96E.
West Cardinal	<i>W2</i>	<i>VQ(9)15s</i>	54° 53'·14N., 1° 27'·30E.
Special Mark	<i>SP1</i>	<i>Fl(4)Y.12s</i>	55° 05'·55N., 1° 35'·98E.
Special Mark	<i>SP2</i>	<i>Fl(4)Y.12s</i>	55° 06'·34N., 1° 46'·13E.
Special Mark	<i>SP3</i>	<i>Fl(4)Y.12s</i>	55° 03'·55N., 1° 51'·85E.
Special Mark	<i>SP4</i>	<i>Fl(4)Y.12s</i>	55° 00'·69N., 1° 51'·93E.
Special Mark	<i>SP5</i>	<i>Fl(4)Y.12s</i>	54° 57'·83N., 1° 52'·01E.
Special Mark	<i>SP6</i>	<i>Fl(4)Y.12s</i>	54° 54'·97N., 1° 52'·09E.
Special Mark	<i>SP7</i>	<i>Fl(4)Y.12s</i>	54° 51'·33N., 1° 50'·30E.
Special Mark	<i>SP8</i>	<i>Fl(4)Y.12s</i>	54° 51'·49N., 1° 44'·97E.
Special Mark	<i>SP9</i>	<i>Fl(4)Y.12s</i>	54° 51'·65N., 1° 39'·63E.
Special Mark	<i>SP10</i>	<i>Fl(4)Y.12s</i>	54° 51'·81N., 1° 34'·28E.
Special Mark	<i>SP11</i>	<i>Fl(4)Y.12s</i>	54° 55'·83N., 1° 27'·72E.
Special Mark	<i>SP12</i>	<i>Fl(4)Y.12s</i>	54° 58'·52N., 1° 28'·13E.
Special Mark	<i>SP13</i>	<i>Fl(4)Y.12s</i>	55° 01'·21N., 1° 28'·55E.

2. All vessels should navigate with caution in the area. A safety zone of 500 metres becomes operational around the turbines under construction.
3. Cable laying operations will be conducted between the new wind farm and Bridlington Bay (54° 00'·50N., 0° 11'·70W).
4. * These and other changes will be included in the next New Edition of Charts 266 and 1191 to be published mid 2023.

1520(P)/23 NORTH SEA - United Kingdom Sector - Works. Wind farm. Buoyage. Restricted area. Submarine cable. (continued)

5. * Charts 268, 5615_23, 2182A and 2182B will be updated by notice to mariners.
6. * Former Notice 115(P)/23 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 121 — 129 — 5614_25

2487(T)/23 NETHERLANDS - Restricted area.

Source: Netherlands Notice 26/201(T)/23

1. A restricted area, entry prohibited, has been established bounded by the following positions:

51° 58'·23N., 3° 59'·00E.
51° 58'·24N., 3° 59'·04E.
51° 58'·10N., 3° 59'·16E.
51° 58'·08N., 3° 59'·27E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 207

4461(P)/23 NORTH SEA - Submarine power cable.

Source: Netherlands Notice 44/332(P)/23

1. A submarine power cable is being laid between Wilhelmshaven and Isle of Grain, joining the following positions:

51° 27'·80N., 0° 42'·72E.
51° 36'·62N., 1° 20'·98E.
51° 47'·96N., 1° 36'·75E.
51° 47'·91N., 1° 52'·07E.
51° 51'·25N., 1° 53'·54E.
51° 54'·29N., 2° 05'·78E.
52° 00'·05N., 2° 10'·26E.
52° 06'·76N., 2° 33'·61E.
52° 20'·49N., 2° 35'·53E.
52° 23'·81N., 2° 46'·05E.
52° 55'·20N., 3° 11'·06E.
53° 30'·21N., 3° 29'·95E.
53° 39'·95N., 3° 59'·52E.
53° 38'·74N., 4° 12'·12E.
53° 46'·49N., 4° 59'·05E.
54° 02'·20N., 5° 27'·67E.
54° 06'·08N., 7° 09'·20E.
53° 55'·31N., 7° 12'·41E.
53° 50'·81N., 7° 22'·44E.
53° 52'·30N., 7° 33'·22E.
53° 49'·16N., 7° 49'·93E.
53° 50'·63N., 7° 52'·09E.
53° 47'·77N., 8° 05'·75E.
53° 38'·26N., 8° 05'·43E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 1406 — 1610 — 2182A — 2182B — 2692 — 4140 — 5606_5 — 5606_8 — 5607_1 — 5614_25 — DE 2 — DE 7 — DE 20 — DE 87 — DE 103

1171(T)/24 NORTH SEA - Norwegian Sector - Scientific instruments.

Source: Norwegian Notice 1/73647(T)/24

1. Scientific instruments have been established on the seabed in the following positions until January 2025:

61° 19'·10N., 2° 18'·79E.
 61° 18'·67N., 2° 15'·32E.
 61° 18'·46N., 2° 16'·99E.
 61° 18'·03N., 2° 21'·44E.
 61° 14'·35N., 2° 24'·24E.

2. Mariners should avoid fishing with bottom gear within a radius of 400m from the above positions.
(WGS84 DATUM)

Charts affected — 295 — 1427 — 2182D**2115(T)/24 NORTH SEA - Netherlands Sector - Buoyage.**

Source: Netherlands Notice 16/110(T)/2024

1. The following light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Q</i>	<i>PIPE-N1</i>	North cardinal	53° 12'·97N., 4° 43'·91E.
<i>Q(3)10s</i>	<i>PIPE-E1</i>	East cardinal	53° 12'·87N., 4° 44'·23E.
<i>Q(6)+LFl.15s</i>	<i>PIPE-S1</i>	South cardinal	53° 12'·54N., 4° 43'·95E.
<i>Q(9)15s</i>	<i>PIPE-W1</i>	West cardinal	53° 12'·65N., 4° 43'·64E.

2. Mariners are advised to navigate with caution.
(WGS84 DATUM)

Charts affected — 1408 — 1631 — 1632 — 1633**2121(T)/24 NORTH SEA - Netherlands Sector - Virtual aid to navigation.**

Source: Netherlands Notice 16/119(T)/2024

1. A virtual aid to navigation (V-AIS), isolated danger topmark, L08-16, has been established in position
53° 31'·98N., 4° 31'·01E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1408 — 1632 — 1633**2173(T)/24 NORTH SEA - Netherlands Sector - Virtual aid to navigation.**

Source: Netherlands Notice 27/195(T)/22

1. *A virtual aid to navigation (V-AIS), isolated danger topmark, has been established in the following position,
53° 30'·51N., 3° 50'·52E.
2. *Former Notice 3152(T)/22 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1408 — 1632 — 2182A — 5614_25**2544(P)/24 NORTH SEA - United Kingdom Sector - Submarine pipeline. Works.**

Source: Shell UK Ltd

1. Submarine pipeline laying operations are taking place, due for completion summer 2025, joining the following positions:

57° 01'·90N., 1° 57'·22E.
 57° 02'·05N., 1° 57'·71E.
 57° 02'·15N., 1° 58'·46E.
 57° 01'·97N., 1° 59'·24E.
 57° 00'·19N., 2° 02'·90E.
 56° 53'·95N., 2° 22'·68E.
 56° 54'·02N., 2° 22'·75E.

2. Mariners are advised to navigate with caution in the area.

2544(P)/24 NORTH SEA - United Kingdom Sector - Submarine pipeline. Works. (continued)

- Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 272 — 273 — 274 — 1405 — 2182B

2566(T)/24 NORTH SEA - United Kingdom Sector - Development area.

Source: Health and Safety Executive and Shell UK Limited

- As part of the Penguins Redevelopment Project, an offshore development area has been established bounded by the following positions:

61° 38'·05N., 1° 23'·41E.
 61° 40'·52N., 1° 29'·66E.
 61° 35'·05N., 1° 39'·06E.
 61° 30'·53N., 1° 41'·80E.
 61° 29'·28N., 1° 38'·63E.

- Vessels, subsea craft and divers may be working in the area. Other vessels are strongly advised to keep clear.
(WGS84 DATUM)

Charts affected — 295 — 1427 — 1428 — 2182D

2973(P)/24 NORTH SEA - Norwegian Sector - Works. Offshore installation. Precautionary area.

Source: Norwegian Notice 6/74233(P)/24

- Marine installation works are taking place in the Ekofisk oil field.
- A precautionary area has been established, joining the following positions:

56° 41'·95N., 3° 07'·02E.
 56° 33'·22N., 3° 18'·71E.
 56° 17'·91N., 3° 23'·95E.
 56° 17'·00N., 3° 24'·02E.
 56° 16'·48N., 3° 23'·83E.

- Mariners are advised to navigate with caution in the area and maintain a safe distance from the works.
(WGS84 DATUM)

Charts affected — 267 — 272 — 1405 — 1422 — 2182B — 4140 — 5615_23

3454(T)/24 NETHERLANDS - Buoy.

Source: Netherlands Notice 26/213(T)/24

- The North Cardinal light-buoy, *Q E-ZE*, has been temporarily moved:

<i>Former Position</i>	<i>New Position</i>
51° 22'·55N., 3° 48'·44E.	51° 22'·57N., 3° 48'·27E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 120

4221(T)/24 NETHERLANDS - Virtual aid to navigation.

Source: Netherlands Notice 34/278(T)/24

- A virtual aid to navigation (V-AIS), has been established in position 53° 41'·07N., 6° 21'·53E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1633

4421(T)/24 NORTH SEA - Netherlands Sector - Buoyage.

Source: Netherlands Notice 36/295(T)/24

- The following light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.Y.5s</i>	<i>L7-A</i>	Yellow spherical	53° 32'·33N., 4° 11'·78E.
<i>Fl(4)Y.10s</i>	<i>L7-B</i>	Yellow spherical	53° 32'·19N., 4° 12'·29E.

- Mariners are advised to navigate with caution.
(WGS84 DATUM)

Charts affected — 1408 — 1632 — 1633**256(T)/25 NORTH SEA - United Kingdom Sector - Platform. Fog signal.**

Source: Perenco UK

- Trent 43/24 Platform, in position 54° 17'·92N., 1° 39'·49E., is unlit and the fog signal is inoperative.
- Mariners are advised to navigate with caution in the area.
(ETRS89 DATUM)

Charts affected — 266 — 1187 — 2182A — 2182B — 4140 — 5614_25 — 5615_23**471(P)/25 NETHERLANDS - Works. Quays. Jetties.**

Source: Netherlands Notice 2/5(P)/25

- Significant changes to charted detail have taken place at Kraayerhaven within Vlissingen-Oost, in the vicinity of position 51° 27'·20N., 3° 42'·47E.
- New quays have been established and jetties removed.
- Mariners are advised to navigate with caution in the area.
- These changes will be included in the next New Edition of Chart 120.
(WGS84 DATUM)

Chart affected — 120**1066(T)/25 NORTH SEA - Netherlands Sector - Buoyage.**

Source: Netherlands Notice 6/30(T)/25

- Cardinal buoys have been established in the following positions:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Q(9)15s</i>	<i>RVO-W1</i>	West Cardinal, Pillar	54° 26'·0N., 4° 2 0'·1E.
<i>VQ(9)10s</i>	<i>RVO-W2</i>	West Cardinal, Pillar	54° 25'·4N., 4° 2 0'·1E.
<i>Q(3)10s</i>	<i>RVO-O1</i>	East Cardinal, Pillar	54° 25'·8N., 4° 2 0'·5E.
<i>VQ(3)5s</i>	<i>RVO-O2</i>	East Cardinal, Pillar	54° 25'·5N., 4° 2 0'·5E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2182A — 2182B — 5614_25**1226(T)/25 BELGIUM - Buoy.**

Source: Belgian Notice 8/119(T)/23

- A North cardinal light-buoy, *Q JDN*, has been established in the following position 51° 13'·33N., 2° 51'·38E.
- *Former Notice 3183(T)/23 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2449 — 5605_11 — BE 11 — BE 101 — BE 102

1271(T)/25 NORTH SEA - Danish Sector - Measuring instruments.

Source: Danish Notice 50/1238(T)/24

1. Measuring instruments have been established on the seabed in the following positions:

56° 35'·5N., 5° 15'·1E.
 56° 39'·03N., 5° 14'·11E.
 56° 36'·5N., 5° 20'·9E.
 56° 38'·7N., 5° 17'·0E.
 56° 40'·0N., 5° 19'·6E.
 56° 42'·2N., 5° 27'·1E.
 56° 38'·7N., 5° 25'·5E.
 56° 41'·8N., 5° 22'·6E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 272 — 1405 — 1422 — 2182B**1312(T)/25 BELGIUM - Virtual aids to navigation.**

Source: Belgian Notice 3/86(T)/2025

1. Virtual aids to navigation (V-AIS) have been deployed, until further notice, in the following positions:

<i>Designation</i>	<i>Position</i>
POAB1	51° 19'·42N., 4° 18'·51E.
POAB2	51° 19'·34N., 4° 18'·56E.
POAB3	51° 19'·28N., 4° 18'·61E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — BE 106**1330(T)/25 NORTH SEA - Netherlands Sector - Buoy.**

Source: Netherlands Notice 9/62(T)/25

1. *A yellow spherical light-buoy, *Fl.Y.5s W-C*, has been established in position 53° 08'·78N., 3° 57'·32E.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 5740(T)/24 is cancelled.
* Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1408 — 1631**1347(P)/25 DENMARK - North Sea Coast - Wind farm. Restricted area. Buoyage. Submarine cable. Works.**

Source: Danish Notices 6/87(T)/25 and 6/90(T)/25

1. Works are in progress to establish the Thorsminde W Wind Farm.
2. A restricted area, entry prohibited, marked by yellow light-buoys, has been established, bounded by the following positions:

56° 19'·6N., 7° 33'·1E.
 56° 24'·8N., 7° 37'·4E.
 56° 27'·5N., 7° 41'·6E.
 56° 27'·4N., 7° 43'·4E.
 56° 26'·1N., 7° 45'·3E.
 56° 24'·3N., 7° 46'·1E.
 56° 14'·5N., 7° 46'·9E.
 56° 14'·4N., 7° 38'·5E.

3. Cable laying operations will be conducted between the shore and wind farm area, along a 1000m corridor joining the following positions:

56° 27'·4N., 8° 07'·4E.
 56° 20'·7N., 7° 47'·8E.
 56° 21'·0N., 7° 46'·4E.

**1347(P)/25 DENMARK - North Sea Coast - Wind farm. Restricted area. Buoyage. Submarine cable. Works.
(continued)**

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1422 — 2182B

1676(P)/25 NORTH SEA - Norwegian Sector - Works. Offshore installation. Precautionary areas.

Source: Norwegian Notices 2/76731(P)-76732(P)/25

- Subsea installation works are taking place in connection with the development of the Solveig-Ph2 and Symra (Utsira High) Oil Fields.
- Precautionary areas have been established, joining the following positions:
 - 58° 50'·64N., 2° 14'·83E.
 - 58° 50'·58N., 2° 15'·59E.
 - 58° 43'·27N., 2° 13'·86E.
 - 58° 40'·62N., 2° 12'·49E.
 - 58° 40'·39N., 2° 14'·56E.
 - 58° 40'·11N., 2° 14'·48E.
 - 58° 40'·46N., 2° 10'·85E.
 - 58° 42'·90N., 2° 12'·29E.

- and

- 58° 58'·45N., 2° 16'·88E.
- 58° 58'·17N., 2° 17'·43E.
- 58° 55'·53N., 2° 12'·26E.
- 58° 55'·13N., 2° 12'·09E.
- 58° 55'·00N., 2° 11'·02E.
- 58° 55'·43N., 2° 10'·15E.
- 58° 55'·98N., 2° 10'·69E.
- 58° 56'·04N., 2° 12'·21E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 274 — 292 — 1405 — 1427 — 2182C

1687(T)/25 BELGIUM - Obstruction. Buoyage.

Source: Belgian Notice 17/160(T)/24

- An obstruction area exists in an area bounded by the following positions:
 - 51° 18'·88N., 3° 12'·78E.
 - 51° 18'·89N., 3° 12'·81E.
 - 51° 18'·82N., 3° 12'·83E.
 - 51° 18'·81N., 3° 12'·81E.
- Emergency wreck marking buoys have been established in the following positions:
 - 51° 18'·82N., 3° 12'·84E.
 - 51° 18'·81N., 3° 12'·80E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — BE 101

2516(P)/25 NORTH SEA - Norwegian Sector - Submarine pipelines. Precautionary areas.

Source: Norwegian Notice 6/77397(P)/25

- Pipeline laying operations are taking place, joining the following positions:
 - 59° 53'·32N., 2° 34'·83E.
 - 59° 35'·48N., 3° 07'·74E.

2516(P)/25 NORTH SEA - Norwegian Sector - Submarine pipelines. Precautionary areas. (continued)

2. and

60° 07'·32N., 2° 35'·98E.

60° 09'·29N., 2° 41'·91E.

60° 11'·21N., 2° 44'·64E.

60° 24'·35N., 3° 07'·79E.

3. Fishing with bottom gear should be avoided within the precautionary areas.

(WGS84 DATUM)

Charts affected — 292 — 294 — 1427 — 2182C — 2182D**2591(T)/25 NETHERLANDS - Buoyage.**

Source: Netherlands Notice 21/140(T)/25

1. The following yellow light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl. Y.3s</i>	<i>B A</i>	51° 57'·65N., 4° 05'·28E.
<i>Fl. Y.3s</i>	<i>B B</i>	51° 57'·60N., 4° 05'·27E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

(WGS84 DATUM)

Chart affected — 207**2669(P)/25 NORTH SEA - United Kingdom Sector - Submarine pipeline. Works.**

Source: Serica Energy Chinook Limited

1. Submarine pipeline laying operations are taking place, joining the following positions:

57° 04'·88N., 0° 53'·48E.

57° 04'·67N., 0° 54'·29E.

57° 04'·60N., 0° 54'·48E.

57° 04'·51N., 0° 54'·68E.

57° 03'·18N., 0° 56'·74E.

57° 03'·01N., 0° 56'·53E.

57° 02'·66N., 0° 54'·85E.

57° 01'·44N., 0° 50'·39E.

2. Mariners are advised to navigate with caution in the area and maintain a safe distance from the works.

3. Charts will be updated when works are complete.

(WGS84 DATUM)

Charts affected — 273 — 278 — 2182B**2680(P)/25 NORTH SEA - Norwegian Sector - Submarine pipelines. Works.**

Source: Norwegian Notice 5/77256(P)/25

1. *Pipeline laying operations are taking place, joining the following positions:

* 59° 52'·66N., 2° 34'·50E.

* 60° 10'·69N., 2° 35'·23E.

* 60° 13'·38N., 2° 29'·25E.

and

* 59° 52'·66N., 2° 34'·50E.

* 60° 00'·08N., 2° 21'·66E.

and

* 59° 52'·66N., 2° 34'·50E.

* 59° 46'·93N., 2° 25'·52E.

and

* 59° 52'·66N., 2° 34'·50E.

* 59° 43'·44N., 2° 33'·54E.

and

2680(P)/25 NORTH SEA - Norwegian Sector - Submarine pipelines. Works. (continued)

- * 59° 52'·66N., 2° 34'·50E.
- * 59° 51'·47N., 2° 33'·97E.
- * 59° 50'·02N., 2° 37'·48E.
- * 59° 48'·42N., 2° 36'·63E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
4. *Former Notice 4408(P)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 292 — 294 — 1427 — 2182C

2710(P)/25 NORTH SEA - Norwegian Sector - Submarine pipeline. Submarine cable.

Source: Norwegian Notice 8/77598(P)/25

1. Submarine pipeline and cable laying operations are taking place, joining the following positions:
 - 58° 34'·59N., 1° 41'·75E.
 - 58° 38'·73N., 1° 38'·49E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 274 — 291 — 1405 — 2182C

2741(T)/25 NETHERLANDS - Works. Restricted area. Buoyage.

Source: Netherlands Notice 23/158(T)/25

1. Works are taking place in the Afrikahaven.
2. A restricted area, entry prohibited, marked by yellow buoys with a topmark, has been established bounded by the following positions:
 - 52° 25'·14N., 4° 45'·04E.
 - 52° 25'·15N., 4° 45'·10E.
 - 52° 24'·77N., 4° 45'·21E.
 - 52° 24'·76N., 4° 45'·16E.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 124

3098(T)/25 BELGIUM - Restricted area. Buoyage.

Source: Belgian Notice 13/148(T)/25

1. A restricted area, marked by light-buoys, *Fl. Y.5s*, has been established bounded by the following positions:
 - 51° 16'·81N., 4° 13'·88E.
 - 51° 16'·86N., 4° 13'·79E.
 - 51° 17'·34N., 4° 14'·39E.
 - 51° 17'·29N., 4° 14'·48E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — BE 106

3132(T)/25 NETHERLANDS - Buoyage.

Source: Netherlands Notice 26/169(T)/25

1. The following buoys have been established:

<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>RB 1</i>	Green Spar Buoy	51° 50'·33N., 4° 39'·61E.
<i>RB 3</i>	Green Spar Buoy	51° 50'·27N., 4° 39'·61E.

3132(T)/25 NETHERLANDS - Buoyage. (continued)

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 209**3173(P)/25 NORTH SEA - United Kingdom Sector - Submarine pipeline. Works.**

Source: Dana Petroleum

- Submarine pipeline laying operations are taking place, joining the following positions:

57° 04'·98N., 0° 53'·34E.
 57° 04'·68N., 0° 51'·89E.
 57° 04'·43N., 0° 51'·54E.
 57° 04'·03N., 0° 51'·57E.
 56° 55'·65N., 1° 00'·52E.
 56° 55'·02N., 1° 01'·42E.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 273 — 278 — 2182B — 2182C**3268(P)/25 NORTH SEA - Netherlands Sector - Wind farm. Works.**

Source: Netherlands Notice 27/178(P)/25

- Wind farm, *IJmuiden Ver (IJVER)*, construction works are taking place, within an area bounded by the following positions:

53° 01'·06N., 3° 29'·16E.
 52° 52'·58N., 3° 44'·36E.
 52° 37'·11N., 3° 24'·47E.
 52° 37'·13N., 3° 11'·23E.
 52° 38'·04N., 3° 11'·28E.
 52° 53'·20N., 3° 24'·56E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1408 — 1504 — 1631**4044(T)/25 NETHERLANDS - Depth information.**

Source: Netherlands Notice 34/225(T)/25

- Shoaling has been reported within an area bounded by the following positions:

52° 23'·02N., 4° 57'·46E.
 52° 22'·96N., 4° 57'·62E.
 52° 22'·88N., 4° 57'·57E.
 52° 22'·92N., 4° 57'·44E.

- *Pleasure craft with a draft of more than 2·5m that are waiting for a lock are advised to moor on the starboard side before the lock.

- Shoaling has been reported within an area bounded by the following positions:

52° 22'·92N., 4° 57'·71E.
 52° 22'·87N., 4° 57'·84E.
 52° 22'·79N., 4° 57'·73E.
 52° 22'·85N., 4° 57'·64E.

- *Pleasure craft with a draft of more than 2·5m are advised to keep to the main fairway.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- *Former Notice 2601(T)25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 124

4079(T)/25 NETHERLANDS - Buoyage.

Source: Netherlands Notice 35/228(T)/25

1. Yellow spar light-buoys with cylinder topmarks, *Fl.Y.5s*, have been established in the following positions:

<i>Designation</i>	<i>Position</i>
<i>HT-A</i>	52° 25'·74N., 4° 45'·89E.
<i>HT-C</i>	52° 25'·70N., 4° 46'·09E.
<i>HT-E</i>	52° 25'·69N., 4° 46'·28E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 124**4210(T)/25 NORTH SEA - United Kingdom Sector - Fog signals. Wind turbines.**

Source: Ørsted Notice to Mariners August 2025

1. Fog signals are inoperative at the following wind turbines:

53° 50'·0N., 1° 58'·7E.
53° 50'·1N., 1° 52'·4E.

2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 2418(T)/25 is cancelled.
*Indicates new or revised entry
(ETRS89 DATUM)

Chart affected — 1187**4250(T)/25 NORTH SEA - Norwegian Sector - Buoyage.**

Source: Norwegian Notice 15/78379(T)/25

1. The following temporary light-buoys have been moved:

<i>Characteristic</i>	<i>Buoy Type</i>	<i>Former Position</i>	<i>New Position</i>
<i>Fl(5)Y.20s</i>	ODAS yellow superbuoy	56° 48'·9N., 5° 16'·1E.	56° 48'·9N., 5° 16'·7E.
<i>Fl(5)Y.20s</i>	Metoccean yellow spherical	56° 48'·3N., 5° 16'·8E.	56° 48'·3N., 5° 17'·4E.

2. Mariners are advised to navigate with caution in the area.
3. Former notice 512(T)/25 is cancelled.
(WGS84 DATUM)

Charts affected — 1405 — 1422**4255(T)/25 NORTH SEA - Norwegian Sector - Buoy.**

Source: Norwegian Notice 15/78397(T)/25

1. A yellow spherical ODAS Waverider light-buoy, *Fl(5)Y.20s*, has been established, in position 60° 10'·33N., 2° 32'·45E.
2. Mariners are advised to navigate with caution in the area
(WGS84 DATUM)

Charts affected — 294 — 1427 — 2182C**4348(T)/25 NORTH SEA - United Kingdom Sector - Scientific instruments. Buoyage.**

Source: Northern Endurance Partnership

1. A seabed mounted scientific instrument has been established in position 54° 15'·92N., 0° 56'·08E.
2. A seabed mounted scientific instrument has been established in position 54° 12'·18N., 0° 55'·00E.
3. A seabed mounted scientific instrument has been established in position 54° 12'·50N., 1° 09'·20E.
4. Further scientific instruments marked by 4 cardinal buoys, have been established in the area bounded by
54° 11'·46N., 1° 03'·34E.
54° 11'·04N., 1° 03'·34E.
54° 11'·04N., 1° 02'·54E.
54° 11'·46N., 1° 02'·54E.
5. Positions may be subject to change.

4348(T)/25 NORTH SEA - United Kingdom Sector - Scientific instruments. Buoyage. (continued)

6. Mariners are advised to navigate with caution in the area and maintain a safe operating distance of at least 500m from the underwater instruments.
(ETRS89 DATUM)

Charts affected — 266 — 1187 — 1191

4701(P)/25 NORTH SEA - Norwegian Sector - Offshore installation. Precautionary area.

Source: Norwegian Notice 17/78733(P)/25

1. Marine installation activities are taking place in the Øst Frigg oil fields.
2. A precautionary area has been established, radius 600m, centred on 59° 53'·70N., 2° 24'·74E.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 292 — 294 — 1427 — 2182C

4791(P)/25 NORTH SEA - Netherlands Sector - Vessel traffic service.

Source: Netherlands Notice 41/261(P)/25

1. With effect from 3rd November 2025 at 2pm, A vessel traffic service sector, 'VTS off Texel' will be established within an area bounded by the following positions:

52° 58'·60N., 4° 22'·30E.
53° 11'·00N., 4° 21'·80E.
53° 18'·30N., 4° 27'·40E.
53° 35'·50N., 4° 37'·20E.
53° 37'·10N., 5° 06'·90E.
53° 31'·70N., 5° 01'·40E.
53° 26'·40N., 4° 57'·60E.
53° 22'·90N., 4° 43'·90E.
53° 11'·00N., 4° 35'·30E.
2. For the latest information, mariners should contact 'VTS off Texel' on VHF Channel 63.
(WGS84 DATUM)

Charts affected — 1408 — 1631 — 1632 — 1633

4800(T)/25 NORTH SEA - Netherlands Sector - Virtual aid to navigation.

Source: Netherlands Notice 19/125(T)/25

1. *A virtual aid to navigation (V-AIS), isolated danger topmark, has been established in position 52° 54'·55N., 3° 24'·67E.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 2258(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1408 — 1504 — 1631 — 2182A — 5614_25

4987(T)/25 NORTH SEA - Netherlands Sector - Submarine pipeline. Restricted area.

Source: Netherlands Notice 42/271(T)/25

1. A submarine pipeline has been established, joining the following positions:

51° 35'·49N., 3° 39'·12E.
51° 35'·69N., 3° 39'·01E.
2. Anchoring, fishing and other seabed activities are prohibited within 200m of the submarine pipeline.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 110 — 116

4989(T)/25 NETHERLANDS - Buoyage.

Source: Netherlands Notice 42/275(T)/25

1. Special purpose light-buoys have been established as follows:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl.Y.5s</i>	<i>WK A</i>	51° 54'·26N., 4° 28'·54E.
<i>Fl(3)Y.10s</i>	<i>WK C</i>	51° 54'·31N., 4° 28'·64E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 208**5285(T)/25 NETHERLANDS - Buoyage.**

Source: Netherlands Notice 45/286(T)/25

1. Three yellow pillar buoys, *Fl.Y.3s*, have been established, until further notice, in position 51° 58'·29N., 4° 02'·73E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 207**5469(P)/25 NORTH SEA - Netherlands Sector - Obstruction.**

Source: Netherlands Notice 46/289(P)/25

1. An obstruction, with safe clearance depth 32, exists in position 53° 49'·50N., 3° 54'·00E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1632 — 2182A — 2182B — 5614_25**5528(P)/25 NORTH SEA - Netherlands Sector - Obstruction.**

Source: Netherlands Notice 47/296(P)/25

1. An obstruction, with safe clearance depth 21·5, exists in position 52° 45'·36N., 3° 45'·48E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1408 — 1631**5531(T)/25 NORTH SEA - United Kingdom Sector - Buoyage.**

Source: Shell Research Limited

1. *A red auxiliary float exists in this position 57° 09'·16N., 2° 15'·48E.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 2045(T)/25 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 272 — 274**5568(T)/25 BELGIUM - Buoyage. Measuring instruments.**

Source: Belgian Notice 24/182(T)/25

1. Yellow conical special purpose light-buoys, *Fl.Y.5s*, marking measuring instruments, have been established as follows:

<i>Designation</i>	<i>Position</i>
<i>HD24</i>	51° 13'·40N., 2° 49'·60E.
<i>HD25</i>	51° 12'·58N., 2° 50'·35E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2449 — 5605_11 — BE 11 — BE 101 — BE 102

5652(P)/25 NORTH SEA - Netherlands Sector - Wind farm. Works.

Source: Netherlands Notice 48/298(P)/25

1. Wind farm construction works are taking place and fishing is considered dangerous within area bounded by the following positions:

52° 42'·33N., 3° 42'·83E.

52° 37'·83N., 3° 48'·83E.

52° 35'·67N., 3° 46'·83E.

52° 36'·50N., 3° 34'·83E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 125 — 1408 — 1631**5672(T)/25 NORTH SEA - Netherlands Sector - Buoyage. Measuring instruments.**

Source: Netherlands HO

1. Measuring instruments have been temporarily established in the positions shown below. They are marked by either unlit yellow buoys or yellow light-buoys, *Fl(5)Y.20s*, *Fl(4)Y.20s*, *Fl.Y.5s*, *Fl(2)Y.5s* or *Iso.Y.2s*, and will be on station until further notice. Only the largest scale Admiralty chart is quoted. This list will be updated as necessary by Temporary Notices to Mariners.

<i>Position</i>	<i>Largest Scale Chart(s)</i>
51° 55'·70N., 3° 39'·80E.	122
52° 14'·65N., 4° 05'·09E.	130
52° 23'·58N., 4° 03'·36E.	130
52° 28'·300N., 4° 35'·530E.	124
55° 01'·41N., 3° 41'·11E.	266
53° 34'·62N., 5° 40'·35E.	1633
53° 35'·29N., 5° 45'·05E.	1633
55° 37'·26N., 6° 22'·12E.	1633
55° 37'·22N., 6° 31'·33E.	1633
54° 12'·4N., 3° 59'·6E.	DE50
54° 12'·4N., 4° 00'·5E.	DE50
54° 12'·9N., 4° 00'·5E.	DE50
54° 12'·9N., 3° 59'·6E.	DE50
54° 16'·5N., 5° 38'·7E.	DE50
54° 16'·6N., 5° 39'·5E.	DE50

2. and

<i>Position</i>	<i>Largest Scale Chart(s)</i>
54° 25'·3N., 4° 20'·3E.	DE50
54° 26'·0N., 4° 20'·3E.	DE50
54° 39'·0N., 4° 41'·1E.	DE50
54° 39'·0N., 4° 42'·1E.	DE50
54° 38'·5N., 4° 41'·1E.	DE50
54° 38'·5N., 4° 42'·1E.	DE50
53° 34'·22N., 6° 37'·95E.	DE90
53° 31'·03N., 6° 41'·12E.	DE90
53° 18'·78N., 4° 02'·21E.	1632
53° 18'·95N., 4° 02'·58E.	1632
53° 23'·27N., 3° 07'·87E.	1632
53° 23'·28N., 3° 06'·98E.	1632
53° 22'·60N., 3° 08'·08E.	1632

5672(T)/25 NORTH SEA - Netherlands Sector - Buoyage. Measuring instruments. (continued)

3. and

<i>Position</i>	<i>Largest Scale Chart(s)</i>
51° 28'·23N., 3° 19'·76E.	BE101
51° 28'·29N., 3° 19'·76E.	BE101
51° 26'·12N., 3° 20'·07E.	BE101
51° 26'·19N., 3° 20'·07E.	BE101
51° 31'·42N., 3° 13'·33E.	BE101
51° 30'·42N., 3° 15'·12E.	BE101
51° 29'·23N., 3° 17'·09E.	BE101
51° 28'·16N., 3° 19'·00E.	BE101
51° 27'·07N., 3° 21'·00E.	BE101

4. Mariners are advised to navigate with caution in the area.

5. *Former Notice 5498(T)/25 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 122 — 124 — 130 — 266 — 1632 — 1633 — BE 101 — DE 50 — DE 90**5707(T)/25 DENMARK - North Sea Coast - Wreck.**

Source: Danish Notice 44/899(T)/25

1. An unmarked wreck of unknown depth has been reported in approximate position 55° 58'·2N., 8° 05'·0E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1422**5767(T)/25 NORTH SEA - Norwegian Sector - Buoyage.**

Source: Norwegian Notices 4/77079(T)/25 and 18/78773(T)/25

1. Yellow spherical ODAS buoys, *Fl(5)Y.20s*, have been deployed in the following positions:

*59° 54'·73N., 2° 33'·56E.
60° 04'·25N., 2° 33'·97E.

2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 4430(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 292 — 294 — 1427 — 2182C**5785(T)/25 NORTH SEA - United Kingdom Sector - Scientific instrument.**

Source: Muir Mhòr Offshore Wind Farm

1. A scientific instrument exists on the seafloor in the vicinity of position 57° 25'·02N., 0° 34'·81W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 278

(6) FRANCE AND SPAIN, NORTH AND WEST COASTS, AND PORTUGAL

5180(P)/18 PORTUGAL - West Coast - Buoyage. Light-beacons.

Source: Portuguese Chart 26402

1. The characteristics and designations of lateral buoyage in the Rio Douro, between positions $41^{\circ} 08' \cdot 745N.$, $8^{\circ} 40' \cdot 360W.$ and $41^{\circ} 08' \cdot 339N.$, $8^{\circ} 37' \cdot 129W.$ have changed.
2. New lateral buoys and light-beacons have been established from the Ponte da Arrábida bridge ($41^{\circ} 08' \cdot 847N.$, $8^{\circ} 38' \cdot 423W.$) up river to position $41^{\circ} 08' \cdot 339N.$, $8^{\circ} 37' \cdot 129W.$
3. A south cardinal light-buoy, *VQ(6)+LFl.10s*, has been established in position $41^{\circ} 08' \cdot 365N.$, $8^{\circ} 37' \cdot 016W.$
4. Mariners are advised to navigate with caution in the area.
5. These changes will be included in the next New Edition of Chart 3258.
(WGS84 DATUM)

Chart affected — 3258**2884(T)/20 PORTUGAL - West Coast - Scientific instrument.**

Source: Portuguese Notice 3-4/142(T)/20

1. An unmarked subsurface scientific instrument, extending 15m from the seabed, has been temporarily established in position $37^{\circ} 55' \cdot 20N.$, $8^{\circ} 48' \cdot 89W.$
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3224**4149(P)/20 FRANCE - West Coast - Depths. Drying height. Rock.**

Source: French Notice 16/61/17, French Charts 7606 and 7250

1. Depths less than charted exist between Audierne and Loctudy. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
3·4m	$47^{\circ} 57' \cdot 97N.$, $4^{\circ} 27' \cdot 24W.$
2·8m	$47^{\circ} 45' \cdot 69N.$, $4^{\circ} 18' \cdot 76W.$
2·8m	$47^{\circ} 45' \cdot 58N.$, $4^{\circ} 15' \cdot 78W.$
8·0m	$47^{\circ} 46' \cdot 18N.$, $4^{\circ} 13' \cdot 95W.$
7·6m	$47^{\circ} 46' \cdot 73N.$, $4^{\circ} 12' \cdot 84W.$
4·3m	$47^{\circ} 46' \cdot 56N.$, $4^{\circ} 12' \cdot 08W.$
6·1m	$47^{\circ} 47' \cdot 76N.$, $4^{\circ} 07' \cdot 24W.$
3·0m	$47^{\circ} 45' \cdot 48N.$, $4^{\circ} 18' \cdot 84W.$
5·0m	$47^{\circ} 45' \cdot 67N.$, $4^{\circ} 17' \cdot 84W.$
6·9m	$47^{\circ} 46' \cdot 46N.$, $4^{\circ} 11' \cdot 20W.$
* 8·8m	$47^{\circ} 46' \cdot 35N.$, $4^{\circ} 18' \cdot 88W.$
* 1·4m	$47^{\circ} 46' \cdot 13N.$, $4^{\circ} 19' \cdot 08W.$
* 11·6m	$47^{\circ} 45' \cdot 51N.$, $4^{\circ} 08' \cdot 78W.$

2. A rock, drying height 0·9m, exists in position $47^{\circ} 46' \cdot 54N.$, $4^{\circ} 11' \cdot 83W.$
3. Charts 2820 and 2819 will be updated when full details are available.
4. Former Notice 1466(P)/19 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 2819 — 2820**5580(P)/20 PORTUGAL - West Coast - Breakwater. Works. Buoyage. Light.**

Source: Portuguese Notice 9/194/20

1. Breakwater extension works are taking place in the vicinity of a line joining the following positions:

$37^{\circ} 55' \cdot 36N.$, $8^{\circ} 50' \cdot 72W.$
 $37^{\circ} 54' \cdot 96N.$, $8^{\circ} 50' \cdot 46W.$

5580(P)/20 PORTUGAL - West Coast - Breakwater. Works. Buoyage. Light. (continued)

2. The works area is marked by lit and unlit yellow can buoys in the following positions:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl(4)Y.10s</i>	<i>Conduril 1</i>	37° 55'·04N., 8° 50'·37W.
<i>Fl(4)Y.10s</i>	<i>Conduril 2</i>	37° 54'·92N., 8° 50'·42W.
<i>Fl(4)Y.10s</i>	<i>Conduril 3</i>	37° 54'·95N., 8° 50'·57W.
	<i>Conduril 4</i>	37° 55'·05N., 8° 50'·64W.
	<i>Conduril 5</i>	37° 55'·15N., 8° 50'·70W.
	<i>Conduril 6</i>	37° 55'·25N., 8° 50'·77W.
	<i>Conduril 7</i>	37° 55'·35N., 8° 50'·57W.
	<i>Conduril 8</i>	37° 55'·25N., 8° 50'·50W.
	<i>Conduril 9</i>	37° 55'·13N., 8° 50'·44W.

3. Light, LFl.R.8s18m6M, in position 37° 55'·35N., 8° 50'·70W. has been extinguished.

4. Charts will be updated on completion of the works.
(WGS84 DATUM)

Chart affected — 3636

3602(T)/21 PORTUGAL - West Coast - Buoy.

Source: Portuguese Notice 4/182(T)/21

1. A yellow spar buoy, *Fl.Y.4s*, has been established in position 41° 11'·108N., 8° 41'·948W.
(WGS84 DATUM)

Chart affected — 3258

1320(T)/22 PORTUGAL - West Coast - Buoyage.

Source: Portuguese Notices 11/353(T)-354(T)/21

1. The following light-buoys are reported out of service:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>C1</i>	<i>Fl.Y.4s</i>	Special	38° 40'·22N., 9° 28'·44W.
<i>C2</i>	<i>Fl.Y.5s</i>	Special	38° 40'·00N., 9° 27'·96W.

(WGS84 DATUM)

Chart affected — 3635

4280(T)/22 PORTUGAL - West Coast - Buoy.

Source: Portuguese Notice 4/182(T)/22

1. An ODAS buoy, *Fl.Y.4s1M*, has been established in position 39° 34'·04N., 9° 09'·45W.
(WGS84 DATUM)

Chart affected — 3635

4815(T)/22 PORTUGAL - West Coast - Beacon.

Source: Portuguese Notice 6/227(T)/22

1. Beacon No13M, in position 38° 41'·98N., 8° 59'·28W. has been damaged.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3222

4864(T)/22 PORTUGAL - West Coast - Buoyage.

Source: Portuguese Notice 6/225(T)/22

1. ODAS light-buoys, *Fl(5)Y.20s2M*, have been established, in the following positions:

<i>Designation</i>	<i>Position</i>
<i>DI-WRB-1</i>	41° 10'·36N., 8° 42'·82W.
<i>DI-WRB-2</i>	41° 10'·32N., 8° 41'·98W.
<i>DI-WRB-3</i>	41° 09'·97N., 8° 41'·79W.

4864(T)/22 PORTUGAL - West Coast - Buoyage. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3258**3268(T)/23 FRANCE - West Coast - Wind farm. Restricted area. Works. Obstructions.**

Source: French Notice 2/5(T)/23

- Environmental monitoring stations have been anchored in preparation for a wind farm construction project in the following positions:

<i>Designation</i>	<i>Position</i>
Station A	47° 23'·30N., 3° 43'·00W.
Station B	47° 18'·59N., 3° 33'·45W.
Control Station	47° 12'·58N., 3° 16'·23W.
Station C	47° 26'·26N., 3° 25'·64W.
Station O	47° 20'·00N., 3° 36'·56W.
Station L	47° 17'·56N., 3° 31'·63W.

- A restricted area with a 20m diameter has been established around the stations, with anchoring and any fishing activity prohibited.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 20 — 2521 — 2522 — 2822**3687(T)/23 FRANCE - North Coast - Measuring instruments. Buoy.**

Source: French Notice 8/8(T)/23

- Three measuring instruments have been deployed, until further notice, in the following positions:

49° 28'·688N., 0° 05'·671E.
 49° 28'·225N., 0° 05'·005E.
 49° 28'·560N., 0° 02'·248E.

- The first measuring instrument is marked on the surface by a yellow buoy.
- Mariners are requested not to fish, dredge, trawl, or anchor near these positions.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2146 — 2879 — 2990**3920(P)/23 PORTUGAL - West Coast - Depths.**

Source: Portuguese Notice 3/150(P)/23

- Depths of less than 5m exist in the entrance to Doca de Alcântara in an area bounded by the following approximate positions:

38° 42'·140N., 9° 09'·680W.
 38° 42'·120N., 9° 09'·670W.
 38° 42'·120N., 9° 09'·550W.
 38° 42'·130N., 9° 09'·570W.

- A 4m depth exists in position 38° 42'·130N., 9° 09'·660W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3221 — 3222**1522(T)/24 PORTUGAL - South Coast - Buoy.**

Source: Portuguese Notice 11/285(T)/23

- The north cardinal light-buoy, *Q APA N*, in position 37° 05'·79N., 7° 29'·06W., is extinguished.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 93

1530(T)/24 PORTUGAL - West Coast - Buoy.

Source: Portuguese Notice 11/280(T)/23

1. The *Boia Aveiro* light-buoy, *Fl(3)G.7s*, in position 40° 37'·86N., 8° 46'·98W., is extinguished.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3227**1588(T)/24 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 12/303(T)/23

1. The *QM2* south cardinal pillar light-buoy, *VQ(6)+LFl.10s4M*, in position 41° 10'·115N., 8° 42'·484W., is temporarily extinguished and damaged.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3258**1734(T)/24 PORTUGAL - West Coast - Buoy. Automatic Identification System. Virtual aid to navigation.**

Source: Portuguese Notice 1/112(T)/24

1. The starboard-hand light-buoy *Fl.G.3s5M No1 AIS*, in position 38° 26'·915N., 8° 58'·251W., has been temporarily removed.
2. A virtual aid to navigation, *V-AIS*, has been deployed in position 38° 26'·99N., 8° 58'·17W.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3259**1736(T)/24 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 1/115(T)/24

1. The starboard-hand light-buoy, *Fl(2)G.6s3M No 15CN*, in position 38° 29'·250N., 8° 49'·400W., is off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3259 — 3260**2594(T)/24 PORTUGAL - West Coast - Light.**

Source: Portuguese Notice 2/140(T)/24

1. The range of the rear light at Barra, in position 40° 08'·873N., 8° 52'·156W. has been reduced to 4 miles and the sector has been removed.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3228**3655(T)/24 FRANCE - West Coast - Works. Wind farm. Restricted area.**

Source: French Notice 21/11(T)/24

1. Works are in progress to establish a wind farm in the vicinity of the Islands of Yeu and Noirmoutier.
2. A restricted area, entry prohibited, has been established bounded by the following positions:

46° 59'·24N., 2° 31'·28W.
 46° 50'·69N., 2° 21'·19W.
 46° 49'·75N., 2° 22'·88W.
 46° 45'·91N., 2° 29'·80W.
 46° 52'·51N., 2° 37'·60W.
 46° 55'·66N., 2° 37'·72W.

3655(T)/24 FRANCE - West Coast - Works. Wind farm. Restricted area. (continued)

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 20 — 2522

3698(P)/24 PORTUGAL - West Coast - Alongside depths. Coastline. Drying height. Obstruction. Works.

Source: Portuguese Notice 3/171(P)/24

- There have been numerous changes to existing charted detail within the Port of Sines. The most significant are as follows:
- Works are in progress within an area bounded by the following positions:

37° 56'·141N., 8° 51'·139W.
 37° 56'·109N., 8° 51'·085W.
 37° 56'·000N., 8° 51'·221W.
 37° 56'·024N., 8° 51'·297W.
- Terminal extension works have taken place in an area bounded by the following positions:

37° 55'·818N., 8° 50'·429W.
 37° 55'·780N., 8° 50'·405W.
 37° 55'·745N., 8° 50'·347W.
 37° 55'·711N., 8° 50'·380W.
 37° 55'·778N., 8° 50'·491W.
- Alongside depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
16·8m	37° 56'·285N., 8° 51'·422W.
16·9m	37° 56'·357N., 8° 51'·539W.

- An obstruction, with a known drying height of 2·2m, exists in position 37° 56'·024N., 8° 51'·546W.
- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 3224

3704(T)/24 PORTUGAL - South Coast - Buoyage.

Source: Portuguese Notices 1/120(T)/22 and 3/163-165(T)/24

- The special purpose light-buoys marking the artificial reef in position 37° 05'·56N., 8° 35'·05W. may be temporarily extinguished or removed.
- Mariners are advised to navigate with caution in the area.
- Former Notices 4084(T)/22 and 2478(T)/23 are cancelled.
(WGS84 DATUM)

Chart affected — 83

3708(T)/24 PORTUGAL - South Coast - Buoyage.

Source: Portuguese Notices 11/356(T)-357(T)/21, 8/273(T)-274(T)/22 and 3/167(T)-168(T)/24

- The following light-buoys have been removed:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Q(6)+LFl.15s</i>	<i>'SE'</i>	South Cardinal	36° 59'·99N., 7° 43'·97W.
<i>Q(3)10s</i>	<i>'E'</i>	East Cardinal	37° 00'·86N., 7° 41'·59W.
<i>Q</i>	<i>'NW'</i>	North Cardinal	37° 01'·00N., 7° 44'·48W.

- *The south cardinal light-buoy, *Q(6)+LFl.15s 'S'*, in position 36° 59'·28N., 7° 46'·19W., is unlit and has been moved. The buoy is now in position 36° 59'·42N., 7° 45'·87W.
- *The following cardinal light-buoy has been moved:

<i>Characteristic</i>	<i>Designation</i>	<i>Former Position</i>	<i>New Position</i>
<i>Q(9)15s</i>	<i>'W'</i>	37° 00'·29N., 7° 46'·78W.	37° 00'·43N., 7° 46'·38W.

3708(T)/24 PORTUGAL - South Coast - Buoyage. (continued)

4. *Former Notice 928(T)/23 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 93

4472(T)/24 PORTUGAL - South Coast - Depth.

Source: Portuguese Notice 4/183(T)/24

1. A depth of 0·8m exists within Vila Real de Santo Antonio in the following position 37° 09'·19N., 7° 23'·73W.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — 93

4637(T)/24 FRANCE - North Coast - Restricted areas. Works. Buoy.

Source: French Notice 27/9(T)/24

1. *Works are in progress to establish the Dieppe – Le Tréport Wind Farm.
2. *A Works Zone, within which entry is prohibited, has been established within an area bounded by the following positions:
 50° 06'·21N., 1° 01'·67E.
 50° 04'·16N., 1° 04'·68E.
 50° 10'·17N., 1° 14'·59E.
 50° 13'·55N., 1° 09'·64E.
 50° 08'·99N., 1° 02'·11E.
 50° 07'·66N., 1° 04'·05E.
3. *A Buffer Zone, where entry, stopping and anchoring are prohibited, applying to passenger vessels, commercial vessels, vessels over 500 UMS gross tonnage, or vessels transporting dangerous goods, has been established bounded by the following positions:
 50° 15'·67N., 1° 09'·74E.
 50° 09'·05N., 0° 58'·81E.
 50° 07'·72N., 1° 00'·76E.
 50° 06'·27N., 0° 58'·37E.
 50° 02'·04N., 1° 04'·58E.
 50° 10'·10N., 1° 17'·89E.
4. *Geophysical works are ongoing between the electrical substation in position 50° 10'·78N., 1° 10'·34E. and the landing point on the coast near Penly in position 49° 58'·80N., 1° 12'·30E. All nautical activities are prohibited within a 500m radius of the survey vessels.
5. *A data collection buoy has been established in position 50° 05'·08N., 1° 11'·70E., surrounded by a 150m restricted area, within which all activities are prohibited.
6. *For the latest information regarding Dieppe – Le Tréport Wind Farm, including fishing restrictions, mariners are advised to consult PING (portail.ping-info-nautique.fr/avurnav-notice).
7. Former Notice 1673(T)/24 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 2148 — 2451

4898(T)/24 PORTUGAL - West Coast - Works. Spoil ground.

Source: Portuguese Notice 7/243(T)/2024

1. Dredging works are taking place within port of Figueira da Foz and its approaches.
2. A spoil ground has been established, within an area bounded by the following positions:
 40° 07'·60N., 8° 52'·16W.
 40° 07'·07N., 8° 52'·36W.
 40° 07'·08N., 8° 52'·47W.
 40° 07'·64N., 8° 52'·31W.

4898(T)/24 PORTUGAL - West Coast - Works. Spoil ground. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3228**4908(T)/24 FRANCE - North Coast - Works. Restricted area.**

Source: French Notice 32/7(T)/24

- Construction works are taking place at the Calvados offshore wind farm.
- A Work Zone, within which entry is prohibited, has been established within an area bounded by the following positions:

49° 30'·26N., 0° 36'·00W.
 49° 29'·71N., 0° 31'·10W.
 49° 29'·12N., 0° 30'·01W.
 49° 28'·81N., 0° 27'·57W.
 49° 27'·21N., 0° 25'·51W.
 49° 26'·91N., 0° 25'·21W.
 49° 25'·43N., 0° 24'·39W.
 49° 24'·95N., 0° 25'·01W.
 49° 25'·85N., 0° 32'·84W.
 49° 27'·44N., 0° 34'·89W.
 49° 27'·69N., 0° 34'·92W.
 49° 29'·16N., 0° 35'·91W.
 49° 29'·20N., 0° 36'·29W.

- All nautical activities are prohibited within a 500m radius of the works vessels.
- For the latest information regarding Calvados Wind Farm, including fishing restrictions, mariners are advised to consult PING (portail.ping-info-nautique.fr/avurnav-notice).
(WGS84 DATUM)

Charts affected — 2136 — 2613 — 2656 — 2675**5097(T)/24 PORTUGAL - West Coast - Wreck. Restricted area.**

Source: Portuguese Notice 5/206(T)/24

- A dangerous wreck, depth 24m, exists in approximate position 41° 06'·00N., 8° 44'·00W.
- A circular safety zone, radius 500 yards, has been established, centred on the wreck.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3258 — 3634**5236(T)/24 PORTUGAL - West Coast - Works. Bridge. Buoyage.**

Source: Portuguese Notice 5/208(T)/24

- Works are in progress at the Engenheiro Edgar Cardoso bridge.
- The following lateral light-buoys have been established to mark the channel for navigation:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
*VQ(3)G.5s2M	ML-1	Starboard	40° 08'·709N., 8° 50'·557W.
*VQ(3)R.5s2M	ML-2	Port	40° 08'·742N., 8° 50'·554W.
*VQ(3)G.5s2M	ML-3	Starboard	40° 08'·708N., 8° 50'·476W.
*VQ(3)R.5s2M	ML-4	Port	40° 08'·743N., 8° 50'·470W.

- Mariners are advised to use the marked channel and to navigate with caution in the area.
- *Former Notice 4168(T)/23 is cancelled.
*Indicated new or revised entry
(WGS84 DATUM)

Chart affected — 3228**5616(T)/24 FRANCE - North Coast - Wreck.**

Source: French Notice 39/13(T)/24

- A wreck has been reported in position 48° 47'·24N., 2° 40'·64W.

5616(T)/24 FRANCE - North Coast - Wreck. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2029 — 2669 — 5604_6

5757(T)/24 PORTUGAL - West Coast - Buoy.

Source: Portuguese Notice 9/273(T)/24

1. The lateral light-buoy, *Fl(3)G.9s3M No 11CN*, in position 38° 29'·55N., 8° 50'·06W. is temporarily extinguished.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3259 — 3260

115(P)/25 FRANCE - North Coast - Wind farm. Buoyage. Anchorage area. Works.

Source: French Notices 33/40/24 and 42/36/24

1. Construction work for the Fécamp Wind Farm, centred on position 49° 53'·91N., 0° 14'·15E., has been completed.
2. Buoyage marking the works has been removed.
3. For the latest information regarding Fécamp Wind Farm, including restrictions, mariners are advised to consult PING (portail.ping-info-nautique.fr/avurnav-notice).
4. The limits of the anchorage area SE of Pointe De Barfleur have been amended, bounded by the following new positions:

49° 37'·50N., 1° 06'·50W.
49° 37'·50N., 0° 49'·50W.
49° 33'·89N., 0° 43'·00W.
49° 28'·00N., 0° 43'·00W.
49° 25'·12N., 0° 48'·60W.
49° 26'·32N., 1° 01'·88W.
49° 32'·75N., 1° 11'·20W.
49° 36'·40N., 1° 08'·70W.
5. These changes will be included in New Editions of Charts 2613, 2148, 2146, and 2451 to be published mid 2025.
6. Charts 2450, 2675 and 2656 will be updated by Notice to Mariners.
7. Former Notice 4293(T)/22 is cancelled.
(WGS84 DATUM)

Chart affected — 2148

252(T)/25 PORTUGAL - West Coast - Buoy.

Source: Portuguese Notice 10/285(T)/24 and ENC PT526309

1. The lateral buoy, *Q.G.1s3M No 9CS*, in position 38° 28'·10N., 8° 47'·10W., has been moved to position 38° 28'·10N., 8° 47'·00W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3260

257(T)/25 PORTUGAL - South Coast - Buoy.

Source: Portuguese Notice 10/288(T)/24

1. The ODAS light-buoy, *Fl(5)Y.20s CSA 82/D*, in position 36° 54'·42N., 7° 53'·98W. has been temporarily removed.
(WGS84 DATUM)

Charts affected — 87 — 89 — 91 — 93 — 3132

289(T)/25 FRANCE - North Coast - Measuring instruments. Buoyage.

Source: French Notices 48/7(T)-9(T)/24

1. Measuring instruments, marked by yellow light-buoys, *Fl(5)Y.3M*, have been established in the following positions:

<i>Designation</i>	<i>Position</i>
<i>SOMME 4</i>	49° 25'·77N., 0° 51'·64W.
<i>SOMME 5</i>	49° 29'·88N., 0° 35'·93W.
<i>SOMME 6</i>	49° 25'·21N., 0° 24'·29W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2135 — 2136 — 2613**415(T)/25 FRANCE - North Coast - Wreck.**

Source: French Notice 40/14(T)/24

1. A wreck has been reported in position 49° 29'·21N., 0° 09'·10W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2146 — 2613 — 2675**1120(T)/25 PORTUGAL - West Coast - Platform. Buoyage.**

Source: Portuguese Notice 11/310(T)/24

1. A floating platform has been installed marked by special light-buoys, *LFl.Y.6s*, in the following positions:

<i>Designation</i>	<i>Position</i>
<i>Floating platform</i>	38° 28'·680N., 8° 52'·322W.
<i>N Buoy</i>	38° 28'·921N., 8° 52'·498W.
<i>S Buoy</i>	38° 28'·711N., 8° 52'·285W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3259**1229(T)/25 FRANCE - North Coast - Automatic Identification System.**

Source: French Notice 46/11(T)/24

1. The Automatic Identification System, *AIS*, at the South cardinal light-buoy *DY2*, in position 51° 09'·45N., 2° 19'·42E., has been temporarily removed.
2. Mariners are advised to navigate with caution in the area.
3. *Former notice 286(T)/25 is cancelled
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 323 — 1406 — 1610 — 2449 — 5605_1 — 5605_10 — 5605_11 — 5606_1 — BE 11 — BE 102**1343(T)/25 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 12/336(T)/24

1. The lateral buoy, *Fl(2)R.6s3M*, in position 40° 39'·60N., 8° 42'·42W. has been extinguished.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3227

1505(P)/25 PORTUGAL - West Coast - Depths. Restricted areas. Marine Reserve.

Source: ENC PT526303 and Portuguese Chart 26303

1. Depths less than charted exist within the entrance to the Rio Tejo. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
12·7m	38° 39'·302N., 9° 19'·181W.
10·7m	38° 39'·405N., 9° 18'·935W.
1·2m	38° 40'·289N., 9° 17'·874W.
8·6m	38° 40'·422N., 9° 17'·823W.
*5·1m	38° 39'·264N., 9° 21'·919W.
*4·3m	38° 39'·374N., 9° 21'·218W.
*7·2m	38° 39'·522N., 9° 21'·577W.
*5·8m	38° 39'·760N., 9° 21'·361W.
*11·2m	38° 39'·206N., 9° 19'·204W.
*7·8m	38° 40'·429N., 9° 17'·834W.

2. A restricted area has been established, anchoring, fishing, dredging, diving, salvage and trawling prohibited, radius 750m (0·4NM), centred on Forte de São Lourenço, at position 38° 39'·628N. , 9° 17'·934W.
3. Restricted areas have been established, anchoring, fishing, dredging, diving, salvage and trawling prohibited, bounded by the following positions:

38° 39'·910N., 9° 16'·580W.
 38° 39'·910N., 9° 16'·350W.
 38° 39'·750N., 9° 16'·350W.
 38° 39'·750N., 9° 16'·580W.

4. and:

*38° 40'·571N., 9° 19'·288W.
 *38° 40'·349N., 9° 19'·329W.
 *38° 40'·320N., 9° 19'·380W.
 *38° 40'·289N., 9° 19'·501W.
 *38° 40'·303N., 9° 19'·611W.
 *38° 40'·426N., 9° 19'·779W.
 *38° 40'·609N., 9° 19'·768W.

5. *The restricted area, anchoring prohibited, bounded by the following positions has been removed:

38° 41'·836N., 9° 16'·491W.
 38° 41'·648N., 9° 16'·491W.
 38° 41'·637N., 9° 16'·236W.
 38° 39'·628N., 9° 17'·933W.
 38° 40'·416N., 9° 19'·417W.

6. *A marine reserve has been established, anchoring, fishing and trawling prohibited, bounded by the following positions:

38° 41'·152N., 9° 21'·258W.
 38° 40'·950N., 9° 21'·350W.
 38° 41'·383N., 9° 22'·183W.
 38° 41'·552N., 9° 22'·071W.

7. *An Entry Prohibited Area has been established, bounded by the following positions:

38° 41'·627N., 9° 24'·801W.
 38° 41'·660N., 9° 24'·760W.
 38° 41'·544N., 9° 24'·834W.
 38° 41'·428N., 9° 24'·963W.
 38° 41'·338N., 9° 25'·076W.
 38° 41'·397N., 9° 25'·185W.
 38° 41'·434N., 9° 25'·231W.
 38° 41'·450N., 9° 25'·220W.

8. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
9. These changes will be included in the next New Edition of Charts 3220 and 3221.
10. *Former Notice 1938(P)/24 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 3221

1716(T)/25 PORTUGAL - West Coast - Scientific instruments. Moorings.

Source: Portuguese Notice 1/108(T)/25

1. Scientific instruments and their associated moorings have been reported adrift in the vicinity of position 38° 16'·38N., 9° 04'·05W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 87 — 3635 — 3636**1718(T)/25 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 1/109(T)/25

1. The port hand lateral light-buoy, *Fl.R.3s3M No 12CN*, in position 38° 29'·45N., 8° 49'·70W. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3259 — 3260**1951(T)/25 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 2/125(T)/25

1. The ODAS buoy, *Fl(5)Y.20s*, in position 41° 08'·86N., 9° 34'·87W., is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 87 — 3634 — 4011 — 4014 — 4103**1986(T)/25 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 2/135(T)/25

1. The red pillar buoy, *No 8*, in position 38° 39'·86N., 9° 08'·35W. is reported off station.
(WGS84 DATUM)

Charts affected — 3221 — 3222**2101(T)/25 FRANCE - North Coast - Measuring instruments.**

Source: French Notice 15/1(T)/25

1. As part of the AO10 wind farm planning, two passive acoustic monitoring sensors have been established in the following positions:

<i>Designation</i>	<i>Position</i>
SOMME HA-4	49° 56'·40N., 0° 07'·58E.
SOMME HA-5	49° 53'·68N., 0° 04'·87E.

(WGS84 DATUM)

Charts affected — 2450 — 2451 — 2613**2162(T)/25 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 3/155(T)/25

1. The yellow pillar buoy, X-shape topmark, *Fl.Y.4s CI* in position 38° 40'·22N., 9° 28'·43W. is reported off station.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3635**2343(P)/25 PORTUGAL - West Coast - Depths. General information.**

Source: UKHO

1. Numerous changes to aids to navigation and depths have occurred within Porto de Leixões and its approaches 41° 10'·707N., 8° 42'·411W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

2343(P)/25 PORTUGAL - West Coast - Depths. General information. (continued)

3. Charts will be updated when more information has been received.
(WGS84 DATUM)

Chart affected — 3258

2696(T)/25 PORTUGAL - West Coast - Buoy.

Source: Portuguese Notice 4/172(T)/25

1. The *No 1* light-buoy, *VQ(6)+LFl.10s2M*, in position 37° 55'·68N., 8° 50'·34W. is reported unlit and without topmark.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3224

2706(T)/25 PORTUGAL - West Coast - Buoy. Virtual aid to navigation.

Source: Portuguese Notice 4/170(T)/25

1. The *No 2* light-buoy, *Fl.R.10s7M*, in position 38° 37'·29N., 9° 23'·27W. is reported off station, and has been temporarily replaced by a Virtual Aid to Navigation (V-AIS).
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3220 — 3635

2762(T)/25 PORTUGAL - West Coast - Depths.

Source: Portuguese Notice 5/189(T)/25

1. Depths less than charted exist within the approaches to Setúbal. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
10·2m	38° 27'·697N., 8° 57'·699W.
10·1m	38° 29'·686N., 8° 55'·393W.
10·8m	38° 29'·785N., 8° 55'·281W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3259

3097(P)/25 SPAIN - West Coast - Depths. Alongside depths.

Source: ENC ES504162

1. Alongside depths within the port of Marín have changed. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
2·7m	42° 23'·872N., 8° 42'·378W.
4·8m	42° 23'·865N., 8° 42'·086W.
12·4m	42° 24'·032N., 8° 41'·947W.
0·6m	42° 23'·680N., 8° 41'·748W.
0·2m	42° 23'·772N., 8° 41'·746W.
7·6m	42° 24'·117N., 8° 41'·670W.
9·6m	42° 24'·150N., 8° 41'·839W.
2·4m	42° 23'·932N., 8° 41'·557W.
8·7m	42° 23'·981N., 8° 41'·880W.

2. Depths less than charted exist within the port of Marín. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
6·2m	42° 23'·814N., 8° 41'·968W.
6·5m	42° 23'·962N., 8° 41'·910W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. These changes will be included in the next New Edition of Chart 1733.
(WGS84 DATUM)

Chart affected — 1733

3130(T)/25 FRANCE - West Coast - Platform. Restricted area.

Source: French Notice 23/2(T)/25

1. A platform has been established in position 48° 09'·24N., 4° 25'·01W.
2. A restricted area, entry prohibited, has been established bounded by the following positions:

48° 09'·21N., 4° 25'·22W.
 48° 09'·26N., 4° 25'·01W.
 48° 09'·25N., 4° 24'·88W.
 48° 09'·22N., 4° 25'·00W.
 (WGS84 DATUM)

Chart affected — 2349**3140(T)/25 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 5/187(T)/25

1. The ODAS buoy, *Fl(5)Y.20s*, in position 39° 33'·61N., 9° 12'·56W. has been removed.
 (WGS84 DATUM)

Chart affected — 3635**3241(T)/25 PORTUGAL - West Coast - Depths.**

Source: Portuguese Notice 6/208(T)/25

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
14·3m	38° 40'·489N., 9° 17'·928W.
16·2m	38° 40'·483N., 9° 17'·985W.

2. Mariners are advised to navigate with caution in the area and consult the local authorities for the latest information.
 (WGS84 DATUM)

Charts affected — 3220 — 3221 — 3635**3633(T)/25 PORTUGAL - West Coast - Depths. Dredged areas.**

Source: : Portuguese Notices 5/168(T)/23 and 4/169(T)/25

1. Silting has been detected in Rio Tejo, in the areas bounded by the following positions:

38° 39'·756N., 9° 18'·842W.
 38° 39'·647N., 9° 18'·749W.
 38° 39'·090N., 9° 19'·469W.
 38° 39'·210N., 9° 19'·560W.
 and
 38° 40'·172N., 9° 17'·924W.
 38° 40'·314N., 9° 18'·020W.
 38° 40'·608N., 9° 17'·599W.
 38° 40'·505N., 9° 17'·503W.

2. Shoal depths exist in the following positions:

<i>Depth</i>	<i>Position</i>
13·6m	38° 39'·271N., 9° 19'·311W.
13·8m	38° 39'·336N., 9° 19'·226W.
1·7m	38° 40'·329N., 9° 17'·858W.
1·5m	38° 40'·497N., 9° 17'·644W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. *Former Notice 4013(T)/23 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 3221

3758(T)/25 PORTUGAL - West Coast - Buoyage.

Source: : Portuguese Notices 8/213(T)-214(T)/23

1. The light-buoy, *Fl(2)G.6s3M No 9CN*, in position 38° 29'·70N., 8° 50'·40W., is unlit.
2. The light-buoy, *Fl.G.3s3M No 13CN*, in position 38° 29'·41N., 8° 49'·73W., is off station.
3. *Former Notice 4446(T)/23 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 3259 — 3260**3802(T)/25 PORTUGAL - West Coast - Depths.**

Source: Portuguese HO

1. Depths less than charted exist within the approaches to Figueira da Foz. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
3·7m	40° 08'·255N., 8° 52'·649W.
3·6m	40° 08'·308N., 8° 52'·694W.
5·9m	40° 08'·583N., 8° 52'·849W.
4·3m	40° 08'·619N., 8° 52'·816W.
4·9m	40° 08'·545N., 8° 52'·508W.

2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 2770(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 3228**3877(T)/25 PORTUGAL - South Coast - Obstruction.**

Source: Portuguese Notice 6/210(T)/25

1. An obstruction has been reported in position 37° 00'·35N., 7° 51'·58W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 83**3904(T)/25 PORTUGAL - West Coast - Superbuoy.**

Source: Portuguese Notice 6/203(T)/25

1. An ODAS superbuoy, *Fl(5)Y.20s5M*, has been established in position 41° 03'·29N., 9° 13'·71W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 87 — 3634 — 4103**3906(T)/25 PORTUGAL - West Coast - Superbuoy.**

Source: Portuguese Notice 6/206(T)/25

1. An ODAS superbuoy, *Fl(5)Y.20s5M*, has been established in position 40° 11'·17N., 9° 30'·05W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 87 — 3634 — 3635 — 4103**4202(T)/25 PORTUGAL - West Coast - Wreck. Virtual aid to navigation.**

Source: Portuguese Notice 8/243(T)/25

1. A dangerous wreck, marked by a virtual aid to navigation (V-AIS), exists in approximate position 41° 08'·771N., 8° 40'·121W.
2. Vessels are requested to reduce their speed when approaching the location, and to navigate south of the sunken vessel.

4202(T)/25 PORTUGAL - West Coast - Wreck. Virtual aid to navigation. (continued)

3. Mariners are advised to exercise caution and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3258**4256(T)/25 FRANCE - North Coast - Restricted area.**

Source: French Notice 33/2(T)/25

1. In this zone, when active, a restricted area, traffic, anchoring and parking prohibited, has been established bounded by the following positions:

 $49^{\circ} 28' \cdot 90N., 0^{\circ} 05' \cdot 52E.$
 $49^{\circ} 28' \cdot 72N., 0^{\circ} 05' \cdot 93E.$
 $49^{\circ} 28' \cdot 59N., 0^{\circ} 06' \cdot 21E.$
 $49^{\circ} 28' \cdot 23N., 0^{\circ} 06' \cdot 78E.$
 $49^{\circ} 28' \cdot 03N., 0^{\circ} 05' \cdot 50E.$
 $49^{\circ} 28' \cdot 78N., 0^{\circ} 05' \cdot 39E.$
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2879 — 2990**4315(T)/25 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 7/231(T)/25

1. An ODAS super buoy, X-shape topmark, *Fl(5)Y.20s5M*, has been established in position $39^{\circ} 05' \cdot 21N., 9^{\circ} 37' \cdot 94W.$
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 87 — 3635 — 4103**4317(T)/25 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 7/229(T)/25

1. An ODAS super buoy, X-shape topmark, *Fl(5)Y.20s5M*, has been established in position $41^{\circ} 43' \cdot 53N., 9^{\circ} 06' \cdot 34W.$
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 87 — 3634 — 4103**4502(T)/25 SPAIN - South West Coast - Breakwater. Works. Light. Buoy.**

Source: Spanish Notice 35/275(T)/25

1. Breakwater works are taking place on the Levante dock in the port of Cádiz.
2. The light, *Fl(2)R.6s6m1M* is reported temporarily extinguished and has been replaced by a lateral light buoy, *Q.R.2s1M*, in position $36^{\circ} 31' \cdot 969N., 6^{\circ} 16' \cdot 919W.$ until further notice.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 88**4649(T)/25 FRANCE - West Coast - Buoy.**

Source: French Notice 36/1(T)/25

1. A PAM scientific buoy and two anchor blocks have been established in position $48^{\circ} 06' \cdot 86N., 4^{\circ} 22' \cdot 80W.$
(WGS84 DATUM)

Chart affected — 2349

4773(T)/25 PORTUGAL - West Coast - Dredging area. Explosive dumping ground. Works.

Source: Portuguese Notice 8/250(T)/25

1. Dredging works are taking place in the approaches to Figueira da Foz in the area bounded by the following positions:

40° 09'·61N., 8° 52'·87W.
40° 09'·23N., 8° 52'·69W.
40° 08'·74N., 8° 52'·64W.
40° 08'·69N., 8° 52'·95W.
40° 09'·54N., 8° 53'·35W.

2. Dumping works are taking place within an area bounded by the following positions:

40° 07'·60N., 8° 52'·16W.
40° 07'·07N., 8° 52'·36W.
40° 07'·09N., 8° 52'·47W.
40° 07'·64N., 8° 52'·31W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3228**4794(T)/25 PORTUGAL - South Coast - Buoy.**

Source: Portuguese Notice 8/253(T)/25

1. The lateral buoy, *Fl.G.4s No 1*, in position 37° 07'·34N., 8° 31'·44W. is reported unlit.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 83**4819(T)/25 PORTUGAL - West Coast - Buoy.**

Source: Portuguese Notice 8/253(T)/25

1. The lateral buoy, *Fl(2)G.5s2M OVI*, in position 40° 40'·15N., 8° 43'·02W. is reported unlit.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3227**4825(T)/25 PORTUGAL - West Coast - Rock. Explosive dumping ground. Works.**

Source: Portuguese Notice 8/249(T)/25

1. Works to break up an underwater rock are taking place in the port of Figueira da Foz in an area bounded by the following positions:

40° 08'·72N., 8° 52'·38W.
40° 08'·77N., 8° 52'·10W.
40° 08'·82N., 8° 51'·37W.
40° 08'·78N., 8° 51'·37W.
40° 08'·68N., 8° 52'·27W.
40° 08'·69N., 8° 52'·35W.

2. Dumping works are taking place within an area bounded by the following positions:

40° 20'·67N., 8° 54'·29W.
40° 20'·60N., 8° 53'·88W.
40° 20'·08N., 8° 54'·03W.
40° 20'·14N., 8° 54'·44W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 3228 — 3634

5318(T)/25 SPAIN - South West Coast - Bridge. Works.

Source: Spanish Notice 39/297(T)/25

1. Bridge works are taking place at V Centenario Bridge in the area bounded by the following positions:

37° 21'·138N., 5° 59'·627W.

37° 21'·080N., 5° 59'·558W.

37° 20'·752N., 5° 59'·572W.

37° 20'·818N., 5° 59'·662W.

37° 20'·976N., 5° 59'·631W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2980

(7) NORTH ATLANTIC OCEAN

5962(T)/19 NORTH ATLANTIC OCEAN - Buoy.

Source: UKHO

1. An unlit ODAS buoy, has been reported to exist in approximate position 14° 49'·2N., 51° 02'·4W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4012 — 4013 — 4216 — 4407**430(T)/22 NORTH ATLANTIC OCEAN - Buoy.**

Source: NOAA

1. The ODAS light-buoy, *Fl(4)Y.20s42058*, in position 14° 23'·3N., 74° 48'·3W.is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4012 — 4013 — 4400 — 4402**474(P)/22 NORTH ATLANTIC OCEAN - Submarine cable.**

Source: ASN Marine

1. *Work has begun laying the Amitié submarine cable from Nahant Bay (USA) to Forêt Domaniale du Porge (France), joining the following approximate positions:

<i>Segment</i>	<i>Approximate Positions</i>
1·1	42° 27'·41N., 70° 56'·14W. 42° 26'·13N., 70° 51'·24W. 42° 25'·52N., 70° 49'·94W. 42° 23'·22N., 70° 45'·74W. 42° 26'·89N., 70° 48'·98W. 42° 28'·36N., 70° 45'·79W. 42° 30'·40N., 70° 43'·44W. 42° 32'·12N., 70° 39'·87W. 42° 33'·72N., 70° 39'·55W. 42° 34'·38N., 70° 38'·36W. 42° 35'·01N., 70° 36'·24W. 42° 34'·55N., 70° 32'·96W. 42° 37'·04N., 70° 33'·33W. 42° 38'·05N., 70° 32'·82W. 42° 40'·64N., 70° 32'·84W. 42° 41'·45N., 70° 33'·18W. 42° 42'·64N., 70° 31'·96W. 42° 45'·20N., 70° 23'·29W. 42° 45'·41N., 70° 20'·48W. 42° 47'·19N., 70° 15'·17W. 42° 43'·88N., 70° 02'·04W. 42° 41'·48N., 70° 00'·64W. 42° 36'·28N., 69° 50'·05W.

474(P)/22

NORTH ATLANTIC OCEAN - Submarine cable. (continued)

2.

42° 35'·10N., 69° 44'·18W.
42° 26'·23N., 69° 23'·79W.
42° 21'·32N., 69° 01'·28W.
42° 26'·80N., 68° 35'·61W.
42° 32'·26N., 68° 18'·74W.
42° 34'·19N., 68° 01'·68W.
42° 33'·30N., 67° 48'·81W.
42° 21'·43N., 67° 22'·56W.
42° 19'·78N., 67° 15'·97W.
42° 17'·77N., 66° 12'·38W.
42° 02'·43N., 65° 18'·26W.
41° 49'·74N., 64° 32'·16W.
41° 49'·52N., 62° 30'·07W.
42° 08'·78N., 61° 26'·06W.
42° 13'·30N., 60° 52'·30W.
42° 19'·24N., 55° 24'·79W.
42° 33'·89N., 52° 15'·41W.
42° 31'·54N., 51° 58'·33W.
41° 54'·41N., 51° 05'·07W.
41° 44'·80N., 50° 41'·89W.
41° 44'·06N., 50° 29'·81W.
41° 50'·42N., 49° 31'·70W.
41° 44'·74N., 48° 03'·98W.
41° 25'·48N., 47° 03'·49W.

3.

42° 07'·10N., 44° 51'·32W.
42° 59'·36N., 42° 49'·35W.
42° 52'·55N., 42° 00'·34W.
43° 38'·38N., 40° 12'·72W.
43° 37'·64N., 38° 50'·42W.
44° 02'·21N., 37° 37'·74W.
44° 40'·44N., 34° 58'·52W.
44° 57'·56N., 34° 25'·12W.
45° 14'·84N., 32° 14'·21W.
45° 05'·89N., 31° 37'·11W.
45° 14'·64N., 30° 23'·76W.
45° 45'·08N., 28° 16'·10W.
45° 45'·08N., 26° 18'·97W.
46° 09'·30N., 24° 32'·92W.
46° 12'·63N., 23° 37'·60W.
46° 03'·25N., 23° 13'·85W.
46° 08'·88N., 21° 45'·24W.
46° 45'·23N., 18° 26'·41W.
46° 58'·23N., 17° 17'·77W.
46° 54'·02N., 15° 49'·41W.
47° 03'·59N., 15° 05'·99W.
47° 03'·71N., 13° 48'·04W.
47° 22'·94N., 10° 29'·73W.

474(P)/22 NORTH ATLANTIC OCEAN - Submarine cable. (continued)

4.

1·3	47° 22'·94N., 10° 29'·73W.
	47° 16'·62N., 10° 10'·12W.
	46° 57'·68N., 8° 48'·97W.
	46° 43'·67N., 8° 21'·79W.
	46° 28'·60N., 7° 27'·57W.
	46° 18'·64N., 6° 43'·77W.
	45° 49'·67N., 6° 04'·47W.
	45° 40'·14N., 5° 11'·84W.
	45° 32'·75N., 5° 00'·78W.
	45° 03'·83N., 4° 41'·41W.
	44° 54'·94N., 4° 28'·81W.
	44° 48'·34N., 4° 09'·05W.
	44° 41'·70N., 3° 00'·46W.
	44° 37'·72N., 2° 44'·76W.
	44° 34'·24N., 1° 59'·45W.
	44° 53'·58N., 1° 16'·92W.
	44° 53'·70N., 1° 15'·97W.
	44° 53'·56N., 1° 13'·16W.

5. Vessels should navigate with caution in the area.

6. Charts will be updated when the works are complete.

7. Former Notice 5648(P)/20 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 20 — 1104 — 1227 — 2427 — 2483 — 2492 — 2664 — 2666 — 2670 — 4746**1329(T)/22 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Fish havens. Buoyage.**

Source: Portuguese Notices 11/359(T)/21 and 11/361(T)/21

1. Fish aggregating devices (MFAD) have been anchored in the following positions:

38° 23'·26N., 28° 24'·77W.

38° 31'·85N., 28° 51'·27W.

2. The devices consist of several anchored/submerged structures and floating equipment, marked by a yellow light-buoy *F.W.2M* at its end.

3. A safety distance of over 1000m is required.

4. Former Notice 5081(T)/21 is cancelled.

(WGS84 DATUM)

Charts affected — 1950 — 1956**1444(T)/22 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Works. Restricted areas. Piles. Buoyage.**

Source: Portuguese Notices 10/328(T)-329(T)/21 and ENC PT548519

1. Works are in progress at Ponta Delgada.

2. *A restricted area, entry prohibited, marked by lit piles, F.Y, has been established, bounded by the following positions:

37° 44'·23N., 25° 40'·05W.

37° 44'·19N., 25° 40'·05W.

37° 44'·19N., 25° 40'·01W.

37° 44'·23N., 25° 40'·01W.

3. *A restricted area, entry prohibited, has been established bounded by the following positions:

37° 44'·11N., 25° 40'·20W.

37° 44'·10N., 25° 39'·97W.

37° 44'·12N., 25° 39'·97W.

37° 44'·13N., 25° 40'·20W.

4. Red light-buoys, *FLR.1·5sIM* have been established, in the following position:

37° 44'·12N., 25° 39'·98W.

5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

**1444(T)/22 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Works. Restricted areas. Piles. Buoyage.
(continued)**

6. Former Notice 4163(T)/21 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 1895

1387(P)/24 NORTH ATLANTIC OCEAN - Submarine cable. Works.

Source: Alcatel Submarine Networks

1. A submarine cable is due to be laid during 2026, between Manasquan, USA and Blaabjerg, Denmark, joining the following approximate positions:

55° 55'·4N., 8° 09'·0E.
 55° 56'·1N., 8° 06'·6E.
 56° 00'·5N., 7° 58'·8E.
 56° 02'·5N., 7° 54'·8E.
 56° 00'·8N., 7° 41'·7E.
 56° 00'·4N., 7° 33'·7E.
 56° 01'·4N., 7° 29'·6E.
 56° 11'·8N., 6° 53'·9E.
 56° 22'·8N., 6° 17'·4E.
 56° 39'·2N., 5° 40'·3E.
 56° 43'·8N., 5° 24'·3E.
 56° 45'·1N., 5° 06'·5E.
 56° 57'·2N., 4° 49'·2E.
 57° 15'·1N., 4° 16'·5E.
 58° 14'·9N., 3° 09'·4E.
 58° 42'·6N., 2° 57'·0E.
 58° 49'·0N., 2° 52'·4E.
 58° 57'·0N., 2° 41'·7E.
 58° 58'·8N., 2° 37'·2E.
 59° 04'·2N., 2° 05'·1E.
 59° 04'·4N., 1° 11'·4E.
 59° 13'·4N., 0° 28'·7E.
 59° 30'·2N., 0° 48'·9W.
 59° 38'·2N., 1° 30'·6W.

- 2.

59° 48'·4N., 3° 10'·5W.
 59° 49'·0N., 4° 01'·6W.
 59° 39'·4N., 5° 22'·0W.
 59° 36'·1N., 6° 10'·0W.
 59° 30'·6N., 6° 33'·4W.
 59° 27'·0N., 7° 39'·3W.
 58° 47'·2N., 9° 24'·9W.
 58° 26'·2N., 15° 35'·9W.
 41° 31'·9N., 49° 41'·5W.
 41° 17'·2N., 52° 40'·0W.
 40° 57'·3N., 55° 03'·7W.
 40° 55'·4N., 57° 07'·7W.
 40° 35'·2N., 59° 11'·8W.
 40° 35'·0N., 61° 16'·1W.
 40° 25'·3N., 62° 58'·6W.
 39° 56'·8N., 65° 27'·1W.
 39° 45'·1N., 65° 45'·2W.
 39° 15'·4N., 66° 00'·6W.
 39° 04'·0N., 66° 00'·2W.
 38° 48'·7N., 66° 11'·9W.
 38° 45'·1N., 66° 40'·9W.
 38° 29'·4N., 67° 09'·1W.
 38° 25'·1N., 67° 38'·8W.
 38° 27'·3N., 69° 15'·7W.

38° 41'·2N., 70° 15'·9W.

1387(P)/24 NORTH ATLANTIC OCEAN - Submarine cable. Works. (continued)

38° 43'·5N., 71° 17'·4W.
 39° 05'·0N., 72° 13'·4W.
 39° 14'·8N., 72° 26'·0W.
 39° 39'·8N., 73° 13'·8W.
 39° 40'·9N., 73° 18'·2W.
 39° 43'·8N., 73° 19'·8W.
 39° 45'·3N., 73° 19'·2W.
 40° 00'·0N., 73° 30'·3W.
 40° 02'·6N., 73° 36'·9W.
 40° 03'·3N., 73° 45'·8W.
 40° 03'·9N., 73° 47'·0W.
 40° 04'·1N., 73° 55'·1W.
 40° 05'·2N., 73° 58'·3W.
 40° 06'·0N., 73° 59'·0W.
 40° 06'·4N., 73° 59'·5W.
 40° 06'·8N., 74° 01'·0W.
 40° 06'·9N., 74° 02'·0W.

3. Mariners are advised to navigate with caution in the area.
4. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 2 — 219 — 245 — 272 — 274 — 292 — 1119 — 1128 — 1129 — 1234 — 1239 — 1405 — 1422 — 1427 — 1942 — 2182B — 2182C — 2635 — 2666 — 2670 — 2755 — 2860 — 2861 — 4101 — 4102 — 4103 — 4114 — 4140 — 4403 — 4404 — 4407

4677(T)/24 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Buoy.

Source: Portuguese Notice 06/235(T)/2024

1. An ODAS buoy has been established in position 38° 31'·417N., 28° 37'·047W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1957

1168(T)/25 NORTH ATLANTIC OCEAN - Measuring instruments. Restricted areas.

Source: French Notice 2/1(T)/25

1. Oceanographic measuring equipment has been established in the following positions:

23° 20'·1N., 16° 12'·4W.
 23° 22'·8N., 16° 20'·6W.

2. Fishing and anchoring prohibited areas have been established, radius 0·5 M, centred on the above positions.
(WGS84 DATUM)

Chart affected — 3134

1795(P)/25 NORTH ATLANTIC OCEAN - Submarine cables. Works.

Source: Alcatel Submarine Networks and UKHO

1. Cable installation works are planned between 2022 and 2024 to install the 2 Africa West telecommunications cable joining the following positions for water less than 200m deep:

Segment
 Port-Bouet

Lomé

Approximate Positions
 5° 14'·03N., 3° 53'·60W.
 5° 12'·62N., 3° 53'·22W.
 5° 07'·66N., 3° 49'·94W.
 5° 03'·51N., 3° 47'·59W.
 4° 57'·33N., 3° 46'·84W.
 6° 10'·83N., 1° 23'·51E.
 5° 58'·62N., 1° 28'·33E.

2. Charts will be updated when full details are available.

1795(P)/25 NORTH ATLANTIC OCEAN - Submarine cables. Works. (continued)

3. *Former Notice 5507(P)/24 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 1392 — 3100 — 3101

2703(T)/25 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Buoy.

Source: Portuguese Notice 4/191(T)/25

1. The Ponta Delgada ODAS light-buoy, *Fl(5)Y.20s 1M*, in position 37° 43'·86N., 25° 39'·85W. is reported off station.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — 1895

3141(T)/25 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Buoy.

Source: Portuguese Notice 5/193(T)/25

1. The ODAS buoy, *Fl(5)Y.20s*, in position 39° 05'·09N., 27° 57'·34W. is has been removed.
 (WGS84 DATUM)

Chart affected — 1956

3907(T)/25 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Buoy.

Source: Portuguese Notice 6/214(T)/25

1. The ODAS light-buoy, *Fl(5)Y.20s BOND 2*, in position 37° 43'·58N., 25° 43'·22W. has been temporarily replaced by a light-buoy, *VQ*.
 (WGS84 DATUM)

Chart affected — 1895

4031(T)/25 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Buoy.

Source: Portuguese Notice 6/215(T)/25

1. The lateral light-buoy, *Fl(2)R.12s*, in position 39° 22'·80N., 31° 09'·87W. is reported off station.
 (WGS84 DATUM)

Chart affected — 1959

4320(T)/25 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Buoy.

Source: Portuguese Notice 7/236(T)/25

1. An ODAS buoy, *Fl(5)Y.20s ODAS BOND 1*, has been removed from position 38° 44'·84N., 27° 00'·22W.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — 1956

4768(T)/25 NORTH ATLANTIC OCEAN - Arquipélago dos Açores - Buoy.

Source: Portuguese Notice 8/258(T)/25

1. The ODAS buoy, *Fl(5)Y.20s BOND 5*, in position 39° 05'·09N., 27° 57'·33W. has been replaced by a yellow, sphere buoy with radar reflector until further notice.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
 (WGS84 DATUM)

Chart affected — 1956

5804(P)/25 NORTH ATLANTIC OCEAN - Islas Canarias - Submarine cables.

Source: Red Eléctrica

1. Submarine cables are being laid between Tenerife and La Gomera, joining the following positions:

28° 05'·274N., 17° 06'·482W.

28° 05'·268N., 17° 06'·718W.

2. and

28° 12'·9N., 16° 50'·2W.

28° 12'·9N., 16° 50'·6W.

28° 13'·3N., 16° 51'·5W.

28° 13'·1N., 16° 52'·5W.

28° 12'·8N., 16° 53'·4W.

28° 13'·0N., 16° 58'·0W.

28° 12'·3N., 16° 59'·8W.

28° 11'·3N., 17° 00'·9W.

28° 11'·3N., 17° 01'·9W.

28° 10'·8N., 17° 02'·6W.

28° 06'·9N., 17° 04'·6W.

28° 05'·7N., 17° 04'·6W.

28° 05'·3N., 17° 05'·6W.

28° 05'·2N., 17° 05'·9W.

28° 05'·3N., 17° 06'·3W.

28° 05'·3N., 17° 06'·4W.

3. and

28° 12'·9N., 16° 50'·2W.

28° 12'·5N., 16° 53'·7W.

28° 12'·8N., 16° 54'·0W.

28° 12'·6N., 16° 57'·8W.

28° 11'·0N., 17° 00'·6W.

28° 11'·0N., 17° 01'·8W.

28° 10'·6N., 17° 02'·6W.

28° 06'·9N., 17° 04'·5W.

28° 05'·6N., 17° 04'·5W.

28° 05'·4N., 17° 05'·1W.

28° 05'·2N., 17° 05'·8W.

28° 05'·2N., 17° 06'·0W.

28° 05'·3N., 17° 06'·3W.

28° 05'·3N., 17° 06'·4W.

4. Mariners are advised to navigate with caution in the area.
5. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 1858 — 1861 — 3133 — 3134

(8) MEDITERRANEAN AND BLACK SEAS

938(T)/12 RUSSIA - Black Sea Coast - Scientific instruments.

Source: Russian Notice 2/103(T)/12

1. Submerged scientific instruments have been temporarily established in position 44° 01'·10N., 37° 00'·50E. (WGS84 Datum).

Charts affected — 2214 — 2233**4211(T)/16 RUSSIA - Black Sea Coast - Works. Buoyage.**

Source: Russian Notices 7/945(T)/13 and 30/3981(T)/16

1. Works are in progress within an area bounded by the following positions:

44° 42'·888N., 37° 50'·546E. (shore)
 44° 42'·634N., 37° 49'·942E.
 44° 42'·675N., 37° 49'·513E.
 44° 42'·967N., 37° 49'·080E.
 44° 43'·180N., 37° 49'·265E.
 44° 43'·026N., 37° 49'·928E. (shore)

2. * Lateral light-buoys have been established within Novorossiysk Port as follows:

<i>Buoy Type</i>	<i>Characteristic</i>	<i>Position</i>
Starboard hand	<i>Fl.G.3s</i>	44° 42'·91N., 37° 49'·33E.
Port hand	<i>Fl.R.3s</i>	44° 42'·94N., 37° 49'·28E.

3. Former Notice 1179(T)/13 is cancelled.

* Indicates new or revised entry
 (WGS84 Datum)

Chart affected — 3318**5194(T)/16 RUSSIA - Black Sea Coast - Buoy.**

Source: Russian Notice 38/5110(T)/16

1. A mooring buoy has been temporarily established in position 45° 01'·19N., 36° 58'·35E. (Pulkovo 1942 Datum)

Chart affected — 2216**5398(T)/16 RUSSIA - Black Sea Coast - Measuring instruments.**

Source: Russian Notice 39/5260(T)/16

1. Submarine measuring instruments have been established in position 43° 33'·3N., 36° 23'·2E.
2. Mariners are advised to avoid anchoring or trawling in the vicinity of this mooring. (WGS84 Datum)

Chart affected — 2233**3738(P)/17 LIBYA - Anchorage areas. Submarine pipelines. Buoyage. Restricted area.**

Source: Libyan Ports and Maritime Transport Authority

1. The Al Khalij (Surt) Power and Desalinisation Station is now operational in position, 31° 13'·100N. , 16° 20'·850E. An anchorage area, SPM and pipelines have been established offshore of the plant as follows (see accompanying diagram).
2. A circular anchorage area, diameter 1NM, has been established, centred on position 31° 14'·700N. , 16° 22'·200E.
3. A SPM mooring light-buoy with ground tackle, *Mo(U)15s Horn(U)30s*, has been established in position 31° 14'·431N. , 16° 21'·229E.

Centred on the SPM is:

- a. A vessel manoeuvring area, radius 624m, for vessels with a maximum draft of 11·3m, also
- b. Within a radius of 225m exist two floating hoses equipped with winker lights every 36·6m.
- c. The depth of water at the SPM is reported to be:
 - i. 26·7m at High Water
 - ii. 25·5m at MSL
 - iii. 24·5m at Chart Datum

3738(P)/17 LIBYA - Anchorage areas. Submarine pipelines. Buoyage. Restricted area. (continued)

4. Connecting the SPM to shore are Oil and Gas submarine pipelines which have been established between the following positions:

31° 13'·300N., 16° 21'·015E. (shore)

31° 14'·431N., 16° 21'·229E. (SPM)

5. A water intake submarine pipeline has been established between the following positions:

Position**Remarks**

31° 13'·320N., 16° 20'·800E. (shore)

31° 13'·836N., 16° 20'·594E.

Marked by unlit yellow special mark buoys

6. A discharge submarine pipeline has been established between the following positions:

Position**Remarks**

31° 13'·280N., 16° 21'·240E. (shore)


31° 13'·428N., 16° 21'·410E.

Marked by unlit yellow special mark buoys

7. Mariners are advised to navigate with caution in the area and consult the local authorities for the latest information.
8. Charts will be updated when full details are available.
9. Former Notice 84(P)/17 is cancelled.
(WGS84 Datum)

Chart affected — 3402

To accompany Notice to Mariners 3738(P)/17

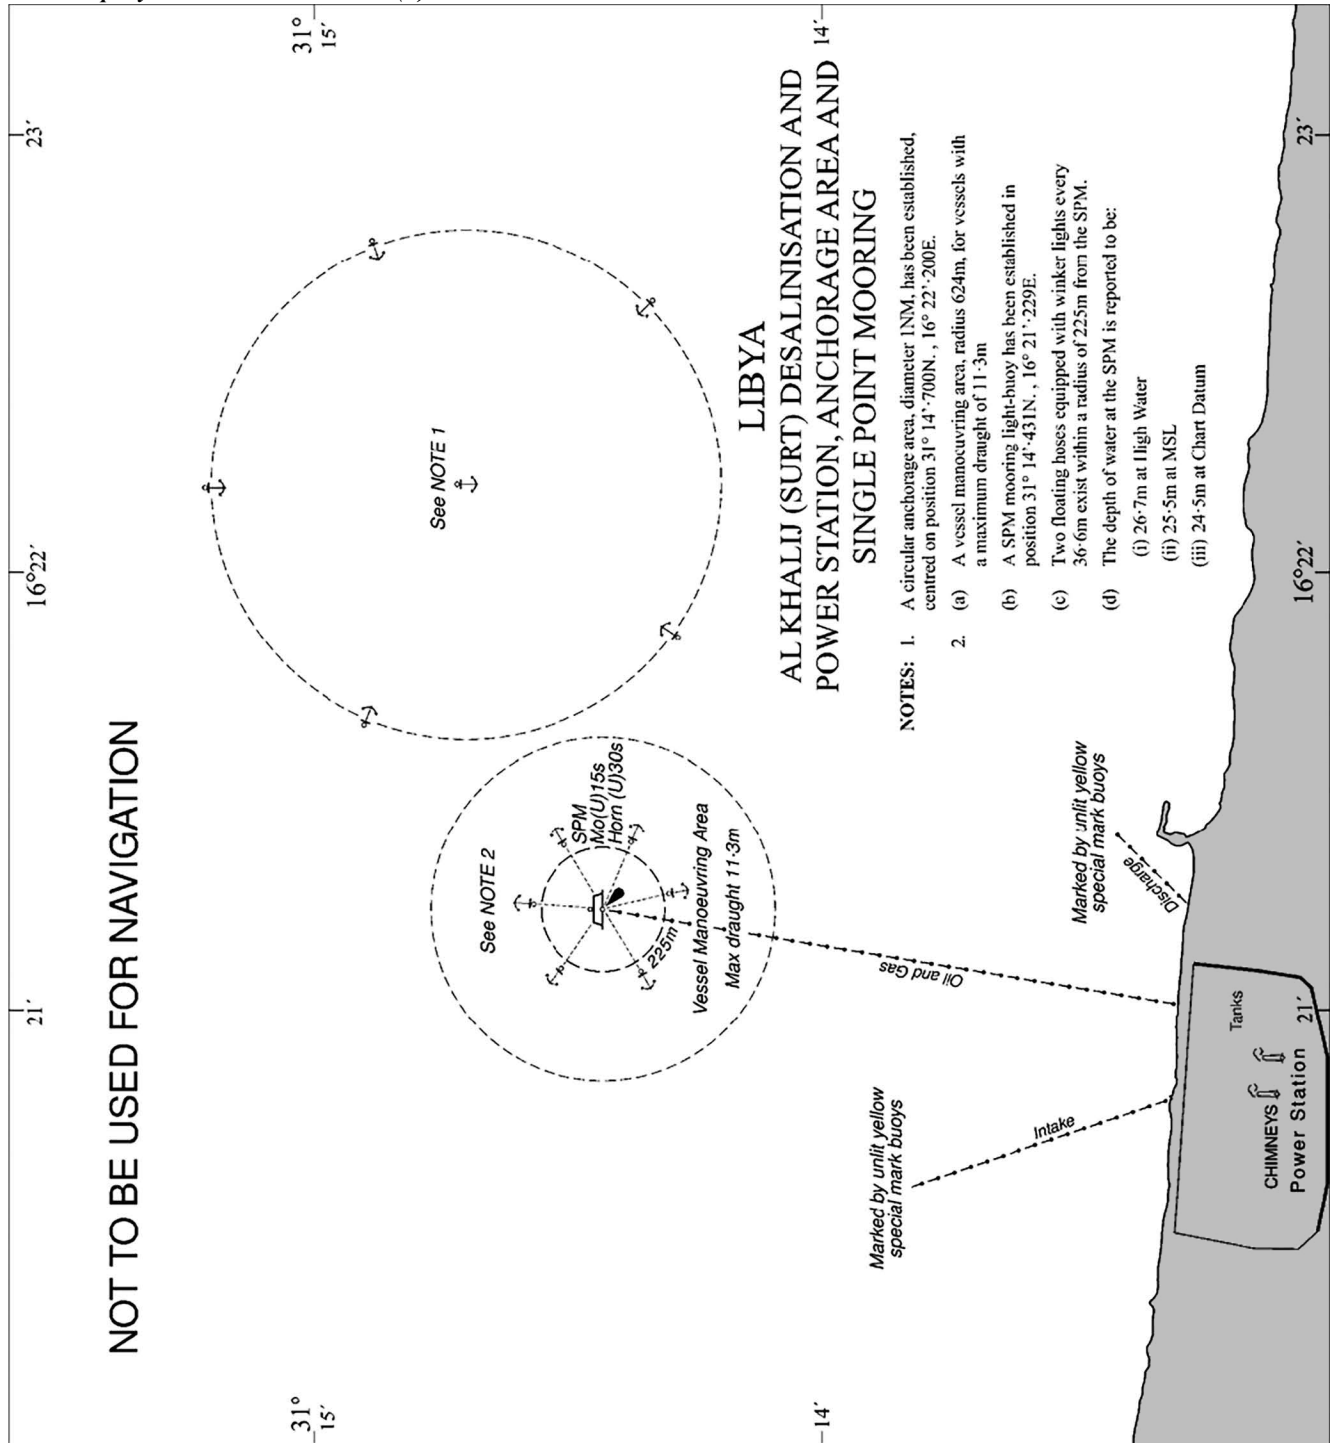

5712(T)/17 CROATIA - Buoyage.

Source: Croatian Notices 10/4(T)-5(T)/17

- Two yellow special purpose light-buoys, *Fl. Y*, have been established in the following positions:

45° 17'·728N., 14° 32'·978E.

45° 17'·705N., 14° 33'·012E.

(WGS84 DATUM)

Chart affected — 1996**3440(T)/18 RUSSIA - Black Sea Coast - Buoy.**

Source: Russian Notice 26/3508(T)/18

- A south cardinal light-buoy, *Q(6)+LFl.15s*, has been temporarily established in position 45° 20'·23N., 36° 39'·38E.
(PULKOVO 1942 DATUM)

Chart affected — 2242**4669(T)/18 RUSSIA - Black Sea Coast - Buoy.**

Source: Russian Notice 36/4834(T)/18

- A south cardinal pillar buoy has been established in position: 45° 07'·58N., 36° 38'·43E.
(PULKOVO 1942 DATUM)

Chart affected — 2242**1659(T)/19 RUSSIA - Black Sea Coast - Buoy.**

Source: Russian Notice 7/728(T)/19

- An isolated danger light-buoy, *Fl(2)5s*, has been established in position 44° 43'·182N., 37° 47'·249E.
- Former Notice 488(T)/19 is cancelled.
(WGS84 DATUM)

Chart affected — 3318**3604(P)/19 GREECE - Aegean Sea Coast - Dredging area. Works.**

Source: Greek Notice 5/88/19

- Dredging works are taking place in the area bounded by the following positions:

37° 34'·04N., 22° 47'·23E.

37° 34'·09N., 22° 47'·47E.

37° 34'·15N., 22° 47'·67E.

37° 34'·30N., 22° 47'·83E.

37° 34'·29N., 22° 48'·03E.

37° 34'·07N., 22° 48'·02E.

37° 34'·08N., 22° 47'·83E.

37° 34'·10N., 22° 47'·77E.

37° 34'·03N., 22° 47'·52E.

37° 33'·96N., 22° 47'·30E.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Chart 1683 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1683**5467(T)/19 ALGERIA - Buoy.**

Source: Algerian Notice 15/1/19

- The red spherical light-buoy, *Fl(2)R.6s*, in position 36° 44'·802N., 5° 05'·985E. is reported off station.
(UNDETERMINED DATUM)

Chart affected — 1710

6397(P)/19 UKRAINE - General information.

Source: Ukrainian Notice 42/531/19

1. Aids to navigation on the coast of the Crimean Peninsula are temporarily out of the control of the State Hydrographic Service of Ukraine.
2. You are requested to inform Centre of Navigational and Hydrographic Information (CNHI) of the State Hydrographic Service of Ukraine about any changes in navigational circumstances affecting the safety of navigation.

CNHI of the State Hydrographic Service of Ukraine
23, Yu. Gagarina Ave., Kyiv, 02094
tel./fax: +38 044 292 41 20
mob. tel.: +38 050 411 84 73
e-mail: navtex@ukr.net, navtexukr@gmail.com

3. Mariners are requested to proceed with caution.
4. Former Notice 2644(P)/14 is cancelled.

Charts affected — 2214 — 2216 — 2217 — 2232 — 2233 — 2234 — 2242

6406(T)/19 ROMANIA - Buoyage.

Source: Romanian Notice 10/233(T)/19

1. The following east cardinal light-buoys, *Q(3)*, have been reported missing:

44° 04'·48N., 28° 38'·64E.
44° 04'·20N., 28° 38'·67E.
44° 03'·96N., 28° 38'·74E.
(WGS84 DATUM)

Chart affected — 2284

679(T)/20 MALTA - Wreck. Buoy.

Source: Transport Malta

1. A dangerous wreck, marked by an emergency wreck marking light-buoy, *Al.Oc.BuY.3s*, exists in position 35° 50'·29N., 14° 32'·75E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 36

1352(T)/20 ITALY - Sicilia - Obstruction.

Source: Italian Notice 3.33(T)/20

1. An obstruction is reported to exist in the entrance to Marsala (37° 47'·232N., 12° 26'·277E.)
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 964

1635(T)/20 UKRAINE - Buoyage.

Source: Ukrainian Notice 7/103(T)/20.

1. Unlit red pillar buoys are reported missing in the following positions:

46° 56'·4N., 31° 58'·4E.
46° 56'·4N., 31° 58'·2E.

2. The red pillar buoy, in position 46° 56'·4N., 31° 58'·6E., is reported submerged.
(WGS84 DATUM)

Chart affected — 2203

5235(T)/20 RUSSIA - Black Sea Coast - Works.

Source: Russian Notice 38/3441(T)/20

1. Works are in progress within an area bounded by the following positions:

45° 07'·30N., 36° 37'·97E.
 45° 07'·50N., 36° 37'·68E.
 45° 07'·92N., 36° 38'·43E.
 45° 07'·85N., 36° 38'·55E.
 45° 07'·62N., 36° 38'·17E.
 45° 07'·50N., 36° 38'·25E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2242**5237(T)/20 RUSSIA - Black Sea Coast - Works. Light-beacons.**

Source: Russian Notices 37/4321(T)/19 and 38/3445(T)/20

1. Works are in progress within an area bounded by the following positions:

44° 43'·32N., 37° 49'·06E.
 44° 43'·29N., 37° 49'·13E.
 44° 43'·10N., 37° 49'·01E.
 44° 43'·12N., 37° 48'·94E.

2. Light-beacons, Fl.Y, have been established in the following positions:

44° 43'·292N., 37° 49'·131E.
 44° 43'·092N., 37° 49'·014E.

3. Former notice 5192(T)/19 is cancelled.
(WGS84 DATUM)

Chart affected — 3318**5448(P)/20 GREECE - Aegean Sea Coast - Depths. Obstructions. Buoyage.**

Source: Greek Chart 322/1

1. Depths less than charted exist within the Port of Alexandroupoli and its approaches. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
5·7m	40° 50'·37N., 25° 53'·75E.
6·1m	40° 50'·16N., 25° 53'·76E.
6·5m	40° 50'·04N., 25° 54'·29E.
1·4m	40° 50'·66N., 25° 52'·81E.
2·6m	40° 50'·41N., 25° 53'·93E.
5·4m	40° 50'·01N., 25° 54'·74E.

2. Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
2·8m	40° 50'·67N., 25° 53'·49E.
5·0m	40° 50'·34N., 25° 54'·74E.

3. Unlit conical special buoys have been established in the following positions:

40° 50'·08N., 25° 55'·10E.
 40° 50'·11N., 25° 54'·90E.
 40° 50'·32N., 25° 54'·66E.

4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 1636

384(T)/21 GEORGIA - Marine farm.

Source: Georgian Circular 19/20

1. A marine farm has been established, in an area bounded by the following positions:

41° 45′·46N., 41° 42′·83E.

41° 45′·46N., 41° 43′·19E.

41° 45′·22N., 41° 43′·00E.

41° 45′·23N., 41° 42′·63E.

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Chart affected — 3313**1059(T)/21 ITALY - East Coast - Buoy.**

Source: ENC IT300035

1. The special purpose yellow can light-buoy, *Fl.Y.3s*, in position 42° 49′·9N., 14° 07′·2E. is reported missing.

(WGS84 DATUM)

Chart affected — 200**2417(P)/21 EGYPT - North Coast - Works. Reclamation area.**

Source: ENC EG4EGM12

1. Reclamation works are taking place for a new Abu Qir container terminal in the vicinity of position

31° 20′·23N., 30° 04′·49E.

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Chart affected — 2681**2670(T)/21 ROMANIA - Dredged area. Spoil grounds.**

Source: Romanian Notices 2/49(T)/19 and 2/50(T)/19

1. *Dredging works are taking place in Constanta harbour.
2. Spoil ground areas have been established within an area bounded by the following positions:

43° 47′·51N., 28° 36′·05E.

43° 47′·28N., 28° 35′·79E.

43° 47′·12N., 28° 36′·15E.

43° 47′·36N., 28° 36′·36E.

and

44° 05′·95N., 28° 40′·10E.

44° 05′·72N., 28° 40′·08E.

44° 05′·71N., 28° 40′·20E.

44° 05′·94N., 28° 40′·22E.

3. Mariners are advised to navigate with caution in the area.

4. Former Notice 1887(T)/19 is cancelled.

* Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 2282 — 2284

3886(P)/21 EGYPT - North Coast - Breakwater. Works. Dredging area. Reclamation area.

Source: ENC EG5EGM21

1. Breakwater construction works are taking place in Mīnā' Dūmyāṭ (Damietta Port), joining the following positions:

31° 28'·74N., 31° 44'·37E.

31° 29'·87N., 31° 44'·10E.

31° 30'·50N., 31° 44'·64E.

31° 30'·61N., 31° 45'·58E.

31° 31'·10N., 31° 45'·70E.

and

31° 29'·30N., 31° 45'·76E.

31° 30'·35N., 31° 46'·01E.

2. Dredging and reclamation works are taking place in the area bounded by the following positions:

31° 35'·15N., 31° 46'·90E.

31° 26'·79N., 31° 46'·70E.

31° 28'·37N., 31° 43'·25E.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. Charts will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 2578**4128(T)/21 UKRAINE - Buoy.**

Source: UKHO

1. The special purpose light-buoy, *Fl.Y.5s*, in position 44° 38'·82N., 33° 17'·00E. is reported off station.
2. Mariners are advised to navigate with caution in the area.
(PULKOVO 1942 DATUM)

Charts affected — 2217 — 2232**4263(T)/21 RUSSIA - Black Sea Coast - Buoyage.**

Source: Russian Notice 25/2635(T)/21

1. Special pillar light-buoys, *Fl.Y.3s*, have been deployed, until further notice, in the following positions:

45° 07'·26N., 36° 37'·60E.

45° 07'·29N., 36° 37'·66E.

45° 05'·26N., 36° 37'·60E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2216 — 2242**4414(T)/21 RUSSIA - Black Sea Coast - Buoy. Scientific instruments.**

Source: Russian Notice 27/2909(T)/21

1. A lit pillar buoy, *Fl.W*, has been established in position 44° 33'·14N., 37° 58'·48E.
2. Submerged instruments, depth unknown, have been established in position 44° 46'·63N., 37° 20'·61E.
3. A submerged instrument area has been established with a radius of 926m (0·5M), centred on 44° 47'·34N., 37° 22'·41E.
4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2216 — 2233 — 3311**4677(T)/21 RUSSIA - Black Sea Coast - Buoy.**

Source: Russian Chart 33112

1. The west cardinal light-buoy, *Q(9)15s*, in position 44° 41'·92N., 37° 26'·52E. is reported missing.

4677(T)/21 RUSSIA - Black Sea Coast - Buoy. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2216 — 2233 — 3311

5172(T)/21 TURKEY - İstanbul Boğazi - Buoy.

Source: Turkish Notice 38/129(T)/21

- The green conical light-buoy, *Fl.G.3s*, in position 41° 04'·48N., 29° 02'·76E. is reported missing.
(WGS84 DATUM)

Charts affected — 1159 — 1198

520(P)/22 SPAIN - Mediterranean Sea Coast - Depths. Dredged areas.

Source: Spanish Chart 4811

- *Changes to depths have taken place within and in the approaches to the port of Valencia.
- *Dredged areas centred on the following positions no longer exist:

<i>Depth</i>	<i>Position</i>
17m (2010)	39° 26'·08N., 0° 19'·28W.
17m (2010)	39° 26'·32N., 0° 18'·44W.
18m (2010)	39° 25'·87N., 0° 18'·28W.
8m (2006)	39° 27'·50N., 0° 19'·66W.
12m (2006)	39° 27'·74N., 0° 18'·59W.
- *Chart 562 should be consulted for detailed depth information within and in the approaches to the port.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- *These and other changes will be included in the next New Edition of Chart 518.
- Former Notice 3192(P)/21 is cancelled.
*indicates new or revised entry
(WGS84 DATUM)

Chart affected — 518

1118(T)/22 RUSSIA - Black Sea Coast - Buoyage.

Source: ENC RU6MCLR0 and UKHO

- It has been reported that cardinal light-buoys have been removed from the following positions:

<i>Buoy Type</i>	<i>Characteristic</i>	<i>Position</i>
East Cardinal	<i>Q(3)10s</i>	44° 04'·81N., 39° 03'·74E.
West Cardinal	<i>Q(9)15s</i>	44° 04'·82N., 39° 04'·07E.
South Cardinal	<i>Q(6)+LFl.15s</i>	44° 05'·10N., 39° 04'·27E.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3312

1274(T)/22 ALGERIA - Buoy.

Source: Algerian Notice 24/10/21

- The yellow pillar light-buoy, *Fl(3)Y.9s*, in position 36° 46'·72N., 3° 10'·18E. is reported off station.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 855

2002(T)/22 ALGERIA - Buoy.

Source: Algerian Notice 3/3/22

- The light-buoy, *Q(12)15s*, in position 36° 43'·95N., 5° 06'·83E. is reported off station.

2002(T)/22 ALGERIA - Buoy. (continued)

- Mariners are advised to navigate with caution in the area.
(UNDETERMINED DATUM)

Chart affected — 1710**4792(T)/22 CROATIA - Buoy.**

Source: Croatian Notice 6/5(T)/22

- A yellow waverider light-buoy, *Fl(5)Y.20s4M*, has been established, in position 43° 29'·34N., 16° 27'·68E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 269 — 2712**5085(T)/22 SLOVENIA - Anchor berths.**

Source: Slovenian Notice 11/1(T)/22

- Temporary anchorage berths have been established in the approaches to the Port of Koper in the following positions:

<i>Designation</i>	<i>Position</i>
T1	45° 35'·47N., 13° 38'·13E.
T2	45° 35'·46N., 13° 37'·37E.
T3	45° 35'·54N., 13° 36'·56E.
T4	45° 35'·96N., 13° 37'·44E.
T5	45° 33'·71N., 13° 38'·95E.
T6	45° 33'·74N., 13° 38'·14E.
T7	45° 33'·79N., 13° 37'·30E.
T8	45° 33'·85N., 13° 36'·46E.
T9	45° 33'·90N., 13° 35'·63E.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Former Notice 4197(T)/22 is cancelled
(WGS84 DATUM)

Charts affected — 204 — 1461**223(T)/23 GEORGIA - Scientific instruments. Buoyage.**

Source: Georgian Circular Notice 20/22

- Scientific instruments, marked by red unlit buoys, have been established in the following positions:

41° 39'·965N., 41° 38'·931E.
and
41° 38'·320N., 41° 34'·912E.

- Mariners are advised to navigate with caution in the area and keep a distance of 200m radius from the above positions.
(WGS84 DATUM)

Charts affected — 3313 — 3317**291(P)/23 ISRAEL - Mediterranean Sea Coast - Works.**

Source: Israeli Notice 172/22

- Gas pipeline laying operations are taking place within an area between the approaches to the ports of Ashqelon and Ashdod.

291(P)/23 ISRAEL - Mediterranean Sea Coast - Works. (continued)

2. All marine activities including anchoring and fishing are prohibited within 1NM of a line joining the following positions:

31° 51'·50N., 34° 39'·30E.
 31° 52'·53N., 34° 38'·35E.
 31° 53'·08N., 34° 36'·73E.
 31° 53'·00N., 34° 35'·90E.
 31° 52'·47N., 34° 34'·92E.
 31° 47'·92N., 34° 32'·37E.
 31° 41'·50N., 34° 27'·95E.
 31° 40'·57N., 34° 27'·68E.
 31° 39'·73N., 34° 28'·42E.
 31° 39'·17N., 34° 29'·85E.

3. The works vessel, MV SEMINOLE, may be at anchor anywhere within this area. Anchor cables extending up to 800 meters in length will be established around the vessel.
4. All marine activities are prohibited within 1·5NM of the works vessel.
5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
6. Charts will be updated when full details are available.
 (WGS84 DATUM)

Charts affected — 1591 — 2634

452(T)/23 ROMANIA - Data collection buoys.

Source: Romanian Notice 8/78(T)/22

1. Unlit data collection buoys have been established in the following positions:

44° 10'·04N., 28° 39'·82E.
 44° 15'·41N., 28° 38'·04E.

2. Mariners are advised to navigate with caution in the area.
3. Former Notice 2154(T)/22 is cancelled.
 (WGS84 DATUM)

Charts affected — 2282 — 2284

906(T)/23 GEORGIA - Scientific instruments.

Source: Georgian Circular Notice 23/22

1. Scientific equipment has been deployed in the following positions:

41° 40'·198N., 41° 39'·074E.
 41° 39'·779N., 41° 40'·280E.
 41° 39'·146N., 41° 39'·853E.

2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — 3317

1741(T)/23 CROATIA - Restricted area.

Source: Croatian Notice 10/2(T)/22

1. A circular limit of restricted area, entry prohibited, radius 500m, centred on 44° 58'·55N., 13° 41'·00E., has been temporarily established until further notice.
 (WGS84 DATUM)

Charts affected — 201 — 1461

2502(T)/23 UKRAINE - Channel.

Source: Ukrainian Notice 9/127(T)/22

1. Transit of all vessels between the First Elbow of the Buz'ko-Dniprovs'ko Lymans'kyi Kanal (46° 34'·73N., 31° 25'·59E.) and the Third Elbow of the Spasskiy Kanal (46° 57'·14N., 31° 55'·12E.) is prohibited until further notice.
2. *Former Notice 4313(T)/22 is cancelled.

2502(T)/23 UKRAINE - Channel. (continued)

3. *NOTE: Content of Notice unchanged, re-issued to include Charts 2205 and 2212.

*Indicates new or revised information

(WGS84 DATUM)

Charts affected — 2200 — 2201 — 2203 — 2205 — 2212

2503(P)/23 UKRAINE - General information.

Source: UKHO

1. It has been reported that mined areas, entry prohibited, have been established bounded by the following positions:

46° 04'·4N., 30° 28'·4E.

46° 04'·5N., 30° 31'·1E.

45° 58'·0N., 30° 28'·0E.

45° 48'·1N., 30° 18'·3E.

45° 31'·3N., 29° 46'·8E.

45° 29'·7N., 29° 45'·0E.

and

46° 19'·0N., 30° 40'·8E.

46° 18'·4N., 30° 43'·1E.

46° 17'·5N., 30° 43'·2E.

46° 04'·7N., 30° 31'·3E.

46° 04'·6N., 30° 28'·4E.

and

46° 14'·8N., 30° 37'·6E.

46° 11'·9N., 30° 47'·1E.

46° 20'·2N., 30° 53'·1E.

46° 22'·5N., 30° 45'·1E.

and

46° 36'·0N., 31° 00'·8E.

46° 33'·4N., 30° 59'·7E.

46° 30'·9N., 30° 49'·8E.

46° 31'·7N., 30° 46'·6E.

46° 31'·5N., 30° 44'·2E.

2.

and

46° 33'·7N., 30° 52'·3E.

46° 31'·1N., 30° 54'·9E.

46° 31'·0N., 30° 55'·9E.

46° 29'·6N., 30° 56'·4E.

46° 30'·8N., 31° 06'·6E.

46° 36'·6N., 31° 04'·3E.

and

46° 36'·7N., 31° 31'·8E.

46° 36'·2N., 31° 30'·7E.

46° 34'·7N., 31° 25'·1E.

46° 35'·5N., 31° 23'·3E.

46° 35'·5N., 31° 21'·7E.

46° 34'·9N., 31° 21'·7E.

46° 35'·2N., 31° 05'·9E.

46° 35'·7N., 31° 05'·7E.

46° 35'·2N., 31° 01'·3E.

46° 34'·5N., 31° 00'·5E.

46° 35'·8N., 31° 01'·0E.

and

46° 21'·8N., 31° 30'·3E.

46° 28'·1N., 31° 28'·4E.

46° 34'·7N., 31° 26'·1E.

46° 35'·6N., 31° 29'·6E.

46° 34'·9N., 31° 30'·5E.

2503(P)/23 UKRAINE - General information. (continued)

3.

46° 22'·2N., 31° 31'·9E.

and

46° 27'·9N., 31° 00'·8E.

46° 32'·4N., 31° 01'·2E.

46° 32'·6N., 31° 26'·3E.

46° 28'·0N., 31° 27'·9E.

and

46° 00'·9N., 33° 04'·8E.

46° 00'·9N., 33° 05'·5E.

45° 59'·5N., 33° 05'·5E.

45° 58'·2N., 32° 54'·2E.

46° 07'·0N., 32° 05'·5E.

46° 09'·4N., 32° 06'·6E.

and

46° 04'·0N., 33° 12'·8E.

46° 03'·1N., 33° 13'·9E.

45° 55'·6N., 33° 08'·1E.

45° 49'·2N., 32° 48'·1E.

45° 57'·3N., 32° 54'·5E.

45° 59'·3N., 33° 06'·8E.

46° 00'·9N., 33° 06'·8E.

and

46° 06'·2N., 32° 05'·4E.

45° 57'·4N., 32° 53'·3E.

45° 49'·2N., 32° 47'·0E.

4.

45° 59'·7N., 32° 02'·4E.

5. *Former Notice 4689(P)/22 is cancelled.

6. *NOTE: Content of Notice unchanged, re-issued to include Charts 2205, 2212 and 2243.

*Indicates new or revised information.

(WGS84 DATUM)

Charts affected — 2200 — 2202 — 2205 — 2212 — 2213 — 2214 — 2232 — 2243**2506(T)/23 UKRAINE - Spoil ground. Virtual aid to navigation.**

Source: Ukrainian Notice 5/63(T)/22

1. A dumping ground, radius 1000m, has been established, centred on position 46° 28'·11N., 31° 21'·88E.

2. A virtual aid to navigation (V-AIS), X-Shape topmark, has been established marking the dumping ground.

3. Mariners are advised to navigate with caution in the area.

4. *Former Notice 2344(T)/22 is cancelled.

5. *NOTE: Content of Notice unchanged, re-issued to include Charts 2205 and 2212.

*Indicates new or revised information.

(WGS84 DATUM)

Charts affected — 2200 — 2205 — 2212**2841(P)/23 LEBANON - Traffic separation scheme. Anchorage areas. Precautionary area. Pilot boarding place.**

Source: French Notice 22/12(P)/23, Lebanese Navy Hydrographic Service and UKHO

1. A traffic separation scheme has been established in the approaches to Beyrouth (Beirut) (33° 56'·75N., 35° 30'·49E.). The details of the new scheme are shown in the accompanying diagram, along with amendments to the limits of the existing anchorage areas.

2841(P)/23 LEBANON - Traffic separation scheme. Anchorage areas. Precautionary area. Pilot boarding place. (continued)

2. The new traffic separation scheme has been established to access Jun El Khudr (Baie Saint-Georges) and the port of Beyrouth (Beirut) in the following positions:

33° 56'·220N., 35° 33'·350E.

33° 57'·38N., 35° 32'·10E.

33° 57'·36N., 35° 28'·26E.

33° 57'·9N., 35° 14'·4E.

and

33° 55'·420N., 35° 32'·290E.

33° 56'·120N., 35° 31'·530E.

33° 56'·10N., 35° 28'·26E.

33° 55'·5N., 35° 13'·8E.

3. A separation zone runs from the open sea on an axis of 090° - 270° along latitude 33° 56' .74N, then along an axis of 140° - 320°, where it ends in a precautionary area.
4. *The former approach route, in position 33° 54'·1N., 35° 19'·0E., is no longer in force.
5. The limits of the West anchorage have been amended as follows:

33° 54'·900N., 35° 30'·300E.

33° 54'·600N., 35° 30'·300E.

33° 54'·600N., 35° 31'·460E.

33° 54'·900N., 35° 31'·460E.

6. The North anchorage has been replaced by two new anchorage areas, bounded by the following positions:

33° 56'·47N., 35° 34'·95E.

33° 57'·24N., 35° 33'·94E.

33° 57'·09N., 35° 33'·36E.

33° 56'·70N., 35° 33'·21E.

33° 56'·210N., 35° 33'·410E.

33° 55'·420N., 35° 34'·240E.

33° 55'·320N., 35° 34'·600E.

and

33° 58'·00N., 35° 34'·13E.

33° 57'·40N., 35° 34'·07E.

33° 57'·34N., 35° 34'·07E.


33° 56'·66N., 35° 35'·00E.

33° 58'·00N., 35° 35'·63E.

7. The pilot boarding place is now in position 33° 55'·190N., 35° 32'·700E., within the new precautionary area.
8. Mariners are advised to navigate with caution in the area and consult local port authorities for latest information.
9. Charts will be updated when full details are available.
10. *Former Notice 2145(P)/23 is cancelled.
* Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2633 — 2634

To accompany Notice to Mariners 2841(P)/23

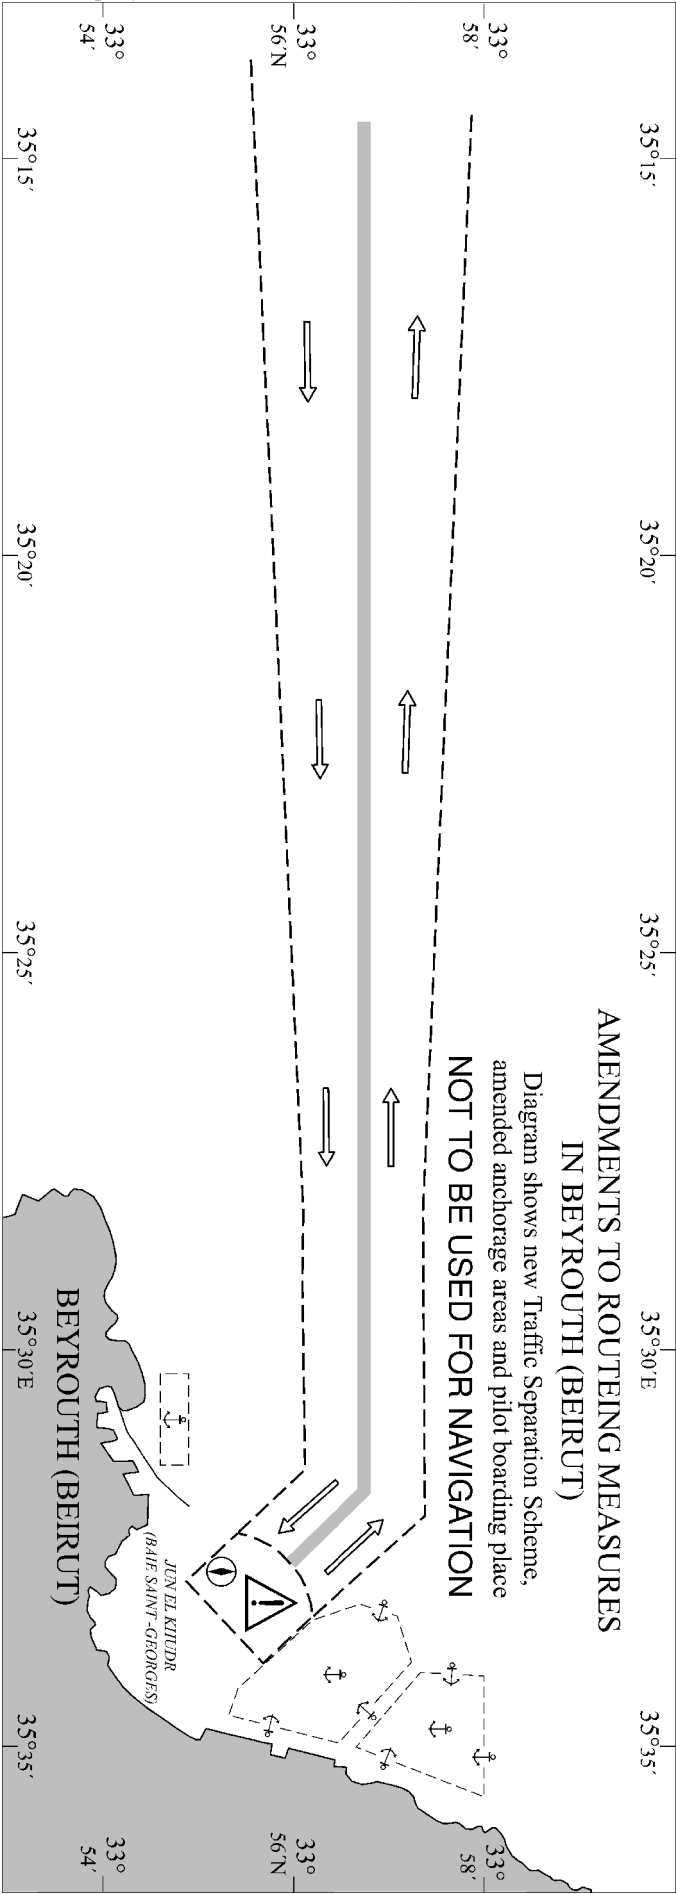

3527(P)/23 ITALY - Sicilia - Submarine pipeline. Restricted area.

Source: Italian Notices 13.31(T)-32(T)/23

1. A submarine pipeline is being laid within an area bounded by the following positions:

37° 02'·9N., 14° 16'·4E.
36° 51'·9N., 14° 14'·7E.
36° 53'·0N., 13° 56'·4E.
37° 03'·9N., 14° 01'·0E.

2. A restricted area, entry, anchoring, fishing and diving prohibited, has been established within the above positions.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 965 — 2123**3635(T)/23 LIBYA - Depths. Obstructions. Coastline. Maximum authorised draught. General information.**

Source: UKHO

1. Following the flood of Darnah on 10th September 2023, significant changes to depths and potential for submerged obstructions may be present within the port and approaches.
2. There is significant change to coastline, shoaling and potential for submerged obstructions at the mouth of Wadi Darnah, 32° 46'·05N., 22° 39'·11E.
3. It is reported that the navigational channel and entrance to Darnah port has been surveyed and there is a minimum depth of 7·5m. Vessels with a maximum draft of 6·5m may enter the harbour basin.
4. Aids to Navigation are reported to be unreliable and may be missing, unlit or out of position.
5. Mariners are advised to navigate with caution and consult the local authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3401**3698(P)/23 RUSSIA - Black Sea Coast - Jetty.**

Source: UKHO

1. A jetty is reported to exist, in an area bounded by the following positions:
44° 43'·328N., 37° 49'·077E.
44° 43'·319N., 37° 49'·104E.
44° 43'·086N., 37° 48'·964E.
44° 43'·113N., 37° 48'·883E.
44° 43'·284N., 37° 48'·993E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Chart 3318 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 3318**4029(T)/23 UKRAINE - Danger area.**

Source: Romanian Notice 9/75(T)/23

1. A mine hazard area, dangerous to navigation, radius 5M, has been reported to exist, centred on position 45° 07'·1N., 30° 09'·7E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2213 — 2214 — 2232**4288(T)/23 UKRAINE - Buoy.**

Source: Ukrainian Notice 22/359(T)/23

1. A south cardinal light-buoy, *Q(6)+LFl.15s*, has been established in position 46° 19'·266N., 30° 40'·413E.

4288(T)/23 UKRAINE - Buoy. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2243**4652(T)/23 CROATIA - Buoy.**

Source: Croatian Notice 7/7(T)/23

1. A special light-buoy, *Fl.Y.2s*, has been established in position 43° 57′·50N., 15° 25′·55E.
(WGS84 DATUM)

Chart affected — 2773**4982(T)/23 FRANCE - South Coast - Submarine power cable. Restricted area.**

Source: French Notice 49/9(T)/23

1. A submarine power cable is being laid, joining the following approximate positions:

43° 21′·06N., 4° 52′·78E.
43° 19′·78N., 4° 53′·40E.
43° 19′·28N., 4° 53′·10E.
43° 14′·81N., 4° 50′·07E.
43° 12′·10N., 4° 48′·23E.
2. Anchoring and fishing is restricted, or prohibited for certain vessels, within 250m of the submarine cable route.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 155 — 1705 — 2116**1488(T)/24 GEORGIA - Buoy.**

Source: Georgian Circular Notice 22/23

1. The green lateral light-buoy, *Fl.G.3s*, in position 42° 09′·522N., 41° 38′·847E. has been temporarily withdrawn.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3317

1550(T)/24 MEDITERRANEAN SEA - General information. Restricted area.

Source: Italian Notice 25.15(T)/23

1. Geomorphological surveys are taking place between Sicily and Sardinia, joining the following positions:

39° 11'·7N., 9° 20'·0E.
 39° 09'·2N., 9° 22'·9E.
 39° 10'·8N., 9° 18'·5E.
 39° 07'·7N., 9° 21'·9E.
 39° 03'·5N., 9° 17'·1E.
 38° 55'·6N., 9° 42'·2E.
 38° 52'·0N., 9° 28'·5E.
 38° 31'·5N., 9° 48'·9E.
 38° 30'·4N., 10° 24'·0E.
 38° 22'·0N., 10° 20'·0E.
 38° 26'·5N., 10° 41'·9E.
 38° 24'·4N., 10° 46'·0E.
 38° 40'·7N., 11° 52'·1E.
 38° 30'·6N., 11° 52'·1E.
 38° 21'·3N., 12° 35'·2E.
 38° 17'·0N., 12° 55'·6E.
 38° 16'·2N., 12° 59'·2E.
 38° 19'·1N., 13° 22'·3E.
 38° 26'·1N., 13° 25'·3E.
 38° 17'·7N., 13° 40'·4E.
 38° 14'·2N., 13° 34'·2E.
 38° 16'·9N., 13° 41'·9E.
 37° 59'·4N., 13° 47'·5E.
 37° 58'·7N., 13° 45'·3E.

2. Navigating, anchoring, mooring, diving, fishing and any other marine activities are prohibited within a radius of 500m from the operation vessels.
3. Mariners are advised to navigate with caution in the area and consult the port authority of Palermo for the latest information.
(WGS84 DATUM)

Charts affected — 166 — 167 — 963 — 1439 — 1440 — 1976 — 1983 — 1990 — 2122**1622(T)/24 RUSSIA - Black Sea Coast - Buoy.**

Source: Russian Notice 3/165(T)/24

1. The north cardinal light-buoy, *Q*, in position 45° 06'·37N., 36° 38'·09E. is reported unlit.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2242**1640(T)/24 ITALY - South Coast - Measuring instruments. Works.**

Source: Italian Notices 26.13-14/23

1. Numerous environmental monitoring stations are being established within the port of Taranto, in an area bounded by the following positions:
 40° 30'·38N., 17° 07'·80E.
 40° 30'·38N., 17° 14'·02E.
 40° 26'·19N., 17° 14'·01E.
 40° 26'·19N., 17° 07'·79E.
2. Mariners are advised to navigate with caution in the area, maintain a safe distance of at least 100m from works vessels and pass at a low speed without causing swell.
(WGS84 DATUM)

Chart affected — 1417

2318(T)/24 UKRAINE - Buoyage.

Source: Ukrainian Notices 6/79(T)-80(T)/24

- The following buoys are reported missing:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy type</i>	<i>Position</i>
		South Cardinal	46° 51'·64N., 31° 58'·77E
<i>Fl.G.3s</i>	<i>No 1</i>	Starboard-hand	46° 51'·55N., 31° 58'·80E
			.
(WGS84 DATUM)			

Chart affected — 2203**2319(T)/24 UKRAINE - Buoy.**

Source: Ukrainian Notice 6/78(T)/24

- The green pillar light-buoy, *Fl.G.3s No 1*, in position 46° 55'·73N., 31° 57'·11E. is temporarily extinguished.
(WGS84 DATUM)

Chart affected — 2203**2320(T)/24 UKRAINE - Buoy.**

Source: Ukrainian Notice 6/77(T)/24

- A yellow special buoy has been deployed, until further notice, in position 46° 36'·19N., 31° 44'·41E.
(WGS84 DATUM)

Chart affected — 2200**2383(T)/24 TURKEY - Black Sea Coast - Buoyage. Automatic Identification Systems.**

Source: Turkish Notice 3/10(T)/24

- Yellow *ODAS* light-buoys, *Fl(3)Y.8s*, and associated Automatic Identification Systems, *AIS*, have been removed in the following positions:

42° 00'·6N., 34° 48'·1E.
41° 51'·56N., 32° 34'·58E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1275 — 2237 — 2238**2405(T)/24 FRANCE - South Coast - Restricted area.**

Source: French Notice 11/5(T)/24

- A restricted area, anchoring, dredging and fishing prohibited, has been established bounded by the following positions:

42° 47'·7N., 3° 02'·5E.
42° 48'·6N., 3° 06'·2E.
42° 48'·8N., 3° 06'·2E.
42° 50'·7N., 3° 13'·5E.
42° 50'·7N., 3° 14'·2E.
42° 50'·8N., 3° 14'·5E.
42° 50'·7N., 3° 14'·9E.
42° 50'·5N., 3° 15'·2E.
42° 50'·1N., 3° 14'·7E.
42° 50'·2N., 3° 14'·6E.
42° 50'·2N., 3° 13'·7E.
42° 48'·3N., 3° 06'·4E.
42° 48'·4N., 3° 06'·3E.
42° 47'·5N., 3° 02'·6E.
(WGS84 DATUM)

Chart affected — 1705

2635(T)/24 ITALY - West Coast - Works. Breakwater.

Source: Italian Notice 5.12/24

1. Survey works, in connection with the construction of a new breakwater in the port of Genoa, are taking place, in an area bounded by the following positions:

44° 23'·36N., 8° 48'·06E.
 44° 23'·36N., 8° 49'·97E.
 44° 24'·00N., 8° 53'·79E.
 44° 23'·07N., 8° 56'·17E.
 44° 23'·27N., 8° 56'·33E.
 44° 22'·95N., 8° 59'·14E.
 44° 21'·13N., 8° 58'·82E.
 44° 20'·13N., 8° 58'·05E.
 44° 20'·09N., 8° 54'·10E.
 44° 21'·30N., 8° 48'·07E.

2. Mariners are requested to maintain a safe distance of at least 50m from works vessels and to navigate with caution at a reduced speed in the area.
(WGS84 DATUM)

Charts affected — 354 — 355 — 356 — 1913**3188(T)/24 ITALY - Sardegna - Buoy.**

Source: Italian Notice 6.24(T)/24

1. The green conical buoy, in position 41° 11'·995N., 9° 23'·943E. has been removed.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1212 — 1213**3767(T)/24 GREECE - West Coast - Buoyage.**

Source: Greek Notice 4/71/24

1. Special purpose light-buoys, *Fl.Y.2s*, have been established in the following positions:

38° 25'·81N., 22° 25'·49E.
 38° 25'·75N., 22° 25'·68E.
 38° 25'·62N., 22° 25'·63E.
 38° 25'·66N., 22° 25'·40E.
 38° 25'·72N., 22° 25'·43E.
 (WGS84 DATUM)

Chart affected — 2405**3883(T)/24 UKRAINE - Buoy.**

Source: Ukrainian Notice 15/223(T)/24

1. The isolated danger buoy in position 46° 04'·14N., 30° 29'·71E. is reported missing.
(WGS84 DATUM)

Charts affected — 2212 — 2213**3884(T)/24 UKRAINE - Buoy.**

Source: Ukrainian Notice 15/225(T)/24

1. The yellow special light buoy, *Fl.Y.5s*, in position 46° 21'·50N., 30° 49'·75E. is reported missing.
(WGS84 DATUM)

Charts affected — 2212 — 2243**3892(T)/24 UKRAINE - Buoyage.**

Source: Ukrainian Notice 15/224(T)/24

1. The south cardinal light-buoy, *Q(6)+LFl.15s*, in position 46° 19'·03N., 30° 56'·18E. is reported missing.

3892(T)/24 UKRAINE - Buoyage. (continued)

2. A south cardinal buoy, *Q(6)+LFl.15s*, has been deployed, until further notice, in position 46° 08'·97N., 30° 46'·29E. (WGS84 DATUM)

Charts affected — 2212 — 2232

4227(T)/24 ITALY - Sardegna - Jetty. Works.

Source: Italian Notice 10.24(T)/24

1. Jetty demolition works are taking place, in the vicinity of position 39° 51'·89N., 8° 33'·95E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 1205

4504(T)/24 RUSSIA - Black Sea Coast - Works.

Source: Russian Notice 24/2403(T)/24

1. Construction works are taking place, in areas bounded by the following positions:

45° 07'·09N., 36° 40'·28E.

45° 06'·98N., 36° 40'·60E.

45° 06'·81N., 36° 40'·46E.

45° 06'·82N., 36° 40'·40E.

45° 06'·69N., 36° 40'·28E.

45° 06'·70N., 36° 40'·24E.

45° 06'·52N., 36° 40'·05E.

45° 06'·47N., 36° 39'·95E.

45° 06'·47N., 36° 39'·80E.

45° 06'·59N., 36° 39'·60E.

45° 06'·97N., 36° 40'·01E.

and

45° 07'·97N., 36° 38'·36E.

45° 07'·82N., 36° 38'·18E.

45° 07'·60N., 36° 37'·78E.

45° 07'·84N., 36° 37'·79E.

45° 07'·92N., 36° 37'·79E.

45° 07'·98N., 36° 37'·85E.

45° 08'·15N., 36° 38'·23E.

45° 08'·26N., 36° 38'·31E.

45° 08'·17N., 36° 38'·53E.

45° 08'·14N., 36° 38'·61E.

45° 08'·10N., 36° 38'·63E.

2. For the safety of navigation, anchoring, fishing, trawling, underwater and dredging works, any operation using explosives or stopping within the area are not recommended.
3. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Charts affected — 2216 — 2242

4700(T)/24 ITALY - Sardegna - Beacon.

Source: Italian Notice 12.27(T)/24

1. The isolated danger beacon in position 41° 05'·88N., 9° 34'·34E. has been removed.
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Chart affected — 1211

4708(P)/24 UKRAINE - General information.

Source: UKHO and Ukrainian Notices 24/380(T)/23, 34/479/24 and 34/481- 482/24

1. Owing to insufficient information it is not always possible to ensure that this chart is completely up to date for new dangers or changes to aids to navigation. Mariners are therefore advised to exercise particular caution when navigating in Ukrainian waters.

4708(P)/24 UKRAINE - General information. (continued)

2. Due to the failure of the Kakhovska dam in the Dnipro River, there is a risk of drifting objects and mines in the north western part of the Black Sea. Mariners are therefore advised to exercise particular caution when navigating through the maritime humanitarian corridor, to and from Ukrainian ports.
3. *The ports of Berdiansk, Mariupol, Skadovsk, Kherson, Kerch, Sevastopol, Feodosiya, Yalta, Yevpatoriya, Kerchenskyi Sea Fishing Port and Sevastopolskyi Sea Fishing Port remain closed until further notice.
4. *Former Notice 2501(P)/23 is cancelled.
*Indicates new or revised information
(WGS84 DATUM)

Charts affected — 2200 — 2201 — 2202 — 2203 — 2205 — 2212 — 2213 — 2214 — 2216 — 2217 — 2232 — 2233 — 2234 — 2238 — 2242 — 2243 — 2282 — 3302 — 3303

5164(P)/24 GREECE - Aegean Sea Coast - Dredging area.

Source: Greek Notice 7/124/24

1. A dredging area, in the vicinity of the Port of Évdilos, exists in an area bounded by the following positions:
 $37^{\circ} 37' \cdot 95N., 26^{\circ} 10' \cdot 79E.$
 $37^{\circ} 37' \cdot 95N., 26^{\circ} 11' \cdot 09E.$
 $37^{\circ} 37' \cdot 79N., 26^{\circ} 11' \cdot 04E.$
 $37^{\circ} 37' \cdot 75N., 26^{\circ} 10' \cdot 85E.$
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 1526

5328(P)/24 MEDITERRANEAN SEA - Submarine cable.

Source: Alcatel Submarine Networks and UKHO

1. *The BLUE SCS submarine fibre optic cable system is due to be laid during the years 2022 – 2024. The cable is made up of many segments and the proposed positions in water depths of less than 200m are listed below with details of the largest scale relevant Admiralty Charts affected [in brackets]. The accompanying diagram shows the overall coverage of the proposed cables.
2. **K** Italy – Stretto di Messina and approaches [917]
 $38^{\circ} 21' \cdot 81N., 15^{\circ} 31' \cdot 64E.$
 $38^{\circ} 20' \cdot 52N., 15^{\circ} 36' \cdot 79E.$
 $38^{\circ} 19' \cdot 21N., 15^{\circ} 39' \cdot 95E.$
 $38^{\circ} 18' \cdot 39N., 15^{\circ} 40' \cdot 71E.$
 $38^{\circ} 16' \cdot 59N., 15^{\circ} 40' \cdot 38E.$
 $38^{\circ} 15' \cdot 85N., 15^{\circ} 39' \cdot 86E.$
 $38^{\circ} 14' \cdot 58N., 15^{\circ} 35' \cdot 93E.$
 $38^{\circ} 13' \cdot 80N., 15^{\circ} 35' \cdot 71E.$
3. **L** Libya - Ṭarābulus (Tripoli) [3403]
 $33^{\circ} 13' \cdot 6N., 13^{\circ} 22' \cdot 4E.$
 $32^{\circ} 59' \cdot 1N., 13^{\circ} 09' \cdot 9E.$
 $32^{\circ} 53' \cdot 0N., 13^{\circ} 09' \cdot 4E.$
4. **M** Medina Bank ($34^{\circ} 50' \cdot 00N$ $15^{\circ} 10' \cdot 00E$) [3403, 2124]
 $35^{\circ} 00' \cdot 7N., 15^{\circ} 23' \cdot 1E.$
 $34^{\circ} 48' \cdot 2N., 15^{\circ} 05' \cdot 1E.$
5. **N** Libya – Darnah [3401]
 $32^{\circ} 46' \cdot 4N., 22^{\circ} 37' \cdot 6E.$
 $32^{\circ} 50' \cdot 0N., 22^{\circ} 36' \cdot 2E.$
 $32^{\circ} 53' \cdot 3N., 22^{\circ} 33' \cdot 8E.$
 $32^{\circ} 59' \cdot 1N., 22^{\circ} 30' \cdot 9E.$
6. **P** Cyprus – Paphos [849, 775]
 $34^{\circ} 41' \cdot 63N., 32^{\circ} 21' \cdot 98E.$
 $34^{\circ} 42' \cdot 74N., 32^{\circ} 26' \cdot 14E.$
 $34^{\circ} 43' \cdot 11N., 32^{\circ} 26' \cdot 61E.$
 $34^{\circ} 44' \cdot 03N., 32^{\circ} 26' \cdot 93E.$

5328(P)/24 MEDITERRANEAN SEA - Submarine cable. (continued)**7. Q Israel – Tel Aviv [1591]**

32° 07′·78N., 34° 33′·82E.

32° 05′·04N., 34° 43′·68E.

32° 04′·90N., 34° 44′·77E.

32° 04′·54N., 34° 45′·89E.

8. Vessels are advised to monitor NAVAREA III, local warnings and Notices to Mariners of other nations for the latest information regarding the cable laying activity. Vessels should give the cable laying vessels a wide berth and avoid anchoring or trawling in the vicinity of the cable.

9. For further information regarding submarine cables, see The Mariners Handbook (NP100).


10. Charts will be updated when works are complete.

11. *Former Notice 1911(P)/22 is cancelled.

*Indicates new or revised entry

(WGS84 DATUM)

Charts affected — 775 — 849 — 1591 — 2074 — 2124 — 2634 — 3401 — 3403

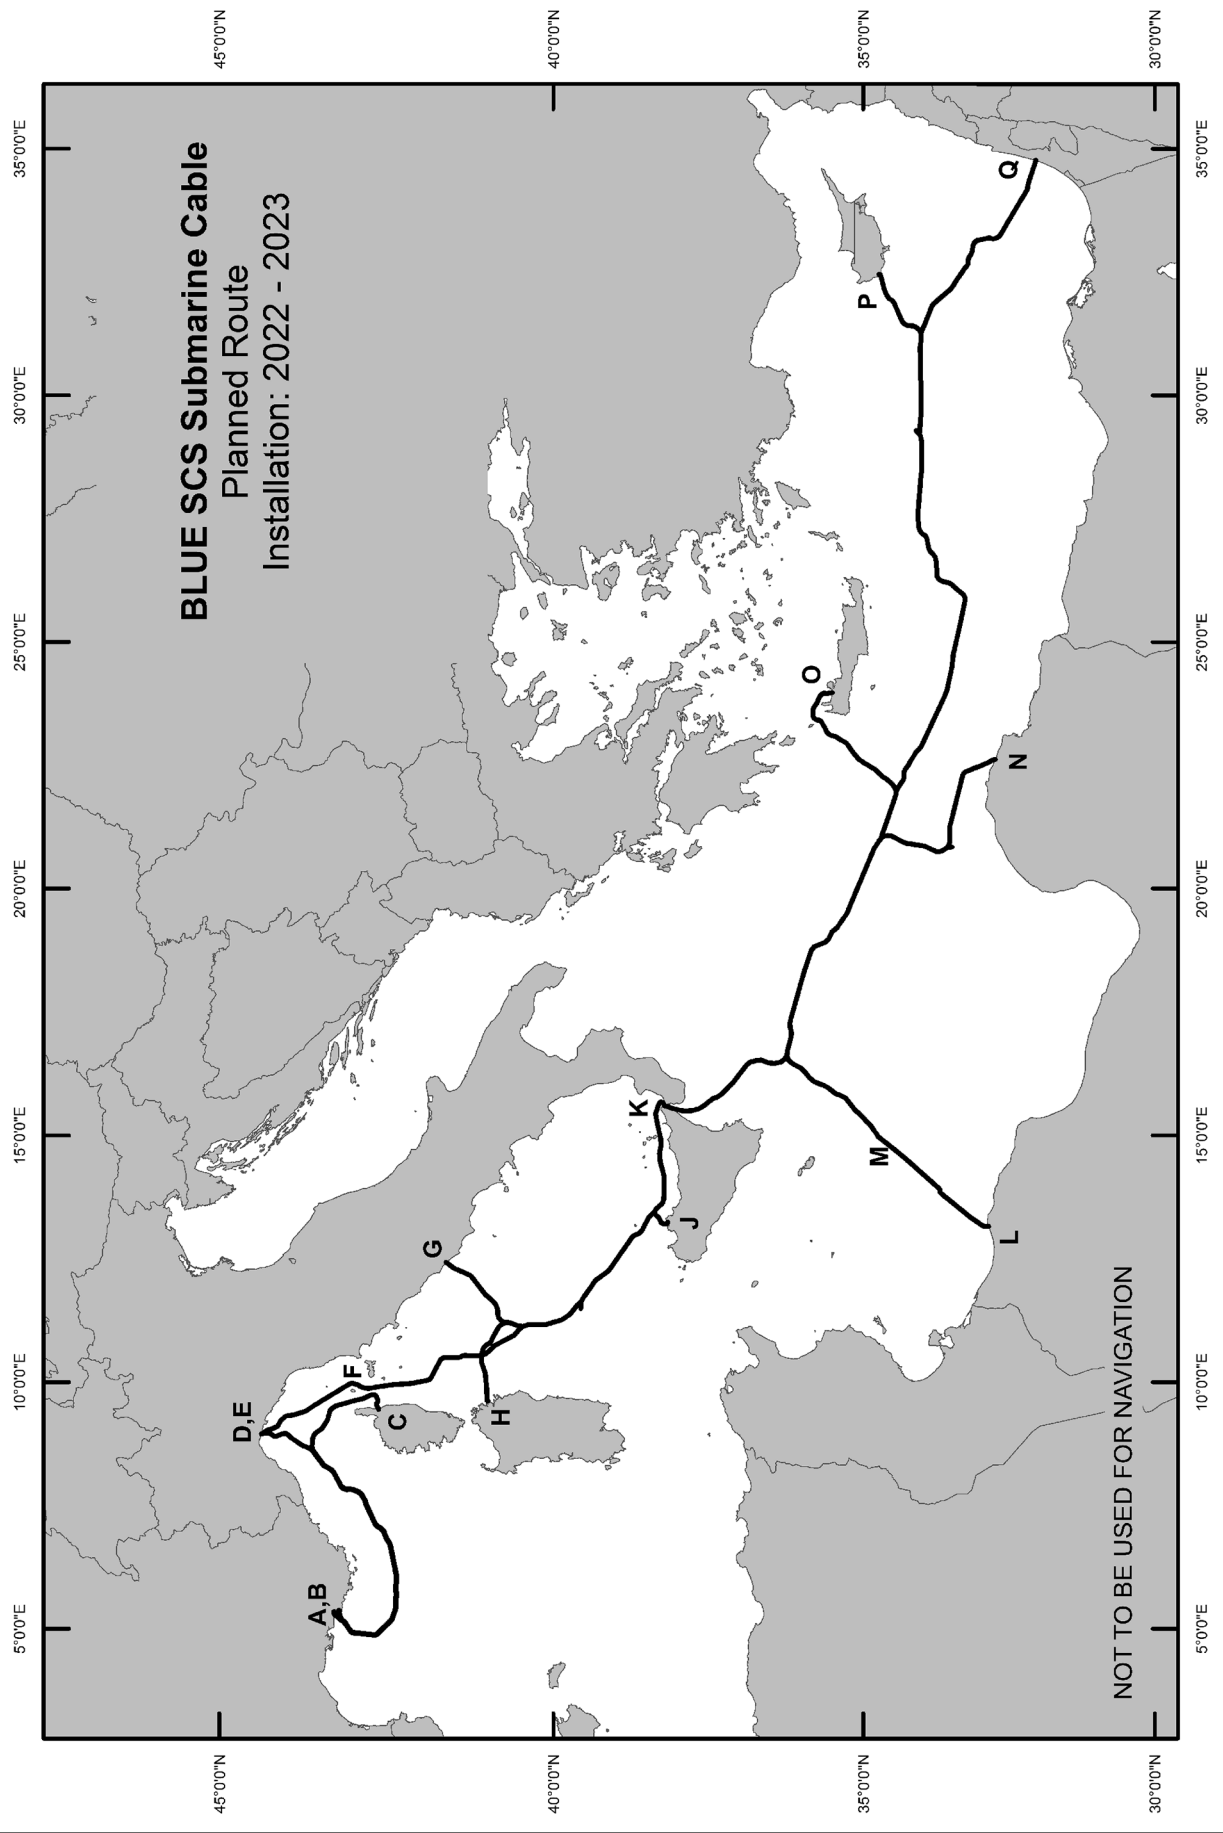

5359(P)/24 MEDITERRANEAN SEA - Submarine cables.

Source: Alcatel Submarine Networks and UKHO.

1. The Oryx submarine fibre optic cable system is due to be laid. The proposed positions in depths of less than 200m are listed below with details of the relevant, largest scale Admiralty Charts affected [in brackets]. The accompanying diagram shows the overall coverage of the proposed cables.

2. **A** - Italy (Savona) to Egypt (Port Said eastwards) [Charts 166, 167, 183, 350, 964, 1913, 1998, 1999, 2122, 2123, 2124, 2578]:

44° 15'·154N., 8° 27'·038E.
 44° 15'·123N., 8° 27'·025E.
 44° 15'·115N., 8° 27'·024E.
 44° 15'·107N., 8° 27'·027E.
 44° 15'·100N., 8° 27'·032E.
 44° 15'·085N., 8° 27'·054E.
 44° 14'·944N., 8° 27'·515E.
 44° 14'·34N., 8° 28'·90E.

3. and

43° 12'·2N., 9° 51'·9E.
 43° 07'·6N., 9° 56'·2E.
 43° 05'·9N., 9° 57'·4E.
 43° 04'·9N., 9° 57'·9E.
 43° 03'·5N., 9° 58'·2E.
 43° 02'·5N., 9° 58'·1E.
 42° 59'·1N., 9° 56'·8E.
 42° 58'·2N., 9° 56'·3E.
 42° 56'·6N., 9° 54'·2E.
 42° 55'·6N., 9° 53'·4E.
 42° 53'·0N., 9° 52'·7E.
 42° 51'·7N., 9° 51'·9E.

4. and

37° 46'·1N., 11° 52'·2E.
 37° 46'·0N., 11° 52'·2E.
 37° 45'·1N., 11° 53'·1E.
 37° 44'·6N., 11° 53'·7E.
 37° 44'·3N., 11° 54'·5E.
 37° 44'·2N., 11° 55'·1E.
 37° 44'·0N., 11° 56'·3E.
 37° 43'·9N., 11° 57'·6E.
 37° 43'·9N., 11° 58'·9E.

5. and

37° 40'·26N., 12° 07'·66E.
 37° 34'·2N., 12° 15'·8E.
 37° 30'·7N., 12° 20'·5E.
 37° 29'·6N., 12° 22'·0E.
 37° 25'·1N., 12° 28'·3E.
 37° 24'·9N., 12° 28'·5E.
 37° 24'·7N., 12° 28'·7E.
 37° 24'·4N., 12° 28'·9E.
 37° 24'·1N., 12° 29'·2E.
 37° 23'·8N., 12° 29'·6E.
 37° 23'·6N., 12° 30'·0E.
 37° 22'·7N., 12° 32'·7E.
 37° 22'·6N., 12° 32'·9E.
 37° 22'·5N., 12° 33'·0E.
 37° 22'·4N., 12° 33'·1E.
 37° 20'·7N., 12° 34'·4E.
 37° 20'·6N., 12° 34'·6E.
 37° 20'·4N., 12° 34'·9E.
 37° 20'·3N., 12° 35'·2E.
 37° 18'·6N., 12° 43'·3E.

5359(P)/24 MEDITERRANEAN SEA - Submarine cables. (continued)

6. and

37° 14'·8N., 12° 53'·5E.
37° 13'·3N., 12° 54'·4E.
37° 13'·1N., 12° 54'·6E.
37° 12'·8N., 12° 54'·8E.
37° 12'·6N., 12° 55'·1E.
37° 12'·3N., 12° 55'·3E.
37° 11'·9N., 12° 55'·5E.
37° 11'·6N., 12° 55'·9E.

7. and

36° 33'·5N., 14° 22'·3E.
36° 33'·5N., 14° 22'·7E.
36° 33'·4N., 14° 23'·3E.
36° 33'·3N., 14° 23'·7E.
36° 33'·1N., 14° 24'·0E.
36° 32'·9N., 14° 24'·3E.
36° 32'·3N., 14° 25'·1E.
36° 31'·4N., 14° 26'·4E.
36° 30'·5N., 14° 28'·0E.
36° 29'·7N., 14° 30'·0E.

8. and

36° 29'·5N., 14° 31'·8E.
36° 29'·3N., 14° 32'·2E.
36° 29'·2N., 14° 32'·5E.
36° 29'·1N., 14° 33'·0E.
36° 29'·0N., 14° 33'·9E.
36° 26'·0N., 14° 44'·6E.
36° 24'·6N., 14° 49'·9E.
36° 24'·0N., 14° 54'·8E.
36° 23'·1N., 15° 00'·1E.
36° 23'·2N., 15° 17'·1E.
36° 23'·3N., 15° 19'·1E.
36° 23'·4N., 15° 20'·3E.
36° 23'·7N., 15° 21'·8E.
36° 24'·1N., 15° 23'·2E.
36° 24'·6N., 15° 24'·3E.
36° 25'·6N., 15° 25'·8E.
36° 26'·0N., 15° 26'·5E.

9. and

31° 42'·98N., 32° 45'·86E.
31° 41'·71N., 32° 45'·56E.
31° 40'·85N., 32° 45'·08E.
31° 39'·89N., 32° 44'·22E.
31° 35'·42N., 32° 38'·45E.
31° 34'·69N., 32° 38'·05E.
31° 33'·93N., 32° 38'·09E.
31° 32'·67N., 32° 37'·77E.
31° 31'·68N., 32° 37'·58E.
31° 30'·60N., 32° 37'·57E.
31° 29'·48N., 32° 37'·75E.
31° 22'·96N., 32° 38'·36E.
31° 22'·30N., 32° 38'·42E.
31° 21'·11N., 32° 38'·81E.
31° 18'·83N., 32° 39'·90E.
31° 17'·46N., 32° 40'·29E.
31° 16'·20N., 32° 40'·40E.
31° 14'·75N., 32° 40'·20E.

5359(P)/24 MEDITERRANEAN SEA - Submarine cables. (continued)

10. **B** - France (Marseille southwards) to Egypt (Port Said) [Charts 153, 166, 167, 176, 183, 1705, 2116, 2122, 2123, 2578, 3403]:

43° 15'·17N., 5° 22'·48E.
43° 15'·19N., 5° 22'·44E.
43° 15'·20N., 5° 22'·36E.
43° 15'·15N., 5° 22'·04E.
43° 15'·10N., 5° 21'·85E.
43° 15'·10N., 5° 21'·81E.
43° 15'·11N., 5° 21'·72E.
43° 15'·10N., 5° 21'·69E.
43° 15'·04N., 5° 21'·45E.
43° 15'·02N., 5° 21'·41E.
43° 14'·80N., 5° 20'·88E.
43° 14'·74N., 5° 20'·78E.
43° 14'·70N., 5° 20'·74E.
43° 14'·54N., 5° 20'·63E.
43° 14'·50N., 5° 20'·63E.

11. and

43° 14'·46N., 5° 20'·63E.
43° 14'·42N., 5° 20'·62E.
43° 14'·36N., 5° 20'·60E.
43° 14'·28N., 5° 20'·54E.
43° 14'·15N., 5° 20'·42E.
43° 13'·85N., 5° 20'·05E.
43° 13'·14N., 5° 19'·26E.
43° 12'·95N., 5° 19'·13E.
43° 12'·81N., 5° 19'·07E.
43° 12'·55N., 5° 19'·02E.
43° 12'·36N., 5° 19'·03E.
43° 12'·16N., 5° 19'·08E.
43° 07'·6N., 5° 20'·6E.
43° 06'·9N., 5° 20'·9E.
43° 06'·6N., 5° 21'·1E.
43° 05'·6N., 5° 22'·1E.
43° 05'·2N., 5° 22'·4E.
43° 05'·0N., 5° 22'·7E.
43° 04'·6N., 5° 23'·2E.
43° 04'·5N., 5° 23'·3E.
43° 04'·3N., 5° 23'·3E.
43° 04'·1N., 5° 23'·3E.
43° 03'·8N., 5° 23'·4E.
43° 03'·5N., 5° 23'·6E.
43° 03'·2N., 5° 23'·9E.

5359(P)/24 MEDITERRANEAN SEA - Submarine cables. (continued)

12. and

37° 33'·6N., 11° 38'·9E.
 37° 33'·1N., 11° 39'·8E.
 37° 31'·0N., 11° 42'·1E.
 37° 30'·0N., 11° 42'·8E.
 37° 29'·0N., 11° 43'·4E.
 37° 28'·3N., 11° 44'·1E.
 37° 27'·5N., 11° 44'·9E.
 37° 26'·8N., 11° 46'·1E.
 37° 24'·3N., 11° 52'·6E.
 37° 23'·3N., 11° 55'·2E.
 37° 20'·6N., 11° 59'·8E.
 37° 16'·6N., 12° 05'·4E.
 37° 14'·8N., 12° 07'·5E.
 37° 14'·0N., 12° 08'·7E.
 37° 13'·3N., 12° 10'·1E.
 37° 10'·8N., 12° 13'·9E.
 37° 08'·5N., 12° 16'·5E.
 36° 56'·7N., 12° 25'·4E.
 36° 53'·5N., 12° 28'·8E.

13. and

34° 47'·6N., 15° 21'·1E.
 34° 49'·2N., 15° 17'·3E.
 34° 50'·1N., 15° 13'·3E.
 34° 50'·4N., 15° 08'·6E.
 34° 50'·3N., 15° 03'·9E.

14. and

31° 55'·30N., 31° 41'·03E.
 31° 53'·15N., 31° 43'·91E.
 31° 48'·94N., 31° 51'·16E.
 31° 47'·51N., 31° 52'·97E.
 31° 46'·28N., 31° 53'·98E.
 31° 39'·97N., 31° 57'·01E.
 31° 38'·78N., 31° 57'·81E.
 31° 37'·79N., 31° 57'·97E.
 31° 37'·20N., 31° 58'·38E.
 31° 35'·83N., 31° 58'·95E.
 31° 35'·34N., 31° 59'·75E.
 31° 35'·27N., 32° 00'·82E.
 31° 35'·28N., 32° 02'·01E.
 31° 33'·17N., 32° 04'·19E.
 31° 32'·89N., 32° 05'·78E.
 31° 31'·10N., 32° 07'·09E.
 31° 30'·78N., 32° 08'·97E.
 31° 28'·73N., 32° 09'·89E.
 31° 27'·38N., 32° 12'·89E.
 31° 20'·82N., 32° 15'·52E.
 31° 20'·36N., 32° 16'·03E.
 31° 19'·69N., 32° 16'·22E.
 31° 19'·07N., 32° 16'·06E.
 31° 16'·41N., 32° 18'·08E.

5359(P)/24 MEDITERRANEAN SEA - Submarine cables. (continued)

15. C - Spain (Barcelona) to Egypt (Al Iskandariyah south-westwards) [Charts 166, 167, 176, 183, 302, 1196, 1704, 2122, 2123, 2681, 3403]:

41° 25'·38N., 2° 14'·02E.
 41° 25'·27N., 2° 14'·35E.
 41° 25'·24N., 2° 14'·54E.
 41° 25'·17N., 2° 14'·91E.
 41° 24'·1N., 2° 20'·1E.
 41° 24'·0N., 2° 21'·1E.
 41° 23'·9N., 2° 21'·9E.
 41° 23'·9N., 2° 22'·4E.
 41° 23'·9N., 2° 23'·0E.
 41° 24'·0N., 2° 23'·7E.
 41° 24'·6N., 2° 29'·2E.
 41° 24'·7N., 2° 31'·7E.
 41° 24'·7N., 2° 35'·1E.
 41° 24'·4N., 2° 38'·6E.
 41° 24'·0N., 2° 41'·3E.

16. and

37° 44'·7N., 10° 31'·3E.
 37° 42'·4N., 10° 36'·8E.
 37° 40'·9N., 10° 41'·8E.
 37° 40'·2N., 10° 45'·2E.
 37° 40'·7N., 10° 47'·4E.
 37° 39'·9N., 10° 51'·2E.

17. and

36° 53'·0N., 12° 17'·4E.
 36° 54'·9N., 12° 16'·5E.
 36° 56'·4N., 12° 15'·1E.
 36° 59'·7N., 12° 10'·7E.
 37° 03'·1N., 12° 03'·5E.
 37° 04'·6N., 12° 01'·4E.
 37° 06'·5N., 11° 59'·5E.
 37° 15'·1N., 11° 52'·8E.
 37° 15'·6N., 11° 52'·2E.
 37° 17'·1N., 11° 48'·5E.
 37° 20'·9N., 11° 36'·8E.
 37° 21'·3N., 11° 34'·9E.
 37° 21'·7N., 11° 31'·7E.
 37° 22'·2N., 11° 30'·5E.
 37° 23'·1N., 11° 29'·8E.
 37° 24'·0N., 11° 29'·6E.
 37° 24'·9N., 11° 28'·8E.
 37° 30'·9N., 11° 16'·1E.
 37° 31'·3N., 11° 14'·5E.

18. and

34° 40'·4N., 15° 02'·5E.
 34° 39'·9N., 15° 04'·7E.
 34° 39'·3N., 15° 14'·9E.


19. and

31° 09'·5N., 29° 22'·6E.
 31° 07'·28N., 29° 26'·66E.
 31° 05'·17N., 29° 30'·04E.
 31° 04'·31N., 29° 31'·27E.
 31° 03'·70N., 29° 32'·00E.
 31° 02'·86N., 29° 33'·16E.
 31° 01'·17N., 29° 35'·01E.
 31° 01'·09N., 29° 35'·28E.
 31° 01'·31N., 29° 37'·09E.
 31° 01'·30N., 29° 37'·17E.

5359(P)/24 MEDITERRANEAN SEA - Submarine cables. (continued)

20. Vessels are advised to monitor NAVAREA III; also local warnings and Notices to Mariners of other nations for the latest information regarding the cable laying activity.
21. Vessels should give the cable laying vessels a wide berth and avoid anchoring or trawling in the vicinity of the cable.
22. For further information regarding submarine cables, see The Mariners Handbook (NP100).
23. Charts will be updated when the works are complete.
(WGS84 DATUM)

**Charts affected — 153 — 166 — 167 — 176 — 183 — 302 — 350 — 964 — 1196 — 1704 — 1705 — 1913 —
1998 — 1999 — 2116 — 2122 — 2123 — 2124 — 2578 — 2681 — 3403**

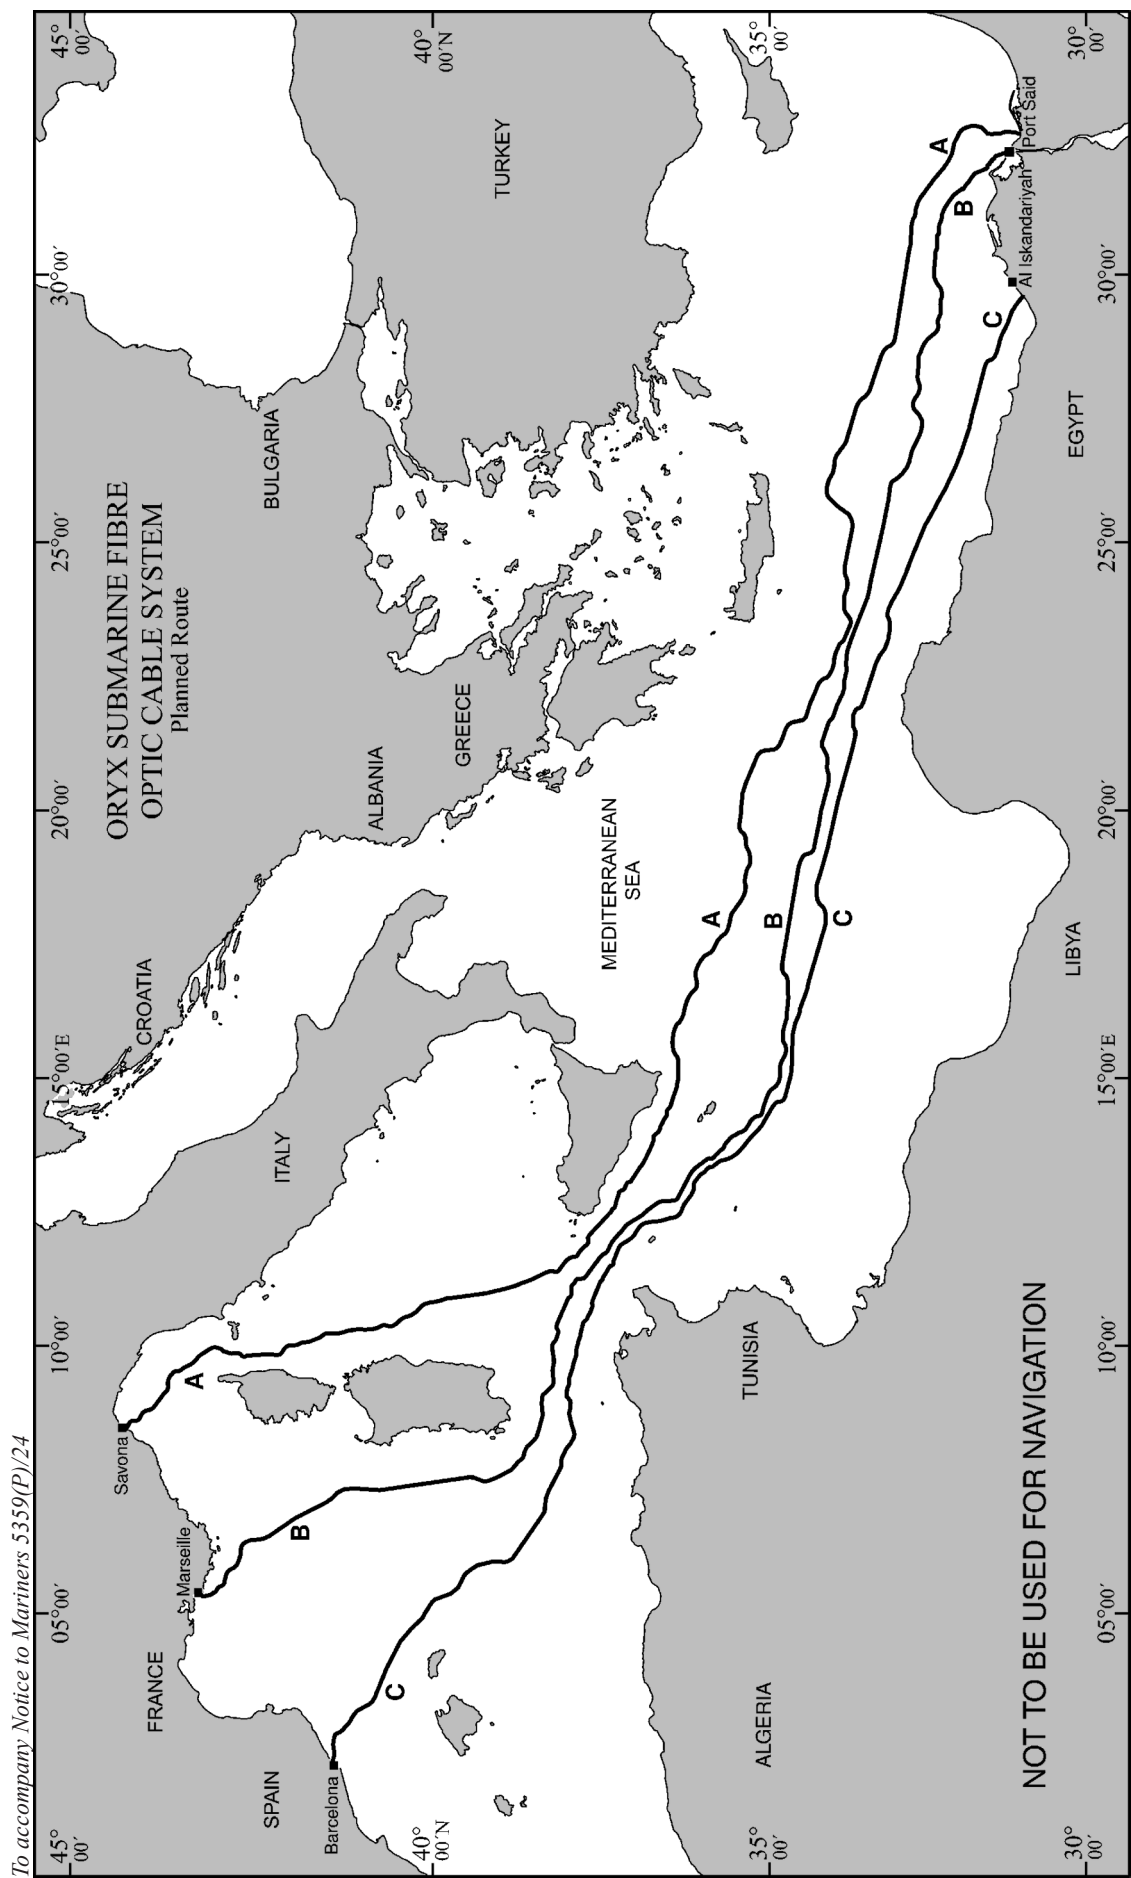

INTENTIONALLY BLANK

5696(T)/24 UKRAINE - Buoyage.

Source: UKHO

1. Mooring buoys have been established in the vicinity of the following positions:

44° 39'·85N., 33° 14'·05E.

44° 39'·73N., 33° 14'·00E.

2. Mariners are advised to navigate with caution in the area.
(PULKOVO 1942 DATUM)

Chart affected — 2217**5756(T)/24 CROATIA - Buoy.**

Source: Croatian Notice 9/8(T)/24

1. The yellow special light-buoy, *Fl.Y.2s*, in position 44° 14'·25N., 15° 06'·72E. is reported missing.
(WGS84 DATUM)

Chart affected — 515**5876(T)/24 ITALY - East Coast - Harbour developments.**

Source: Italian Notice 19.18(T)/24

1. Harbour works are taking place, in an area bounded by the following positions:

44° 26'·671N., 12° 14'·512E.

44° 26'·667N., 12° 14'·530E.

44° 26'·576N., 12° 14'·490E.

44° 26'·580N., 12° 14'·472E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1445**5983(T)/24 FRANCE - South Coast - Restricted area.**

Source: French Notice 41/5(T)/24

1. A circular restricted area, entry prohibited, radius of 200m, centred on the ODAS buoy in position 43° 09'·42N., 4° 45'·57E., has been established.
(WGS84 DATUM)

Chart affected — 2116**186(T)/25 UKRAINE - Buoyage.**

Source: UKHO

1. Mooring buoys have been established in the vicinity of the following positions:

44° 52'·01N., 35° 56'·33E.

44° 52'·07N., 35° 56'·33E.

44° 52'·09N., 35° 56'·61E.

44° 52'·19N., 35° 56'·70E.

44° 52'·16N., 35° 56'·76E.

44° 52'·22N., 35° 56'·76E.

44° 58'·03N., 35° 58'·96E.

44° 59'·41N., 36° 01'·35E.

45° 01'·05N., 36° 01'·97E.

45° 18'·73N., 36° 30'·61E.

45° 18'·69N., 36° 30'·68E.

45° 18'·33N., 36° 30'·78E.

45° 18'·32N., 36° 30'·85E.

2. Submerged mooring buoys have been established in the vicinity of the following positions:

44° 58'·05N., 35° 59'·47E.

44° 59'·39N., 36° 01'·45E.

3. The safe water light-buoy, *LFl.6s*, in position 45° 09'·20N., 36° 28'·00E. is reported missing.

186(T)/25 UKRAINE - Buoyage. (continued)

4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2216 — 2242

339(T)/25 ROMANIA - Beacons. Obstruction.

Source: Romanian Notice 9/75(T)/24

1. An obstruction, marked by 6 unlit beacons, exists in position: 44° 14'·25N., 28° 40'·52E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2282

359(T)/25 BLACK SEA - Restricted areas.

Source: UKHO

1. Restricted areas, entry prohibited, have been established bounded by the following positions:

45° 11'·32N., 36° 24'·37E.

45° 12'·02N., 36° 27'·40E.

45° 11'·43N., 36° 27'·43E.

45° 10'·94N., 36° 25'·55E.

45° 10'·77N., 36° 24'·32E.

and

45° 11'·86N., 36° 35'·91E.

45° 11'·50N., 36° 34'·67E.

45° 11'·50N., 36° 34'·26E.

45° 11'·65N., 36° 31'·98E.

45° 11'·89N., 36° 30'·82E.

45° 11'·96N., 36° 30'·28E.

45° 11'·76N., 36° 28'·71E.

45° 11'·54N., 36° 27'·86E.

45° 12'·12N., 36° 27'·83E.

45° 12'·28N., 36° 28'·50E.

45° 12'·50N., 36° 29'·96E.

45° 12'·47N., 36° 30'·67E.

45° 12'·19N., 36° 32'·11E.

45° 12'·03N., 36° 34'·48E.

45° 12'·36N., 36° 35'·46E.

45° 12'·43N., 36° 36'·17E.

2. The limits of the Kosa Tuzla restricted area have been amended and now join the following positions:

45° 12'·41N., 36° 36'·17E.

45° 12'·34N., 36° 35'·48E.

45° 12'·01N., 36° 34'·45E.

45° 16'·37N., 36° 29'·40E.

45° 17'·97N., 36° 29'·40E.

45° 18'·52N., 36° 31'·13E.

45° 14'·04N., 36° 36'·91E.

45° 12'·64N., 36° 36'·91E.

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2242

409(T)/25 UKRAINE - Buoy.

Source: Ukrainian Notice 42/603(T)/24

1. A south cardinal light-buoy, *Q(6)+LFl.15s*, has been established in position 46° 31'·94N., 30° 53'·90E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2205 — 2212

469(P)/25 MOROCCO - North Coast - Works.

Source: French Notice 49/10(P)/24

1. Works are taking place in the vicinity of Tanger Med 1 35° 53'·956N., 5° 29'·554W. and Tanger Med 2 35° 52'·808N., 5° 31'·899W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 145**593(T)/25 FRANCE - South Coast - Buoy. Restricted area.**

Source: French Notice 49/7(T)/24

1. A yellow ODAS light-buoy, *Fl(5)Y.20s*, has been established in position 43° 14'·32N., 6° 41'·58E.
2. A restricted area, entry and swimming prohibited, has been established, radius 50m, centred on the ODAS buoy.
3. Mariners are advised to navigate with caution in the area and consult PING (portail.ping-info-nautique.fr/avurnav-notice) for the latest restrictions. (WGS84 DATUM)

Chart affected — 2166**776(T)/25 BLACK SEA - Obstruction.**

Source: UKHO

1. A submerged obstruction, 2·5m above the seabed, is reported to exist in position 44° 39'·17N., 33° 31'·00E.
2. Mariners are advised to navigate with caution in the area. (PULKOVO 1942 DATUM)

Chart affected — 2217**851(T)/25 TÜRKIYE - West Coast - Dredging area.**

Source: Turkish Notice 51/251(T)/24

1. A dredging area has been established bounded by the following positions:
 38° 26'·31N., 26° 59'·02E.
 38° 25'·63N., 26° 58'·28E.
 38° 25'·75N., 26° 58'·07E.
 38° 26'·43N., 26° 58'·82E.
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Charts affected — 1522 — 1624**886(T)/25 UKRAINE - Buoy.**

Source: Ukrainian Notice 3/50(T)/25

1. The unlit red pillar buoy, *No 4*, in position 46° 44'·8N., 31° 54'·7E. is reported missing. (WGS84 DATUM)

Chart affected — 2203**930(T)/25 FRANCE - South Coast - Works. Scientific instruments. Restricted areas.**

Source: French Notice 51/18(T)/24

1. *Works to install scientific instruments are taking place in the Gulf of Lions.
2. *Restricted areas, fishing, trawling, and anchoring prohibited, have been established within a 200m radius of the following positions:
 43° 06'·6N., 3° 14'·0E.
 43° 03'·0N., 3° 21'·3E.
 42° 57'·7N., 3° 35'·7E.
 43° 15'·19N., 4° 56'·20E.
 43° 15'·59N., 4° 51'·95E.
 43° 05'·9N., 4° 39'·0E.

930(T)/25 FRANCE - South Coast - Works. Scientific instruments. Restricted areas. (continued)

3. *Restricted areas, fishing, trawling, and anchoring prohibited, have been established within areas bounded by the following positions:

42° 53'·9N., 3° 28'·3E.
 42° 54'·5N., 3° 28'·8E.
 42° 54'·4N., 3° 29'·0E.
 42° 53'·8N., 3° 28'·5E.

4. and

43° 00'·2N., 3° 32'·3E.
 43° 00'·9N., 3° 32'·7E.
 43° 00'·8N., 3° 33'·0E.
 43° 00'·1N., 3° 32'·6E.

5. and

43° 08'·4N., 4° 23'·6E.
 43° 08'·5N., 4° 23'·8E.
 43° 08'·0N., 4° 24'·5E.
 43° 07'·8N., 4° 24'·3E.

6. and

43° 00'·7N., 4° 37'·7E.
 43° 00'·9N., 4° 37'·9E.
 43° 00'·6N., 4° 38'·8E.
 43° 00'·4N., 4° 38'·7E.

7. and

43° 08'·5N., 4° 45'·2E.
 43° 09'·3N., 4° 45'·3E.
 43° 09'·3N., 4° 45'·6E.
 43° 08'·5N., 4° 45'·5E.

8. and

* 43° 08'·5N., 3° 41'·6E.
 * 43° 08'·1N., 3° 41'·3E.
 * 43° 08'·0N., 3° 41'·5E.
 * 43° 08'·4N., 3° 41'·8E.

9. *For the latest information regarding restrictions, including fishing restrictions, mariners are advised to consult PING (portail.ping-info-nautique.fr/avurnav-notice).

10. *Former Notice 212(T)/25 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 1705 — 2116

1021(T)/25 MOROCCO - North Coast - Works.

Source: French Notice 1/7(T)/2025

1. *Survey works are taking place between 01 January 2025 to 31 December 2026, bounded by the following positions:

35° 56'·44N., 5° 42'·80W.
 35° 56'·17N., 5° 39'·00W.
 35° 54'·27N., 5° 38'·20W.
 35° 52'·95N., 5° 36'·81W.
 35° 51'·94N., 5° 36'·36W.
 35° 49'·82N., 5° 36'·18W.
 35° 50'·14N., 5° 37'·78W.
 35° 52'·60N., 5° 40'·84W.
 35° 54'·68N., 5° 42'·25W.
 35° 56'·06N., 5° 42'·76W.

2. Mariners are advised to navigate with caution in the area.

1021(T)/25 MOROCCO - North Coast - Works. (continued)

3. *Former Notice 3981(T)/24 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 91 — 141 — 142 — 773

1130(T)/25 ROMANIA - Buoyage.

Source: Romanian Notice 12/99(T)/24

1. The following ODAS buoys have been temporarily removed:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.Y.2.5s</i>	ODAS	Spherical	44° 03'·88N., 28° 40'·71E.
<i>Fl.Y.2.5s</i>	ODAS	Spherical	44° 14'·00N., 28° 39'·65E.
<i>Fl.Y.2.5s</i>	ODAS	Spherical	44° 19'·11N., 28° 44'·01E.

(WGS84 DATUM)

Charts affected — 2282 — 2284

1174(T)/25 BLACK SEA - Buoy.

Source: UKHO

1. The Feodosiyskiy safe-water light-buoy, *LFl.6s*, in position 45° 04'·2N., 35° 29'·1E. is reported missing.
 (WGS84 DATUM)

Chart affected — 2233

1210(T)/25 BLACK SEA - Maritime limit.

Source: UKHO

1. A circular area, radius 0·6NM, within which navigation is not recommended, is reported to exist, centred on 45° 03'·2N., 36° 28'·8E.
 (WGS84 DATUM)

Charts affected — 2216 — 2233 — 2242

1274(T)/25 SEA OF AZOV - Anchorage areas. Spoil ground. Recommended route. Restricted areas.

Source: UKHO

1. Mariners should exercise particular caution when navigating within the following areas and along the following recommended route:

<i>Location</i>	<i>Position</i>
<i>Anchorage Area No 457</i>	46° 55'·93N., 37° 30'·00E.
<i>Anchorage Area No 458</i>	46° 58'·93N., 37° 31'·75E.
<i>Spoil Ground</i>	46° 56'·43N., 37° 26'·54E.
<i>Recommended Route No 55</i>	46° 35'·81N., 36° 37'·20E.

2. Anchoring, fishing, dredging, underwater activities and explosive operations are prohibited within these areas until any remaining mines have been cleared.
 (WGS84 DATUM)

Charts affected — 2234 — 3302 — 3303

1284(T)/25 UKRAINE - Buoy.

Source: UKHO

1. The No 2 port-hand light-buoy, *Fl.R.3s*, in position 46° 36'·75N., 36° 35'·90E. is reported missing.
 2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 2234 — 3302

1321(T)/25 UKRAINE - Buoy.

Source: UKHO

1. The *No 23* starboard-hand light-buoy, *Fl.G.3s*, in position 45° 18'·51N., 36° 30'·99E. is reported unlit.
(WGS84 DATUM)

Chart affected — 2242**1521(T)/25 BLACK SEA - Wreck.**

Source: UKHO

1. A wreck, depth 3·5m, is reported to exist in position 45° 18'·7N., 32° 48'·1E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2232**1550(T)/25 MALTA - Works.**

Source: Transport Malta

1. Works are taking place at quays in Valletta Harbour within areas bounded by the following positions:

35° 53'·674N., 14° 30'·813E.
35° 53'·657N., 14° 30'·843E.
35° 53'·656N., 14° 30'·831E.
35° 53'·611N., 14° 30'·799E.
35° 53'·594N., 14° 30'·749E.
35° 53'·508N., 14° 30'·602E.

2. and

35° 52'·985N., 14° 30'·227E.
35° 53'·011N., 14° 30'·197E.
35° 53'·180N., 14° 30'·409E.
35° 53'·130N., 14° 30'·443E.
35° 53'·120N., 14° 30'·419E.

3. and

35° 53'·251N., 14° 30'·314E.
35° 53'·237N., 14° 30'·336E.
35° 53'·071N., 14° 30'·130E.
35° 53'·088N., 14° 30'·111E.

4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 177**1599(T)/25 BLACK SEA - Buoy.**

Source: UKHO

1. It has been reported that a mooring buoy exists in position 44° 37'·27N., 33° 33'·24E.
(PULKOVO 1942 DATUM)

Chart affected — 2217**1602(T)/25 BLACK SEA - Obstructions.**

Source: UKHO

1. Submerged obstructions, consisting of large concrete blocks, are reported to exist in the following positions:

<i>Depth</i>	<i>Position</i>
15·8m	44° 37'·17N., 33° 32'·22E.
8·8m	44° 36'·95N., 33° 34'·52E.

1602(T)/25 BLACK SEA - Obstructions. (continued)

2. Mariners are advised to navigate with caution in the area.
(PULKOVO 1942 DATUM)

Chart affected — 2217**1713(T)/25 RUSSIA - Black Sea Coast - Buoy.**

Source: Russian Notice 5/443/25

1. The *No 1* light-buoy, *Fl.G.3s*, in position 45° 01'·94N., 36° 36'·61E. is reported unlit.
(WGS84 DATUM)

Chart affected — 2216**1766(T)/25 ALGERIA - Buoyage.**

Source: Algerian Notices 24/10/21 and 1/16/25

1. The yellow pillar light-buoys, *Fl(3)Y.9s*, in positions 36° 46'·68N., 3° 09'·25E. and 36° 46'·72N., 3° 10'·18E. are reported off station.
2. Mariners are advised to navigate with caution in the area.
3. Former Notice 1758(T)/24 is cancelled.
(WGS84 DATUM)

Chart affected — 855**1775(T)/25 BLACK SEA - Wreck. Depth. Restricted area.**

Source: UKHO

1. A wreck, depth 62m, is reported to exist in position 44° 36'·3N., 33° 24'·7E.
2. Anchoring, fishing and seabed activities are not recommended in the vicinity of the wreck, due to the presence of explosives.
3. Mariners are advised to navigate with caution in the area.
(Pulkovo 1942 Datum)

Chart affected — 2217**1890(P)/25 ITALY - Sicilia - Submarine cable.**

Source: Italian Notice 5.34(T)/25

1. A submarine cable is being laid between Battipaglia and Termini Imerese, joining the following positions:
 37° 58'·62N., 13° 48'·00E.
 38° 09'·93N., 13° 51'·37E.
 38° 13'·50N., 14° 01'·51E.
 38° 20'·20N., 14° 34'·39E.
 38° 17'·06N., 14° 54'·77E.
 38° 32'·96N., 15° 38'·35E.
 38° 47'·98N., 15° 53'·88E.
 39° 45'·00N., 15° 34'·74E.
 39° 56'·65N., 15° 21'·07E.
 40° 10'·87N., 14° 44'·71E.
 40° 16'·46N., 14° 40'·24E.
 40° 28'·17N., 14° 42'·42E.
 40° 35'·28N., 14° 52'·88E.
2. Mariners are advised to navigate with caution in the area and maintain a safe clearance distance from vessels involved in the works.
(WGS84 DATUM)

Charts affected — 172 — 908 — 963 — 1018 — 1908 — 1941 — 1976**2001(T)/25 CYPRUS - Buoy.**

Source: Cyprus Department of Lands and Surveys

1. A yellow *ODAS* light-buoy, *Fl(5)Y.20s*, has been established in position 35° 00'·49N., 34° 04'·21E.

2001(T)/25 CYPRUS - Buoy. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 851**2028(T)/25 CROATIA - Buoy.**

Source: Croatian Notice 2/6(T)/25

1. The pillar, X-shape topmark light-buoy, *Fl(2)Y*, in position 43° 43'·70N., 15° 52'·98E. has been temporarily removed.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2773**2031(T)/25 ITALY - East Coast - Works.**

Source: Italian Notice 5.50(T)/25

1. Marine sampling works are taking place in an area bounded by the following positions:
44° 30'·74N., 12° 20'·36E.
44° 31'·03N., 12° 21'·15E.
44° 30'·63N., 12° 24'·05E.
44° 29'·35N., 12° 24'·53E.
44° 28'·77N., 12° 22'·91E.
2. During the works, fishing gear will be poitioned throughout this area.
3. Mariners are advised to navigate with caution in the area and are requested to keep listening to the radio on VHF Ch 16.
(WGS84 DATUM)

Charts affected — 204 — 220 — 1467**2187(P)/25 TÜRKIYE - Marmara Denizi - Harbour developments.**

Source: ENC TR300295

1. Significant Harbour developments including breakwater, dry dock, piers and quay construction works are taking place, within an unsurveyed area bounded by the following positions:
40° 26'·901N., 27° 08'·836E.
40° 27'·459N., 27° 09'·250E.
40° 27'·09N., 27° 10'·01E.
40° 26'·77N., 27° 09'·76E.
2. Latest depths are unknown.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1004**2211(T)/25 ROMANIA - Works.**

Source: Romanian Notices 1/15(T)/25 and 4/34(T)/25

1. Drilling and underwater works are taking place, until 31st December 2026, in an area bounded by the following positions:
44° 04'·4N., 30° 34'·1E.
44° 02'·4N., 30° 30'·5E.
43° 51'·9N., 30° 41'·1E.
43° 48'·7N., 30° 44'·3E.
43° 50'·7N., 30° 50'·4E.
44° 02'·8N., 30° 37'·8E.
44° 04'·7N., 30° 37'·9E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2214 — 2232

2631(T)/25 ISRAEL - Mediterranean Sea Coast - Spoil grounds.

Source: Israeli Notice 28/25

1. Dumping areas have been established in the approaches to the port of Hefa (Haifa), bounded by the following positions:

32° 49'·95N., 35° 00'·67E.

32° 50'·53N., 34° 59'·78E.

32° 50'·74N., 34° 59'·98E.

32° 50'·16N., 35° 00'·86E.

2. and

32° 50'·92N., 34° 59'·95E.

32° 51'·22N., 34° 59'·42E.

32° 51'·35N., 34° 59'·52E.

32° 51'·06N., 35° 00'·06E.

3. Fishing and all underwater activities are prohibited within the areas.
4. For the latest information regarding the Alfa anchorages, contact the local port authority.
5. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1585**2709(P)/25 ISRAEL - Mediterranean Sea Coast - Submarine pipelines. Works.**

Source: ENC IL200011 and UKHO

1. Submarine pipeline laying operations are taking place, joining the following positions:

31° 44'·1N., 34° 17'·7E.

31° 52'·4N., 34° 23'·2E.

31° 55'·6N., 34° 24'·5E.

31° 59'·0N., 34° 25'·3E.

32° 02'·8N., 34° 24'·0E.

32° 06'·5N., 34° 21'·5E.

32° 10'·5N., 34° 16'·7E.

32° 30'·6N., 34° 11'·5E.

32° 59'·4N., 34° 04'·5E.

2. and

32° 58'·0N., 33° 39'·4E.

32° 56'·6N., 33° 42'·5E.

32° 56'·3N., 33° 52'·0E.

32° 52'·3N., 33° 59'·3E.

32° 52'·1N., 34° 04'·9E.

32° 45'·4N., 34° 16'·8E.

32° 44'·5N., 34° 22'·0E.

32° 37'·5N., 34° 34'·9E.

32° 37'·8N., 34° 37'·2E.

32° 35'·8N., 34° 43'·5E.

32° 36'·1N., 34° 45'·8E.

32° 35'·9N., 34° 51'·0E.

32° 35'·6N., 34° 54'·9E.

3. and

33° 10'·5N., 34° 17'·3E.

33° 08'·3N., 34° 18'·2E.

32° 49'·8N., 34° 33'·6E.

32° 48'·4N., 34° 34'·5E.

32° 47'·3N., 34° 35'·9E.

32° 43'·9N., 34° 38'·5E.

32° 40'·4N., 34° 42'·5E.

32° 38'·4N., 34° 46'·7E.

32° 35'·9N., 34° 51'·0E.

32° 35'·6N., 34° 54'·9E.

4. Mariners are advised to navigate with caution in the area.

2709(P)/25 ISRAEL - Mediterranean Sea Coast - Submarine pipelines. Works. (continued)

5. Charts will be updated when works are complete.
6. Former Notice 4674(T)/24 is cancelled.
(WGS84 DATUM)

Charts affected — 1585 — 1591 — 2634**2815(T)/25 ITALY - West Coast - Works.**

Source: Italian Notice 10.10(T)/25

1. Restoration works are taking place on sections of the breakwater Diga dell'Aeroporto/Diga di Cornigliano joining positions:
 - 44° 23'·978N., 8° 52'·841E.
 - 44° 24'·191N., 8° 52'·194E.
 - 44° 24'·812N., 8° 49'·026E.
2. Navigation, mooring, anchoring and any other activities are prohibited in the vicinity of vessels engaged in the works.
(WGS84 DATUM)

Charts affected — 354 — 355 — 356 — 1913**2816(T)/25 ITALY - East Coast - Works. Restricted area.**

Source: Italian Notice 10.15(T)/25

1. Works are taking place in areas bounded by the following positions:
 - 41° 38'·09N., 15° 56'·13E.
 - 41° 38'·13N., 15° 56'·22E.
 - 41° 37'·21N., 15° 56'·83E.
 - 41° 37'·17N., 15° 56'·73E.
2. and
 - 41° 37'·17N., 15° 56'·73E.
 - 41° 37'·27N., 15° 56'·98E.
 - 41° 36'·84N., 15° 57'·22E.
 - 41° 36'·76N., 15° 57'·01E.
3. Entry into the designated areas is prohibited.
4. Mariners are required to keep a safe distance of no less than 300m from the designated areas.
(WGS84 DATUM)

Chart affected — 1443**2817(T)/25 ITALY - Sicilia - Restricted areas.**

Source: Italian Notice 9.16(T)/25

1. Restricted areas, entry prohibited, have been established bounded by the following positions:
 - 37° 58'·95N., 13° 47'·63E.
 - 37° 59'·26N., 13° 47'·65E.
 - 37° 59'·62N., 13° 49'·16E.
 - 37° 59'·31N., 13° 49'·17E.
2. and
 - 38° 01'·5N., 13° 52'·8E.
 - 38° 01'·7N., 13° 53'·5E.
 - 38° 00'·8N., 13° 54'·2E.
 - 38° 00'·4N., 13° 53'·3E.
3. and
 - 37° 59'·39N., 13° 47'·30E.
 - 37° 59'·04N., 13° 47'·37E.
 - 37° 59'·01N., 13° 47'·13E.
 - 37° 59'·39N., 13° 47'·09E.

2817(T)/25 ITALY - Sicilia - Restricted areas. (continued)

4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 963 — 1976**2843(P)/25 ROMANIA - Depths. Works.**

Source: Romanian Notices 3/25(P)-26(P)/25

1. As a result of coastal erosion, the depths in the vicinity of the coast have undergone changes in the coastal sectors between the following positions:

Mangalia	43° 54′·07N., 28° 37′·09E.
	43° 48′·30N., 28° 35′·55E.
Costinesti	43° 56′·38N., 28° 38′·30E.
	43° 57′·72N., 28° 38′·89E.

2. Sea defence construction works are in progress in the coastal sectors above.
3. Mariners are advised to navigate with caution in the area.
4. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 2282**2904(T)/25 TÜRKIYE - South Coast - Wrecks.**

Source: Turkish Notice 16/77(T)/25

1. A dangerous wreck exists in position: 36° 37′·26N., 29° 05′·45E.
2. A stranded wreck exists in position: 36° 38′·19N., 29° 05′·94E.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1644**2997(T)/25 ALGERIA - Obstruction.**

Source: Algerian Notice 8/1/25

1. A floating obstruction has been reported in position 36° 58′·5N., 7° 04′·2E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 252 — 2121

3082(P)/25 ITALY - Sicilia - Submarine cable.

Source: SubCom

1. The Mediterranean Sea section of the IEX submarine fibre optic cable system is being laid between Marseille, Vado Ligure (Italy), Kólpos Mesará (Kíti) and Al Iskandariyah (Alexandria) south-westwards. The completed sections will be updated by Notice to Mariners. The proposed cable route positions in depths of less than 200m are listed below:

36° 52'·8N., 12° 24'·5E.
 36° 55'·8N., 12° 21'·9E.
 37° 01'·4N., 12° 18'·9E.
 37° 10'·3N., 12° 11'·7E.
 37° 13'·6N., 12° 10'·5E.
 37° 14'·7N., 12° 08'·8E.
 37° 20'·1N., 12° 01'·8E.
 37° 21'·3N., 12° 00'·1E.
 37° 21'·7N., 11° 59'·4E.
 37° 22'·0N., 11° 58'·8E.
 37° 23'·8N., 11° 55'·3E.
 37° 24'·2N., 11° 54'·6E.
 37° 24'·5N., 11° 53'·6E.
 37° 27'·2N., 11° 46'·5E.
 37° 27'·7N., 11° 45'·7E.
 37° 28'·7N., 11° 44'·6E.
 37° 29'·5N., 11° 43'·9E.
 37° 31'·0N., 11° 43'·1E.
 37° 31'·2N., 11° 43'·0E.
 37° 31'·5N., 11° 43'·0E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 2122 — 2123**3190(T)/25 CROATIA - Measuring instrument. Restricted area.**

Source: Croatian Notice 4/29(T)/25

1. A sound meter is anchored in vicinity of 42° 40'·01N., 18° 02'·20E. Anchoring is prohibited within 100 metres radius of this position.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 680 — 1580**3199(T)/25 ITALY - West Coast - Restricted area. Buoyage.**

Source: Italian Notices 8.1/25 and 8.26/25

1. A restricted area, entry prohibited, marked by yellow light-buoys, has been established bounded by the following positions:

*44° 24'·08N., 8° 53'·28E.
 *44° 24'·04N., 8° 53'·26E.
 *44° 23'·70N., 8° 53'·21E.
 *44° 23'·31N., 8° 53'·75E.
 *44° 23'·00N., 8° 54'·53E.
 *44° 22'·75N., 8° 55'·45E.
 *44° 22'·85N., 8° 56'·25E.
 *44° 23'·30N., 8° 56'·26E.
 *44° 23'·33N., 8° 56'·27E.
2. *Former Notice 3517(T)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 356 — 1913

3309(P)/25 SEA OF AZOV - Wrecks.

Source: UKHO

1. Two wrecks, each 20m wide, are reported to exist between the following positions:

46° 45'·020N., 36° 46'·248E.

46° 44'·920N., 36° 46'·248E.

2. and

46° 45'·031N., 36° 46'·343E.

46° 44'·932N., 36° 46'·343E.

3. Mariners are advised to navigate with caution in the area and consult the local port authority for the latest information.
4. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 3302**3318(T)/25 MALTA - Restricted areas.**

Source: ENC MT500177

1. Restricted areas, entry prohibited, have been established bounded by the following positions:

35° 55'·530N., 14° 29'·676E.

35° 55'·499N., 14° 29'·704E.

35° 55'·449N., 14° 29'·672E.

35° 55'·461N., 14° 29'·612E.

2. and

35° 55'·149N., 14° 29'·679E.

35° 55'·140N., 14° 29'·681E.

35° 55'·130N., 14° 29'·587E.

3. and

35° 54'·326N., 14° 30'·710E.

35° 54'·311N., 14° 30'·689E.

35° 54'·356N., 14° 30'·619E.

35° 54'·369N., 14° 30'·631E.

4. and

35° 54'·067N., 14° 30'·637E.

35° 54'·137N., 14° 30'·725E.

35° 54'·130N., 14° 30'·734E.

5. and

35° 53'·946N., 14° 30'·046E.

35° 53'·943N., 14° 30'·062E.

35° 53'·889N., 14° 30'·045E.

35° 53'·894N., 14° 30'·025E.

6. and

35° 53'·902N., 14° 30'·276E.

35° 53'·916N., 14° 30'·279E.

35° 53'·928N., 14° 30'·301E.

35° 53'·925N., 14° 30'·321E.

7. and

35° 53'·584N., 14° 31'·610E.

35° 53'·654N., 14° 31'·629E.

8. and

35° 53'·450N., 14° 31'·226E.

35° 53'·452N., 14° 31'·228E.

35° 53'·418N., 14° 31'·271E.

35° 53'·412N., 14° 31'·264E.

3318(T)/25 MALTA - Restricted areas. (continued)

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 177**3405(P)/25 CYPRUS - Wreck.**

Source: Cyprus Department of Lands and Surveys

- The wreck of a barge has been reported within the limit of the Moni Anchorage Area, in approximate position 34° 41'·06N., 33° 10'·03E.
- *An emergency wreck marking buoy, *Fl(2)5s*, has been deployed in the same position as above.
- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
- *Former Notice 2885(P)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 849 — 850**3617(T)/25 SPAIN - Mediterranean Sea Coast - Wreck. Buoy.**

Source: Spanish Notice 30/244(T)/25

- A dangerous wreck, marked by emergency wreck marking buoy, *AlOc(2)BuY.3sIM*, exists in position 41° 19'·345N., 2° 09'·792E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 1180 — 1196**3860(T)/25 UKRAINE - Buoy.**

Source: UKHO

- The starboard-hand lateral light-buoy, *Fl.G.3s No15*, in position 47° 01'·32N., 37° 29'·76E. is reported missing.
(WGS84 DATUM)

Chart affected — 3303**3863(P)/25 TÜRKIYE - South Coast - Works. Depths.**

Source: Turkish Chart 3342

- Due to port works in Isdemir, depths may differ from those charted within an area bounded by the following positions:
36° 44'·94N., 36° 11'·28E.
36° 43'·67N., 36° 12'·11E.
36° 42'·31N., 36° 11'·57E.
36° 42'·44N., 36° 11'·19E.
36° 42'·99N., 36° 11'·06E.
36° 43'·19N., 36° 10'·90E.
36° 43'·47N., 36° 10'·88E.
36° 43'·96N., 36° 11'·08E.
36° 44'·50N., 36° 11'·03E.
36° 44'·94N., 36° 11'·05E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2104

3865(T)/25 CROATIA - Buoyage.

Source: Croatian Notice 5/13(T)/25

1. The following special light-buoys, *Fl.Y.2s*, have been established in the following positions:

43° 32'·59N., 16° 24'·12E.

43° 32'·58N., 16° 24'·26E.

(WGS84 DATUM)

Chart affected — 269**3916(T)/25 ITALY - Sicilia - Restricted area.**

Source: Italian Notice 13.14(T)/2025

1. A prohibited area has been established, radius 50m, centred on 37° 13'·75N., 15° 11'·82E.
2. Navigation, transit, the mooring of any unit and generally, any activity will be prohibited of a distance of 100m.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 966**3918(T)/25 ITALY - West Coast - Works. Buoyage.**

Source: Italian Notice 13.10/2025

1. Works are taking place in the area bounded by the following positions and marked by buoys with flashing yellow lights:

44° 24'·756N., 8° 49'·332E.

44° 24'·799N., 8° 49'·348E.

44° 24'·777N., 8° 49'·461E.

44° 24'·734N., 8° 49'·445E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 354 — 356**3922(T)/25 ITALY - Sicilia - Restricted area.**

Source: Italian Notice 14.24(T)/25

1. An anchoring prohibited area has been established, radius 250m, centred on position 37° 00'·50N., 14° 15'·00E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 965**3927(T)/25 ITALY - East Coast - Submarine pipelines.**

Source: Italian Notice 14.31(T)/25

1. Pipeline surveying operations are taking place, in the vicinity of lines joining the following positions:

44° 24'·00N., 12° 18'·17E.

44° 28'·82N., 12° 27'·19E.

2. and

44° 23'·48N., 12° 33'·62E.

44° 24'·34N., 12° 32'·79E.

3. and

44° 24'·00N., 12° 18'·17E.

44° 23'·48N., 12° 33'·62E.

4. and

44° 28'·82N., 12° 27'·19E.

44° 23'·40N., 12° 27'·21E.

3927(T)/25 ITALY - East Coast - Submarine pipelines. (continued)

5. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 204 — 220 — 1467**3930(T)/25 ITALY - East Coast - Buoy.**

Source: Italian Notice 14.27(T)/25

1. An ODAS buoy has been deployed, until further notice, in position 40° 39'·200N., 17° 59'·616E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1545**3934(T)/25 ITALY - West Coast - Buoyage.**

Source: Italian Notice 14.20(T)/25

1. Environmental monitoring buoys, *Fl.Y.3s*, have been established in the following positions:

44° 06'·199N., 9° 50'·064E.
44° 05'·905N., 9° 50'·717E.
44° 04'·402N., 9° 51'·411E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 118**4001(P)/25 GEORGIA - Works.**

Source: ENC GE510110

1. Works associated with the construction of an artificial Island are taking place within an area bounded by the following positions:

41° 39'·055N., 41° 39'·873E.
41° 39'·041N., 41° 39'·856E.
41° 39'·159N., 41° 39'·697E.
41° 39'·398N., 41° 39'·753E.
41° 39'·415N., 41° 39'·737E.
41° 39'·560N., 41° 39'·715E.
41° 39'·869N., 41° 40'·041E.
41° 39'·906N., 41° 40'·432E.
41° 39'·833N., 41° 40'·577E.
41° 39'·821N., 41° 40'·568E.
41° 39'·731N., 41° 40'·748E.
2. Mariners are advised to navigate with caution and consult the local port authorities for the latest information.
3. Chart 3317 will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 3317

4307(T)/25 ITALY - West Coast - Works. Breakwater.

Source: : Italian Notice 15.23(T)/25

1. Survey works, in connection with the construction of a new breakwater in the port of Genoa, are taking place in an area bounded by the following positions:

44° 24'·059N., 8° 53'·612E.
 44° 24'·140N., 8° 53'·651E.
 44° 23'·983N., 8° 54'·349E.
 44° 23'·873N., 8° 55'·087E.
 44° 24'·068N., 8° 55'·152E.
 44° 24'·044N., 8° 55'·295E.
 44° 23'·764N., 8° 55'·472E.
 44° 23'·318N., 8° 56'·948E.
 44° 23'·242N., 8° 56'·901E.
 44° 23'·845N., 8° 54'·961E.
 44° 23'·821N., 8° 54'·921E.

2. Mariners are requested to maintain a safe distance of at least 50m from works vessels and to navigate with caution at a reduced speed in the area.
(WGS84 DATUM)

Charts affected — 355 — 356**4349(P)/25 CYPRUS - Works. Berth. Submarine pipelines.**

Source: Cyprus Department of Lands and Surveys.

1. Works are taking place to construct an LPG Berth and subsea pipelines in an area bounded by the following positions:

34° 43'·172N., 33° 18'·752E.
 34° 42'·876N., 33° 18'·671E.
 34° 42'·712N., 33° 18'·829E.
 34° 42'·546N., 33° 18'·626E.
 34° 42'·711N., 33° 18'·424E.
 34° 42'·871N., 33° 18'·563E.
 34° 43'·188N., 33° 18'·713E.

2. Mariners are advised to keep clear of the construction area at all times and consult the local port authorities for the latest information.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 849 — 850**4404(P)/25 MEDITERRANEAN SEA - Submarine cables.**

Source: Alcatel Submarine Networks and UKHO

1. The Medusa submarine fibre optic cable system is due to be laid. The proposed positions in depths of less than 200m are listed below with details of the relevant, largest scale Admiralty Charts affected [in brackets]. The accompanying diagram shows the overall coverage of the proposed cables.
2. A - Morocco (Melilla) to Spain (Barcelona) and France (Marseille) [153, 580, 1196, 1704, 1705, 2116, 2437]:

35° 18'·9N., 2° 41'·1W.
 35° 08'·6N., 2° 42'·2W.
 35° 06'·8N., 2° 43'·0W.

3. and

41° 24'·1N., 2° 41'·7E.
 41° 24'·2N., 2° 41'·4E.
 41° 24'·6N., 2° 39'·0E.
 41° 24'·8N., 2° 35'·6E.
 41° 24'·9N., 2° 32'·8E.
 41° 24'·7N., 2° 30'·0E.
 41° 24'·1N., 2° 23'·2E.
 41° 24'·1N., 2° 21'·1E.
 41° 24'·4N., 2° 19'·1E.
 41° 25'·39N., 2° 14'·02E.

4404(P)/25 MEDITERRANEAN SEA - Submarine cables. (continued)

4. and

43° 15'·01N., 5° 22'·40E.
 43° 15'·04N., 5° 22'·24E.
 43° 14'·99N., 5° 21'·67E.
 43° 15'·02N., 5° 21'·45E.
 43° 15'·15N., 5° 21'·10E.
 43° 15'·17N., 5° 20'·90E.
 43° 15'·27N., 5° 20'·36E.
 43° 15'·24N., 5° 19'·87E.
 43° 15'·15N., 5° 19'·53E.
 43° 14'·39N., 5° 17'·71E.
 43° 14'·33N., 5° 16'·86E.
 43° 13'·46N., 5° 12'·90E.
 43° 11'·95N., 5° 11'·24E.
 43° 06'·9N., 5° 08'·6E.
 43° 06'·1N., 5° 03'·8E.
 43° 06'·2N., 5° 02'·7E.
 43° 06'·0N., 5° 01'·4E.
 43° 04'·1N., 4° 59'·7E.
 43° 02'·2N., 4° 56'·8E.
 43° 00'·7N., 4° 47'·0E.
 42° 59'·2N., 4° 44'·2E.
 42° 56'·2N., 4° 42'·2E.
 42° 51'·6N., 4° 42'·5E.

5. **B** – France (Marseille) to Tunisia (Bizerte), Italy (Mazara del Vallo) and Malta (Ras il-Wahx) [153, 194, 964, 1705, 2116, 2121, 2122, 2123, 2537, 2538]:

43° 04'·6N., 5° 17'·9E.
 43° 04'·8N., 5° 17'·9E.
 43° 05'·2N., 5° 17'·7E.
 43° 05'·5N., 5° 17'·6E.
 43° 05'·7N., 5° 17'·6E.
 43° 07'·3N., 5° 17'·3E.
 43° 07'·6N., 5° 17'·4E.
 43° 08'·05N., 5° 17'·24E.
 43° 08'·31N., 5° 17'·27E.
 43° 08'·87N., 5° 17'·34E.
 43° 09'·52N., 5° 17'·32E.
 43° 09'·77N., 5° 17'·51E.
 43° 11'·22N., 5° 17'·48E.
 43° 12'·03N., 5° 17'·68E.
 43° 12'·66N., 5° 17'·71E.
 43° 13'·35N., 5° 17'·91E.
 43° 13'·49N., 5° 18'·01E.
 43° 14'·13N., 5° 18'·77E.
 43° 14'·31N., 5° 19'·06E.
 43° 14'·62N., 5° 19'·72E.

6. and

43° 14'·70N., 5° 19'·88E.
 43° 15'·01N., 5° 20'·60E.
 43° 15'·02N., 5° 20'·65E.
 43° 15'·03N., 5° 20'·76E.
 43° 15'·06N., 5° 20'·90E.
 43° 15'·07N., 5° 21'·04E.
 43° 14'·94N., 5° 21'·59E.
 43° 15'·00N., 5° 22'·24E.
 43° 14'·98N., 5° 22'·40E.

4404(P)/25 MEDITERRANEAN SEA - Submarine cables. (continued)

7. and

37° 17'·4N., 9° 52'·5E.
37° 17'·6N., 9° 53'·5E.
37° 17'·7N., 9° 53'·7E.
37° 18'·0N., 9° 54'·0E.
37° 18'·5N., 9° 54'·2E.
37° 19'·5N., 9° 54'·3E.
37° 27'·5N., 9° 52'·8E.
37° 29'·2N., 9° 51'·9E.

8. and

37° 39'·61N., 12° 34'·11E.
37° 34'·5N., 12° 26'·5E.
37° 33'·8N., 12° 26'·4E.
37° 29'·7N., 12° 28'·3E.
37° 28'·3N., 12° 29'·5E.
37° 28'·1N., 12° 29'·7E.
37° 27'·4N., 12° 31'·0E.
37° 27'·0N., 12° 31'·4E.
37° 13'·2N., 12° 33'·4E.
37° 12'·7N., 12° 33'·6E.
37° 07'·7N., 12° 37'·4E.
37° 07'·2N., 12° 37'·7E.
37° 06'·6N., 12° 37'·8E.
37° 06'·2N., 12° 37'·8E.
37° 05'·9N., 12° 37'·6E.
36° 57'·0N., 12° 33'·7E.
36° 56'·7N., 12° 33'·6E.
36° 54'·3N., 12° 33'·1E.
36° 54'·0N., 12° 32'·9E.
36° 52'·7N., 12° 31'·6E.
36° 52'·1N., 12° 30'·5E.
36° 51'·8N., 12° 30'·1E.
36° 50'·1N., 12° 29'·4E.
36° 48'·8N., 12° 28'·8E.
36° 47'·5N., 12° 27'·3E.

9. and

36° 44'·9N., 12° 25'·5E.
36° 42'·5N., 12° 24'·5E.
36° 44'·5N., 12° 23'·0E.
36° 46'·5N., 12° 22'·0E.
36° 48'·9N., 12° 20'·5E.
36° 52'·6N., 12° 19'·0E.
36° 54'·9N., 12° 17'·7E.
36° 58'·1N., 12° 14'·0E.
36° 59'·5N., 12° 12'·5E.
37° 02'·1N., 12° 07'·8E.
37° 06'·5N., 12° 01'·4E.
37° 07'·8N., 12° 00'·1E.
37° 15'·0N., 11° 55'·7E.
37° 16'·5N., 11° 55'·8E.
37° 17'·5N., 11° 55'·0E.
37° 21'·0N., 11° 51'·0E.
37° 22'·4N., 11° 49'·8E.
37° 27'·5N., 11° 43'·2E.
37° 30'·6N., 11° 40'·5E.
37° 31'·2N., 11° 38'·9E.
37° 31'·9N., 11° 38'·0E.

4404(P)/25 MEDITERRANEAN SEA - Submarine cables. (continued)

10. and

35° 56'·04N., 14° 20'·63E.
 35° 55'·86N., 14° 20'·38E.
 35° 55'·68N., 14° 20'·01E.
 35° 55'·42N., 14° 19'·68E.
 35° 55'·09N., 14° 19'·48E.
 35° 54'·64N., 14° 19'·07E.
 35° 54'·29N., 14° 18'·90E.
 35° 54'·07N., 14° 18'·71E.
 35° 52'·51N., 14° 16'·87E.
 35° 52'·04N., 14° 16'·20E.
 35° 51'·69N., 14° 15'·48E.
 35° 51'·59N., 14° 15'·09E.
 35° 51'·53N., 14° 14'·68E.
 35° 51'·54N., 14° 14'·36E.

11. C – Libya (Ṭarābulus, Miṣrātah and Banghāzī) to Greece (Kolpos and Irakleion), Cyprus (Ktima) and Egypt (Port Said)
 [183, 775, 849, 1038, 1091, 1093, 1657, 2578, 3352, 3401, 3402, 3403, 3678]:

32° 51'·0N., 13° 27'·4E.
 32° 54'·2N., 13° 30'·2E.
 32° 55'·6N., 13° 31'·7E.
 32° 57'·1N., 13° 33'·6E.
 32° 59'·5N., 13° 34'·6E.
 33° 03'·9N., 13° 34'·8E.
 33° 14'·9N., 13° 36'·1E.

12. and

32° 32'·2N., 14° 59'·2E.
 32° 29'·9N., 14° 56'·8E.
 32° 26'·0N., 14° 55'·1E.

13. and

32° 10'·3N., 19° 47'·6E.
 32° 06'·8N., 19° 49'·4E.
 32° 05'·5N., 19° 50'·5E.
 32° 04'·6N., 19° 51'·8E.
 32° 04'·0N., 19° 53'·5E.
 32° 03'·87N., 19° 55'·61E.
 32° 04'·18N., 19° 58'·63E.
 32° 04'·13N., 20° 02'·09E.
 32° 04'·00N., 20° 02'·43E.

14. and

37° 51'·80N., 24° 02'·40E.
 37° 51'·88N., 24° 02'·69E.
 37° 51'·85N., 24° 03'·03E.
 37° 51'·31N., 24° 04'·83E.
 37° 49'·03N., 24° 10'·08E.
 37° 48'·26N., 24° 10'·92E.
 37° 47'·03N., 24° 11'·91E.
 37° 45'·04N., 24° 12'·32E.
 37° 44'·56N., 24° 12'·63E.
 37° 41'·75N., 24° 12'·97E.
 37° 38'·83N., 24° 12'·89E.
 37° 38'·33N., 24° 12'·73E.

4404(P)/25 MEDITERRANEAN SEA - Submarine cables. (continued)

15. and

35° 19'·91N., 25° 11'·73E.
 35° 20'·10N., 25° 11'·81E.
 35° 20'·43N., 25° 12'·11E.
 35° 21'·23N., 25° 12'·29E.
 35° 21'·79N., 25° 12'·56E.
 35° 22'·55N., 25° 12'·67E.
 35° 23'·11N., 25° 12'·48E.
 35° 23'·56N., 25° 12'·07E.
 35° 24'·64N., 25° 11'·08E.

16. and

34° 44'·01N., 32° 26'·98E.
 34° 43'·98N., 32° 26'·93E.
 34° 43'·94N., 32° 26'·91E.
 34° 43'·37N., 32° 26'·80E.
 34° 43'·28N., 32° 26'·75E.
 34° 43'·19N., 32° 26'·68E.
 34° 43'·13N., 32° 26'·59E.
 34° 42'·65N., 32° 25'·59E.
 34° 42'·43N., 32° 25'·38E.
 34° 41'·55N., 32° 25'·08E.
 34° 40'·58N., 32° 25'·12E.
 34° 39'·99N., 32° 24'·89E.
 34° 39'·58N., 32° 24'·54E.

17. and

31° 16'·41N., 32° 18'·08E.
 31° 16'·53N., 32° 18'·08E.
 31° 19'·16N., 32° 16'·18E.
 31° 19'·66N., 32° 16'·36E.
 31° 20'·41N., 32° 16'·15E.
 31° 20'·77N., 32° 15'·70E.
 31° 27'·47N., 32° 13'·02E.
 31° 28'·16N., 32° 11'·90E.
 31° 28'·71N., 32° 10'·18E.
 31° 28'·88N., 32° 09'·97E.
 31° 30'·92N., 32° 09'·06E.
 31° 31'·03N., 32° 07'·86E.
 31° 31'·21N., 32° 07'·23E.
 31° 33'·07N., 32° 05'·82E.
 31° 33'·20N., 32° 04'·76E.
 31° 33'·43N., 32° 04'·08E.
 31° 35'·46N., 32° 02'·09E.
 31° 35'·56N., 32° 01'·78E.
 31° 35'·41N., 32° 00'·55E.
 31° 35'·45N., 31° 59'·95E.
 31° 35'·77N., 31° 59'·29E.
 31° 36'·31N., 31° 58'·87E.
 31° 37'·27N., 31° 58'·57E.
 31° 37'·83N., 31° 58'·16E.
 31° 38'·85N., 31° 58'·01E.


4404(P)/25 MEDITERRANEAN SEA - Submarine cables. (continued)

18. and

31° 39′·23N., 31° 57′·87E.
31° 39′·52N., 31° 57′·61E.
31° 40′·03N., 31° 57′·22E.
31° 41′·67N., 31° 56′·42E.
31° 42′·41N., 31° 56′·22E.
31° 46′·70N., 31° 54′·15E.
31° 47′·11N., 31° 54′·00E.
31° 47′·44N., 31° 54′·09E.
31° 47′·72N., 31° 54′·31E.
31° 48′·03N., 31° 54′·39E.
31° 48′·34N., 31° 54′·28E.
31° 49′·37N., 31° 53′·06E.
31° 52′·77N., 31° 47′·30E.
31° 53′·55N., 31° 45′·60E.
31° 53′·84N., 31° 45′·42E.
31° 54′·74N., 31° 45′·43E.
31° 55′·11N., 31° 45′·27E.
31° 57′·5N., 31° 41′·4E.
31° 58′·7N., 31° 41′·2E.
32° 00′·4N., 31° 38′·8E.
32° 01′·4N., 31° 38′·5E.
32° 02′·8N., 31° 37′·9E.
32° 03′·5N., 31° 37′·8E.

19. Vessels are advised to monitor NAVAREA III; also local warnings and Notices to Mariners of other nations for the latest information regarding the cable laying activity.
20. Vessels should give the cable laying vessels a wide berth and avoid anchoring or trawling in the vicinity of the cable.
21. For further information regarding submarine cables, see The Mariner's Handbook (NP100).
22. Charts will be updated when works are complete.
(WGS84 DATUM)

**Charts affected — 153 — 183 — 194 — 580 — 775 — 849 — 964 — 1038 — 1091 — 1093 — 1196 — 1657 —
1704 — 1705 — 2116 — 2121 — 2122 — 2123 — 2437 — 2537 — 2538 — 2578 — 3352 — 3401 — 3402 —
3403 — 3678**

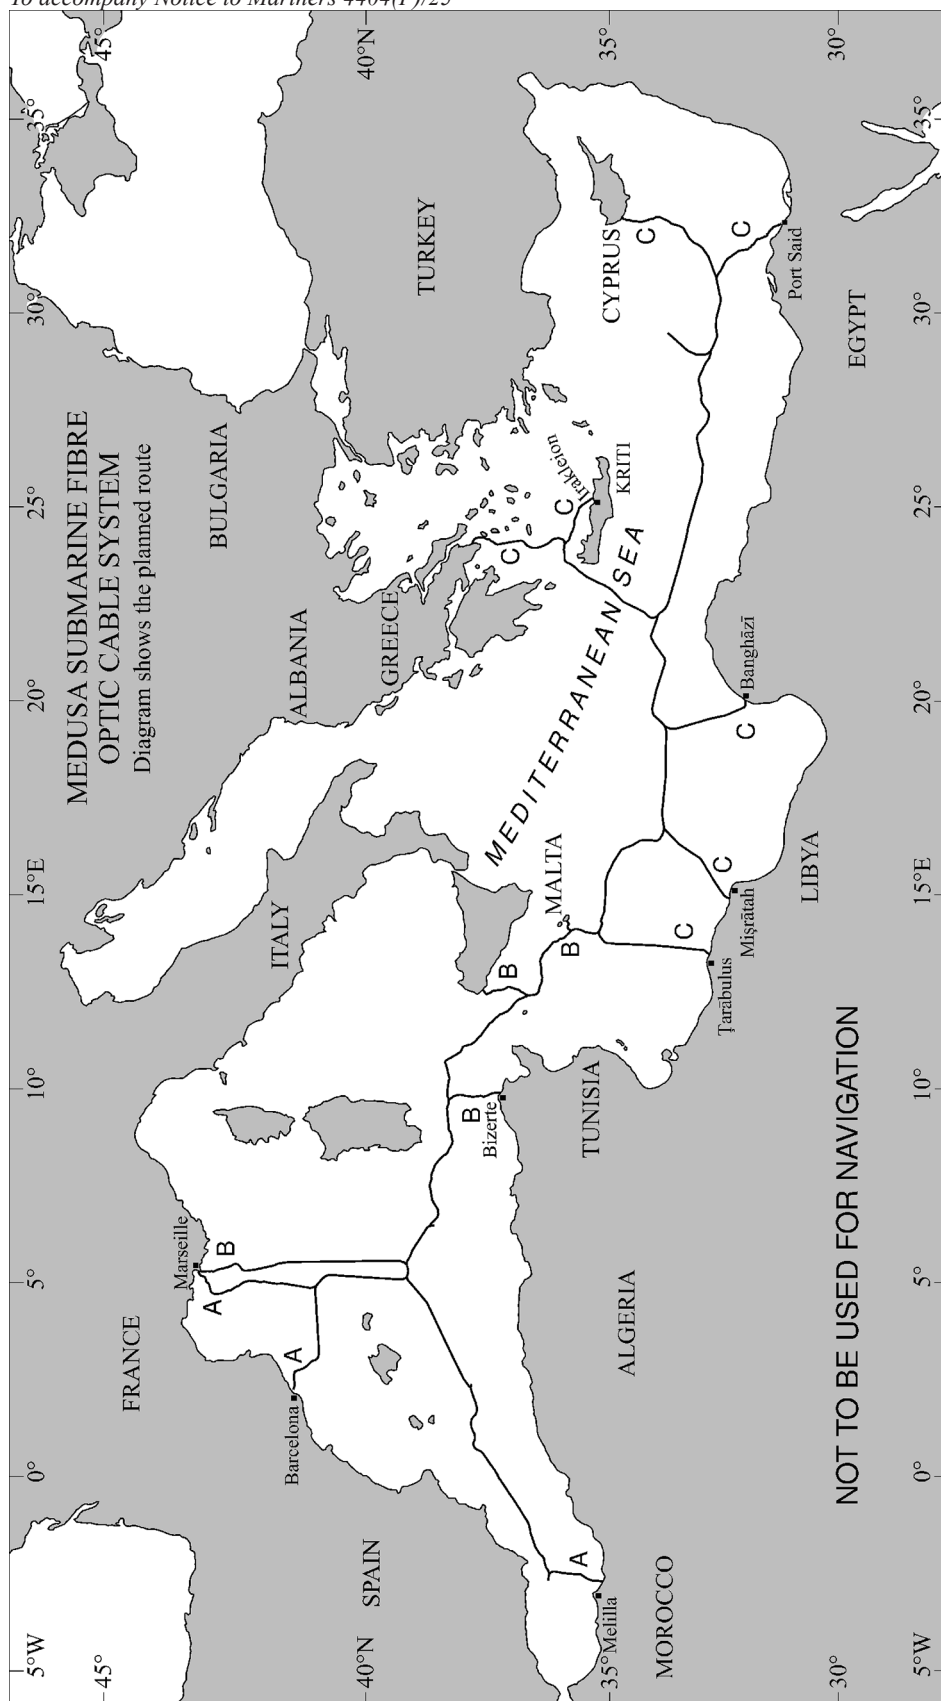

4619(T)/25 TUNISIA - Works.

Source: Tunisian Notice 14/177(T)/25

1. Diving operations are taking place, until early 2026, in the vicinity of the entrance to the port of Bizerte, in an area centred on: $37^{\circ} 16' \cdot 5N$, $9^{\circ} 53' \cdot 6E$.
2. Mariners are advised to navigate with caution when entering or leave the port, and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2121 — 2122

4627(P)/25 ITALY - West Coast - Submarine pipeline.

Source: Italian Notice 16.34(T)/25

1. Pipeline laying operations are taking place, in the vicinity of the line joining the following positions:

44° 23'·58N., 8° 56'·05E.

44° 23'·36N., 8° 56'·37E.

44° 23'·03N., 8° 56'·19E.

44° 22'·88N., 8° 55'·57E.

2. Mariners are advised to navigate with caution in the area and maintain a safe distance from vessels involved in the works.
(WGS84 DATUM)

Charts affected — 355 — 365**4629(P)/25 ITALY - Sardegna - Depth.**

Source: UKHO

1. Less water has been reported in the vicinity of position 40° 55'·04N., 9° 35'·98E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1211**4713(T)/25 ITALY - Sicilia - Breakwaters. Works.**

Source: Italian Notice 17.27(T)/25

1. Breakwater renovation works are taking place in the Port of Acquisanta in the vicinity of position 38° 08'·725N., 13° 22'·347E.
2. Material for these works is being taken from the breakwater in the vicinity of position 38° 07'·448N., 13° 22'·344E.
3. For the duration of the works, navigation is prohibited in the vicinity of these breakwaters.
4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information on VHF 16 for the Port of Palermo and VHF 74 for the Port of Acquisanta.
(WGS84 DATUM)

Chart affected — 963**4925(T)/25 ROMANIA - Scientific instrument.**

Source: Romanian Notice 7/69(T)/25

1. A submerged measuring instrument has been established on the seabed in the following position:
44° 03'·3N., 30° 36'·0E.
(WGS84 DATUM)

Chart affected — 2232**5095(P)/25 GEORGIA - Depths. Alongside depths. Light. Buoy.**

Source: ENC GE610405

1. Depths and alongside depths within and in the approaches to the Port of Kulevi have changed. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
11·3	42° 16'·991N., 41° 37'·120E.
13·3	42° 16'·511N., 41° 38'·095E.
10·9m	42° 16'·453N., 41° 38'·323E.
6m	42° 16'·430N., 41° 38'·429E.

2. The charted light, F.WRG.25m22-10M, in position 42° 16'·345N., 41° 38'·602E., has been extinguished.
3. The light-buoy in position 42° 16'·694N., 41° 37'·610E., has been moved to 42° 16'·685N., 41° 37'·543E.
4. Mariners are advised to navigate with caution in the area and to contact the local port authorities for the latest information.
5. These changes will be included in a New Edition of Chart 3317 to be published late 2025.
(WGS84 DATUM)

Chart affected — 3317

5217(T)/25 SPAIN - Mediterranean Sea Coast - Buoy.

Source: Spanish Notice 40/307(T)/25

1. *A starboard-hand lateral buoy, *Q.G.IsIM*, has been deployed, until further notice, in position 39° 38'·688N., 0° 12'·603W.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 507(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 1460**5405(P)/25 GEORGIA - Buoy.**

Source: ENC GE510110

1. A red *ODAS* buoy has been established in position 41° 40'·043N., 41° 39'·917E.
2. This change will be included in a New Edition of Chart 3317 to be published early 2026.
(WGS84 DATUM)

Chart affected — 3317**5424(T)/25 CROATIA - Measuring instrument. Restricted area.**

Source: Croatian Notice 6/14(T)/25

1. A measuring instrument has been established in the vicinity of 42° 39'·88N., 18° 00'·55E.
2. Anchoring is prohibited within 100 metres radius of this position.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 1580**5521(P)/25 ITALY - Sardegna - Firing practice areas.**

Source: Italian Notices 18.1/25, 19.1-2/25, 19.5-6/25, 19.10/25, and 19.12/25

1. Multiple new firing practice areas have been established in an area bounded by the following positions:
39° 23'·9N., 9° 36'·8E.
39° 01'·1N., 10° 09'·3E.
38° 49'·9N., 11° 30'·8E.
39° 51'·3N., 11° 44'·1E.
40° 45'·7N., 11° 17'·6E.
40° 39'·2N., 9° 44'·6E.
2. A firing practice area has been established bounded by the following positions:
38° 55'·2N., 8° 42'·5E.
38° 52'·3N., 8° 45'·8E.
38° 50'·6N., 8° 44'·7E.
38° 48'·9N., 8° 41'·3E.
38° 49'·0N., 8° 37'·0E.
38° 50'·0N., 8° 32'·8E.
38° 51'·8N., 8° 31'·4E.
38° 54'·0N., 8° 30'·7E.
38° 56'·0N., 8° 31'·7E.
38° 57'·0N., 8° 37'·1E.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. These changes will be included in New Editions of Charts 1983, 1990 and 1992 to be published early 2026.
5. Charts 1207 and 1210 will be updated by Notice to Mariners.
(WGS84 DATUM)

Charts affected — 1983 — 1990 — 1992

5599(T)/25 SPAIN - Mediterranean Sea Coast - Buoyage.

Source: Spanish Notice 42/321(T)/25

1. ODAS light-buoys, *Fl(5)Y.20s*, have been established in the following positions:

39° 27'·43N., 0° 18'·31W.

39° 23'·40N., 0° 17'·29W.

(WGS84 DATUM)

Charts affected — 518 — 562**5682(T)/25 ITALY - Sicilia - Works. Restricted area.**

Source: Italian Notice 19.40(T)/25

1. Port works are taking place in the port of Acquisanta.
2. An entry prohibited area has been established, radius 200m, centred on position 38° 08'·480N., 13° 22'·450E.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 963**5790(P)/25 ITALY - West Coast - Submarine cable.**

Source: Italian Notice 16.38(T)/25

1. *A submarine cable is being laid, joining the following positions:

37° 38'·79N., 12° 32'·99E.

37° 37'·79N., 12° 29'·39E.

37° 51'·8N., 11° 55'·2E.

37° 58'·1N., 11° 55'·4E.

39° 51'·0N., 11° 05'·4E.

40° 29'·8N., 10° 55'·2E.

40° 58'·7N., 10° 27'·0E.

41° 12'·7N., 10° 29'·8E.

41° 45'·5N., 10° 12'·8E.

42° 13'·4N., 10° 03'·8E.

42° 42'·3N., 9° 58'·3E.

43° 12'·2N., 9° 56'·3E.

44° 01'·08N., 9° 22'·80E.

44° 12'·82N., 9° 06'·78E.

44° 17'·90N., 9° 03'·22E.

44° 23'·640N., 8° 56'·824E.

2. *and

41° 45'·9N., 12° 13'·2E.

41° 45'·5N., 12° 11'·7E.

41° 43'·8N., 12° 10'·1E.

41° 39'·5N., 11° 59'·7E.

41° 32'·8N., 11° 39'·4E.

41° 28'·5N., 11° 06'·7E.

41° 18'·4N., 10° 44'·8E.

41° 13'·4N., 10° 07'·1E.

41° 09'·9N., 10° 03'·3E.

41° 02'·08N., 9° 42'·81E.

40° 59'·50N., 9° 41'·67E.

40° 57'·38N., 9° 37'·13E.

40° 56'·583N., 9° 34'·564E.

3. Mariners are advised to navigate with caution in the area and maintain a safe distance from any vessels involved in the works.
4. *Former Notice 2374(P)/25 is cancelled.

5790(P)/25 ITALY - West Coast - Submarine cable. (continued)

5. Charts will be updated when works are complete.

*Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 167 — 355 — 356 — 964 — 1210 — 1211 — 1911 — 1913 — 1914 — 1983 — 1992 — 1998 — 1999 — 2122

5791(P)/25 STRAIT OF GIBRALTAR - Submarine cables.

Source: Red Eléctrica

1. Submarine cables are being laid between Spain and Ceuta, joining the following positions:

35° 52'·88N., 5° 19'·49W.
 35° 52'·73N., 5° 19'·21W.
 35° 52'·53N., 5° 19'·01W.
 35° 52'·26N., 5° 18'·87W.
 35° 52'·17N., 5° 18'·44W.
 35° 52'·60N., 5° 16'·72W.
 35° 54'·29N., 5° 14'·14W.
 35° 56'·75N., 5° 13'·76W.
 35° 57'·42N., 5° 14'·02W.
 36° 00'·11N., 5° 16'·25W.
 36° 00'·33N., 5° 16'·43W.
 36° 00'·57N., 5° 16'·32W.
 36° 03'·05N., 5° 13'·26W.
 36° 06'·61N., 5° 10'·75W.
 36° 07'·58N., 5° 10'·57W.
 36° 11'·67N., 5° 12'·73W.
 36° 12'·33N., 5° 13'·50W.
 36° 12'·49N., 5° 14'·18W.
 36° 12'·58N., 5° 17'·24W.
 36° 12'·65N., 5° 17'·62W.
 36° 12'·59N., 5° 18'·89W.
 36° 12'·66N., 5° 19'·44W.

2. and

35° 52'·88N., 5° 19'·49W.
 35° 52'·72N., 5° 19'·17W.
 35° 52'·39N., 5° 18'·69W.
 35° 52'·40N., 5° 18'·33W.
 35° 52'·58N., 5° 17'·71W.
 35° 52'·52N., 5° 17'·37W.
 35° 52'·75N., 5° 16'·83W.
 35° 53'·00N., 5° 16'·65W.
 35° 54'·34N., 5° 14'·64W.
 35° 56'·65N., 5° 14'·25W.
 35° 57'·31N., 5° 14'·48W.
 35° 58'·58N., 5° 15'·70W.
 36° 00'·22N., 5° 16'·91W.
 36° 00'·72N., 5° 16'·83W.
 36° 03'·00N., 5° 13'·97W.
 36° 06'·73N., 5° 11'·23W.
 36° 07'·49N., 5° 11'·06W.
 36° 11'·48N., 5° 13'·17W.
 36° 12'·43N., 5° 14'·10W.
 36° 12'·49N., 5° 15'·06W.
 36° 12'·52N., 5° 17'·41W.
 36° 12'·57N., 5° 18'·15W.
 36° 12'·59N., 5° 18'·89W.

3. Mariners are advised to navigate with caution in the area.

4. Charts will be updated when works are complete.

(WGS84 DATUM)

Charts affected — 141 — 142 — 773 — 1448 — 2742 — 3578

INTENTIONALLY BLANK

(9) AFRICA, WEST COAST AND SOUTH ATLANTIC

4735(P)/14 SENEGAL - Depths.

Source: French Notice 39/1(P)/14

- Recent surveys show numerous depths less than charted exist in the Rivière Saloum. The most significant of these are as follows:

<i>Depth</i>	<i>Position</i>
0·9m	14° 06'·32N., 16° 30'·10W.
0·9m	14° 04'·54N., 16° 32'·13W.
1·8m	14° 03'·48N., 16° 33'·69W.
0·3m	14° 08'·03N., 16° 29'·30W.
2·9m	14° 08'·20N., 16° 27'·69W.
7·8m	14° 08'·14N., 16° 27'·59W.
4·7m	14° 08'·17N., 16° 27'·34W.
7·9m	14° 08'·45N., 16° 26'·81W.
6·4m	14° 09'·00N., 16° 26'·68W.
6·4m	14° 09'·85N., 16° 26'·49W.
4·1m	14° 10'·10N., 16° 25'·45W.
5·2m	14° 09'·88N., 16° 25'·25W.

- Mariners are advised to navigate with caution in the area and contact the local authorities for the latest information.
- The chart will be updated when further information becomes available.
(WGS84 Datum)

Chart affected — 607**1277(T)/18 GUINEA - Barge.**

Source: French Notice 7/05(T)/18

- A barge is reported to be moored in approximate position 8° 54'·0N., 14° 33'·0W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 601 — 1147**2294(T)/20 GHANA - Fog signal. Superbuoy.**

Source: Tullow Oil

- The fog signal, *Horn(U)30s*, at yellow superbuoy, *Mo(U)30s*, in position 4° 36'·6N., 2° 52'·6W. is temporarily inoperative.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1383**877(P)/21 IVORY COAST - Works. Bridge.**

Source: French Notice 52/14(P)/20

- Construction of a bridge is taking place in an area bounded by the following positions:

5° 20'·24N., 4° 02'·41W.
 5° 20'·41N., 4° 02'·14W.
 5° 20'·39N., 4° 02'·12W.
 5° 20'·22N., 4° 02'·38W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3103

1310(T)/21 CAMEROON - Buoy.

Source: French Notice 2/12(T)/21

1. The mooring buoy, *Q(5)10s*, in position 3° 29'·5N., 9° 15'·4E. has been temporarily removed.
(WGS84 DATUM)

Charts affected — 1387 — 3118**1324(P)/21 IVORY COAST - Works. Breakwaters.**

Source: French Notice 2/11(P)/21

1. Works are taking place in the Port of San Pedro 4° 44'·27N., 6° 36'·78W.
2. The East and West Breakwaters are being extended
3. A new container terminal is under construction to the NW of the cement plant.
4. Dredging works are taking place in the basin and access channel.
5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
6. Charts will be updated when full details are available
(WGS84 DATUM)

Chart affected — 3108**124(P)/22 IVORY COAST - Dredged area.**

Source: French Notice 40/9(P)/21

1. Dredging has taken place within the Port of Abidjan.
2. The Canal de Vridi, 5° 15'·46S., 4° 00'·764W., has been dredged to 16m.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. Chart 3103 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 3103**2416(T)/22 GABON - Obstruction.**

Source: French Notice 12/18(T)/22

1. An obstruction, depth unknown, exists in position 0° 43'·64S., 8° 47'·84E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1322**4968(P)/22 SENEGAL - Development area. Works.**

Source: Woodside Energy Ltd

1. As part of the development of the Sangomar oil field and the establishment of the Léopold Sédar Senghor FPSO, a works in progress area exists bounded by the following positions:
 13° 46'·8N., 17° 39'·3W.
 13° 46'·9N., 17° 30'·4W.
 13° 40'·4N., 17° 30'·3W.
 13° 40'·3N., 17° 39'·2W.
2. Infrastructure within the development area is planned to last until September 2023.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1664 — 3135 — 4104 — 4215**886(T)/23 NAMIBIA - Buoyage. Wave recorders.**

Source: South African Notice 8/79(T)/22

1. Special purpose yellow wave rider light-buoys, *Fl(5)Y.20s*, have been established in the following positions:
 28° 31'·7S., 16° 14'·8E.
 28° 38'·9S., 16° 10'·4E.

886(T)/23 NAMIBIA - Buoyage. Wave recorders. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3870 — 4176

910(T)/23 SOUTH ATLANTIC OCEAN - São Tomé e Príncipe - Obstructions.

Source: Portuguese Notice 8/280(T)/22

1. At the entrance to the port of São Tomé, several containers fell in the sea in position 0° 21'·057N., 6° 44'·250E.
2. Four containers are sunk, in the following positions:

0° 21'·129N., 6° 44'·059E.
0° 21'·155N., 6° 44'·074E.
0° 21'·082N., 6° 44'·244E.
0° 21'·070N., 6° 44'·268E.
3. The remaining 13 containers positions are unknown.
4. The vessel that transported the containers is stranded in position 0° 20'·739N., 6° 44'·381E.
5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 1595

1761(T)/23 ANGOLA - Light.

Source: Angola LNG Ltd and Porto Do Soyo NM 1/23

1. Ponta de Padrão Light, Fl.G.4s15m11M, in position 6° 04'·674S., 12° 19'·881E. has been reported as unreliable.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 306 — 658 — 659

2490(P)/23 GUINEA - Wreck.

Source: mv Lion

1. The wreck of a capsized fishing vessel, with an exposed hulk has been reported in position: 9° 29'·06N., 13° 43'·48W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 412

3109(T)/23 MOROCCO - West Coast - Restricted area. Anchorage area.

Source: French Notice 28/08(T)/23

1. Anchoring is prohibited, until further notice, in the waiting anchorage area bounded by the following positions:

33° 42'·84N., 7° 33'·11W.
33° 42'·84N., 7° 29'·90W.
33° 40'·36N., 7° 29'·90W.
33° 38'·79N., 7° 33'·11W.
2. Mariners are advised to consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 856 — 860 — 861

3269(T)/23 SENEGAL - Buoy.

Source: French Notice 2/8(T)/23

1. An ODAS buoy, has been established in position 14° 09'·7N., 17° 30'·7W.
2. Mariners are advised to use a wide berth and navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1663 — 3135 — 4104

3783(P)/23 CONGO - Depths.

Source: French Notices 30/10(P)/22 and 17/10(T)/23

- Depths less than charted exist in the access channel and in the Port de Pointe-Noire. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
14·7m	4° 45'·847S., 11° 49'·369E.
*14·7m	4° 46'·125S., 11° 49'·708E.
15·4m	4° 46'·054S., 11° 49'·718E.
15·0m	4° 46'·149S., 11° 49'·758E.
*15·2m	4° 46'·168S., 11° 49'·864E.
*15·1m	4° 46'·119S., 11° 49'·846E.
*15·1m	4° 46'·206S., 11° 49'·923E.
*15·0m	4° 46'·332S., 11° 49'·908E.
*14·5m	4° 46'·439S., 11° 50'·053E.
*15·0m	4° 46'·460S., 11° 49'·974E.
*14·6m	4° 46'·472S., 11° 49'·959E.
*14·3m	4° 46'·563S., 11° 49'·986E.
*14·5m	4° 46'·550S., 11° 50'·079E.
*14·0m	4° 46'·657S., 11° 49'·991E.
*14·5m	4° 46'·621S., 11° 50'·071E.
*11·1m	4° 46'·711S., 11° 49'·520E.
*14·2m	4° 46'·758S., 11° 49'·589E.
*14·2m	4° 46'·828S., 11° 49'·704E.
2·7m	4° 47'·096S., 11° 49'·543E.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- *Former Notice 4258(P)/22 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Chart affected — 3290**4105(T)/23 ANGOLA - Platform.**

Source: Portuguese Notice 7/205(T)/23

- A lit platform, DWS, has been established in position 8° 44'·517S., 13° 14'·267E.
- All vessels must keep a safe distance and approach with extreme caution.
(WGS84 DATUM)

Chart affected — 303**236(P)/24 EQUATORIAL GUINEA - Depths. Wreck.**

Source: French Chart 7837

- Depths less than charted exist within Puerto de Malabo. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
12·9m	3° 45'·876N., 8° 46'·760E.
7·9m	3° 45'·828N., 8° 46'·967E.
7·9m	3° 45'·781N., 8° 47'·005E.

- A wreck with depth 10·1m exists in position 3° 45'·624N., 8° 46'·134E.
- Mariners are advised to navigate with caution in the area and consult the port authorities for the latest information.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1321

1761(P)/24 SENEGAL - Works.

Source: French Notice 6/13(P)/24

1. Works associated with the construction of the Port at Bargny-Sendou are taking place in an area bounded by the following positions:

14° 39'·6N., 17° 11'·7W.
 14° 42'·63N., 17° 16'·89W.
 14° 37'·19N., 17° 20'·01W.
 14° 32'·59N., 17° 17'·14W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for more information.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 1000 — 1663**2291(T)/24 MOROCCO - West Coast - Works. Submarine power cable.**

Source: French Notice 6/12(T)/24

1. Investigation works have begun in connection with the Xlinks submarine power cable between Port de Tan-Tan (Morocco) and Cornborough Range (North Devon - England).
2. Submarine power cable activities are taking place, joining the following positions:

28° 25'·7N., 11° 23'·5W.
 28° 34'·2N., 11° 28'·1W.
 28° 36'·7N., 11° 27'·8W.
 29° 52'·7N., 10° 01'·3W.
 30° 56'·4N., 9° 58'·3W.
 30° 59'·4N., 10° 06'·8W.
 31° 42'·4N., 10° 06'·3W.
 33° 02'·1N., 9° 11'·6W.
 33° 48'·6N., 8° 18'·8W.
 34° 15'·8N., 6° 52'·3W.
 35° 13'·1N., 6° 33'·2W.
 35° 53'·8N., 6° 29'·4W.

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 87 — 91 — 856 — 862 — 863 — 2717 — 3132 — 3133**3686(T)/24 GHANA - Buoyage. Automatic Identification Systems.**

Source: Ghana Maritime Authority

1. The yellow special purpose light-buoys and associated Automatic Identification Systems, *AIS*, in the following positions are reported to be missing:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl.4s</i>	<i>No 9</i>	4° 50'·0N., 2° 43'·2W.
<i>Fl.4s</i>	<i>No 10</i>	4° 47'·5N., 2° 46'·0W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1383**5576(P)/24 SENEGAL - Works. Channel. Offshore installation. Buoyage.**

Source: French Notices 3/3(T)/21, 25/10(P)/23 and 37/168/24

1. Works associated with the construction of the gas terminal at the Tortue/Ahmeyin fields are taking place.

5576(P)/24 SENEGAL - Works. Channel. Offshore installation. Buoyage. (continued)

2. An access channel, marked by special light-buoys, has been established joining the following positions:

14° 41'·446N., 17° 25'·231W.
 14° 41'·605N., 17° 25'·256W.
 14° 41'·500N., 17° 25'·170W.
 14° 41'·397N., 17° 25'·049W.
 14° 41'·248N., 17° 24'·884W.
 14° 41'·195N., 17° 24'·735W.
 14° 41'·090N., 17° 24'·738W.
 14° 41'·183N., 17° 24'·953W.
 14° 41'·339N., 17° 25'·112W.

3. A floating crane is moored in position 14° 39'·416N., 17° 20'·653W.

4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

5. *Former Notice 4481(P)/24 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 1000 — 1001

5600(T)/24 IVORY COAST - Buoyage.

Source: French Notice 38/12(T)/24

1. The following light-buoys have been moved:

<i>Characteristic</i>	<i>Designation</i>	<i>Former Position</i>	<i>New Position</i>
<i>Oc(2)R.6s</i>	<i>C2</i>	5° 18'·208N., 4° 01'·942W.	5° 18'·160N., 4° 01'·940W.
<i>Q(6)+LFL.15s AIS</i>	<i>A</i>	5° 16'·620N., 4° 01'·929W.	5° 16'·640N., 4° 01'·850W.
<i>Fl.R.6s AIS</i>	<i>No0</i>	5° 16'·150N., 4° 01'·750W.	5° 16'·150N., 4° 01'·790W.
<i>*Fl.R.5s Whis AIS</i>	<i>AN</i>	5° 14'·167N., 3° 58'·950W.	5° 14'·110N., 3° 58'·990W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

3. *Former Notice 4237(T)/23 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 3101 — 3103

5909(T)/24 SENEGAL - Works. Submarine power cable. Buoyage.

Source: French Notice 40/20(T)/24

1. Works are in progress to install a new submarine power cable in the approaches to Dakar.

2. The works are marked by special buoys in the following positions:

<i>Number</i>	<i>Position</i>
1	14° 41'·95N., 17° 24'·83W.
2	14° 41'·48N., 17° 24'·84W.
3	14° 42'·29N., 17° 23'·08W.
4	14° 42'·75N., 17° 23'·11W.
5	14° 41'·49N., 17° 20'·25W.
6	14° 41'·96N., 17° 20'·25W.
7	14° 42'·22N., 17° 18'·60W.

3. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 1000 — 1001

1090(T)/25 SOUTH ATLANTIC OCEAN - São Tomé e Príncipe - Buoy.

Source: Portuguese Notice 11/316(T)/24

1. The east cardinal light-buoy, *VQ(3)5s*, in position 0° 22'·88N., 6° 44'·38E., is unlit.

2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — 1595

1198(T)/25 MOROCCO - West Coast - Scientific instruments.

Source: French Notice 1/6(T)/25

1. Scientific research operations are taking place along the line joining the following positions:

28° 25'·73N., 11° 23'·49W.
 28° 34'·21N., 11° 28'·05W.
 28° 36'·68N., 11° 27'·76W.
 29° 52'·69N., 10° 01'·28W.
 30° 56'·35N., 9° 58'·30W.
 30° 59'·43N., 10° 06'·80W.
 31° 42'·42N., 10° 06'·35W.
 33° 02'·13N., 9° 11'·56W.
 33° 48'·64N., 8° 18'·79W.
 34° 15'·78N., 6° 52'·30W.
 35° 13'·10N., 6° 33'·15W.
 35° 53'·78N., 6° 29'·40W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 87 — 91 — 856 — 862 — 863 — 2717 — 3132 — 3133 — 4103 — 4104 — 4301**1788(P)/25 CAMEROON - Wrecks.**

Source: French Notice 6/5(P)/25

1. Uncharted wrecks exist in the approaches to Kribi 2° 56'·47N., 9° 54'·31E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1322**1820(P)/25 MAURITANIA - Obstructions. Light.**

Source: French Notice 7/167/25

1. Numerous obstructions have been removed from within Port De L'Amitié:

Obstruction Position

2·1m 17° 59'·527N., 16° 01'·853W.
 9·5m 17° 59'·179N., 16° 01'·880W.
 10m 17° 59'·315N., 16° 02'·194W.
 9·1m 17° 59'·070N., 16° 02'·000W.
 12·9m 17° 58'·30N., 16° 06'·00W.
 13·4m 17° 58'·05N., 16° 06'·03W.
 14·3m 17° 58'·28N., 16° 06'·79W.

2. A light, Iso.R.3s, has been established in position: 18° 35'·30N., 16° 06'·70W.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1688**1860(T)/25 MOROCCO - West Coast - Buoy.**

Source: French Notice 9/5(T)/25

1. The port lateral buoy, *FL.R.4s ES2*, in position 31° 30'·25N., 9° 46'·49W., is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 863

1882(T)/25 MOROCCO - West Coast - Marine farms. Buoyage.

Source: French Notice 13/3(T)/25

1. Marine farms, marked by light-buoys, have been established in the following positions:

35° 45'·38N., 5° 58'·00W.
 35° 41'·00N., 6° 00'·50W.
 35° 36'·4N., 6° 03'·2W.
 35° 32'·9N., 6° 05'·1W.
 35° 27'·4N., 6° 06'·9W.
 35° 23'·1N., 6° 09'·8W.
 35° 18'·2N., 6° 11'·7W.
 34° 14'·97N., 6° 45'·50W.

2. It is strictly forbidden to navigate between the marine farms and the coast.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 91 — 142 — 773 — 856**1988(T)/25 ANGOLA - Dredging area. Works.**

Source: Portuguese Notice 2/139(T)/25

1. Dredging works are taking place in the area bounded by the following positions:

8° 47'·03S., 13° 14'·21E.
 8° 47'·11S., 13° 14'·41E.
 8° 47'·80S., 13° 14'·09E.
 8° 47'·70S., 13° 13'·90E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 303**3867(T)/25 EQUATORIAL GUINEA - Buoy.**

Source: French Notice 29/2(T)/25

1. The Safe-Water buoy, in position 1° 50'·31N., 9° 43'·41E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1322 — 1387 — 3327**4088(P)/25 SENEGAL - Buoy.**

Source: French Notice 32/3(P)/25

1. An isolated danger buoy, has been established in position 14° 42'·293N., 17° 22'·063W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1000 — 1001**4192(T)/25 MOROCCO - West Coast - General information.**

Source: French Notice 36/2(P)/25

1. *A 40ft container was lost overboard in the vicinity of position 33° 42'·78N., 7° 38'·63W.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 1699(T)/25 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 856 — 860

4198(T)/25 BENIN - Buoyage.

Source: French Notices 30/01(T)/25, 32/04(T)/25 and SHOM

1. *The following light-buoys have been removed due to maintenance:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.G.4s</i>	<i>No5</i>	Lateral Buoy	6° 20'·520N., 2° 26'·550E.
<i>Fl.R.4s</i>	<i>No6</i>	Lateral Buoy	6° 19'·930N., 2° 26'·980E.
<i>*Fl(5)Y.20s</i>	<i>ODAS</i>	Special Buoy	6° 19'·936N., 2° 26'·581E.

2. *The Safe Water Buoy, *Iso.4s, PAC*, has drifted to position 6° 17'·52N., 2° 28'·39E.
3. *Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. *Former Notice 2825(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1384 — 1385 — 1392

5350(T)/25 MAURITANIA - Buoy.

Source: French Notice 43/2(T)/25

1. Metocean equipment, marked by a yellow special light-buoy, *Fl.Y.10s*, has been deployed in position: 23° 41'·76N., 15° 53'·78W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1690

5444(T)/25 GABON - Buoyage.

Source: French Notice 42/1(P)/25

1. Mariners are advised that there have been numerous changes to the Estuaire du Gabon lateral light-buoys, within the access channel to Port d'Owendo.
2. The following light-buoys have been reported as missing:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl.G</i>	<i>Pénélope</i>	0° 25'·13N., 9° 13'·52E.
<i>Fl.R.4s</i>	<i>Postillon</i>	0° 26'·04N., 9° 16'·90E.
<i>Fl.R.4s</i>	<i>One</i>	0° 25'·13N., 9° 18'·14E.
<i>Fl.R.4s</i>	<i>Caraïbe</i>	0° 24'·13N., 9° 20'·76E.
<i>Fl.G.4s</i>	<i>Papillon</i>	0° 23'·60N., 9° 20'·38E.
<i>Fl.R.4s</i>	<i>Sud Est</i>	0° 21'·74N., 9° 22'·55E.
<i>Fl.R.4s</i>	<i>Intermédiaire</i>	0° 20'·14N., 9° 24'·46E.

3. The following light-buoys have been reported as extinguished:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl.R.4s</i>	<i>Thémis</i>	0° 25'·72N., 9° 13'·52E.
<i>Fl.10s</i>	<i>Pilote</i>	0° 17'·00N., 9° 26'·04E.

4. The following light-buoys have been established and have been reported as extinguished:

<i>Buoy Type</i>	<i>Position</i>
<i>Starboard Lateral</i>	0° 25'·18N., 9° 16'·95E.
<i>Port Lateral</i>	0° 23'·80N., 9° 20'·88E.

5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3325

5595(T)/25 CAMEROON - Buoy.

Source: French Notice 45/3(T)/25

1. The Safe-Water light-buoy, *LFl.10s*, in position 2° 56'·78N., 9° 53'·35E. is reported missing.

5595(T)/25 CAMEROON - Buoy. (continued)

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 1322**5833(T)/25 MOROCCO - West Coast - Works. Breakwater. Buoyage. Light.**

Source: French Notice 35/6(T)/25

- Breakwater extension works are taking place on the Moulay Youssef jetty.
- The works area is marked by light-buoys in the following positions:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Q(2)W.5s3M</i>	<i>B01</i>	Yellow special buoy	33° 37'·312N., 7° 35'·532W.
<i>Q(2)W.5s3M</i>	<i>B02</i>	Yellow special buoy	33° 37'·410N., 7° 35'·308W.
<i>Q(2)W.5s3M</i>	<i>B03</i>	Yellow special buoy	33° 37'·262N., 7° 35'·202W.
<i>Q(2)W.5s3M</i>	<i>B04</i>	Yellow special buoy	33° 37'·176N., 7° 35'·435W.
<i>Fl(3)G.10s7M</i>	<i>B05</i>	Starboard lateral buoy	33° 37'·388N., 7° 35'·132W.

- Light, Fl(3)G.10s10m7M, in position 33° 37'·230N., 7° 35'·500W. has been temporarily extinguished.
- Mariners are requested to take a wide berth and maintain a constant watch on VHF channels 16 and 14 near the area. (WGS84 DATUM)

Charts affected — 860 — 861

(10) AFRICA, SOUTH AND EAST COASTS, AND MADAGASCAR

209(T)/18 SOUTH AFRICA - South Coast - Buoy.

Source: South African Notice 11/72(T)/17

1. The mooring buoy in approximate position 34° 57'·5S., 22° 11'·2E. has been temporarily removed.
(CAPE DATUM)

Charts affected — 4153 — 4155**576(T)/18 SOUTH AFRICA - South Coast - Wreck.**

Source: South African Notice 12/73(T)/17

1. A wreck, depth 1.3m, is reported to exist in position 33° 00'·936S., 17° 57'·094E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1236 — 4142**2060(T)/18 SOUTH AFRICA - East Coast - Buoy.**

Source: South African Notice 3/38(T)/18

1. A red lateral spar light-buoy, *Q.R.*, has been established in position 29° 52'·07S., 31° 03'·59E. This buoy marks a reported shoal.
(WGS84 DATUM)

Charts affected — 643 — 4170**4924(P)/18 TANZANIA - Depths. Lights. Buoyage. Beacons. Leading line. Submarine pipelines. Jetty. Rocks.**

Source: Indian Chart 2693 and UKHO

1. Numerous changes to charted detail within Tanga Port and its approaches have been reported. The most significant are as follows:
2. Depths less than charted have been reported in the following positions:

<i>Depth</i>	<i>Position</i>
16·0m	5° 01'·393S., 39° 10'·501E.
0·2m	5° 01'·986S., 39° 08'·715E.
15·8m	5° 02'·104S., 39° 10'·374E.
4·6m	5° 02'·216S., 39° 09'·258E.
7·7m	5° 02'·871S., 39° 08'·746E.
11·1m	5° 02'·873S., 39° 09'·722E.
7·2m	5° 03'·088S., 39° 08'·703E.
6·5m	5° 03'·205S., 39° 09'·665E.
3·5m	5° 03'·539S., 39° 09'·490E.
21m	5° 03'·628S., 39° 10'·618E.
4·9m	5° 03'·633S., 39° 08'·340E.
5·0m	5° 03'·748S., 39° 09'·400E.
8·5m	5° 04'·038S., 39° 09'·643E.
13·1m	5° 04'·121S., 39° 10'·238E.
15·6m	5° 04'·178S., 39° 10'·514E.

3. Numerous navigational aids are reported to be in different positions to those charted, the most notable being:

<i>Feature</i>	<i>Character</i>	<i>Former Position</i>	<i>New Position</i>
Front leading light	Fl.2s11m7M	5° 03'·260S., 39° 06'·636E.	5° 03'·268S., 39° 06'·634E.
Rear leading light	Fl.7s8M	5° 03'·281S., 39° 06'·607E.	5° 03'·283S., 39° 06'·613E.
Front leading mark	White beacon	5° 03'·710S., 39° 06'·786E.	5° 03'·728S., 39° 06'·789E.
Rear leading mark	White beacon	5° 03'·740S., 39° 06'·775E.	5° 03'·761S., 39° 06'·774E.
Front leading light	Q	5° 03'·847S., 39° 05'·988E.	5° 03'·875S., 39° 05'·987E.
Rear leading light	Fl.5s	5° 03'·949S., 39° 05'·747E.	5° 03'·973S., 39° 05'·768E.
Isolated danger buoy	<i>Fl(2)10s</i>	5° 03'·666S., 39° 09'·550E.	5° 03'·633S., 39° 09'·474E.
*Lit Beacon	<i>Fl.G.6s7m</i>	5° 02'·444S., 39° 09'·820E.	5° 02'·439S., 39° 09'·856E.
*Buoy	<i>Q.G</i>	5° 03'·250S., 39° 06'·939E.	5° 03'·225S., 39° 06'·876E.
*Light	<i>F.R</i>	5° 03'·921S., 39° 06'·345E.	5° 03'·932S., 39° 06'·359E.

4924(P)/18 TANZANIA - Depths. Lights. Buoyage. Beacons. Leading line. Submarine pipelines. Jetty. Rocks.
(continued)

4. The lights in position 5° 03'·871S., 39° 06'·453E. and 5° 03'·991S., 39° 06'·357E. and associated leading line are reported to have been removed.
5. Two submarine pipelines are reported to have been laid joining the following positions:
 5° 03'·903S., 39° 05'·659E.
 5° 03'·875S., 39° 05'·702E.
 5° 03'·466S., 39° 06'·721E.
 and
 5° 03'·375S., 39° 07'·764E.
 5° 03'·184S., 39° 07'·820E.
6. Mooring buoys are reported to have been established in the following positions:
 5° 03'·478S., 39° 06'·646E.
 5° 03'·513S., 39° 06'·673E.
 5° 03'·436S., 39° 06'·688E.
 5° 03'·410S., 39° 06'·736E.
 5° 03'·057S., 39° 07'·798E.
 5° 03'·213S., 39° 07'·935E.
7. The jetty in the vicinity of position 5° 03'·280S., 39° 07'·869E. is reported destroyed.
8. *The lateral buoy, *Fl(2)R.10s PA*, in position 5° 03'·027S., 39° 07'·174E. has reportedly been replaced by a mooring buoy.
9. *Numerous dangerous underwater rocks have been reported to exist in the approaches to Tanga, the most significant of which are in the following positions:
 4° 55'·71S., 39° 15'·94E.
 4° 55'·91S., 39° 15'·57E.
 4° 56'·06S., 39° 15'·27E.
 4° 56'·31S., 39° 14'·76E.
 4° 56'·51S., 39° 14'·81E.
 4° 56'·71S., 39° 14'·79E.
 4° 57'·13S., 39° 14'·24E.
 4° 57'·36S., 39° 14'·27E.
 4° 57'·67S., 39° 12'·62E.
 4° 58'·00S., 39° 12'·77E.
 4° 58'·11S., 39° 12'·73E.
 4° 58'·79S., 39° 12'·67E.
 5° 02'·46S., 39° 09'·65E.
10. Mariners are advised to navigate with caution in this area and consult the local port authorities for the latest information.
11. Charts will be updated when full details are available.
12. * Indicates new or revised entry.
13. Former Notice 1433(P)/18 is cancelled.
(WGS84 DATUM)

Charts affected — 663 — 3310 — 3361**210(T)/19 SOUTH AFRICA - East Coast - Depths.**

Source: UKHO

1. Depths shoaler than charted exist within Durban Harbour in the following positions:

<i>Berth</i>	<i>Depth</i>	<i>Position</i>
M	12·2m	29° 52'·207S., 31° 02'·106E.
N	12·2m	29° 52'·267S., 31° 01'·989E.

2. Mariners are advised to navigate with caution in the area.
3. Former Notice 3504(T)/17 is cancelled.
(WGS84 DATUM)

Chart affected — 643

403(T)/19 SOUTH AFRICA - West Coast - Depth.

Source: UKHO

1. Shoal depths of up to 5·6m have been reported in the maintained depth area at Moss gas Quay, in the vicinity of position 33° 00'·0S., 17° 59'·2E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4142**2589(T)/19 SOUTH AFRICA - West Coast - Depths. Dredged depths.**

Source: South African Notice 3/36(T)/19 and UKHO

1. Numerous changes to depths exist within Duncan Dock and Ben Schoeman Dock in the following approximate positions:

<i>Berth</i>	<i>Depth</i>	<i>Position</i>
J	9·9m	33° 54'·992S., 18° 26'·108E.
L	6·6m	33° 55'·170S., 18° 26'·347E.
Repair Pier 4	8·4m	33° 55'·069S., 18° 26'·479E.
Landing Wharf 3	12·8m	33° 54'·887S., 18° 26'·501E.
Tanker Basin 1	13·7m	33° 54'·803S., 18° 26'·535E.
Tanker Basin 2	13·3m	33° 54'·892S., 18° 26'·660E.
Eastern Mole 1	12·2m	33° 54'·608S., 18° 26'·168E.
Eastern Mole 2	12·7m	33° 54'·703S., 18° 26'·299E.
500	9m	33° 55'·046S., 18° 27'·055E.
501	8·7m	33° 55'·038S., 18° 27'·159E.
502	8·9m	33° 54'·963S., 18° 27'·249E.
600	8·8m	33° 54'·900S., 18° 27'·244E.
700	9·2m	33° 54'·364S., 18° 26'·706E.
701	9·2m	33° 54'·321S., 18° 26'·652E.
702	9·8m	33° 54'·291S., 18° 26'·497E.

2. Dredged depths within Duncan Dock, Ben Schoeman Dock and Victoria Basin have changed as follows:

<i>Previous Depth</i>	<i>Amended depth</i>	<i>Approximate position</i>
12·7m	13·7m	33° 54'·902S., 18° 26'·462E.
9·8m	10·6m	33° 54'·981S., 18° 26'·633E.
4·8m	5·4m	33° 55'·077S., 18° 27'·040E.
10·4m	10·1m	33° 54'·233S., 18° 25'·417E.

3. Mariners are advised to navigate with caution in the area.
4. Former Notice 3500(T)/17 is cancelled.
(WGS84 DATUM)

Chart affected — 1846**2590(T)/19 SOUTH AFRICA - South Coast - Depth.**

Source: South African Notice 3/37(T)/19 and UKHO

1. A depth of 10·5m exists in approximate position 33° 57'·59S., 25° 37'·82E.
2. Former Notice 3510(T)/17 is cancelled.
(WGS84 DATUM)

Chart affected — 4158**2591(T)/19 SOUTH AFRICA - South Coast - Depths.**

Source: South African Notice 3/38(T)/19 and UKHO

1. Depths less than charted exist within Charl Malan Basin and Buffalo River, in the following approximate positions:

<i>Depth</i>	<i>Location</i>	<i>Position</i>
7·8m	Repair Quay	33° 01'·343S., 27° 53'·903E.
9·6m	Berth C	33° 01'·394S., 27° 54'·061E.
10·5m	Berth K	33° 01'·553S., 27° 54'·669E.
10·5m	Berth L	33° 01'·620S., 27° 54'·823E.
10·5m	Berth R	33° 01'·484S., 27° 54'·175E.

2. Mariners are advised to navigate with caution in the area.

2591(T)/19 SOUTH AFRICA - South Coast - Depths. (continued)

3. Former Notice 3487(T)/17 is cancelled.
(WGS84 DATUM)

Chart affected — 4162

2592(T)/19 SOUTH AFRICA - East Coast - Depths.

Source: South African Notice 3/40(T)/19 and UKHO

1. A depth of 14m exists at the following approximate positions:

<i>Berth</i>	<i>Position</i>
208	28° 48'·363S., 32° 03'·540E.
209	28° 48'·433S., 32° 03'·382E.

2. Former Notice 3502(T)/17 is cancelled.
(WGS84 DATUM)

Chart affected — 4174

6161(P)/19 TANZANIA - Buoyage. Light-beacons. Works.

Source: Tanzania Ports Authority

1. The following light-buoys have been established or amended in the approaches to Tanga:

<i>Designation</i>	<i>Position</i>	<i>Comments</i>
No 1	5° 03'·75S., 39° 13'·30E.	New position
No 2	5° 03'·94S., 39° 12'·40E.	New position
No 3	5° 02'·27S., 39° 12'·60E.	New buoy
No 4	5° 03'·54S., 39° 11'·99E.	Replaces Niule light-beacon
No 5	5° 02'·443S., 39° 09'·879E.	Replaces Ulenge Reef light-beacon
No 6	5° 03'·481S., 39° 09'·458E.	Replaces Dixon Bank buoy
No 7	5° 02'·27S., 39° 08'·86E.	New buoy
No 8	5° 02'·874S., 39° 08'·696E.	Replaces No 2 buoy
No 9	5° 02'·482S., 39° 07'·817E.	Replaces Kwawa light-beacon
No 10	5° 03'·019S., 39° 07'·139E.	Replaces Raskazone North red buoy
No 11	5° 03'·221S., 39° 06'·857E.	Replaces Tanga East buoy

2. Dredging works are taking place within Tanga port, within an area bounded by the following positions:

5° 03'·585S., 39° 05'·936E.
 5° 03'·504S., 39° 06'·221E.
 5° 03'·521S., 39° 06'·490E.
 5° 03'·221S., 39° 06'·857E.
 5° 02'·899S., 39° 07'·010E.
 5° 03'·011S., 39° 07'·256E.
 5° 03'·581S., 39° 06'·930E.
 5° 03'·917S., 39° 06'·153E.

3. Mariners are advised to navigate with caution in the area.
 4. Chart 663 will be updated when full details are available.
 (WGS84 DATUM)

Chart affected — 663

6566(T)/19 SOUTH AFRICA - West Coast - Rocks. Depths.

Source: South African Notice 10/62(T)/19

1. Underwater rocks, depth unknown, have been reported to exist in the following approximate positions:

33° 00'·02S., 17° 57'·51E.
 33° 01'·02S., 17° 56'·90E.
 33° 01'·52S., 17° 57'·50E.
 33° 01'·57S., 17° 57'·92E.
 33° 01'·59S., 17° 57'·93E.

2. A rock, depth 1·7m, has been reported to exist in approximate position 33° 01'·57S., 17° 57'·54E.
 3. Depths of 2m and less are reported to exist in the vicinity of approximate position 33° 01'·62S., 17° 57'·58E.

6566(T)/19 SOUTH AFRICA - West Coast - Rocks. Depths. (continued)

4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1236 — 4142

3553(T)/20 SOUTH AFRICA - West Coast - Obstructions. Buoyage.

Source: South African Notice 4/51(T)/20

1. Octopus lines with unlit buoys are laid in the following areas:

32° 55′·87S., 17° 50′·04E.
33° 10′·25S., 17° 50′·04E.
33° 10′·25S., 18° 00′·50E.
32° 55′·87S., 18° 00′·50E.
and
*34° 18′·99S., 18° 24′·94E.
34° 20′·65S., 18° 24′·80E.
34° 23′·10S., 18° 26′·70E.
34° 23′·10S., 18° 28′·65E.
34° 21′·50S., 18° 28′·65E.
and
34° 21′·40S., 18° 29′·85E.
34° 20′·95S., 18° 30′·65E.
34° 20′·05S., 18° 29′·70E.
34° 20′·05S., 18° 28′·95E.
34° 19′·00S., 18° 28′·50E.
34° 17′·75S., 18° 28′·50E.
34° 17′·75S., 18° 27′·95E.

2.

and
34° 16′·55S., 18° 28′·50E.
34° 15′·65S., 18° 28′·95E.
34° 15′·50S., 18° 28′·45E.
and
34° 14′·08S., 18° 28′·51E.
34° 14′·05S., 18° 29′·05E.
34° 13′·15S., 18° 28′·90E.
34° 12′·52S., 18° 28′·40E.
34° 12′·52S., 18° 27′·70E.
and

3553(T)/20 SOUTH AFRICA - West Coast - Obstructions. Buoyage. (continued)

3.

34° 11'·20S., 18° 27'·80E.

34° 11'·20S., 18° 28'·10E.

34° 10'·50S., 18° 28'·10E.

34° 10'·50S., 18° 27'·80E.

and

34° 10'·50S., 18° 25'·70E.

34° 10'·50S., 18° 26'·10E.

34° 08'·00S., 18° 28'·10E.

34° 07'·70S., 18° 27'·10E.

and

34° 06'·40S., 18° 28'·55E.

34° 08'·30S., 18° 31'·20E.

34° 06'·60S., 18° 39'·20E.

34° 04'·40S., 18° 39'·95E.

and

34° 04'·40S., 18° 40'·00E.

34° 08'·00S., 18° 40'·00E.

34° 13'·60S., 18° 45'·60E.

34° 13'·60S., 18° 47'·60E.

34° 24'·60S., 18° 47'·60E.

34° 24'·60S., 18° 51'·80E.

34° 21'·80S., 19° 00'·00E.

34° 20'·60S., 19° 00'·00E.

and

4.

33° 59'·3S., 22° 07'·0E.

33° 59'·3S., 23° 34'·4E.

34° 08'·6S., 23° 34'·4E.

34° 08'·6S., 22° 07'·0E.

5. Octopus lines with unlit buoys are laid within two areas, radius 0·5M, centred on the following positions:

34° 08'·25S., 18° 34'·95E.

34° 08'·85S., 18° 38'·80E.

6. Mariners are advised to navigate with caution in these areas.

7. Former Notice 3228(T)/19 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 1236 — 1922 — 4142 — 4145 — 4146 — 4150 — 4151 — 4152 — 4153 — 4154 — 4155**276(T)/21 SOUTH AFRICA - South Coast - Buoy. Radar beacon.**

Source: South African Notice 11/78(T)/20

1. The East Cardinal light-buoy, *Q(3)10s* and associated *Racon* in position 34° 14'·72S., 18° 34'·24E. is reported off station.

2. Mariners are advised to navigate with caution in the area.

(CAPE DATUM)

Chart affected — 4150**1841(T)/22 SOUTH AFRICA - West Coast - Current meter.**

Source: South African Notice 1/30(T)/22

1. A submerged current meter has been established in the following position:

<i>Depth</i>	<i>Approximate position</i>
100m	30° 38'·2S., 17° 00'·9E.

2. Vessels engaged in trawling are advised to keep a safe distance.

3. Former Notice 1875(T)/19 is cancelled.

(WGS84 DATUM)

Charts affected — 2078 — 4177

2866(T)/23 SOUTH AFRICA - West Coast - Buoy. Obstruction.

Source: South African Notice 3/54(T)/23

1. A yellow ODAS light-buoy, *Fl(5)Y.20s*, has been established in approximate position 29° 38'·5S., 13° 52'·8E.
2. An ODAS scientific instrument exists, depth 80m below the surface, in approximate position 29° 37'·3S., 13° 55'·8E.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4177**3520(P)/23 MADAGASCAR - East Coast - Breakwater. Works. Dry docks. Dredging area.**

Source: French Notice 5/21(P)/23

1. Breakwater extension works are taking place in the Port of Toamasina in the vicinity of position 18° 09'·016S., 49° 25'·817E.
2. A container dock C4 is being constructed as part of the extension of dock C3 in the vicinity of position 18° 09'·073S., 49° 25'·677E.
3. Extensive dredging has taken place within the work area.
4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 695 — 696**120(T)/24 SOUTH AFRICA - West Coast - Landmark.**

Source: South African Notice 3/57(T)/23

1. The lit radio mast on Else Peak, in position 34° 09'·000S., 18° 26'·120E., has collapsed.
(WGS84 DATUM)

Charts affected — 1922 — 4150**3861(T)/24 KENYA - Works. Bridge.**

Source: Kenya Ports Authority

1. Demolition works are taking place at Likoni Floating Bridge (4° 04'·361S., 39° 39'·400E.).
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 666**5925(P)/24 SOMALIA - Quay. Anchorage area. Restricted area. Buoy. Pilot boarding place. Mooring. Light. Works.**

Source: Bosaso Port Authority

1. Port developments are taking place in and around the port of Boosaaso (11° 17'·40N., 49° 10'·62E.)
2. Quay extension works have been completed in the vicinity of position 11° 17'·49N., 49° 10'·70E.
3. A new anchorage area has been established, bounded by the following positions:
11° 22'·59N., 49° 08'·48E.
11° 18'·40N., 49° 11'·34E.
11° 16'·86N., 49° 03'·58E.
11° 21'·32N., 49° 02'·17E.
4. The restricted area, anchoring and fishing prohibited, has been amended and now joins the following positions:
11° 17'·96N., 49° 13'·49E.
11° 24'·22N., 49° 14'·31E.
11° 22'·78N., 49° 08'·60E.
11° 17'·67N., 49° 12'·30E.
5. The safe water buoy in position 11° 18'·21N., 49° 09'·87E. has been removed.
6. A pilot boarding place has been established in position 11° 18'·18N., 49° 09'·80E.
7. A floating single point mooring has been established in position 11° 18'·50N., 49° 13'·24E.
8. Light, Fl.3s8M, in position 11° 17'·51N., 49° 10'·65E. has been extinguished.
9. Chart 6 will be updated by Notice to Mariners.

5925(P)/24 SOMALIA - Quay. Anchorage area. Restricted area. Buoy. Pilot boarding place. Mooring. Light. Works. (continued)

10. Chart 2970 will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 2970

2693(T)/25 SOUTH AFRICA - South Coast - Buoy.

Source: South African Notice 3/47(T)/25

1. A yellow spherical buoy has been established in position 34° 11'·25S., 18° 25'·80E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1922

2695(T)/25 SOUTH AFRICA - South Coast - Buoyage.

Source: South African Notice 3/46(T)/25

1. North cardinal buoys, have been removed from the following positions:

34° 10'·50S., 18° 27'·60E.
34° 10'·60S., 18° 27'·23E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1922 — 4150

2698(T)/25 SOUTH AFRICA - West Coast - Buoyage.

Source: South African Notice 3/43(T)/25

1. Yellow special purpose light-buoys, *Fl(5)Y.20s*, have been established in the following positions:

33° 02'·90S., 18° 01'·00E.
33° 02'·98S., 18° 00'·40E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1236 — 4142

3101(T)/25 MOZAMBIQUE - Buoy.

Source: Port of Maputo

1. The red can light-buoy, *Fl.R.4s*, in position 25° 46'·2S., 32° 49'·7E. is reported off station.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 644

(11) RED SEA, ARABIA, IRAQ AND IRAN

3234(T)/13 IRAQ - Wreck.

Source: Umm Qasr Port Authority

1. A wreck has been reported in Khawr 'Abd Allāh within the vicinity of *No 22* light-buoy ($29^{\circ} 59' \cdot 89N.$, $48^{\circ} 12' \cdot 71E.$) and *No 23* light-buoy ($30^{\circ} 00' \cdot 12N.$, $48^{\circ} 12' \cdot 72E.$)
(All positions are referred to WGS84 Datum).
2. Mariners are advised to navigate with caution in the area and consult the port authority for the latest information.

Chart affected — 1229**5236(T)/14 QATAR - Buoyage.**

Source: Civil Aviation Authority, Qatar

1. Yellow light buoys have been temporarily established in the following positions:

<i>Designation</i>	<i>Position</i>
<i>North</i>	$26^{\circ} 55' \cdot 80N.$, $51^{\circ} 12' \cdot 60E.$
<i>Halul</i>	$26^{\circ} 04' \cdot 80N.$, $52^{\circ} 25' \cdot 20E.$
<i>Jazarat</i>	$24^{\circ} 59' \cdot 10N.$, $52^{\circ} 13' \cdot 50E.$

(WGS84 Datum)

Charts affected — 2523 — 2883 — 2886 — 2887 — 3950**1182(T)/16 EGYPT - Red Sea Coast - Platform. Light.**

Source: Egyptian Notice 40/16

1. The platform M-5, in position $28^{\circ} 13' \cdot 44N.$, $33^{\circ} 25' \cdot 31E.$, is reported to be unlit until further notice.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 333 — 2374**4281(P)/16 SAUDI ARABIA - Red Sea Coast - Harbour developments. Depths.**

Source: UKHO

1. Extensive harbour developments are taking place at King Abdullah Port. Mariners are advised to consult the local authorities for the latest information.
2. Depths less than charted exist in the approaches to King Abdullah Port. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
17.9m	$22^{\circ} 34' \cdot 73N.$, $38^{\circ} 58' \cdot 34E.$
11.5m	$22^{\circ} 34' \cdot 31N.$, $38^{\circ} 58' \cdot 06E.$
22.5m	$22^{\circ} 30' \cdot 56N.$, $38^{\circ} 53' \cdot 15E.$
20.0m	$22^{\circ} 21' \cdot 20N.$, $38^{\circ} 59' \cdot 21E.$
20.0m	$22^{\circ} 21' \cdot 04N.$, $39^{\circ} 00' \cdot 22E.$
62.0m	$22^{\circ} 19' \cdot 01N.$, $38^{\circ} 53' \cdot 20E.$
31.0m	$22^{\circ} 16' \cdot 34N.$, $38^{\circ} 55' \cdot 57E.$
32.0m	$22^{\circ} 11' \cdot 95N.$, $38^{\circ} 54' \cdot 17E.$
27.0m	$22^{\circ} 11' \cdot 08N.$, $38^{\circ} 53' \cdot 95E.$
21.5m	$22^{\circ} 05' \cdot 27N.$, $38^{\circ} 54' \cdot 08E.$
20.4m	$22^{\circ} 00' \cdot 18N.$, $38^{\circ} 45' \cdot 41E.$
26.5m	$21^{\circ} 59' \cdot 04N.$, $38^{\circ} 53' \cdot 05E.$
16.5m	$21^{\circ} 58' \cdot 69N.$, $38^{\circ} 48' \cdot 11E.$
7.5m	$21^{\circ} 53' \cdot 88N.$, $38^{\circ} 52' \cdot 26E.$
14.6m	$21^{\circ} 46' \cdot 71N.$, $39^{\circ} 00' \cdot 90E.$
37.0m	$21^{\circ} 41' \cdot 22N.$, $38^{\circ} 45' \cdot 27E.$

3. Mariners are advised to navigate with caution in the area.
4. Charts will be updated when full details are available.
(WGS84 Datum)

Chart affected — 63

5105(P)/16 SAUDI ARABIA - Red Sea Coast - Depths. Wrecks. Submarine pipeline. Rocks. Coral.

Source: UKHO

1. Numerous depths less than charted exist in the approaches to Jizān, the most significant are as follows:

<i>Depth</i>	<i>Position</i>
7·3m	17° 08'·33N., 41° 24'·37E.
8·8m	17° 06'·59N., 41° 30'·39E.
7·0m	17° 04'·87N., 41° 31'·63E.
11·8m	17° 06'·71N., 41° 31'·71E.
9·1m	17° 03'·21N., 41° 32'·94E.
6·6m	17° 10'·77N., 41° 35'·61E.
7·5m	17° 09'·83N., 41° 37'·21E.
9·6m	17° 10'·72N., 41° 58'·95E.
4·7m	17° 10'·96N., 41° 59'·33E.
11·3m	17° 00'·55N., 42° 21'·42E.
17·0m	16° 52'·19N., 42° 23'·96E.
9·2m	16° 51'·05N., 42° 24'·87E.
16·2m	16° 50'·37N., 42° 27'·84E.
14·6m	16° 49'·74N., 42° 30'·13E.
10·1m	16° 50'·75N., 42° 31'·73E.

2. Wrecks exist in the following positions:

<i>Description</i>	<i>Position</i>
Known depth 12·7m	16° 43'·63N., 42° 31'·94E.
Known depth 19·1m	16° 43'·12N., 42° 32'·30E.

3. Numerous uncharted dangers exist in the vicinity of the Farasan Islands.
 4. A submarine pipeline has been laid joining the following positions:

16° 52'·33N., 42° 33'·51E. (shore)
 16° 49'·95N., 42° 29'·60E.(SPM)

5. *Patches of rock and coral exist in the following positions:

<i>Feature</i>	<i>Depth</i>	<i>Position</i>
Rock	2·8m	17° 15'·63N., 42° 18'·43E.
Rock	1·8m	17° 15'·51N., 42° 17'·66E.
Coral	Unknown	17° 15'·31N., 42° 18'·43E.
Coral	Unknown	17° 15'·59N., 42° 18'·02E.

6. Mariners are advised to navigate with extreme caution in the area and consult the local authorities for the latest information.
 7. Former Notice 4295(P)/16 is cancelled.
 *Indicates a new or revised entry.
 8. Charts will be updated when full details are available.
 (WGS84 Datum)

Chart affected — 16

2363(P)/17 RED SEA - Routeing measures.

Source: Royal Saudi Naval Forces (Western Fleet HQ)

1. Advice to vessels proceeding to Yemeni Red Sea Ports.

Under the terms of UNSCR (United Nations Security Council Resolution) 2216 a coalition of maritime forces is operating in the Red Sea to prevent the transport of weapons and associated material to Yemeni Ports. To enforce this UNSCR the coalition has announced that the following routeing should be followed by vessels proceeding to Yemeni ports.

Entering the Red Sea from the north (via the Suez Canal):

All vessels entering the Red Sea from the north and heading to Yemeni Red Sea ports should follow the route described below to the waiting area:

A	27° 29'·00N., 34° 07'·00E.
B	21° 00'·00N., 38° 50'·00E.
C	19° 25'·00N., 39° 22'·00E.
D	17° 00'·00N., 41° 00'·00E.
E	16° 50'·00N., 41° 07'·00E.
F	14° 51'·00N., 42° 04'·00E.
G	14° 49'·00N., 42° 11'·00E.

2. Entering the Red Sea from the south (via the Bab el Mandeb):

All vessels entering the Red Sea from the south and heading to Yemeni Red Sea ports should follow the route described below to the waiting area:

A	13° 14'·00N., 43° 04'·00E.
B	13° 33'·50N., 42° 40'·00E.
C	14° 24'·00N., 42° 12'·50E.
D	14° 37'·00N., 42° 16'·00E.

3. Waiting Area:

When the vessel arrives in the waiting area, it should use VHF CH16 to ask the coalition ships for permission to enter the Yemeni ports.

A	14° 51'·00N., 42° 10'·00E.
B	14° 37'·00N., 42° 12'·00E.
C	14° 37'·00N., 42° 22'·00E.
D	14° 51'·00N., 42° 20'·00E.

4. Failure to comply may result in the vessel being considered suspicious and subsequently come under the surveillance of coalition forces and possible further action in accordance with the terms of UNSCR 2216. This situation is subject to change.

Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Charts affected — 6 — 12 — 15 — 143 — 157 — 158 — 159 — 164 — 452 — 453 — 1925 — 2375 — 2658 — 2659 — 2964

2822(T)/17 QATAR - Buoy.

Source: MENAS Notice 11/17

1. An isolated danger buoy has been temporarily established in position 26° 14'·26N., 51° 07'·93E. (WGS84 DATUM)

Charts affected — 2523 — 3790

3559(P)/17 UNITED ARAB EMIRATES - Submarine pipeline. Obstruction.

Source: ADNOC Petroleum Ports Authority

1. Submarine pipeline laying is taking place between Jazīrat Dās (25° 08'·73N., 52° 52'·42E.) and Ra's al Qilā (24° 09'·09N., 52° 58'·73E.). An obstruction, which consists of a 'tie in', exists 3m above the seabed in position 24° 49'·89N., 52° 53'·60E.

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Charts affected — 2837 — 3178 — 3179

5518(P)/17 IRAQ - Jetty. Dolphins. Mooring buoys. Floating dock. Dredged area.

Source: General Company for Ports of Iraq

1. A new, unsurveyed, dredged area exists alongside a jetty that has been established, joining:
30° 03'·76N., 47° 56'·01E.
30° 03'·67N., 47° 56'·09E.
2. Dolphins have been established, within the new dredged area, in the following positions:
30° 03'·79N., 47° 55'·99E.
30° 03'·65N., 47° 56'·11E.
3. Mooring buoys have been removed in the following positions:
30° 03'·79N., 47° 55'·81E.
30° 03'·74N., 47° 55'·84E.
4. The floating dock has been removed, centred on position 30° 03'·85N., 47° 55'·85E.
5. Works are ongoing and further changes should be expected within the basin.
6. Mariners are advised to navigate with caution in the area.
7. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1228**994(P)/19 IRAQ - Works. Buoyage. Channel.**

Source: Captain Sameer

1. Works are in progress to construct Al Faw Grand Port.
2. A new dredged channel is being established between positions 29° 50'·33N., 48° 29'·90E. and
29° 46'·33N., 48° 33'·19E.
3. Navigational aids will be installed as works progress.
4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1229 — 1235 — 2847 — 2884**1646(P)/19 BAHRAIN - Works.**

Source: MENAS Nav Warning 17/19

1. Dredging and reclamation works are in progress at the Bahrain Investment Gateway in the vicinity of position
26° 15'·500N., 50° 41'·000E.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 3737 — 3759**1937(T)/19 EGYPT - Red Sea Coast - Buoy.**

Source: m.v Hartland Point

1. The isolated danger light-buoy, *Fl(2)10s*, in position 28° 11'·29N., 33° 21'·40E., is reported missing.
(WGS84 DATUM)

Charts affected — 333 — 2374**2208(T)/19 QATAR - Buoy.**

Source: Iino Marine Service and MENAS Notice 65/19

1. The special light-buoy, *Mo(U)Y14s*, in position 25° 57'·63N., 51° 52'·86E. is reported missing.
2. Former Notice 1279(T)/15 is cancelled.
(WGS84 DATUM)

Charts affected — 2523 — 2837 — 2847 — 2886 — 3772 — 3950

3202(P)/19 SAUDI ARABIA - East Coast - Depths.

Source: Saudi Ports Authority

- Depths less than charted exist within the Port of Ad Dammām. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
12·7m	26° 30'·62N., 50° 12'·60E.
13·0m	26° 30'·49N., 50° 12'·34E.
12·0m	26° 30'·26N., 50° 12'·29E.
13·6m	26° 30'·07N., 50° 11'·64E.
13·0m	26° 30'·03N., 50° 11'·72E.
11·3m	26° 29'·98N., 50° 11'·47E.
11·0m	26° 29'·78N., 50° 11'·44E.

- Mariners are advised to navigate with caution and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3812**6699(P)/19 SAUDI ARABIA - East Coast - Works. Buoyage. Dredged area.**

Source: Saudi Ports Authority

- Dredging works have taken place at Commercial Port to extend the area of deeper water to the north west. The area has been dredged to 14m and is bounded by the following positions:

27° 02'·04N., 49° 41'·91E.
 27° 02'·01N., 49° 41'·84E.
 27° 02'·08N., 49° 41'·60E.
 27° 02'·24N., 49° 41'·42E.
 27° 01'·53N., 49° 40'·60E.
 27° 01'·63N., 49° 40'·50E.
 27° 02'·36N., 49° 41'·32E.
 27° 02'·28N., 49° 41'·41E.
 27° 02'·16N., 49° 41'·64E.

- Buoys have been moved to mark the extended dredged area.
- Mariners are advised to navigate with caution in the area and consult the local port authority for the latest information.
- Chart 3718 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 3718**3127(P)/20 SAUDI ARABIA - Red Sea Coast - General information.**

Source: UKHO

- Changes to aids to navigation at Jizan (16° 53'·43N., 42° 33'·20E.) have been reported.
- Significant changes to aids to navigation for the southern approach, Pearly Gates (16° 19'·80N., 41° 52'·55E.), have also been reported. Mariners are strongly advised to use the North Approach Route.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Charts 15 and 16 will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 15 — 16**5242(T)/20 KUWAIT - Light-beacon. Lights.**

Source: MENAS Notice 9/20

- The following light-beacon has been reported missing:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
FL.R.3s5M	M2	29° 23'·00N., 47° 53'·86E.

- The lights in the vicinity of Az Zawr, centred on position, 29° 26'·77N. , 48° 16'·30E., are reported missing.
- Mariners are advised to navigate with caution in the area.

5242(T)/20 KUWAIT - Light-beacon. Lights. (continued)

4. Former Notice 6639(T)/19 is cancelled.
(WGS84 DATUM)

Charts affected — 1214 — 3773

6028(P)/20 UNITED ARAB EMIRATES - Works. Restricted area. Outfall. Buoyage.

Source: Umm Al Quwain Harbour Master

1. Desalination plant construction works are in progress within a restricted area bounded by the following positions:

25° 39'·46N., 55° 44'·86E.
25° 39'·60N., 55° 44'·63E.
25° 39'·68N., 55° 44'·69E.
25° 40'·84N., 55° 42'·83E.
25° 40'·48N., 55° 42'·51E.
25° 39'·17N., 55° 44'·56E.

2. Construction of an outfall pipe is taking place joining the following positions:

25° 39'·29N., 55° 44'·70E.
25° 40'·61N., 55° 43'·02E.

3. Yellow special buoys are to be established in the following positions:

25° 40'·63N., 55° 43'·00E.
25° 40'·07N., 55° 43'·71E.

4. Mariners are advised to navigate with caution in the area.
5. Charts will be updated when works are completed.
(WGS84 DATUM)

Chart affected — 3175

3623(P)/21 SAUDI ARABIA - Red Sea Coast - Depths.

Source: Saudi Ports Authority

1. Depths less than charted exist within Jeddah Port. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
* 12·2m	21° 28'·079N., 39° 09'·469E.
6·5m	21° 28'·204N., 39° 09'·116E.
14·7m	21° 28'·480N., 39° 09'·631E.
10·6m	21° 28'·898N., 39° 09'·487E.
* 7·1m	21° 28'·345N., 39° 09'·816E.
* 14·5m	21° 28'·778N., 39° 09'·476E.
* 16·6m	21° 29'·211N., 39° 09'·245E.

2. * Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. * Former Notice 3103(P)/19 is cancelled.
* Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 2577

4104(T)/21 SAUDI ARABIA - East Coast - Obstruction.

Source: NAVAREA IX Warning 299/21

1. An obstruction, consisting of an anchor and chain, has been reported in position 27° 16'·20N., 49° 55'·32E.
2. Mariners are requested not to anchor in the vicinity.
(WGS84 DATUM)

Charts affected — 2882 — 2883 — 3719 — 3775 — 3788

597(P)/22 BAHRAIN - Dredged area. Reclamation area. Works. Buoyage.

Source: MENAS Nav Warning 252/21

1. Dredging and reclamation works are taking place in the area bounded by the following positions:

26° 11'·58N., 50° 41'·67E.
 26° 12'·17N., 50° 41'·33E.
 26° 12'·02N., 50° 41'·01E.
 26° 11'·69N., 50° 41'·19E.
 26° 11'·64N., 50° 41'·41E.
 26° 10'·77N., 50° 41'·61E.
 26° 10'·77N., 50° 42'·42E.
 26° 10'·82N., 50° 42'·40E.
 26° 10'·84N., 50° 42'·35E.
 26° 11'·55N., 50° 41'·92E.
 26° 11'·51N., 50° 41'·83E.

2. Two special purpose buoys have been established, in positions:

26° 10'·77N., 50° 41'·61E.
 26° 10'·77N., 50° 42'·05E.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 3734 — 3736 — 3737**1064(P)/22 UNITED ARAB EMIRATES - Works. Restricted areas.**

Source: MENAS Nav Warning 62/22

1. Works are taking place on the east side of Şīr Banī Yās. For vessels not engaged in the works, restricted areas, entry prohibited, have been established, bounded by the following positions:

* 24° 20'·42N., 52° 38'·79E.
 * 24° 20'·94N., 52° 39'·83E.
 * 24° 22'·23N., 52° 38'·94E.
 * 24° 21'·77N., 52° 38'·05E.
 and
 * 24° 18'·16N., 52° 38'·50E.
 * 24° 17'·87N., 52° 39'·11E.
 * 24° 19'·02N., 52° 39'·63E.
 * 24° 19'·20N., 52° 38'·63E.

2. Mariners are advised to navigate with caution in the area.
3. Charts 3179, 3778, 3779 and 3780 will be updated when full details are available.
4. Former Notice 3072(P)/21 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 3179 — 3778 — 3779 — 3780**1452(P)/22 SAUDI ARABIA - Red Sea Coast - Buoy. Single Point Mooring. Deep water route. Precautionary area. Submarine pipeline.**

Source: Saudi Ports Authority

1. A new Deep Water route, minimum depth 27m, marked by existing lateral buoys, has been established in the approaches to Jazan Economic City, starting at 17° 00'·80N., 41° 19'·90E.. (See accompanying diagram).
2. A precautionary area has been established within the deep water route, bounded by the following positions:

17° 05'·55N., 42° 03'·97E.
 17° 04'·03N., 42° 08'·05E.
 17° 03'·69N., 42° 09'·07E.
 17° 03'·35N., 42° 10'·09E.
 16° 59'·99N., 42° 10'·02E.
 17° 02'·37N., 42° 02'·07E.
 17° 03'·96N., 42° 03'·02E.


3. The South Cardinal light-buoy, *Q(6)+LFI.15s*, in position 17° 06'·04N., 41° 24'·50E. has been removed.

1452(P)/22 SAUDI ARABIA - Red Sea Coast - Buoy. Single Point Mooring. Deep water route. Precautionary area. Submarine pipeline. (continued)

4. An SPM mooring light-buoy with ground tackle, *Mo(U)15s*, has been established in position $17^{\circ} 15' \cdot 69N$, $42^{\circ} 14' \cdot 78E$.
5. A submarine pipeline has been established joining the SPM to shore in the following positions:
 $17^{\circ} 15' \cdot 69N$, $42^{\circ} 14' \cdot 78E$.
 $17^{\circ} 17' \cdot 51N$, $42^{\circ} 19' \cdot 46E$.
6. Mariners are advised to navigate with caution in the area.
7. These changes will be included in the next New Edition of Chart 15.
(WGS84 DATUM)

Chart affected — 15

To accompany Notice to Mariners 1452(P)/22

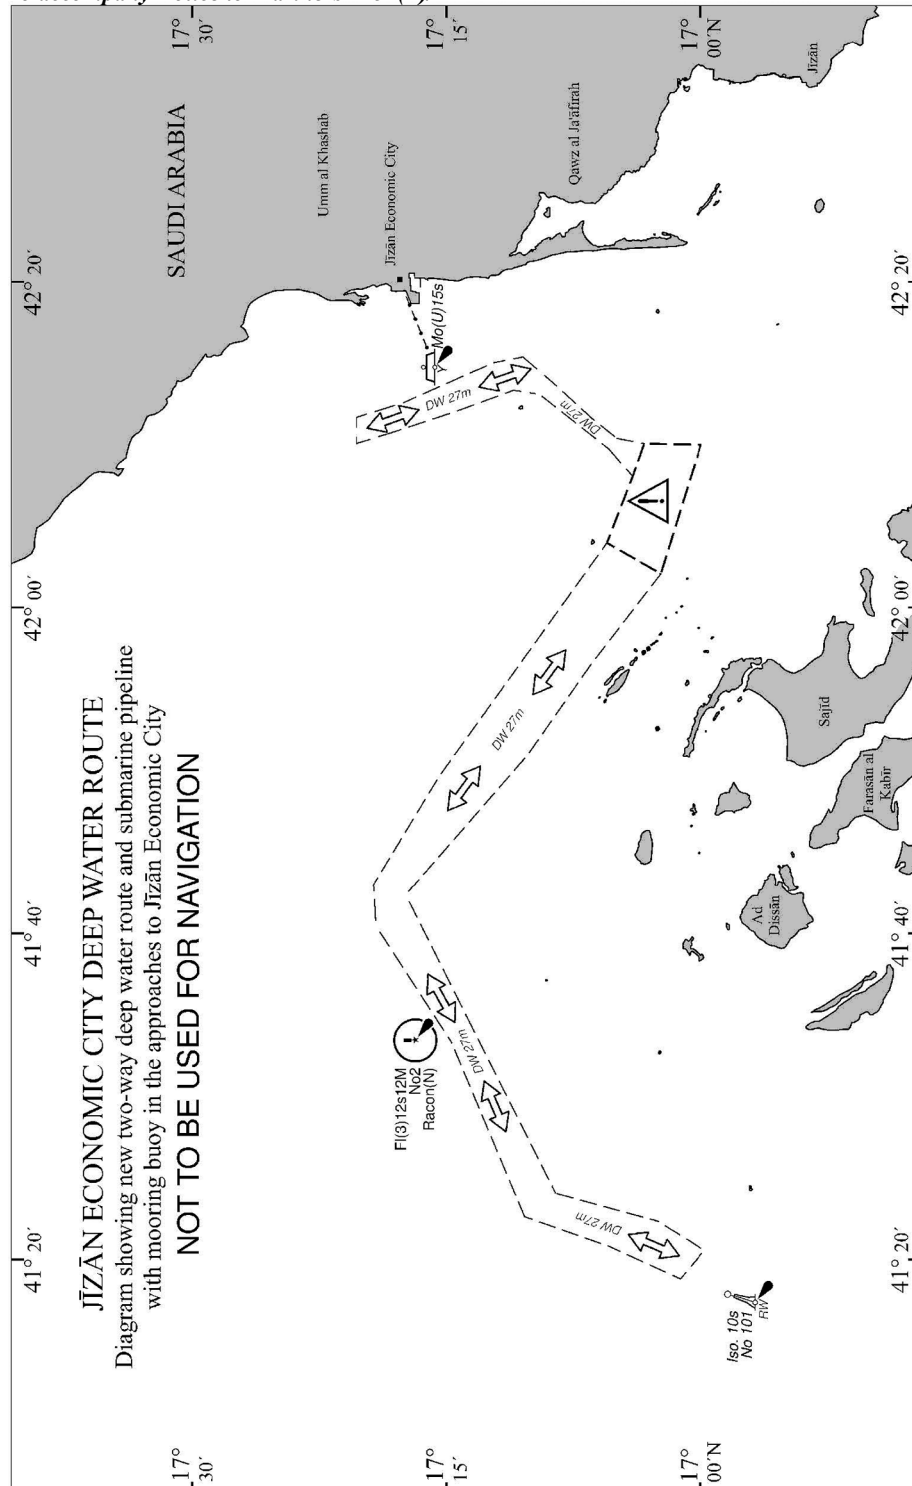

3372(P)/22 **UNITED ARAB EMIRATES - Dredging area. Reclamation area. Works. Buoyage. Restricted area.**

Source: Abu Dhabi Ports Company

1. Dredging and reclamation works are in progress at Khalifa Port, in an area bounded by the following positions:

24° 49′·39N., 54° 37′·19E.

24° 50′·93N., 54° 39′·24E.

24° 49′·75N., 54° 40′·25E.

24° 48′·20N., 54° 38′·19E.

2. The area is marked by special buoys, *FL.Y.5s*.

3. Entry into the area is restricted.

4. Mariners are advised to navigate with caution in the area.

5. Charts will be updated on completion of works.
(WGS84 DATUM)

Chart affected — 3176

4751(P)/22 QATAR - Submarine pipeline. Works. Offshore installation.

Source: QatarEnergy

1. Submarine pipeline and Jacket installation works are taking place within areas bounded by the following positions:

25° 56'·08N., 51° 32'·93E.

26° 02'·00N., 51° 34'·00E.

26° 02'·00N., 51° 37'·00E.

25° 55'·50N., 51° 34'·33E.

and

26° 04'·28N., 51° 31'·70E.

26° 43'·02N., 51° 57'·62E.

26° 24'·50N., 52° 20'·77E.

26° 02'·72N., 51° 36'·42E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 2523 — 2837 — 2847 — 2883 — 2886 — 2887 — 3772 — 3950**734(T)/23 KUWAIT - Buoyage.**

Source: Princess Vanya

1. The following safe water-buoys, are reported to be missing:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>LFl.10s</i>	<i>C1</i>	Safe Water, pillar	28° 38'·30N., 49° 07'·00E.
<i>LFl.10s</i>	<i>C2</i>	Safe Water, pillar	28° 38'·30N., 48° 55'·00E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1224 — 2847 — 2858 — 2882 — 2884 — 3773 — 3774**1223(P)/23 UNITED ARAB EMIRATES - Works. Dredging area.**

Source: Port of Fujairah

1. Development works and dredging are taking place at Dhadna Yacht Marina in the vicinity of 25° 32'·59N., 56° 22'·40E.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 3171 — 3520**1233(T)/23 EGYPT - Suez Canal - Works. Buoy.**

Source: ENHD

1. Dredging works are taking place in the area bounded by the following positions:

31° 19'·72N., 32° 22'·62E.

31° 19'·69N., 32° 22'·82E.

31° 19'·05N., 32° 22'·48E.

31° 19'·05N., 32° 22'·41E.

2. The north cardinal pillar light-buoy, *VQ Hm 92*, may be temporarily removed during the dredging works.

1233(T)/23 EGYPT - Suez Canal - Works. Buoy. (continued)

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2578**1722(T)/23 SAUDI ARABIA - Red Sea Coast - Buoyage.**

Source: Pakistani Nav Warnings 489/22 and 513/22

- The following yellow mooring buoys, *Q.Y.*, are reported missing:

<i>Designation</i>	<i>Position</i>
<i>B2</i>	23° 58'·63N., 38° 02'·20E.
<i>B3</i>	23° 57'·83N., 38° 01'·21E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 327**4159(T)/23 SAUDI ARABIA - Red Sea Coast - Buoy.**

Source: Port of NEOM

- A Yellow special purpose buoy, X-Shaped Topmark, *Fl(5)Y.20s*, has been deployed, until further notice, in position 27° 33'·700N., 35° 31'·700E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 12**4449(T)/23 UNITED ARAB EMIRATES - Obstruction.**

Source: MENAS 247/23

- An obstruction, consisting of an anchor and chain, has been reported in position 25° 07'·23N., 52° 53'·27E.
- Mariners are requested not to anchor in the vicinity.
(WGS84 DATUM)

Charts affected — 2444 — 3179 — 3413**555(T)/24 IRAN - Barge.**

Source: Iranian Notice 28/23

- An accommodation barge is temporarily moored in position 26° 41'·40N., 52° 15'·50E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2523 — 2883 — 2886**619(T)/24 KUWAIT - Wreck.**

Source: MENAS Notice 12/2024

- A dangerous wreck, depth unknown, has been reported in position 29° 05'·50N., 48° 22'·10E.
- An Isolated danger buoy, *Fl(2)5s*, has been temporarily deployed in position 29° 05'·52N., 48° 22'·06E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 1223 — 2882 — 2884 — 3773**905(T)/24 BAHRAIN - Buoy.**

Source: Bahraini HO

- The special purpose buoy in position 26° 51'·87N., 50° 51'·65E. is reported to be adrift.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2883 — 2886 — 3788

1357(T)/24 UNITED ARAB EMIRATES - Buoy.

Source: Port of Fujairah 03/24

1. The Fairway light-buoy, *Iso.6s FW*, in position 25° 07'·70N., 56° 25'·00E. is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3709 — 3723**2528(P)/24 UNITED ARAB EMIRATES - Works. Dredging area. Reclamation area.**

Source: Abu Dhabi Maritime

1. Dredging and reclamation works are taking place within the Lower Zaqqum Oil Field, bounded by the following positions:

25° 05'·24N., 53° 35'·53E.
25° 05'·04N., 53° 47'·17E.
25° 03'·37N., 53° 47'·00E.
25° 01'·73N., 53° 46'·08E.
24° 59'·83N., 53° 38'·12E.
25° 00'·05N., 53° 36'·30E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2443 — 2444 — 2837 — 2889**2672(P)/24 SAUDI ARABIA - Red Sea Coast - Submarine cables.**

Source: Alcatel Submarine Networks

1. Submarine cable laying operations are taking place for the ORYX cable system, joining the following positions:

<i>Location</i>	<i>Position</i>
Gulf of Aqaba	29° 29'·30N., 34° 53'·38E.
	29° 27'·65N., 34° 54'·45E.
	29° 23'·26N., 34° 52'·50E.
	29° 21'·32N., 34° 53'·16E.
	29° 19'·56N., 34° 56'·35E.
	29° 17'·97N., 34° 56'·87E.
	27° 55'·97N., 34° 22'·29E.
	27° 52'·89N., 34° 26'·29E.
	27° 47'·79N., 34° 29'·13E.
	27° 44'·07N., 34° 36'·17E.
Strait of Tiran to Dubā	27° 32'·21N., 34° 50'·70E.
	27° 17'·66N., 35° 04'·17E.
	27° 16'·94N., 35° 15'·46E.
	27° 17'·88N., 35° 18'·64E.
	27° 21'·52N., 35° 31'·18E.
	27° 22'·17N., 35° 36'·39E.
	27° 21'·27N., 35° 40'·39E.
	and
	27° 55'·968N., 34° 22'·286E.
	27° 52'·888N., 34° 26'·291E.
	27° 47'·785N., 34° 29'·135E.
	27° 44'·073N., 34° 36'·173E.
	27° 32'·215N., 34° 50'·700E.

2672(P)/24 SAUDI ARABIA - Red Sea Coast - Submarine cables. (continued)

2.

27° 17'·661N., 35° 04'·165E.
 27° 16'·944N., 35° 15'·463E.
 27° 17'·878N., 35° 18'·643E.
 27° 18'·104N., 35° 19'·717E.
 27° 17'·933N., 35° 21'·797E.
 27° 15'·048N., 35° 26'·423E.
 27° 16'·463N., 35° 33'·501E.
 27° 17'·739N., 35° 41'·324E.
 27° 19'·808N., 35° 43'·563E.
 Gulf of Suez to Yanbu' Al 28° 21'·89N., 33° 05'·11E.
 Bahr
 28° 23'·83N., 33° 09'·18E.
 28° 24'·40N., 33° 15'·22E.
 28° 15'·71N., 33° 28'·20E.
 28° 06'·41N., 33° 35'·18E.
 27° 54'·50N., 33° 42'·29E.
 27° 44'·73N., 33° 53'·43E.
 27° 41'·32N., 33° 52'·87E.
 27° 35'·08N., 34° 03'·21E.
 27° 30'·20N., 34° 09'·38E.
 27° 22'·15N., 34° 11'·39E.
 27° 17'·40N., 34° 18'·62E.
 26° 38'·29N., 34° 40'·61E.
 26° 37'·10N., 34° 49'·38E.
 26° 15'·41N., 35° 08'·44E.

3.

26° 09'·74N., 35° 07'·22E.
 25° 45'·22N., 35° 23'·61E.
 25° 18'·36N., 35° 38'·32E.
 25° 02'·27N., 35° 52'·38E.
 24° 57'·16N., 36° 01'·56E.
 24° 21'·52N., 36° 18'·97E.
 24° 05'·81N., 36° 25'·75E.
 23° 54'·57N., 36° 50'·23E.
 23° 56'·45N., 37° 08'·40E.
 24° 01'·06N., 37° 32'·03E.
 23° 54'·97N., 37° 38'·59E.
 23° 59'·52N., 37° 54'·14E.
 24° 04'·96N., 37° 57'·13E.
 24° 04'·81N., 38° 01'·29E.

4. In order to simplify the depiction of this submarine cable, a reduced number of geographical positions have been listed.
5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
6. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 12 — 158 — 159 — 327 — 333 — 801 — 2374 — 2375

2688(T)/24 ARABIAN SEA - Scientific instruments. Buoyage.

Source: AlMaseh Albahri Sultan and Guardian Geomatics

1. Scientific instruments have been established on the seabed, marked by yellow light-buoys, *Fl.Y*, in the following positions:

28° 38'·20N., 48° 56'·26E.
 28° 07'·30N., 49° 06'·19E.
 28° 21'·39N., 49° 23'·27E.
 28° 45'·30N., 49° 29'·20E.
 28° 18'·43N., 48° 44'·57E.
2. Mariners are requested to maintain a 500m distance from the marker buoys.
3. Mariners are advised to navigate with caution in the area.

2688(T)/24 ARABIAN SEA - Scientific instruments. Buoyage. (continued)

4. *Former Notice 1835(T)/24 is cancelled.
 *Indicates new or revised entry.
 (WGS84 DATUM)

Charts affected — 1224 — 2882 — 2884 — 3773 — 3774

2747(T)/24 UNITED ARAB EMIRATES - Barge. Lights.

Source: MENAS Notice 106/24

1. An accommodation barge has been anchored in the following position: 25° 06'·79N., 52° 53'·39E. Anchor points are marked by lights.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — 3413

3475(P)/24 UNITED ARAB EMIRATES - Works. Submarine pipeline.

Source: MENAS Navtex 134/24

1. Submarine pipeline laying works are taking place, joining the following positions:
 25° 09'·25N., 52° 52'·80E.
 25° 09'·55N., 52° 58'·54E.
 25° 04'·98N., 53° 08'·17E.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
 (WGS84 DATUM)

Charts affected — 2443 — 2444 — 2837 — 2886 — 2887 — 2889 — 3178 — 3179 — 3413

3728(P)/24 BAHRAIN - Depths.

Source: UKHO

1. Depths less than charted are reported to exist within Khawr al Qulay'ah. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
6·6m	26° 11'·948N., 50° 39'·009E.
6·1m	26° 11'·918N., 50° 39'·047E.
6·3m	26° 11'·905N., 50° 39'·061E.
7·9m	26° 11'·906N., 50° 39'·106E.
7·8m	26° 11'·885N., 50° 39'·080E.
6·8m	26° 11'·859N., 50° 39'·104E.
5·8m	26° 11'·837N., 50° 39'·123E.

2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — 3736

4265(T)/24 KUWAIT - Restricted area.

Source: MENAS Notice 152/24

1. A temporary restricted area has been established, radius 300m, centred on position 29° 24'·10N., 48° 50'·51E.
2. Entry, fishing and anchoring is prohibited within the restricted area.
3. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 2882 — 2884 — 3773

4544(T)/24 UNITED ARAB EMIRATES - Wreck.

Source: UKHO

1. A dangerous wreck has been reported to exist in approximate position 25° 35'·02N., 54° 51'·15E.

4544(T)/24 UNITED ARAB EMIRATES - Wreck. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2837 — 2858 — 2887 — 2888 — 2889 — 3175 — 4705

4659(T)/24 UNITED ARAB EMIRATES - Dredged area. Works. Buoyage.

Source: MENAS Notice 214/24

1. Dredging works are taking place in an area bounded by the following positions:

25° 44'·46N., 55° 41'·92E.

25° 44'·92N., 55° 45'·58E.

25° 43'·21N., 55° 44'·98E.

25° 42'·87N., 55° 42'·87E.

2. The following cardinal buoys have been established:

Buoy Type***Position***

North Cardinal Buoy

25° 42'·56N., 55° 45'·00E.

East Cardinal Buoy

25° 42'·00N., 55° 45'·57E.

West Cardinal Buoy

25° 42'·11N., 55° 43'·85E.

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2888 — 3174 — 3175

4949(T)/24 UNITED ARAB EMIRATES - Buoy.

Source: RAK Ports Notice 18/24

1. An ODAS light-buoy, *Q Y*, has been established in position 26° 08'·60N., 55° 42'·80E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2888 — 3174

5384(P)/24 BAHRAIN - Works. Submarine pipeline.

Source: MENAS Nav Warning 186/24

1. Construction works including seabed excavation and pipeline laying activities are taking place, in an area bounded by the following positions:

* 26° 10'·03N., 50° 39'·57E.

* 26° 09'·95N., 50° 39'·55E.

* 26° 09'·88N., 50° 39'·58E.

* 26° 09'·95N., 50° 39'·72E.

* 26° 10'·00N., 50° 39'·90E.

* 26° 09'·73N., 50° 40'·37E.

* 26° 09'·77N., 50° 40'·42E.

* 26° 09'·98N., 50° 40'·28E.

* 26° 10'·07N., 50° 40'·00E.

* 26° 10'·05N., 50° 39'·72E.

2. *Mariners are requested to maintain listening watch on VHF CH 16/74/72 and take instructions as required from Bahrain Port Control and BAPCO Wharf Control.
3. *Charts will be updated when works are complete.
4. *Former Notice 5210(T)/21 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 3734 — 3736 — 3737

5665(P)/24 QATAR - Submarine cables. Works.

Source: QatarEnergy

1. *Submarine cable works are taking place within the area bounded by the following positions:

25° 57'·015N., 51° 27'·344E.

25° 47'·738N., 52° 06'·214E.

26° 15'·431N., 52° 24'·608E.

26° 15'·491N., 52° 16'·533E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
4. *Former Notice 4981(P)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2523 — 2837 — 2847 — 2886 — 2887 — 3772 — 3781 — 3950**117(P)/25 DJIBOUTI - Submarine cables.**

Source: French Notice 43/196/24

1. Submarine cables exist in the following positions:

13° 12'·20N., 43° 02'·91E.

13° 17'·55N., 42° 58'·72E.

13° 20'·36N., 42° 58'·49E.

13° 22'·99N., 42° 56'·74E.

and

11° 47'·31N., 43° 22'·60E.

11° 47'·35N., 43° 21'·71E.

11° 47'·28N., 43° 20'·96E.

11° 46'·91N., 43° 20'·26E.

11° 44'·52N., 43° 18'·34E.

11° 44'·16N., 43° 18'·14E.

11° 43'·87N., 43° 18'·06E.

11° 42'·18N., 43° 17'·89E.

2. Chart 265 will be updated when full details are available.
3. Charts 6, 143, 157, 264, 452, 453, 1925 will be updated by Notice to Mariners.
(WGS84 DATUM)

Chart affected — 265**414(T)/25 SAUDI ARABIA - Red Sea Coast - Lights. Buoyage.**

Source: Saudi Ports Authority

1. *The following leading lights, Fl.Bu, are reported unlit:

17° 17'·15N., 42° 20'·14E.

17° 17'·50N., 42° 20'·56E.

414(T)/25 SAUDI ARABIA - Red Sea Coast - Lights. Buoyage. (continued)

2. *The following buoys are reported missing from station or unlit:

<i>Buoy No.</i>	<i>Type</i>	<i>Location</i>	<i>Issue</i>	<i>Position</i>
101	Safe Water	Deep Water Route	Unlit	16° 56'·77N., 41° 17'·37E.
102	Starboard Lateral	Deep Water Route	Unlit	16° 56'·71N., 41° 18'·84E.
104	Isolated Danger	Deep Water Route	Missing	16° 59'·90N., 41° 19'·36E.
108	Starboard Lateral	Deep Water Route	Missing	17° 08'·50N., 41° 24'·44E.
110	Starboard Lateral	Deep Water Route	Unlit	17° 13'·61N., 41° 34'·59E.
111	Port Lateral	Deep Water Route	Missing	17° 14'·82N., 41° 33'·35E.
112A	Port Lateral	Deep Water Route	Unlit	17° 19'·15N., 41° 40'·45E.
113	Port Lateral	Deep Water Route	Unlit	17° 15'·45N., 41° 49'·63E.
117	Port Lateral with Racon	Deep Water Route	Unlit, no Racon	17° 06'·25N., 42° 03'·82E.
118	Starboard Lateral	Deep Water Route	Unlit	17° 02'·30N., 42° 02'·10E.
122	Starboard Lateral	Deep Water Route	Damaged, unlit	17° 05'·00N., 42° 10'·38E.
*124	Port Lateral	Deep Water Route	Missing	17° 09'·82N., 42° 13'·16E.
129	Port Lateral	Dredged Channel Approach	Unlit	17° 13'·47N., 42° 14'·49E.
217	Special Mark	Northern limit of Channel	Unlit	17° 20'·30N., 42° 11'·70E.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

4. *Former notice 1413(T)/23 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 15 — 157

481(P)/25 SAUDI ARABIA - Red Sea Coast - Works. Port developments. Dredging area.

Source: Saudi Ports Authority

- Port developments and dredging are taking place at Jeddah Port to deepen and widen the entrance to the port, and to deepen the approach channel to the Red Sea Gateway Terminal 21° 29'·273N., 39° 09'·310E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 2577 — 2599

632(T)/25 UNITED ARAB EMIRATES - Buoy.

Source: MENAS Nav Warning 9/25

- *A data collection buoy has been temporarily established in the following position:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl(5)Y.20s</i>	<i>MIDI 018</i>	Yellow Spherical Buoy	25° 03'·01N., 53° 04'·16E.

- Mariners are advised to navigate with caution in the area.
- *Former Notice 5509(T)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2443 — 2444 — 3178 — 3179

671(T)/25 UNITED ARAB EMIRATES - Restricted area. Buoyage.

Source: Abu Dhabi Ports NM 21/24

- A temporary restricted area, entry prohibited, marked by Yellow light-buoys, *Fl.3s*, has been established bounded by the following positions:

24° 32'·11N., 54° 21'·63E.
24° 32'·13N., 54° 21'·72E.
24° 32'·11N., 54° 21'·72E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3713 — 3715

695(P)/25 UNITED ARAB EMIRATES - Depths.

Source: Abu Dhabi Maritime

- Recent survey information has shown that numerous depths less than charted exist between Muṣṣafaḥ Channel and New Free Port. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
3·9m	24° 29'·15N., 54° 17'·44E.
3·7m	24° 28'·97N., 54° 17'·59E.
3·5m	24° 29'·47N., 54° 17'·74E.
4·4m	24° 29'·42N., 54° 18'·06E.
4·6m	24° 29'·90N., 54° 17'·90E.
4·3m	24° 29'·70N., 54° 18'·41E.
3·6m	24° 29'·54N., 54° 18'·74E.
2·4m	24° 29'·94N., 54° 18'·96E.
3·7m	24° 30'·04N., 54° 19'·23E.
2·4m	24° 30'·31N., 54° 19'·25E.
4·1m	24° 30'·37N., 54° 19'·54E.
2·9m	24° 30'·59N., 54° 19'·35E.
3·6m	24° 30'·81N., 54° 19'·26E.
4·7m	24° 30'·76N., 54° 18'·39E.
5m	24° 31'·22N., 54° 18'·80E.
4m	24° 31'·04N., 54° 19'·79E.
4·1m	24° 31'·72N., 54° 20'·44E.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 3713 — 3715**777(T)/25 UNITED ARAB EMIRATES - Depths.**

Source: Abu Dhabi Ports Company

- Recent survey information has shown numerous depths less than charted exist at the edges of the approach channel leading to Khalifa Port. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
17·8m	24° 50'·65N., 54° 39'·61E.
17·5m	24° 50'·44N., 54° 39'·79E.
17·1m	24° 50'·21N., 54° 39'·99E.
16·6m	24° 49'·92N., 54° 40'·25E.
17·9m	24° 50'·10N., 54° 40'·28E.

- While the centre of the channel broadly maintains a charted depth of 18·5m, a shoal depth of 18·1m exists in position 24° 53'·14N., 54° 37'·50E.
- Mariners are advised to navigate with caution in the area and consult the local port authority for the latest information.
(WGS84 DATUM)

Charts affected — 3176 — 3177 — 3752**839(T)/25 OMAN - Buoy.**

Source: Omani Navigational Warning 34/24

- The yellow special purpose light-buoy, *Fl.Y.5s*, in position 19° 41'·33N., 57° 43'·32E., is reported missing.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3762

1022(T)/25 ISRAEL - Red Sea Coast - Platform. Lights. Works.

Source: Israeli Notice 4/25

1. Underwater installation works are taking place within an area bounded by the following positions:

29° 32′·60N., 34° 58′·38E.

29° 32′·45N., 34° 58′·31E.

29° 32′·51N., 34° 58′·15E.

29° 32′·66N., 34° 58′·22E.

2. A yellow platform, fixed to the seabed by four pillars, has been constructed in position 29° 32′·55N., 34° 58′·28E. The pillars are marked by Q.R lights.
3. Mariners are requested to maintain a minimum safe distance of 0·5 NM from the works vessel and platform and are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 801**1135(P)/25 RED SEA - Submarine cables.**

Source: UKHO

1. The PEACE telecommunications cable has been laid joining the following positions:

16° 33′·83N., 40° 42′·17E.

16° 26′·61N., 40° 41′·29E.

16° 14′·75N., 40° 53′·30E.

16° 12′·74N., 40° 58′·17E.

16° 07′·94N., 41° 03′·02E.

16° 08′·42N., 41° 06′·94E.

15° 40′·24N., 41° 31′·60E.

15° 33′·78N., 41° 30′·19E.

15° 14′·85N., 41° 36′·61E.

14° 40′·84N., 41° 59′·93E.

14° 28′·94N., 42° 12′·82E.

13° 41′·00N., 42° 37′·79E.

13° 35′·87N., 42° 39′·34E.

13° 29′·89N., 42° 47′·40E.

13° 24′·41N., 42° 53′·36E.

13° 19′·47N., 42° 57′·24E.

13° 18′·53N., 42° 58′·65E.

13° 18′·61N., 43° 01′·86E.

13° 00′·23N., 43° 13′·62E.

13° 00′·27N., 43° 16′·56E.

12° 55′·75N., 43° 19′·26E.

12° 50′·85N., 43° 20′·86E.

12° 45′·26N., 43° 21′·11E.

12° 42′·02N., 43° 22′·09E.

12° 39′·53N., 43° 22′·05E.

- 2.

12° 37′·96N., 43° 22′·82E.

12° 36′·71N., 43° 26′·16E.

12° 37′·00N., 43° 27′·74E.

12° 33′·54N., 43° 42′·69E.

12° 27′·43N., 43° 49′·98E.

12° 25′·31N., 43° 51′·18E.

3. and

13° 33′·03N., 42° 43′·17E.

13° 33′·86N., 42° 42′·46E.

13° 35′·65N., 42° 42′·21E.

13° 37′·52N., 42° 40′·96E.

13° 41′·00N., 42° 37′·79E.

4. Mariners are advised to navigate with caution in the area.

1135(P)/25 RED SEA - Submarine cables. (continued)

5. This change will be included in a New Edition of Charts 143, 452, 453 and 1925 to be published mid 2025 and 265 late 2025.
6. Charts 6, 157, and 3661 will be updated by notice to mariners.
(WGS84 DATUM)

Chart affected — 265**1219(T)/25 KUWAIT - Platform.**

Source: MENAS Notice 295/24

1. Drilling Rig Oriental Dragon 1 will be stationed in position 28° 55'·30N., 48° 28'·49E. until the end of December 2025.
2. Mariners are requested to give a wide berth and to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2882 — 2884 — 3773**1287(T)/25 SAUDI ARABIA - East Coast - Buoy.**

Source: Saudi Ports Authority

1. The port-hand lateral light-buoy, *Fl(3)R.5s RAZ 6*, in position 27° 41'·95N., 49° 23'·44E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3775**1359(T)/25 KUWAIT - Light. Buoy.**

Source: MENAS Notice 10/25

1. *The MET Tower and associated light, *Fl(4)15s6m5M*, in position 28° 46'·00N., 48° 26'·13E. has collapsed and is no longer operational, creating an obstruction to navigation.
2. *A light-buoy, *Fl(4)15s*, has been established in position 28° 46'·00N., 48° 26'·10E. to mark the remains of the damaged tower.
3. Mariners are advised to navigate with caution in the area.
4. *Former Notice 2031(T)/21 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1223 — 2882 — 2884 — 3773**1572(T)/25 KUWAIT - Works.**

Source: Kuwait Coastguard

1. Harbour works are taking place in the vicinity of position 29° 20'·78N., 47° 55'·54E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 1214**1613(P)/25 SAUDI ARABIA - Red Sea Coast - Harbour developments. Channel. Channel depth. Buoyage. Light-beacons. Dredging area.**

Source: Saudi Ports Authority

1. Extensive harbour developments and dredging are taking place at Port of Ḍubā (NEOM) (27° 33'·600N., 35° 32'·700E.) .
2. *A new buoyed approach channel with a reported depth between 15m and 18m, aligned 101·2°, has been established in the entrance to Port of Ḍubā (NEOM).

1613(P)/25 SAUDI ARABIA - Red Sea Coast - Harbour developments. Channel. Channel depth. Buoyage. Light-beacons. Dredging area. (continued)

3. *The following lateral light-buoys have been established marking the approach channel:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl.G.1.5s</i>	<i>No 1</i>	27° 33'·858N., 35° 31'·773E.
<i>Fl.R.1.5s</i>	<i>No 2</i>	27° 33'·964N., 35° 31'·795E.
<i>Fl.G.3s</i>	<i>No 3</i>	27° 33'·807N., 35° 32'·071E.
<i>Fl.R.3s</i>	<i>No 4</i>	27° 33'·914N., 35° 32'·094E.
<i>Fl(2)G.3s</i>	<i>No 5</i>	27° 33'·762N., 35° 32'·335E.
<i>Fl(2)R.3s</i>	<i>No 6</i>	27° 33'·869N., 35° 32'·358E.

4. *A special purpose light-buoy, *Fl.Y.2s* has been established in position 27° 33'·868N., 35° 32'·461E.
 5. *The special purpose light-buoy, *Fl(5)Y*, in position 27° 33'·700N., 35° 32'·600E. has been removed.
 6. *The following light-beacons have been removed:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl.G.3s</i>	<i>No 1</i>	27° 33'·730N., 35° 31'·765E.
<i>Fl.R.3s</i>	<i>No 2</i>	27° 33'·848N., 35° 31'·811E.
<i>Fl.G.1.5s</i>	<i>No 3</i>	27° 33'·685N., 35° 32'·153E.
<i>Fl.R.1.5s</i>	<i>No 4</i>	27° 33'·789N., 35° 32'·169E.
<i>Fl(2)G.3s</i>	<i>No 5</i>	27° 33'·659N., 35° 32'·400E.
<i>Fl(2)R.3s</i>	<i>No 6</i>	27° 33'·749N., 35° 32'·542E.

7. Mariners are advised to navigate with caution in the area and consult Dūbā Port Authority (NEOM) for the latest information.
 8. Charts will be updated when works are complete.
 9. *Former Notice 4768(P)/24 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 12

1952(T)/25 UNITED ARAB EMIRATES - Restricted area. Buoyage. Dredging area. Reclamation area. Works.

Source: ADNOC and MENAS Nav Warning 72/25

1. A restricted area, prohibited entry, marked by special purpose light-buoys, *Fl.Y*, has been established bounded by the following positions:
 24° 09'·818N., 52° 47'·247E.
 24° 09'·699N., 52° 47'·343E.
 24° 09'·567N., 52° 47'·135E.
 24° 09'·689N., 52° 47'·044E.
 2. Dredging and reclamation works are taking place in the vicinity of SHT-II, centred on 24° 08'·001N., 52° 47'·146E.
 3. *Positions of existing lateral buoyage in the vicinity of the dredging and reclamation works will change as the project progresses.
 4. Mariners are advised to navigate with caution in the area and contact Ruwais VTIS for the latest information.
 5. *Former Notice 1655(T)/25 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 3778 — 3796

2159(T)/25 ISRAEL - Red Sea Coast - Marine farm. Buoyage.

Source: Israeli Notice 19/25

1. A marine farm has been established, marked by special light-buoys in the following positions:
 29° 31'·93N., 34° 56'·57E.
 29° 31'·91N., 34° 56'·61E.
 29° 31'·88N., 34° 56'·53E.
 (WGS84 DATUM)

Chart affected — 801

2272(T)/25 UNITED ARAB EMIRATES - Buoyage. Dredging area. Works. Anchorage area.

Source: ADNOC and MENAS Nav Warning 278/24

1. Environmental Monitoring light-buoys, *Fl.Y.2s*, have been established in the following positions:

<i>Designation</i>	<i>Position</i>
<i>ENV BUOY 1</i>	24° 11'·231N., 52° 40'·957E.
<i>*ENV BUOY 2</i>	24° 10'·78N., 52° 38'·92E.
<i>ENV BUOY 3</i>	24° 10'·723N., 52° 41'·832E.
<i>ENV BUOY 4</i>	24° 15'·04N., 52° 47'·47E.
<i>ENV BUOY 5</i>	24° 13'·40N., 52° 38'·49E.

2. Marker light-buoys, *Fl.Y.5s*, have been established in the following positions:

<i>Designation</i>	<i>Position</i>
<i>MARKER BUOY 1</i>	24° 11'·534N., 52° 41'·382E.
<i>MARKER BUOY 2</i>	24° 11'·295N., 52° 41'·662E.
<i>*MARKER BUOY 3</i>	24° 11'·16N., 52° 39'·58E.
<i>MARKER BUOY 4</i>	24° 10'·053N., 52° 40'·849E.
<i>*MARKER BUOY 5</i>	24° 10'·02N., 52° 39'·33E.
<i>MARKER BUOY 6</i>	24° 09'·098N., 52° 40'·572E.

3. *Dredging works are taking place within an area bounded by the following positions:

24° 09'·20N., 52° 39'·89E.
 24° 11'·369N., 52° 41'·406E.
 24° 11'·276N., 52° 41'·513E.
 24° 10'·141N., 52° 40'·718E.
 24° 08'·853N., 52° 40'·305E.
 24° 08'·769N., 52° 40'·190E.

4. *A temporary sheltering area has been established, for local vessels in adverse weather, bounded by the following positions:

24° 16'·33N., 52° 37'·86E.
 24° 16'·32N., 52° 39'·13E.
 24° 15'·46N., 52° 39'·13E.
 24° 15'·47N., 52° 37'·88E.

5. Mariners are advised to navigate with caution in the area.

6. *Former Notice 141(T)/25 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 3179 — 3778 — 3780 — 3796

2278(T)/25 UNITED ARAB EMIRATES - Buoyage.

Source: RAK Ports Notice 9/25

1. An area to be avoided has been established, with limits marked by four cardinal buoys, in the following positions:

<i>Buoy Type</i>	<i>Position</i>
North Cardinal	25° 43'·05N., 55° 45'·82E.
East Cardinal	25° 42'·87N., 55° 46'·38E.
South Cardinal	25° 42'·51N., 55° 46'·24E.
West Cardinal	25° 42'·69N., 55° 45'·68E.

2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 3174 — 3175

2335(T)/25 UNITED ARAB EMIRATES - Buoy.

Source: RAK Ports Notice 11/25

1. An ODAS light-buoy, *Q.Y*, has been established in position 25° 44'·21N., 55° 41'·60E.

2335(T)/25 UNITED ARAB EMIRATES - Buoy. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2887 — 2888 — 3174 — 3175

2395(P)/25 UNITED ARAB EMIRATES - Reclamation area. Works. Buoyage.

Source: Port of Fujairah Notice 362

1. Reclamation works are taking place, in an area bounded by the following positions:

- * 25° 11'·159N., 56° 22'·615E.
- * 25° 10'·634N., 56° 22'·732E.
- * 25° 10'·577N., 56° 22'·136E.

2. The following light-buoys have been established to mark the reclamation works:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl(2)Y.8s</i>	<i>Y1</i>	Special Purpose Buoy	25° 10'·60N., 56° 22'·32E.
* <i>Q(3)10s</i>		East Cardinal Buoy	25° 10'·634N., 56° 22'·732E.
* <i>Fl(2)Y.8s</i>	<i>Y2</i>	Special Purpose Buoy	25° 10'·832N., 56° 22'·702E.
* <i>Fl(2)Y.8s</i>	<i>Y3</i>	Special Purpose Buoy	25° 10'·618N., 56° 22'·511E.
* <i>Fl(2)Y.8s</i>	<i>Y4</i>	Special Purpose Buoy	25° 11'·034N., 56° 22'·671E.

3. Mariners are advised to navigate with caution in the area.
4. Charts will be updated when works are complete.
5. *Former Notice 320(P)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 3708 — 3709 — 3723

2752(P)/25 UNITED ARAB EMIRATES - Bridge. Works.

Source: Dubai Maritime Authority

1. Bridge construction works are taking place at the entrance of Khawr Dubai (Dubai Creek) in the vicinity of
25° 16'·780N., 55° 17'·600E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3414

2801(T)/25 KUWAIT - Scientific instruments.

Source: MENAS Notice 96/25

1. Scientific instruments have been established in the following positions:

- 29° 36'·12N., 48° 10'·44E.
- 29° 59'·21N., 48° 07'·90E.
- 29° 53'·24N., 48° 19'·03E.
- 29° 51'·96N., 48° 19'·98E.
- 29° 48'·58N., 48° 23'·78E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1229 — 1235 — 3773

2867(P)/25 BAHRAIN - Submarine cable. Works.

Source: MENAS Navtex 122/25

1. Submarine cable works are taking place joining the following positions:

26° 14'·521N., 50° 33'·644E.
 26° 16'·979N., 50° 32'·291E.
 26° 20'·84N., 50° 33'·15E.
 26° 21'·69N., 50° 34'·66E.
 26° 23'·12N., 50° 40'·54E.
 26° 25'·72N., 50° 44'·77E.

2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 2886 — 3735 — 3737 — 3738 — 3790**3339(T)/25 SAUDI ARABIA - Red Sea Coast - Buoy.**

Source: NAVAREA IX Warning 256/25

1. The West Cardinal light buoy, *Q(9)15s, No 4*, in the vicinity of position 21° 26'·65N., 39° 03'·52E., is reported missing.
2. Mariners are advised to navigate with caution.
 (WGS84 DATUM)

Charts affected — 2599 — 2658**3394(T)/25 IRAN - Light-beacon.**

Source: SHOM

1. The Cable Bank isolated danger light-beacon, Fl(2)10s8M, in position 26° 46'·79N., 52° 31'·82E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 2523 — 2837 — 2858 — 2883 — 2886 — 2887**3597(P)/25 ARABIAN SEA - Submarine cables. Works.**

Source: UKHO

1. Cable installation works are taking place in the Persian Gulf, Arabian Sea and Red Sea to install telecoms cables joining the following approximate positions:

<i>Segment</i>	<i>Approximate Positions</i>
Persian Gulf to Arabian Sea	21° 42'·000N., 62° 48'·178E.
	22° 34'·705N., 62° 24'·765E.
	23° 03'·941N., 61° 44'·953E.
	23° 00'·908N., 60° 21'·305E.
	24° 04'·031N., 58° 08'·677E.
	23° 57'·494N., 57° 55'·645E.
	24° 55'·027N., 56° 38'·656E.
	25° 11'·436N., 56° 48'·192E.
	26° 32'·409N., 56° 32'·360E.
	25° 27'·315N., 54° 59'·199E.
	25° 23'·567N., 53° 02'·695E.
	26° 00'·325N., 52° 15'·453E.
	26° 32'·199N., 51° 12'·939E.
	27° 09'·600N., 50° 46'·450E.
	29° 08'·718N., 49° 00'·059E.
	29° 54'·782N., 48° 30'·207E.

3597(P)/25 ARABIAN SEA - Submarine cables. Works. (continued)

2.

Kuwait	29° 08'·718N., 49° 00'·059E. 29° 11'·216N., 48° 21'·357E. 29° 20'·251N., 48° 05'·721E.
Saudi Arabia East	27° 09'·600N., 50° 46'·450E. 26° 59'·462N., 50° 42'·724E. 26° 39'·618N., 50° 21'·691E. 26° 14'·253N., 50° 18'·711E. 26° 14'·592N., 50° 13'·227E.

3.

Bahrain	26° 32'·199N., 51° 12'·939E. 26° 28'·37N., 50° 49'·20E. 26° 23'·08N., 50° 39'·95E. 26° 20'·91N., 50° 33'·19E. 26° 16'·954N., 50° 32'·194E. 26° 14'·516N., 50° 33'·526E.
---------	--

4.

Qatar	26° 00'·325N., 52° 15'·453E. 25° 44'·267N., 51° 59'·663E. 25° 37'·569N., 51° 32'·837E.
United Arab Emirates	24° 55'·032N., 56° 38'·647E. 25° 04'·118N., 56° 21'·628E.

5.

Oman 1	23° 57'·494N., 57° 55'·645E. 23° 44'·677N., 57° 48'·851E.
Pakistan 1	24° 51'·711N., 66° 51'·039E. 23° 48'·921N., 62° 24'·678E. 23° 07'·093N., 61° 43'·128E. 23° 03'·941N., 61° 44'·953E.

6.

Pakistan 2	23° 48'·921N., 62° 24'·678E. 25° 11'·732N., 62° 16'·592E.
Arabian Sea 1	17° 30'·002N., 62° 51'·030E. 18° 46'·176N., 63° 27'·932E. 21° 33'·991N., 62° 52'·119E.
Arabian Sea 2	18° 46'·176N., 63° 27'·932E. 18° 30'·983N., 66° 10'·000E.

7.

Yemen	12° 55'·422N., 56° 27'·443E. 13° 05'·632N., 56° 29'·050E. 13° 24'·432N., 56° 48'·995E.
-------	--

8. Mariners are advised to navigate with caution in these areas.

9. Charts will be updated when works are complete.

10. *Former Notice 1855(P)/25 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

**Charts affected — 38 — 58 — 1268 — 2441 — 2442 — 2443 — 2444 — 2523 — 2851 — 2882 — 2883 —
2884 — 2886 — 2887 — 2888 — 2889 — 3171 — 3172 — 3174 — 3175 — 3176 — 3520 — 3723 — 3735 —
3737 — 3738 — 3761 — 3773 — 3774 — 3775 — 3786 — 3788 — 3790 — 3950**

3704(T)/25 KUWAIT - Restricted areas.

Source: MENAS Nav Warnings 002/25 and 141/25

1. *Circular restricted areas, entry restricted with a radius of 300m (0·16NM), have been temporarily established in the following positions:

28° 52'·48N., 48° 21'·63E.
29° 13'·10N., 48° 44'·42E.

3704(T)/25 KUWAIT - Restricted areas. (continued)

- Mariners are advised to navigate with caution in the area.
- *Former Notice 1218(T)/25 is cancelled.
(WGS84 DATUM)

Charts affected — 2882 — 2884 — 3773**3887(T)/25 UNITED ARAB EMIRATES - Buoyage.**

Source: AD Ports

- Lit yellow Metocean buoys have been established in the following positions:

<i>Characteristic</i>	<i>Position</i>
<i>Fl(4)Y.20s</i>	24° 38'·680N., 52° 35'·373E.
<i>Fl(4)Y.20s</i>	24° 10'·796N., 52° 29'·589E.
<i>Fl(4)Y.20s</i>	24° 31'·365N., 53° 52'·798E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2889 — 3177 — 3179 — 3722 — 3951**3912(T)/25 SAUDI ARABIA - Red Sea Coast - Buoyage.**

Source: NAVAREA IX Warning 277/25

- The following light-buoys have been temporarily removed:

<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>No 10</i>	South Cardinal Buoy	23° 56'·21N., 38° 11'·30E.
<i>No 16</i>	South Cardinal Buoy	23° 54'·21N., 38° 15'·17E.
<i>*East Reef</i>	East Cardinal Buoy	24° 05'·61N., 37° 47'·24E.
<i>*S2</i>	Lateral Port Buoy	23° 27'·98N., 38° 25'·85E.

- Mariners are advised to navigate with caution in the area.
- *Former Notice 5920(T)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 326 — 327 — 328**4050(T)/25 RED SEA - Wreck.**

Source: French Notice 31/1(T)/25

- *A wreck with approximate depth, 50m, has been reported in position 14° 45'·2N., 41° 50'·0E.
- Mariners are advised to navigate with caution in the area.
- *Former Notice 3307(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 143 — 157 — 2964 — 4704**4385(T)/25 BAHRAIN - Buoyage.**

Source: MENAS Notice 19/22 and SHOM

- *The emergency wreck marking light-buoy, *Al.Oc.BuY.3s*, in position 26° 36'·03N., 50° 58'·66E. is reported to be unlit and off station.
- *The safe water light-buoy, *LFl.10s Ra's Tannūrah*, in position 27° 06'·11N., 50° 57'·54E. is reported to be unlit.
- *The isolated danger light-buoy, *Fl(2)12s 5FTM Patch*, in position 26° 30'·81N., 51° 18'·05E. is reported to be off station.
- Mariners are advised to navigate with caution in the area.
- *Former Notice 716(T)/22 is cancelled.
(WGS84 DATUM)

Charts affected — 2837 — 2847 — 2858 — 2883 — 2886 — 3788 — 3790

4719(T)/25 UNITED ARAB EMIRATES - Restricted areas.

Source: Sharjah Ports Customs and Free Zones Authority

1. Restricted areas, entry and anchoring restricted, have been established bounded by the following positions:

25° 26'·59N., 56° 31'·88E.

25° 26'·60N., 56° 34'·86E.

25° 23'·89N., 56° 34'·87E.

25° 23'·88N., 56° 31'·89E.

2. and

25° 25'·49N., 56° 43'·70E.

25° 25'·49N., 56° 46'·68E.

25° 22'·78N., 56° 46'·69E.

25° 22'·78N., 56° 43'·71E.

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2837 — 2858 — 2888 — 3520 — 3723**4998(T)/25 UNITED ARAB EMIRATES - Buoy.**

Source: MENAS Notice 269/25

1. The *Zaqqum* light-buoy, *LFl.10s*, in position 25° 06'·58N., 53° 25'·06E. is reported to have unreliable light and racon.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2443 — 2444 — 2837 — 2858 — 2886 — 2887 — 2889 — 3178**5035(P)/25 UNITED ARAB EMIRATES - Dredging area. Reclamation area. Works. Buoyage. Overhead cable. Pylons. Channel.**

Source: Abu Dhabi Maritime

1. Dredging, reclamation and ground improvement works are taking place in the vicinity of Al Hudariyat Island and New Muşaffaḥ in an area bounded by the following positions:

24° 25'·89N., 54° 19'·53E.
24° 26'·06N., 54° 18'·50E.
24° 23'·95N., 54° 17'·99E.
24° 24'·00N., 54° 20'·08E.
24° 21'·45N., 54° 22'·80E.
24° 22'·35N., 54° 23'·81E.
24° 21'·67N., 54° 25'·28E.
24° 22'·64N., 54° 25'·96E.
24° 23'·99N., 54° 23'·56E.
2. Works consisting of reclamation and dredging, are taking place in the vicinity of Sās an Nakhl Port,
24° 27'·60N., 54° 29'·20E.
3. The Khawr al Maqṭa' channel, 24° 27'·58N., 54° 28'·91E., has been dredged and realigned.

5035(P)/25 UNITED ARAB EMIRATES - Dredging area. Reclamation area. Works. Buoyage. Overhead cable. Pylons. Channel. (continued)

4. New lateral buoys have been established in the following positions:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.G.4s</i>	<i>RM-1</i>	Green Pillar	24° 28'·12N., 54° 29'·19E.
<i>Fl.R.4s</i>	<i>RM-2</i>	Red Pillar	24° 28'·10N., 54° 29'·26E.
<i>*Fl.G.4s</i>	<i>RM-3</i>	Green Pillar	24° 27'·90N., 54° 29'·08E.
<i>Fl.R.4s</i>	<i>RM-4</i>	Red Pillar	24° 27'·87N., 54° 29'·15E.
<i>Fl.R.4s</i>	<i>RM-4A</i>	Red Pillar	24° 27'·64N., 54° 28'·98E.
<i>Fl.G.4s</i>	<i>RM-5</i>	Green Pillar	24° 27'·48N., 54° 28'·80E.
<i>Fl.R.4s</i>	<i>RM-6</i>	Red Pillar	24° 27'·46N., 54° 28'·86E.
<i>Fl.G.4s</i>	<i>RM-7</i>	Green Pillar	24° 27'·15N., 54° 28'·67E.
<i>Fl.R.4s</i>	<i>RM-8</i>	Red Pillar	24° 27'·15N., 54° 28'·72E.
<i>Fl.G.4s</i>	<i>RM-9</i>	Green Pillar	24° 26'·93N., 54° 28'·55E.
<i>Fl.R.4s</i>	<i>RM-10</i>	Red Pillar	24° 26'·90N., 54° 28'·60E.
<i>Fl.G.4s</i>	<i>RM-11</i>	Green Pillar	24° 26'·57N., 54° 28'·43E.
<i>Fl.R.4s</i>	<i>RM-12</i>	Red Pillar	24° 26'·55N., 54° 28'·48E.
<i>Fl.G.4s</i>	<i>RM-13</i>	Green Pillar	24° 26'·17N., 54° 28'·51E.
<i>Fl.R.4s</i>	<i>RM-14</i>	Red Pillar	24° 26'·17N., 54° 28'·56E.
<i>Fl.G.4s</i>	<i>RM-15</i>	Green Pillar	24° 25'·71N., 54° 28'·86E.
<i>Fl.R.4s</i>	<i>RM-16</i>	Red Pillar	24° 25'·73N., 54° 28'·99E.

5. The following lateral buoys have been removed:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.G.3s</i>	<i>YM-3</i>	Green Conical	24° 28'·25N., 54° 29'·27E.
<i>Fl.R.3s</i>	<i>YM-4</i>	Red Can	24° 28'·24N., 54° 29'·33E.
<i>Fl.G.3s</i>	<i>W4</i>	Green Conical	24° 27'·87N., 54° 29'·08E.
<i>Fl.R.3s</i>	<i>SM-18</i>	Red Can	24° 27'·88N., 54° 29'·15E.
<i>Fl.G.3s</i>	<i>W6</i>	Green Conical	24° 27'·24N., 54° 28'·75E.
<i>Fl.R.3s</i>	<i>SM-20</i>	Red Can	24° 27'·22N., 54° 28'·80E.
<i>Fl.R.3s</i>	<i>W7</i>	Red Can	24° 26'·62N., 54° 28'·49E.
<i>Fl.G</i>	<i>W8</i>	Green Conical	24° 26'·61N., 54° 28'·44E.
<i>Fl.R.3s</i>	<i>W9</i>	Red Can	24° 26'·01N., 54° 28'·70E.
<i>Fl.G.3s</i>	<i>W10</i>	Green Conical	24° 25'·99N., 54° 28'·66E.
<i>Fl.R.3s</i>	<i>W11</i>	Red Can	24° 25'·90N., 54° 28'·91E.
<i>Fl.G.3s</i>	<i>W12</i>	Green Conical	24° 25'·86N., 54° 28'·90E.
<i>Fl.R.3s</i>	<i>W13</i>	Red Can	24° 25'·85N., 54° 29'·47E.
<i>Fl.G.3s</i>	<i>W14</i>	Green Conical	24° 25'·80N., 54° 29'·47E.

6. The overhead power cable, with vertical clearance of 60m, in position 24° 26'·56N., 54° 28'·45E. and associated pylons have been removed.

7. Mariners are advised to navigate with caution in the area.

8. Charts will be updated when full details are available.

9. *Former Notice 3603(P)/25 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 3713 — 3715

5049(P)/25 UNITED ARAB EMIRATES - Restricted area. Buoyage.

Source: Dubai Maritime Authority

1. *A restricted area, entry prohibited, marked by special light-buoys, *Fl.Y*, has been established bounded by the following positions:

25° 11'·53N., 55° 12'·90E.
25° 11'·75N., 55° 11'·80E.
25° 11'·19N., 55° 11'·36E.
25° 10'·15N., 55° 11'·56E.
25° 10'·06N., 55° 11'·88E.
25° 10'·32N., 55° 12'·59E.
25° 10'·60N., 55° 12'·91E.

2. Mariners are advised to navigate with caution in the area.

5049(P)/25 UNITED ARAB EMIRATES - Restricted area. Buoyage. (continued)

3. *Former Notice 4243(P)/25 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 3176 — 3412

5224(T)/25 UNITED ARAB EMIRATES - Buoyage.

Source: MENAS Notice 271/25

1. Lit yellow special buoys have been established in the following positions:

<i>Designation</i>	<i>Position</i>
*UID01	25° 19'·91N., 54° 49'·78E.
*UID02	25° 25'·75N., 54° 52'·53E.
*UID03	25° 22'·64N., 54° 48'·64E.
*UID04	25° 25'·98N., 54° 48'·35E.

2. Mariners are advised to navigate with caution and requested to keep clear of the marked area.
 3. *Former Notice 3225(T)/25 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 2887 — 2888 — 2889 — 3175 — 3176

5363(T)/25 QATAR - Restricted area.

Source: QatarEnergy

1. An entry prohibited area has been established, radius 500m (0·27M), centred on:
 25° 41'·82N., 52° 12'·78E.
 2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — 3950

5450(P)/25 UNITED ARAB EMIRATES - Reclamation areas. Buoyage. Breakwater. Dredging areas. Works.

Source: Abu Dhabi Maritime

1. Dredging and reclamation works are in progress in an area bounded by the following positions:
 24° 51'·08N., 54° 29'·01E.
 24° 44'·16N., 54° 36'·97E.
 24° 39'·13N., 54° 31'·73E.
 24° 46'·03N., 54° 23'·77E.
 2. A special purpose light-buoy, *Fl.Y*, marks each corner of the area. Additional unlit yellow buoys have been placed 500m apart to mark the area.
 3. *Dredging and reclamation works are in progress marked by special purpose light-buoys, *Fl.Y*, in the vicinity of Nurai Island 24° 38'·60N., 54° 28'·24E.
 4. An offshore breakwater marked by special purpose light-buoys, *Fl.Y*, is under construction between the following positions:
 24° 38'·40N., 54° 27'·00E.
 24° 39'·45N., 54° 28'·60E.
 5. Entry into these areas is restricted, and mariners are advised to contact the local authorities before entering.
 6. *Former Notice 4322(P)/23 is cancelled.
 *Indicates new or revised entry.
 (WGS84 DATUM)

Charts affected — 3176 — 3177 — 3752

5592(T)/25 UNITED ARAB EMIRATES - Dredging area. Works. Buoyage.

Source: Abu Dhabi Ports

1. Marine construction and dredging works are taking place at Khalifa Port, in the area bounded by the following positions:

24° 49'·46N., 54° 37'·62E.
 24° 50'·69N., 54° 39'·27E.
 24° 51'·02N., 54° 39'·00E.
 24° 51'·15N., 54° 39'·19E.
 24° 50'·71N., 54° 39'·57E.
 24° 50'·37N., 54° 39'·48E.
 24° 49'·91N., 54° 38'·87E.
 24° 49'·35N., 54° 39'·38E.
 24° 48'·60N., 54° 38'·39E.

2. Two yellow light-buoys, *Fl.Y.10s*, marking the western boundary, have been deployed in the following positions:

24° 49'·20N., 54° 37'·87E.
 24° 48'·98N., 54° 38'·05E.

3. Entry into this area is prohibited until further notice.

4. A silt curtain has been deployed in the vicinity of:

24° 51'·15N., 54° 39'·61E.

5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Charts affected — 3176 — 3177 — 3752**5657(T)/25 SAUDI ARABIA - Red Sea Coast - Buoyage.**

Source: NAVAREA IX Warning 440/25

1. The following light-buoys are reported missing:

<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
No 7	Green Pillar Buoy	23° 55'·08N., 38° 09'·19E.
* <i>W</i>	Isolated Danger Buoy	23° 55'·01N., 38° 12'·53E.
No 8R	Yellow Pillar Buoy	23° 54'·07N., 38° 17'·19E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

3. *Former Notice 3271(T)/25 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 326 — 327 — 328**5813(P)/25 EGYPT - Red Sea Coast - Spoil ground. Depths. Buoyage. Channel. Breakwaters. Dredged areas. Works. Reclamation area. Light.**

Source: ENC EG5EGR12 and EG3GOS01

1. Significant changes to charted detail have taken place in the approaches to and within the North port of Ain Sukhna. The most significant of these are as follows:

2. The existing spoil ground has been extended, joining the following positions

29° 38'·76N., 32° 26'·06E.
 29° 38'·76N., 32° 27'·50E.
 29° 37'·76N., 32° 27'·50E.
 29° 37'·76N., 32° 26'·06E.

3. Depths less than charted exist within the spoil ground. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
27·3m	29° 38'·09N., 32° 26'·15E.
*31m	29° 38'·71N., 32° 26'·97E.
*31m	29° 37'·97N., 32° 27'·16E.

4. The East cardinal buoy in position 29° 38'·89N., 32° 24'·51E. has been amended to *Q(3)10s*.

5. Reclamation has taken place on the approach to the port resulting in significant changes to the coastline North and South of the approach channel.

5813(P)/25 EGYPT - Red Sea Coast - Spoil ground. Depths. Buoyage. Channel. Breakwaters. Dredged areas. Works. Reclamation area. Light. (continued)

6. The North breakwater has been extended to position 29° 39'·02N., 32° 22'·58E.
 7. The South breakwater has been extended to position 29° 38'·63N., 32° 22'·56E.
 8. *The following lights have been moved:

<i>Characteristic</i>	<i>Former Position</i>	<i>New Position</i>
<i>Fl.G.6M</i>	29° 39'·02N., 32° 22'·21E.	29° 39'·02N., 32° 22'·58E.
<i>Fl.R.6M</i>	29° 38'·63N., 32° 22'·31E.	29° 38'·63N., 32° 22'·56E.

9. *A cargo transshipment area has been established within an area bounded by the following positions:

29° 43'·70N., 32° 28'·27E.
 29° 43'·70N., 32° 25'·79E.
 29° 41'·30N., 32° 25'·79E.
 29° 41'·30N., 32° 28'·27E.

10. Two new outer breakwaters have been established in the following positions:

<i>Designation</i>	<i>Position</i>
North Outer breakwater	29° 39'·93N., 32° 21'·64E. 29° 39'·93N., 32° 22'·32E.

and

<i>Designation</i>	<i>Position</i>
South Outer breakwater	29° 37'·55N., 32° 21'·74E. 29° 37'·63N., 32° 22'·50E.

11. Buoys have been removed as follows:

<i>Characteristic</i>	<i>Buoy Type</i>	<i>Position</i>
<i>VQ</i>	North Cardinal	29° 38'·73N., 32° 21'·06E.
<i>VQ</i>	North Cardinal	29° 38'·73N., 32° 20'·91E.
<i>VQ</i>	North Cardinal	29° 38'·74N., 32° 20'·77E.
<i>VQ</i>	North Cardinal	29° 38'·73N., 32° 20'·64E.
<i>VQ</i>	North Cardinal	29° 38'·73N., 32° 20'·49E.
<i>Fl(2)R.5s</i>	Spar	29° 38'·73N., 32° 20'·35E.

12. *A new North Ain Sukhna container terminal has been established dredged to 18m with turning circle, the new terminal is bounded by the following positions:

29° 38'·88N., 32° 21'·15E.
 29° 38'·88N., 32° 20'·28E.
 29° 39'·66N., 32° 19'·76E.
 29° 39'·57N., 32° 19'·58E.
 29° 39'·13N., 32° 19'·87E.
 29° 38'·87N., 32° 19'·57E.
 29° 38'·87N., 32° 19'·13E.
 29° 38'·67N., 32° 19'·13E.
 29° 38'·69N., 32° 21'·15E.

13. The front leading light, in position 29° 38'·82N., 32° 19'·54E. has been moved to the following position, 29° 38'·82N., 32° 19'·01E. The leading lines and bearings remain unchanged.
 14. *Excavation works are taking place to establish a further new container terminal in the vicinity of position 29° 38'·35N., 32° 21'·24E.
 15. *Chart 2132 panel A will be withdrawn in early 2026.
 16. *These changes will be included in the next New Edition of Chart 2133 to be published early 2026.
 17. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
 18. *Former Notice 1511(P)/25 is cancelled.
 *Indicates new or revised entry.
 (WGS84 DATUM)

Charts affected — 2132 — 2133

(12) INDIAN OCEAN, PAKISTAN, INDIA, SRI LANKA, BANGLADESH AND BURMA

5395(T)/17 PAKISTAN - Wreck.

Source: Pakistani Notice 37/140(T)/17

1. A wreck is reported to exist in the following approximate position: 24° 09'·7N., 67° 06'·7E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 39 — 707 — 4705**2951(T)/18 BANGLADESH - Obstruction.**

Source: Bangladeshi Hydrographic and Oceanographic Centre Notice 8(T)/18

1. It is reported that an underwater obstruction exists in the vicinity of position 21° 35'·6N., 91° 49'·4E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 90**2078(P)/19 INDIA - East Coast - Works.**

Source: Indian Notice 9/90(P)/18

1. Construction works are taking place within an area bounded by the following positions:
17° 42'·53N., 83° 15'·85E.
17° 42'·57N., 83° 15'·77E.
17° 42'·71N., 83° 15'·89E.
17° 42'·65N., 83° 15'·98E.
2. Mariners are advised to navigate with caution in the area and to contact the local port authority for further information.
3. Former Notice 2555(T)/18 is cancelled.
4. NOTE: Content of Notice unchanged, re-issued to include Chart IN3012.
(WGS84 DATUM)

Chart affected — IN 3012**2106(P)/19 INDIA - West Coast - Works. Buoyage.**

Source: Indian Notice 6/76(P)/19

1. Construction works are taking place, in an area bounded by the following positions:
18° 59'·85N., 72° 56'·90E.
18° 59'·60N., 72° 58'·90E.
18° 58'·30N., 73° 00'·70E.
18° 58'·00N., 73° 00'·30E.
18° 58'·00N., 72° 58'·80E.
18° 59'·20N., 72° 56'·90E.
2. *Numerous buoys have been established marking the construction.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. *Charts will be updated when full details are available.
5. Former Notice 1541(T)/19 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — IN 211 — IN 255 — IN 292 — IN 293 — IN 2016 — IN 2076

2869(P)/19 INDIA - West Coast - Works.

Source: Indian Notice 9/120(P)/19

1. Construction works are taking place, in an area bounded by the following positions:

22° 27'·500N., 69° 05'·440E.

22° 27'·320N., 69° 05'·460E.

22° 26'·820N., 69° 05'·590E.

22° 26'·960N., 69° 05'·590E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — IN 203 — IN 2013 — IN 2031**3861(T)/19 BURMA - Buoy.**

Source: Myanmar Navy Notice 29/19

1. The isolated danger light-buoy, *Fl(2)5s Asian Liberty*, in position 16° 40'·15N., 96° 14'·42E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 833**4267(T)/19 BURMA - Buoy.**

Source: Myanmar Navy Notice 31/19

1. The red lateral buoy, in position 20° 06'·22N., 92° 54'·33E. is reported missing.
(WGS84 DATUM)

Chart affected — 1885**4326(P)/19 INDIA - West Coast - Works.**

Source: Indian Notice 14/180(P)/19

1. The construction of an LNG terminal is in progress within an area bounded by the following positions:

20° 52'·75N., 71° 27'·58E.

20° 52'·96N., 71° 27'·71E.

20° 53'·59N., 71° 28'·70E.

20° 53'·40N., 71° 29'·93E.

20° 52'·73N., 71° 29'·82E.

20° 52'·84N., 71° 29'·08E.

20° 52'·43N., 71° 28'·26E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 1488 — IN 207 — IN 253 — IN 254 — IN 292**5223(T)/19 BANGLADESH - Obstruction.**

Source: BNHOC Notice 33(T)/19

1. An obstruction, depth 2·9m, has been reported in position 21° 43'·0N., 91° 51'·3E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 90

5363(T)/19 BURMA - Works.

Source: Myanmar Navy Notice 36/19

1. Drilling operations will be taking place, until April 2020, bounded by the following positions:

14° 27'·3N., 94° 49'·0E.
 14° 27'·4N., 95° 16'·3E.
 14° 19'·7N., 95° 16'·4E.
 14° 19'·7N., 95° 29'·8E.
 14° 00'·0N., 95° 29'·8E.
 14° 00'·0N., 94° 49'·0E.

2. During the operation, anchoring, fishing and trawling are prohibited within 4km of the drilling area.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 830**5373(T)/19 INDIAN OCEAN - Comores - Volcanic activity.**

Source: SHOM

1. Volcanic activity has been reported in the vicinity of position 12° 54'·0S., 45° 43'·0E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3877 — 3895 — 4701 — 4702**2164(P)/20 INDIAN OCEAN - Chagos - Rocks. Obstructions.**

Source: UKHO

1. Recent satellite imagery has shown numerous uncharted dangers, including underwater rocks and coral heads, at Peros Banhos. The most significant dangers exist in the vicinity of the following positions:

5° 15'·51S., 71° 49'·74E.
 5° 15'·57S., 71° 49'·35E.
 5° 17'·63S., 71° 48'·96E.
 5° 22'·20S., 71° 47'·77E.
 5° 22'·29S., 71° 46'·22E.
 5° 22'·70S., 71° 48'·86E.
 5° 23'·07S., 71° 47'·06E.
 5° 23'·19S., 71° 47'·54E.
 5° 24'·59S., 71° 47'·18E.
 5° 24'·80S., 71° 47'·56E.
 5° 25'·40S., 71° 47'·57E.
 5° 25'·46S., 71° 47'·84E.
 5° 25'·59S., 71° 47'·45E.
 5° 26'·63S., 71° 45'·72E.
 5° 26'·67S., 71° 46'·78E.
 5° 26'·80S., 71° 47'·17E.
 5° 27'·10S., 71° 47'·95E.
 5° 27'·46S., 71° 47'·92E.
 5° 27'·59S., 71° 48'·12E.

2. Mariners are advised to navigate with extreme caution in the area.
3. These changes will be included in the next New Editions of Charts 725 and 727.
(WGS84 DATUM)

Charts affected — 725 — 727**3175(T)/20 BURMA - Wreck.**

Source: Myanmar Navy Notice 18/20

1. A dangerous wreck has been reported in position 16° 22'·00N., 96° 21'·00E.

3175(T)/20 BURMA - Wreck. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 823 — 826 — 833

3503(T)/20 PAKISTAN - Quarantine anchorage.

Source: Pakistani Notice 22/88(T)/20

- A quarantine anchorage area has been established in the approaches to Karachi Port, bounded by the following positions:

24° 42'·2N., 66° 52'·6E.

24° 42'·2N., 66° 53'·8E.

24° 41'·0N., 66° 53'·9E.

24° 41'·0N., 66° 52'·6E.

- Mariners are advised to navigate with caution in the area and consult Karachi port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 39 — 58

4378(P)/20 INDIAN OCEAN - Nicobar Islands - Depths. Obstructions. Lights.

Source: Indian Chart 472

- Depths less than charted exist within The Nicobar Islands. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
16·4m	7° 49'·2N., 93° 29'·4E.
17·1m	7° 42'·9N., 93° 26'·4E.
12·8m	6° 59'·4N., 93° 32'·9E.

- Obstructions exist in the following positions:

7° 59'·1N., 93° 05'·0E.

7° 52'·0N., 93° 12'·0E.

- The following lights have amended characteristics as follows:

<i>Characteristic</i>	<i>Position</i>
Fl(2)16M	8° 13'·4N., 93° 14'·7E.
Fl(2)10M	7° 55'·8N., 93° 34'·6E.
Fl(3)20M	7° 17'·3N., 93° 50'·7E.

- Mariners are advised to navigate with caution in the area.
- Chart IN33 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — IN 33

6303(P)/20 BURMA - Submarine cable. Works.

Source: Myanmar Navy Notice 42/20

1. Submarine cable laying operations are taking place, within areas bounded by the following positions:

16° 31'·9N., 96° 20'·0E.
16° 30'·1N., 96° 20'·3E.
16° 28'·2N., 96° 22'·3E.
16° 25'·7N., 96° 23'·2E.
16° 22'·2N., 96° 22'·2E.
16° 20'·2N., 96° 23'·1E.
16° 19'·9N., 96° 29'·3E.
16° 16'·8N., 96° 37'·4E.
15° 53'·6N., 96° 36'·9E.
15° 52'·1N., 96° 36'·6E.
15° 51'·7N., 96° 38'·7E.
15° 53'·4N., 96° 39'·1E.
16° 18'·3N., 96° 39'·7E.
16° 22'·1N., 96° 29'·6E.
16° 22'·3N., 96° 24'·6E.
16° 25'·8N., 96° 25'·6E.
16° 29'·3N., 96° 24'·2E.
16° 31'·5N., 96° 22'·2E.
and
15° 51'·7N., 96° 38'·7E.
15° 52'·1N., 96° 36'·6E.
14° 48'·5N., 96° 22'·3E.
14° 10'·6N., 96° 19'·9E.

- 2.

14° 06'·6N., 96° 20'·7E.
14° 04'·8N., 96° 19'·6E.
13° 45'·3N., 96° 18'·3E.
13° 42'·7N., 96° 17'·4E.
13° 30'·4N., 96° 09'·5E.
13° 21'·5N., 96° 05'·1E.
13° 13'·5N., 96° 01'·2E.
13° 04'·3N., 96° 02'·6E.
12° 41'·6N., 96° 01'·8E.
12° 20'·7N., 95° 59'·6E.
11° 59'·5N., 96° 00'·8E.
11° 07'·8N., 95° 49'·9E.
10° 20'·0N., 95° 42'·2E.
9° 38'·8N., 95° 40'·6E.
9° 38'·9N., 95° 42'·9E.
10° 20'·9N., 95° 44'·4E.
11° 07'·1N., 95° 52'·0E.
11° 59'·2N., 96° 03'·0E.
12° 20'·9N., 96° 01'·8E.
12° 41'·4N., 96° 04'·1E.
13° 04'·4N., 96° 04'·8E.
13° 13'·1N., 96° 03'·6E.
13° 20'·6N., 96° 07'·6E.
13° 29'·7N., 96° 11'·9E.

- 3.

13° 41'·1N., 96° 19'·0E.
13° 45'·0N., 96° 20'·5E.
14° 04'·3N., 96° 21'·9E.
14° 06'·8N., 96° 23'·7E.
14° 10'·5N., 96° 22'·5E.
14° 48'·7N., 96° 25'·0E.

4. Mariners are advised to navigate with caution in the area.

6303(P)/20 BURMA - Submarine cable. Works. (continued)

5. Charts 823, 826, 830 and 833 will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 823 — 826 — 830 — 833

1276(T)/21 PAKISTAN - Wrecks.

Source: Pakistani Notice 1/4(T)/21

1. Wrecks exist in the following positions:

24° 31'·00N., 66° 57'·00E.
*24° 49'·00N., 66° 36'·00E.
*24° 42'·00N., 66° 41'·00E.

2. Mariners are advised to navigate with caution in the area.
3. Former Notice 5447(T)/20 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 39 — 58

2269(P)/21 INDIA - East Coast - Buoy.

Source: Indian Notice 5/85(P)/21

1. Installation of an STP Buoy is taking place in position 16° 33'·1N., 82° 35'·7E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — IN 31 — IN 32

2620(T)/21 SRI LANKA - West Coast - Wreck.

Source: Sri Lanka Navy Hydrographic Service NM 02/21

1. A stranded wreck exists in position 7° 04'·9N., 79° 46'·7E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 813

3518(P)/21 INDIA - East Coast - Works.

Source: Indian Notice 8/103(P)/21

1. Construction works are in progress within the Udangudi Port limit, bounded by the following positions:

8° 26'·08N., 78° 04'·62E.
8° 22'·52N., 78° 08'·99E.
8° 23'·45N., 78° 09'·53E.
8° 26'·32N., 78° 04'·84E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — IN 32 — IN 223 — IN 262

237(T)/22 BANGLADESH - Wreck.

Source: BNHOC Notice 50(T)/21

1. A dangerous wreck exists in position 21° 32'·9N., 90° 10'·5E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — IN 31

1487(T)/22 BANGLADESH - Depths.

Source: BNHOC Notice 3(T)/22

1. Numerous depth differences (with a few areas less than 2m) exist within the following bounded area.

21° 21'·9N., 90° 27'·7E.

21° 54'·3N., 90° 27'·7E.

21° 54'·3N., 91° 10'·3E.

21° 21'·9N., 91° 00'·4E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — IN 31**1755(T)/22 BANGLADESH - Wreck. Buoyage.**

Source: BNHOC Notice No 4(T)/22

1. A dangerous wreck marked by buoyage, exists in position 21° 46'·0N., 91° 23'·6E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — IN 31**2159(T)/22 BANGLADESH - Wreck. Buoy.**

Source: BNHOC Notice 19(T)/22

1. A dangerous wreck, marked by a red can buoy, *Lfl.R.6s*, exists in position 22° 11'·94N., 91° 43'·12E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — 102 — 1016**2248(T)/22 BANGLADESH - Wreck. Buoy.**

Source: UKHO

1. A dangerous wreck exists in position 22° 13'·77N., 91° 46'·85E.
2. A red can light-buoy, *Lfl.6s*, has been deployed within the vicinity of the wreck.
3. Mariners are advised to navigate with caution in this area.
(WGS84 DATUM)

Charts affected — 102 — 1016**2266(T)/22 BANGLADESH - Wreck. Buoy.**

Source: UKHO

1. A dangerous wreck exists in position 22° 19'·19N., 91° 49'·50E.
2. A red can light buoy, *Lfl.6s*, has been deployed within the vicinity of the wreck.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

NOTE: Content of Notice unchanged, re-issued to include Chart 102.

Chart affected — 102**2280(T)/22 BANGLADESH - Wreck.**

Source: UKHO

1. A dangerous wreck exists in position 22° 07'·84N., 91° 47'·60E.
2. Mariners are advised to navigate with caution in the area.
3. Former Notice 854(T)/22 is cancelled
4. NOTE: Content of Notice unchanged, re-issued to include Charts 102 & 1016.
(WGS84 DATUM)

Charts affected — 90 — 102 — 1016

3056(T)/22 BANGLADESH - Wreck.

Source: BNHOC Notice 17(T)/22

1. A dangerous wreck exists in position 22° 10'·5N., 91° 23'·7E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — IN 31**3632(T)/22 INDIA - West Coast - Buoyage.**

Source: LNG DISHA

1. The white special purpose buoy, in position 21° 39'·50N., 72° 29'·67E. is reported missing.
2. A yellow special purpose light-buoy, *Fl. Y.5s*, has been observed, in position 21° 39'·50N., 72° 30'·72E..
(WGS84 DATUM)

Charts affected — IN 2039 — IN 2082 — IN 2110**4276(T)/22 BANGLADESH - Wreck.**

Source: BNHOC Notice 35(T)/22

1. A dangerous wreck exists in position 22° 15'·60N., 91° 45'·04E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 102 — 1016**4716(P)/22 BURMA - Wells. Submarine pipeline.**

Source: Myanmar Navy Notice 24/2022

1. Wells exist in the following positions:

19° 51'·2N., 92° 24'·6E.
19° 48'·8N., 92° 26'·7E.
19° 48'·0N., 92° 27'·8E.
19° 41'·7N., 92° 32'·5E.

2. A submarine pipeline has been laid joining the following positions:

19° 40'·5N., 92° 32'·6E.
19° 41'·4N., 92° 33'·1E.
19° 47'·7N., 92° 28'·6E.
19° 48'·0N., 92° 27'·8E.
19° 48'·8N., 92° 26'·7E.
19° 51'·2N., 92° 24'·6E.

3. Mariners are warned not to approach within a 9260m (5M) radius of the wells.
4. Mariners are advised to navigate with caution in the area.
5. Charts will be updated when works are complete.
6. Former Notice 1216(T)/22 is cancelled.
(WGS84 DATUM)

Charts affected — 817 — IN 31**393(T)/23 BANGLADESH - Obstruction.**

Source: BNHOC Notice 40(T)/22

1. An obstruction exists in position 21° 10'·0N., 92° 00'·9E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — 817

1526(T)/23 BANGLADESH - Works. Dredging area.

Source: BNHOC Notice 33(T)/22

1. *Dredging works are taking place in the Rabnabad Channel and approaches, between positions 21° 21'·9N., 90° 06'·0E. and 21° 59'·7N., 90° 19'·2E.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 4221(T)/20 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 90 — IN 31**1578(T)/23 BANGLADESH - Wreck.**

Source: BNHOC Notice 4(T)/23

1. A dangerous wreck exists in position 22° 09'·10N., 91° 48'·65E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — 102 — 1016**2391(T)/23 BANGLADESH - Wreck. Buoy.**

Source: BNHOC Notice 12(T)/2023

1. A dangerous wreck exists in position 22° 15'·32N., 91° 43'·93E.
2. A cylindrical light buoy, *LFL.R.6s*, has been deployed within the vicinity of the wreck.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — 102 — 1016**3006(P)/23 SRI LANKA - South Coast - Submarine cable.**

Source: Sri Lankan Notice T3/23

1. A submarine cable is being laid between *Matara Bay (Sri Lanka) and *Satun, (Thailand)*, joining the following positions:
5° 56'·34N., 80° 33'·99E.
5° 55'·34N., 80° 33'·67E.
5° 54'·49N., 80° 33'·49E.
5° 53'·51N., 80° 33'·61E.
5° 52'·44N., 80° 34'·17E.
5° 51'·07N., 80° 34'·79E.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 3265**3078(T)/23 INDIA - West Coast - Fairway. Buoy.**

Source: Indian Notice 24/217(T)/22

1. The Fairway light-buoy, *Fl(3)10s5M*, in position 18° 17'·40N., 72° 49'·25E. is reported off station.
(WGS84 DATUM)

Charts affected — IN 211 — IN 212 — IN 255 — IN 256 — IN 2036

3080(P)/23 INDIA - West Coast - Pier. Works.

Source: Indian Notice 24/220(P)/22

1. Pier construction works are taking place, in an area bounded by the following positions:

21° 41'·85N., 72° 30'·43E.

21° 41'·86N., 72° 30'·55E.

21° 41'·79N., 72° 30'·55E.

21° 41'·79N., 72° 30'·60E.

21° 41'·46N., 72° 30'·73E.

21° 41'·39N., 72° 30'·73E.

21° 41'·39N., 72° 30'·63E.

21° 41'·46N., 72° 30'·63E.

21° 41'·59N., 72° 30'·57E.

21° 41'·58N., 72° 30'·43E.

2. Mariners are advised to navigate with caution in the area and contact the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — IN 2082 — IN 2110**3270(T)/23 BANGLADESH - Wreck.**

Source: BHNOB Notice 1(T)/23

1. A dangerous wreck, *PA*, has been reported in position 21° 11'·0N., 89° 59'·0E.
(WGS84 DATUM)

Chart affected — 90**3437(T)/23 INDIA - West Coast - Wreck.**

Source: Indian Nav Warning 750/23

1. A dangerous wreck has been reported in position 22° 37'·70N., 68° 58'·90E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 39 — IN 202 — IN 203 — IN 251 — IN 2068**3827(T)/23 INDIAN OCEAN - Buoy.**

Source: Australian Notice 20/867(T)/23

1. The special light buoy, *Fl.Y.2s*, in position 12° 19'·2S., 108° 30'·8E., is off station.
(WGS84 DATUM)

Charts affected — 4708 — 4723**3835(T)/23 BANGLADESH - Wreck.**

Source: BNHOC Notice 07(T)/2023

1. A stranded wreck exists in position 22° 18'·26N., 91° 30'·32E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — 1016**4179(P)/23 INDIA - West Coast - Works. Maritime limit. Buoyage. Mooring buoys. Wreck. Depths.**

Source: ENC IN62031A, ENC IN62025A and ENC IN62033B

1. Construction and pipe laying works are in progress, by crane vessel *Sapura 2000*, in an area bounded by the following positions:
22° 30'·44N., 69° 50'·08E.
22° 29'·27N., 69° 51'·53E.
22° 28'·90N., 69° 51'·19E.
22° 30'·07N., 69° 49'·74E.

**4179(P)/23 INDIA - West Coast - Works. Maritime limit. Buoyage. Mooring buoys. Wreck. Depths.
(continued)**

- A turning circle, radius 200m, has been established, centred on position 22° 29'·587N., 69° 50'·855E.
- The following light-buoys have been established:

Light Characteristic	Designation	Buoy Type	Position
<i>Q</i>	<i>NCM</i>	North Cardinal	22° 29'·528N., 69° 50'·964E.
<i>Q(9)15s</i>	<i>WCM</i>	West Cardinal	22° 29'·649N., 69° 50'·950E.
<i>Q(6)+LFl.15s</i>	<i>SCM</i>	South Cardinal	22° 29'·686N., 69° 50'·840E.

- The West cardinal buoy, *Q(9)15s*, in position 22° 29'·633N., 69° 50'·843E., has been removed.
- Changes to mooring buoys have taken place within Sikka Creek.
- A wreck, depth 0·9m, exists within position 22° 30'·203N., 69° 50'·454E.
- Depths less than charted exist within Sikka Creek. The most significant are as follows:

Depth	Position
2·7m	22° 27'·377N., 69° 47'·575E.
7·8m	22° 30'·017N., 69° 49'·896E.
9·3m	22° 29'·656N., 69° 50'·565E.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
- Former Notice 3115(P)/19 is cancelled.
(WGS84 DATUM)

Charts affected — IN 203 — IN 2033 — IN 2083**4523(T)/23 INDIA - East Coast - Buoyage.**

Source: Indian Notice 5/59(T)/23

- The following light-buoys are reported missing:

Designation	Characteristic	Position
<i>No1</i>	<i>Fl.G.3s</i>	20° 12'·82N., 86° 46'·32E.
<i>No2</i>	<i>Fl.R.3s</i>	20° 12'·58N., 86° 46'·17E.

- Mariners are advised to navigate with caution in the area.
- Former Notice 225(T)/23 is cancelled.
(WGS84 DATUM)

Charts affected — IN 3010 — IN 3041**4627(T)/23 INDIA - West Coast - Wreck.**

Source: Indian Nav Warning 484/23

- A wreck is reported to exist in approximate position 15° 29'·08N., 73° 48'·30E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — IN 2022**4644(T)/23 INDIA - West Coast - Buoy.**

Source: Indian Notice 14/131(T)/23

- The port-hand lateral buoy, *Fl(3)R.15s No 2*, in position 14° 44'·40N., 74° 07'·41E. is reported off station.
(WGS84 DATUM)

Chart affected — IN 2008**4647(T)/23 INDIA - West Coast - Buoy.**

Source: Indian Notice 14/135(T)/23

- The port-hand lateral buoy, *Fl.R.5s*, in position 14° 48'·76N., 74° 05'·67E., is reported off station.
(WGS84 DATUM)

Charts affected — IN 2008 — IN 2120

4665(T)/23 PAKISTAN - Buoy.

Source: Pakistani NavWarning 116/23

1. The wreck marking light-buoy, *Fl. 7.5s*, in position 24° 46'·86N., 66° 56'·04E. is reported unlit.
(WGS84 DATUM)

Charts affected — 40 — 58

4723(T)/23 INDIA - West Coast - Wreck.

Source: Indian Nav Warning 733/23

1. A dangerous wreck has been reported to exist in approximate position 18° 14'·66N., 72° 53'·16E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — IN 211 — IN 212 — IN 256 — IN 292 — IN 293 — IN 2036

4968(T)/23 PAKISTAN - Wreck.

Source: Pakistani Nav Warning 293/23

1. A dangerous wreck has been reported to exist in approximate position 25° 10'·0N., 65° 04'·0E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 38 — 707

39(T)/24 INDIA - West Coast - Wreck.

Source: Indian Nav Warning 1057/23

1. A dangerous wreck is reported to exist in approximate position 18° 49'·73N., 72° 42'·50E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — IN 22 — IN 211 — IN 255 — IN 292 — IN 293 — IN 2016

1453(T)/24 BANGLADESH - Wreck.

Source: BNHOC Notice 25(T)/2023

1. A dangerous wreck exists in position 22° 09'·2N., 91° 27'·8E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 90

1618(T)/24 INDIAN OCEAN - La Réunion - Mooring. Buoy.

Source: French Notice 1/16(T)/24

1. A lit wave buoy, *Fl(5)Y.20s*, has been deployed, until further notice, in position 20° 52'·41S., 55° 31'·91E.
2. The associated mooring will remain in place until 31st December 2027.
(WGS84 DATUM)

Charts affected — 1495 — 1497

2133(P)/24 INDIA - West Coast - Works. Buoy.

Source: Indian Notice 23/185(P)/23

1. Works to widen the entrance to Tuticorin Harbour are taking place in the vicinity of 8° 44'·88N., 78° 13'·52E.
2. *Berth extension works are taking place in the vicinity of position 8° 45'·21N., 78° 12'·60E.
3. *A port lateral buoy, *Fl.R.3s*, has been established in position 8° 44'·88N., 78° 13'·55E.
4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

2133(P)/24 INDIA - West Coast - Works. Buoy. (continued)

5. *Former Notice 4645(P)/23 is cancelled.
 *Indicated new or revised entry
 (WGS84 DATUM)

Chart affected — IN 2075

2184(T)/24 INDIA - East Coast - Moorings.

Source: Indian Notice 2/39(T)/24

1. Underwater Acoustic Doppler Current Profiler (ADCP) moorings are deployed in the following positions:

<i>ADCP Mooring</i>	<i>Position</i>	<i>Depth (m)</i>
EQCM2.14	0° 00'·1N., 83° 00'·0E.	399
EQCM3.13	0° 00'·0N., 77° 21'·7E.	383, 888
EQCM4.3	3° 00'·0N., 77° 21'·9E.	381, 811

2. All vessels are to maintain a safe distance from these moorings and exercise caution in the vicinity.
 3. Former Notice 519(T)/22 is cancelled.
 (WGS84 DATUM)

Charts affected — 709 — 4703 — 4706 — 4707

2474(T)/24 BANGLADESH - Wreck.

Source: BNHOC Notice 07(T)/24

1. A dangerous wreck exists in position 21° 46'·5N., 91° 21'·9E.
 2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 90 — IN 31

3526(P)/24 INDIAN OCEAN - Seychelles - Depths.

Source: Fugro

1. Recent survey information has shown that numerous depths less than charted exist between Mamelles Islet and Brisare Rocks. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
18·8m	4° 28'·55S., 55° 31'·98E.
8·5m	4° 29'·07S., 55° 31'·98E.
19·7m	4° 29'·52S., 55° 32'·58E.
7·6m	4° 30'·82S., 55° 29'·63E.
15m	4° 32'·51S., 55° 29'·20E.

2. Mariners are advised to navigate with caution in the area.
 3. Charts will be updated when full details are available.
 (WGS84 DATUM)

Charts affected — 721 — 740 — 742

4004(T)/24 BURMA - Light.

Source: UKHO

1. The light, Fl.15s66m12M, in position 16° 32'·0N., 94° 14'·7E., is reported to be extinguished.
 2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 818 — 823 — 830

4325(T)/24 INDIA - East Coast - Buoyage.

Source: Indian Notice 10/74(T)/24

- Underwater Acoustic Doppler Current Profiler (ADCP) moorings have been deployed in the following positions:

<i>Position</i>	<i>Depth of ADCP (m)</i>
* 12° 01'·21N., 80° 08'·02E.	167
* 12° 01'·85N., 80° 11'·56E.	191, 406, 766
* 14° 29'·95N., 80° 25'·07E.	171, 371
* 16° 01'·51N., 82° 02'·73E.	176, 381
* 16° 10'·75N., 81° 58'·80E.	171
17° 44'·07N., 84° 00'·58E.	168, 377
* 17° 48'·68N., 83° 59'·67E.	96, 174
* 19° 25'·92N., 85° 42'·05E.	166
* 19° 23'·91N., 85° 47'·47E.	177, 381, 685
* 19° 58'·44N., 88° 19'·61E.	163, 367

- All vessels are to maintain a safe distance and exercise caution in the vicinity of the moorings.
- Former Notice 4853(T)/23 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 317 — 318 — 319 — IN 31 — IN 32 — IN 33 — IN 308 — IN 352 — IN 353**4341(T)/24 INDIAN OCEAN - La Réunion - Buoyage.**

Source: French Notice 29/08(T)/24

- Yellow data collection buoys, *Fl(5)20s*, X-Shape topmark, have been established at the following positions:

21° 03'·156S., 55° 13'·194E.
 21° 03'·177S., 55° 13'·213E.
 21° 03'·203S., 55° 13'·239E.
 21° 03'·282S., 55° 13'·201E.

- These buoys will be in place until December 2026.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1495**4488(T)/24 INDIA - East Coast - Works. Buoyage.**

Source: Indian Notice 13/93(T)/24

- Construction works, marked by buoyage, are taking place in an area bounded by the following positions:

13° 15'·61N., 80° 21'·13E.
 13° 15'·61N., 80° 21'·17E.
 13° 15'·50N., 80° 21'·20E.
 13° 15'·39N., 80° 21'·22E.
 13° 15'·30N., 80° 21'·24E.
 13° 15'·24N., 80° 21'·21E.
 13° 15'·19N., 80° 21'·15E.
 13° 15'·24N., 80° 21'·09E.
 13° 15'·31N., 80° 21'·11E.
 13° 15'·38N., 80° 21'·09E.
 13° 15'·45N., 80° 21'·08E.
 13° 15'·50N., 80° 21'·08E.
 13° 15'·60N., 80° 21'·06E.
 13° 15'·61N., 80° 21'·12E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 317 — IN 313 — IN 3001 — IN 3028**4547(P)/24 INDIAN OCEAN - Seychelles - Depths.**

Source: UKHO

4547(P)/24 INDIAN OCEAN - Seychelles - Depths. (continued)

1. Recent survey information has shown that numerous depths less than charted exist within the area of Seychelles Bank, D'Arros, Saint Joseph Islands, Providence, Grand' Anse and in the approaches to Mahé and Praslin. The most significant are as follows:

14·4 m	9° 37'·8S., 51° 01'·5E.
14·9 m	9° 42'·5S., 51° 18'·9E.
14·1 m	5° 21'·48S., 53° 16'·74E.
17·4 m	5° 22'·64S., 53° 17'·26E.
18·5 m	5° 22'·85S., 53° 16'·45E.
17·9 m	5° 23'·40S., 53° 18'·65E.
14·9 m	5° 25'·25S., 53° 16'·47E.
9·8 m	5° 25'·84S., 53° 17'·81E.
4·8 m	5° 26'·09S., 53° 18'·88E.
17·5 m	5° 12'·6S., 55° 26'·1E.
14·3 m	5° 07'·2S., 55° 21'·5E.
22·6 m	4° 50'·8S., 56° 32'·9E.
13·6 m	4° 48'·4S., 56° 34'·5E.
17·0 m	4° 37'·1S., 55° 55'·9E.
16·0 m	4° 36'·2S., 55° 45'·5E.
13·6 m	4° 19'·22S., 55° 40'·65E.
13·6 m	4° 17'·87S., 55° 44'·42E.
10·6 m	4° 17'·9S., 55° 51'·8E.
11·4 m	4° 39'·6S., 54° 07'·9E.
14·1 m	4° 35'·9S., 54° 10'·1E.
14·4 m	4° 28'·9S., 54° 11'·9E.
22·9 m	4° 27'·9S., 54° 17'·2E.
11·7 m	4° 24'·3S., 54° 10'·0E.
18·9 m	4° 21'·9S., 54° 23'·5E.
13·3 m	4° 19'·3S., 54° 16'·3E.
21·5 m	4° 15'·2S., 54° 31'·2E.
10·2 m	4° 06'·6S., 54° 27'·4E.
10·5 m	4° 05'·3S., 54° 31'·6E.
12·9 m	4° 02'·6S., 54° 29'·4E.
12·1 m	3° 56'·4S., 54° 35'·1E.
9·7 m	3° 53'·6S., 54° 40'·3E.
8·4 m	3° 47'·5S., 54° 57'·1E.
12·1 m	9° 57'·9S., 50° 23'·6E.

2. Mariners are advised to navigate with caution in the area
3. These and other changes will be included in the next New Editions of Charts 716, 721, 724 and 740.
(WGS84 DATUM)

Charts affected — 716 — 721 — 740

4830(P)/24 BANGLADESH - Depths. Drying height.

Source: Bangladeshi Chart 3001 and ENC BD407428

1. * Depths and drying heights less than charted exist in the approaches to Chattogram. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
6·4m	22° 13'·09N., 91° 41'·12E.
8·1m	22° 12'·41N., 91° 46'·67E.
5·2m	22° 12'·02N., 91° 47'·69E.
7·8m	22° 10'·22N., 91° 43'·53E.
8m	22° 10'·44N., 91° 46'·60E.
7·4m	22° 08'·36N., 91° 44'·58E.
7·5m	22° 08'·25N., 91° 46'·14E.
* 6·8m	21° 44'·70N., 91° 45'·35E.
* 4·7m	21° 47'·77N., 91° 53'·34E.
* 6·5m	21° 57'·53N., 91° 49'·83E.
* 7·8m	21° 59'·61N., 91° 38'·78E.
* 6·8m	22° 02'·62N., 91° 37'·82E.
* 0·7m	22° 07'·78N., 91° 28'·40E.
* 2·8m	22° 09'·73N., 91° 28'·68E.
* 5·7m	22° 07'·45N., 91° 38'·54E.
* 4·5m	22° 11'·52N., 91° 35'·87E.
* 4·8m	22° 15'·82N., 91° 37'·80E.
* 4·6m	22° 19'·73N., 91° 36'·57E.
* 0·7m	22° 19'·59N., 91° 31'·79E.
* Drying 1·7m	22° 21'·10N., 91° 31'·71E.

2. Mariners are advised to navigate with caution in the area.
 3. *These changes will be included in the next New Edition of Chart 1016.
 4. *Former Notice 1013(P)/24 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 1016**5043(P)/24 INDIA - East Coast - Jetty. Dredged areas. Berth.**

Source: ENC IN63028E and Indian Notice 11/76/24

1. *Significant changes to charted detail have taken place within Kamarajar Port including changes to coastline and dredged areas.
 2. A new LNG jetty has been established, centred on position 13° 16'·518N., 80° 20'·837E.
 3. *The following dredged areas exist within areas bounded by the following positions:

<i>Dredged Area</i>	<i>Positions</i>
16·0m (2020)	13° 16'·063N., 80° 20'·291E. 13° 16'·063N., 80° 20'·296E. 13° 16'·038N., 80° 20'·296E. 13° 16'·038N., 80° 20'·322E. 13° 16'·179N., 80° 20'·674E. 13° 16'·103N., 80° 20'·926E. 13° 16'·296N., 80° 20'·908E. 13° 16'·409N., 80° 20'·909E. 13° 16'·573N., 80° 20'·717E. 13° 16'·505N., 80° 20'·652E. 13° 16'·504N., 80° 20'·455E. 13° 16'·450N., 80° 20'·402E. 13° 16'·419N., 80° 20'·291E.
16·0m (2024)	13° 16'·727N., 80° 20'·487E. 13° 16'·727N., 80° 20'·348E. 13° 16'·506N., 80° 20'·348E. 13° 16'·442N., 80° 20'·302E. 13° 16'·442N., 80° 20'·291E. 13° 16'·419N., 80° 20'·291E. 13° 16'·450N., 80° 20'·402E. 13° 16'·536N., 80° 20'·487E.

5043(P)/24 INDIA - East Coast - Jetty. Dredged areas. Berth. (continued)

15·0m (2020) 13° 16'·409N., 80° 20'·909E.
 13° 16'·429N., 80° 20'·927E.
 13° 16'·593N., 80° 20'·736E.
 13° 16'·573N., 80° 20'·717E.

4. *A new berth, General Cargo Berth-II, has been established between positions 13° 16'·536N., 80° 20'·487E. and 13° 16'·727N., 80° 20'·487E.
5. *The Siot Iron Ore Jetty, centred on position 13° 15'·815N., 80° 20'·395E., now has a dredged depth of 18·0m (2020).
6. *A turning circle, with approximate radius 300m, has been established, centred on position 13° 16'·342N., 80° 20'·672E.
7. Mariners are advised to navigate with caution in the area and contact the local port authority for the latest information.
8. *Charts will be updated when full details are available.
9. *Former Notice 1866(P)/22 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — IN 3001**5319(P)/24 INDIA - West Coast - Jetty. Dredged depths. Berths.**

Source: Indian Hydrographic Office

1. A new liquid cargo jetty has been established, joining the following positions:

18° 56'·61N., 72° 56'·24E.
 18° 56'·60N., 72° 56'·17E.
 18° 56'·52N., 72° 56'·02E.

2. The alongside depths at the new jetty, which are maintained, are as follows:

<i>Position</i>	<i>Designation</i>	<i>Depth</i>
18° 56'·58N., 72° 56'·09E.	Liquid Berth 3	15·2m
18° 56'·55N., 72° 56'·11E.	Liquid Berth 4	12·2m

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. Former Notice 4125(T)/21 is cancelled.
 (WGS84 DATUM)

Charts affected — IN 211 — IN 2016 — IN 2076**5743(P)/24 INDIAN OCEAN - Seychelles - Wrecks. Obstructions. Foul.**

Source: Fugro

1. A recent survey has shown wrecks and obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
7·7m	4° 37'·285S., 55° 27'·608E.
3·3m	4° 37'·767S., 55° 27'·989E.
6·8m	4° 37'·809S., 55° 28'·054E.
2·7m	4° 37'·854S., 55° 28'·157E.
1·3m	4° 37'·925S., 55° 28'·042E.
2·9m	4° 38'·318S., 55° 28'·332E.
8·3m	4° 38'·308S., 55° 28'·953E.
9·2m	4° 39'·153S., 55° 29'·384E.
7·1m	4° 39'·297S., 55° 29'·422E.
2·0m	4° 39'·307S., 55° 29'·507E.
18·4m	4° 38'·618S., 55° 30'·196E.
16·2m	4° 38'·786S., 55° 30'·238E.
9·5m	4° 38'·903S., 55° 30'·291E.
19·9m	4° 39'·010S., 55° 30'·324E.
13·3·m	4° 38'·656S., 55° 30'·646E.
17·0m	4° 36'·19S., 55° 31'·87E.
12·2m	4° 36'·26S., 55° 32'·23E.

5743(P)/24 INDIAN OCEAN - Seychelles - Wrecks. Obstructions. Foul. (continued)

2. A foul area containing multiple obstructions exists within an area bounded by the following positions:

4° 37'·259S., 55° 27'·525E.
 4° 37'·254S., 55° 27'·527E.
 4° 37'·251S., 55° 27'·532E.
 4° 37'·262S., 55° 27'·548E.
 4° 37'·267S., 55° 27'·555E.
 4° 37'·276S., 55° 27'·565E.
 4° 37'·304S., 55° 27'·592E.
 4° 37'·310S., 55° 27'·586E.
 4° 37'·308S., 55° 27'·576E.

3. These and other changes will be included in the next New Edition of Chart 722.

4. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — 742

5980(T)/24 BANGLADESH - Buoy.

Source: BNHOC Notice 33(T)/24

1. The Maikhali Fairway safe water light-buoy, *Mo(A)*, in position 21° 27'·5N., 91° 48'·0E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 90 — 817

388(T)/25 BANGLADESH - Wreck.

Source: BNHOC Notice 1(T)/25

1. A stranded wreck exists in position 22° 08'·77N., 91° 28'·70E.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 90 — 1016

527(P)/25 INDIAN OCEAN - Seychelles - Depths.

Source: British Government Survey

1. Recent survey information has shown that numerous depths less than charted exist between Port Victoria and Ave Maria Rock. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
9·3m	4° 39'·833S., 55° 30'·519E.
5·8m	4° 39'·579S., 55° 30'·401E.
9·7m	4° 38'·034S., 55° 29'·152E.
6·7m	4° 37'·873S., 55° 29'·173E.
8·8m	4° 37'·372S., 55° 29'·449E.
6·2m	4° 37'·378S., 55° 29'·540E.
4·6m	4° 35'·833S., 55° 28'·220E.
0·9m	4° 35'·931S., 55° 30'·033E.
10m	4° 30'·20S., 55° 31'·34E.
0·7m	4° 29'·10S., 55° 32'·11E.
7m	4° 24'·07S., 55° 46'·20E.
17·5m	4° 22'·49S., 55° 45'·77E.
3·5m	4° 20'·30S., 55° 48'·58E.
9·1m	4° 19'·57S., 55° 49'·36E.
2·1m	4° 19'·01S., 55° 48'·90E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
 (WGS84 DATUM)

Chart affected — 742

881(T)/25 INDIAN OCEAN - La Réunion - Beacons.

Source: French Notice 50/23(T)/24

- Two yellow floating beacons with black pictograms have been established in the following positions:

21° 05'·06S., 55° 13'·49E.

21° 05'·11S., 55° 13'·52E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1495**955(T)/25 INDIAN OCEAN - La Réunion - Moorings. Scientific instruments.**

Source: French Notices 38/14(T)/23 and 50/22(T)/24

- *Moorings equipped with scientific instruments have been established in the following positions:

<i>Designation</i>	<i>Position</i>
CM1	20° 55'·726S., 55° 16'·893E.
CM2	21° 00'·48S., 55° 15'·32E.
CM3	21° 00'·63S., 55° 15'·16E.
CM4	21° 02'·53S., 55° 12'·42E.
CM5	20° 55'·566S., 55° 16'·947E.
CM6	21° 02'·35S., 55° 12'·16E.
CM7	20° 55'·28S., 55° 20'·47E.
CM8	20° 56'·647S., 55° 16'·663E.
CM9	20° 56'·686S., 55° 16'·766E.
CM10	20° 59'·93S., 55° 16'·02E.
CM11	21° 00'·16S., 55° 15'·07E.
CM12	21° 00'·81S., 55° 10'·52E.
CM13	21° 00'·48S., 55° 12'·98E.
CM14	21° 14'·01S., 55° 17'·52E.
CM15	21° 09'·27S., 55° 16'·13E.
CM16	21° 17'·30S., 55° 20'·97E.
CM17	21° 20'·39S., 55° 27'·27E.
CM18	21° 23'·79S., 55° 21'·25E.
CM19	21° 22'·39S., 55° 32'·56E.
CM20	21° 07'·48S., 55° 47'·12E.

- Mariners are requested not to anchor near these positions and to navigate with caution in these areas.
- *Former Notice 4224(T)/23 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1495 — 1497**1601(P)/25 INDIA - West Coast - Dolphins. Jetties. Works.**

Source: Indian Notice 4/47(P)/25

- Jetty and dolphin construction works are taking place, in an area bounded by the following positions:

21° 40'·270N., 72° 32'·000E.

21° 39'·920N., 72° 30'·820E.

21° 40'·040N., 72° 30'·670E.

21° 40'·040N., 72° 30'·600E.

21° 39'·900N., 72° 30'·540E.

21° 39'·640N., 72° 30'·540E.

21° 39'·650N., 72° 30'·730E.

21° 39'·290N., 72° 30'·840E.

21° 39'·290N., 72° 30'·960E.

21° 39'·810N., 72° 30'·840E.

21° 40'·150N., 72° 32'·000E.

- Mariners are advised to navigate with caution in the area and contact the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — IN 2082 — IN 2110

1906(T)/25 INDIA - West Coast - Buoy.

Source: Indian Notice 1/33(T)/25

1. *An INCOIS coastal observatory buoy, has been deployed, until further notice, in position 9° 47'·92N., 76° 12'·87E.
2. Mariners are to maintain a clearance of 1 NM.
3. *Former Notice 4718(T)/23 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — IN 22 — IN 32 — IN 220 — IN 260 — IN 2029**2623(T)/25 BANGLADESH - Wreck.**

Source: BNHOC Notice 17(T)/25

1. A stranded wreck exists in position 22° 09'·8N., 91° 27'·6E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 90**2651(P)/25 INDIAN OCEAN - Works. Submarine cables.**

Source: Alcatel Submarine Networks and UKHO

1. Cable installation works are planned between November 2020 and November 2021 to install the 2-AFRICA-GERA telecommunications cable joining the following positions for water less than 200m deep:

<i>Segment</i>	<i>Approximate positions</i>
Bab el Mandeb	14° 17'·7N., 42° 25'·0E.
	14° 16'·3N., 42° 45'·1E.
	14° 04'·7N., 42° 54'·3E.
	13° 54'·7N., 42° 56'·4E.
	13° 38'·8N., 42° 57'·0E.
	13° 28'·6N., 42° 55'·7E.
	13° 20'·4N., 43° 00'·7E.
	13° 18'·9N., 43° 03'·7E.
	13° 15'·6N., 43° 07'·2E.
	13° 00'·8N., 43° 16'·6E.
	12° 50'·9N., 43° 21'·4E.
	12° 44'·8N., 43° 21'·6E.
	12° 41'·2N., 43° 17'·9E.
	12° 38'·9N., 43° 18'·5E.
	12° 37'·0N., 43° 17'·7E.
	and
	12° 43'·2N., 43° 15'·7E.
	13° 03'·2N., 43° 08'·2E.
	13° 13'·7N., 43° 00'·2E.
	13° 18'·9N., 42° 55'·2E.
	13° 23'·2N., 42° 48'·4E.
	13° 26'·9N., 42° 41'·7E.
	13° 33'·8N., 42° 38'·5E.
	13° 38'·7N., 42° 36'·6E.
	13° 45'·4N., 42° 28'·7E.
	13° 51'·2N., 42° 25'·2E.
	and
	14° 30'·6N., 42° 09'·5E.
	14° 39'·8N., 41° 59'·0E.
	15° 13'·7N., 41° 34'·8E.
	15° 36'·1N., 41° 27'·9E.
	15° 49'·8N., 41° 17'·4E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
4. *Former Notice 637(P)/24 is cancelled.

2651(P)/25 INDIAN OCEAN - Works. Submarine cables. (continued)

5. *NOTE: The Cape Town, Port Elizabeth, Durban, Maputo, Nacala, Madagascar, Dar es Salaam, Mombasa, Muqdisho, Seychelles, Djibouti and Yanbu al Bahr sections have been updated by Notice to Mariners and removed from this Notice. The content of the remainder of this Notice is unchanged.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 143 — 157 — 171 — 452 — 453 — 1925 — 1926

2730(T)/25 BANGLADESH - Wreck.

Source: BNHOC Notice 18(T)/25

1. A dangerous wreck exists in position 22° 14'·47N., 91° 49'·83E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 102

2812(P)/25 INDIA - West Coast - Works.

Source: Indian Notice 7/60/25

1. Construction works are taking place within Hāzira Port, in an area bounded by the following positions:
21° 05'·01N., 72° 37'·98E.
21° 04'·98N., 72° 37'·96E.
21° 04'·68N., 72° 37'·92E.
21° 04'·50N., 72° 38'·11E.
21° 04'·72N., 72° 38'·33E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — IN 2034 — IN 2108

2823(T)/25 INDIA - West Coast - Obstructions. Scientific instruments.

Source: Indian Notice 8/65(T)/25

1. Underwater Acoustic Doppler Current Profiler (ADCP) moorings are deployed in the following positions:

<i>Moorings</i>	<i>Position</i>	<i>Depth of ADCP(m)</i>
OGD20	15° 10'·13N., 72° 44'·59E.	182, 287, 592
OJ D8	17° 31'·9N., 71° 07'·0E.	194, 399
OMD17	19° 59'·6N., 69° 13'·9E.	162, 367, 722
OOD6	22° 15'·9N., 67° 28'·2E.	187, 394, 698
OUD8	12° 29'·1N., 74° 02'·3E.	146, 246, 651
OKD17	9° 03'·18N., 75° 25'·96E.	190, 295, 600
KKD15	6° 57'·4N., 77° 24'·0E.	115, 315, 625
*NIOW-2	14° 36'·6N., 72° 52'·1E.	180, 245
*NIOS-2	14° 35'·7N., 72° 57'·1E.	155, 200
*NION-2	14° 40'·3N., 72° 55'·3E.	160, 215

2. All vessels are to maintain a safe distance from these moorings and exercise caution in the vicinity.
3. *Former Notice 2004(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 39 — 707 — 709 — IN 22 — IN 32 — IN 214 — IN 221 — IN 251 — IN 253 — IN 257 — IN 258 — IN 260 — IN 261 — IN 263 — IN 272 — IN 292 — IN 293

3086(P)/25 INDIA - East Coast - Depths. Recommended anchorage. Buoyage.

Source: ENC's IN43040R, IN53016M, IN3317AA and Indian Chart 358

1. Depths less than charted exist in the vicinity of Pāmban Island. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
3·7m	9° 20'·65N., 79° 20'·56E.
9·9m	9° 20'·96N., 79° 24'·56E.
6·9m	9° 20'·76N., 79° 27'·78E.
8·3m	9° 21'·41N., 79° 27'·95E.
8·7m	9° 19'·63N., 79° 28'·51E.
7·4m	9° 18'·99N., 79° 28'·24E.
7·6m	9° 19'·03N., 79° 24'·41E.
7·3m	9° 17'·29N., 79° 28'·76E.
4·2m	9° 14'·65N., 79° 23'·75E.
4·6m	9° 15'·06N., 79° 23'·45E.
5m	9° 11'·09N., 79° 29'·75E.
2·4m	9° 09'·24N., 79° 30'·69E.
2·4m	9° 03'·94N., 79° 30'·67E.
8·1m	9° 02'·42N., 79° 30'·66E.
8·7m	9° 03'·23N., 79° 28'·51E.
2·7m	9° 04'·95N., 79° 28'·36E.
2·3m	9° 07'·35N., 79° 25'·90E.
1·5m	9° 07'·35N., 79° 23'·59E.
1·4m	9° 10'·15N., 79° 23'·45E.
1·5m	9° 10'·79N., 79° 22'·22E.
3·3m	9° 09'·23N., 79° 23'·31E.
5·7m	9° 08'·41N., 79° 21'·01E.
6·9m	9° 08'·56N., 79° 17'·58E.

2. and

<i>Depth</i>	<i>Position</i>
5·4m	9° 09'·90N., 79° 17'·85E.
8·2m	9° 12'·05N., 79° 14'·84E.
4m	9° 10'·48N., 79° 15'·25E.
8·6m	9° 12'·30N., 79° 16'·63E.
7·9m	9° 14'·60N., 79° 30'·15E.
10m	9° 22'·23N., 79° 12'·45E.
4·7m	9° 18'·12N., 79° 12'·03E.
0·2m	9° 15'·55N., 79° 11'·63E.
0·2m	9° 15'·34N., 79° 11'·31E.
9·7m	9° 12'·79N., 79° 13'·89E.
8·1m	9° 12'·12N., 79° 13'·62E.
6·6m	9° 11'·36N., 79° 13'·60E.
1·4m	9° 10'·48N., 79° 14'·87E.
3·6m	9° 10'·48N., 79° 07'·93E.
9·4m	9° 09'·04N., 79° 03'·62E.
10·2m	9° 07'·77N., 79° 14'·43E.
7·6m	9° 09'·94N., 79° 00'·97E.
14·4m	9° 02'·76N., 79° 06'·77E.
14·9m	9° 02'·41N., 79° 12'·50E.
9·8m	9° 40'·76N., 79° 12'·04E.
9·8m	9° 41'·58N., 79° 16'·57E.
9·8m	9° 35'·08N., 79° 16'·07E.
9·1m	9° 29'·38N., 79° 10'·42E.

3. and

<i>Depth</i>	<i>Position</i>
* 1·7m	10° 09'·08N., 79° 55'·38E.
* 10m	9° 36'·31N., 79° 18'·13E.
* 7·4m	9° 07'·09N., 79° 16'·47E.

4. A recommended anchorage has been established, centred on position 9° 09'·42N., 79° 09'·35E.

3086(P)/25 INDIA - East Coast - Depths. Recommended anchorage. Buoyage. (continued)

5. The following buoys have been removed:

<i>Buoy Type</i>	<i>Position</i>
Black and white, conical	9° 17'·42N., 79° 12'·58E.
Starboard lateral	9° 17'·11N., 79° 12'·49E.
Safe water	9° 15'·72N., 79° 11'·68E.
Safe water	9° 15'·47N., 79° 12'·22E.
Black and white, spherical	9° 15'·31N., 79° 12'·39E.

6. Mariners are advised to navigate with caution in the area.

7. *Former Notice 1429(P)/24 is cancelled.

*Indicates new or revised entry.

(INDIAN DATUM)

Charts affected — 69 — 1584 — 2197 — IN 262

3402(T)/25 INDIAN OCEAN - Buoyage.

Source: NOAA

1. White and orange RAMA data light-buoys, with radar reflectors and mast carrying sensors, are laid in the following positions:

<i>Designation</i>	<i>Position</i>
<i>RA184A</i>	0° 00'·0N., 89° 57'·6E.
<i>RA186A</i>	0° 10'·9N., 80° 24'·2E.
<i>RA187A</i>	1° 30'·5S., 80° 33'·4E.
<i>RA188A</i>	1° 34'·7S., 66° 59'·4E.
<i>RA190A</i>	1° 42'·3N., 66° 42'·9E.
<i>RA191A</i>	3° 59'·1N., 66° 58'·9E.
<i>RA192A</i>	7° 55'·7N., 67° 06'·2E.
<i>RA193A</i>	15° 02'·9N., 88° 59'·9E.
<i>RA194A</i>	8° 02'·6N., 88° 56'·8E.
<i>RT028</i>	11° 50'·5S., 80° 18'·8E.
* <i>RT043</i>	2° 14'·2S., 91° 24'·6E.
<i>RT044</i>	12° 00'·8N., 88° 30'·1E.
* <i>RT045</i>	7° 59'·0S., 80° 28'·9E.
* <i>RT046</i>	4° 03'·7S., 80° 31'·9E.
* <i>RT047</i>	3° 55'·2S., 64° 58'·5E.
* <i>RT048</i>	8° 06'·4S., 65° 03'·8E.
* <i>RT049</i>	12° 00'·7S., 64° 57'·7E.

2. The positions of the buoys are subject to frequent change, they may be off station for extended periods of time and additional buoyage may be deployed.

3. The latest information can be found on the Indian National Centre for Ocean Information Services (INCOIS) website, incois.gov.in/portal/OON.jsp and on the NOAA website, <https://www.pmel.noaa.gov/gtmmba/mooring-status-summary>.

4. *Former Notice 2822(T)/25 is cancelled.

*Indicates new or revised entry

(WGS84 DATUM)

Charts affected — 709 — 4702 — 4703 — 4706 — 4707 — 4714 — IN 31 — IN 33

3914(T)/25 BANGLADESH - Wreck.

Source: BNHOC Notice 23(T)/25

1. A Dangerous wreck exists in position 22° 12'·52N., 91° 28'·03E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 90 — 1016

3936(T)/25 INDIA - East Coast - Buoy.

Source: Indian Notice 14/105(T)/25

1. The isolated danger buoy, *Fl(2)*, in position 13° 05'·978N., 80° 19'·210E. is off station.

3936(T)/25 INDIA - East Coast - Buoy. (continued)

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — IN 3001 — IN 3004**4041(P)/25 BANGLADESH - Submarine cable. Works.**

Source: BNHOC Notice 22(P)/25

- A submarine cable is being laid, joining the following positions:

21° 11'·7N., 91° 53'·2E.
 21° 03'·3N., 91° 48'·5E.
 20° 49'·3N., 91° 43'·8E.
 20° 46'·2N., 91° 42'·9E.
 20° 41'·0N., 91° 40'·8E.
 20° 33'·3N., 91° 32'·8E.
 20° 31'·7N., 91° 32'·1E.
 20° 31'·1N., 91° 30'·4E.
 20° 00'·0N., 90° 57'·3E.
 19° 57'·4N., 90° 55'·3E.
 19° 56'·7N., 90° 55'·8E.
 19° 56'·7N., 90° 54'·9E.
 19° 55'·2N., 90° 53'·9E.

- A 500m protection zone has been established either side of the cable.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 90 — 817 — IN 31**4046(T)/25 INDIA - West Coast - Wreck.**

Source: Indian Nav Warning 720/25

- A dangerous wreck has been reported in position 18° 53'·65N., 72° 51'·89E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — IN 211 — IN 2015 — IN 2016**4275(P)/25 INDIAN OCEAN - Submarine cables.**

Source: SubCom

- The Red Sea and Arabian Sea sections of the IEX submarine fibre optic cable system are being laid between Ra's az Za'farana (Egypt) and Mumbai (India). The accompanying diagram shows the overall coverage of the completed and proposed cable sections. The completed sections will be updated by Notice to Mariners. The proposed cable route positions in depths of less than 200m are listed below.

27° 59'·0N., 34° 52'·1E.
 27° 59'·7N., 34° 52'·5E.
 28° 01'·4N., 34° 52'·9E.
 28° 03'·2N., 34° 53'·0E.
 28° 03'·8N., 34° 53'·3E.
 28° 04'·2N., 34° 53'·4E.
 28° 04'·6N., 34° 53'·8E.

- and

16° 15'·90N., 41° 38'·57E.
 16° 19'·81N., 41° 34'·73E.
 16° 24'·73N., 41° 29'·44E.
 16° 28'·07N., 41° 26'·18E.

4275(P)/25 INDIAN OCEAN - Submarine cables. (continued)

3. and

12° 33'·84N., 43° 23'·74E.
12° 35'·41N., 43° 21'·01E.
12° 36'·50N., 43° 20'·75E.
12° 38'·73N., 43° 21'·69E.
12° 42'·74N., 43° 19'·94E.
12° 45'·73N., 43° 19'·29E.
12° 49'·98N., 43° 19'·39E.
12° 54'·97N., 43° 17'·71E.
13° 15'·00N., 43° 06'·10E.
13° 17'·70N., 43° 05'·79E.
13° 20'·18N., 43° 02'·24E.
13° 20'·70N., 43° 00'·77E.
13° 28'·55N., 42° 56'·06E.
13° 39'·15N., 42° 57'·17E.
13° 48'·14N., 42° 56'·06E.
13° 54'·46N., 42° 56'·77E.
13° 57'·35N., 42° 57'·49E.
14° 04'·45N., 42° 55'·46E.
14° 14'·0N., 42° 50'·6E.
14° 14'·2N., 42° 49'·1E.
14° 17'·0N., 42° 45'·2E.
14° 16'·5N., 42° 39'·1E.
14° 20'·0N., 42° 35'·3E.
14° 28'·6N., 42° 30'·4E.

4. and

11° 35'·84N., 43° 09'·11E.
11° 36'·00N., 43° 10'·24E.
11° 36'·09N., 43° 10'·62E.
11° 36'·42N., 43° 11'·53E.
11° 37'·41N., 43° 12'·94E.
11° 38'·25N., 43° 14'·33E.
11° 38'·96N., 43° 15'·71E.
11° 39'·18N., 43° 16'·07E.
11° 39'·35N., 43° 16'·25E.
11° 40'·16N., 43° 16'·76E.
11° 40'·62N., 43° 16'·91E.
11° 41'·44N., 43° 17'·01E.
11° 41'·62N., 43° 17'·11E.
11° 43'·02N., 43° 17'·16E.
11° 44'·49N., 43° 17'·31E.
11° 45'·27N., 43° 17'·62E.
11° 45'·74N., 43° 17'·90E.

4275(P)/25 INDIAN OCEAN - Submarine cables. (continued)


5. and

19° 07'·61N., 72° 48'·13E.
19° 07'·37N., 72° 47'·11E.
19° 02'·29N., 72° 35'·92E.
19° 01'·45N., 72° 28'·20E.
19° 00'·07N., 72° 27'·82E.
18° 55'·57N., 72° 27'·72E.
18° 54'·01N., 72° 27'·04E.
18° 52'·58N., 72° 23'·98E.
18° 52'·69N., 72° 23'·30E.
18° 52'·34N., 72° 17'·45E.
18° 51'·43N., 72° 09'·33E.
18° 50'·7N., 72° 07'·8E.
18° 47'·8N., 72° 03'·4E.
18° 46'·8N., 72° 03'·1E.
18° 42'·2N., 71° 52'·7E.
18° 41'·3N., 71° 52'·5E.
18° 40'·5N., 71° 52'·0E.
18° 40'·2N., 71° 49'·8E.
18° 13'·2N., 70° 53'·6E.
18° 10'·2N., 70° 53'·3E.
18° 02'·7N., 70° 48'·9E.
18° 00'·4N., 70° 46'·5E.
17° 59'·9N., 70° 46'·2E.

6. Mariners are advised to navigate with caution in the area.

7. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 6 — 12 — 15 — 143 — 157 — 159 — 264 — 265 — 452 — 453 — 707 — 1925 — 3661 —
IN 22 — IN 211 — IN 255 — IN 292 — IN 293 — IN 2016

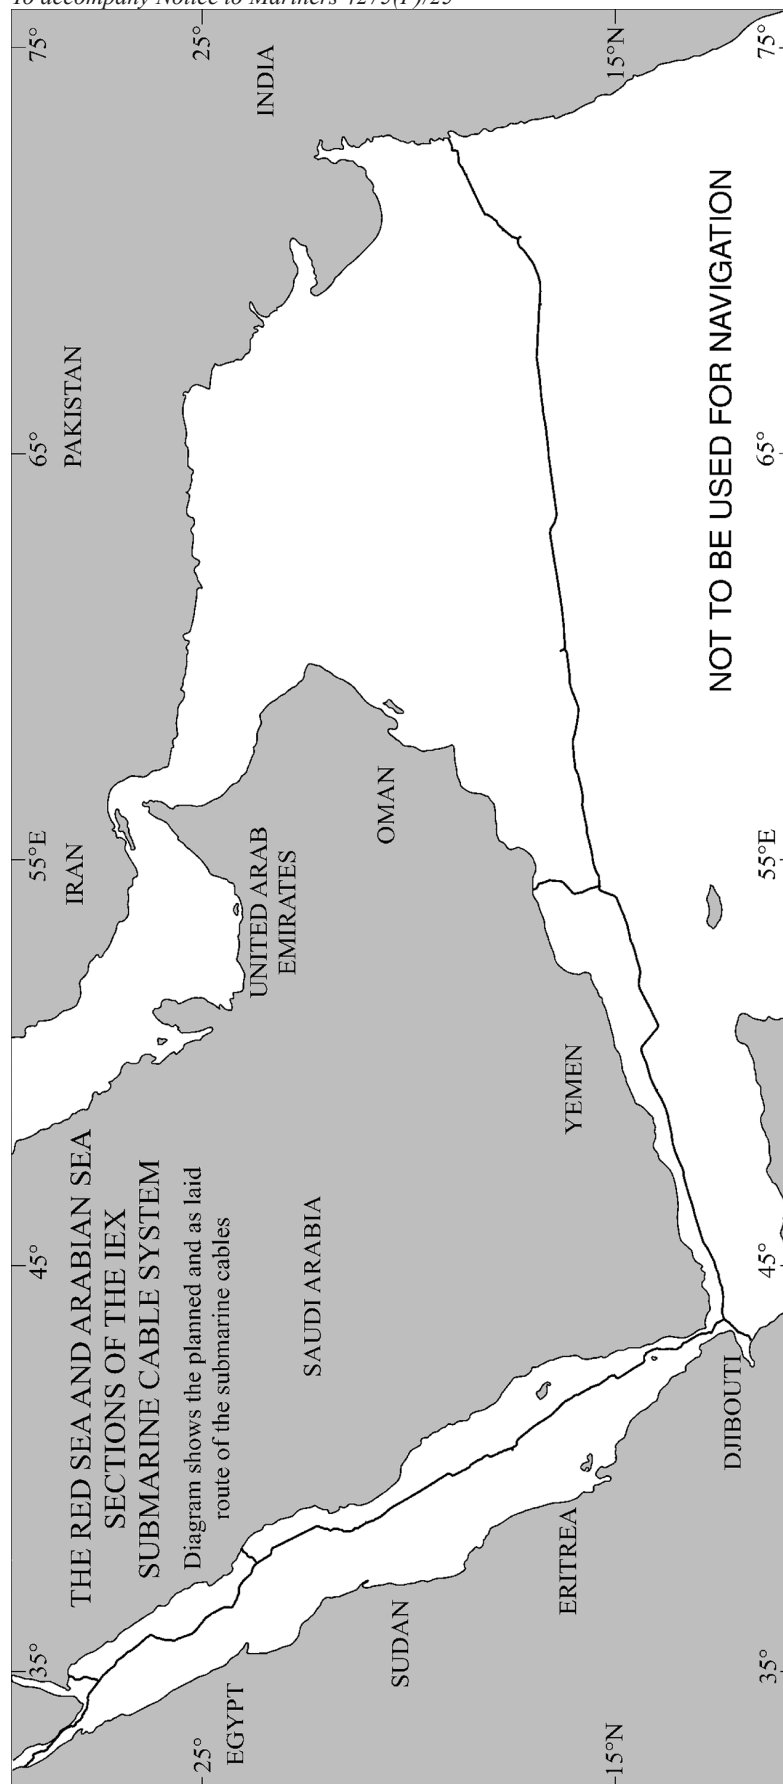

4305(T)/25 BANGLADESH - Wreck. Buoy.

Source: BNHOC Notice 30(T)/25

1. A dangerous wreck, marked by an isolated danger light-buoy, *LFl.6s*, exists in position $22^{\circ} 14' \cdot 61N.$, $91^{\circ} 46' \cdot 40E.$
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 102 — 1016

2.297

4387(P)/25 INDIA - West Coast - Platform. Works.

Source: Indian Notice 14/104(P)/25

1. Platform construction works are taking place in the vicinity of position 22° 37'·27N., 68° 27'·15E.
2. Mariners are advised to keep 500 metres away from the above location and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 39 — 707 — IN 202 — IN 251**4534(P)/25 INDIA - West Coast - Submarine cable. Works.**

Source: Alcatel Submarine Networks

1. A submarine cable is being laid joining the following positions:

19° 07'·99N., 72° 48'·67E.

18° 45'·37N., 72° 08'·99E.

16° 26'·30N., 71° 18'·91E.

10° 53'·91N., 74° 23'·68E.

7° 16'·57N., 73° 52'·30E.

5° 15'·62N., 74° 36'·55E.

1° 41'·61N., 77° 37'·45E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 707 — 709 — 1014 — 4703 — 4705 — 4706 — 4707 — IN 22 — IN 211 — IN 255 — IN 257 — IN 258 — IN 259 — IN 272 — IN 273 — IN 292 — IN 293 — IN 294 — IN 2016**4581(T)/25 INDIAN OCEAN - Buoyage.**

Source: Indian Notice 17/126(T)/25 and INCOIS

1. Yellow data light-buoys, *Fl(4)15s*, with radar reflectors and mast-carrying sensors have been established in the following positions:

Buoy	Position	Remark
<i>BD08</i>	17° 49'·25N., 89° 12'·50E.	OMNI
<i>*BD09</i>	17° 05'·0N., 91° 19'·9E.	OMNI
<i>BD10</i>	16° 18'·32N., 87° 59'·20E.	OMNI
<i>*BD11</i>	15° 02'·4N., 91° 53'·9E.	OMNI
<i>BD12</i>	10° 32'·5N., 94° 01'·2E.	OMNI
<i>BD13</i>	13° 56'·28N., 86° 59'·82E.	OMNI
<i>BD14</i>	6° 34'·35N., 88° 19'·47E.	OMNI
<i>CB01</i>	11° 35'·33N., 92° 35'·77E.	Coastal
<i>CB06</i>	13° 05'·58N., 80° 18'·45E.	Coastal
<i>TB05</i>	10° 15'·1N., 88° 33'·0E.	Tsunami
<i>TB06</i>	14° 41'·8N., 89° 33'·2E.	Tsunami
<i>TB09</i>	16° 45'·6N., 89° 54'·9E.	Tsunami
<i>STB01</i>	6° 15'·00N., 88° 52'·80E.	Tsunami
<i>*STB03</i>	3° 48'·6N., 91° 42'·0E.	Tsunami

2. Mariners are advised to maintain a clearance of 1 nautical mile.
3. The positions of these buoys change frequently. The latest positions are available on the Indian National Centre for Ocean Information Services website at incois.gov.in/portal/OON.jsp
4. *Former Notice 3679(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 317 — 830 — 1398 — 4706 — 4707 — IN 31 — IN 32 — IN 33 — IN 313 — IN 357 — IN 472 — IN 473 — IN 3001 — IN 3004

4582(T)/25 INDIAN OCEAN - Buoyage.

Source: Indian Notice 17/124(T)/25 and UKHO

1. Moored yellow Wave Rider Buoys (WRB) have been deployed in the following positions:

WRB Buoy	Position
<i>WRB Gopalpur</i>	19° 15'·27N., 84° 56'·13E.
<i>WRB Visakhapatnam</i>	17° 38'·30N., 83° 15'·93E.
<i>WRB Kanyakumari</i>	8° 06'·48N., 77° 17'·88E.
* <i>WRB Krishnapatnam</i>	14° 16'·15N., 80° 10'·85E.
<i>WRB Pondicherry</i>	11° 54'·88N., 79° 50'·83E.
<i>WRB Kozhikode</i>	11° 17'·90N., 75° 39'·80E.
<i>WRB Ratnagiri</i>	16° 58'·60N., 73° 15'·20E.
<i>WRB Versova</i>	19° 07'·92N., 72° 44'·22E.
<i>WRB Veraval</i>	20° 53'·23N., 70° 23'·58E.
<i>WRB Karwar</i>	14° 49'·20N., 74° 03'·00E.
<i>WRB Digha</i>	21° 24'·70N., 87° 38'·70E.
<i>WRB Kollam</i>	8° 52'·10N., 76° 32'·80E.
<i>WRB Tuticorin</i>	8° 53'·00N., 78° 17'·80E.
<i>WRB Vizhinjam</i>	8° 21'·58N., 76° 59'·88E.
<i>WRB Seychelles</i>	4° 39'·46S., 55° 52'·22E.
<i>WRB Mauritius</i>	20° 08'·53S., 57° 28'·93E.

2. The positions of the buoys are subject to frequent change and may be off station for extended periods of time.
 3. Mariners are advised to maintain a safe distance from buoys and navigate with caution in the area.
 4. *Former Notice 3872(T)/25 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 317 — 707 — 710 — 711 — 712 — 740 — 742 — 1470 — IN 22 — IN 31 — IN 32 — IN 33 —
 IN 205 — IN 206 — IN 211 — IN 212 — IN 213 — IN 215 — IN 216 — IN 219 — IN 221 — IN 223 — IN 253 —
 IN 255 — IN 256 — IN 257 — IN 258 — IN 259 — IN 262 — IN 272 — IN 292 — IN 293 — IN 308 — IN 351 —
 IN 352 — IN 353 — IN 357 — IN 2008 — IN 2120 — IN 3002 — IN 3034 — IN 3035

4585(T)/25 INDIA - West Coast - Buoyage.

Source: Indian Notice 17/125(T)/25 and INCOIS

1. Yellow data light-buoys, *Fl(4)15s*, with radar reflectors and mast carrying sensors have been established in the following positions:

Buoy	Position
*AD06	18° 16'·2N., 67° 12'·5E.
AD07	14° 56'·6N., 68° 59'·1E.
*AD08	12° 10'·0N., 67° 54'·7E.
AD09	8° 05'·4N., 73° 16'·4E.
AD10	10° 18'·8N., 72° 35'·4E.
*CALVAL	10° 29'·6N., 72° 11'·6E.
CB02	10° 52'·4N., 72° 12'·6E.
*TB12	19° 45'·1N., 67° 07'·8E.
STB02	20° 45'·6N., 65° 16'·8E.

2. Mariners are advised to maintain a clearance of 1 nautical mile.
 3. The positions of these buoys change frequently. The latest positions are available on the Indian National Centre for Ocean Information Services website at incois.gov.in/portal/OON.jsp
 4. *Former Notice 3074(T)/25 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 707 — 709 — 4703 — 4705 — 4706 — 4707 — IN 22 — IN 273 — IN 292 — IN 293 — IN 294

4616(T)/25 BANGLADESH - Buoy.

Source: BNHOC Notice 25(T)/25

1. A starboard-hand lateral buoy, *Fl.G.5s*, has been deployed, until further notice, in position 22° 10'·9N., 91° 23'·4E.

4616(T)/25 BANGLADESH - Buoy. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 90

4635(P)/25 BANGLADESH - Depths.

Source: ENC BD407426

- Depths less than charted exist within Zulfiquar channel. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
5·5m	21° 33'·55N., 89° 27'·10E.
4·8m	21° 34'·21N., 89° 26'·73E.
4·9m	21° 36'·69N., 89° 28'·27E.
4·7m	21° 37'·19N., 89° 28'·14E.
3·2m	21° 37'·92N., 89° 28'·28E.
2·6m	21° 38'·92N., 89° 28'·54E.
1·4m	21° 39'·75N., 89° 28'·74E.
0·7m	21° 40'·35N., 89° 28'·88E.
0·6m	21° 41'·54N., 89° 29'·13E.
8·8m	21° 44'·38N., 89° 28'·51E.
3·7m	21° 44'·47N., 89° 28'·99E.
5·5m	21° 46'·38N., 89° 29'·87E.
4·9m	21° 48'·37N., 89° 29'·91E.
3·2m	21° 49'·13N., 89° 30'·07E.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- These changes will be included in the next New Edition of Chart 899.
(WGS84 DATUM)

Chart affected — 899

4674(T)/25 INDIA - West Coast - Wreck.

Source: Indian Nav Warning 799/25

- A wreck has been reported in approximate position 18° 51'·00N., 72° 47'·00E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — IN 211 — IN 255 — IN 2016

5080(T)/25 BANGLADESH - Wreck. Buoy.

Source: BNHOC Notice 39(T)/25

- A dangerous wreck, marked by an isolated danger light-buoy, *LFL 6s*, exists in position 22° 14'·00N., 91° 47'·00E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 102 — 1016

5151(T)/25 INDIAN OCEAN - La Réunion - Scientific instrument.

Source: French Notice 38/4(T)/25

- A scientific mooring equipped with a hydrophone, EDF HYDRO TANIKA, has been established in the following position:
20° 52'·83S., 55° 23'·19E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1495 — 1497

5216(T)/25 BANGLADESH - Buoyage.

Source: BNHOC Notices 06(T)/25, 09(T)/25, 19(T)/25, 24(T)/25 and 35(T)/25

1. Changes to buoyage have taken place within Pussur River including the following:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Status</i>	<i>Position</i>
<i>Fl(2)G.12s</i>	<i>B-7</i>	Starboard lateral	Unlit	21° 33'·88N., 89° 28'·70E.
<i>Fl(2)R.12s</i>	<i>B-8</i>	Port lateral	Missing	21° 33'·88N., 89° 27'·00E.
<i>Fl(3)G.15s</i>	<i>B-9</i>	Starboard lateral	Unlit	21° 35'·93N., 89° 28'·03E.
* <i>Fl(3)R.15s</i>	<i>B-10</i>	Port lateral	Missing	21° 35'·93N., 89° 26'·93E.
<i>Fl(2)G.12s</i>	<i>B-11</i>	Starboard lateral	Unlit	21° 38'·42N., 89° 28'·04E.
<i>Fl(2)R.12s</i>	<i>B-12</i>	Port lateral	Unlit	21° 38'·42N., 89° 26'·96E.
<i>Fl.G.8s</i>	<i>B-13</i>	Starboard lateral	Unlit	21° 40'·05N., 89° 28'·63E.
<i>Fl.R.8s</i>	<i>B-14</i>	Port lateral	Missing	21° 40'·05N., 89° 27'·56E.
<i>Fl(4)G.15s</i>	<i>B-15</i>	Starboard lateral	Unlit	21° 42'·09N., 89° 29'·08E.
<i>Fl(4)R.15s</i>	<i>B-16</i>	Port lateral	Unlit	21° 42'·09N., 89° 28'·14E.
<i>Fl(2)R.10s</i>	<i>B-18</i>	Port lateral	Unlit	21° 44'·12N., 89° 28'·12E.
<i>Fl.R.6s</i>	<i>B-20</i>	Port lateral	Unlit	21° 46'·15N., 89° 28'·27E.
<i>Fl(4)R.20s</i>	<i>B-34</i>	Port lateral	Missing	21° 56'·17N., 89° 30'·95E.
<i>Fl(3)G.15s</i>	<i>K-3</i>	Starboard lateral	Missing	22° 02'·77N., 89° 34'·01E.
<i>Fl(2)R.12s</i>	<i>S-2</i>	Port lateral	Unlit	22° 06'·69N., 89° 35'·60E.
<i>Fl(4)R.20s</i>	<i>S-4</i>	Port lateral	Unlit	22° 07'·61N., 89° 35'·74E.
<i>Fl(2)R.12s</i>	<i>S-6</i>	Port lateral	Unlit	22° 09'·45N., 89° 34'·28E.
<i>Fl.G.10s</i>	<i>S-9</i>	Starboard lateral	Missing	22° 10'·78N., 89° 33'·44E.
<i>Fl(2)R.12s</i>	<i>M-8</i>	Port lateral	Unlit	22° 13'·89N., 89° 35'·02E.
<i>Fl(2)R.10s</i>	<i>H-2</i>	Port lateral	Deleted	22° 18'·73N., 89° 36'·84E.
<i>Fl(4)R.20s</i>	<i>H-4</i>	Port lateral	Deleted	22° 19'·94N., 89° 37'·69E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

3. * Former Notice 4499(T)/25 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)**Charts affected — 90 — 899 — 907 — 910 — IN 351****5229(P)/25 INDIAN OCEAN - Submarine cables. Works.**

Source: Alcatel Submarine Networks and UKHO

1. Cable installation works are taking place to install the 1-AFRICA telecommunications cable joining the following positions:

<i>Segment</i>	<i>Position</i>
Pakistan	24° 47'·003N., 67° 02'·995E. 24° 32'·550N., 66° 34'·179E. 23° 58'·497N., 65° 26'·284E. 23° 50'·109N., 64° 01'·864E. 23° 29'·206N., 63° 16'·380E. 23° 00'·014N., 62° 49'·169E.

2. and

Oman	23° 00'·014N., 62° 49'·169E. 21° 27'·447N., 60° 18'·004E. 20° 10'·988N., 60° 03'·934E. 16° 35'·345N., 57° 49'·643E. 15° 22'·278N., 57° 33'·617E. 13° 13'·295N., 54° 58'·897E.
------	--

5229(P)/25

INDIAN OCEAN - Submarine cables. Works. (continued)

3. and

Somalia 13° 13'·295N., 54° 58'·897E.
 12° 20'·350N., 55° 21'·734E.
 11° 28'·564N., 55° 21'·834E.
 10° 48'·524N., 54° 55'·326E.
 9° 41'·686N., 55° 05'·658E.
 4° 10'·082N., 52° 22'·433E.
 2° 10'·497N., 52° 43'·920E.
 1° 41'·356S., 48° 59'·043E.
 4° 16'·527S., 44° 00'·016E.
 4° 36'·114S., 42° 26'·655E.
 4° 35'·596S., 41° 38'·837E.
 4° 17'·726S., 41° 22'·983E.
 4° 17'·790S., 40° 28'·959E.
 4° 20'·412S., 40° 24'·436E.
 4° 18'·802S., 40° 12'·576E.
 4° 15'·082S., 40° 03'·465E.
 4° 07'·461S., 39° 50'·993E.
 4° 07'·812S., 39° 46'·786E.
 4° 05'·413S., 39° 43'·090E.
 4° 03'·052S., 39° 42'·416E.

4. and

Gulf of Oman 25° 04'·022N., 56° 21'·646E.
 25° 03'·792N., 56° 24'·398E.
 25° 00'·979N., 56° 24'·982E.
 24° 59'·871N., 56° 26'·426E.
 24° 56'·680N., 56° 44'·099E.
 24° 40'·067N., 57° 11'·519E.
 24° 30'·340N., 57° 13'·375E.
 24° 23'·521N., 57° 21'·080E.
 24° 05'·424N., 58° 40'·673E.
 23° 32'·487N., 59° 20'·856E.
 23° 35'·822N., 60° 04'·944E.
 22° 53'·310N., 61° 36'·013E.
 23° 00'·014N., 62° 49'·169E.

5. and

25° 04'·022N., 56° 21'·647E.
 25° 04'·112N., 56° 21'·981E.
 25° 06'·076N., 56° 24'·151E.
 25° 06'·615N., 56° 25'·500E.
 25° 06'·169N., 56° 28'·753E.
 25° 05'·483N., 56° 34'·162E.
 25° 05'·420N., 56° 35'·261E.
 25° 04'·952N., 56° 37'·275E.
 25° 03'·357N., 56° 38'·752E.
 25° 02'·397N., 56° 38'·988E.
 25° 01'·393N., 56° 39'·697E.
 25° 00'·034N., 56° 41'·204E.
 24° 59'·659N., 56° 41'·464E.
 24° 58'·182N., 56° 41'·951E.
 24° 57'·488N., 56° 42'·749E.
 24° 56'·971N., 56° 44'·787E.
 24° 56'·882N., 56° 45'·747E.

5229(P)/25 INDIAN OCEAN - Submarine cables. Works. (continued)

6. and

Gulf of Aden 12° 18'·364N., 43° 33'·462E.
12° 17'·810N., 43° 36'·758E.
11° 45'·456N., 43° 55'·953E.
11° 28'·399N., 44° 38'·685E.
11° 25'·921N., 45° 22'·489E.
11° 48'·030N., 46° 16'·452E.
12° 08'·706N., 48° 16'·467E.
13° 28'·317N., 53° 36'·391E.
13° 13'·295N., 54° 58'·897E.

7. and

Djibouti 12° 18'·364N., 43° 33'·462E.
12° 08'·508N., 43° 33'·762E.
12° 08'·065N., 43° 33'·596E.
12° 07'·098N., 43° 32'·610E.
12° 05'·111N., 43° 31'·258E.
12° 02'·579N., 43° 28'·376E.
12° 00'·071N., 43° 25'·779E.
11° 55'·247N., 43° 19'·865E.
11° 54'·013N., 43° 19'·214E.
11° 52'·701N., 43° 18'·944E.
11° 49'·858N., 43° 18'·787E.
11° 44'·972N., 43° 17'·029E.
11° 43'·272N., 43° 16'·792E.
11° 40'·400N., 43° 16'·390E.
11° 39'·414N., 43° 15'·840E.
11° 38'·701N., 43° 14'·808E.
11° 37'·282N., 43° 12'·603E.
11° 36'·571N., 43° 11'·448E.
11° 36'·183N., 43° 10'·583E.
11° 35'·996N., 43° 09'·909E.
11° 35'·919N., 43° 09'·483E.
11° 35'·874N., 43° 09'·079E.

8. and

Saudi Arabia 20° 18'·270N., 39° 11'·001E.
19° 00'·209N., 39° 56'·980E.
17° 09'·837N., 40° 50'·466E.
16° 04'·197N., 41° 07'·976E.
14° 23'·563N., 42° 07'·969E.
14° 08'·647N., 42° 36'·046E.
14° 09'·603N., 42° 47'·366E.
13° 47'·224N., 42° 56'·599E.
13° 28'·779N., 42° 56'·488E.
12° 49'·336N., 43° 18'·982E.
12° 39'·015N., 43° 15'·115E.
12° 35'·653N., 43° 16'·127E.
12° 28'·340N., 43° 28'·591E.
12° 18'·365N., 43° 33'·461E.

5229(P)/25 INDIAN OCEAN - Submarine cables. Works. (continued)

9. and

Yemen 14° 46'·24N., 42° 57'·20E.
 14° 40'·20N., 42° 39'·96E.
 14° 42'·53N., 42° 35'·97E.
 14° 48'·12N., 42° 33'·50E.
 15° 05'·44N., 42° 23'·25E.
 15° 23'·44N., 42° 06'·21E.
 15° 35'·41N., 42° 02'·45E.
 15° 47'·56N., 41° 56'·28E.
 15° 56'·34N., 41° 54'·84E.
 16° 00'·54N., 41° 52'·81E.
 16° 11'·89N., 41° 45'·01E.
 16° 12'·69N., 41° 42'·94E.
 16° 11'·43N., 41° 38'·14E.
 16° 13'·81N., 41° 34'·81E.
 16° 13'·64N., 41° 31'·38E.
 16° 11'·59N., 41° 25'·67E.
 16° 10'·21N., 41° 17'·92E.
 16° 11'·30N., 41° 14'·49E.
 16° 15'·62N., 41° 10'·59E.
 16° 16'·35N., 41° 07'·49E.
 16° 18'·42N., 41° 05'·05E.

10. Mariners are advised to navigate with caution in the area.

11. Charts will be updated when full details are available.

12. *Former Notice 746(P)/25 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

**Charts affected — 5 — 6 — 15 — 38 — 39 — 40 — 58 — 100 — 143 — 157 — 158 — 159 — 164 — 171 —
 263 — 264 — 265 — 452 — 453 — 542 — 548 — 616 — 666 — 707 — 1925 — 2659 — 2837 — 2851 —
 2858 — 2949 — 2964 — 2968 — 2969 — 2970 — 3520 — 3522 — 3523 — 3661 — 3709 — 3723 — 3784 —
 3785**

5380(T)/25 INDIA - West Coast - Wreck.

Source: HYDROPAC 2844/25

1. A dangerous wreck has been reported in position 23° 02'·0N., 67° 24'·0E.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 39 — 707 — 4705 — IN 251**5381(T)/25 BANGLADESH - Recommended tracks.**

Source: BNHOC Notice 33(T)/25

1. A recommended track has been established as follows:

<i>Bearing</i>	<i>Position</i>
312°-132°	21° 27'·16N., 89° 32'·49E. 21° 31'·52N., 89° 27'·79E.
358°-178°	21° 31'·52N., 89° 27'·79E. 21° 38'·04N., 89° 27'·57E.
013°-193°	21° 38'·04N., 89° 27'·57E. 21° 41'·68N., 89° 28'·43E.
003°-183°	21° 41'·68N., 89° 28'·43E. 21° 46'·42N., 89° 28'·65E.
039°-219°	21° 46'·42N., 89° 28'·65E. 21° 49'·05N., 89° 30'·88E.

(WGS84 DATUM)

Charts affected — 90 — 899 — IN 351

5739(P)/25 INDIAN OCEAN - Submarine cable.

Source: Alcatel Submarine Networks

1. Submarine cable laying operations are taking place for the WABAN cable, joining the following positions:

33° 41'·78S., 18° 26'·25E.
33° 43'·84S., 18° 18'·59E.
33° 45'·80S., 18° 09'·49E.
33° 48'·23S., 18° 08'·40E.
33° 49'·55S., 18° 02'·01E.
33° 53'·15S., 17° 59'·23E.
33° 59'·4S., 17° 41'·5E.
34° 07'·0S., 17° 25'·1E.
34° 17'·8S., 17° 07'·2E.
34° 27'·8S., 16° 56'·2E.
35° 02'·8S., 16° 43'·8E.
35° 57'·8S., 17° 11'·7E.
36° 19'·3S., 17° 51'·6E.
36° 20'·5S., 18° 22'·5E.
36° 44'·0S., 18° 50'·1E.
37° 35'·5S., 19° 11'·4E.
37° 52'·8S., 20° 06'·9E.
37° 08'·1S., 21° 38'·6E.
37° 14'·2S., 23° 52'·7E.
36° 44'·9S., 24° 22'·4E.
32° 23'·4S., 31° 32'·5E.
32° 00'·6S., 32° 05'·5E.
31° 18'·8S., 31° 54'·3E.
31° 09'·1S., 32° 03'·7E.
30° 52'·7S., 32° 09'·2E.

2. and

30° 02'·51S., 30° 54'·07E.
30° 08'·23S., 31° 05'·77E.
30° 36'·22S., 31° 14'·02E.
30° 46'·9S., 31° 37'·7E.
30° 55'·4S., 32° 05'·0E.
30° 52'·7S., 32° 09'·2E.

3. and

30° 52'·6S., 32° 09'·1E.
30° 44'·7S., 32° 24'·1E.
30° 55'·1S., 33° 06'·0E.
30° 27'·5S., 34° 40'·5E.
30° 23'·4S., 35° 24'·9E.
30° 05'·9S., 36° 19'·0E.
30° 02'·5S., 37° 10'·5E.
29° 15'·7S., 37° 56'·5E.
28° 46'·5S., 40° 05'·3E.
26° 38'·3S., 46° 15'·2E.
26° 29'·3S., 47° 25'·7E.
23° 19'·8S., 52° 38'·3E.
23° 26'·3S., 54° 20'·0E.
22° 37'·4S., 55° 28'·7E.
22° 31'·5S., 56° 34'·7E.
21° 31'·3S., 57° 39'·6E.
20° 44'·1S., 59° 15'·1E.
18° 16'·1S., 61° 21'·5E.
16° 09'·7S., 63° 46'·2E.
13° 26'·0S., 68° 25'·6E.

5739(P)/25 INDIAN OCEAN - Submarine cable. (continued)

4. and

12° 40'·2S., 68° 46'·9E.
10° 32'·7S., 71° 52'·2E.
9° 00'·3S., 73° 00'·0E.
8° 15'·4S., 73° 08'·1E.
6° 49'·4S., 74° 30'·8E.
1° 24'·1N., 77° 42'·4E.
1° 48'·3N., 77° 38'·1E.

5. and

1° 48'·4N., 77° 38'·1E.
1° 44'·6N., 77° 46'·3E.
1° 48'·9N., 78° 06'·9E.
2° 02'·6N., 78° 28'·0E.
2° 05'·3N., 78° 48'·4E.
2° 18'·3N., 79° 02'·5E.
2° 25'·0N., 79° 23'·5E.
2° 23'·2N., 80° 03'·1E.
2° 38'·9N., 81° 36'·0E.
3° 01'·0N., 82° 36'·4E.
3° 32'·6N., 83° 36'·3E.
4° 34'·9N., 84° 57'·2E.
4° 21'·5N., 86° 44'·1E.
4° 53'·2N., 87° 06'·4E.
5° 06'·0N., 87° 24'·8E.

6. and

5° 06'·0N., 87° 24'·8E.
5° 01'·0N., 88° 57'·2E.
5° 25'·8N., 89° 54'·5E.
5° 18'·3N., 90° 29'·3E.
5° 33'·9N., 90° 56'·7E.
5° 41'·2N., 92° 17'·4E.
5° 54'·5N., 92° 39'·1E.
6° 06'·6N., 92° 46'·9E.
6° 11'·1N., 93° 00'·1E.
6° 06'·1N., 93° 44'·1E.
6° 33'·6N., 94° 15'·9E.
7° 07'·9N., 94° 38'·4E.
7° 19'·9N., 94° 43'·7E.
7° 28'·4N., 94° 57'·4E.
7° 57'·5N., 95° 13'·5E.
7° 58'·8N., 95° 34'·9E.
7° 23'·2N., 96° 39'·5E.
6° 49'·5N., 98° 07'·9E.
6° 47'·73N., 98° 37'·37E.
6° 19'·25N., 99° 02'·99E.

7. and

6° 10'·29N., 99° 18'·14E.
6° 11'·12N., 99° 22'·23E.
6° 07'·62N., 99° 37'·06E.
6° 06'·72N., 99° 47'·61E.
6° 06'·80N., 99° 56'·43E.
6° 07'·47N., 99° 59'·09E.
6° 10'·84N., 100° 05'·58E.
6° 11'·70N., 100° 08'·39E.
6° 12'·48N., 100° 14'·56E.

8. Mariners are advised to navigate with caution in the area.

5739(P)/25 INDIAN OCEAN - Submarine cable. (continued)

9. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 709 — 712 — 830 — 3795 — 3797 — 3880 — 3900 — 3904 — 3906 — 3942 — 3943 —
4146 — 4148 — 4150 — 4151 — 4152 — 4156 — 4159 — 4163 — 4169 — 4171 — 4177 — 4178 — 4179 —
4180 — 4700 — 4702 — 4707 — IN 33 — IN 472



(13) MALACCA STRAIT, SINGAPORE STRAIT AND SUMATERA

1401(P)/18 INDONESIA - Sumatera - Submarine cables.

Source: Indonesian Notices 5/49/18, 7/67/18 and 8/77/18

1. Submarine cable laying operations are taking place in connection with Palapa Ring cable system, joining the following positions:

2. Section A:

3° 13'·67N., 106° 13'·39E. (shore)
3° 14'·13N., 106° 13'·25E.
3° 14'·92N., 106° 13'·42E.
3° 15'·15N., 106° 13'·32E.
3° 16'·86N., 106° 10'·52E.
3° 17'·47N., 106° 09'·79E.
3° 18'·30N., 106° 08'·03E.
3° 21'·92N., 106° 06'·44E.
3° 24'·29N., 106° 07'·46E.
3° 28'·35N., 106° 15'·20E.
3° 27'·08N., 107° 45'·19E.
3° 29'·62N., 107° 52'·31E.
3° 26'·56N., 108° 05'·17E.
3° 29'·95N., 108° 17'·75E.
3° 35'·67N., 108° 23'·69E.
3° 40'·41N., 108° 25'·27E.
3° 42'·18N., 108° 25'·31E.
3° 43'·79N., 108° 23'·02E.
3° 43'·73N., 108° 18'·43E.(shore)

3. Section B:

1° 10'·06N., 104° 08'·33E. (shore)
1° 10'·16N., 104° 08'·55E.
1° 12'·31N., 104° 09'·55E.
1° 12'·40N., 104° 15'·02E.
1° 12'·51N., 104° 15'·07E.
1° 13'·25N., 104° 19'·67E.
1° 13'·19N., 104° 19'·75E.
1° 14'·91N., 104° 24'·81E.
1° 18'·03N., 104° 35'·25E.
1° 20'·99N., 104° 48'·16E.
1° 36'·83N., 104° 56'·52E.
1° 37'·57N., 105° 01'·24E.
1° 37'·15N., 105° 02'·45E.
1° 37'·30N., 105° 03'·66E.
2° 13'·74N., 105° 34'·47E.
2° 20'·05N., 105° 43'·66E.
2° 25'·86N., 105° 44'·35E.
2° 37'·76N., 105° 54'·04E.
3° 10'·82N., 106° 03'·51E.
3° 15'·64N., 106° 07'·53E.
3° 15'·50N., 106° 12'·59E.
3° 15'·18N., 106° 13'·19E.
3° 14'·78N., 106° 13'·32E.
3° 14'·11N., 106° 13'·22E.
3° 13'·67N., 106° 13'·39E. (shore)

1401(P)/18 INDONESIA - Sumatera - Submarine cables. (continued)

4. Sections D and E:

0° 01'·10S., 104° 36'·80E.(shore)
 0° 00'·65N., 104° 39'·59E.
 0° 00'·55S., 104° 43'·46E.
 0° 01'·10S., 104° 46'·13E.
 0° 00'·10N., 104° 48'·49E.
 0° 12'·18N., 104° 55'·45E.
 0° 14'·32N., 104° 55'·65E.
 0° 20'·72N., 104° 58'·88E.
 0° 35'·66N., 105° 02'·28E.
 0° 41'·81N., 105° 02'·76E.
 1° 03'·87N., 104° 55'·74E.
 1° 14'·16N., 104° 40'·71E.
 1° 15'·06N., 104° 35'·34E.
 1° 15'·45N., 104° 32'·81E.
 1° 15'·14N., 104° 28'·59E.
 1° 14'·56N., 104° 25'·83E.
 1° 12'·92N., 104° 22'·59E.
 1° 13'·01N., 104° 21'·84E.
 1° 12'·32N., 104° 19'·53E.
 1° 11'·91N., 104° 19'·01E.
 1° 11'·76N., 104° 18'·57E.
 1° 11'·46N., 104° 09'·37E.
 1° 11'·06N., 104° 08'·83E.
 1° 10'·16N., 104° 08'·55E.
 1° 10'·06N., 104° 08'·33E.(shore)

5. Section F:

1° 08'·45N., 103° 55'·49E.(shore)
 1° 09'·03N., 103° 55'·73E.
 1° 09'·59N., 103° 55'·08E.
 1° 10'·04N., 103° 54'·47E.
 1° 10'·56N., 103° 54'·46E.
 1° 10'·89N., 103° 53'·17E.
 1° 10'·68N., 103° 52'·00E.
 1° 07'·13N., 103° 45'·66E.
 1° 05'·96N., 103° 45'·83E.
 1° 01'·06N., 103° 39'·60E.
 1° 03'·44N., 103° 34'·68E.
 1° 02'·09N., 103° 32'·47E.
 0° 59'·43N., 103° 32'·59E.
 0° 59'·00N., 103° 29'·76E.
 0° 59'·85N., 103° 26'·64E.(shore)

6. Section G:

1° 03'·07N., 103° 18'·79E.(shore)
 1° 02'·80N., 103° 17'·86E.
 1° 14'·03N., 103° 03'·81E.
 1° 14'·69N., 103° 01'·97E.
 1° 15'·89N., 102° 53'·96E.
 1° 16'·15N., 102° 47'·91E.
 1° 15'·20N., 102° 42'·76E.
 1° 13'·10N., 102° 39'·19E.
 1° 11'·48N., 102° 38'·71E.
 1° 07'·12N., 102° 39'·17E.
 1° 05'·03N., 102° 38'·69E.
 1° 02'·53N., 102° 37'·86E.
 1° 01'·69N., 102° 37'·17E.
 1° 01'·08N., 102° 37'·03E.
 1° 00'·49N., 102° 37'·19E.
 0° 59'·64N., 102° 37'·14E.(shore)

1401(P)/18 INDONESIA - Sumatera - Submarine cables. (continued)

7. Section K:

0° 14'·55S., 104° 28'·00E.(shore)
 0° 14'·81S., 104° 28'·11E.
 0° 15'·03S., 104° 27'·69E.
 0° 14'·88S., 104° 27'·18E.
 0° 14'·95S., 104° 26'·64E.
 0° 14'·80S., 104° 25'·43E.
 0° 15'·07S., 104° 24'·82E.
 0° 13'·97S., 104° 14'·20E.
 0° 13'·90S., 104° 08'·27E.
 0° 16'·54S., 104° 03'·74E.
 0° 19'·50S., 104° 00'·70E.
 0° 47'·15S., 103° 31'·75E.
 0° 48'·44S., 103° 30'·58E.(shore)

8. Mariners are advised to navigate with caution in the area.

9. Charts will be updated when the works are complete.
(WGS84 DATUM)

Charts affected — 1312 — 2422 — 2435 — 2436 — 2868 — 2870 — 3947

4673(P)/18 INDONESIA - Sumatera - Submarine cable.

Source: Indonesian Notices 8/78/18, 13/135/18, 19/210/18, 33/355/18 and 33/357/18

1. The Indonesia Global Gateway (IGG) submarine cable, has been laid joining the following positions:
2. Segment 2A

1° 38'·64N., 101° 32'·22E.
 1° 39'·01N., 101° 32'·79E.
 1° 38'·97N., 101° 33'·15E.
 1° 39'·75N., 101° 34'·63E.
 1° 40'·47N., 101° 36'·88E.
 1° 41'·78N., 101° 42'·28E.
 1° 41'·64N., 101° 44'·31E.
 1° 39'·61N., 101° 48'·50E.
 1° 35'·09N., 101° 54'·36E.
 1° 35'·52N., 101° 55'·15E.
 1° 36'·23N., 101° 55'·16E.
 1° 37'·03N., 101° 54'·89E.
 1° 39'·62N., 101° 54'·99E.
 1° 42'·04N., 101° 54'·06E.
 1° 45'·49N., 101° 53'·24E.
 1° 46'·16N., 101° 52'·71E.
 1° 46'·86N., 101° 52'·86E.
 1° 48'·46N., 101° 53'·83E.
 1° 48'·57N., 101° 55'·02E.
 1° 48'·06N., 101° 56'·61E.
 1° 45'·33N., 102° 01'·33E.
 1° 44'·94N., 102° 05'·29E.
 1° 45'·11N., 102° 06'·68E.
 1° 44'·91N., 102° 07'·36E.
 1° 45'·04N., 102° 08'·76E.

4673(P)/18 INDONESIA - Sumatera - Submarine cable. (continued)**3. Segment Dumai to Batam**

1° 44'·97N., 102° 08'·28E.
 1° 45'·01N., 102° 08'·93E.
 1° 44'·78N., 102° 09'·98E.
 1° 44'·90N., 102° 10'·17E.
 1° 44'·61N., 102° 11'·44E.
 1° 44'·69N., 102° 14'·38E.
 1° 45'·22N., 102° 15'·06E.
 1° 44'·93N., 102° 16'·78E.
 1° 45'·10N., 102° 17'·09E.
 1° 36'·55N., 102° 34'·51E.
 1° 16'·10N., 103° 03'·54E.
 1° 12'·43N., 103° 19'·57E.
 1° 12'·25N., 103° 21'·36E.
 1° 11'·01N., 103° 23'·27E.
 1° 10'·61N., 103° 23'·36E.
 1° 07'·05N., 103° 29'·19E.
 1° 07'·15N., 103° 29'·33E.
 1° 07'·43N., 103° 29'·28E.
 1° 07'·50N., 103° 29'·30E.
 1° 07'·66N., 103° 29'·06E.

4. Segment Balikpapan

1° 15'·18S., 116° 55'·99E.
 1° 15'·32S., 116° 56'·28E.
 1° 15'·50S., 117° 01'·00E.
 1° 15'·92S., 117° 01'·71E.
 1° 20'·88S., 117° 08'·80E.
 1° 26'·11S., 117° 18'·26E.
 1° 29'·15S., 117° 27'·27E.

5. Segment 4

4° 00'·12S., 107° 10'·47E.
 4° 05'·10S., 107° 09'·08E.
 4° 35'·33S., 107° 04'·75E.
 5° 04'·97S., 107° 03'·45E.
 5° 37'·72S., 106° 57'·50E.
 5° 39'·62S., 106° 56'·77E.
 5° 43'·32S., 106° 53'·12E.
 5° 45'·77S., 106° 49'·48E.
 5° 48'·13S., 106° 42'·63E.
 5° 47'·67S., 106° 41'·33E.
 5° 47'·75S., 106° 38'·75E.
 5° 44'·98S., 106° 36'·72E.
 and
 5° 39'·62S., 106° 56'·77E.
 5° 45'·70S., 107° 08'·38E.
 5° 58'·23S., 107° 07'·62E.

6. Charts will be updated when full details are available.

7. Former Notice 4377(P)/18 is cancelled.

NOTE: Content of Notice unchanged, re-issued to remove Chart 2639 from the list of charts affected.
(WGS84 DATUM)

Chart affected — 3947

637(T)/19 INDONESIA - Sumatera - Buoy.

Source: Indonesian Notice 1/14(T)/19

1. The Isolated danger light-buoy, *Fl(2)5s*, in position 2° 15'·36S., 105° 15'·95E. is reported missing.
(WGS84 DATUM)

Chart affected — 3471

4676(T)/19 MALAYSIA - Peninsular Malaysia, West Coast - Buoyage.

Source: Malaysian Notice 7/182(T)/19

- The following port hand lateral light-buoys have been reported unlit:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
<i>Fl.R.2s</i>	<i>No 2</i>	3° 10'·53N., 101° 14'·74E.
<i>Fl.R.2s</i>	<i>No 10</i>	3° 04'·69N., 101° 19'·95E.
<i>Fl(2)R.10s</i>	<i>No 12</i>	3° 04'·02N., 101° 20'·42E.
<i>Q.R</i>	<i>No 14</i>	3° 03'·29N., 101° 20'·88E.

(WGS84 DATUM)

Charts affected — 2152 — 2155**6060(P)/19 MALAYSIA - Peninsular Malaysia, West Coast - Depths.**

Source: ENC MS3RS2FC

- Depths less than charted exist within *TSS Port Dickson to Tanjung Keling*. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
21m	2° 17'·79N., 101° 49'·62E.
26m	2° 17'·97N., 101° 50'·37E.
22m	2° 14'·76N., 101° 53'·17E.
24m	2° 14'·75N., 101° 54'·33E.

- Charts will be updated when full details are available.

(WGS84 DATUM)

Chart affected — 1146**2024(P)/20 MALACCA STRAIT - Submarine cable.**

Source: Indonesian Notice 11/136/20

- A submarine cable has been laid, joining the following positions:

2° 25'·7N., 100° 20'·8E.
 2° 27'·0N., 100° 25'·8E.
 2° 43'·2N., 100° 32'·2E.
 2° 45'·1N., 100° 39'·2E.
 2° 42'·0N., 100° 45'·8E.
 2° 31'·5N., 100° 54'·2E.
 2° 18'·5N., 101° 10'·4E.
 2° 15'·8N., 101° 25'·1E.
 2° 09'·6N., 101° 35'·3E.
 2° 09'·9N., 101° 37'·3E.
 1° 59'·2N., 101° 54'·6E.
 1° 52'·8N., 101° 51'·7E.
 1° 44'·9N., 101° 52'·8E.
 1° 37'·2N., 101° 54'·6E.
 1° 36'·7N., 101° 55'·2E.
 1° 35'·9N., 101° 55'·4E.
 1° 35'·1N., 101° 55'·0E.
 1° 34'·9N., 101° 54'·6E.
 1° 35'·0N., 101° 53'·9E.
 1° 40'·3N., 101° 47'·2E.
 1° 41'·2N., 101° 42'·7E.
 1° 38'·5N., 101° 32'·4E.

- Charts will be updated when full details are available.

(WGS84 DATUM)

Charts affected — 3940 — 3946 — 3947**165(T)/21 INDONESIA - Sumatera - Wreck.**

Source: Indonesian Notice 52/652/20

- A sunken vessel has been reported in position 1° 09'·50N., 103° 56'·79E.

165(T)/21 INDONESIA - Sumatera - Wreck. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3831 — 3833 — 3937 — 4041

4687(P)/21 INDONESIA - Sumatera - Light-beacon.

Source: Indonesian Notice 30/414/21

1. A light beacon, marking Karang Singa, is being constructed in the vicinity of position 1° 16'·05N., 104° 21'·95E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1312 — 2403 — 2869 — 3831 — 5527

1494(T)/22 MALACCA STRAIT - Wreck. Hulk.

Source: PUSHIDROSAL and UKHO

1. A wreck of a fishing vessel has been reported in position 3° 26'·52N., 100° 32'·82E.
2. The hulk is buoyant and may drift from the reported position.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3901 — 3945

5134(T)/22 MALACCA STRAIT - Buoy.

Source: Malaysian Notice 6/97(T)/22

1. The *Terusan* light-buoy, *Fl.R.10s*, in position 2° 51'·51N., 101° 15'·21E. is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2158

104(T)/23 INDONESIA - Sumatera - Wreck.

Source: Indonesian Notice 50/577(P)/22

1. A sunken vessel exists in position 2° 42'·01S., 105° 51'·23E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3471

1881(P)/23 SINGAPORE - Buoy.

Source: Maritime and Port Authority of Singapore

1. The *HVB-8A* starboard lateral light-buoy, *Fl.G.4s*, in position: 1° 15'·860N., 103° 36'·290E., is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4038 — 4040

2643(T)/24 INDONESIA - Sumatera - Buoy.

Source: Indonesian Notice 12/120T/24

1. The lateral light-buoy, *Fl.R.6s No 8*, in position 3° 24'·53N., 99° 27'·93E. is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3584 — 3921

3053(T)/24 INDONESIA - Sumatera - Wreck.

Source: Indonesian Notice 13/133/24

1. A sunken vessel has been reported in position 3° 50'·64N., 98° 56'·26E.

3053(T)/24 INDONESIA - Sumatera - Wreck. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3901 — 3921

3239(P)/24 SINGAPORE STRAIT - Submarine cable.

Source: Maritime and Port Authority of Singapore

1. A submarine cable has been laid joining the following positions:
Segment 1.1 – BU1 – Segment 1.2

1° 12'·97N., 103° 37'·08E.
1° 12'·58N., 103° 36'·98E.
1° 12'·39N., 103° 36'·84E.
1° 11'·81N., 103° 35'·94E.
1° 11'·80N., 103° 35'·35E.
1° 11'·68N., 103° 35'·14E.
1° 11'·08N., 103° 34'·98E.
1° 11'·02N., 103° 34'·68E.
1° 06'·50N., 103° 31'·59E.
1° 05'·06N., 103° 33'·31E.
1° 04'·55N., 103° 33'·41E.
1° 01'·32N., 103° 39'·03E.
1° 01'·35N., 103° 39'·74E.
1° 05'·83N., 103° 45'·36E.
1° 06'·93N., 103° 45'·24E.
1° 08'·42N., 103° 47'·12E.
1° 09'·21N., 103° 49'·01E.
1° 11'·51N., 103° 53'·01E.
1° 13'·47N., 103° 57'·74E.
1° 13'·87N., 104° 02'·13E.
1° 14'·07N., 104° 03'·83E.
1° 14'·16N., 104° 15'·30E.
1° 14'·72N., 104° 17'·29E.
1° 15'·53N., 104° 17'·76E.
1° 16'·32N., 104° 19'·89E.
1° 17'·86N., 104° 21'·58E.
1° 18'·64N., 104° 21'·88E.
1° 21'·68N., 104° 25'·26E.
1° 22'·40N., 104° 26'·67E.
1° 22'·32N., 104° 27'·11E.
1° 25'·93N., 104° 32'·68E.
1° 29'·68N., 104° 37'·43E.
1° 30'·24N., 104° 38'·17E.

STUB 1

1° 10'·84N., 103° 33'·75E.
1° 10'·83N., 103° 33'·82E.
1° 10'·78N., 103° 34'·17E.
1° 10'·76N., 103° 34'·35E.
1° 10'·78N., 103° 34'·46E.
1° 10'·80N., 103° 34'·50E.

STUB 2

1° 09'·09N., 103° 32'·76E.
1° 09'·23N., 103° 32'·81E.
1° 09'·15N., 103° 33'·10E.
1° 09'·13N., 103° 33'·20E.
1° 09'·15N., 103° 33'·29E.
1° 09'·23N., 103° 33'·43E.
1° 09'·26N., 103° 33'·45E.

2. Mariners are advised to navigate with caution in the area.

3239(P)/24 SINGAPORE STRAIT - Submarine cable. (continued)

3. These changes will be included in the next New Edition of Charts 4030, 4036, 4038, 4039, 4040, 4041, 4042 & ENC's SG5C4030, SG5C4036, SG5C4039, SG5C4041 (WGS84 DATUM)

Charts affected — 4036 — 4038 — 4039 — 4040 — 4041 — 4042

3799(T)/24 MALACCA STRAIT - Wreck. Buoy.

Source: Marine Department, Malaysia Notice 99(T)/24

1. A wreck, marked by an isolated danger light-buoy, *Fl(2)10s*, has been reported in position 2° 49'·55N., 101° 16'·33E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2139 — 2158 — 3901 — 3902 — 3946

4207(T)/24 SINGAPORE - Obstructions.

Source: Maritime and Port Authority of Singapore

1. Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
3·3m	1° 17'·475N., 103° 43'·333E.
13·4m	1° 17'·417N., 103° 43'·477E.
15·6m	1° 17'·253N., 103° 43'·697E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4034

4479(P)/24 SINGAPORE - Submarine pipeline.

Source: Maritime and Port Authority of Singapore

1. A buried water pipeline tunnel exists joining the following positions:

1° 16'·841N., 103° 38'·942E.
 1° 16'·727N., 103° 39'·307E.
 1° 16'·683N., 103° 39'·403E.
 1° 16'·640N., 103° 39'·466E.
 1° 16'·587N., 103° 39'·523E.
 1° 16'·540N., 103° 39'·564E.
 1° 16'·433N., 103° 39'·640E.
 1° 16'·431N., 103° 39'·637E.
 1° 16'·541N., 103° 39'·559E.
 1° 16'·588N., 103° 39'·519E.
 1° 16'·636N., 103° 39'·465E.
 1° 16'·679N., 103° 39'·403E.
 1° 16'·722N., 103° 39'·311E.
 1° 16'·838N., 103° 38'·940E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4038 — 4040

4919(T)/24 MALACCA STRAIT - Wreck.

Source: Marine Department, Malaysia Notice 146(T)/24

1. A dangerous wreck has been reported in position 1° 26'·43N., 102° 59'·94E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3902 — 3947

5006(P)/24 SINGAPORE - Submarine cable.

Source: Maritime and Port Authority of Singapore

1. A submarine cable has been laid joining the following positions:

1° 12'·97N., 103° 37'·12E.
 1° 12'·33N., 103° 36'·90E.
 1° 11'·71N., 103° 36'·01E.
 1° 11'·71N., 103° 35'·53E.
 1° 06'·32N., 103° 31'·47E.
 1° 06'·18N., 103° 31'·20E.

2. Mariners are advised to navigate with caution in the area.
3. These changes will be included in the next New Editions of Charts 4030, 4038, 4039 and 4040.
4. Former Notice 3728(P)/23 is cancelled.
(WGS84 DATUM)

Charts affected — 4038 — 4039 — 4040**5884(T)/24 SINGAPORE STRAIT - Wreck.**

Source: Indonesian Notice 48/472/24

1. A sunken vessel, *Mutiara Kencana*, has been reported in the vicinity of position 1° 11'·48N., 103° 28'·14E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2403 — 3833 — 3902 — 3947**1403(T)/25 MALACCA STRAIT - Buoy.**

Source: Malaysian Notice 11/246(T)/24

1. P. Jarak light-buoy, *Fl.Y.5s*, in position 3° 57'·83N., 100° 05'·37E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3921 — 3944 — 3945**1407(T)/25 MALAYSIA - Peninsular Malaysia, West Coast - Buoy.**

Source: Malaysian Notice 11/247(T)/24

1. Penyu light-buoy, *Fl.G.5s*, in position 3° 14'·97N., 101° 09'·90E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2139 — 2155 — 3901 — 3945**1408(T)/25 MALAYSIA - Peninsular Malaysia, West Coast - Buoyage.**

Source: Marine Department, Malaysia Notice 20(T)/2025

1. The following light-buoys have been moved:

<i>Characteristic</i>	<i>Designation</i>	<i>Former Position</i>	<i>New Position</i>
<i>Fl.R.2s</i>	<i>NO.2</i>	3° 10'·53N., 101° 14'·74E.	3° 10'·57N., 101° 14'·75E.
<i>Q.R</i>	<i>NO.14</i>	3° 03'·29N., 101° 20'·88E.	3° 03'·33N., 101° 20'·92E.
<i>Q.G</i>	<i>Buas Buas</i>	2° 53'·76N., 101° 15'·97E.	2° 53'·75N., 101° 16'·02E.
<i>Fl.G.5s</i>	<i>Selat</i>	2° 52'·61N., 101° 15'·71E.	2° 52'·60N., 101° 15'·75E.
<i>Fl.G.3s</i>	<i>Pintu Gedung</i>	2° 51'·44N., 101° 15'·49E.	2° 51'·43N., 101° 15'·53E.
<i>Fl(3)R.10s</i>	<i>Tenteram</i>	2° 53'·82N., 101° 15'·67E.	2° 53'·82N., 101° 15'·62E.
<i>Fl.R.10s</i>	<i>Terusan</i>	2° 51'·51N., 101° 15'·21E.	2° 51'·51N., 101° 15'·15E.
<i>Fl(2)R.10s</i>	<i>Tengah</i>	2° 52'·67N., 101° 15'·44E.	2° 52'·67N., 101° 15'·38E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2152 — 2155 — 2157 — 2158

2052(T)/25 SINGAPORE - Depth. Obstructions.

Source: Maritime and Port Authority of Singapore

1. High spot and obstructions with least depth below CD exists off Pulau Tekong.

<i>Feature</i>	<i>Depth</i>	<i>Position</i>
High Spot	1·7m	1° 26'·50N., 104° 01'·97E.
Obstruction	3·1m	1° 26'·04N., 104° 01'·13E.
Obstruction	9·5m	1° 23'·41N., 104° 05'·13E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4043 — 4044**2072(P)/25 SINGAPORE - Submarine cables.**

Source: Maritime and Port Authority of Singapore

1. Submarine cables have been laid joining the following positions:
a. Segment 2.2

1° 15'·080N., 104° 19'·500E.
 1° 14'·267N., 104° 15'·458E.
 1° 14'·248N., 104° 08'·745E.
 1° 14'·587N., 104° 05'·005E.
 1° 13'·563N., 103° 57'·636E.
 1° 11'·728N., 103° 53'·079E.
 1° 07'·042N., 103° 45'·099E.
 1° 05'·943N., 103° 44'·801E.
 1° 01'·800N., 103° 40'·099E.
 1° 01'·659N., 103° 39'·531E.
 1° 01'·791N., 103° 38'·788E.
 1° 04'·525N., 103° 34'·465E.
 1° 06'·581N., 103° 31'·527E.
 1° 06'·807N., 103° 31'·501E.
 1° 11'·529N., 103° 34'·679E.
 1° 11'·664N., 103° 35'·926E.
 1° 12'·265N., 103° 36'·888E.
 1° 12'·977N., 103° 37'·189E.

b. Stub West

1° 12'·270N., 103° 36'·840E.
 1° 12'·327N., 103° 36'·900E.
 1° 12'·510N., 103° 37'·022E.
 1° 12'·977N., 103° 37'·189E.

c. Stub East

1° 11'·682N., 103° 36'·081E.
 1° 12'·024N., 103° 36'·641E.
 1° 12'·245N., 103° 36'·907E.
 1° 12'·376N., 103° 37'·002E.
 1° 12'·485N., 103° 37'·058E.
 1° 12'·977N., 103° 37'·189E.

2. Mariners are advised to navigate with caution in the area.
3. These changes will be included in the next New Edition of Dual-Badged Charts 4030, 4038, 4039, 4040, 4041 and 4042.
4. Charts 1312, 2403, 2422, 2869, 3831, 3833, 3947, 3948 and 3949 will be updated by Notice to Mariners.
(WGS84 DATUM)

Charts affected — 4038 — 4039 — 4040 — 4041

3080(P)/25 SINGAPORE - Alongside depths. Berths.

Source: Maritime and Port Authority of Singapore

1. Least alongside depths have changed for the following berths:

<i>Berth</i>	<i>Alongside Depth (Year Surveyed)</i>	<i>Position</i>
OS3	10·1m (2025)	1° 13'·880N., 103° 46'·496E.
OS4	11·0m (2025)	1° 13'·975N., 103° 46'·401E.
OS9	12·7m (2025)	1° 14'·392N., 103° 45'·917E.
OS10	15·3m (2025)	1° 13'·676N., 103° 46'·691E.
OS10B	5·2m (2025)	1° 13'·675N., 103° 46'·647E.
OS11	5·3m (2025)	1° 14'·290N., 103° 45'·570E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4032 — 4035**3230(T)/25 MALACCA STRAIT - Dredging area. Works.**

Source: Marine Department, Malaysia Notice 134(T)/25

1. Dredging works are taking place in an area bounded by the following positions:

1° 56'·00N., 102° 20'·50E.
 1° 57'·37N., 102° 20'·50E.
 1° 57'·80N., 102° 22'·02E.
 1° 51'·12N., 102° 31'·66E.
 1° 48'·50N., 102° 39'·25E.
 1° 47'·57N., 102° 39'·25E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 3902 — 3947**3470(P)/25 SINGAPORE - Alongside depths. Berths.**

Source: Maritime and Port Authority of Singapore

1. Least alongside depths have changed for the following berths:

<i>Berth</i>	<i>Alongside Depth (Year Surveyed)</i>	<i>Position</i>
OTS2	15·2m (2025)	1° 14'·39N., 103° 44'·99E.
OTS3	13·2m (2025)	1° 14'·32N., 103° 44'·94E.
OTS4	11·8m (2025)	1° 14'·33N., 103° 45'·04E.
OTS6W	7·0m (2025)	1° 14'·26N., 103° 44'·96E.
OTS6E	10·7m (2025)	1° 14'·24N., 103° 45'·03E.
OTS10	15·9m (2025)	1° 14'·23N., 103° 44'·19E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4032**3471(P)/25 SINGAPORE - Alongside depths. Berths.**

Source: Maritime and Port Authority of Singapore

1. Least alongside depths have changed for the following berths:

<i>Berth</i>	<i>Alongside Depth (Year Surveyed)</i>	<i>Position</i>
CM1	11·0m (2025)	1° 15'·98N., 103° 51'·68E.
CM2	10·8m (2025)	1° 15'·92N., 103° 51'·61E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4037

3472(P)/25 SINGAPORE - Alongside depths. Berths.

Source: Maritime and Port Authority of Singapore

- Least alongside depths have changed for the following berths:

<i>Berth</i>	<i>Alongside Depth (Year Surveyed)</i>	<i>Position</i>
OS13 (Pulau Ular)	10·3m (2025)	1° 14'·28N., 103° 45'·42E.
ECC Quay	8·1m (2025)	1° 13'·64N., 103° 45'·36E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4032**3493(P)/25 SINGAPORE - Wreck.**

Source: Maritime and Port Authority of Singapore

- A wreck, least depth 4·6m, exists in position 1° 17'·649N., 103° 45'·311E. , within the mooring area for harbour craft off West Coast Pier.
- Mariners are advised to navigate with caution in the area.
- Former Notice 4478(P)/24 is cancelled.
(WGS84 DATUM)

Chart affected — 4034**3774(T)/25 SINGAPORE - Buoy.**

Source: Maritime and Port Authority of Singapore

- A yellow special light-buoy, *Fl.Y.3s NTU-Kusu*, has been established in position 1° 13'·332N., 103° 51'·798E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4037 — 4040 — 4041**3939(P)/25 INDONESIA - Sumatera - Submarine cable. Works.**

Source: Indonesian Notice 25/225(P)/25

- A submarine cable is being laid from Batam to Jakarta, joining the following positions:

1° 10'·02N., 104° 08'·32E.
 1° 10'·00N., 104° 08'·47E.
 1° 12'·90N., 104° 09'·39E.
 1° 12'·92N., 104° 09'·41E.
 1° 12'·93N., 104° 09'·43E.
 1° 16'·60N., 104° 28'·24E.
 1° 17'·41N., 104° 42'·27E.
 1° 17'·47N., 104° 42'·41E.
 1° 12'·11N., 104° 55'·82E.
 0° 43'·18N., 105° 31'·46E.
 0° 42'·99N., 105° 31'·61E.
 1° 04'·54S., 106° 50'·87E.
 2° 27'·88S., 109° 05'·19E.
 2° 28'·21S., 109° 05'·43E.
 2° 37'·82S., 109° 08'·81E.
 2° 38'·13S., 109° 08'·82E.
 5° 35'·43S., 107° 12'·98E.
 5° 52'·38S., 107° 09'·28E.
 5° 58'·18S., 107° 07'·73E.
 5° 58'·27S., 107° 07'·65E.

- Charts will be updated when works are complete.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 1066 — 1312 — 2137 — 2403 — 2414 — 2470 — 2797 — 2862 — 2869 — 2870 — 2872 — 2873 — 3482 — 3729 — 3757 — 3758 — 3831 — 3949 — 4042 — 4708

4027(T)/25 MALACCA STRAIT - Buoy.

Source: Marine Department, Malaysia Notice 169(T)/25

1. Tengah light-buoy, *Fl(2)R.10s*, in position $2^{\circ} 52' \cdot 67N.$, $101^{\circ} 15' \cdot 44E.$ is reported unlit.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2157 — 2158

4663(T)/25 SINGAPORE - Alongside depths.

Source: Maritime and Port Authority of Singapore

1. Least depths alongside have changed for the following berths:

<i>Berth</i>	<i>Alongside Depth (Year Surveyed)</i>	<i>Position</i>
OM1	11·8m (2025)	$1^{\circ} 17' \cdot 846N.$, $103^{\circ} 41' \cdot 358E.$
OM2	11·2m (2025)	$1^{\circ} 17' \cdot 822N.$, $103^{\circ} 41' \cdot 218E.$
OM3	10·0m (2025)	$1^{\circ} 17' \cdot 853N.$, $103^{\circ} 41' \cdot 218E.$
OM5	14·5m (2025)	$1^{\circ} 17' \cdot 597N.$, $103^{\circ} 41' \cdot 595E.$
OM7	14·1m (2025)	$1^{\circ} 17' \cdot 500N.$, $103^{\circ} 41' \cdot 236E.$
OM8	11·9m (2025)	$1^{\circ} 17' \cdot 809N.$, $103^{\circ} 41' \cdot 136E.$
OM9	10·4m (2025)	$1^{\circ} 17' \cdot 842N.$, $103^{\circ} 41' \cdot 129E.$

2. Mariners are advised to navigate with caution.
(WGS84 DATUM)

Chart affected — 4033

4665(T)/25 SINGAPORE - Buoy. Light-beacon.

Source: Maritime and Port Authority of Singapore

1. The beacon, *Fl(3)R.15s5m3M Pioneer*, in position $1^{\circ} 17' \cdot 238N.$, $103^{\circ} 39' \cdot 398E.$ has been removed for maintenance.
2. A red can light-buoy, *Fl(3)R.15s Pioneer*, has been established at the same position.
3. Mariners are advised to navigate with caution.
(WGS84 DATUM)

Chart affected — 4033

5685(P)/25 INDONESIA - Sumatera - Submarine cable.

Source: Indonesian Notice 41/366(P)/25

1. Submarine cable laying operations are taking place in connection with Asia Link Cable (ALC) system, joining the following positions:

$1^{\circ} 01' \cdot 004N.$, $103^{\circ} 34' \cdot 756E.$
 $1^{\circ} 17' \cdot 287N.$, $104^{\circ} 07' \cdot 610E.$
 $1^{\circ} 17' \cdot 221N.$, $104^{\circ} 08' \cdot 703E.$
 $1^{\circ} 17' \cdot 573N.$, $104^{\circ} 10' \cdot 225E.$
 $1^{\circ} 16' \cdot 951N.$, $104^{\circ} 10' \cdot 755E.$
 $1^{\circ} 17' \cdot 054N.$, $104^{\circ} 12' \cdot 420E.$
 $1^{\circ} 17' \cdot 006N.$, $104^{\circ} 15' \cdot 715E.$
 $1^{\circ} 17' \cdot 356N.$, $104^{\circ} 18' \cdot 830E.$
 $1^{\circ} 18' \cdot 376N.$, $104^{\circ} 20' \cdot 854E.$
 $1^{\circ} 19' \cdot 934N.$, $104^{\circ} 21' \cdot 147E.$
 $1^{\circ} 20' \cdot 007N.$, $104^{\circ} 21' \cdot 179E.$
 $1^{\circ} 22' \cdot 466N.$, $104^{\circ} 24' \cdot 438E.$
 $1^{\circ} 23' \cdot 625N.$, $104^{\circ} 25' \cdot 012E.$
 $1^{\circ} 26' \cdot 815N.$, $104^{\circ} 29' \cdot 220E.$
 $1^{\circ} 29' \cdot 667N.$, $104^{\circ} 32' \cdot 370E.$
 $1^{\circ} 39' \cdot 603N.$, $104^{\circ} 37' \cdot 091E.$
 $1^{\circ} 40' \cdot 022N.$, $104^{\circ} 38' \cdot 693E.$
 $1^{\circ} 49' \cdot 675N.$, $104^{\circ} 41' \cdot 960E.$
 $1^{\circ} 51' \cdot 197N.$, $104^{\circ} 42' \cdot 442E.$
 $1^{\circ} 52' \cdot 503N.$, $104^{\circ} 41' \cdot 616E.$
 $2^{\circ} 06' \cdot 007N.$, $104^{\circ} 46' \cdot 147E.$
 $2^{\circ} 09' \cdot 181N.$, $104^{\circ} 44' \cdot 614E.$

5685(P)/25 INDONESIA - Sumatera - Submarine cable. (continued)

2° 37'·978N., 104° 52'·119E.
2° 40'·808N., 105° 07'·428E.
2° 46'·112N., 105° 08'·286E.

3° 09'·794N., 105° 20'·287E.
3° 15'·533N., 105° 25'·863E.
3° 21'·776N., 105° 34'·247E.
3° 21'·929N., 105° 34'·341E.
3° 29'·757N., 105° 33'·374E.
3° 40'·416N., 105° 44'·759E.
3° 45'·459N., 106° 03'·651E.
3° 41'·949N., 106° 09'·725E.
4° 02'·685N., 106° 56'·817E.
5° 12'·782N., 107° 58'·815E.
6° 09'·412N., 110° 21'·675E.
6° 26'·378N., 110° 29'·947E.
6° 28'·826N., 110° 34'·839E.
6° 29'·840N., 110° 42'·820E.
6° 42'·264N., 110° 47'·061E.
6° 51'·779N., 110° 57'·408E.

2. Charts will be updated when works are complete.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

**Charts affected — 1312 — 1348 — 2403 — 2414 — 2422 — 2435 — 2436 — 2470 — 2868 — 2869 — 3445 —
3482 — 3831 — 3833 — 3902 — 3937 — 3948**

5844(P)/25 SINGAPORE - Buoy.

Source: Maritime and Port Authority of Singapore

1. The *Shell SBM* buoy, *Fl.Y.5s*, in position 1° 11'·468N., 103° 47'·429E., has been temporarily removed.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3833 — 4035 — 4036 — 4039 — 4040 — 4041 — 5524

(14) CHINA SEA WITH ITS WEST SHORE AND CHINA

5218(T)/14 THAILAND - Gulf of Thailand Coast - Platforms.

Source: 104(T)/2557 (2014)

1. Platforms are being installed in the following approximate positions

<i>Designation</i>	<i>Position</i>
B	11° 41'·80N., 100° 32'·45E.
C	11° 46'·72N., 100° 32'·50E.

2. Mariners are requested to maintain a distance of at least 2 nautical miles clear of the above positions.
(WGS84 Datum)
3. Charts will be updated when full details become available
4. Former Notice 3714(T)/14 is cancelled

Charts affected — 67 — 2414 — 3965**877(P)/16 CHINA - Yellow Sea Coast - Precautionary area.**

Source: Chinese Notice 52/Section 1/15

1. Due to frequent collisions between merchant and fishing vessels a heavy traffic area has been established within an area bounded by the following positions:
 36° 57'·00N., 122° 42'·70E.
 36° 57'·00N., 122° 56'·60E.
 36° 35'·00N., 122° 56'·60E.
 36° 35'·00N., 122° 42'·70E.
2. Mariners are advised to operate with caution, keep good lookout, navigate at safe speed and display lights and signals as required.
3. A wide berth should be given to fishing vessels and vessels with restricted manoeuvrability.
4. Charts will be updated when full details are available.
(WGS84 Datum)

Charts affected — 1254 — 1256 — 1289 — 3480**1407(T)/16 GULF OF THAILAND - Platform.**

Source: UKHO

1. * A platform has been reported to exist in the vicinity of position 10° 22'·30N., 103° 17'·65E.
2. Mariners are advised to navigate with caution in the area.
3. Former Notice 696(T)/12 is cancelled.
* Indicates new or revised entry
(WGS84 Datum)

Charts affected — 2103 — 3879 — 3967**3206(T)/16 VIETNAM - Buoyage.**

Source: VMS-South Notice 87/16

1. Three special mark light-buoys, *Fl(4)Y.12s*, exist in the vicinity of 11° 17'·70N., 108° 47'·87E. due to the construction of an outfall pipe.
2. Mariners are advised to navigate with caution in the area.
(WGS84 Datum)

Chart affected — 3987**491(T)/17 THAILAND - Gulf of Thailand Coast - Restricted areas.**

Source: Thai Notice 45(T)/2559(2016)

1. Restricted areas, radius 2M, marking unexploded ordnance, have been established centred on the following positions:
 12° 30'·00N., 100° 55'·90E.
 12° 29'·00N., 100° 56'·10E.

491(T)/17 THAILAND - Gulf of Thailand Coast - Restricted areas. (continued)

2. Mariners are advised not to approach these areas.
(WGS84 DATUM)

Charts affected — 1046 — 3727 — 3965 — 3966

3056(T)/18 VIETNAM - Wreck.

Source: VMS-North Notice 92(T)/18

1. A wreck exists in position 20° 56'·66N., 106° 45'·99E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3875

5260(T)/18 MALAYSIA - Peninsular Malaysia, East Coast - Wreck.

Source: Marine Department, Malaysia Notice 133(T)/18

1. A dangerous wreck has been reported in approximate position 4° 27'·25N., 103° 35'·10E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2422 — 3446

835(P)/19 VIETNAM - Buoyage.

Source: VMS-South Notice 254/18

1. Special light-buoys *Fl(3+1)12s*, marking the construction of a power cable, have been established in the following positions:

<i>Designation</i>	<i>Position</i>
<i>KB1</i>	10° 04'·03N., 104° 04'·57E.
<i>KB2</i>	10° 04'·47N., 104° 03'·26E.
<i>KB3</i>	10° 04'·95N., 104° 07'·21E.
<i>KB4</i>	10° 04'·82N., 104° 05'·89E.
<i>KB5</i>	10° 14'·29N., 104° 31'·88E.
<i>KB6</i>	10° 14'·85N., 104° 30'·75E.
<i>KB7</i>	10° 14'·26N., 104° 34'·00E.
<i>KB8</i>	10° 14'·82N., 104° 33'·04E.

2. Mariners are advised to navigate with caution in the area.
3. Chart 3879 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 3879

2660(T)/19 VIETNAM - Wreck.

Source: NGA HydroPac 1364/19(93)

1. A wreck has been reported in position 20° 46'·03N., 107° 11'·24E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3875 — 3888

3109(T)/19 CHINA - East Coast - Buoy.

Source: mv Ust Luga

1. The ODAS super-buoy, *Mo(O)Y.12s*, in position 31° 15'·0N., 123° 30'·0E. is reported to be unlit and off station.
(CGCS 2000 DATUM)

Charts affected — 1199 — 2412 — 3480

4141(T)/19 TAIWAN - Works.

Source: Taiwanese Notice 179/16 and UKHO

1. Dumping work has taken place within an area bounded by the following positions:

22° 32'·16N., 120° 16'·76E.

22° 32'·41N., 120° 17'·11E.

22° 31'·00N., 120° 18'·26E.

22° 30'·76N., 120° 17'·92E.

2. Depths less than charted may exist in the area.
3. Mariners are advised to navigate with caution in the area.
4. Former Notice 49(T)/17 is cancelled.
(WGS84 DATUM)

Chart affected — 3232**4737(P)/19 CHINA - East Coast - Submarine pipeline.**

Source: Chinese Notice 31/1048(T)/19

1. Submarine pipeline laying operations are taking place in the vicinity of a line joining the following positions:

30° 08'·33N., 122° 06'·98E.

30° 09'·30N., 122° 08'·68E.

2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1304**5385(T)/19 CHINA - Bo Hai - Depth.**

Source: Chinese Bulletin Section 1 36/19

1. Depths of 22m exist alongside at Caofeidian Gangqu Ore Pier, position 38° 54'·83N., 118° 30'·09E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 2657**5627(T)/19 CHINA - South Coast - Works.**

Source: Chinese Notice 38/1281(T)/19

1. Submarine cable laying works are taking place within areas bounded by the following positions:

Chart 1723, Panel A

25° 14'·39N., 119° 32'·80E.

25° 13'·40N., 119° 33'·86E.

25° 12'·90N., 119° 32'·80E.

and

25° 17'·16N., 119° 32'·80E.

25° 17'·25N., 119° 36'·21E.

25° 15'·66N., 119° 37'·81E.

25° 12'·99N., 119° 34'·84E.

25° 15'·66N., 119° 32'·80E.

Chart 1723, Panel B

25° 14'·00N., 119° 30'·00E.

25° 16'·07N., 119° 28'·02E.

25° 17'·13N., 119° 30'·87E.

25° 14'·73N., 119° 32'·44E.

25° 14'·00N., 119° 33'·22E.

and

25° 14'·61N., 119° 33'·60E.

25° 17'·13N., 119° 31'·68E.

25° 17'·18N., 119° 33'·60E.

5627(T)/19 CHINA - South Coast - Works. (continued)**Chart 1716**

25° 17'·00N., 119° 36'·46E.
 25° 15'·66N., 119° 37'·81E.
 25° 12'·99N., 119° 34'·84E.
 25° 17'·00N., 119° 31'·77E.

Chart 2401

25° 17'·13N., 119° 30'·87E.
 25° 14'·73N., 119° 32'·44E.
 25° 13'·40N., 119° 33'·87E.
 25° 12'·57N., 119° 32'·08E.
 25° 13'·74N., 119° 30'·25E.
 25° 16'·07N., 119° 28'·02E.
 and
 25° 17'·25N., 119° 36'·21E.
 25° 15'·66N., 119° 37'·81E.
 25° 12'·99N., 119° 34'·84E.
 25° 17'·13N., 119° 31'·68E.

2. Mariners are advised to navigate with caution in the area.
 (CGCS 2000 DATUM)

Charts affected — 1716 — 2401

1660(T)/20 THAILAND - Gulf of Thailand Coast - Buoyage.

Source: Thai Notices 33(T)/2562(2019) and 4(T)/2563(2020)

- *Buoyage in the approaches to Sattahip Commercial Port between positions 12° 37'·84N., 100° 54'·57E. and 12° 36'·65N., 100° 54'·63E. has been temporarily withdrawn.
- Mariners are advised to navigate with caution in the area.
- Former Notice 416(T)/20 is cancelled.
 * Indicates new or revised entry.
 (WGS84 DATUM)

Charts affected — 1046 — 3724 — 3727

2225(P)/20 CHINA - East Coast - Vertical clearance.

Source: UKHO

- The vertical clearance of Sutong Bridge (31° 46'·67N., 120° 59'·72E .) has been reported as 59m.
 (WGS84 DATUM)

Chart affected — 1604

2620(T)/20 CHINA - Yellow Sea Coast - Pier.

Source: Chinese Notice 15/516(T)/20

- Pier construction works are taking place, in an area bounded by the following positions:
 36° 00'·845N., 120° 14'·182E.
 36° 01'·106N., 120° 14'·591E.
 36° 01'·211N., 120° 14'·492E.
 36° 00'·902N., 120° 14'·000E.
 (WGS84 DATUM)

Charts affected — 1505 — 1506

3867(T)/20 MALAYSIA - Peninsular Malaysia, East Coast - Anchorage area.

Source: Malaysian Notice 6/87(T)/20

- An anchorage area has been established, bounded by the following positions:
 5° 57'·10N., 102° 29'·00E.
 5° 57'·80N., 102° 30'·10E.
 5° 57'·30N., 102° 30'·50E.
 5° 56'·50N., 102° 29'·60E.

3867(T)/20 MALAYSIA - Peninsular Malaysia, East Coast - Anchorage area. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3447

4508(T)/20 TAIWAN STRAIT - Wreck.

Source: UKHO

1. A dangerous wreck has been reported to exist in approximate position 23° 04'·0N., 118° 33'·0E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1968 — 3489

4813(P)/20 CHINA - Bo Hai - Depths.

Source: mv Solaris

1. Depths in the approach channel to Dagang Gangqu, in the vicinity of position 38° 45'·88N., 117° 55'·39E. have been reported to be deeper than charted.
2. Mariners are advised to contact the local port authority for the latest information.
3. Charts will be updated when full details are available.
(CGCS 2000 DATUM)

Charts affected — 1250 — 2645

5637(P)/20 SOUTH CHINA SEA - Fish havens.

Source: UKHO

1. Numerous Fish Aggregating Devices have been reported to exist within 60M of the following positions:
17° 31'·6N., 118° 49'·6E.
15° 57'·1N., 118° 00'·3E.
13° 12'·7N., 118° 22'·4E.
8° 48'·8N., 116° 03'·7E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1338 — 3483 — 3489 — 4411 — 4414 — 4464 — 4507 — 4508 — 4509

6104(T)/20 VIETNAM - Wreck.

Source: VMS-North Notice 193(T)/20

1. A wreck has been reported in position 16° 55'·6N., 107° 13'·0E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3989

6269(T)/20 VIETNAM - Wreck.

Source: VMS-North Notice 201(T)/20

1. A wreck exists in position 15° 29'·0N., 108° 43'·7E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3988

751(T)/21 TAIWAN - Obstructions.

Source: UKHO

1. It has been reported that 12 containers have been lost in position 24° 56'·80N., 120° 28'·10E.

751(T)/21 TAIWAN - Obstructions. (continued)

- Mariners are advised to navigate with caution in this area.
(WGS84 DATUM)

Charts affected — 1761 — 1968 — 3231

1320(T)/21 CHINA - Bo Hai - Wreck.

Source: Yamal Spirit

- A dangerous wreck has been reported in approximate position 38° 45' .83N., 117° 43' .79E.
- Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 2645

1435(T)/21 CHINA - South Coast - Works. Buoyage. Reclamation area. Automatic Identification Systems.

Source: Hong Kong Notices 18/45(T)/19, 3/12(T)/19 and 2/2(T)-3(T)/21

- Works involving the construction of a seawall and breakwater, are being carried out, within the area bounded by the following positions:

 22° 11' .37N. , 113° 59' .66E.
 22° 11' .37N. , 113° 59' .79E.
 22° 11' .16N. , 113° 59' .79E.
 22° 11' .09N. , 113° 59' .55E.
 22° 11' .11N. , 113° 59' .47E.
 22° 11' .27N. , 113° 59' .46E.
- Yellow light-buoys will mark the positions of anchors extending from a semi-submersible barge and a working area of approximately 250m will be established around the vessel.
- *Yellow light-buoys will mark the positions of anchors extending from a crane barge and dumb lighter and a working area of approximately 100m will be established around each vessel.
- Land reclamation works, marked by yellow light-buoys with AIS, are being carried out, within the area bounded by the following positions:

 22° 11' .33N. , 113° 59' .46E.
 22° 11' .15N. , 113° 59' .47E.
 22° 11' .14N. , 113° 59' .29E.
 22° 11' .14N. , 113° 59' .29E.
 22° 11' .37N. , 113° 58' .74E.
 22° 11' .49N. , 113° 58' .71E.
 22° 11' .60N. , 113° 58' .76E.
 22° 11' .66N. , 113° 58' .82E.
 22° 11' .66N. , 113° 58' .94E.
- Yellow light-buoys will mark the positions of anchors extending from the working vessels and a working area of approximately 50m will be established around each vessel.
- Mariners are advised to navigate with caution in these areas.
- Former Notice 5171(T)/19 is cancelled.
* Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 341 — 3026 — 4129

1470(T)/21 VIETNAM - Works. Offshore installation.

Source: VMS-South Notice 25/21

- Drilling works are taking place until, October 2021, in the following positions:

 16° 47' .0N., 108° 28' .8E.
 16° 55' .0N., 108° 12' .7E.
- Passing vessels should keep 2M clear of the operation areas.

1470(T)/21 VIETNAM - Works. Offshore installation. (continued)

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3488 — 3988 — 3989

1471(P)/21 VIETNAM - Submarine power cable. Buoyage.

Source: VMS-South Notice 278/20

1. A submarine power cable is being laid in the vicinity of Banc de Pâques. The cable is marked by two yellow special purpose light buoys, *Fl(3+1)Y.12s*, in the following positions:

Designation Position

PH-01 13° 35'·06N., 109° 17'·73E.

PH-02 13° 36'·14N., 109° 20'·28E.

2. Chart 3874 will be updated when full details become available.
(WGS84 DATUM)

Chart affected — 3874

2042(T)/21 CHINA - South Coast - Dredged area.

Source: Chinese Chart 16781

1. Dredging is in progress in the area to the West side of the Dong Hangdao channel, in the vicinity of position 21° 36'·15N., 108° 38'·49E., with considerable changes to depths.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Chart affected — 3999

3513(P)/21 CHINA - Bo Hai - Depths.

Source: Chinese Bulletin Section 1 32/21

1. Depths less than charted exist in the approach channel to Caofeidian Gangqu Basin No 3, within an area bounded by the following positions:

38° 58'·23N., 118° 41'·01E.

38° 59'·10N., 118° 40'·45E.

38° 59'·04N., 118° 40'·31E.

38° 58'·17N., 118° 40'·87E.

2. Mariners are advised to navigate with caution in the area.
3. Chart 2657 will be updated when full details are available.
(CGCS 2000 DATUM)

Chart affected — 2657

3775(T)/21 CHINA - East Coast - Buoyage.

Source: Chinese Notice 18/630/21

1. Emergency wreck marking buoys, *Al.Oc.BuY.3s*, have been established in the following positions:

30° 08'·48N., 121° 52'·96E.

30° 08'·21N., 121° 53'·16E.

2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1304

4767(T)/21 CHINA - South Coast - Submarine cable.

Source: Chinese Notice 2/58(T)/20

1. Submarine cable laying operations are taking place, joining the following positions:

21° 23'·04N., 112° 17'·03E.

21° 30'·42N., 112° 17'·01E.

21° 30'·92N., 112° 09'·95E.

4767(T)/21 CHINA - South Coast - Submarine cable. (continued)

2. Mariners are advised to navigate with caution in the area.
3. * Former Notice 980(T)/20 is cancelled.
* Indicates new or revised entry.
(CGCS 2000 DATUM)

Charts affected — 1537 — 1555

4851(T)/21 CHINA - East Coast - Buoy. Wreck.

Source: Chinese Notice 37/1305/21

1. An emergency wreck marking buoy, to indicate a new wreck, has been established in position 32° 13'·31N., 122° 03'·56E.
2. Virtual-AIS may also be established to indicate the new wreck.
3. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1281

515(P)/22 MALAYSIA - Peninsular Malaysia, East Coast - Breakwater. Lights. Quay. Depths. Maintained channels.

Source: Malaysian Charts 6359 and 6400 and Marine Department, Malaysia Notice 167/21

1. Extensive changes have taken place at Kuantan Port, the most significant are as follows:
2. A new breakwater has been established, joining the following positions:

3° 59'·68N., 103° 25'·18E.

3° 59'·85N., 103° 26'·08E.

3° 58'·93N., 103° 26'·79E.

3° 58'·49N., 103° 26'·76E.

3. The breakwater is marked by lights in the following positions:

Characteristic**Position**

Fl.G.3s11m10M

3° 58'·49N., 103° 26'·76E.

Fl.Y.5s10m5M

3° 58'·92N., 103° 26'·79E.

*Fl.Y.2s10m5M

3° 59'·83N., 103° 26'·08E.

4. A new quay has been established, joining the following positions:

3° 59'·60N., 103° 25'·46E.

3° 59'·17N., 103° 25'·79E.

5. The least depth alongside the quay is 10·2m, rocky bottom.

6. A sector light, Oc.RWG.5s30m6M has been established in position 4° 00'·01N., 103° 25'·42E. , with the following sectors:

Colour**Bearing**

Red

324·4° - 326·8° (2·4°)

White

322·1° - 324·4° (2·3°)

Green

319·8° - 322·1° (2·3°)

7. Depths less than charted exist within Kuantan Port. The most significant are as follows:

Depth**Position**

11·1m

3° 58'·26N., 103° 26'·36E.

11·1m

3° 58'·32N., 103° 26'·37E.

11·3m

3° 58'·27N., 103° 26'·17E.

11·7m

3° 58'·05N., 103° 26'·46E.

8. A new maintained entrance channel, depth 17m, has been established joining the following positions:

3° 56'·02N., 103° 33'·27E.

3° 56'·56N., 103° 28'·09E.

3° 58'·41N., 103° 26'·60E.

9. A maintained area has been established, depth 16m, in the vicinity of position 3° 59'·07N., 103° 26'·10E.

10. Mariners are advised to navigate with caution in the area.

515(P)/22 MALAYSIA - Peninsular Malaysia, East Coast - Breakwater. Lights. Quay. Depths. Maintained channels. (continued)

11. Former Notice 1028(P)/19 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Chart affected — 1379

578(T)/22 CHINA - East Coast - Buoyage. Virtual aid to navigation.

Source: Chinese Notices 46/1630/21 and 49/1731/21

1. Emergency wreck marking buoys have been established to indicate a new wreck in position 24° 18'·18N., 118° 21'·60E.
2. Virtual-AIS has also been established to indicate the new wreck.
3. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1719 — 1760

598(T)/22 VIETNAM - Wreck.

Source: VMS-North Notice 124(T)/21

1. A wreck exists in position 16° 07'·97N., 108° 11'·76E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3884

1288(T)/22 CHINA - East Coast - Buoyage. Wreck. Virtual aid to navigation.

Source: Chinese Notice 7/175/2022

1. Two emergency wreck marking buoys, to indicate a new wreck exists in position 29° 09'·52N., 122° 15'·59E.
2. Virtual-AIS may also be established to indicate the new wreck.
3. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1759

1530(P)/22 CHINA - Bo Hai - Depths. Channel. Buoyage.

Source: mV Seri Camar

1. Depths less than charted are reported to exist within an area of radius 0.7NM, centred on 38° 47'·46N., 118° 07'·00E.
2. Vessels are advised to avoid the area and vessels have been recommended to join Dagusha Hangdao channel by joining between buoy *No 203* and buoy *No 205*.
(CGCS 2000 DATUM)

Charts affected — 1250 — 2645

2375(T)/22 MALAYSIA - Peninsular Malaysia, East Coast - Light-beacon. Buoy.

Source: Malaysian Notice 7/136(T)/21

1. The Neville Rock light-beacon, Fl(2)R.5s15m10M in position 1° 26'·66N., 104° 02'·64E. has been destroyed.
2. A red lateral light-buoy, Fl(2)R.5s has been established in position 1° 26'·67N., 104° 02'·75E.
3. Former Notice 4679(T)/21 is cancelled.
(WGS84 DATUM)

Charts affected — 4043 — 4044

2482(T)/22 CHINA - South Coast - Reef.

Source: Hong Kong Notice 26/101(T)/21

1. Artificial reefs are being established on the seabed within the area bounded by the following positions:

22° 20'·027N., 113° 58'·662E.

22° 19'·837N., 113° 58'·662E.

22° 19'·837N., 113° 59'·157E.

22° 20'·027N., 113° 59'·157E.

2. There will be a vertical clearance of about 4·5m from the top of the artificial reef to sea level.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4122 — 4123**3924(T)/22 CHINA - Yellow Sea Coast - Restricted area.**

Source: UKHO

1. It has been reported that an entry prohibited area has been established, surrounding the anchorage in position,
36° 46'·73N., 122° 09'·94E. with access only allowed from the south.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts 1289 and 1254 will be updated when full details are available.
(CGCS 2000 DATUM)

Charts affected — 1254 — 1289**3935(P)/22 CHINA - East Coast - Traffic separation scheme. Separation zones. Precautionary areas. Restricted areas.**

Source: UKHO

1. The Changjiang Kou traffic separation scheme is reported to have been significantly amended.
2. The details of the reported new scheme are shown in the accompanying diagram. The numbered positions in the diagram relate to the positions listed below.
3. Traffic scheme A is reported to have been extended eastwards.

- a. Separation zones are reported to have been established bound by the following positions:

(1) 31° 06'·42N., 122° 33'·14E.

(2) 31° 06'·42N., 122° 45'·33E.

(3) 31° 05'·92N., 122° 45'·33E.

(4) 31° 05'·92N., 122° 33'·14E.

and

(5) 31° 06'·42N., 122° 50'·33E.

(6) 31° 06'·42N., 123° 00'·00E.

(7) 31° 05'·92N., 123° 00'·00E.

(8) 31° 05'·92N., 122° 50'·33E.

- b. Westbound traffic lanes are reported to have been established bound by the following positions:

(1) 31° 06'·42N., 122° 33'·14E.

(2) 31° 06'·42N., 122° 45'·33E.

(9) 31° 07'·17N., 122° 45'·33E.

(10) 31° 07'·17N., 122° 33'·14E.

and

(5) 31° 06'·42N., 122° 50'·33E.

(6) 31° 06'·42N., 123° 00'·00E.

(11) 31° 07'·17N., 123° 00'·00E.

(12) 31° 07'·17N., 122° 50'·33E.

- c. Eastbound traffic lanes are reported to have been established bound by the following positions:

(3) 31° 05'·92N., 122° 45'·33E.

(4) 31° 05'·92N., 122° 33'·14E.

(13) 31° 05'·16N., 122° 33'·14E.

(14) 31° 05'·17N., 122° 45'·33E.

and

(7) 31° 05'·92N., 123° 00'·00E.

(8) 31° 05'·92N., 122° 50'·33E.

3935(P)/22 CHINA - East Coast - Traffic separation scheme. Separation zones. Precautionary areas. Restricted areas. (continued)

- (15) 31° 05'·17N., 122° 50'·33E.
 (16) 31° 05'·17N., 123° 00'·00E.

4. Traffic scheme B is reported to have been extended eastwards.

a. Separation zones are reported to have been established bound by the following positions:

- (17) 30° 59'·52N., 122° 33'·14E.
 (18) 30° 59'·06N., 122° 35'·42E.
 (19) 30° 59'·06N., 122° 45'·33E.
 (20) 30° 58'·54N., 122° 45'·33E.
 (21) 30° 58'·54N., 122° 35'·42E.
 (22) 30° 59'·01N., 122° 33'·14E.
 and
 (23) 30° 59'·07N., 122° 50'·33E.
 (24) 30° 59'·07N., 123° 00'·00E.
 (25) 30° 58'·54N., 123° 00'·00E.
 (26) 30° 58'·54N., 122° 50'·33E.

b. Westbound traffic lanes are reported to have been established bound by the following positions:

- (17) 30° 59'·52N., 122° 33'·14E.
 (18) 30° 59'·06N., 122° 35'·42E.
 (19) 30° 59'·06N., 122° 45'·33E.
 (27) 30° 59'·83N., 122° 45'·33E.
 (28) 30° 59'·83N., 122° 35'·42E.
 (29) 31° 00'·30N., 122° 33'·14E.
 and
 (23) 30° 59'·07N., 122° 50'·33E.
 (24) 30° 59'·07N., 123° 00'·00E.
 (30) 30° 59'·83N., 123° 00'·00E.
 (31) 30° 59'·83N., 122° 50'·33E.

c. Eastbound traffic lanes are reported to have been established bound by the following positions:

- (20) 30° 58'·54N., 122° 45'·33E.
 (21) 30° 58'·54N., 122° 35'·42E.
 (22) 30° 59'·01N., 122° 33'·14E.
 (32) 30° 58'·23N., 122° 33'·14E.
 (33) 30° 57'·76N., 122° 35'·42E.
 (34) 30° 57'·77N., 122° 45'·33E.
 and
 (25) 30° 58'·54N., 123° 00'·00E.
 (26) 30° 58'·54N., 122° 50'·33E.
 (35) 30° 57'·77N., 122° 50'·33E.
 (36) 30° 57'·77N., 123° 00'·00E.

5. Traffic scheme C1 is reported to have been extended northwards.

a. A separation zone is reported to have been established bound by the following positions:

- (37) 31° 20'·00N., 122° 32'·29E.
 (38) 31° 07'·17N., 122° 32'·28E.
 (39) 31° 07'·17N., 122° 31'·69E.
 (40) 31° 20'·00N., 122° 31'·69E.

b. A southbound traffic lane is reported to have been established bound by the following positions:

- (40) 31° 20'·00N., 122° 31'·69E.
 (39) 31° 07'·17N., 122° 31'·69E.
 (42) 31° 07'·17N., 122° 30'·80E.
 (41) 31° 20'·00N., 122° 30'·80E.

c. A northbound traffic lane is reported to have been established bound by the following positions:

- (10) 31° 07'·17N., 122° 33'·14E.
 (38) 31° 07'·17N., 122° 32'·28E.
 (37) 31° 20'·00N., 122° 32'·29E.
 (43) 31° 20'·00N., 122° 33'·15E.

6. Traffic scheme C3 is reported to have been extended southwards.

a. A separation zone is reported to have been established bound by the following positions:

3935(P)/22 CHINA - East Coast - Traffic separation scheme. Separation zones. Precautionary areas. Restricted areas. (continued)

- (44) 30° 49'·08N., 122° 31'·67E.
- (45) 30° 58'·54N., 122° 31'·68E.
- (46) 30° 58'·41N., 122° 32'·27E.
- (47) 30° 49'·27N., 122° 32'·27E.

b.A southbound traffic lane is reported to have been established bound by the following positions:

- (44) 30° 49'·08N., 122° 31'·67E.
- (45) 30° 58'·54N., 122° 31'·68E.
- (48) 30° 58'·72N., 122° 30'·81E.
- (49) 30° 48'·82N., 122° 30'·82E.

c.A northbound traffic lane is reported to have been established bound by the following positions:

- (47) 30° 49'·27N., 122° 32'·27E.
- (46) 30° 58'·41N., 122° 32'·27E.
- (32) 30° 58'·23N., 122° 33'·14E.
- (50) 30° 49'·54N., 122° 33'·14E.

7. A new North-South traffic separation scheme is reported to have been established as follows:

a.Separation zones are reported to have been established bound by the following positions:

- (51) 31° 20'·00N., 122° 47'·33E.
- (52) 31° 20'·00N., 122° 48'·33E.
- (53) 31° 07'·17N., 122° 48'·33E.
- (54) 31° 07'·17N., 122° 47'·33E.
- and
- (55) 31° 05'·17N., 122° 47'·33E.
- (56) 31° 05'·17N., 122° 48'·33E.
- (57) 30° 59'·83N., 122° 48'·33E.
- (58) 30° 59'·83N., 122° 47'·33E.

b.Southbound traffic lanes are reported to have been established bound by the following positions:

- (51) 31° 20'·00N., 122° 47'·33E.
- (54) 31° 07'·17N., 122° 47'·33E.
- (9) 31° 07'·17N., 122° 45'·33E.
- (59) 31° 20'·00N., 122° 45'·33E.
- and
- (14) 31° 05'·17N., 122° 45'·33E.
- (55) 31° 05'·17N., 122° 47'·33E.
- (58) 30° 59'·83N., 122° 47'·33E.
- (27) 30° 59'·83N., 122° 45'·33E.

c.Northbound traffic lanes are reported to have been established bound by the following positions:

- (52) 31° 20'·00N., 122° 48'·33E.
- (53) 31° 07'·17N., 122° 48'·33E.
- (12) 31° 07'·17N., 122° 50'·33E.
- (60) 31° 20'·00N., 122° 50'·33E.
- and
- (57) 30° 59'·83N., 122° 48'·33E.
- (31) 30° 59'·83N., 122° 50'·33E.
- (15) 31° 05'·17N., 122° 50'·33E.
- (56) 31° 05'·17N., 122° 48'·33E.

8. Precautionary areas are reported to have been established bound by the following position:


- (9) 31° 07'·17N., 122° 45'·33E.
- (12) 31° 07'·17N., 122° 50'·33E.
- (15) 31° 05'·17N., 122° 50'·33E.
- (14) 31° 05'·17N., 122° 45'·33E.
- and
- (27) 30° 59'·83N., 122° 45'·33E.
- (31) 30° 59'·83N., 122° 50'·33E.
- (35) 30° 57'·77N., 122° 50'·33E.
- (34) 30° 57'·77N., 122° 45'·33E.

9. Navigation via the North-South traffic separation scheme, C2, centred on position, 31° 02'·77N., 122° 31'·99E. is reported to be prohibited.


3935(P)/22 CHINA - East Coast - Traffic separation scheme. Separation zones. Precautionary areas. Restricted areas. (continued)

10. It is reported that vessels not entering or leaving Changjiang Kou should pass E of 123°E.
11. It is reported that anchoring is prohibited within an area bound by traffic scheme B, traffic scheme C3, and 123°E.
12. Anchoring prohibited areas are reported to have been established bound by the following positions:
- 31° 13'·17N., 122° 50'·88E.
31° 07'·50N., 122° 50'·88E.
31° 07'·50N., 122° 53'·47E.
31° 13'·17N., 122° 53'·47E.
and
31° 05'·05N., 122° 50'·24E.
31° 01'·99N., 122° 50'·24E.
31° 01'·99N., 122° 54'·13E.
31° 05'·05N., 122° 54'·13E.
13. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
14. Charts will be updated when full details are available.
(CGCS 2000 DATUM)

Charts affected — 1199 — 1306 — 1602 — 2412 — 3480

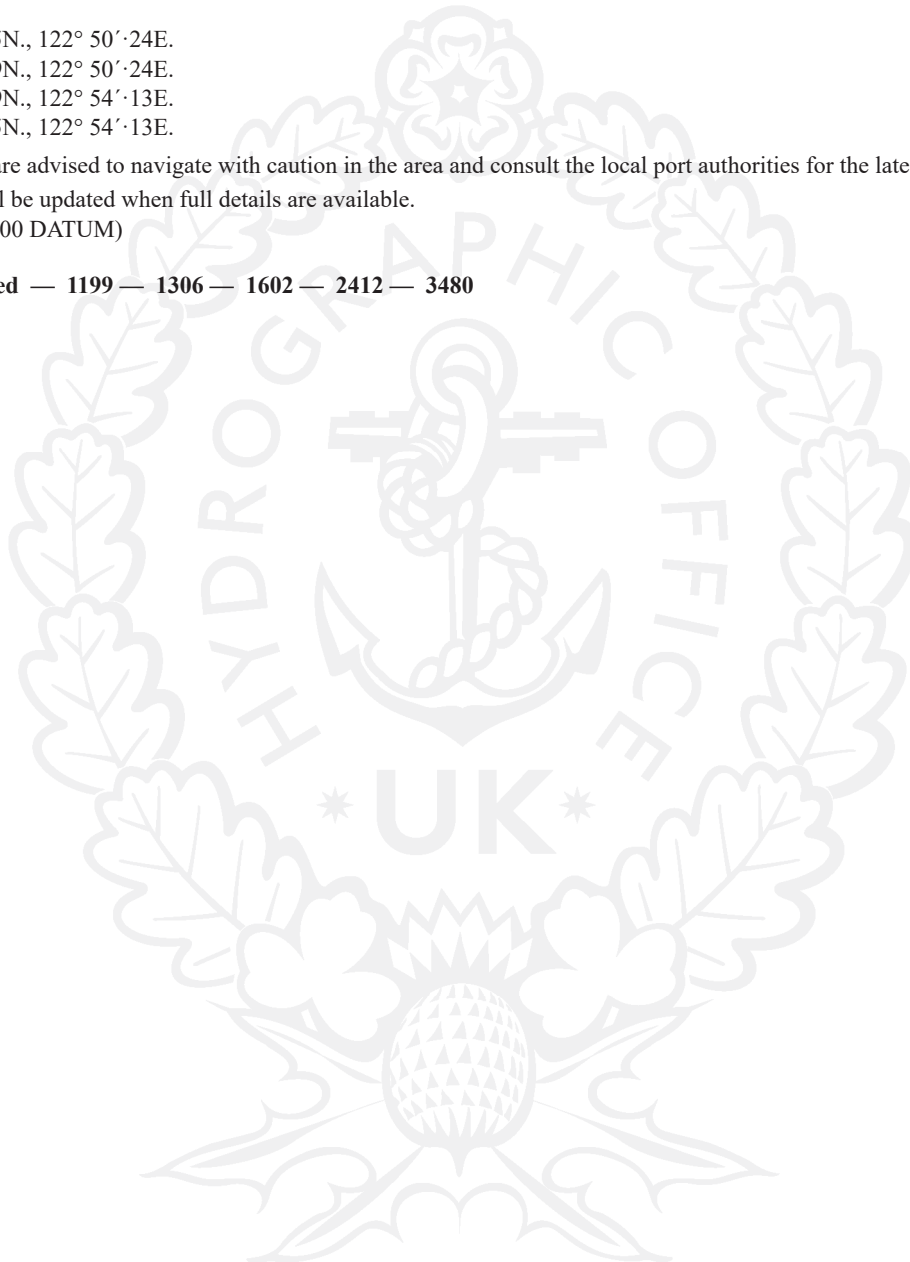

To accompany Notice to Mariners 3935(P)/22

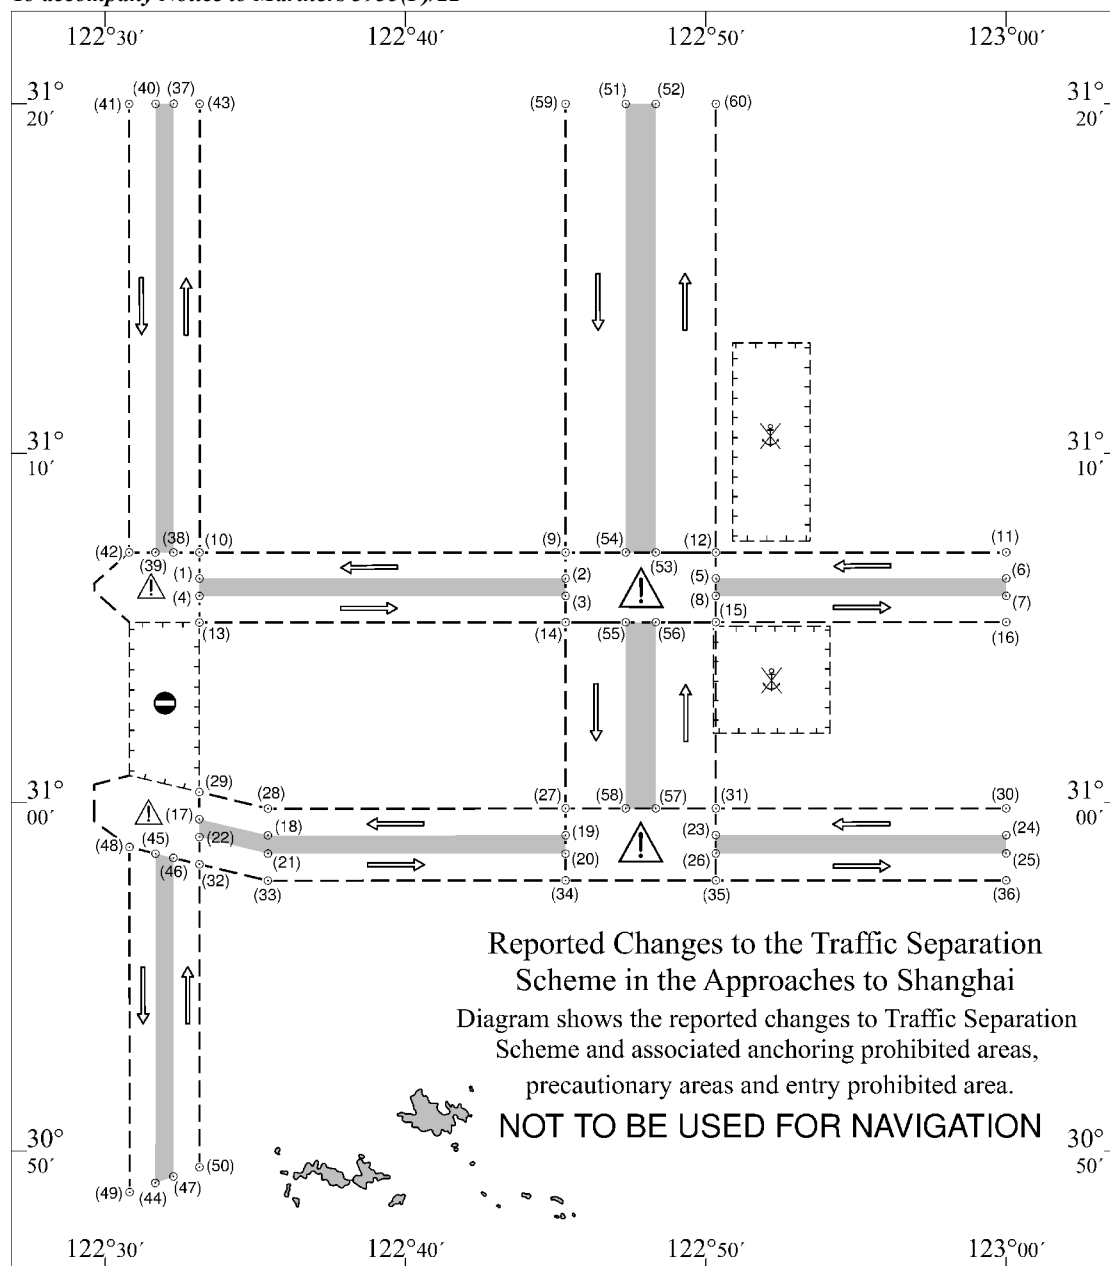

4054(T)/22 VIETNAM - Wreck.

Source: VMS-North Notice 57(T)/22

1. A wreck exists in position $15^{\circ} 47' \cdot 0N.$, $108^{\circ} 32' \cdot 0E.$.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3488 — 3988

4295(T)/22 CHINA - South Coast - Light-beacons.

Source: Chinese Notice 37/1309(T)/22

1. Special light-beacons, Mo(O)Y.12s, have been temporarily established in the following positions:

22° 51'·03N., 113° 33'·45E.

22° 51'·15N., 113° 33'·43E.

2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 344**4297(T)/22 CHINA - South Coast - Buoyage.**

Source: Chinese Notice 36/1288(T)/22

1. The following port hand lateral light-buoys have been temporarily established:

<i>Designation</i>	<i>Characteristic</i>	<i>Position</i>
LNG1	Fl.R.4s	22° 50'·23N., 113° 33'·96E.
LNG2	Fl.R.4s	22° 50'·47N., 113° 33'·92E.

(CGCS 2000 DATUM)

Chart affected — 344**244(P)/23 VIETNAM - Works. Wind farm. Wind turbines. Lights. Automatic Identification Systems. Buoyage.**

Source: Vietnamese Notice 221/22

1. Works are in progress to establish a wind farm North East of Cua Ham Luong.
2. Turbines are marked by lights, Mo(U)15s11m5M, and associated Automatic Identification System, AIS, in the positions:

<i>Designation</i>	<i>Position</i>
T-01	9° 58'·77N., 106° 40'·62E.
T-07	9° 57'·80N., 106° 41'·08E.

3. The construction works, which are marked by lit special buoys, FI(3+1)18s, in the following positions:

<i>Designation</i>	<i>Position</i>
V-01	9° 57'·71N., 106° 41'·15E.
V-02	9° 58'·81N., 106° 40'·74E.

4. Mariners are advised to navigate with caution in the area.
5. Chart GB1261 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1261**840(T)/23 VIETNAM - Wreck.**

Source: VMS-North Notice 7(T)/23

1. A wreck exists in position 16° 08'·84N., 108° 12'·11E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3884**1055(T)/23 VIETNAM - Light-beacon. Beacon.**

Source: VMS-South Notices 31/23 and 33/23

1. The light-beacon, Fl.R.4s5M No 38 RW, in position 10° 35'·12N., 106° 50'·14E. has been temporarily extinguished.
2. A red pillar light-buoy, Fl.R.3s No 38, has been established in position 10° 35'·10N., 106° 50'·15E.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1039

1558(T)/23 MALAYSIA - Peninsular Malaysia, East Coast - Offshore installation.

Source: Marine Department, Malaysian Notice 146(T)/2022

1. A floating solar panel, has been deployed until 31st May 2023 between the following positions:

5° 24'·48N., 103° 05'·17E.

5° 39'·63N., 103° 00'·95E.

5° 45'·93N., 103° 02'·56E.

5° 49'·91N., 103° 02'·56E.

2. Mariners are advised to keep clear of the area and navigate with caution within the vicinity of the area.
(WGS84 DATUM)

Charts affected — 2422 — 2426 — 3446 — 3447**1965(T)/23 CHINA - Buoy.**

Source: Chinese Notice 9/199/23

1. An emergency wreck marking buoy, to indicate a new wreck, has been established in position 32° 45'·4N., 122° 19'·0E.
2. Virtual-AIS may also be established to indicate the new wreck.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2412 — 3480**2519(T)/23 VIETNAM - Buoy.**

Source: VMS-South Notice 54/23

1. The isolated danger buoy in position 10° 38'·39N., 107° 57'·39E., is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1261 — 3986 — 3987**3105(P)/23 CHINA - Yellow Sea Coast - Port developments. Jetties. Light. Reclamation areas. Depths.**

Source: Chinese Chart 12576

1. Port developments have taken place within Lanshan Gangqu. The most significant are as follows:
2. A new jetty has been established in the vicinity of position 35° 06'·174N., 119° 24'·781E. The most north-easterly position, 35° 06'·278N., 119° 24'·844E., is marked by the charted light, Iso.G.4s15m8M.
3. Other new jetties have been established in the following positions:

35° 05'·081N., 119° 21'·848E.

35° 06'·849N., 119° 23'·815E.

35° 06'·774N., 119° 23'·899E.

4. Land reclamation is taking place in the vicinity of the following positions:

35° 05'·052N., 119° 23'·036E.

and

35° 06'·402N., 119° 24'·193E.

5. Numerous depths less than charted exist within Lanshan Gangqu. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
10·6m	35° 06'·272N., 119° 23'·466E.
9·7m	35° 07'·173N., 119° 24'·518E.
18·9m	35° 06'·712N., 119° 24'·906E.
7·8m	35° 04'·880N., 119° 22'·881E.
4·8m	35° 06'·327N., 119° 24'·849E.
14·8m	35° 07'·132N., 119° 24'·960E.
2·9m	35° 07'·625N., 119° 23'·721E.

6. Mariners are advised to navigate with caution in the area and contact the local port authority for the latest information.

3105(P)/23 CHINA - Yellow Sea Coast - Port developments. Jetties. Light. Reclamation areas. Depths.
(continued)

7. These changes will be included in a New Edition of Charts 841 and 880 to be published late 2023.
(CGCS 2000 DATUM)

Chart affected — 880

3299(T)/23 CHINA - East Coast - Buoy.

Source: mv Thruxton

1. A yellow buoy is reported to exist in position 31° 00'·0N., 124° 00'·0E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2412 — 3480

3367(T)/23 TAIWAN - Wreck. Buoy. Virtual aid to navigation.

Source: UKHO

1. *The dangerous wreck in position: 22° 36'·33N., 120° 12'·44E. has been reported to have a depth of 12·6m and to be in position: 22° 36'·49N., 120° 12'·44E.
2. A salvage area has been established, radius 555m (0.345M), centred on: 22° 36'·54N., 120° 12'·41E.
3. *A red can light-buoy, *VQR*, has been established in position: 22° 36'·41N., 120° 12'·45E.
4. *A virtual aid to navigation (V-AIS), cross topmark, has been established in position: 22° 36'·48N., 120° 12'·40E.
5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
6. *Former Notice 2919(T)/23 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 2409 — 3230 — 3232

3389(T)/23 CHINA - East Coast - Submarine pipeline. Works.

Source: Chinese Notice 29/1068(T)/23

1. Pipeline laying operations are taking place, joining the following positions:
30° 40'·28N., 122° 15'·17E.
30° 39'·42N., 122° 14'·78E.
30° 40'·63N., 122° 17'·33E.
30° 41'·80N., 122° 23'·88E.
30° 41'·85N., 122° 25'·53E.
30° 42'·45N., 122° 25'·55E.
30° 42'·40N., 122° 23'·82E.
30° 41'·20N., 122° 17'·10E.
2. Mariners are advised to navigate with caution in the area.
(CGCS2000 DATUM)

Charts affected — 1134 — 1144 — 1199 — 1303 — 1306

3497(T)/23 TAIWAN - Obstructions.

Source: UKHO

1. Numerous obstructions have been reported, approximately centred on the following positions:

Positions

22° 32'·57N., 120° 14'·41E.
22° 28'·22N., 120° 19'·16E.
22° 25'·61N., 120° 21'·88E.
22° 26'·71N., 120° 22'·66E.
22° 29'·90N., 120° 20'·53E.
22° 24'·95N., 120° 28'·28E.

* 22° 37'·20N., 120° 12'·80E.
* 22° 32'·88N., 120° 14'·13E.
* 22° 32'·00N., 120° 14'·91E.

3497(T)/23 TAIWAN - Obstructions. (continued)

- * 22° 32'·35N., 120° 16'·76E.
- * 22° 32'·62N., 120° 18'·04E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. *Former Notice 3178(T)/23 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 2376 — 2409 — 3230 — 3232

4222(P)/23 VIETNAM - Works. Bridge. Piles.

Source: VMS-South Notice 197/23

1. Works are in progress to construct Phuoc An Bridge between the following positions:
10° 37'·88N., 106° 59'·99E.
10° 37'·96N., 106° 59'·72E.
2. Piles have been established in the following positions:
10° 37'·95N., 106° 59'·75E.
10° 37'·91N., 106° 59'·88E.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. Chart 1059 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1059

4556(T)/23 VIETNAM - Buoyage.

Source: VMS-North Notice 99(T)/23

1. Special purpose light-buoys, *Fl(3+1)Y.12s* have been established in the following positions:

<i>Designation</i>	<i>Position</i>
<i>X1</i>	16° 11'·32N., 108° 17'·60E.
<i>X2</i>	16° 11'·05N., 108° 17'·60E.
<i>X3</i>	16° 11'·05N., 108° 17'·32E.
<i>X4</i>	16° 11'·32N., 108° 17'·32E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3884

4715(T)/23 CHINA - East Coast - Wreck.

Source: Chinese Notice 44/1586/23

1. A dangerous wreck has been reported in position: 29° 58'·83N., 121° 48'·03E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1592

4892(T)/23 VIETNAM - Virtual aids to navigation.

Source: VMS-North Notice 121(T)/23

1. Virtual aids to navigation (V-AIS) have been established in the following positions:
20° 35'·17N., 106° 53'·54E.
20° 34'·95N., 106° 52'·95E.
20° 34'·32N., 106° 53'·22E.
20° 34'·59N., 106° 53'·84E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1965 — 3990

260(T)/24 VIETNAM - Wreck.

Source: HYDROPAC 4003/23(93)

1. A wreck, depth unknown, exists in the vicinity of position $9^{\circ} 34' \cdot 6N.$, $106^{\circ} 48' \cdot 9E.$
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3986**942(P)/24 CHINA - East Coast - Recommended routes.**

Source: Chinese Notices 45/1630-1633/23, 46/1691-1693/23, 47/1737-1739/23, 48/1786-1787/23, 49/1836-1842/23, 50/1894-1895/23, 51/1949-1951/23 and 52/2010-2013/23

1. There have been significant changes to the recommended routes between $27^{\circ} 14' \cdot 0N.$, $120^{\circ} 43' \cdot 4E.$ and $24^{\circ} 07' \cdot 1N.$, $118^{\circ} 15' \cdot 6E.$
2. Mariners are advised to navigate with caution in the area and to contact the local port authorities for the latest information.
3. Former Notice 549(P)/24 is cancelled.
4. NOTE: Content of Notice unchanged, re-issued to include Chart 2413.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 1716 — 1719 — 1720 — 1754 — 1760 — 1761 — 2400 — 2401 — 2431**1451(T)/24 CHINA - East Coast - Virtual aid to navigation.**

Source: Chinese Notice 44/1587/23

1. A virtual aid to navigation, V-AIS, isolated danger topmark, marking a new wreck, has been established in position $29^{\circ} 10' \cdot 6N.$, $122^{\circ} 09' \cdot 4E.$
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1759**1621(T)/24 MALAYSIA - Peninsular Malaysia, East Coast - Wreck.**

Source: Marine Department, Malaysia Notice 7(T)/24

1. A dangerous wreck has been reported drifting in the vicinity of position $4^{\circ} 35' \cdot 32N.$, $104^{\circ} 02' \cdot 88E.$
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2414 — 2422 — 3446 — 3482 — 4508**1742(T)/24 CHINA - Yellow Sea Coast - Wreck. Buoyage. Virtual aid to navigation.**

Source: Chinese Notices 3/96/24 and 7/282/24

1. A dangerous wreck exists in position $34^{\circ} 39' \cdot 20N.$, $119^{\circ} 57' \cdot 00E.$, marked by 2 emergency wreck marking buoys.
2. Virtual-AIS may also be established to indicate the new wreck.
3. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1201**1825(P)/24 CHINA - Yellow Sea Coast - Pier.**

Source: UKHO

1. A new pier with berthing facility has been reported, joining the following positions:
 $35^{\circ} 34' \cdot 493N.$, $119^{\circ} 45' \cdot 676E.$
 $35^{\circ} 34' \cdot 436N.$, $119^{\circ} 45' \cdot 659E.$
 $35^{\circ} 34' \cdot 390N.$, $119^{\circ} 45' \cdot 589E.$
 $35^{\circ} 34' \cdot 328N.$, $119^{\circ} 45' \cdot 545E.$
 $35^{\circ} 34' \cdot 256N.$, $119^{\circ} 45' \cdot 532E.$
2. Mariners are advised to navigate with caution in the area.

1825(P)/24 CHINA - Yellow Sea Coast - Pier. (continued)

3. Chart 809 will be updated when full details are available.
(CGCS 2000 DATUM)

Chart affected — 809

1879(P)/24 CHINA - South Coast - Depths. Virtual aids to navigation. Alongside depths. Fairway.

Source: UKHO

- The approach channel to Qinzhou Wan has been reported to be deeper between positions, 21° 09'·80N., 108° 35'·09E. and 21° 28'·45N., 108° 38'·38E.
- The Dong Hangdao fairway has been reported to be deeper between positions, 21° 28'·35N., 108° 38'·22E. and 21° 33'·39N., 108° 38'·23E.
- * The Dong Hangdao fairway has also been reported to have moved as follows:

Former Position

21° 38'·91N., 108° 39'·33E.
21° 37'·46N., 108° 40'·41E.
21° 36'·69N., 108° 39'·94E.

New Position

21° 39'·01N., 108° 39'·19E.
21° 37'·07N., 108° 39'·81E.
21° 36'·65N., 108° 39'·82E.

- Depths within the vicinity of the pier have also been reported to be deeper, centred on 21° 32'·40N., 108° 40'·09E.
- The alongside depths at the pier have also been reported as follows:

Depth

15·6m
19·2m
18·2m
23·1m
22·8m

Position

21° 32'·84N., 108° 40'·10E.
21° 32'·92N., 108° 40'·12E.
21° 33'·05N., 108° 40'·18E.
21° 32'·89N., 108° 40'·17E.
21° 32'·98N., 108° 40'·21E.

- Reported depths less than charted exist within approaches to Qinzhou Wan. The most significant are as follows:

Depth

19·6m
18·7m
11m
9·8m
12·5m
11·8m
9·8m
7·4m
4·6m
3·7m
4·2m
2·7m
4m
5·2m

Position

21° 15'·02N., 108° 36'·88E.
21° 16'·22N., 108° 36'·88E.
21° 26'·91N., 108° 36'·94E.
21° 27'·82N., 108° 37'·52E.
21° 25'·27N., 108° 36'·41E.
21° 27'·82N., 108° 40'·52E.
21° 29'·54N., 108° 38'·36E.
21° 30'·24N., 108° 38'·91E.
21° 31'·29N., 108° 38'·05E.
21° 32'·43N., 108° 38'·37E.
21° 32'·02N., 108° 38'·38E.
21° 33'·33N., 108° 38'·40E.
21° 32'·37N., 108° 34'·04E.
21° 32'·68N., 108° 34'·48E.

- A virtual aid to navigate (V-AIS), isolated danger topmark, is reported to exist in position 21° 28'·23N., 108° 38'·15E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Charts will be updated when full details are available.
- *Former Notice 3994(P)/23 is cancelled.
*Indicates new or revised entry
(CGCS 2000 DATUM)

Charts affected — 3992 — 3999

1941(T)/24 VIETNAM - Buoyage.

Source: VMS-North Notices 92/23 and 141/23

1. Special purpose light-buoys, *Fl(3+1)Y.12s*, have been established in the following positions:

<i>Designation</i>	<i>Position</i>
*TC1	16° 08'·97N., 108° 10'·59E.
TC2	*16° 08'·86N., 108° 10'·89E.
*TC3	16° 08'·34N., 108° 09'·98E.
TC4	*16° 08'·13N., 108° 10'·21E.
*TC5	16° 07'·95N., 108° 09'·39E.
*TC6	16° 07'·60N., 108° 09'·33E.
*TC7	16° 08'·10N., 108° 08'·96E.
*TC8	16° 07'·86N., 108° 08'·47E.
*TC9	16° 08'·37N., 108° 09'·05E.
TC11	16° 08'·67N., 108° 08'·86E.
TC13	16° 08'·87N., 108° 08'·52E.

2. Mariners are advised to navigate with caution in the area.
3. Former Notice 4355(T)/23 is cancelled.

*Indicates new or revised entry.
(WGS84 DATUM)

Chart affected — 3884**2183(T)/24 TAIWAN - Works.**

Source: UKHO

1. Harbour works are taking place in an area bounded by the following positions:

22° 33'·13N., 120° 19'·77E.
22° 32'·96N., 120° 19'·92E.
22° 32'·94N., 120° 19'·90E.
22° 33'·12N., 120° 19'·75E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2376**2299(P)/24 CHINA - Bo Hai - Vessel traffic services.**

Source: Chinese Chart 11800

1. The Beichangshan Shuidao VTS, centred on 38° 05'·0N., 120° 24'·6E. and 37° 58'·3N., 121° 02'·9E. are reported to be two-way.
2. Charts 1250 and 1255 will be updated when full details are available.
(CGCS 2000 DATUM)

Charts affected — 1250 — 1255**2339(P)/24 CHINA - South Coast - Fairways. Depths. Bridge. Vertical clearance.**

Source: Chinese Chart 15731

1. Fairway limits in Longteng Hangdao (Inner Section) and Nansandao Xihangdao have changed as follows:

21° 04'·91N., 110° 30'·19E.
21° 04'·83N., 110° 31'·98E.
21° 04'·00N., 110° 34'·07E.
21° 03'·61N., 110° 35'·34E.

2. Fairway limits in Nansandao Xihangdao and Shitoujiao Hangdao have changed as follows:

21° 05'·65N., 110° 26'·84E.
21° 05'·10N., 110° 27'·52E.
21° 04'·84N., 110° 28'·30E.
21° 04'·86N., 110° 29'·17E.

2339(P)/24 CHINA - South Coast - Fairways. Depths. Bridge. Vertical clearance. (continued)

3. Numerous depths less than charted exist within Zhanjiang Gang. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
7·1m	21° 03'·70N., 110° 34'·77E.
7·6m	21° 03'·83N., 110° 34'·29E.
7·8m	21° 03'·19N., 110° 36'·14E.
12m	21° 04'·14N., 110° 29'·13E.
15·5m	21° 05'·44N., 110° 31'·45E.
12m	21° 04'·55N., 110° 30'·35E.
18·5m	21° 04'·43N., 110° 29'·57E.
11·6m	21° 04'·03N., 110° 29'·36E.
4·4m	21° 03'·81N., 110° 27'·07E.
4·4m	21° 15'·16N., 110° 25'·22E.
12·8m	21° 06'·11N., 110° 26'·64E.

- Numerous depths deeper than charted exist within the fairways of Zhanjiang Gang.
- The bridge under construction, in the vicinity of position 21° 19'·48N., 110° 25'·04E., is now complete and has a vertical clearance of 40m.
- Mariners are advised to navigate with caution in the area.
- These changes will be included in the next New Edition of Charts 3363 and 3364.
(CGCS 2000 DATUM)

Charts affected — 3363 — 3364

2444(T)/24 CHINA - East Coast - Wreck. Buoyage. Virtual aid to navigation.

Source: Chinese Notices 3/104/24 and 4/156/24

- A dangerous wreck exists in position 30° 20'·97N., 122° 37'·20E., and is marked by 2 emergency wreck marking buoys.
- A virtual aid to navigation (V-AIS) may also be established to indicate the new wreck.
- Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1199 — 1305

2996(T)/24 VIETNAM - Wreck.

Source: VMS-North Notice 33(T)/24

- A wreck exists in position 15° 17'·0N., 108° 58'·5E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3488 — 3988

3021(P)/24 CHINA - Bo Hai - Wind farm.

Source: UKHO

- A wind farm has been reported, within an area bounded by the following approximate positions:
 - 37° 52'·95N., 120° 17'·52E.
 - 37° 52'·95N., 120° 24'·90E.
 - 37° 49'·05N., 120° 22'·41E.
 - 37° 49'·05N., 120° 12'·95E.
- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
(CGCS 2000 DATUM)

Charts affected — 1206 — 1250 — 1255 — 1294

3089(P)/24 CHINA - East Coast - Anchorage areas. Recommended routes.

Source: UKHO

1. Recommended routes in the Lansha Yang area are reported to exist as follows:

32° 32'·09N., 122° 09'·95E.
 32° 32'·24N., 121° 45'·12E.
 and
 32° 24'·96N., 122° 09'·97E.
 32° 25'·43N., 121° 42'·07E.
 32° 26'·49N., 121° 40'·34E.
 and
 32° 00'·56N., 122° 10'·04E.
 32° 04'·87N., 122° 00'·70E.
 and
 31° 34'·8N., 122° 38'·8E.
 31° 29'·0N., 123° 03'·4E.

2. The following anchorage areas have been reported in the Lansha Yang area:

<i>Purpose</i>	<i>Designation</i>	<i>Position</i>
General Purpose	N1	32° 31'·28N., 121° 49'·19E. 32° 30'·31N., 121° 49'·18E. 32° 30'·30N., 121° 50'·33E. 32° 31'·28N., 121° 50'·34E.
LNG	N2	32° 30'·99N., 121° 52'·89E. 32° 30'·29N., 121° 52'·89E. 32° 30'·28N., 121° 54'·55E. 32° 30'·98N., 121° 54'·55E.
Dangerous Goods	N3	32° 30'·65N., 121° 57'·10E. 32° 28'·87N., 121° 57'·09E. 32° 28'·84N., 122° 01'·56E. 32° 30'·63N., 122° 01'·57E.
Dangerous Goods	S1	32° 25'·96N., 121° 37'·69E. 32° 25'·15N., 121° 37'·69E. 32° 25'·15N., 121° 39'·10E. 32° 25'·96N., 121° 39'·10E.
LNG	S2	32° 25'·78N., 121° 40'·05E. 32° 25'·24N., 121° 40'·05E. 32° 25'·23N., 121° 41'·97E. 32° 25'·77N., 121° 41'·97E.
Dangerous Goods for ships of 20,000-50,000 DWT	S3	32° 26'·78N., 121° 53'·90E. 32° 26'·24N., 121° 53'·90E. 32° 26'·23N., 121° 57'·09E. 32° 26'·77N., 121° 57'·09E.

3. Mariners are advised to navigate with caution in the area.
4. Charts 1199 and 1281 will be updated when full details are available.
5. Chart 1284 will be withdrawn mid 2024.
(CGCS 2000 DATUM)

Charts affected — 1199 — 1281**3377(T)/24 CHINA - East Coast - Buoyage. Wreck. Virtual aid to navigation.**

Source: Chinese Notice 21/799/24

1. Two emergency wreck marking buoys have been established, to indicate a new wreck in position
29° 19'·5N., 122° 30'·4E.
2. Virtual-AIS may also be established to indicate the new wreck.
3. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1759

3387(T)/24 CHINA - South Coast - Buoyage.

Source: Chinese Notice 20/789(T)/24

- The following light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Mo(P)Y.12s</i>	<i>JH1</i>	Special Purpose	22° 31'·837N., 113° 49'·102E.
<i>Mo(P)Y.12s</i>	<i>JH2</i>	Special Purpose	22° 31'·908N., 113° 49'·257E.
<i>Mo(P)Y.12s</i>	<i>JH3</i>	Special Purpose	22° 29'·950N., 113° 50'·997E.
<i>Mo(P)Y.12s</i>	<i>JH4</i>	Special Purpose	22° 30'·037N., 113° 51'·145E.

- The following light-buoys have been removed as follows:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.R.4s</i>	<i>F6</i>	Port Hand	22° 31'·625N., 113° 49'·340E.
<i>Fl.G.4s</i>	<i>F5</i>	Starboard Hand	22° 31'·695N., 113° 49'·425E.
<i>Fl.R.4s</i>	<i>F4</i>	Port Hand	22° 31'·087N., 113° 49'·852E.
<i>Fl.G.4s</i>	<i>F3</i>	Starboard Hand	22° 31'·160N., 113° 49'·933E.
<i>Fl.G.4s</i>	<i>F2</i>	Starboard Hand	22° 30'·540N., 113° 50'·553E.

- Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 348**3445(T)/24 VIETNAM - Buoy.**

Source: VMS South Notice 144/24

- A pillar light-buoy, *Fl(3+1)Y.16s*, has been deployed, until further notice, in position 10° 35'·04N., 107° 01'·70E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1059**3465(P)/24 CHINA - East Coast - Overhead cable. Safe vertical clearance.**

Source: mv Stena Superior and mv Tenryu

- *It has been reported that the overhead power cable, with a charted vertical clearance of 36m, in position 29° 43'·89N., 122° 13'·12E., now has a vertical clearance of 72·5m.
- It has been reported that the vertical clearance of the overhead power cable, in position 29° 43'·82N., 122° 13'·52E., has been reduced to 70m.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Charts will be updated when full details are available.
- * Former Notice 5350(P)/21 is cancelled.
(CGCS 2000 DATUM)
*Indicates new or revised entry

Chart affected — 1126**3634(P)/24 VIETNAM - Overhead cable. Light-beacons.**

Source: VMS-South Notice 92/24

- An overhead power cable, with vertical clearances of between 38m and 59m, and marked by 117 special light-beacons, *Fl(2)Y.10s*, has been established, joining the following positions:
 10° 14'·04N., 104° 34'·89E.
 10° 14'·53N., 104° 34'·23E.
 10° 14'·57N., 104° 23'·08E.
 10° 04'·41N., 104° 05'·74E.
 10° 04'·17N., 104° 02'·91E.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 3879 — 3985

4253(T)/24 VIETNAM - Buoyage. Submarine pipeline. Works.

Source: VMS-South Notice 183/24

1. Special mark light-buoys, *Fl(4)Y.12s*, have been temporarily established, marking submarine pipeline laying works, in the following positions:

<i>Designation</i>	<i>Position</i>
<i>V1</i>	12° 13'·15N., 109° 12'·58E.
<i>V2</i>	12° 13'·36N., 109° 12'·67E.
<i>V3</i>	12° 13'·47N., 109° 13'·38E.
<i>V4</i>	12° 13'·42N., 109° 13'·82E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3883**4271(P)/24 CHINA - Bo Hai - Depths.**Source: *mv Amali*

1. Depths in the approach channel to Dagang Gangqu, in the vicinity of position: 38° 45'·88N., 117° 55'·34E., and at the Tianjin Nangang LNG Terminal in position: 38° 44'·87N., 117° 42'·33E., are reported as dredged to 14·6m - 15m and maintained by the port authority.
2. Mariners are advised to consult the local port authority for the latest information.
(CGCS 2000 DATUM)

Chart affected — 2645**4276(P)/24 CHINA - Yellow Sea Coast - Wind farm.**

Source: UKHO

1. A wind farm has been reported to exist within an area bounded by the following positions:

34° 17'·0N., 120° 29'·3E.
 34° 16'·6N., 120° 28'·1E.
 34° 12'·2N., 120° 35'·2E.
 34° 12'·7N., 120° 36'·5E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(CGCS 2000 DATUM)

Chart affected — 1253**4288(T)/24 CHINA - South Coast - Virtual aid to navigation. Buoy.**

Source: Chinese Notice 26/1034(T)/24

1. A virtual aid to navigation (V-AIS), port topmark, has replaced the *No 2* light-buoy in position 21° 22'·72N., 111° 18'·50E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1537 — 3348**4377(T)/24 TAIWAN - Works.**

Source: UKHO

1. Wharf construction and re-construction works, affecting berths 25-28, are taking place within an area bounded by the following positions:

22° 35'·85N., 120° 17'·96E.
 22° 35'·83N., 120° 17'·93E.
 22° 35'·72N., 120° 17'·97E.
 22° 35'·70N., 120° 17'·92E.
 22° 35'·47N., 120° 18'·01E.
 22° 35'·50N., 120° 18'·11E.

4377(T)/24 TAIWAN - Works. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2376

4407(P)/24 THAILAND - Gulf of Thailand Coast - Submarine cable.

Source: Thai Notice 4(P)/24

1. Submarine power cables are being laid between Ko Phangan and Ko Tao, joining the following positions:

10° 03'·98N., 99° 50'·05E.
10° 03'·91N., 99° 49'·95E.
10° 02'·33N., 99° 50'·40E.
9° 51'·55N., 99° 56'·00E.
9° 49'·07N., 99° 59'·69E.
9° 48'·48N., 99° 59'·85E.
9° 47'·73N., 99° 59'·68E.

2. Mariners are requested not to anchor or trawl in the vicinity
3. Charts will be updated once works are complete.
(WGS84 DATUM)

Charts affected — 66 — 2414 — 3963 — 3964

4702(T)/24 VIETNAM - Wrecks.

Source: VMS-North Notice 118(T)/24

1. Wrecks exist in the following positions:

20° 55'·70N., 107° 03'·70E.
20° 53'·85N., 107° 04'·65E.
20° 55'·43N., 107° 04'·93E.
20° 56'·13N., 107° 04'·55E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3875 — 3889

4734(T)/24 CHINA - South Coast - Works.

Source: Chinese Notice 28/1097(T)/24

1. Offshore operations are taking place in the area bounded by the following positions:

21° 12'·09N., 110° 25'·48E.
21° 12'·02N., 110° 25'·62E.
21° 12'·50N., 110° 25'·94E.
21° 12'·53N., 110° 25'·90E.
21° 12'·58N., 110° 25'·80E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Chart affected — 3364

4736(T)/24 VIETNAM - Wrecks.

Source: VMS-North Notice 122(T)/24

1. Wrecks exist in the following positions:

20° 48'·00N., 107° 08'·90E.
20° 47'·97N., 107° 08'·90E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 3875 — 3888 — 3889

4742(T)/24 CHINA - East Coast - Obstruction.

Source: Chinese Notice 38/1465/24

1. An obstruction has been reported in position 31° 21'·34N., 121° 39'·45E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1603**4850(P)/24 MALAYSIA - Peninsular Malaysia, East Coast - Works. Breakwater.**

Source: Marine Department, Malaysia Notice 127(T)/24

1. Breakwater construction works are taking place at Kuala Nerus, Kuala Terengganu until August 2026, joining the following positions:

5° 26'·83N., 103° 04'·88E.
5° 28'·98N., 103° 01'·52E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2422 — 3446 — 3447**4853(T)/24 TAIWAN - Buoyage.**

Source: Taiwanese Notice 96(T)/24

1. The following light-buoys have been established:

<i>Designation</i>	<i>Light</i>	<i>Type</i>	<i>Position</i>
*TPC2 W1	Q	North Cardinal	24° 08'·17N., 120° 11'·98E.
*TPC2 W2	Q	North Cardinal	24° 07'·23N., 120° 16'·30E.
*TPC2 W3	Q(6)+LFl.15s	South Cardinal	24° 03'·43N., 120° 13'·30E.
*TPC2 W4	Q(6)+LFl.15s	South Cardinal	24° 03'·11N., 120° 08'·06E.

2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 3660(T)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1760 — 2409 — 3231**4871(P)/24 CHINA - South Coast - Wind turbines. Works.**

Source: Chinese Bulletin 29/24 and Chinese Notice 29/1167(T)/2024

1. Wind power turbines have been established in the following positions:

No 1 20° 13'·2N., 109° 07'·6E.
No 3 20° 12'·2N., 109° 07'·8E.
No 10 20° 08'·7N., 109° 08'·6E.
No 11 20° 08'·2N., 109° 08'·7E.
2. Offshore steel pipe works, with a diameter of 8.6m and a 12.5m high topmark are taking place, centred on 20° 09'·3N., 109° 14'·8E.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Charts affected — 3892 — 3990**4883(T)/24 CHINA - East Coast - Pilot boarding places.**

Source: Chinese Notice 31/1239(T)/24

1. A new pilot boarding area has been established bounded by the following positions:

26° 26'·77N., 119° 52'·85E.
26° 26'·55N., 119° 52'·90E.
26° 26'·74N., 119° 54'·21E.
26° 26'·99N., 119° 54'·13E.
2. The pilot boarding place in position 26° 26'·60N., 119° 52'·47E. has been removed.

4883(T)/24 CHINA - East Coast - Pilot boarding places. (continued)

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for more information.
(CGCS 2000 DATUM)

Charts affected — 2400 — 2416 — 2431

4901(T)/24 TAIWAN - Wreck. Obstructions.

Source: UKHO

1. A stranded wreck exists in approximate position 23° 02'·15N., 120° 02'·00E.
2. Multiple containers have been lost in the vicinity of 23° 02'·90N., 120° 02'·97E. Obstructions may exist within a 1·3M radius, centred on this position.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2409

4921(P)/24 SOUTH CHINA SEA - Submarine pipeline. Platforms.

Source: Indonesian Notice 33/307(P)/24

1. Pipeline laying operations are taking place, joining the following positions:

4° 08'·6N., 105° 06'·5E.

4° 30'·2N., 105° 13'·7E.

2. Platforms are being established in the following positions:

Designation

WHP-L

WHP-M

Position

4° 30'·9N., 105° 11'·5E.

4° 30'·5N., 105° 15'·0E.

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2414 — 2422 — 2869 — 3482

4942(P)/24 MALAYSIA - Peninsular Malaysia, East Coast - Platform. Submarine pipeline. Works.

Source: Marine Department, Malaysia Notice 172(T)/24

1. A platform, Bindu-A, is being established in position 6° 10'·2N., 104° 54'·2E.
2. Pipeline laying operations are taking place, joining the following positions:

5° 38'·8N., 104° 58'·9E.
6° 10'·2N., 104° 54'·2E.
3. Mariners are requested to maintain a distance of at least 2 nautical miles from the working area and to navigate with caution in the area.
4. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 2414 — 2422 — 2426 — 3482

5492(P)/24 CHINA - East Coast - Bridges. Overhead cables. Vertical clearances.

Source: UKHO

1. Uncharted bridges have been reported, in the vicinity of the following positions:

Name

Chang Tai Bridge

Chang Jiang Bridge

Long Tan Bridge

Clearance (Reported)

70m

Unknown

51m

Position

32° 00'·55N., 119° 58'·04E.

32° 13'·61N., 119° 40'·47E.

32° 14'·61N., 119° 05'·18E.

2. Uncharted overhead power cables have been reported, in the vicinity of the following positions:

Clearance (Reported)

65m

65m

51m

Position

31° 57'·66N., 120° 03'·38E.

31° 57'·74N., 120° 03'·06E.

32° 14'·79N., 119° 05'·74E.

5492(P)/24 CHINA - East Coast - Bridges. Overhead cables. Vertical clearances. (continued)

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Charts affected — 1620 — 1621

5571(T)/24 VIETNAM - Buoyage.

Source: VMS-North Notice 120(T)/24

1. The following special light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl(4)Y.15s</i>	<i>TC01</i>	Yellow pillar, x-shape topmark	18° 08'·7N., 106° 23'·2E.
<i>Fl(4)Y.15s</i>	<i>NC</i>	Yellow pillar, x-shape topmark	18° 15'·9N., 106° 33'·0E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3989

5834(T)/24 VIETNAM - Buoy. Tidal gauge.

Source: VMS South Notice 297/24

1. An isolated danger buoy, *Fl(2)Y.5s B*, has been deployed, in position 10° 31'·18N., 107° 00'·51E.
2. A tidal gauge, in position 10° 31'·21N., 107° 00'·50E., has been destroyed.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1059

5982(T)/24 CHINA - East Coast - Wreck. Buoy. Virtual aid to navigation.

Source: Chinese Notice 46/1625/21

1. *An emergency wreck marking buoy has been established to indicate a new wreck in the following position:
30° 03'·75N., 122° 23'·65E.
2. Virtual-AIS have been established to indicate the new wreck.
3. Mariners are advised to navigate with caution in the area.
4. Former Notice 382(T)/22 is cancelled.
* Indicates new or revised entry
(CGCS 2000 DATUM)

Charts affected — 1199 — 1305 — 1759

96(T)/25 VIETNAM - Wreck.

Source: VMS-North Notice 154(T)/24

1. A wreck exists in position 20° 50'·67N., 106° 46'·43E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3882

281(T)/25 MALAYSIA - Peninsular Malaysia, East Coast - Buoyage.

Source: Marine Department, Malaysia Notice 226/24

1. ODAS buoys, *Fl(5)Y.20s*, have been deployed, until further notice, in the following positions:

<i>Designation</i>	<i>Position</i>
<i>ODAS 1</i>	4° 19'·69N., 103° 39'·99E.
<i>ODAS 2</i>	4° 16'·77N., 103° 44'·24E.

281(T)/25 MALAYSIA - Peninsular Malaysia, East Coast - Buoyage. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2414 — 2422 — 3446 — 3482 — 4508

311(P)/25 CHINA - South Coast - Submarine power cable.

Source: Chinese Notice 23/813(T)/21 and 51/1991/24

1. A submarine power cable is being laid, within an area 300m wide, centred on a line joining the following positions:

21° 31'·76N., 111° 39'·31E.

21° 30'·42N., 111° 40'·78E.

*21° 28'·62N., 111° 39'·86E.

2. Vessels should navigate with caution and avoid anchoring or trawling in the vicinity of the cable route.
3. Charts will be updated when full details are available.
4. *Former Notice 4313(P)/21 is cancelled.
*Indicates new or revised entry
(CGCS 2000 DATUM)

Charts affected — 1537 — 1555

590(T)/25 MALAYSIA - Peninsular Malaysia, East Coast - Buoy.

Source: Marine Department, Malaysia Notice 271(T)/24

1. The isolated danger light-buoy, *Fl(2)10s*, in position 1° 17'·68N., 104° 11'·09E. is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2403 — 3831 — 4042 — 5527

663(T)/25 CHINA - Bo Hai - Wreck.

Source: Chinese Notice 52/2048(T)/24

1. A dangerous wreck has been reported in position 39° 49'·90N., 121° 09'·40E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1249 — 1252 — 1256

732(T)/25 VIETNAM - Wreck.

Source: VMS-North Notice 180(T)/24

1. A dangerous wreck exists in position 16° 06'·57N., 108° 14'·34E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3884

781(P)/25 THAILAND - Gulf of Thailand Coast - Jetty. Works. Buoyage.

Source: Thai Notices 12(P)/2565 (2022) and 11(P)/2567 (2024)

1. *Jetty construction works are taking place, marked by yellow special purpose light-buoys, *Fl.Y.4s*, until May 2026, in an area bounded by the following positions:

13° 04'·10N., 100° 52'·17E.

13° 03'·77N., 100° 50'·64E.

13° 00'·88N., 100° 52'·18E.

13° 01'·08N., 100° 54'·54E.

13° 02'·04N., 100° 54'·93E.

2. Mariners are advised to navigate with caution in the area.

781(P)/25 THAILAND - Gulf of Thailand Coast - Jetty. Works. Buoyage. (continued)

3. *Former Notice 5055(P)/22 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 986 — 1046

838(P)/25 TAIWAN - Submarine cable. Works.

Source: UKHO

1. Submarine cable laying works are taking place within an area bounded by the following positions:

24° 06'·71N., 120° 23'·64E.
 24° 06'·91N., 120° 22'·78E.
 24° 06'·95N., 120° 20'·47E.
 24° 07'·45N., 120° 17'·89E.
 24° 07'·52N., 120° 17'·80E.
 24° 07'·72N., 120° 16'·70E.
 24° 07'·60N., 120° 16'·60E.
 24° 07'·24N., 120° 10'·64E.
 24° 07'·51N., 120° 10'·23E.
 24° 02'·20N., 119° 55'·97E.
 24° 02'·07N., 119° 55'·21E.
 24° 02'·74N., 119° 55'·72E.
 24° 02'·74N., 119° 55'·85E.
 24° 08'·13N., 120° 10'·31E.
 24° 07'·80N., 120° 10'·81E.
 24° 08'·05N., 120° 16'·64E.
 24° 07'·83N., 120° 17'·93E.
 24° 07'·24N., 120° 20'·60E.
 24° 07'·20N., 120° 22'·79E.
 24° 06'·99N., 120° 23'·79E.

2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 1760 — 2409 — 3231

842(T)/25 CHINA - South Coast - Works.

Source: Hong Kong Notice 25/60(T)/24

1. Marine works are taking place in areas bounded by the following positions:

22° 16'·826N., 114° 05'·532E.
 22° 16'·126N., 114° 04'·713E.
 22° 16'·070N., 114° 03'·949E.
 22° 16'·872N., 114° 04'·183E.
 22° 16'·950N., 114° 05'·216E.
 and

22° 15'·556N., 114° 04'·047E.
 22° 15'·548N., 114° 03'·797E.
 22° 15'·902N., 114° 03'·900E.
 22° 15'·938N., 114° 04'·494E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
 (WGS84 DATUM)

Charts affected — 4119 — 4121 — 4122 — 4129

845(T)/25 CHINA - Yellow Sea Coast - Wreck.

Source: Chinese Notice 49/1930(T)/24

1. A dangerous wreck has been reported drifting in the vicinity of position 36° 55'·00N., 123° 01'·00E.
 2. Mariners are advised to navigate with caution in the area.
 (CGCS 2000 DATUM)

Charts affected — 1254 — 1256 — 1289 — 3480

882(T)/25 CHINA - Bo Hai - Obstruction.

Source: Chinese Notice 52/2050(T)/24

1. An obstruction, 30m x 30m in size, has been reported in position 38° 17'·00N., 121° 01'·00E., drifting southwards.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1206 — 1255**883(T)/25 CHINA - Bo Hai - Wreck.**

Source: Chinese Notice 52/2047(T)/24

1. A dangerous wreck has been reported in position 39° 52'·00N., 121° 21'·70E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Charts affected — 1249 — 1252**884(T)/25 CHINA - Bo Hai - Wreck.**

Source: Chinese Notice 52/2051(T)/24

1. A dangerous wreck has been reported in the approximate position 37° 53'·88N., 121° 13'·40E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1206 — 1255**898(T)/25 VIETNAM - Works. Light.**

Source: VMS-North Notice 184(T)/24

1. The White sector at the DaoTran Lighthouse 21° 14'·3N., 107° 57'·8E. has been withdrawn and the White sector has been temporarily amended to 251·49°- 233·43°(341·94°).
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 3990**941(T)/25 MALAYSIA - Peninsular Malaysia, East Coast - Obstructions.**

Source: Marine Department, Malaysia Notice 14(T)/25

1. It has been reported that 62 shipping containers have gone overboard in the vicinity of 5° 30'·62N., 103° 20'·40E.
2. Mariners are advised to navigate with caution in the area and inform the local authorities of any floating containers.
(WGS84 DATUM)

Charts affected — 2414 — 2422 — 3446 — 3447**1121(T)/25 CHINA - South Coast - Dredging areas. Works.**

Source: Hong Kong Notice 1/3(T)/25

1. Dredging works are taking place in the areas bounded by the following positions:

22° 20'·626N., 114° 07'·258E.
 22° 20'·594N., 114° 07'·147E.
 22° 19'·561N., 114° 07'·498E.
 22° 19'·593N., 114° 07'·609E.
 22° 20'·148N., 114° 07'·420E.
 22° 20'·156N., 114° 07'·448E.
 22° 20'·262N., 114° 07'·412E.
 22° 20'·254N., 114° 07'·384E.
 and

22° 20'·513N., 114° 06'·869E.
 22° 19'·785N., 114° 07'·115E.
 22° 19'·822N., 114° 07'·226E.

1121(T)/25 CHINA - South Coast - Dredging areas. Works. (continued)

22° 20'·546N., 114° 06'·981E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 4118 — 4119 — 4122**1136(T)/25 CHINA - Bo Hai - Danger area.**

Source: Chinese Bulletin Section 1 44/24

1. An unexploded ordnance has been reported within the vicinity of: 38° 19'·20N., 120° 46'·80E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1206 — 1250 — 1255**1439(T)/25 CHINA - East Coast - Obstruction.**

Source: Chinese Notice 8/201(T)/25

1. An obstruction has been reported in position 29° 42'·60N., 122° 29'·83E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1126 — 1759**1560(P)/25 CHINA - Yellow Sea Coast - Recommended routes.**

Source: UKHO

1. *Recommended routes in the Bohai sea and waters to the East, Liaodong Wan and Shandong area are reported to exist as follows:
2. **Haigang Gangqu to Changshan Shuidao:**

<i>Northern boundary line</i>	<i>Southern boundary line</i>
38° 05'·90N., 120° 16'·07E.	38° 04'·93N., 120° 15'·73E.
38° 12'·12N., 119° 33'·27E.	38° 10'·63N., 119° 33'·07E.
38° 16'·97N., 119° 15'·43E.	38° 15'·83N., 119° 14'·33E.
38° 22'·88N., 118° 41'·30E.	38° 19'·48N., 118° 53'·40E.
38° 23'·43N., 118° 28'·20E.	38° 21'·37N., 118° 28'·70E.
38° 21'·72N., 118° 23'·20E.	38° 19'·80N., 118° 24'·33E.

3. **Dongying Gang to Changshan Shuidao:**

<i>Northern boundary line</i>	<i>Southern boundary line</i>
38° 04'·48N., 120° 15'·68E.	38° 02'·83N., 120° 15'·65E.
38° 03'·42N., 119° 32'·57E.	38° 01'·23N., 119° 33'·45E.
38° 05'·40N., 119° 17'·47E.	38° 03'·28N., 119° 17'·47E.

4. **Weifang Gang to Changshan Shuidao:**

<i>Northern boundary line</i>	<i>Southern boundary line</i>
38° 00'·07N., 120° 15'·03E.	37° 58'·10N., 120° 16'·67E.
37° 53'·90N., 120° 01'·75E.	37° 50'·72N., 120° 03'·17E.
	37° 47'·30N., 119° 59'·32E.
37° 45'·75N., 119° 51'·62E.	37° 43'·62N., 119° 54'·32E.
37° 36'·75N., 119° 36'·63E.	37° 34'·57N., 119° 39'·33E.

5. **West route of Laizhou Gang:**

<i>Western boundary line</i>	<i>Eastern boundary line</i>
37° 38'·75N., 119° 50'·50E.	37° 38'·75N., 119° 53'·85E.
38° 01'·82N., 119° 50'·50E.	38° 01'·92N., 119° 53'·85E.

6. **Longkou Gang to Laizhou Gang:**

<i>Northern boundary line</i>	<i>Southern boundary line</i>
37° 48'·77N., 120° 00'·80E.	37° 45'·47N., 119° 56'·85E.
	37° 45'·47N., 120° 02'·53E.
37° 44'·73N., 120° 06'·03E.	37° 43'·78N., 120° 04'·77E.

1560(P)/25 CHINA - Yellow Sea Coast - Recommended routes. (continued)**7. Longkou Gang to Changshan Shuidao:**

<i>Western boundary line</i>	<i>Eastern boundary line</i>
37° 58'·02N., 120° 16'·67E.	37° 56'·07N., 120° 19'·73E.
37° 51'·02N., 120° 09'·83E.	37° 49'·00N., 120° 12'·75E.
37° 44'·97N., 120° 08'·82E.	37° 44'·97N., 120° 12'·75E.

8. Yantai Gang to Weihai Gang:

<i>Northern boundary line</i>	<i>Southern boundary line</i>
37° 39'·55N., 122° 08'·70E.	37° 37'·53N., 122° 10'·20E.
37° 39'·55N., 121° 33'·50E.	37° 37'·53N., 121° 33'·50E.

9. Weihai Gang to Chengshan Jiao:

<i>Northern boundary line</i>	<i>Southern boundary line</i>
37° 33'·50N., 122° 34'·13E.	37° 30'·53N., 122° 39'·47E.
37° 33'·50N., 122° 19'·38E.	37° 30'·53N., 122° 19'·38E.

10. Longyan Gang to Chengshan Jiao:

<i>Western boundary line</i>	<i>Eastern boundary line</i>
37° 27'·52N., 122° 37'·45E.	37° 27'·52N., 122° 39'·95E.
37° 30'·50N., 122° 37'·45E.	37° 30'·00N., 122° 39'·95E.

11. Rongcheng Wan to Chengshan Jiao:

<i>Northern boundary line</i>	<i>Southern boundary line</i>
37° 21'·78N., 122° 45'·92E.	37° 17'·05N., 122° 45'·92E.
37° 21'·78N., 122° 40'·67E.	37° 20'·83N., 122° 39'·22E.

12. Lidao to Chengshan Jiao:

<i>Northern boundary line</i>	<i>Southern boundary line</i>
37° 17'·05N., 122° 45'·92E.	37° 16'·25N., 122° 45'·92E.
37° 17'·05N., 122° 40'·72E.	37° 16'·25N., 122° 40'·72E.

13. Qingdao Gang to Chengshan Jiao:

<i>Northern boundary line</i>	<i>Southern boundary line</i>
36° 02'·17N., 120° 47'·50E.	36° 00'·37N., 120° 48'·37E.
36° 19'·43N., 121° 37'·93E.	36° 17'·02N., 121° 39'·47E.
36° 38'·28N., 122° 16'·35E.	36° 37'·75N., 122° 20'·83E.
36° 53'·43N., 122° 42'·63E.	36° 50'·48N., 122° 42'·65E.

14. Aoshan Wan to Qingdao Gang:

<i>Northern boundary line</i>	<i>Southern boundary line</i>
36° 14'·25N., 120° 53'·15E.	36° 13'·20N., 120° 51'·78E.
36° 19'·70N., 120° 45'·33E.	36° 18'·75N., 120° 44'·03E.

15. Rizhao Gang to Qingdao Gang:

<i>Western boundary line</i>	<i>Eastern boundary line</i>
35° 23'·68N., 119° 53'·93E.	35° 23'·48N., 119° 55'·23E.
35° 45'·07N., 120° 05'·97E.	35° 44'·53N., 120° 07'·57E.

16. Qingdao Gang to Rizhao Gang approaches:

<i>Northern boundary line</i>	<i>Southern boundary line</i>
35° 23'·12N., 120° 54'·57E.	35° 23'·12N., 120° 57'·22E.
35° 36'·82N., 120° 54'·57E.	35° 31'·53N., 120° 57'·22E.

17. Qingdao Gang to Shanghai, Yangtze River estuary:

<i>Western boundary line</i>	<i>Eastern boundary line</i>
35° 54'·80N., 120° 45'·67E.	35° 54'·80N., 120° 49'·50E.
35° 24'·80N., 121° 00'·47E.	35° 25'·90N., 121° 04'·00E.

18. Dongjiakou Gangqu to Chengshan Jiao:

<i>Northern boundary line</i>	<i>Southern boundary line</i>
35° 19'·00N., 120° 03'·07E.	35° 17'·22N., 120° 06'·03E.
35° 19'·00N., 120° 30'·00E.	35° 17'·22N., 120° 16'·73E.

1560(P)/25 CHINA - Yellow Sea Coast - Recommended routes. (continued)**19. Dongjiakou Gangqu to Shanghai, Yangtze River estuary:**

<i>Northern boundary line</i>	<i>Southern boundary line</i>
35° 10'·50N., 120° 22'·83E.	35° 09'·33N., 120° 19'·50E.
35° 18'·67N., 120° 02'·37E.	35° 17'·45N., 119° 59'·92E.

20. Charts will be updated when full details are available

21. *Former Notice 3255(P)/24 is cancelled.

*Indicates new or revised entry
(CGCS 2000 DATUM)

Charts affected — 1201 — 1250 — 1253 — 1254 — 1255 — 1256 — 1289 — 1294 — 1317 — 1501 — 1502

1568(T)/25 CHINA - Yellow Sea Coast - Obstruction.

Source: Chinese Notice 8/198(T)/25

1. An obstruction has been reported in position 34° 21'·3N., 122° 09'·2E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3480

1583(T)/25 CHINA - East Coast - Obstruction.

Source: Chinese Notice 8/200(T)/25

1. An obstruction has been reported in position: 30° 15'·0N., 123° 01'·2E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1199 — 2412

1600(T)/25 CHINA - East Coast - Buoy. Virtual aid to navigation. Wreck.

Source: Chinese Notice 6/112/25

1. An emergency wreck marking buoy, to indicate a new wreck, has been established in position 28° 05'·69N., 121° 51'·34E. Virtual-AIS may also be established to indicate the new wreck.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1721 — 1759

1853(P)/25 CHINA - Bo Hai - Depths. Fairway.

Source: Chinese Chart 11762

1. Depths less than charted exist within Caofeidian Gangqu, Basin No 1. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
17·2m	38° 57'·11N., 118° 27'·62E.
17·2m	38° 56'·98N., 118° 27'·62E.
16·2m	38° 57'·08N., 118° 27'·84E.
15·5m	38° 56'·81N., 118° 27'·91E.

2. A fairway has been established joining the following positions:

38° 55'·05N., 118° 36'·22E.
38° 54'·37N., 118° 36'·55E.
38° 53'·87N., 118° 40'·60E.
and

38° 53'·25N., 118° 40'·60E.
38° 54'·05N., 118° 33'·37E.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. Charts will be updated when full details are available.
(CGCS 2000 DATUM)

Charts affected — 1249 — 1250 — 2657

1908(P)/25 CHINA - East Coast - Recommended routes.

Source: UKHO and Chinese Charts 13379, 13381, 13339, 13641 and 13640

1. *Recommended routes in the Zhejiang area are reported to exist as follows:
2. **West Route:**

30° 48'·50N., 122° 18'·30E.
 30° 32'·80N., 122° 11'·10E.
 30° 31'·20N., 121° 57'·90E.
 30° 21'·20N., 121° 46'·40E.
 30° 07'·00N., 121° 52'·80E.
 30° 05'·10N., 121° 53'·98E.
 30° 04'·20N., 121° 54'·65E.
 30° 03'·37N., 121° 55'·47E.
 30° 02'·29N., 121° 56'·34E.
 29° 58'·30N., 121° 58'·40E.
 29° 55'·37N., 122° 01'·58E.
 29° 55'·37N., 122° 07'·71E.
 29° 52'·80N., 122° 09'·10E.
 29° 50'·64N., 122° 07'·57E.
 29° 46'·92N., 122° 03'·78E.
 29° 45'·81N., 122° 03'·66E.
 29° 44'·06N., 122° 02'·87E.
 29° 42'·60N., 122° 01'·82E.
 29° 33'·90N., 122° 06'·70E.
 29° 06'·90N., 122° 06'·70E.
 28° 45'·60N., 122° 01'·00E.
 28° 27'·80N., 121° 48'·40E.
 28° 14'·60N., 121° 45'·50E.
 27° 43'·50N., 121° 14'·50E.
 27° 38'·20N., 121° 05'·80E.
 27° 27'·00N., 120° 54'·00E.
 27° 05'·20N., 120° 36'·20E.

3. **Central approach route of Zhoushan:**

30° 21'·20N., 121° 46'·40E.
 30° 17'·00N., 121° 49'·50E.
 30° 15'·80N., 121° 55'·50E.
 30° 12'·40N., 122° 03'·50E.
 30° 11'·27N., 122° 04'·86E.

4. Charts will be updated when full details are available.

5. *Former Notice 3468(P)/2024 is cancelled.

*Indicates new or revised entry
 (CGCS 2000 DATUM)

Charts affected — 1126 — 1130 — 1303 — 1304

2032(T)/25 MALAYSIA - Peninsular Malaysia, East Coast - Buoy.

Source: Marine Department, Malaysia Notice 62(T)/25

1. The isolated danger light-buoy, *Fl(2)10s JBB 97*, in position 1° 20'·87N., 104° 18'·97E. is reported damaged.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 2403 — 3831 — 4042

2170(P)/25 CHINA - Yellow Sea Coast - Submarine cable. Wind farm.

Source: Chinese Charts 11142 and 11100

1. A submarine cable has been laid joining the following positions:

39° 40′·56N., 123° 10′·23E.
39° 40′·34N., 123° 10′·30E.
39° 40′·07N., 123° 10′·53E.
39° 38′·99N., 123° 10′·74E.
39° 33′·83N., 123° 12′·56E.
39° 31′·84N., 123° 19′·37E.

2. Wind farms have been established, in the vicinity of the following positions:

39° 32′·14N., 123° 18′·91E.
39° 29′·06N., 123° 12′·03E.
39° 25′·57N., 123° 19′·99E.

3. Mariners are advised to navigate with caution in the area.
4. Chart 1251 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1251

2181(T)/25 VIETNAM - Dredging area. Works. Buoyage.

Source: VMS-South Notice 74/25

1. Dredging works are taking place in the approaches to Quy Nhon, within an area bounded by the following positions:

13° 47′·18N., 109° 14′·32E.
13° 47′·18N., 109° 15′·51E.
13° 43′·05N., 109° 15′·51E.
13° 43′·05N., 109° 14′·32E.

2. Works are expected to be completed December 2025.
3. During the works, buoyage may be off station.
4. Mariners are advised to navigate with caution in the area and consult the Southern Vietnam Maritime Safety Corporation (VMS South) for the latest information.
5. Charts will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 3874

2331(T)/25 CHINA - South Coast - Buoy.

Source: Chinese Notice 9/237(T)/25

1. The lateral light-buoy, *Fl.G.4s No 1*, in position 20° 14′·80N., 110° 14′·90E., has been removed.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 3890

2403(T)/25 CHINA - South Coast - Dredging area. Works.

Source: Chinese Notice 16/522(T)/25

1. Dredging works are taking place in the area bounded by the following positions:

21° 07′·47N., 109° 07′·97E.
21° 07′·26N., 109° 08′·02E.
21° 10′·80N., 109° 24′·14E.
21° 11′·33N., 109° 24′·72E.
21° 11′·48N., 109° 24′·57E.
21° 11′·13N., 109° 24′·14E.
21° 10′·98N., 109° 23′·84E.
21° 10′·89N., 109° 23′·52E.

2403(T)/25 CHINA - South Coast - Dredging area. Works. (continued)

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Charts affected — 1728 — 3892**2409(T)/25 TAIWAN - Works. Buoy.**

Source: UKHO and Taiwanese Notice 13/25

1. The Porthand lateral light-buoy *No.3, Fl(2)G.4s* in position 24° 15'·30N., 120° 30'·36E. has been moved to position 24° 15'·14N., 120° 30'·30E.
2. Wharf construction works are taking place in the vicinity of the following positions:
24° 15'·61N., 120° 30'·50E.
24° 15'·24N., 120° 30'·31E.
24° 15'·20N., 120° 30'·40E.
24° 15'·59N., 120° 30'·57E.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2618**2414(T)/25 CHINA - Bo Hai - Obstruction.**

Source: Chinese Notice 16/518(T)/25

1. An obstruction has been reported in the approximate position 38° 38'·00N., 120° 36'·20E.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Charts affected — 1206 — 1249 — 1250 — 1255 — 1256**2485(T)/25 CHINA - Bo Hai - Obstructions.**

Source: Chinese Notice 19/614(T)/25

1. Obstructions have been reported to exist in the following positions:
38° 40'·4N., 120° 08'·5E.
38° 39'·3N., 120° 10'·3E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1249 — 1250 — 1255 — 1256**2634(T)/25 CHINA - Yellow Sea Coast - Wreck.**

Source: Chinese Notice 11/359(T)/25

1. A dangerous wreck has been reported drifting in the vicinity of position 37° 54'·45N., 122° 42'·83E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1255 — 1256 — 1289

2664(T)/25 CHINA - South Coast - Dredging area. Works.

Source: Chinese Notice 11/362(T)/25

1. Dredging works are taking place in the area bounded by the following positions:

21° 28'·00N., 109° 33'·13E.
 21° 27'·77N., 109° 33'·02E.
 21° 27'·42N., 109° 32'·90E.
 21° 27'·05N., 109° 32'·85E.
 21° 26'·68N., 109° 32'·88E.
 21° 23'·99N., 109° 33'·43E.
 21° 23'·94N., 109° 33'·45E.
 21° 20'·38N., 109° 34'·18E.
 21° 17'·33N., 109° 31'·41E.
 21° 13'·67N., 109° 27'·30E.
 21° 12'·27N., 109° 25'·72E.
 21° 11'·23N., 109° 24'·56E.
 21° 11'·33N., 109° 24'·46E.
 21° 17'·42N., 109° 31'·31E.
 21° 19'·65N., 109° 33'·33E.
 21° 20'·18N., 109° 33'·68E.
 21° 20'·79N., 109° 33'·85E.
 21° 21'·41N., 109° 33'·82E.
 21° 23'·91N., 109° 33'·31E.
 21° 23'·97N., 109° 33'·30E.
 21° 27'·26N., 109° 32'·63E.
 21° 28'·05N., 109° 33'·00E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Charts affected — 1728 — 3892**2809(T)/25 CHINA - Yellow Sea Coast - Wreck.**

Source: Chinese Notice 11/360(T)/25

1. A dangerous wreck has been reported drifting in the vicinity of position: 35° 34'·83N., 120° 14'·87E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1253 — 1501 — 3480**2824(T)/25 THAILAND - Gulf of Thailand Coast - Wreck.**

Source: Thai Notice 5(T)/2568 (2025)

1. A dangerous wreck has been reported to exist in approximate position: 12° 31'·56N., 100° 57'·58E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1046 — 3727 — 3965 — 3966**3076(T)/25 GULF OF THAILAND - Wreck.**

Source: Marine Department, Malaysia Notice 125/25

1. A wreck has been reported in the following positions:

7° 43'·9N., 102° 59'·4E.
 7° 37'·6N., 102° 56'·9E.
 7° 19'·9N., 102° 46'·3E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2414 — 2426 — 3985 — 4508

3217(T)/25 CHINA - Bo Hai - Channel limits. Lights. Buoyage.

Source: Chinese Notices 20/650(T)-651(T)/25

1. A channel, marked by lights and lateral buoys, has been established, joining the following positions:

37° 41'·91N., 120° 10'·67E.

37° 36'·84N., 120° 10'·67E.

37° 36'·17N., 120° 11'·45E.

and

37° 41'·91N., 120° 10'·87E.

37° 37'·51N., 120° 10'·86E.

37° 36'·84N., 120° 11'·16E.

37° 36'·37N., 120° 11'·76E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Chart affected — 1294**3226(T)/25 TAIWAN - Works. Buoyage.**

Source: Taiwanese Notice 78(T)/25

1. Maritime work is being undertaken in the following area, which is marked by light-buoys, *Fl.Y.4s*:

22° 23'·83N., 120° 32'·82E.

22° 23'·22N., 120° 32'·40E.

22° 23'·16N., 120° 32'·49E.

22° 23'·77N., 120° 32'·92E.

2. Conical light-buoys, *Fl.Y.4s*, have been deployed in the following positions:

22° 23'·22N., 120° 32'·49E.

22° 23'·26N., 120° 32'·48E.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for more information.
(WGS84 DATUM)

Charts affected — 3230 — 3232**3242(T)/25 MALAYSIA - Peninsular Malaysia, East Coast - Moored storage tanker. Platform.**

Source: Marine Department, Malaysia Notice 135(T)/25

1. The *FSO 'Duta Pacific'* has been laid up in position 5° 43'·95N., 103° 39'·20E. until further notice.
2. A Wellhead Support Structure has been laid up in position 5° 44'·11N., 103° 38'·96E. until further notice.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2414 — 2422 — 2426 — 3446 — 3447 — 3482**3243(T)/25 CHINA - Yellow Sea Coast - Buoy. Wreck. Virtual aid to navigation.**

Source: Chinese Notice 21/662/25

1. An emergency wreck marking buoy, to indicate a new wreck, has been established in position 34° 56'·6N., 120° 18'·9E.
2. Virtual-AIS has been established to indicate the new wreck.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Chart affected — 1253

3357(T)/25 CHINA - East Coast - Works.

Source: Chinese Notice 22/724(T)/25

1. Offshore operating areas with a circular limit, radius 0.03M, have been established, centred on the following positions:

29° 43'·07N., 121° 57'·13E.
29° 41'·95N., 121° 59'·18E.
29° 45'·43N., 122° 00'·98E.
29° 46'·26N., 122° 01'·32E.
29° 48'·79N., 122° 01'·99E.
29° 48'·26N., 122° 03'·41E.
29° 50'·15N., 122° 04'·62E.
29° 50'·70N., 122° 04'·96E.
29° 50'·08N., 122° 07'·55E.
29° 50'·41N., 122° 09'·77E.
29° 52'·15N., 122° 09'·64E.

2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1126 — 1130**3678(T)/25 CHINA - East Coast - Wreck.**

Source: Chinese Notice 26/826(T)/25

1. A dangerous wreck has been reported drifting in the vicinity of position 30° 10'·0N., 123° 25'·0E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1199 — 2412 — 4509**3712(T)/25 TAIWAN - Platform. Buoyage.**

Source: UKHO

1. An unlit platform has been established in position: 22° 55'·66N., 120° 08'·47E.
2. The platform is marked by light-buoys, *Fl. Y. 4s*
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2409 — 3232**3822(P)/25 CHINA - East Coast - Overhead cable. Vertical clearance.**

Source: Globe Polaris

1. It has been reported that the overhead power cable, with a charted vertical clearance of 36m, in position: 29° 43'·91N., 122° 13'·03E., has been removed.
2. Charts will be updated when full details are available.
(CGCS 2000 DATUM)

Chart affected — 1126**3963(T)/25 MALAYSIA - Peninsular Malaysia, East Coast - Buoy.**

Source: Marine Department, Malaysia Notice 161(T)/25

1. The safe water light-buoy, *LFl. 10s*, in position 5° 50'·78N., 102° 33'·22E. is temporarily unlit.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3447

3991(T)/25 CHINA - South Coast - Works.

Source: Hong Kong Notice 13/35(T)/25

1. Marine site investigation works are taking place in an area bounded by the following positions:

22° 19'·694N., 114° 03'·768E.
22° 19'·509N., 114° 03'·541E.
22° 18'·888N., 114° 03'·369E.
22° 18'·282N., 114° 04'·127E.
22° 18'·428N., 114° 04'·593E.
22° 19'·208N., 114° 04'·525E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 4122 — 4129**4049(T)/25 CHINA - East Coast - Works.**

Source: Chinese Notice 22/721(T)/25

1. Offshore operating areas with a circular limit, radius 0·03M, have been established, centred on the following positions:

30° 08'·61N., 121° 45'·26E.
30° 07'·02N., 121° 45'·39E.
30° 06'·41N., 121° 42'·04E.
30° 06'·53N., 121° 39'·09E.
30° 04'·15N., 121° 40'·76E.
30° 04'·78N., 121° 42'·66E.
30° 03'·32N., 121° 43'·24E.
30° 03'·62N., 121° 44'·22E.
30° 01'·71N., 121° 44'·85E.
30° 00'·69N., 121° 44'·63E.
29° 59'·81N., 121° 43'·50E.
29° 59'·25N., 121° 44'·60E.
29° 59'·19N., 121° 46'·03E.
29° 59'·96N., 121° 49'·73E.

2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1304 — 1592**4314(T)/25 TAIWAN - Platform.**

Source: UKHO

1. A wave generator verification platform has been deployed in position 25° 09'·240N., 121° 46'·690E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2619**4347(T)/25 MALAYSIA - Peninsular Malaysia, East Coast - Works. Dredged area. Spoil ground.**

Source: Marine Department, Malaysia Notice 184(T)/25

1. Dredging works are taking place within an area bounded by the following positions:

1° 26'·17N., 103° 55'·41E.
1° 25'·98N., 103° 55'·39E.
1° 25'·98N., 103° 55'·34E.
1° 26'·09N., 103° 55'·26E.
1° 26'·09N., 103° 55'·22E.
1° 26'·17N., 103° 55'·22E.

4347(T)/25 MALAYSIA - Peninsular Malaysia, East Coast - Works. Dredged area. Spoil ground. (continued)

2. A spoil ground has been established, within an area bounded by the following positions:

1° 26'·02N., 104° 23'·75E.
1° 26'·01N., 104° 24'·00E.
1° 25'·52N., 104° 23'·81E.
1° 25'·52N., 104° 23'·51E.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2403 — 3831 — 4044

4386(T)/25 TAIWAN - Works.

Source: UKHO

1. Dredging works are taking place within areas bounded by the following positions:

24° 16'·68N., 120° 31'·00E.
24° 16'·33N., 120° 30'·86E.
24° 16'·32N., 120° 30'·88E.
24° 16'·64N., 120° 31'·02E.
24° 16'·60N., 120° 31'·13E.
24° 16'·63N., 120° 31'·14E.
and

24° 16'·75N., 120° 31'·40E.
24° 16'·45N., 120° 31'·57E.
24° 16'·45N., 120° 31'·61E.
24° 16'·76N., 120° 31'·43E.
and

24° 17'·03N., 120° 31'·53E.
24° 17'·05N., 120° 31'·52E.
24° 17'·04N., 120° 31'·39E.
24° 17'·01N., 120° 31'·41E.
and

24° 17'·24N., 120° 31'·76E.
24° 17'·22N., 120° 31'·82E.
24° 17'·20N., 120° 31'·62E.
24° 17'·23N., 120° 31'·62E.
and

24° 17'·36N., 120° 31'·02E.
24° 17'·35N., 120° 31'·04E.
24° 17'·27N., 120° 31'·01E.
24° 17'·23N., 120° 31'·06E.
24° 17'·22N., 120° 31'·06E.
24° 17'·26N., 120° 30'·99E.
24° 17'·27N., 120° 30'·99E.
24° 17'·27N., 120° 30'·97E.

2. Works to install a floating dock are taking place within an area bounded by the following positions:

24° 15'·96N., 120° 31'·45E.
24° 15'·96N., 120° 31'·37E.
24° 16'·07N., 120° 31'·41E.
24° 16'·07N., 120° 31'·44E.

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2618

4392(T)/25 CHINA - East Coast - Dredging area. Works.

Source: Chinese Bulletin Section 1 28/25

1. Dredging works are taking place in the area bounded by the following positions:

31° 07'·44N., 121° 53'·76E.
31° 07'·77N., 121° 53'·18E.
31° 08'·31N., 121° 52'·47E.
31° 08'·49N., 121° 52'·66E.
31° 07'·97N., 121° 53'·33E.
31° 07'·65N., 121° 53'·91E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Chart affected — 1602**4412(T)/25 CHINA - East Coast - Wreck.**

Source: Chinese Notice 28/879(T)/25

1. A dangerous wreck has been reported drifting in the vicinity of position 30° 50'·1N., 123° 09'·6E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1199 — 2412 — 3480**4413(P)/25 CHINA - Bo Hai - Obstruction.**

Source: Chinese Bulletin Section 1 29/25

1. An obstruction exists in position 39° 27'·6N., 119° 35'·7E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1249**4429(T)/25 CHINA - East Coast - Dredging area. Works.**

Source: Chinese Notice 30/936(T)/25

1. Dredging works and reef removal operations are taking place in the area bounded by the following positions:

29° 45'·32N., 122° 00'·45E.
29° 45'·03N., 122° 00'·58E.
29° 45'·52N., 122° 01'·23E.
29° 45'·63N., 122° 01'·47E.
29° 45'·72N., 122° 01'·26E.
29° 45'·53N., 122° 00'·94E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Chart affected — 1126

4528(P)/25 CHINA - East Coast - Buoyage.

Source: UKHO

1. The following light-buoys in the approaches to Shanghai have been moved to indicate an adjustment of the Nancao Hangdao channel:

<i>Characteristic</i>	<i>Designation</i>	<i>Former Position</i>	<i>New Position</i>
<i>Mo(A)6s</i>	<i>S1</i>	31° 00'·29N., 122° 28'·19E.	31° 00'·33N., 122° 27'·95E.
<i>LFl.10s</i>	<i>S2</i>	31° 00'·63N., 122° 26'·47E.	31° 00'·69N., 122° 26'·21E.
<i>Iso.4s</i>	<i>S3</i>	31° 00'·99N., 122° 24'·79E.	31° 01'·04N., 122° 24'·46E.
<i>Mo(A)6s</i>	<i>S4</i>	31° 01'·32N., 122° 23'·07E.	31° 01'·39N., 122° 22'·72E.
<i>LFl.10s</i>	<i>S5</i>	31° 01'·67N., 122° 21'·38E.	31° 01'·74N., 122° 20'·97E.
<i>Iso.4s</i>	<i>S6</i>	31° 02'·01N., 122° 19'·66E.	31° 01'·84N., 122° 19'·33E.
<i>Mo(A)6s</i>	<i>S7</i>	31° 02'·34N., 122° 17'·98E.	31° 01'·94N., 122° 17'·68E.
<i>LFl.10s</i>	<i>S8</i>	31° 02'·66N., 122° 16'·40E.	31° 02'·04N., 122° 16'·04E.
<i>Iso.4s</i>	<i>S9</i>	31° 02'·74N., 122° 14'·76E.	31° 02'·14N., 122° 14'·40E.
<i>Mo(A)6s</i>	<i>S10</i>	31° 02'·81N., 122° 13'·15E.	31° 02'·25N., 122° 12'·75E.
<i>Fl(3)G.10s</i>	<i>S11</i>	31° 03'·30N., 122° 10'·67E.	31° 02'·70N., 122° 10'·62E.
<i>Fl(3)R.10s</i>	<i>S12</i>	31° 02'·50N., 122° 09'·32E.	31° 02'·09N., 122° 09'·86E.
<i>Q.G</i>	<i>S13</i>	31° 03'·41N., 122° 08'·85E.	31° 02'·84N., 122° 08'·29E.
<i>Q.R</i>	<i>S14</i>	31° 02'·83N., 122° 07'·37E.	31° 02'·49N., 122° 07'·22E.
<i>Fl.G.4s</i>	<i>S15</i>	31° 03'·93N., 122° 06'·57E.	31° 03'·46N., 122° 06'·37E.
<i>Fl.R.4s</i>	<i>S16</i>	31° 03'·43N., 122° 05'·54E.	31° 03'·09N., 122° 05'·40E.
<i>Fl(2)G.6s</i>	<i>S17</i>	31° 04'·55N., 122° 04'·35E.	31° 04'·18N., 122° 04'·18E.
<i>Fl.G.4s</i>	<i>S23</i>	31° 05'·75N., 121° 59'·87E.	31° 05'·95N., 121° 59'·84E.
<i>Mo(O)Y.15s</i>	<i>H18</i>	31° 03'·28N., 122° 05'·63E.	31° 02'·58N., 122° 05'·94E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(CGCS 2000 DATUM)

Chart affected — 1602**4905(P)/25 CHINA - South Coast - Anchorage areas. Works. Port development. Depths. Buoyage.**

Source: UKHO

1. A new terminal has been established in an area bounded by the following positions:

23° 34'·94N., 117° 07'·87E.
 23° 34'·54N., 117° 08'·56E.
 23° 34'·06N., 117° 08'·33E.
 23° 34'·12N., 117° 08'·22E.
 23° 34'·47N., 117° 08'·38E.
 23° 34'·86N., 117° 07'·80E.

2. Anchorages have been established bounded by the following positions:

<i>Anchorage</i>	<i>Positions</i>
C2	23° 26'·82N., 117° 16'·70E. 23° 26'·27N., 117° 17'·07E. 23° 25'·85N., 117° 16'·39E. 23° 26'·09N., 117° 16'·22E. 23° 26'·53N., 117° 16'·21E.
C3	23° 24'·62N., 117° 13'·85E. 23° 24'·06N., 117° 14'·23E. 23° 23'·32N., 117° 12'·99E. 23° 23'·87N., 117° 12'·62E.
* C1	23° 30'·93N., 117° 10'·10E. 23° 29'·77N., 117° 11'·34E. 23° 29'·39N., 117° 10'·93E. 23° 30'·54N., 117° 09'·68E.

4905(P)/25 CHINA - South Coast - Anchorage areas. Works. Port development. Depths. Buoyage. (continued)

3. *Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
* 10·5m	23° 29'·73N., 117° 09'·60E.
* 10·3m	23° 31'·26N., 117° 07'·63E.
* 0·4m	23° 33'·49N., 117° 06'·55E.
* 9·6m	23° 32'·64N., 117° 08'·34E.
* 8·9m	23° 32'·77N., 117° 08'·08E.
* 8·4m	23° 33'·17N., 117° 08'·12E.
* 8·5m	23° 33'·47N., 117° 08'·47E.
* 10·7m	23° 28'·93N., 117° 09'·83E.

4. *Cardinal buoys have been established in the following positions:

<i>Buoy</i>	<i>Positions</i>
* East Cardinal	23° 33'·66N., 117° 07'·66E.
* South Cardinal	23° 33'·88N., 117° 07'·78E.

5. Mariners are advised to navigate with caution in the area.

6. Charts will be updated when full details are available.

7. *Former Notice 88(P)/25 is cancelled.

*Indicates new or revised entry
(CGCS 2000 DATUM)

Charts affected — 1760 — 1792 — 1962

4964(T)/25 VIETNAM - Wreck.

Source: VMS-North Notice 41(T)/25

1. A wreck exists in position 18° 06'·9N., 106° 30'·5E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3488 — 3989

5000(T)/25 VIETNAM - Wreck.

Source: VMS-North Notice 71(T)/25

1. A wreck has been reported in position 18° 47'·8N., 105° 45'·7E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3989

5354(P)/25 CHINA - South Coast - Wind farm. Platform.

Source: Chinese Notice 38/1139/25

1. A wind farm has been established, bounded by the following positions:

21° 23'·85N., 108° 14'·02E.
 21° 23'·22N., 108° 14'·02E.
 21° 22'·60N., 108° 10'·45E.
 21° 20'·15N., 108° 09'·53E.
 21° 17'·57N., 108° 10'·12E.
 21° 16'·18N., 108° 11'·68E.
 21° 19'·45N., 108° 14'·85E.
 21° 23'·83N., 108° 15'·05E.

2. An unlit platform has been established in position 21° 21'·31N., 108° 11'·74E.
3. Mariners are advised to navigate with caution in the area.
4. These changes will be included in a New Edition of Chart 3992 to be published early 2026.
5. Chart 3990 will be updated by Notice to Mariners.
(CGCS 2000 DATUM)

Chart affected — 3992

5414(P)/25 TAIWAN - Pilot boarding places.

Source: UKHO

- Changes to the pilot boarding places and areas in the approaches to Kaohsiung have taken place as follows:
- Pilot boarding places have been removed as follows:

<i>Name</i>	<i>Position</i>
<i>P1</i>	22° 37'·35N., 120° 13'·28E.
<i>P2</i>	22° 32'·37N., 120° 15'·88E.
<i>First Entrance</i>	22° 37'·26N., 120° 13'·26E.
<i>Second Entrance</i>	22° 32'·43N., 120° 15'·84E.
<i>Intercontinental Terminal</i>	22° 32'·18N., 120° 15'·05E.

- The pilot boarding area joining the following positions, has been removed:

22° 37'·67N., 120° 13'·17E.
 22° 37'·52N., 120° 13'·80E.
 22° 37'·04N., 120° 13'·75E.

- New pilot boarding areas have been established as follows:

<i>Name</i>	<i>Vessel Type</i>	<i>Position</i>
<i>First Entrance S</i>	Fishing vessels, tugboats, workboats and substandard vessels	22° 37'·65N., 120° 13'·29E. 22° 37'·53N., 120° 13'·85E. 22° 37'·04N., 120° 13'·78E. 22° 37'·03N., 120° 13'·21E.
<i>Second Entrance S</i>	Fishing vessels, tugboats, workboats, and other secondary or auxiliary vessels	22° 32'·65N., 120° 15'·99E. 22° 32'·76N., 120° 16'·56E. 22° 32'·41N., 120° 16'·68E. 22° 32'·21N., 120° 16'·13E.
<i>Second Entrance M</i>	Small and medium sized vessels	22° 32'·54N., 120° 15'·42E. 22° 32'·65N., 120° 15'·99E. 22° 32'·21N., 120° 16'·13E. 22° 32'·02N., 120° 15'·58E.
<i>Intercontinental Terminal L</i>	Large vessels	22° 32'·28N., 120° 14'·06E. 22° 32'·54N., 120° 15'·42E. 22° 32'·02N., 120° 15'·58E.
<i>Intercontinental Terminal</i>		22° 31'·61N., 120° 14'·43E. 22° 32'·15N., 120° 13'·42E. 22° 32'·57N., 120° 15'·56E. 22° 32'·04N., 120° 15'·66E. 22° 31'·44N., 120° 13'·97E.

- Mariners are advised to navigate with caution in the area.
- These changes will be included in a New Edition of Chart 2376 to be published early 2026.
- Charts 3230 and 3232 will be updated by Notice to Mariners.
(WGS84 DATUM)

Chart affected — 2376**5582(T)/25 CHINA - Yellow Sea Coast - Wreck.**

Source: Chinese Notice 45/1413(T)/25

- A fishing vessel is reported to be drifting in the vicinity of position 37° 59'·9N., 122° 07'·6E.
- Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1255 — 1256**5583(T)/25 CHINA - East Coast - Wreck.**

Source: Chinese Notice 45/1414(T)/25

- A fishing vessel is reported to be drifting in the vicinity of position 30° 24'·3N., 123° 09'·8E.

5583(T)/25 CHINA - East Coast - Wreck. (continued)

2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Chart affected — 1199

5837(P)/25 CHINA - Bo Hai - Depths.

Source: Chinese Bulletin Section 1 36/25

1. Abnormal depths in the approaches to Qinhuangdao Gang have been reported in the following positions:
39° 39′.89N., 119° 55′.15E.
39° 45′.15N., 119° 55′.07E.
2. Mariners are advised to navigate with caution in the area.
(CGCS 2000 DATUM)

Charts affected — 1249 — 1252 — 1256



(15) JAPAN

3852(T)/07 JAPAN - Honshū - Depths.

Source: Japanese Notice 34/1183(T)/02

1. Depths less than charted exist in the following positions:

12m 35° 07' 28"N., 140° 19' 58"E.
34m 35° 07' 21"N., 140° 21' 27"E.
21m 35° 08' 04"N., 140° 22' 35"E.
33m 35° 08' 39"N., 140° 24' 33"E.
34m 35° 08' 00"N., 140° 24' 33"E.
34m 35° 07' 58"N., 140° 25' 19"E.

Chart affected — JP 87**2050(T)/09 JAPAN - Honshū - Depth.**

Source: Japanese Notice 13/540(T)/09

1. A depth of 3·9m exists in position 35° 17' 17·6"N., 139° 33' 12·5"E. (WGS84 Datum)

Chart affected — JP 90**2051(T)/09 JAPAN - Honshū - Depth.**

Source: Japanese Notice 13/541(T)/09

1. A depth of 3·4m exists in position 34° 36' 31·4"N., 138° 51' 47·6"E. (WGS84 Datum).

Chart affected — JP 80**2667(T)/09 JAPAN - Honshū - Depths.**

Source: Japanese Notice 18/773(T)/09

1. A depth of 6·5m exists in position 35° 10' 09·4"N., 139° 40' 05·0"E.
 2. A depth of 3·1m exists in position 35° 09' 46·4"N., 139° 40' 00·0"E.
- (All positions are referred to WGS84 Datum)

Chart affected — JP 90**3043(T)/09 JAPAN - Honshū - Depth.**

Source: Japanese Notice 21/909(T)/09

1. A depth of approximately 4m exists in position 35° 17' 47·4"N., 139° 31' 15·8"E. (WGS84 Datum)

Chart affected — JP 90**3781(T)/09 JAPAN - Nansei Shotō - Depth. Rock.**

Source: Japanese Notice 26/1149(T)/09

1. A rock awash at the level of chart datum exists in position 27° 05' 59"N., 128° 01' 42"E.
 2. A depth of 9m exists in position 27° 05' 49"N., 128° 02' 02"E.
- (All positions are referred to WGS84 Datum.)

Charts affected — 2024 — JP 226

4209(T)/09 JAPAN - Nansei Shotō - Depths.

Source: Japanese Notice 29/1287(T)/09

- Depths of 1m to 6m less than charted exist within an area bounded by the following positions (WGS84 Datum):

27° 02' 54.0"N., 127° 56' 45.1"E.
 27° 03' 00.1"N., 127° 57' 04.0"E.
 27° 01' 57.1"N., 127° 56' 20.7"E.
 27° 01' 35.9"N., 127° 55' 46.4"E.
 27° 00' 30.1"N., 127° 55' 46.4"E.
 26° 59' 58.0"N., 127° 54' 54.2"E.
 26° 59' 57.6"N., 127° 54' 38.7"E.
 27° 00' 04.8"N., 127° 54' 41.5"E.
 27° 00' 30.6"N., 127° 55' 24.4"E.
 27° 01' 37.8"N., 127° 55' 37.3"E.
 and
 26° 59' 14.2"N., 127° 53' 06.5"E.
 26° 58' 53.7"N., 127° 53' 02.0"E.
 26° 58' 41.9"N., 127° 52' 45.2"E.
 26° 59' 10.8"N., 127° 52' 38.1"E.
 26° 59' 16.8"N., 127° 52' 57.4"E.

Chart affected — JP 226**4523(T)/09 JAPAN - Kyūshū - Depth.**

Source: Japanese Notice 31/1374(T)/09

- A depth of 8m exists in position 34° 05' 34"N., 129° 09' 15"E. (WGS84 Datum).

Charts affected — JP 179 — JP 187**5469(T)/09 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 38/1643(T)/09

- A depth of 8.7m exists in position 31° 52' 18"N., 129° 57' 24"E.
 - A depth of 6.7m exists in position 31° 51' 13"N., 129° 54' 32"E.
- (All positions are referred to WGS84 Datum).

Charts affected — JP 213 — JP 1222**6128(T)/09 JAPAN - Kyūshū - Depth.**

Source: Japanese Notice 43/1871(T)/09

- A depth of 10.6m exists in position 31° 51' 33"N., 129° 58' 34"E. (WGS84 Datum).

Charts affected — JP 213 — JP 1222**2781(T)/10 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 20/835(T)/10

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
9m	33° 45' 21"N., 129° 38' 31"E.
6m	33° 45' 15"N., 129° 38' 15"E.
3m	33° 44' 44"N., 129° 37' 30"E.
1m	33° 41' 41"N., 129° 37' 52"E.

(All positions are referred to WGS84 Datum).

Charts affected — JP 179 — JP 187 — JP 1228

3116(T)/10 JAPAN - Nansei Shotō - Depth.

Source: Japanese Notice 23/966(T)/10

1. A depth of 14m exists in position 26° 56' 47"N., 127° 58' 41"E. (WGS84 Datum).

Chart affected — JP 226**3611(T)/10 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 27/1095(T)/10

1. Depths less than charted exist in the following positions (WGS84 Datum):

8·5 m	33° 45' 42"N., 129° 37' 54"E.
10·5 m	33° 45' 41"N., 129° 37' 41"E.
12·5 m	33° 45' 39"N., 129° 37' 47"E.

Charts affected — JP 179 — JP 187 — JP 1228**5507(T)/10 JAPAN - Kyūshū - Rock.**

Source: Japanese Notice 43/1599(T)/10

1. A submerged rock exists in the following position 32° 11' 36·9"N., 129° 58' 13·3"E. (WGS84 Datum).

Chart affected — JP 213**526(T)/11 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 3/92(T)/11

1. Depths less than charted exist in the following positions (WGS84 Datum):

<i>Depth</i>	<i>Position</i>
12·5m	34° 21' 58"N., 133° 45' 23"E.
17·5m	34° 21' 17"N., 133° 43' 54"E.
18m	34° 21' 15"N., 133° 43' 46"E.
18m	34° 21' 07"N., 133° 43' 39"E.
18m	34° 21' 22"N., 133° 43' 36"E.
17·5m	34° 21' 16"N., 133° 43' 25"E.
14m	34° 20' 46"N., 133° 42' 48"E.
17m	34° 20' 29"N., 133° 40' 41"E.
16·5m	34° 20' 26"N., 133° 40' 33"E.

Chart affected — JP 153**785(T)/11 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 5/155(T)/11

1. A depth of 16·5m exists in position 34° 25' 54"N., 134° 05' 31"E.
2. A depth of 15·5m exists in position 34° 25' 53"N., 134° 06' 27"E.
3. A depth of 18·5m exists in position 34° 26' 15"N., 134° 04' 10"E.
(All positions are referred to WGS84 Datum).

Chart affected — JP 153**2285(T)/11 JAPAN - Honshū - Depths.**

Source: Japanese Notice 19/641(T)/11

1. Depths less than charted exist in the following positions (WGS84 Datum):

9·9m	35° 17' 29"N., 139° 31' 47"E.
3·1m	35° 17' 49"N., 139° 31' 10"E.
6·7m	35° 17' 46"N., 139° 29' 46"E.

Chart affected — JP 90

3253(T)/11 JAPAN - Kyūshū - Depths.

Source: Japanese Notice 27/964(T)/11

1. Depths less than charted exist in the following positions (WGS84 Datum):

6·1m	33° 28' 20"N., 129° 45' 47"E.
5·9m	33° 28' 15"N., 129° 45' 28"E.
4m	33° 27' 52"N., 129° 44' 46"E.
14·6m	33° 27' 41"N., 129° 42' 45"E.
10·9m	33° 27' 25"N., 129° 42' 58"E.
6·4m	33° 27' 13"N., 129° 43' 10"E.
3·6m	33° 27' 03"N., 129° 43' 32"E.
5·4m	33° 27' 00"N., 129° 43' 41"E.
5·4m	33° 26' 57"N., 129° 44' 44"E.
8·6m	33° 25' 51"N., 129° 44' 26"E.
3·2m	33° 25' 26"N., 129° 43' 37"E.
7·2m	33° 24' 47"N., 129° 42' 38"E.
14·6m	33° 25' 55"N., 129° 41' 52"E.
1·8m	33° 25' 27"N., 129° 41' 09"E.
3·2m	33° 25' 27"N., 129° 41' 00"E.
0·9m	33° 25' 15"N., 129° 40' 45"E.
5·9m	33° 25' 06"N., 129° 40' 46"E.
6·4m	33° 24' 15"N., 129° 40' 39"E.
2·2m	33° 24' 12"N., 129° 40' 48"E.
2·2m	33° 24' 01"N., 129° 40' 14"E.

Charts affected — JP 198 — JP 1228**4931(T)/11 JAPAN - Seto Naikai - Wreck.**

Source: Japanese Notice 41/1427(T)/11

1. A wreck, about 7 metres in length, exists in position 34° 34'·3N., 134° 48'·4E. (WGS84 Datum).

Chart affected — JP 106**640(T)/12 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 4/5050(T)/12

1. Depths less than charted exist as follows:

<i>Depth</i>	<i>Position (WGS84 Datum)</i>
3m	34° 28' 35"N., 134° 08' 05"E.
2m	34° 29' 11"N., 134° 06' 24"E.
5m	34° 27' 54"N., 134° 06' 23"E.

Charts affected — JP 106 — JP 153**5697(T)/12 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 48/5766(T)/12

1. Depths of 13m exist in the following positions (WGS84 Datum):

33° 16'·27N., 131° 57'·08E.
33° 16'·30N., 131° 57'·22E.

Charts affected — JP 151 — JP 1102

58(T)/13 JAPAN - Honshū - Depths.

Source: Japanese Notice 50/5808(T)/12

1. Depths less than charted exist in the following positions (WGS84 Datum):

<i>Depth</i>	<i>Position</i>
27·1m	35° 10'·85N., 140° 30'·25E.
25·3m	35° 09'·67N., 140° 24'·81E.
16·1m	35° 10'·13N., 140° 23'·82E.
18·1m	35° 09'·80N., 140° 23'·50E.
23·9m	35° 08'·52N., 140° 22'·87E.
3·4m	35° 08'·13N., 140° 20'·21E.
8m	35° 07'·86N., 140° 19'·90E.
19·3m	35° 07'·64N., 140° 20'·11E.
16·8m	35° 07'·63N., 140° 20'·00E.
17·7m	35° 07'·55N., 140° 20'·05E.
18·5m	35° 07'·49N., 140° 20'·06E.
16·5m	35° 07'·38N., 140° 20'·05E.
18·6m	35° 07'·36N., 140° 19'·03E.
16·9m	35° 07'·60N., 140° 19'·85E.
14m	35° 07'·52N., 140° 19'·84E.
18·6m	35° 07'·44N., 140° 19'·66E.
13·9m	35° 07'·68N., 140° 19'·58E.
28·5m	35° 06'·98N., 140° 19'·55E.
17·5m	35° 07'·43N., 140° 19'·06E.
18·7m	35° 07'·38N., 140° 19'·02E.

Chart affected — JP 87**1029(T)/13 JAPAN - Kyūshū - Depth.**

Source: Japanese Notice 6/5091(T)/13

1. A depth of 0·1m exists in position 33° 11'·42N., 128° 48'·17E. (WGS84 Datum).

Chart affected — JP 187**2692(T)/13 JAPAN - Shikoku - Depths.**

Source: Japanese Notice 21/5376(T)/13

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position (WGS84 Datum)</i>
9·5m	33° 15'·70N., 132° 29'·97E.
16·5m	33° 15'·43N., 132° 30'·66E.
16·5m	33° 13'·99N., 132° 32'·42E.
18m	33° 13'·74N., 132° 32'·21E.
12·5m	33° 13'·26N., 132° 29'·78E.
10·5m	33° 12'·67N., 132° 28'·88E.
5m	33° 13'·26N., 132° 27'·83E.
24·5m	33° 13'·13N., 132° 27'·76E.

Charts affected — JP 151 — JP 1102**2831(T)/13 JAPAN - Shikoku - Depths.**

Source: Japanese Notice 22/5396(T)/13

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position (WGS84 Datum)</i>
10m	33° 13'·23N., 132° 29'·77E.
20m	33° 13'·32N., 132° 29'·34E.
6·5m	33° 12'·87N., 132° 27'·72E.

Chart affected — JP 151

2832(T)/13 JAPAN - Kyūshū - Depths.

Source: Japanese Notice 22/5397(T)/13

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position (WGS84 Datum)</i>
11m	33° 06'·02N., 132° 02'·72E.
13·5m	33° 06'·03N., 132° 02'·30E.

Chart affected — JP 151**3137(T)/13 JAPAN - Seto Naikai - Wreck.**

Source: Japanese Notice 25/5447(T)/13

- A wreck, 19m in length, exists in position 34° 17'·0N., 134° 59'·0E. (WGS84 Datum)

Chart affected — JP 106**3833(T)/13 JAPAN - Shikoku - Depths.**

Source: Japanese Notice 32/5582(T)/13

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position (WGS84 Datum)</i>
20·5m	33° 18'·64N., 132° 30'·73E.
5m	33° 18'·78N., 132° 21'·40E.
7m	33° 18'·94N., 132° 21'·62E.

Charts affected — JP 151 — JP 1102**3834(T)/13 JAPAN - Kyūshū - Depth.**

Source: Japanese Notice 32/5583(T)/13

- A depth of 12m exists in position 33° 30'·30N., 129° 34'·15E. (WGS84 Datum).

Charts affected — JP 198 — JP 1228**3835(T)/13 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 32/5584(T)/13

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position (WGS84 Datum)</i>
3·2m	33° 28'·18N., 129° 29'·77E.
8·3m	33° 28'·15N., 129° 31'·32E.
7·9m	33° 27'·95N., 129° 32'·28E.

Chart affected — JP 198**4132(T)/13 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 35/5636(T)/13

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position (WGS84 Datum)</i>
15·5m	33° 30'·58N., 129° 31'·02E.
10·8m	33° 30'·90N., 129° 32'·93E.

Chart affected — JP 198

4133(T)/13 JAPAN - Kyūshū - Depths.

Source: Japanese Notice 35/5637(T)/13

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position (WGS84 Datum)</i>
4·1m	33° 26'·81N., 129° 26'·43E.
11·6m	33° 26'·82N., 129° 26'·69E.

Chart affected — JP 198**5219(T)/13 JAPAN - Seto Naikai - Depth.**

Source: Japanese Notice 16/5220(T)/12

- A depth of 15·5m exists in position 34° 24' 17"N., 134° 11' 49"E. (WGS84 Datum)

Chart affected — JP 153**196(T)/14 JAPAN - Seto Naikai - Wreck.**

Source: Japanese Notice 51/5911(T)/13

- A wreck, 12m in length, exists in the vicinity of position 33° 47'·7N., 134° 43'·5E. (WGS84 Datum).

Charts affected — 996 — 1648 — JP 77**2751(T)/14 JAPAN - Honshū - Depths.**

Source: Japanese Notice 23/5331(T)/12

- Depths less than charted exist in the following positions (WGS84 Datum):

<i>Depth</i>	<i>Position</i>
8·2m	34° 18' 19·3"N., 130° 51' 28·9"E.
13·8m	34° 18' 01·6"N., 130° 51' 07·3"E.
12·9m	34° 17' 05·9"N., 130° 51' 43·1"E.
13m	34° 14' 13·3"N., 130° 54' 13·4"E.
6·9m	34° 13' 07·3"N., 130° 54' 22·6"E.

Chart affected — JP 179**2916(T)/14 JAPAN - Seto Naikai - Depth.**

Source: Japanese Notice 4/162(T)/10

- A depth of 10·4m exists in position 33° 52'·62N., 132° 00'·79E. (WGS84 Datum).

Charts affected — JP 1101 — JP 1102**3693(T)/14 JAPAN - Honshū - Depth.**

Source: Japanese Notice 31/5569(T)/14

- A depth of 4·4m exists in position 37° 14'·85N., 136° 41'·81E. (WGS84 Datum)

Chart affected — JP 1169**4183(T)/14 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 36/5652(T)/14

- A depth of 4m exists in position 33° 24'·94N., 132° 22'·68E.
- A depth of 8·5m exists in position 33° 24'·54N., 132° 20'·42E. (WGS84 Datum)

Chart affected — JP 1102

4687(T)/14 JAPAN - Honshū - Depths.

Source: Japanese Notice 40/5709(T)/14

- Depths less than charted exist in the following positions:

4·7m	35° 01'·59N., 139° 49'·28E.
4·7m	34° 59'·05N., 139° 49'·10E.
8·9m	34° 58'·87N., 139° 46'·59E.

(WGS84 Datum)

Chart affected — JP 90**4963(T)/14 JAPAN - Honshū - Depths.**

Source: Japanese Notice 42/5750(T)/14

- Depths of 2·1m less than charted exist on and in the vicinity of a line joining the following positions:

34° 29'·95N., 136° 56'·70E.
34° 29'·68N., 136° 56'·78E.
34° 29'·43N., 136° 56'·17E.

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
22·5m	34° 29'·53N., 136° 57'·05E.
17·3m	34° 29'·95N., 136° 58'·05E.
29·5m	34° 28'·45N., 136° 57'·70E.
22·5m	34° 28'·28N., 136° 58'·02E.

(WGS84 Datum)

Chart affected — JP 1051**5209(T)/14 JAPAN - Honshū - Depth.**

Source: Japanese Notice 44/5779(T)/14

- A depth of 25m exists in position 34° 27'·91N., 136° 56'·20E.

(WGS84 Datum)

Chart affected — JP 1051**5470(T)/14 JAPAN - Honshū - Depths.**

Source: Japanese Notice 46/5800(T)/14

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
13·7m	34° 26'·72N., 136° 55'·66E.
5·7m	34° 26'·69N., 136° 55'·60E.
9·9m	34° 26'·22N., 136° 55'·54E.

(WGS84 Datum)

Chart affected — JP 1051**5725(T)/14 JAPAN - Honshū - Depths.**

Source: Japanese Notice 48/5842(T)/14

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
3·8m	35° 17'·74N., 139° 31'·38E.
4·6m	35° 17'·65N., 139° 31'·31E.
5·3m	35° 17'·41N., 139° 31'·22E.
3·3m	35° 17'·82N., 139° 31'·17E.
6·7m	35° 17'·75N., 139° 31'·04E.

(WGS84 Datum)

5725(T)/14 JAPAN - Honshū - Depths. (continued)

- Former Notice 2113(T)/14 is cancelled.

Chart affected — JP 90**5727(T)/14 JAPAN - Honshū - Depths.**

Source: Japanese Notice 48/5844(T)/14

- A depth of 9·1m exists in position 34° 26′·01N., 136° 55′·64E.
- A depth of 7·3m exists on and in the vicinity of a line joining the following positions:

34° 25′·50N., 136° 55′·48E.

34° 25′·32N., 136° 55′·69E.

(WGS84 Datum)

Chart affected — JP 1051**968(T)/15 JAPAN - Honshū - Depth.**

Source: Japanese Notice 5/5071(T)/15

- A depth of 8m exists in position 34° 58′·65N., 139° 08′·22E.
(WGS84 Datum)

Chart affected — JP 80**1444(T)/15 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 9/5130(T)/15

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
5m	33° 22′·76N., 132° 22′·11E.
9·5m	33° 22′·12N., 132° 24′·24E.
6m	33° 20′·88N., 132° 22′·64E.

(WGS84 Datum)

Charts affected — JP 151 — JP 1102**2493(T)/15 JAPAN - Honshū - Depth.**

Source: Japanese Notice 17/5259(T)/15

- A depth of 27·5m exists in position 34° 52′·84N., 139° 47′·53E.
(WGS84 Datum)

Chart affected — JP 90**3163(T)/15 JAPAN - Shikoku - Depth.**

Source: Japanese Notice 22/5339(T)/15

- A depth of 6m exists in the vicinity of position 33° 26′·30N., 133° 27′·67E.
(WGS84 Datum)

Chart affected — JP 108**3298(T)/15 JAPAN - Honshū - Depth.**

Source: Japanese Notice 23/5357(T)/15

- A depth of 5·5m exists in position 39° 40′ 19"N., 141° 59′ 30"E.
(WGS84 Datum)

Chart affected — JP 54

3552(T)/15 JAPAN - Kyūshū - Obstruction.

Source: Japanese Notice 25/5405(T)/15

1. An obstruction, anchor and chain, exists within an area bounded by the following positions:

33° 34'·40N., 129° 51'·88E.

33° 34'·02N., 129° 52'·27E.

33° 33'·88N., 129° 51'·78E.

(WGS84 Datum)

Charts affected — JP 179 — JP 187 — JP 1228**3929(T)/15 JAPAN - Honshū - Depths.**

Source: Japanese Notice 28/5451(T)/15

1. Depths less than charted exist in the following positions:

Depth

4·8m

3·3m

(WGS84 Datum)

Position

34° 23'·71N., 136° 55'·37E.

34° 23'·69N., 136° 55'·33E.

Chart affected — JP 1051**4168(T)/15 JAPAN - Shikoku - Depths.**

Source: Japanese Notice 30/5483(T)/15

1. Depths less than charted exist in the following positions:

Depth

13·5m

7·5m

24·5m

(WGS84 Datum)

Position

33° 13'·46N., 132° 21'·22E.

33° 12'·62N., 132° 20'·45E.

33° 12'·21N., 132° 19'·61E.

Chart affected — JP 151**1773(T)/16 JAPAN - Seto Naikai - Depth.**

Source: Japanese Notice 12/5155(T)/16

1. A depth of 19m exists in position 33° 25'·45N., 132° 18'·83E.
(WGS84 Datum)

Chart affected — JP 1102**3085(T)/16 JAPAN - Honshū - Depths.**

Source: Japanese Notice 20/5257(T)/16

1. Depths less than charted exist in the following positions:

Depth

8·0m

8·5m

Position

37° 29'·66N., 141° 03'·34E.

37° 21'·14N., 141° 03'·00E.

2. Former Notice 2923(T)/16 is cancelled.
(WGS84 Datum)

Chart affected — JP 1098**5264(T)/16 JAPAN - Honshū - Depth.**

Source: Japanese Notice 40/5606(T)/16

1. A depth of 11·7m exists in position 35° 08' 52.2"N., 139° 48' 33.0"E.
(WGS84 Datum)

Chart affected — JP 90

6268(T)/16 JAPAN - Kyūshū - Depth.

Source: Japanese Notice 47/5715(T)/16

1. A depth of 23·2m exists in position 33° 37'·58N., 129° 31'·22E.
(WGS84 Datum)

Charts affected — JP 179 — JP 187**782(T)/17 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 5/5074(T)/17

1. A depth of 5·9m exists in position 33° 23'·78N., 131° 39'·82E.
2. Depths of 1·4m less than charted exist within an area bounded by the following positions:
33° 23'·88N., 131° 41'·02E.
33° 23'·47N., 131° 42'·18E.
33° 23'·18N., 131° 42'·37E.
33° 23'·33N., 131° 40'·48E.
3. Depths of 0·8m less than charted exist on and in the vicinity of a line joining the following positions:
33° 23'·92N., 131° 40'·63E.
33° 22'·93N., 131° 39'·42E.
4. Depths of 3·3m less than charted exist on and in the vicinity of a line joining the following positions:
33° 23'·53N., 131° 39'·32E.
33° 23'·30N., 131° 39'·32E.
5. Depths of 4·5m less than charted exist within an area bounded by the following positions:
33° 22'·90N., 131° 39'·13E.
33° 22'·72N., 131° 39'·43E.
33° 22'·38N., 131° 39'·18E.
33° 22'·55N., 131° 38'·98E.
6. Former Notice 528(T)/11 is cancelled.
(WGS84 DATUM)

Charts affected — JP 1101 — JP 1102**784(T)/17 JAPAN - Kyūshū - Wreck.**

Source: Japanese Notice 5/5078(T)/17

1. A wreck, cargo vessel, length 130m, exists in position 32° 25'·6N., 128° 46'·8E.
(WGS84 DATUM)

Chart affected — JP 187**1395(T)/17 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 10/5140(T)/17

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
19·5m	34° 36' 27·7"N., 134° 53' 57·0"E.
18m	34° 36' 21·5"N., 134° 53' 53·7"E.
7·5m	34° 37' 59·1"N., 134° 53' 28·5"E.
7·5m	34° 38' 06·0"N., 134° 53' 10·4"E.
7·5m	34° 38' 12·5"N., 134° 52' 58·7"E.
10m	34° 38' 19·8"N., 134° 52' 45·1"E.
7·5m	34° 38' 12·7"N., 134° 52' 46·2"E.
11m	34° 37' 57·4"N., 134° 52' 14·1"E.
11m	34° 37' 10·0"N., 134° 53' 06·6"E.
10m	34° 36' 56·7"N., 134° 53' 13·2"E.

(WGS84 DATUM)

Chart affected — JP 106

1509(T)/17 JAPAN - Kyūshū - Depths.

Source: Japanese Notice 11/5152(T)/17

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
2·1m	33° 26'·18N., 129° 25'·42E.
3·6m	33° 24'·98N., 129° 25'·27E.
3·9m	33° 24'·47N., 129° 25'·12E.
6·4m	33° 23'·82N., 129° 24'·63E.
4·4m	33° 23'·12N., 129° 24'·52E.
2·3m	33° 21'·10N., 129° 24'·75E.
5·5m	33° 21'·13N., 129° 26'·05E.
8·8m	33° 20'·18N., 129° 26'·38E.
6·3m	33° 16'·82N., 129° 25'·18E.
5·9m	33° 15'·95N., 129° 24'·15E.
3·9m	33° 15'·22N., 129° 20'·50E.
4·3m	33° 15'·02N., 129° 20'·15E.
5·7m	33° 14'·97N., 129° 20'·47E.
9·5m	33° 14'·03N., 129° 23'·05E.
6·8m	33° 12'·70N., 129° 20'·88E.
6·8m	33° 12'·50N., 129° 21'·13E.

(WGS84 DATUM)

Chart affected — JP 198**1907(T)/17 JAPAN - Honshū - Depths.**

Source: Japanese Notice 15/5221(T)/17

1. Shoal depths exist in the following positions:

<i>Depth</i>	<i>Position</i>
8m	33° 49'·62N., 136° 04'·17E.
14m	33° 49'·68N., 136° 04'·09E.
8m	33° 49'·91N., 136° 04'·09E.
4m	33° 48'·82N., 136° 03'·25E.

(WGS84 DATUM)

Chart affected — JP 93**2047(T)/17 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 16/5236(T)/17

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
29·2m	33° 10'·54N., 131° 51'·58E.
12·9m	33° 08'·20N., 131° 53'·87E.
25·9m	33° 07'·88N., 131° 59'·87E.
26m	33° 07'·70N., 132° 00'·07E.

(WGS84 DATUM)

Chart affected — JP 151

2048(T)/17 JAPAN - Kyūshū - Depths.

Source: Japanese Notice 16/5237(T)/17

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
7·3m	33° 01'·04N., 131° 56'·78E.
26·9m	32° 58'·26N., 131° 58'·53E.
14·8m	32° 56'·72N., 132° 00'·21E.
23·4m	32° 57'·78N., 132° 02'·96E.
24m	32° 57'·89N., 132° 03'·34E.

(WGS84 DATUM)

Chart affected — JP 151**2444(T)/17 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 19/5279(T)/17

- Depths between 1·5m and 3m less than charted exist on and in the vicinity of a line joining the following positions:

34° 36' 20"N., 134° 52' 40"E.
 34° 36' 24"N., 134° 53' 21"E.
 (WGS84 DATUM)

Chart affected — JP 106**3958(T)/17 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 32/5455(T)/17

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
7·1m	33° 14'·20N., 128° 55'·10E.
33·0m	33° 11'·20N., 128° 54'·10E.
28·5m	33° 11'·10N., 128° 55'·20E.
15·7m	33° 07'·60N., 128° 41'·90E.
7·9m	33° 07'·50N., 128° 42'·10E.
17·9m	33° 07'·30N., 128° 42'·60E.
3·5m	33° 07'·00N., 128° 42'·50E.

(WGS84 DATUM)

Charts affected — JP 179 — JP 187 — JP 213**4214(T)/17 JAPAN - Kyūshū - Depth.**

Source: Japanese Notice 34/5492(T)/17

- A depth of 17m exists in position 31° 50'·55N., 129° 57'·42E.
 (WGS84 DATUM)

Charts affected — JP 187 — JP 213 — JP 1222**4482(T)/17 JAPAN - Kyūshū - Wreck.**

Source: Japanese Notice 36/5515(T)/17

- A wreck, depth 27·5m, approximately 120m in length, exists in the vicinity of position 33° 23'·93N., 129° 36'·35E.
 (WGS84 DATUM)

Charts affected — JP 179 — JP 187 — JP 198 — JP 213

4847(T)/17 JAPAN - Seto Naikai - Depths.

Source: Japanese Notice 39/5549(T)/17

- Depths of between 2m and 4m less than charted exist on and in the vicinity of a line joining the following positions:

34° 36' 35"N., 134° 52' 16"E.

34° 36' 27"N., 134° 52' 00"E.

34° 36' 08"N., 134° 51' 42"E.

(WGS84 DATUM)

Chart affected — JP 106**5216(T)/17 JAPAN - Honshū - Depths.**

Source: Japanese Notice 42/5577(T)/17

- Depths less than charted exist in the following positions:

Depth Position

19·3m 34° 28'·47N., 136° 59'·12E.

19·4m 34° 28'·36N., 136° 58'·85E.

17·4m 34° 28'·12N., 136° 58'·32E.

(WGS84 DATUM)

Charts affected — JP 70 — JP 1051**5218(T)/17 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 42/5580(T)/17

- Depths less than charted exist in the following positions:

Depth Position

14·5m 33° 09'·60N., 128° 54'·10E.

5·5m 33° 09'·40N., 128° 54'·30E.

(WGS84 DATUM)

Charts affected — JP 187 — JP 213**5220(T)/17 JAPAN - Nansei Shotō - Depth.**

Source: Japanese Notice 42/5583(T)/17

- A depth of 12·4m exists in position 26° 45'·03N., 128° 05'·77E.

(WGS84 DATUM)

Chart affected — JP 226**6023(T)/17 JAPAN - Honshū - Depths.**

Source: Japanese Notice 49/5682(T)/17

- Depths less than charted exist in the following positions:

Depth

0·9m

0·2m

5·8m

0·3m

1·2m

5·6m

0·6m

6·5m

3m

(WGS84 DATUM)

Position

39° 41' 08·7"N., 141° 59' 17·3"E.

39° 40' 58·7"N., 141° 59' 17·9"E.

39° 40' 35·7"N., 141° 59' 04·8"E.

39° 40' 23·6"N., 141° 58' 57·3"E.

39° 40' 22·2"N., 141° 59' 22·1"E.

39° 40' 20·7"N., 141° 59' 07·6"E.

39° 40' 15·7"N., 141° 59' 03·2"E.

39° 40' 10·4"N., 141° 59' 04·8"E.

39° 40' 07·3"N., 141° 59' 24·2"E.

Chart affected — JP 54

144(T)/18 JAPAN - Honshū - Depth.

Source: Japanese Notice 51/5702(T)/17

1. A depth of 3·6m exists in position 35° 17' 42·5"N., 139° 28' 57·6"E.
(WGS84 DATUM)

Chart affected — JP 90**1507(T)/18 JAPAN - Seto Naikai - Obstructions.**

Source: Japanese Notice 10/5115(T)/18

1. Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
6·5m	33° 23'·59N., 131° 39'·96E.
7·3m	33° 23'·45N., 131° 39'·41E.
10·7m	33° 23'·24N., 131° 40'·86E.

(WGS84 DATUM)

Charts affected — JP 1101 — JP 1102**1609(T)/18 JAPAN - Honshū - Depths.**

Source: Japanese Notice 11/5128(T)/18

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
9·9m	34° 31' 15·6"N., 137° 00' 07·0"E.
16·6m	34° 31' 12·1"N., 137° 00' 26·8"E.
19·4m	34° 31' 15·9"N., 137° 00' 58·2"E.
18·8m	34° 30' 57·3"N., 137° 01' 04·3"E.
16·9m	34° 30' 27·0"N., 137° 00' 39·3"E.
19·1m	34° 30' 35·3"N., 137° 00' 29·3"E.

(WGS84 DATUM)

Chart affected — JP 1051**1613(T)/18 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 11/5134(T)/18

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
23m	32° 47'·73N., 131° 59'·70E.
22m	32° 47'·72N., 131° 59'·05E.

(WGS84 DATUM)

Chart affected — JP 151**1614(T)/18 JAPAN - Kyūshū - Depths.**

Source: Japanese Notice 11/5135(T)/18

1. Depths of 4·0m less than charted exist on and in the vicinity of a line joining the following positions:

32° 50'·40N., 132° 00'·78E.
32° 50'·93N., 131° 59'·93E.

1614(T)/18 JAPAN - Kyūshū - Depths. (continued)

2. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
7·5m	32° 52'·35N., 131° 59'·72E.
8·6m	32° 52'·30N., 131° 59'·62E.
9·2m	32° 51'·68N., 131° 59'·02E.
6·2m	32° 51'·38N., 131° 58'·92E.
5·9m	32° 51'·13N., 131° 58'·57E.
4·4m	32° 51'·07N., 131° 58'·47E.

(WGS84 DATUM)

Chart affected — JP 151

5095(T)/18 JAPAN - Honshū - Depths.

Source: Japanese Notice 40/5489(T)/18

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
12·1m	34° 31' 16·4"N., 136° 59' 58·5"E.
10·1m	34° 31' 09·4"N., 136° 59' 56·6"E.
9·7m	34° 30' 28·1"N., 136° 59' 55·4"E.
10·3m	34° 30' 17·8"N., 136° 59' 57·8"E.
15·6m	34° 30' 01·6"N., 137° 00' 39·2"E.
15·9m	34° 29' 37·6"N., 137° 00' 06·9"E.
18m	34° 29' 11·1"N., 136° 59' 45·9"E.
19m	34° 28' 53·7"N., 136° 59' 52·2"E.
10·7m	34° 29' 08·2"N., 136° 59' 26·1"E.
13·6m	34° 29' 20·0"N., 136° 59' 06·3"E.
10·3m	34° 29' 08·3"N., 136° 59' 09·5"E.
13·2m	34° 29' 17·7"N., 136° 58' 33·6"E.
18·9m	34° 29' 13·8"N., 136° 58' 29·3"E.
8·8m	34° 29' 06·7"N., 136° 58' 44·6"E.
6·6m	34° 28' 53·9"N., 136° 58' 54·8"E.

(WGS84 DATUM)

Charts affected — JP 70 — JP 1051

5368(T)/18 JAPAN - Seto Naikai - Depths.

Source: Japanese Notice 42/5522(T)/18

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
9·8m	34° 26' 42·1"N., 133° 38' 24·4"E.
9·9m	34° 26' 10·3"N., 133° 38' 28·4"E.
9·3m	34° 26' 57·4"N., 133° 36' 57·1"E.
9·8m	34° 26' 40·2"N., 133° 36' 57·1"E.

(WGS84 DATUM)

Chart affected — JP 153

5486(T)/18 JAPAN - Nansei Shotō - Depths.

Source: Japanese Notice 43/5543(T)/18

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
9·6m	24° 11'·65N., 123° 28'·90E.
10·2m	24° 11'·50N., 123° 31'·52E.
7·6m	24° 11'·40N., 123° 31'·80E.

(WGS84 DATUM)

Chart affected — JP 1206

5701(T)/18 JAPAN - Seto Naikai - Depth.

Source: Japanese Notice 45/5568(T)/18

1. A depth of 8m exists in position 34° 15'·29N., 133° 06'·31E.
(WGS84 DATUM)

Charts affected — JP 153 — JP 1108**559(T)/19 JAPAN - Seto Naikai - Depth.**

Source: Japanese Notice 1/5003(T)/19

1. A depth of 17m exists in position 34° 14' 32·0"N., 133° 07' 44·6"E.
(WGS84 DATUM)

Charts affected — JP 153 — JP 1108**859(T)/19 JAPAN - Honshū - Depth.**

Source: Japanese Notice 4/5034(T)/19

1. A depth of 20·9m exists in position 35° 33'·33N., 135° 40'·89E.
(WGS84 DATUM)

Chart affected — JP 139**1355(T)/19 JAPAN - Nansei Shotō - Depth.**

Source: Japanese Notice 8/5095(T)/19

1. A depth of 2·5m exists in position 26° 42'·22N., 127° 47'·60E.
(WGS84 DATUM)

Chart affected — JP 226**2410(T)/19 JAPAN - Nansei Shotō - Depths.**

Source: Japanese Notice 16/5199(T)/19

1. The drying area at Shiraho Saki, has been extended joining the following positions:

24° 20'·30N., 124° 13'·90E.
 24° 20'·22N., 124° 14'·58E.
 24° 20'·37N., 124° 15'·02E.
 24° 20'·65N., 124° 15'·30E.
 24° 22'·00N., 124° 15'·55E.

(WGS84 DATUM)

Chart affected — JP 1206**5880(T)/19 JAPAN - Nansei Shotō - Depths.**

Source: Japanese Notice 42/5488(T)/19

1. Depths of 1m to 10m less than charted exist within an area bounded by the following positions:

26° 09'·00N., 127° 38'·00E.
 26° 08'·00N., 127° 37'·10E.
 26° 11'·20N., 127° 36'·60E.
 26° 10'·90N., 127° 37'·20E.

(WGS84 DATUM)

Chart affected — JP 226**318(T)/20 JAPAN - Honshū - Obstruction.**

Source: Japanese Notice 50/5595(T)/19

1. An obstruction, depth 19m exists in position 34° 33'·36N., 137° 08'·10E.
(WGS84 DATUM)

Charts affected — JP 70 — JP 1051

2204(T)/20 JAPAN - Hokkaidō - Obstruction.

Source: Japanese Notice 14/5136(T)/20

1. An obstruction, consisting of an anchor chain, exists in position 42° 34' 14·0"N., 141° 41' 14·0"E.
(WGS84 DATUM)

Charts affected — JP 1030 — JP 1034**4436(T)/20 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 32/5407(T)/20

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
* 17·4m	33° 52'·89N., 132° 08'·83E.
* 13·2m	33° 55'·23N., 132° 09'·28E.

2. Depths between 0·5m and 5m less than charted exist on and in the vicinity of a line joining the following positions:

33° 54'·71N., 132° 08'·14E.
 33° 54'·34N., 132° 08'·25E.
 33° 53'·96N., 132° 08'·46E.

3. *Underwater obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
22m	33° 53'·96N., 132° 08'·18E.
22m	33° 53'·88N., 132° 08'·24E.
21m	33° 53'·67N., 132° 08'·46E.
8·6m	33° 53'·42N., 132° 07'·95E.

4. Former Notice 1208(T)/19 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — JP 1102 — JP 1108**5074(T)/20 JAPAN - Honshū - Obstruction.**

Source: Japanese Notice 38/5473(T)/20

1. An obstruction, consisting of an anchor chain, exists in position 35° 22' 34"N., 139° 41' 04"E.
(WGS84 DATUM)

Chart affected — JP 90**6121(T)/20 JAPAN - Seto Naikai - Rock.**

Source: Japanese Notice 46/5593(T)/20

1. A rock, which covers and uncovers, exists on and in the vicinity of a line joining the following positions:

34° 14'·03N., 134° 25'·63E.
 34° 14'·12N., 134° 25'·93E.
 (WGS84 DATUM)

Chart affected — JP 106**6122(T)/20 JAPAN - Seto Naikai - Rocks.**

Source: Japanese Notice 46/5594(T)/20

1. An underwater rock exists in position 34° 19' 23·2"N., 134° 16' 47·9"E.
2. A rock which covers and uncovers exists in position 34° 17' 42·1"N., 134° 16' 55·5"E.
(WGS84 DATUM)

Charts affected — JP 106 — JP 153

1171(T)/21 JAPAN - Seto Naikai - Depths.

Source: Japanese Notice 9/5103(T)/21

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
10·7m	34° 18'·62N., 133° 17'·10E.
10·1m	34° 18'·56N., 133° 16'·76E.
9·9m	34° 18'·58N., 133° 16'·52E.
9·3m	34° 18'·63N., 133° 16'·15E.
9·9m	34° 18'·74N., 133° 15'·29E.
(WGS84 DATUM)	

Chart affected — JP 153**1541(T)/21 JAPAN - Honshū - Depths.**

Source: Japanese Notice 13/5144(T)/21

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
3·7m	37° 48'·57N., 138° 49'·70E.
2·5m	37° 49'·97N., 138° 51'·33E.
2·8m	37° 50'·52N., 138° 52'·00E.
(WGS84 DATUM)	

Chart affected — JP 1180**1850(T)/21 JAPAN - Honshū - Obstruction.**

Source: Japanese Notice 16/5183(T)/21

- Stationary nets exist, until 16 April 2026, within an area bounded by the following positions:

35° 31'·50N., 133° 57'·77E.
35° 31'·58N., 133° 58'·05E.
35° 32'·00N., 133° 57'·87E.
35° 31'·88N., 133° 57'·47E.
35° 31'·65N., 133° 57'·57E.
(WGS84 DATUM)

Chart affected — JP 1172**2447(T)/21 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 21/5280(T)/21

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
24·5m	33° 50'·07N., 131° 22'·96E.
23m	33° 51'·40N., 131° 24'·47E.
22·5m	33° 51'·62N., 131° 24'·10E.
23·5m	33° 51'·58N., 131° 22'·25E.
23m	33° 51'·49N., 131° 21'·52E.

- Former Notice 3873(T)/10 is cancelled.
(WGS84 DATUM)

Chart affected — JP 1101**3760(T)/21 JAPAN - Honshū - Depth.**

Source: Japanese Notice 34/5470(T)/21

- A depth of 1m less than charted exists in position 36° 38'·88N., 136° 36'·32E.
(WGS84 DATUM)

Chart affected — JP 1169

3767(T)/21 JAPAN - Seto Naikai - Depth.

Source: Japanese Notice 34/5478(T)/21

1. A shoal depth, 6·6m, exists in position 34° 15'·31N., 133° 06'·31E.
(WGS84 DATUM)

Charts affected — JP 153 — JP 1108**4366(T)/21 JAPAN - Seto Naikai - Wreck.**

Source: Japanese Notice 39/5548(T)/21

1. A wreck, 10m in length, exists in position 34° 12'·3N., 133° 16'·3E.
(WGS84 DATUM)

Chart affected — JP 153**4905(T)/21 JAPAN - Hokkaidō - Depth.**

Source: Japanese Notice 43/5601(T)/21

1. A shoal depth, of about 7m, exists in position 42° 11'·36N., 139° 31'·94E.
(WGS84 DATUM)

Chart affected — JP 11**5014(T)/21 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 44/5610(T)/21

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
0·7m	34° 02'·92N., 133° 36'·43E.
7·7m	34° 09'·18N., 133° 27'·85E.
3·2m	34° 09'·13N., 133° 27'·81E.
8·6m	34° 09'·63N., 133° 21'·98E.
1·3m	34° 09'·56N., 133° 21'·97E.

(WGS84 DATUM)

Chart affected — JP 153**835(T)/22 JAPAN - Nansei Shotō - Depths.**

Source: Japanese Notice 7/5094(T)/22

1. Shoal depths exist in the following positions:

<i>Depth</i>	<i>Position</i>
25m	26° 06'·8N., 127° 37'·2E.
22·5m	26° 04'·2N., 127° 37'·5E.

(WGS84 DATUM)

Charts affected — 2024 — JP 226**1938(T)/22 JAPAN - Nansei Shotō - Depths.**

Source: Japanese Notice 18/5245(T)/22

1. Depths of about 15m less than charted exist on and in the vicinity of a line joining the following positions:

24° 27'·0N., 123° 49'·2E.
 24° 27'·2N., 123° 48'·4E.
 24° 27'·7N., 123° 48'·4E.

2. Depths of about 15m less than charted exist on and in the vicinity of a line joining the following positions:

24° 26'·4N., 123° 49'·1E.
 24° 26'·6N., 123° 48'·3E.
 (WGS84 DATUM)

Chart affected — JP 1206

2299(T)/22 JAPAN - Seto Naikai - Depths.

Source: Japanese Notice 19/5263(T)/22

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
10·8m	34° 21' 58·0"N., 133° 45' 20·2"E.
17·1m	34° 21' 56·6"N., 133° 45' 15·2"E.
19·4m	34° 20' 55·9"N., 133° 41' 58·8"E.
16m	34° 20' 28·3"N., 133° 40' 39·0"E.
1·2m	34° 19' 33·2"N., 133° 39' 46·7"E.
3·1m	34° 19' 31·5"N., 133° 39' 43·5"E.

(WGS84 DATUM)

Chart affected — JP 153**2560(T)/22 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 21/5304(T)/22

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
15·3m	34° 24' 15·9"N., 134° 11' 48·0"E.
15·4m	34° 24' 21·5"N., 134° 11' 46·6"E.
15·8m	34° 24' 37·8"N., 134° 11' 31·4"E.
17·8m	34° 24' 44·6"N., 134° 11' 15·9"E.
14·4m	34° 25' 51·7"N., 134° 06' 25·8"E.
17·4m	34° 25' 55·2"N., 134° 06' 23·5"E.
18·2m	34° 26' 19·1"N., 134° 04' 17·5"E.
18·9m	34° 26' 09·4"N., 134° 04' 15·7"E.

(WGS84 DATUM)

Charts affected — JP 106 — JP 153**3643(T)/22 JAPAN - Honshū - Obstruction.**

Source: Japanese Notice 33/5444(T)/22

- An obstruction, consisting of an anchor chain, exists in position 35° 29' 06·0"N., 139° 54' 54·0"E.
(WGS84 DATUM)

Chart affected — JP 90**3977(T)/22 JAPAN - Honshū - Virtual aid to navigation. Lights.**

Source: Japanese Notice 37/5478(T)/22

- The Mikomotoshima light, Fl (2) 16s 51m 19M, in position 34° 34'·5N., 138° 56'·5E. is temporarily extinguished and replaced by light, Fl (2) 10s.
- A virtual aid to navigation, south cardinal topmark, V-AIS, has been established in position 34° 33'·95N., 138° 56'·62E.
(WGS84 DATUM)

Chart affected — JP 80**4560(T)/22 JAPAN - Shikoku - Buoy.**

Source: Japanese Notice 42/5542(T)/22

- The yellow pillar light-buoy, *Mo (U) 8s No 15*, in position 33° 17'·21N., 134° 29'·17E. has been removed until further notice.
(WGS84 DATUM)

Charts affected — JP 77 — JP 108

4829(T)/22 JAPAN - Seto Naikai - Virtual aid to navigation. Obstruction.

Source: Japanese Notice 44/5561(T)/22

1. An unexploded bomb marked by a virtual aid to navigation (V-AIS), special mark, exists in position 33° 52'·80N., 131° 09'·63E.
(WGS84 DATUM)

Chart affected — JP 1101**330(T)/23 JAPAN - Hokkaidō - Wreck.**

Source: Japanese Notice 2/5008(T)/23

1. A wreck, approximately 15m in length, exists in position 42° 53'·9N., 144° 05'·0E.
(WGS84 DATUM)

Charts affected — 1800 — 1803 — JP 1032**826(T)/23 JAPAN - Kyūshū - Depth.**

Source: Japanese Notice 7/5054(T)/23

1. A depth of 19·1m exists in position 33° 55'·08N., 130° 32'·85E.
(WGS84 DATUM)

Chart affected — JP 1228**897(T)/23 JAPAN - Seto Naikai - Wreck.**

Source: Japanese Notice 8/5060(T)/23

1. A wreck, depth 50m, approximately 74m in length, exists in position 34° 09' 23·9"N., 132° 53' 39·4"E.
(WGS84 DATUM)

Chart affected — JP 1108**1334(T)/23 JAPAN - Seto Naikai - Obstruction.**

Source: Japanese Notice 13/5132(T)/23

1. An underwater obstruction (anchor) exists in position 34° 26' 28"N., 133° 43' 37"E.
(WGS84 DATUM)

Chart affected — JP 153**2381(T)/23 JAPAN - Honshū - Obstruction.**

Source: Japanese Notice 25/5255(T)/23

1. An underwater obstruction (a possible concrete block), approximately 1m in height and 1m in length, exists in position 35° 32' 48·2"N., 140° 01' 41·3"E.
(WGS84 DATUM)

Chart affected — JP 90**2547(T)/23 JAPAN - Honshū - Wreck.**

Source: Japanese Notice 27/5281(T)/23

1. A wreck, 6m in length, exists in position 34° 45'·4N., 139° 02'·2E.
(WGS84 DATUM)

Chart affected — JP 80

3433(T)/23 JAPAN - Seto Naikai - Obstructions. Fish havens.

Source: Japanese Notice 7/5070(T)/21 and UKHO

- Underwater obstructions and fish havens of 0·5m to 2m above the seabed, exist within an area bounded by the following positions:

34° 40'·39N., 134° 48'·15E.
 34° 39'·72N., 134° 47'·95E.
 34° 38'·86N., 134° 48'·95E.
 34° 39'·36N., 134° 49'·89E.
 34° 40'·13N., 134° 48'·98E.

- Underwater obstructions and fish havens of 1m to 2m above the seabed, exist within an area bounded by the following positions:

34° 38'·93N., 134° 49'·99E.
 34° 38'·80N., 134° 49'·55E.
 34° 38'·46N., 134° 49'·01E.
 34° 38'·13N., 134° 48'·84E.
 34° 38'·11N., 134° 50'·18E.
 34° 38'·56N., 134° 50'·64E.
 (WGS84 DATUM)

Chart affected — JP 106**4198(T)/23 JAPAN - Honshū - Obstruction.**

Source: Japanese Notice 43/5456(T)/23

- An underwater obstruction, consisting of an anchor chain, exists in the vicinity of position 35° 33' 08"N., 140° 02' 06"E. (WGS84 DATUM)

Chart affected — JP 90**4787(T)/23 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 47/5508(T)/23

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
10·2m	33° 53'·68N., 131° 12'·74E.
10·4m	33° 53'·48N., 131° 12'·54E.

(WGS84 DATUM)

Chart affected — JP 1101**980(T)/24 JAPAN - Nansei Shotō - Depth.**

Source: Japanese Notice 7/5109(T)/24

- A depth of 25m exists in position 26° 22'·1N., 127° 01'·8E. (WGS84 DATUM)

Chart affected — JP 226

1100(T)/24 JAPAN - Nansei Shotō - Depths.

Source: Japanese Notice 8/5129(T)/24

- Depths less than charted exist in the following positions:

Depth Position

0·1m	24° 19'·85N., 123° 56'·55E.
2m	24° 19'·40N., 123° 58'·05E.
5m	24° 18'·40N., 123° 57'·05E.
1m	24° 17'·95N., 123° 56'·40E.
0·3m	24° 17'·20N., 123° 56'·40E.
5m	24° 17'·55N., 123° 57'·35E.
4m	24° 17'·25N., 123° 58'·20E.
1m	24° 17'·20N., 123° 58'·65E.
0·6m	24° 18'·00N., 123° 59'·95E.
4m	24° 16'·45N., 123° 56'·05E.
1m	24° 16'·55N., 123° 56'·50E.
2m	24° 16'·65N., 123° 57'·00E.
1m	24° 16'·05N., 123° 56'·15E.
1m	24° 15'·75N., 123° 56'·70E.
5m	24° 15'·00N., 123° 56'·90E.
4m	24° 14'·80N., 123° 57'·10E.
0·2m	24° 15'·50N., 123° 54'·95E.
2m	24° 13'·35N., 123° 54'·45E.

- Depths of up to 5m less than charted exist within an area bounded by the following positions:

24° 19'·25N., 123° 58'·30E.
 24° 18'·25N., 123° 58'·30E.
 24° 18'·25N., 123° 59'·60E.
 24° 18'·60N., 124° 00'·00E.
 24° 19'·25N., 123° 59'·05E.
 (WGS84 DATUM)

Chart affected — JP 1206**1414(T)/24 JAPAN - Seto Naikai - Wreck.**

Source: Japanese Notice 11/5157(T)/24

- A wreck, approximately 7·5m in length, exists in the vicinity of position 34° 26' 30"N., 133° 33' 30"E.
(WGS84 DATUM)

Chart affected — JP 153**1557(T)/24 JAPAN - Honshū - Obstruction.**

Source: Japanese Notice 12/5161(T)/24

- An underwater obstruction, consisting of an anchor chain, exists in the vicinity of position 35° 20' 16·2"N., 139° 40' 28·8"E.
(WGS84 DATUM)

Chart affected — JP 90**1700(T)/24 JAPAN - Honshū - Obstruction.**

Source: Japanese Notice 13/5172(T)/24

- An underwater obstruction, consisting of an anchor and chain (approximately 50m in length), exists in position 39° 37' 55·4"N., 141° 59' 08·5"E.
(WGS84 DATUM)

Chart affected — JP 54

2095(T)/24 JAPAN - Seto Naikai - Depths.

Source: Japanese Notice 17/5251(T)/24

- Depths less than charted exist in the following positions:

Depth

7·5m

1·2m

(WGS84 DATUM)

Position

34° 09'·18N., 133° 27'·86E.

34° 09'·56N., 133° 21'·97E.

Chart affected — JP 153**2348(T)/24 JAPAN - Seto Naikai - Buoy. Virtual aid to navigation.**

Source: Japanese Notice 18/5260(T)/24

- Kaizenjisho light-buoy has been replaced, until further notice, with a Virtual aid to navigation, north cardinal topmark, V-AIS, in position 33° 57'·38N., 132° 10'·50E.
(WGS84 DATUM)

Charts affected — JP 1102 — JP 1108**2915(T)/24 JAPAN - Honshū - Depths.**

Source: Japanese Notice 22/5309(T)/24

- Depths less than charted exist in the following positions:

Depth

18·7m

24·5m

(WGS84 DATUM)

Position

37° 41'·17N., 137° 12'·75E.

37° 39'·83N., 137° 11'·27E.

Charts affected — JP 120 — JP 1163**3034(T)/24 JAPAN - Honshū - Depths.**

Source: Japanese Notice 23/5317(T)/24

- Depths less than charted exist in the following positions:

Depth

23·5m

26m

(WGS84 DATUM)

Position

37° 30'·13N., 137° 07'·90E.

37° 29'·73N., 137° 06'·42E.

Chart affected — JP 1163**3296(T)/24 JAPAN - Honshū - Wreck.**

Source: Japanese Notice 25/5330(T)/24

- A wreck, approximately 7m in length, exists in the vicinity of position 35° 41'·37N., 140° 53'·47E.
(WGS84 DATUM)

Charts affected — JP 87 — JP 1097**4763(T)/24 JAPAN - Honshū - Light.**

Source: Japanese Notice 39/5487(T)/24

- Izu O Shima Westward Ocean Observation Tower Light, Mo(U) 10s 23m 5M, has been established, until further notice, in position 34° 42'·25N., 139° 19'·90E.
(WGS84 DATUM)

Chart affected — JP 80

4766(T)/24 JAPAN - Seto Naikai - Works.

Source: Japanese Notice 39/5490(T)/24

1. Groyne construction works are taking place, until further notice, within an area bounded by the coastline and the following positions:

33° 41'·22N., 131° 03'·15E.

33° 41'·43N., 131° 04'·03E.

33° 42'·03N., 131° 03'·77E.

33° 41'·70N., 131° 02'·75E.

33° 41'·40N., 131° 02'·88E.

(WGS84 DATUM)

Chart affected — JP 1101**5141(T)/24 JAPAN - Honshū - Obstruction.**

Source: Japanese Notice 42/5508(T)/24

1. An underwater obstruction, consisting of an anchor chain, exists in the vicinity of position 35° 22' 53"N., 139° 40' 32"E.
(WGS84 DATUM)

Chart affected — JP 90**5426(T)/24 JAPAN - Honshū - Wreck.**

Source: Japanese Notice 45/5542(T)/24

1. A wreck, approximately 5m in length, exists in the vicinity of position 35° 03'·10N., 140° 03'·43E.
(WGS84 DATUM)

Chart affected — JP 90**5579(T)/24 JAPAN - Honshū - Automatic Identification System.**

Source: Japanese Notice 46/5552(T)/24

1. Kujukuri Offing Ocean Wind Observational Facilities has established an Automatic Identification System, *AIS*, in position 35° 29'·82N., 140° 35'·35E.
(WGS84 DATUM)

Chart affected — JP 87**5956(T)/24 JAPAN - Honshū - Depth.**

Source: Japanese Notice 49/5589(T)/24

1. A depth of 17·1m exists in position 37° 51'·37N., 138° 51'·89E.
(WGS84 DATUM)

Chart affected — JP 1180**5957(T)/24 JAPAN - Seto Naikai - Obstruction.**

Source: Japanese Notice 49/5594(T)/24

1. An underwater obstruction, depth 18·3m, exists in position 34° 34' 19·2"N., 135° 13' 19·8"E.
(WGS84 DATUM)

Chart affected — JP 106

808(T)/25 JAPAN - Seto Naikai - Depths.

Source: Japanese Notice 4/5031(T)/25

- Depths of about 0·5m to 5m less than charted exist within an area bounded by the following positions:

34° 00'·73N., 134° 37'·92E.
 34° 00'·69N., 134° 37'·92E.
 34° 00'·69N., 134° 37'·97E.
 34° 00'·68N., 134° 38'·00E.
 34° 00'·68N., 134° 38'·01E.
 34° 00'·66N., 134° 38'·06E.
 34° 00'·66N., 134° 38'·10E.
 34° 00'·68N., 134° 38'·11E.
 34° 00'·69N., 134° 38'·08E.
 34° 00'·70N., 134° 38'·01E.
 34° 00'·72N., 134° 37'·97E.

- Depths of about 0·5m to 1m less than charted exist on and in the vicinity of a line joining the following positions:

34° 00'·60N., 134° 38'·26E.
 34° 00'·61N., 134° 38'·23E.

- Depths of about 0·5m to 2m less than charted exist on and in the vicinity of a line joining the following positions:

34° 00'·55N., 134° 38'·42E.
 34° 00'·60N., 134° 38'·32E.

- Depths of about 0·5m to 1m less than charted exist on and in the vicinity of a line joining the following positions:

34° 00'·23N., 134° 38'·64E.
 34° 00'·37N., 134° 38'·51E.

- Depths of about 1m to 1·5m less than charted exist within an area bounded by the following positions:

33° 59'·66N., 134° 39'·02E.
 33° 59'·65N., 134° 38'·98E.
 33° 59'·57N., 134° 39'·01E.
 33° 59'·60N., 134° 39'·04E.

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
9·3m	34° 00'·64N., 134° 38'·22E.
4m	34° 00'·39N., 134° 38'·55E.
3·2m	34° 00'·20N., 134° 38'·70E.
1·1m	33° 59'·80N., 134° 38'·92E.

(WGS84 DATUM)

Chart affected — JP 106**1153(T)/25 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 7/5056(T)/25

- Depths up to 6m less than charted exist on and in the vicinity of a line joining the following positions:

34° 35' 23·7"N., 134° 49' 13·2"E.
 34° 34' 29·4"N., 134° 46' 27·3"E.

- *Depths of about 1m to 4m less than charted exist within an area bounded by the following positions:

34° 35' 09·3"N., 134° 47' 28·0"E.
 34° 35' 09·0"N., 134° 47' 47·6"E.
 34° 35' 17·2"N., 134° 48' 29·5"E.
 34° 35' 13·7"N., 134° 48' 31·1"E.
 34° 34' 50·6"N., 134° 47' 11·6"E.

1153(T)/25 JAPAN - Seto Naikai - Depths. (continued)

3. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
9·8m	34° 35' 39·1"N., 134° 51' 34·0"E.
7·6m	34° 35' 41·3"N., 134° 50' 37·8"E.
7m	34° 35' 36·4"N., 134° 50' 15·7"E.
7·8m	34° 35' 26·3"N., 134° 49' 50·1"E.
3·8m	34° 35' 27·3"N., 134° 49' 43·7"E.
*9m	34° 35' 13·4"N., 134° 46' 38·7"E.
*3·2m	34° 34' 34·4"N., 134° 46' 53·1"E.
12·8m	34° 34' 32·5"N., 134° 46' 14·1"E.
*11m	34° 34' 30·0"N., 134° 46' 12·1"E.

4. *Former Notice 5030(T)/22 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — JP 106

1763(P)/25 JAPAN - Honshū - Submarine cables.

Source: UKHO

1. A submarine cable is being laid, joining the following positions:

34° 58'·2N., 139° 58'·1E.
 34° 57'·7N., 140° 08'·4E.
 34° 53'·2N., 140° 18'·8E.
 34° 44'·6N., 140° 29'·4E.
 34° 41'·7N., 140° 36'·1E.
 34° 35'·6N., 140° 36'·7E.
 34° 30'·3N., 140° 41'·6E.
 34° 21'·1N., 140° 58'·1E.
 34° 16'·5N., 141° 15'·6E.
 34° 13'·9N., 141° 17'·1E.
 34° 13'·4N., 141° 21'·6E.
 34° 16'·0N., 141° 25'·5E.
 34° 16'·4N., 141° 43'·0E.
 34° 19'·2N., 141° 48'·5E.
 34° 24'·7N., 142° 05'·4E.
 34° 26'·4N., 142° 23'·4E.
 34° 22'·9N., 142° 50'·8E.
 34° 21'·8N., 143° 10'·5E.
 34° 17'·6N., 143° 24'·0E.
 34° 09'·6N., 143° 24'·6E.
 34° 05'·9N., 143° 21'·5E.
 33° 52'·1N., 142° 59'·8E.
 33° 59'·3N., 142° 25'·3E.
 33° 49'·3N., 142° 07'·6E.
 33° 38'·8N., 141° 30'·4E.

2. continued:

33° 17'·7N., 141° 03'·5E.
 33° 01'·9N., 140° 23'·2E.
 32° 57'·1N., 140° 21'·9E.
 32° 52'·7N., 140° 16'·7E.
 32° 49'·3N., 140° 06'·5E.
 32° 46'·6N., 139° 46'·7E.
 32° 42'·9N., 139° 33'·6E.
 32° 19'·8N., 139° 04'·2E.
 32° 13'·6N., 138° 54'·6E.
 32° 14'·7N., 138° 45'·1E.
 32° 10'·1N., 138° 17'·9E.
 31° 57'·5N., 137° 54'·6E.
 31° 59'·1N., 137° 47'·4E.

1763(P)/25 JAPAN - Honshū - Submarine cables. (continued)

3. and

31° 59'·0N., 137° 47'·4E.
 31° 54'·9N., 137° 39'·0E.
 31° 55'·2N., 137° 32'·0E.

4. and

34° 19'·7N., 136° 52'·9E.
 34° 20'·3N., 136° 55'·5E.
 34° 19'·8N., 136° 56'·7E.
 34° 16'·6N., 136° 57'·0E.
 34° 15'·6N., 136° 57'·5E.
 34° 13'·3N., 136° 56'·9E.
 34° 11'·4N., 136° 54'·9E.
 34° 07'·7N., 136° 52'·8E.
 33° 57'·8N., 136° 51'·7E.
 33° 54'·3N., 136° 49'·0E.
 33° 50'·6N., 136° 48'·5E.
 33° 31'·5N., 136° 57'·8E.
 33° 22'·0N., 137° 00'·2E.
 33° 10'·8N., 137° 00'·8E.
 33° 05'·1N., 137° 04'·3E.
 32° 58'·8N., 137° 03'·9E.
 32° 55'·4N., 137° 08'·1E.
 32° 40'·3N., 137° 18'·3E.
 32° 27'·9N., 137° 30'·0E.
 32° 12'·7N., 137° 34'·9E.
 32° 08'·8N., 137° 44'·4E.
 32° 05'·3N., 137° 47'·0E.
 31° 58'·9N., 137° 47'·5E.

5. Mariners are advised to navigate with caution in the area.

6. Charts will be updated when works are complete.
 (WGS84 DATUM)

Charts affected — 996 — 2347 — 4510**2881(T)/25 JAPAN - Honshū - Buoy.**

Source: Japanese Notice 24/5243(T)/25

1. The yellow pillar buoy, (*Y Lt*), in position 37° 59'·62N., 140° 56'·56E., is off station until further notice.
 (WGS84 DATUM)

Chart affected — JP 1098**3238(T)/25 JAPAN - Nansei Shotō - Submarine cable. Works.**

Source: Japanese Notice 27/5294(T)/25

1. Submarine cable laying works are taking place, until 20 December 2025, within an area bounded by the coastline and the following positions:

26° 42'·62N., 127° 49'·72E.
 26° 42'·55N., 127° 49'·48E.
 26° 42'·15N., 127° 49'·73E.
 26° 42'·03N., 127° 51'·20E.
 26° 42'·02N., 127° 52'·40E.
 26° 41'·95N., 127° 52'·73E.
 26° 42'·17N., 127° 52'·80E.
 26° 42'·22N., 127° 52'·42E.
 26° 42'·25N., 127° 51'·17E.
 26° 42'·45N., 127° 49'·83E.
 (WGS84 DATUM)

Chart affected — JP 226

3522(T)/25 JAPAN - Seto Naikai - Obstruction.

Source: Japanese Notice 30/5329(T)/25

1. An underwater obstruction, depth 23·5m, exists in position 34° 34'·07N., 135° 10'·80E.
(WGS84 DATUM)

Chart affected — JP 106**3523(T)/25 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 30/5330(T)/25

1. Depths up to 6m less than charted exist on and in the vicinity of a line joining the following positions:

34° 32'·33N., 134° 49'·35E.

34° 32'·60N., 134° 50'·35E.

2. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
10·8m	34° 32'·54N., 134° 50'·37E.
13·3m	34° 31'·63N., 134° 48'·11E.
13·5m	34° 31'·55N., 134° 47'·91E.

(WGS84 DATUM)

Chart affected — JP 106**3610(T)/25 JAPAN - Honshū - Depths.**

Source: Japanese Notice 31/5337(T)/25

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
3·7m	36° 25'·88N., 136° 25'·22E.
7·5m	36° 26'·45N., 136° 25'·62E.
4·7m	36° 26'·78N., 136° 25'·97E.
4·3m	36° 27'·78N., 136° 27'·00E.
3·5m	36° 28'·98N., 136° 28'·13E.
4·8m	36° 30'·50N., 136° 29'·52E.
4m	36° 30'·97N., 136° 30'·08E.
4·3m	36° 32'·03N., 136° 31'·00E.
4m	36° 33'·40N., 136° 32'·33E.
4·1m	36° 33'·92N., 136° 32'·83E.

(WGS84 DATUM)

Chart affected — JP 1169**3990(T)/25 JAPAN - Seto Naikai - Works. Submarine power cable.**

Source: Japanese Notice 34/5375(T)/25

1. Submarine power cable removal works are taking place, from 29 August until 11 October 2025, within an area bounded by the coastline and the following positions:

34° 29'·17N., 134° 01'·22E.

34° 29'·30N., 134° 02'·03E.

34° 28'·95N., 134° 02'·42E.

34° 28'·85N., 134° 02'·20E.

34° 28'·92N., 134° 01'·17E.

(WGS84 DATUM)

Chart affected — JP 153

4119(T)/25 JAPAN - Seto Naikai - Depth.

Source: Japanese Notice 35/5389(T)/25

1. A depth of 8·3m exists in position 34° 15'·13N., 132° 47'·45E.
(WGS84 DATUM)

Chart affected — JP 1108**4326(T)/25 JAPAN - Honshū - Depth.**

Source: Japanese Notice 37/5400(T)/25

1. A shoal depth of about 4·1m exists in position 33° 52' 19·3"N., 135° 08' 54·3"E.
(WGS84 DATUM)

Chart affected — JP 77**4327(T)/25 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice 37/5403(T)/25

1. Depths of about 0·5m to 1m less than charted exist within an area bounded by the following positions:

34° 27'·06N., 133° 38'·64E.

34° 26'·85N., 133° 38'·36E.

34° 26'·97N., 133° 38'·22E.

34° 27'·17N., 133° 38'·25E.

34° 27'·17N., 133° 38'·36E.

(WGS84 DATUM)

Chart affected — JP 153**4450(T)/25 JAPAN - Honshū - Buoy. Automatic Identification System.**

Source: Japanese Notice 38/5407(T)/25

1. A yellow pillar buoy, *Mo(U) 8s 3M*, with Automatic Identification System, *AIS*, has been established, until further notice, in position 37° 38'·42N., 137° 02'·68E.
(WGS84 DATUM)

Chart affected — JP 1163**4572(T)/25 JAPAN - Seto Naikai - Depths.**

Source: Japanese Notice: 39/5428(T)/25

1. Depths of about 0·5m to 0·9m less than charted exist within an area bounded by the following positions:

34° 27'·41N., 133° 38'·54E.

34° 27'·17N., 133° 38'·36E.

34° 27'·17N., 133° 38'·25E.

34° 27'·21N., 133° 38'·27E.

34° 27'·45N., 133° 38'·45E.

(WGS84 DATUM)

Chart affected — JP 153**4573(T)/25 JAPAN - Seto Naikai - Dredging area. Works.**

Source: Japanese Notice: 39/5429(T)/25

1. Dredging works are taking place, until 10 January 2026, within an area bounded by the following positions:

33° 54'·67N., 131° 06'·57E.

33° 54'·34N., 131° 07'·13E.

33° 54'·24N., 131° 07'·05E.

33° 54'·57N., 131° 06'·49E.

(WGS84 DATUM)

Chart affected — JP 1101

5207(T)/25 JAPAN - Kyūshū - Depth.

Source: Japanese Notice 44/5475(T)/25

1. A depth of 16·2m exists in position 33° 09'·5N., 128° 54'·3E.
2. Former Notice 4358(T)/17 is cancelled.
(WGS84 DATUM)

Charts affected — JP 187 — JP 213**5208(T)/25 JAPAN - Nansei Shotō - Obstruction.**

Source: Japanese Notice 44/5477(T)/25

1. A possible unexploded bomb exists in the vicinity of position 26° 26'·9N., 127° 45'·9E.
(WGS84 DATUM)

Chart affected — JP 226**5332(T)/25 JAPAN - Hokkaidō - Superbuoy. Automatic Identification System.**

Source: Japanese Notice 45/5481(T)/25

1. A yellow superbuoy, *Mo(U) 10s*, with Automatic Identification System, *AIS*, and radar reflector, has been established in position 42° 56'·50N., 140° 19'·45E., until further notice.
(WGS84 DATUM)

Charts affected — 1800 — JP 11 — JP 28**5461(T)/25 JAPAN - Hokkaidō - Depths.**

Source: Japanese Notice 46/5505(T)/25

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
8·9m	43° 23'·95N., 145° 48'·85E.
5·3m	43° 23'·42N., 145° 49'·11E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1803**5462(T)/25 JAPAN - Honshū - Depth.**

Source: Japanese Notice 46/5506(T)/25

1. A depth of 12·6m exists in position 37° 24'·83N., 138° 33'·85E.
(WGS84 DATUM)

Chart affected — JP 1180**5463(T)/25 JAPAN - Honshū - Depth.**

Source: Japanese Notice 46/5509(T)/25

1. A depth of 13m exists in the vicinity of position 33° 56'·1N., 135° 03'·2E.
(WGS84 DATUM)

Chart affected — JP 77

5564(T)/25 JAPAN - Honshū - Depths. Obstruction.

Source: Japanese Notice 47/5511(T)/25

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
20·5m	37° 28′·00N., 137° 02′·80E.
17·7m	37° 27′·35N., 137° 01′·46E.
25·5m	37° 27′·04N., 137° 00′·94E.
19·4m	37° 26′·50N., 137° 00′·14E.
27·5m	37° 25′·83N., 136° 58′·35E.
37m	37° 26′·00N., 136° 53′·03E.

2. An underwater obstruction, depth 36m, exists in position 37° 27′·28N., 137° 01′·04E.
3. Former Notice 105(T)/25 is cancelled.
(WGS84 DATUM)

Chart affected — JP 1163

(16) KOREA AND THE PACIFIC COASTS OF RUSSIA

2427(T)/13 RUSSIA - Pacific Ocean Coast - Buoy.

Source: Russian Notice 18/2744(T)/13

1. The east cardinal buoy marking Banka Obmanchivaya in position 43° 42'·6N., 146° 24'·5E. (WGS84 Datum) is reported missing.

Charts affected — 1802 — 1803

1933(T)/14 RUSSIA - Pacific Ocean Coast - Wreck.

Source: Russian Notice 15/2066(T)/14

1. A wreck, depth 23m, has been reported in position 52° 31'·68N., 156° 05'·98E. (Undetermined Datum)

Chart affected — 1230

2746(T)/14 RUSSIA - Pacific Ocean Coast - Restricted area.

Source: Russian Notice 23/3324(T)/14

1. A restricted area, anchoring, fishing, dredging and trawling prohibited, has been established, within a radius of 1·5M of position 49° 16'·0N., 140° 34'·0E. (Undetermined Datum).

Chart affected — 3340

3546(T)/16 RUSSIA - Pacific Ocean Coast - Mooring buoy.

Source: Russian Notice 24/3207(T)/16

1. The mooring buoy in position 42° 30'·5N., 131° 47'·8E. is reported missing.
2. Mariners are advised to navigate with caution in the area. (Undetermined Datum)

Chart affected — 2432

955(T)/17 RUSSIA - Pacific Ocean Coast - Obstructions. Area to be avoided.

Source: Russian Notice 5/471(T)/17

1. Submerged obstructions exist in position 52° 47'·0N., 158° 57'·0E. An area to be avoided, radius 1M, has been established centred on this position.
2. Former Notice 3359(T)/10 is cancelled. (WGS84 DATUM)

Chart affected — 4512

1076(T)/18 RUSSIA - Pacific Ocean Coast - Works.

Source: Russian Notice 6/711(T)/18

1. Reclamation works are taking place within an area bounded by the following positions:

42° 44'·79N., 133° 02'·85E.
42° 44'·95N., 133° 03'·03E.
42° 44'·85N., 133° 03'·17E.
42° 44'·42N., 133° 03'·77E.
42° 44'·41N., 133° 03'·81E.
42° 44'·35N., 133° 03'·83E.

2. Mariners should navigate with caution and obtain the latest details from the local port authority. (WGS84 DATUM)

Chart affected — 3041

3252(T)/18 RUSSIA - Pacific Ocean Coast - Buoyage.

Source: Russian Notice 24/3257(T)/18

1. Yellow special light-buoys, *Fl.Y.5s*, exist in the following positions:

42° 43'·14N., 133° 00'·31E.

42° 42'·99N., 133° 00'·51E.

(WGS84 DATUM)

Chart affected — 3041**4188(T)/18 RUSSIA - Pacific Ocean Coast - Restricted areas.**

Source: Russian Notice 32/4288(T)/18

1. Restricted areas, fishing, dredging, anchoring and trawling prohibited, have been established within areas bounded by the following positions:

43° 04'·27N., 131° 54'·84E.

43° 04'·23N., 131° 54'·51E.

43° 03'·93N., 131° 54'·30E.

43° 03'·68N., 131° 54'·93E.

43° 03'·99N., 131° 55'·19E.

and

43° 03'·63N., 131° 53'·72E.

43° 03'·82N., 131° 53'·96E.

43° 03'·52N., 131° 54'·61E.

43° 03'·32N., 131° 54'·36E.

43° 03'·40N., 131° 54'·11E.

and

* 43° 00'·94N., 131° 54'·79E.

* 43° 00'·94N., 131° 54'·98E.

* 43° 00'·66N., 131° 54'·98E.

* 43° 00'·66N., 131° 54'·68E.

2. Mariners are advised to navigate with caution in the area.

3. Former Notice 6501(T)/16 is cancelled.

* Indicates new or revised entry.

(WGS84 DATUM)

Chart affected — 3044**4192(T)/18 RUSSIA - Pacific Ocean Coast - Wrecks.**

Source: Russian Notice 32/4288(T)/18

1. Stranded wrecks exist in the following positions:

43° 05'·73N., 131° 51'·35E.

43° 05'·47N., 131° 53'·60E.

43° 06'·29N., 131° 55'·63E.

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Chart affected — 3044**4193(T)/18 RUSSIA - Pacific Ocean Coast - Buoy.**

Source: Russian Notice 32/4288(T)/18

1. A mooring buoy has been established in position 43° 04'·36N., 131° 50'·71E.
(WGS84 DATUM)

Chart affected — 3044

212(T)/19 RUSSIA - Pacific Ocean Coast - Buoy.

Source: Russian Notice 50/6546(T)/18

1. The west cardinal light-buoy, *Q(9)15s*, in position 50° 42'·64N., 156° 09'·71E., is reported missing.
(UNDETERMINED DATUM)

Chart affected — 2128**867(T)/19 RUSSIA - Pacific Ocean Coast - Floating dock.**

Source: Russian Notice 2/97(T)/19

1. The floating dock centred on position 42° 52'·18N., 131° 23'·52E., is temporarily submerged.
(WGS84 DATUM)

Chart affected — 3039**2345(T)/19 RUSSIA - Pacific Ocean Coast - Works.**

Source: Russian Notice 15/1828(T)/19

1. Dredging works are taking place, within an area bounded by the following positions:

43° 06'·79N., 131° 53'·08E.

43° 06'·72N., 131° 53'·18E.

43° 06'·51N., 131° 53'·06E.

43° 06'·54N., 131° 52'·94E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3044**6063(T)/19 RUSSIA - Pacific Ocean Coast - Buoyage.**

Source: Russian Notice 44/5117(T)/19

1. Submerged mooring buoys have been established in the following positions:

43° 08'·45N., 131° 51'·64E.

43° 08'·40N., 131° 51'·57E.

43° 08'·36N., 131° 51'·48E.

43° 08'·35N., 131° 51'·50E.

43° 08'·34N., 131° 51'·52E.

43° 07'·72N., 131° 50'·68E.

43° 07'·29N., 131° 50'·18E.

(WGS84 DATUM)

Chart affected — 3044**1278(T)/21 KOREA - West Coast - Buoy.**

Source: Korean Notice 4/110(T)/21

1. An ODAS light-buoy, *Fl(5)Y.20s*, has been temporarily established in position 32° 50'·00N., 124° 44'·00E.
(WGS84 DATUM)

Chart affected — 3480**1897(T)/21 KOREA - West Coast - Buoy.**

Source: Korean Notice 10/225(T)/21

1. A yellow buoy, *ODAS*, has been established in position: 37° 37'·17N., 125° 38'·90E.
(WGS84 DATUM)

Chart affected — 1258

517(T)/22 RUSSIA - Pacific Ocean Coast - Anchorage area.

Source: Russian Notice 41/4351(T)/21

1. A new Tanker anchorage area has been established, bounded by the following positions:

42° 45'·58N., 133° 00'·82E.

42° 45'·17N., 133° 00'·14E.

42° 44'·67N., 133° 01'·15E.

42° 45'·20N., 133° 01'·85E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3041**1556(T)/22 RUSSIA - Pacific Ocean Coast - Light.**

Source: Russian Notice 51/5543(T)/2021

1. The range of the light at Zaliv Ol'gi, in position 43° 40'·6N., 135° 17'·0E. has been temporarily reduced to 9M.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2293**1774(T)/22 KOREA - West Coast - Buoy.**

Source: Korean Notice 10/193(T)/22

1. The lateral light-buoy, *Fl.G.4s*, in position 37° 07'·44N., 126° 27'·52E. is reported unlit.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1270**3427(T)/22 KOREA - West Coast - Radar beacon.**

Source: Korean Notice 16/317(T)/22

1. The radar beacon, Racon (T), in position, 34° 51'·63N., 126° 12'·12E. , is out of service.
(WGS84 DATUM)

Chart affected — 3928**4921(T)/22 RUSSIA - Pacific Ocean Coast - Buoy. Fog signal.**

Source: Russian Notice 32/3585(T)/22

1. The south cardinal light-buoy, *Q(6)+LFl.15s Whis*, in position 42° 46'·90N., 132° 28'·74E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2432 — 3045 — 3046**4928(T)/22 RUSSIA - Pacific Ocean Coast - Mooring buoy.**

Source: Russian Notice 32/3581(T)/22

1. A mooring buoy has been deployed, until further notice, in position 43° 07'·37N., 131° 50'·70E.
(WGS84 DATUM)

Charts affected — 3044 — 3045**433(T)/23 KOREA - West Coast - Buoy.**

Source: Korean Notice 49/1129(T)/22

1. An *ODAS* light-buoy, *Fl(5)Y.20s*, has been temporarily established in position 35° 17'·00N., 125° 09'·00E.
(WGS84 DATUM)

Charts affected — 913 — 3480

526(T)/23 KOREA - West Coast - Buoy.

Source: Korean Notice 49/1130(T)/22

1. An ODAS light-buoy, *Fl(5)Y.20s*, has been established in position: 37° 03'·00N., 124° 37'·00E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1256 — 1258 — 3480**593(T)/23 KOREA - East Coast - Buoy.**

Source: Korean Notice 48/1088(T)/22

1. The yellow ODAS buoy in position 35° 13'·33N., 129° 17'·00E., has been moved to position 35° 13'·13N., 129° 15'·85E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 127 — 896 — 1065 — 3666**2539(T)/23 KOREA STRAIT - Buoy.**

Source: Korean Notice 12/206(T)/23

1. An ODAS buoy, *Fl(5)Y.20s*, has been established in position: 32° 43'·3N., 127° 16'·3E.
(WGS84 DATUM)

Chart affected — 3480**3514(T)/23 RUSSIA - Pacific Ocean Coast - Wrecks.**

Source: Russian Notice 15/1657(T)/22

1. Wrecks exist in an area bounded by the following positions:
59° 32'·49N., 150° 46'·49E.
59° 32'·48N., 150° 46'·48E.
59° 32'·51N., 150° 46'·41E.
59° 32'·51N., 150° 46'·48E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2127**957(T)/24 RUSSIA - Pacific Ocean Coast - Restricted area.**

Source: Russian Notice 6/503(T)/24

1. A restricted area, radius 1·5M, dangerous for all underwater activities, has been established centred on position 49° 16'·0N., 140° 34'·0E.
2. Mariners are advised to navigate with caution in the area.
(UNDETERMINED DATUM)

Chart affected — 3340**1421(T)/24 RUSSIA - Pacific Ocean Coast - Light.**

Source: Russian Notice 40/4266(T)/23

1. The range of the light at Mys Basargina, in position 43° 03'·47N., 131° 57'·76E. has been temporarily reduced to 5M.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3044 — 3045

2297(T)/24 RUSSIA - Pacific Ocean Coast - Restricted area.

Source: Russian Notice 9/812(T)/24

1. Anchoring, fishing, dredging and other seabed activities are not recommended within the area bounded by the following positions:

52° 50'·5N., 159° 14'·6E.

52° 53'·5N., 159° 14'·1E.

52° 55'·6N., 159° 36'·6E.

52° 50'·5N., 159° 36'·6E.

(WGS84 DATUM)

Chart affected — 4512**3671(T)/24 RUSSIA - Pacific Ocean Coast - Virtual aid to navigation.**

Source: Russian Notice 13/1232(T)/24

1. A virtual aid to navigation (V-AIS) has been established in position 49° 07'·27N., 140° 21'·28E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2161**3923(T)/24 RUSSIA - Pacific Ocean Coast - Restricted area.**

Source: Russian Notice 17/1670(T)/24

1. A restricted area, has been established bounded by the following positions:
42° 56'·5N., 134° 12'·5E.
42° 58'·5N., 134° 16'·5E.
42° 50'·0N., 134° 24'·1E.
42° 50'·0N., 134° 14'·6E.
2. In the area for safety of navigation stopping, anchoring, fishing, trawling, dredging works, explosive operations and navigation with slack anchor chain are not recommended.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2293 — 2432**4707(T)/24 RUSSIA - Pacific Ocean Coast - Fog signal. Buoy.**

Source: Russian Notice 32/3409(T)/24

1. The fog signal at west cardinal light-buoy, *Q(9)15s*, in position 59° 29'·99N., 150° 30'·63E. is temporarily inoperative.
(WGS84 DATUM)

Chart affected — 2127**4854(T)/24 KOREA - East Coast - Buoy.**

Source: Korean Notice 29/443(T)/24

1. The special purpose light-buoy, *Fl(5)Y.20s ODAS*, in position 36° 58'·00N., 130° 31'·00E., has been temporarily extinguished.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2347 — 3480 — 3666

4936(T)/24 RUSSIA - Pacific Ocean Coast - Buoyage.

Source: Russian Notice 36/3868(T)/24

1. Mooring buoys have been deployed, until further notice, in the following positions:

Buoy Type

Mooring

Mooring

(WGS84 DATUM)

Position

43° 06'·43N., 131° 55'·62E.

43° 06'·42N., 131° 55'·60E.

Chart affected — 3044**1125(T)/25 KOREA - West Coast - Buoy.**

Source: Korean Notice 1/9(T)/25

1. The light-buoy, *Fl.R. 4s No 24*, in position 37° 20'·21N., 126° 38'·48E. has been moved to 37° 20'·14N., 126° 38'·19E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1271**1429(T)/25 RUSSIA - Pacific Ocean Coast - Obstruction.**

Source: Russian Notice 3/219(T)/25

1. A submerged obstruction exists in position 59° 33'·06N., 150° 43'·58E.
(WGS84 DATUM)

Charts affected — 2127 — 2130**2636(T)/25 KOREA - West Coast - Buoy.**

Source: Korean Notice 13/125(T)/25

1. The light-buoy, *Fl(2)R. 6s No 16*, in position 37° 01'·93N., 126° 22'·71E. has been moved to 37° 01'·86N., 126° 22'·82E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1271**3894(T)/25 RUSSIA - Pacific Ocean Coast - Obstruction. Restricted area.**

Source: Russian Notice 20/2145(T)/25

1. A submerged obstruction, depth 100m, exists in position 42° 18'·2N., 131° 03'·6E.
2. A circular restricted area, radius 2 cables, has been established centred on the obstruction. Anchoring, fishing and underwater activities are not recommended within this area.
(WGS84 DATUM)

Chart affected — 2432**4390(T)/25 KOREA - South Coast - Platform.**

Source: : Korean Notice 30/454(T)/25

1. A lit platform, Mo(U)10s17m9M, has been established in position: 34° 25'·20N., 127° 09'·09E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3929

4826(T)/25 KOREA - West Coast - Buoyage.

Source: Korean Notices 34/534(T)/24 and 33/506(T)-507(T)/25

1. Special light-buoys, *Fl(4)Y. 8s*, have been established in the following positions:

<i>Designation</i>	<i>Position</i>
<i>A</i>	35° 20'·84N., 126° 04'·92E.
<i>D</i>	35° 22'·68N., 126° 06'·16E.
<i>E</i>	35° 22'·84N., 126° 10'·85E.
<i>H</i>	35° 20'·85N., 126° 09'·68E.
<i>K</i>	35° 19'·54N., 126° 08'·86E.
<i>N</i>	35° 19'·82N., 126° 06'·15E.
* <i>Q</i>	35° 23'·39N., 126° 06'·34E.
* <i>R</i>	35° 24'·12N., 126° 06'·42E.
* <i>S</i>	35° 24'·85N., 126° 06'·53E.
* <i>T</i>	35° 25'·08N., 126° 07'·49E.
* <i>U</i>	35° 25'·03N., 126° 08'·46E.
* <i>V</i>	35° 24'·74N., 126° 09'·47E.
* <i>W</i>	35° 24'·22N., 126° 10'·31E.
* <i>X</i>	35° 23'·49N., 126° 10'·89E.

2. Mariners are advised to navigate with caution in the area.

3. *Former Notice 5209(T)/24 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 913

(17) PHILIPPINE ISLANDS, BORNEO AND INDONESIA EXCEPT SUMATERA

2773(T)/15 MALAYSIA - Sarawak - Works.

Source: Marine Department, Sarawak Notice 54(T)/15

1. A working area has been established until 12th May 2017 for jetty construction, within an area bounded by the following positions:

3° 16'·04N., 113° 03'·33E.

3° 15'·98N., 113° 03'·39E.

3° 15'·73N., 113° 03'·13E.

3° 15'·80N., 113° 03'·07E.

2. Mariners are advised to navigate with caution when in the vicinity.
(WGS84 Datum)

Chart affected — 1748

4195(T)/18 INDONESIA - Java Sea - Buoy.

Source: Indonesian Notice 32/349(T)/18

1. The special purpose light-buoy, *Fl.Y.3s*, in position 6° 35'·81S., 113° 17'·36E. is reported missing.
(WGS84 DATUM)

Charts affected — 945 — 2796 — 2876

5227(T)/18 INDONESIA - Sulawesi - General information.

Source: Indonesian Notice 41/464/18

1. As a consequence of the tsunami which occurred on 28 September 2018, depths, coastlines and sea levels may have changed throughout the vicinity of Teluk Palu. Wrecks and obstructions may have been displaced. Tidal predictions may be unreliable and aids to navigation may be damaged, destroyed or out of position. Mariners should expect considerable change and are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2638 — 2893 — 2894

1489(T)/19 INDONESIA - Java Sea - Buoy.

Source: Indonesian Notice 8/114(T)/19

1. The isolated danger light-buoy, *Fl(2)5s*, in position 5° 01'·0S., 107° 21'·0E. is reported missing.
(WGS84 DATUM)

Charts affected — 2470 — 2797 — 2862

6398(T)/19 MALAYSIA - Sarawak - Buoy.

Source: Malaysian Notice 10/241/19 and Marine Department, Sarawak Notice 123(P)/19

1. The yellow special light-buoy, *Fl(5)Y.10s* in position 1° 38'·26N., 110° 28'·33E. is reported to be damaged and may be unlit.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1822

1543(T)/20 INDONESIA - Kalimantan - Obstruction.

Source: Indonesian Notice 8/90(P)/20

1. An obstruction has been reported in position 4° 00'·88N., 118° 04'·71E.
2. Mariners are advised to navigate with caution in the area.
(TIMBALAI 1948 DATUM)

Chart affected — 2099

3590(P)/20 PHILIPPINE ISLANDS - Bohol - Submarine cables.

Source: NavPhil 90/20

1. Submarine cables are being laid joining the following positions:

9° 17'·49N., 123° 18'·42E.
 9° 18'·19N., 123° 21'·37E.
 9° 17'·57N., 123° 23'·67E.
 9° 17'·07N., 123° 25'·72E.
 9° 17'·14N., 123° 26'·85E.
 9° 17'·13N., 123° 28'·20E.
 9° 16'·79N., 123° 29'·27E.
 9° 14'·23N., 123° 29'·80E.
 9° 12'·81N., 123° 30'·02E.
 and
 9° 12'·81N., 123° 30'·02E.
 9° 14'·07N., 123° 30'·37E.
 9° 16'·78N., 123° 30'·88E.
 9° 19'·89N., 123° 33'·56E.
 9° 23'·00N., 123° 41'·61E.
 9° 26'·08N., 123° 49'·71E.
 9° 29'·02N., 123° 53'·15E.
 9° 31'·63N., 123° 54'·81E.
 9° 36'·40N., 123° 55'·94E.
 9° 36'·95N., 123° 56'·00E.

2. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 3484 — 3809 — 3811 — 4416 — 4417 — 4473**3997(P)/20 PHILIPPINE ISLANDS - Sulu Sea - Reef.**

Source: UKHO

1. The reef at Arena Island is reported to extend W to approximate position 9° 14'·5N., 120° 43'·3E.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(UNDETERMINED DATUM)

Charts affected — 3809 — 3811**5550(P)/20 PHILIPPINE ISLANDS - Luzon - Submarine cables.**

Source: PH NAV 121 20

1. Submarine cables are being laid, joining the following positions:

12° 34'·83N., 122° 15'·77E.
 12° 35'·06N., 122° 15'·71E.
 12° 35'·27N., 122° 15'·46E.
 12° 35'·61N., 122° 15'·46E.
 12° 36'·40N., 122° 15'·71E.
 12° 36'·90N., 122° 16'·01E.
 12° 37'·59N., 122° 16'·44E.
 12° 37'·97N., 122° 16'·54E.
 12° 38'·16N., 122° 16'·54E.
 12° 39'·76N., 122° 16'·17E.
 12° 51'·77N., 122° 10'·35E.
 12° 53'·55N., 122° 08'·77E.
 12° 57'·75N., 122° 06'·96E.
 13° 08'·21N., 122° 00'·11E.
 13° 12'·58N., 121° 56'·77E.
 13° 13'·82N., 121° 56'·22E.
 13° 14'·27N., 121° 56'·19E.
 13° 14'·71N., 121° 56'·45E.
 13° 15'·20N., 121° 56'·53E.

5550(P)/20 PHILIPPINE ISLANDS - Luzon - Submarine cables. (continued)**2. and**

12° 34'·41N., 122° 14'·96E.
 12° 34'·54N., 122° 14'·94E.
 12° 34'·67N., 122° 14'·78E.
 12° 34'·64N., 122° 14'·42E.
 12° 34'·60N., 122° 14'·34E.
 12° 34'·33N., 122° 14'·14E.
 12° 34'·22N., 122° 13'·82E.
 12° 34'·29N., 122° 13'·36E.
 12° 35'·33N., 122° 11'·61E.
 12° 35'·87N., 122° 10'·62E.
 12° 36'·18N., 122° 10'·01E.
 12° 36'·32N., 122° 09'·00E.
 12° 36'·92N., 122° 08'·32E.
 12° 37'·05N., 122° 08'·02E.
 12° 37'·08N., 122° 07'·76E.
 12° 37'·06N., 122° 07'·59E.
 12° 36'·99N., 122° 07'·35E.
 12° 36'·99N., 122° 07'·32E.

3. and

12° 15'·4N., 122° 03'·3E.
 12° 15'·4N., 122° 03'·4E.
 12° 15'·6N., 122° 04'·5E.
 12° 15'·6N., 122° 06'·5E.
 12° 15'·5N., 122° 09'·2E.
 12° 10'·0N., 122° 32'·7E.
 12° 10'·3N., 122° 35'·4E.
 12° 11'·8N., 122° 39'·1E.
 12° 12'·8N., 122° 40'·3E.
 12° 19'·2N., 122° 43'·9E.
 12° 20'·4N., 122° 44'·1E.
 12° 21'·2N., 122° 44'·0E.
 12° 21'·8N., 122° 43'·5E.
 12° 22'·1N., 122° 42'·8E.
 12° 22'·3N., 122° 42'·1E.
 12° 22'·2N., 122° 41'·5E.
 12° 22'·2N., 122° 41'·3E.

**4. Charts will be updated when full details become available.
(WGS84 DATUM)**

Charts affected — 3484 — 3489 — 4413 — 4414 — 4416 — 4484 — 4485 — 4487 — 4488 — 4489

6035(T)/20 PHILIPPINE ISLANDS - Luzon - Wreck.

Source: NavPhil 139/20

1. A dangerous wreck has been reported in approximate position 13° 46'·38N., 120° 59'·02E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3558

6064(P)/20 PHILIPPINE ISLANDS - Sulu Sea - Submarine cable.

Source: NAMRIA NAVPHIL 135/20

1. A submarine cable is being laid, joining the following positions:

8° 43'·67N., 123° 22'·88E.
 8° 45'·02N., 123° 24'·92E.
 8° 48'·54N., 123° 26'·70E.
 8° 50'·58N., 123° 28'·28E.
 8° 54'·60N., 123° 27'·49E.
 9° 04'·09N., 123° 19'·29E.
 9° 06'·87N., 123° 21'·13E.
 9° 15'·53N., 123° 22'·02E.
 9° 17'·80N., 123° 23'·34E.
 9° 20'·62N., 123° 23'·60E.
 9° 22'·38N., 123° 22'·96E.
 9° 25'·01N., 123° 20'·74E.

2. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 3426 — 3484 — 3809 — 3811 — 4416 — 4471 — 4473

6158(P)/20 PHILIPPINE ISLANDS - Submarine cables.

Source: NavPhil 133/20

1. Submarine cables are being laid, joining the following positions:

13° 02'·09N., 121° 29'·57E.
 13° 02'·22N., 121° 31'·96E.
 13° 02'·12N., 121° 33'·88E.
 13° 02'·96N., 121° 37'·75E.
 13° 06'·96N., 121° 43'·63E.
 13° 15'·12N., 121° 45'·02E.
 13° 23'·02N., 121° 45'·57E.
 13° 25'·78N., 121° 48'·04E.
 13° 26'·02N., 121° 49'·17E.
 and
 12° 03'·68N., 121° 57'·60E.
 12° 03'·59N., 121° 58'·01E.
 12° 02'·92N., 121° 58'·63E.
 12° 00'·03N., 121° 58'·57E.
 11° 58'·51N., 121° 58'·21E.
 11° 57'·33N., 121° 57'·31E.
 11° 56'·96N., 121° 56'·83E.
 and
 11° 56'·96N., 121° 56'·83E.
 11° 57'·22N., 121° 57'·25E.
 11° 56'·75N., 121° 58'·01E.
 11° 56'·55N., 121° 57'·80E.
 11° 56'·30N., 121° 57'·27E.
 and

11° 16'·71N., 124° 01'·82E.
 11° 18'·56N., 124° 01'·89E.
 11° 19'·47N., 124° 03'·14E.
 11° 23'·42N., 124° 04'·89E.
 11° 29'·79N., 124° 09'·90E.
 11° 41'·99N., 124° 07'·40E.
 11° 44'·78N., 124° 08'·65E.
 11° 50'·22N., 124° 08'·56E.
 11° 54'·16N., 124° 06'·85E.
 11° 53'·12N., 124° 03'·02E.

2. Charts will be updated when full details are available.

6158(P)/20 PHILIPPINE ISLANDS - Submarine cables. (continued)

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3484 — 3489 — 3809 — 4413 — 4414 — 4416 — 4417 — 4477 — 4478 — 4484 — 4489

833(P)/21 PHILIPPINE ISLANDS - Luzon - Submarine cables.

Source: Phil Nav 2/21

1. Submarine cables are being laid joining the following positions:

13° 35'·18N., 124° 14'·39E.
13° 33'·08N., 124° 16'·30E.
13° 11'·90N., 124° 28'·09E.
13° 03'·54N., 124° 27'·01E.
12° 56'·46N., 124° 34'·07E.
12° 52'·44N., 124° 42'·43E.
12° 45'·35N., 124° 44'·00E.
12° 42'·42N., 124° 42'·06E.
12° 30'·53N., 124° 37'·79E.
and
12° 13'·44N., 123° 17'·10E.
12° 12'·04N., 123° 12'·91E.
12° 13'·28N., 123° 07'·08E.
12° 20'·12N., 122° 55'·02E.
12° 22'·84N., 122° 45'·85E.
12° 22'·30N., 122° 41'·22E.

2. Charts will be updated when full details are available.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3484 — 3489 — 4413 — 4416 — 4417 — 4485 — 4486 — 4487

2009(P)/21 BRUNEI - Depths. Dredged areas. Alongside depths.

Source: Maritime and Port Authority of Brunei Darussalam (MPABD)

1. Recent survey and port information has shown numerous depth changes within Muara Harbour.
2. A dredged area of 14·1m exists, bounded by the following positions:

5° 00'·83N., 115° 04'·11E.
5° 01'·32N., 115° 04'·22E.
5° 01'·71N., 115° 04'·86E.
5° 01'·63N., 115° 04'·92E.
5° 01'·22N., 115° 04'·50E.
5° 00'·78N., 115° 04'·40E.

3. Alongside depths are reported to differ from those charted at Pulau Muara Besar. The most significant are as follows:

<i>Berth Number</i>	<i>Alongside depth</i>	<i>Position</i>
1	14·1m	5° 01'·14N., 115° 04'·47E.
2	14·1m	5° 00'·99N., 115° 04'·43E.
4	14·8m	4° 59'·75N., 115° 08'·07E.
5	14·8m	4° 59'·66N., 115° 07'·98E.
6	12·0m	4° 59'·54N., 115° 07'·81E.
7	6·0m	4° 59'·56N., 115° 07'·68E.
8	14·8m	4° 59'·44N., 115° 07'·52E.

4. A dredged area, depth 7·2m, has been established at the RAY Harbour and International Integrated Marine Supply Base, centred on position 5° 00'·47N., 115° 04'·00E.

2009(P)/21 BRUNEI - Depths. Dredged areas. Alongside depths. (continued)

5. Depths less than charted exist. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
12·0m	5° 01'·65N., 115° 04'·75E.
11·3m	5° 01'·29N., 115° 04'·19E.
1·7m	5° 00'·75N., 115° 04'·41E.
2·4m	5° 00'·74N., 115° 04'·33E.
5·6m	4° 59'·33N., 115° 06'·08E.
3·8m	4° 59'·38N., 115° 06'·94E.

6. Mariners are advised to navigate with caution in the area and to contact either Hengyi Industries Ltd Co. or the Maritime and Port Authority of Brunei Darussalam for the latest information.

7. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 2134

2220(P)/21 PHILIPPINE ISLANDS - Submarine cables.

Source: NAMRIA NAVPHIL 32/21

1. Submarine cables are being laid, joining the following positions:

12° 22'·51N., 123° 38'·04E.
 12° 23'·02N., 123° 38'·20E.
 12° 24'·80N., 123° 38'·42E.
 12° 33'·90N., 123° 28'·39E.
 12° 38'·53N., 123° 19'·51E.
 12° 49'·29N., 123° 01'·33E.
 12° 55'·74N., 122° 52'·26E.
 13° 03'·06N., 122° 44'·65E.
 13° 12'·15N., 122° 46'·20E.
 13° 18'·49N., 122° 51'·71E.
 13° 22'·99N., 122° 55'·94E.
 13° 29'·51N., 123° 00'·78E.
 13° 29'·97N., 123° 00'·91E.
 13° 30'·84N., 123° 01'·20E.
 and
 11° 04'·94N., 123° 56'·11E.
 11° 05'·22N., 123° 55'·32E.
 11° 07'·09N., 123° 53'·13E.
 11° 09'·64N., 123° 51'·49E.
 11° 16'·49N., 123° 49'·83E.

2.

11° 29'·93N., 123° 45'·67E.
 12° 06'·38N., 123° 25'·84E.
 12° 07'·16N., 123° 26'·27E.
 12° 12'·66N., 123° 29'·05E.
 12° 12'·68N., 123° 29'·04E.
 and
 11° 02'·90N., 124° 02'·31E.
 11° 02'·80N., 124° 02'·53E.
 11° 02'·55N., 124° 03'·75E.
 11° 02'·12N., 124° 04'·78E.
 10° 59'·08N., 124° 10'·82E.
 10° 58'·35N., 124° 12'·35E.
 10° 49'·25N., 124° 27'·18E.
 10° 52'·57N., 124° 33'·51E.
 10° 55'·76N., 124° 34'·29E.
 10° 58'·61N., 124° 35'·19E.
 11° 00'·81N., 124° 34'·99E.
 and
 10° 46'·20N., 122° 36'·41E.
 10° 45'·76N., 122° 48'·24E.

2220(P)/21 PHILIPPINE ISLANDS - Submarine cables. (continued)

3.

10° 45'·95N., 122° 51'·02E.

10° 46'·11N., 122° 53'·27E.

10° 45'·88N., 122° 54'·32E.

10° 44'·60N., 122° 57'·72E.

and

10° 29'·16N., 123° 25'·56E.

10° 29'·04N., 123° 25'·93E.

10° 29'·18N., 123° 28'·77E.

10° 29'·81N., 123° 34'·70E.

10° 25'·86N., 123° 38'·93E.

10° 25'·61N., 123° 39'·27E.

10° 25'·10N., 123° 39'·73E.

10° 24'·78N., 123° 40'·02E.

and

10° 13'·74N., 123° 46'·56E.

10° 13'·60N., 123° 46'·62E.

10° 13'·27N., 123° 46'·81E.

10° 12'·94N., 123° 47'·37E.

10° 12'·35N., 123° 47'·96E.

10° 11'·60N., 123° 48'·64E.

4.

10° 09'·69N., 123° 48'·77E.

9° 48'·09N., 123° 40'·98E.

9° 40'·40N., 123° 49'·51E.

9° 39'·94N., 123° 50'·71E.

and

9° 14'·44N., 123° 17'·70E.

9° 14'·31N., 123° 17'·83E.

9° 11'·02N., 123° 19'·83E.

8° 58'·16N., 123° 36'·98E.

8° 51'·23N., 124° 02'·89E.

8° 49'·26N., 124° 11'·35E.

8° 47'·30N., 124° 19'·81E.

8° 45'·81N., 124° 26'·19E.

8° 36'·93N., 124° 37'·02E.

8° 36'·56N., 124° 37'·52E.

8° 33'·05N., 124° 39'·79E.

8° 30'·87N., 124° 38'·77E.

8° 30'·68N., 124° 38'·60E.

5. Charts will be updated when full details are available.

6. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)**Charts affected — 3809 — 3811**

4848(P)/21 PHILIPPINE ISLANDS - Submarine cables.

Source: NAMRIA NAV PHIL 129/21

1. Submarine cable laying operations are taking place, joining the following positions:

12° 36'·23N., 121° 33'·08E.
12° 34'·77N., 121° 35'·32E.
12° 56'·30N., 121° 36'·55E.
13° 01'·75N., 121° 38'·90E.
13° 12'·22N., 121° 37'·28E.
13° 26'·82N., 121° 34'·48E.
13° 35'·33N., 121° 32'·85E.
13° 41'·90N., 121° 31'·38E.
13° 47'·47N., 121° 26'·28E.

and

11° 59'·02N., 122° 03'·25E.
12° 00'·02N., 122° 01'·88E.
12° 08'·22N., 121° 57'·40E.
12° 08'·63N., 121° 56'·55E.
12° 09'·03N., 121° 55'·90E.
12° 09'·18N., 121° 54'·62E.
12° 08'·55N., 121° 52'·30E.
12° 09'·67N., 121° 49'·03E.
12° 15'·93N., 121° 44'·13E.
12° 24'·78N., 121° 41'·48E.
12° 30'·53N., 121° 37'·00E.
12° 36'·23N., 121° 33'·08E.

2.

and

11° 36'·50N., 122° 42'·80E.
11° 42'·08N., 122° 39'·25E.
11° 49'·55N., 122° 35'·70E.
11° 57'·38N., 122° 20'·80E.
11° 59'·00N., 122° 06'·77E.
11° 59'·02N., 122° 03'·25E.
11° 59'·57N., 122° 00'·93E.
11° 59'·33N., 121° 59'·68E.
11° 58'·58N., 121° 58'·08E.
11° 57'·87N., 121° 57'·43E.
11° 57'·18N., 121° 57'·03E.
11° 56'·95N., 121° 56'·82E.

and

12° 12'·68N., 123° 29'·03E.
12° 09'·28N., 123° 27'·17E.
12° 04'·72N., 123° 24'·80E.
11° 56'·62N., 123° 18'·02E.
11° 52'·23N., 123° 14'·00E.
11° 48'·90N., 123° 08'·22E.
11° 48'·15N., 123° 00'·23E.
11° 44'·25N., 122° 48'·58E.
11° 40'·03N., 122° 42'·63E.
11° 36'·50N., 122° 42'·82E.

4848(P)/21 PHILIPPINE ISLANDS - Submarine cables. (continued)

3.

and

12° 00'·25N., 120° 14'·92E.
 11° 59'·52N., 120° 15'·62E.
 11° 57'·53N., 120° 18'·82E.
 11° 57'·15N., 120° 19'·55E.
 11° 56'·97N., 120° 23'·68E.
 11° 56'·40N., 120° 28'·57E.
 11° 56'·27N., 120° 30'·50E.
 11° 57'·43N., 120° 35'·53E.
 11° 58'·52N., 120° 39'·57E.
 11° 58'·48N., 120° 45'·57E.
 12° 00'·13N., 120° 50'·22E.
 11° 58'·63N., 121° 00'·75E.
 12° 00'·72N., 121° 04'·82E.
 12° 06'·93N., 121° 10'·72E.
 12° 10'·93N., 121° 19'·08E.
 12° 15'·30N., 121° 26'·13E.
 12° 18'·02N., 121° 28'·35E.
 12° 20'·97N., 121° 31'·00E.
 12° 25'·12N., 121° 34'·47E.
 12° 30'·53N., 121° 36'·30E.
 12° 36'·23N., 121° 33'·08E.

4.

and

10° 49'·65N., 119° 31'·12E.
 10° 57'·62N., 119° 40'·67E.
 10° 59'·10N., 119° 43'·55E.
 10° 59'·78N., 119° 46'·75E.
 11° 04'·57N., 119° 58'·72E.
 11° 06'·97N., 120° 03'·75E.
 11° 12'·15N., 120° 13'·20E.
 11° 16'·02N., 120° 15'·35E.
 11° 25'·72N., 120° 19'·52E.
 11° 30'·43N., 120° 20'·60E.
 11° 36'·43N., 120° 22'·30E.
 11° 42'·03N., 120° 23'·03E.
 11° 44'·08N., 120° 22'·82E.
 11° 53'·28N., 120° 22'·22E.
 11° 57'·42N., 120° 18'·75E.
 11° 59'·08N., 120° 15'·77E.
 12° 00'·25N., 120° 14'·92E.

5.

and

8° 58'·55N., 125° 25'·25E.
 9° 00'·00N., 125° 25'·75E.
 9° 05'·88N., 125° 23'·42E.
 9° 10'·63N., 125° 18'·63E.
 9° 14'·88N., 125° 14'·55E.
 9° 22'·72N., 124° 56'·65E.
 9° 27'·63N., 124° 32'·78E.
 9° 26'·13N., 124° 22'·62E.
 9° 23'·72N., 124° 06'·48E.
 9° 25'·33N., 124° 00'·87E.
 9° 30'·05N., 124° 00'·27E.
 9° 32'·20N., 123° 58'·90E.
 9° 33'·17N., 123° 57'·10E.
 9° 34'·57N., 123° 56'·25E.
 9° 35'·97N., 123° 56'·22E.
 9° 36'·87N., 123° 56'·25E.

6. Mariners are advised to navigate with caution in the area.

4848(P)/21 PHILIPPINE ISLANDS - Submarine cables. (continued)

7. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 967 — 3483 — 3484 — 3489 — 3809 — 3811 — 4413 — 4414 — 4416 — 4417 — 4472 — 4473 — 4474 — 4482 — 4483 — 4484 — 4485 — 4489 — 4490

390(T)/22 PHILIPPINE ISLANDS - Cebu - Wrecks.

Source: NAMRIA NAVPHIL 001/22

1. Wrecks, depth unknown, are reported to exist in the following positions:

10° 18'·93N., 123° 56'·72E.
10° 18'·73N., 123° 56'·46E.
10° 17'·88N., 123° 55'·70E.
10° 13'·65N., 123° 51'·12E.
10° 13'·58N., 123° 51'·14E.
10° 13'·38N., 123° 50'·66E.
10° 12'·85N., 123° 49'·70E.
10° 12'·75N., 123° 48'·56E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 13 — 14 — 4473 — 4477

800(T)/22 BRUNEI - Anchorage areas. Buoyage.

Source: Brunei Notice 1(T)/22

1. Temporary anchorage areas for Commercial Fishing Vessels, marked by special buoys, have been established, bounded by the following positions:

5° 00'·10N., 115° 04'·05E.
5° 00'·10N., 115° 04'·15E.
4° 59'·90N., 115° 04'·15E.
4° 59'·90N., 115° 04'·05E.
and
5° 03'·85N., 115° 04'·50E.
5° 03'·85N., 115° 05'·80E.
5° 03'·44N., 115° 05'·80E.
5° 03'·44N., 115° 04'·50E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2134

1834(P)/22 PHILIPPINE ISLANDS - Luzon - Submarine cable.

Source: NAMIRA NAVPHIL 105/22

1. A submarine cable is being laid between Manila Bay and Albay Gulf, joining the following positions:

13° 06'·2N., 124° 12'·2E.
13° 03'·2N., 124° 15'·0E.
12° 34'·8N., 124° 09'·0E.
12° 28'·4N., 124° 06'·6E.
12° 32'·4N., 123° 58'·0E.
12° 43'·0N., 123° 35'·6E.
12° 41'·0N., 123° 21'·0E.
13° 10'·6N., 121° 45'·6E.
13° 29'·0N., 121° 12'·7E.
13° 32'·0N., 121° 00'·0E.
13° 37'·9N., 120° 47'·0E.
13° 47'·8N., 120° 34'·8E.
14° 03'·2N., 120° 31'·0E.
14° 15'·0N., 120° 33'·0E.
14° 28'·2N., 120° 44'·0E.

1834(P)/22 PHILIPPINE ISLANDS - Luzon - Submarine cable. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3483 — 3484 — 3489 — 3558 — 4411 — 4413 — 4414 — 4416 — 4417 — 4486 — 4487 — 4488 — 4489 — 4490 — 4491

3071(P)/22 PHILIPPINE ISLANDS - Palawan - Fish havens.

Source: UKHO

- Fishing aggregating devices have been reported to exist within an area bounded by the following positions:

11° 25'·7N., 117° 48'·5E.
11° 34'·9N., 118° 23'·8E.
11° 12'·9N., 118° 29'·7E.
11° 03'·7N., 117° 54'·3E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 967 — 3483 — 3489

3759(T)/22 MALAYSIA - Sarawak - Buoyage.

Source: Malaysian Notice 93/22

- Works for the retrieval of the sunken vessel MV Geos have begun, Cardinal Buoys have been temporarily established in the following positions:

<i>Characteristic</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Q</i>	North Cardinal, Pillar	4° 40'·52N., 113° 58'·36E.
<i>Q(3)10s</i>	East Cardinal, Pillar	4° 40'·52N., 113° 58'·71E.
<i>Q(6)+LFl.15s</i>	South Cardinal, Pillar	4° 40'·21N., 113° 58'·72E.
<i>Q(9)15s</i>	West Cardinal, Pillar	4° 40'·23N., 113° 58'·42E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1949 — 2109 — 3838

4294(P)/22 MALAYSIA - Sarawak - Works. Buoyage.

Source: Marine Department, Sarawak Notice 68(T)/22

- Bridge construction works are taking place in the vicinity of the Sejingkat Terminal.
- Buoys associated with the works have been deployed in an area bounded by the following positions:

1° 34'·58N., 110° 25'·12E.
1° 34'·71N., 110° 25'·03E.
1° 34'·95N., 110° 25'·35E.
1° 34'·82N., 110° 25'·44E.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 1822

4798(P)/22 INDONESIA - Papua - Works. Dredging area.

Source: Indonesian Notice 13/195(P)/17

- Works associated with the Tangguh Expansion Project are taking place within an area bounded by the following positions:

2° 30'·09S., 132° 29'·25E.
2° 14'·13S., 132° 28'·68E.
2° 14'·58S., 133° 30'·65E.
2° 29'·21S., 133° 35'·03E.

4798(P)/22 INDONESIA - Papua - Works. Dredging area. (continued)

2. Dredging is in progress in the navigation channel to the new jetty Bulk Offloading Facility (BOF) at Tangguh LNG Terminal within an area bounded by the following positions:

2° 26'·96S., 133° 06'·74E. (shore)
 2° 26'·52S., 133° 06'·44E.
 2° 26'·40S., 133° 06'·61E.
 2° 26'·84S., 133° 06'·93E. (shore)

3. Dumping areas have been established in the following positions:

2° 26'·77S., 132° 52'·11E.
 2° 19'·53S., 133° 07'·27E.

4. Mariners are advised to navigate with caution in the area.
 5. Charts will be updated when full details become available.
 6. *Former Notice 3280(P)/18 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 3747 — 3749

4962(T)/22 INDONESIA - Java Sea - Wreck.

Source: Indonesian Notice 35/406/22

1. A sunken vessel has been reported in position: 5° 17'·16S., 107° 48'·50E.
 2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 2470 — 2797 — 2862 — 3729 — 4508

4993(T)/22 INDONESIA - Sulawesi - Wreck.

Source: Indonesian Notice 35/405/22

1. A sunken vessel has been reported in position 4° 59'·4S., 118° 34'·4E.
 2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 2877 — 2892

1559(P)/23 BRUNEI - Obstructions.

Source: Maritime and Port Authority of Brunei Darussalam

1. Concrete blocks, for the mooring of SCUBA diving vessels, have been placed on the seabed in the following positions:

<i>Name</i>	<i>Position</i>
Blunt Rock	4° 58'·25N., 114° 40'·24E.
Arun Wreck	5° 02'·38N., 114° 41'·76E.
Hornet Reef	5° 01'·23N., 114° 43'·90E.
Little Mount	5° 07'·02N., 114° 45'·14E.
Little Dale	5° 06'·25N., 114° 45'·75E.
Bolkiah Wreck	5° 07'·12N., 114° 57'·13E.
Rig Reef	5° 06'·32N., 114° 56'·94E.
Dolphin 88	5° 05'·92N., 115° 01'·85E.
Abana Pole	5° 06'·47N., 115° 04'·24E.
West Point	5° 06'·42N., 115° 04'·20E.

2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 1338 — 1844

2168(P)/23 PHILIPPINE ISLANDS - Mindanao - Submarine cable. Works.

Source: NAVPHIL 315/22 and 323/22

1. Submarine cable laying operations are taking place joining the following positions:

7° 05'·63N., 125° 47'·27E.

7° 07'·57N., 125° 53'·03E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 3484 — 4419 — 4420 — 4494**2495(T)/23 BRUNEI - Jetty.**

Source: Brunei Notice 40(T)/23

1. The jetty in the vicinity of, 5° 00'·84N., 115° 04'·00E., is closed until further notice.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2134**2605(P)/23 MALAYSIA - Sarawak - Submarine pipeline.**

Source: Marine Department, Sarawak Notice 84(T)/23

1. Pipeline laying operations are taking place, joining the following positions:

4° 32'·78N., 113° 58'·69E.

4° 58'·57N., 112° 59'·05E.

2. Charts will be updated when full details are available.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1949 — 2109 — 3483 — 3838**3186(T)/23 MALAYSIA - Sabah - Buoy.**

Source: Malaysian Notice 10/156(T)/22

1. The Special Purpose light-buoy, *Fl.Y*, in position 6° 04'·526N., 116° 06'·358E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3525 — 3626**3498(T)/23 BRUNEI - Light-beacons. Buoyage.**

Source: Maritime and Port Authority of Brunei Darussalam Notices 44(T)/23 and 50(T)/23

1. The following light-beacons are reported missing in the Muara Eastern Channel:

<i>Designation</i>	<i>Characterisitic</i>	<i>Position</i>
X5	Fl.G.5s4M	5° 02'·80N., 115° 10'·53E.
X7	Fl.G.5s9m4M	5° 01'·18N., 115° 09'·53E.
X8	Fl.G.5s9m4M	5° 00'·33N., 115° 08'·99E.

2. Temporary buoyage to aid navigation will be established in situ.
3. *The light-beacon, Y8, Fl.R.5s9m4M, in position 5° 00'·26N., 115° 09'·08E. is damaged, two submerged metal piles remain.
4. Mariners are advised to navigate with caution in the area.
5. Former Notice 2653(T)/23 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Charts affected — 1844 — 2134

3910(P)/23 PHILIPPINE ISLANDS - Mindanao - Submarine cables.

Source: NAMRIA NAVPHIL 2/23

1. Submarine cables have been laid, joining the following positions:

6° 55'·58N., 122° 00'·94E.

6° 55'·11N., 121° 59'·80E.

6° 55'·35N., 121° 56'·88E.

6° 59'·56N., 121° 50'·79E.

7° 03'·42N., 121° 49'·21E.

7° 07'·69N., 121° 49'·19E.

7° 31'·95N., 121° 59'·83E.

7° 46'·07N., 122° 03'·18E.

8° 03'·55N., 122° 10'·67E.

8° 09'·22N., 122° 19'·18E.

8° 10'·09N., 122° 29'·69E.

8° 09'·13N., 122° 34'·47E.

8° 10'·29N., 122° 40'·57E.

8° 08'·98N., 122° 41'·80E.

8° 07'·30N., 122° 41'·08E.

and

8° 07'·30N., 122° 41'·08E.

8° 09'·49N., 122° 45'·70E.

8° 32'·44N., 123° 00'·56E.

8° 34'·78N., 123° 05'·05E.

8° 35'·44N., 123° 09'·54E.

8° 34'·74N., 123° 20'·10E.

2. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 3809 — 3811 — 4498**4320(P)/23 MALAYSIA - Sarawak - Works. Bridge. Channels.**

Source: Marine Department, Sarawak Notice 99(T)/23

1. Bridge construction works are taking place between the following positions:

2° 22'·27N., 111° 25'·90E.

2° 22'·70N., 111° 25'·28E.

2. The Batang Paloh channel is closed for all vessels above 500GT.
3. A one-way temporary navigation channel has been established for vessels under 500GT. Towing is prohibited while navigating through the channel. This channel should only be used during daylight and against the current.
4. Mariners are advised to navigate with caution in the area and consult the local authorities for the latest information.
5. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 163**4422(T)/23 PHILIPPINE ISLANDS - Masbate - Light-beacon.**

Source: Philippine Notice 12/77(T)/22

1. A light-beacon, Fl.Y, has been established in position 12° 22'·58N., 123° 36'·69E.
(WGS84 DATUM)

Chart affected — 4487**4565(P)/23 INDONESIA - Jawa - Works.**

Source: Indonesian Notice 14/160(T)/23

1. Construction works are taking place in an area bounded by the following positions:

5° 53'·68S., 106° 00'·96E.

5° 53'·62S., 106° 00'·90E.

5° 53'·39S., 106° 01'·13E.

5° 53'·45S., 106° 01'·19E.

4565(P)/23 INDONESIA - Jawa - Works. (continued)

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 909 — 918**1267(T)/24 BRUNEI - Buoy.**

Source: Brunei Notice 4(T)/23

1. The east cardinal light-buoy, *VQ(3)5s*, in position 5° 03'·36N., 115° 11'·48E. is reported missing.
2. *Mariners are advised to navigate with caution in this area.
3. *Former Notice 6173(T)/19 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Chart affected — 1844**1369(T)/24 PHILIPPINE ISLANDS - Buoyage.**

Source: NAVPHIL 254/23

1. The following light-buoys have been reported unlit:

<i>Characteristic</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl(2)G.5s</i>	Green lateral buoy	13° 31'·97N., 122° 03'·17E.
<i>Fl(2)R.5s</i>	Red lateral buoy	13° 31'·99N., 122° 03'·71E.
<i>Q</i>	North Cardinal Buoy	12° 34'·83N., 122° 15'·37E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4484 — 4487 — 4488 — 4489**1517(P)/24 PHILIPPINE ISLANDS - Luzon - Works. Offshore installation.**

Source: *Philippine Notice 9/114(P)/23

1. * In connection with the new Liquid Gas Terminal and power station project at Batangas, works are taking place in an area bounded by the following positions:

13° 44'·67N., 121° 02'·80E.
13° 44'·55N., 121° 02'·60E.
13° 44'·77N., 121° 01'·80E.
13° 45'·17N., 121° 01'·18E.
13° 45'·77N., 121° 00'·53E.
13° 46'·70N., 121° 00'·75E.
2. Mariners are advised to navigate with caution in the area.
3. Chart 3558 will be updated when full details are available.
4. Former Notice 2897(P)/21 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 3558

1616(P)/24 PHILIPPINE ISLANDS - Luzon - Works. Dredging area.

Source: Nav Phil 377/22 and Nav Phil 398/23

1. Dredging works are taking place in the areas bounded by the following positions:

* 14° 20'·96N., 120° 41'·56E.
 * 14° 26'·99N., 120° 46'·72E.
 * 14° 26'·99N., 120° 48'·62E.
 * 14° 28'·18N., 120° 51'·44E.
 * 14° 26'·79N., 120° 52'·01E.
 * 14° 25'·79N., 120° 52'·01E.
 * 14° 25'·79N., 120° 49'·93E.
 * 14° 20'·97N., 120° 45'·33E.
 and
 14° 29'·02N., 120° 57'·37E.
 14° 27'·97N., 120° 56'·95E.
 14° 27'·88N., 120° 56'·33E.
 14° 28'·48N., 120° 56'·12E.
 14° 28'·65N., 120° 56'·15E.

2. Mariners are advised to navigate with caution in the area.

3. Former Notice 2357(T)23 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 3931 — 4491**2465(P)/24 PHILIPPINE ISLANDS - Submarine cables.**

Source: NAMRIA NAVPHIL 233/22

1. Submarine cable laying operations are taking place, joining the following positions:

10° 47'·73N., 122° 40'·91E.
 10° 46'·12N., 122° 41'·10E.
 10° 44'·71N., 122° 41'·66E.
 10° 44'·57N., 122° 41'·82E.
 10° 43'·67N., 122° 44'·63E.
 10° 43'·91N., 122° 46'·98E.
 10° 45'·12N., 122° 48'·87E.
 10° 45'·53N., 122° 51'·29E.
 10° 45'·89N., 122° 53'·87E.
 10° 45'·76N., 122° 54'·16E.
 10° 44'·33N., 122° 55'·27E.
 10° 44'·28N., 122° 55'·48E.
 10° 44'·28N., 122° 56'·50E.
 10° 44'·57N., 122° 57'·66E.
 10° 44'·58N., 122° 57'·67E.
 10° 44'·60N., 122° 57'·72E.
 and

9° 45'·02N., 126° 04'·99E.
 9° 41'·84N., 126° 06'·27E.
 9° 40'·47N., 126° 06'·19E.
 9° 38'·19N., 126° 04'·52E.
 9° 36'·25N., 126° 03'·88E.
 9° 34'·64N., 126° 00'·43E.
 9° 32'·88N., 125° 59'·28E.
 9° 32'·13N., 125° 57'·61E.
 9° 32'·10N., 125° 56'·40E.
 9° 32'·58N., 125° 55'·07E.
 9° 32'·68N., 125° 53'·89E.
 9° 31'·80N., 125° 52'·37E.
 9° 31'·20N., 125° 52'·03E.

2. Mariners are advised to navigate with caution in the area.

3. Charts will be updated when works are complete.

2465(P)/24 PHILIPPINE ISLANDS - Submarine cables. (continued)

- * **NOTE:** Content of Notice unchanged, re-issued to remove Charts 3484, 4417, 4420, 4475 and 4497.
- *Former Notice 106(P)/23 is cancelled.
(WGS84 DATUM)

Charts affected — 2391 — 3809 — 4416 — 4479 — 4480

2488(P)/24 BRUNEI - Works. Buoyage.

Source: Brunei Notice 22/24

- *Dredging and reclamation works are taking place in the areas bounded by the following positions:

4° 59'·87N., 115° 07'·97E.

4° 59'·80N., 115° 08'·17E.

4° 59'·93N., 115° 08'·43E.

5° 00'·31N., 115° 08'·86E.

5° 01'·48N., 115° 09'·66E.

5° 02'·25N., 115° 09'·58E.

5° 02'·27N., 115° 08'·61E.

5° 01'·57N., 115° 08'·61E.

5° 01'·32N., 115° 08'·27E.

5° 01'·33N., 115° 04'·52E.

5° 01'·15N., 115° 04'·59E.

and

4° 59'·57N., 115° 05'·16E.

4° 58'·97N., 115° 05'·17E.

4° 58'·95N., 115° 06'·99E.

4° 59'·56N., 115° 06'·99E.

- Lit special buoys have been established around the limits of the restricted area.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- *Former Notice 2425(P)/23 is cancelled.
- *Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1844 — 2134

3103(T)/24 INDONESIA - Banda Sea - Depths.

Source: ENC ID4162R5

- Depths less than charted have been reported to exist in the following positions:

Depth Position

7m 5° 31'·13S., 132° 40'·92E.

4·3m 5° 33'·78S., 132° 42'·67E.

6·9m 5° 33'·59S., 132° 43'·97E.

3·1m 5° 33'·12S., 132° 45'·24E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2791

4329(T)/24 PHILIPPINE ISLANDS - Cebu - Buoyage.

Source: NAMRIA NavPhil 345/23

- The following light-buoys are reported unlit:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl(2)R.5s</i>	<i>No 6</i>	Starboard Lateral	10° 20'·64N., 123° 59'·48E.
<i>Fl(2)R.5s</i>		Starboard Lateral	10° 14'·11N., 123° 53'·40E.

4329(T)/24 PHILIPPINE ISLANDS - Cebu - Buoyage. (continued)

2. The following light-buoys have been temporarily removed:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl(2)G.5s</i>	<i>No 3</i>	Port Lateral	10° 20'·65N., 124° 00'·17E.
<i>Fl(2)5s</i>		Isolated Danger Mark	10° 18'·650N., 123° 55'·920E.
<i>Fl(2)5s</i>		Isolated Danger Mark	10° 14'·44N., 123° 52'·65E.
<i>Fl(2)G.5s</i>		Port Lateral	10° 14'·10N., 123° 53'·03E.

3. The East Cardinal light-buoy, *Q(3)10s*, in position 10° 16'·37N., 123° 53'·15E. is reported missing.

4. Mariners are advised to navigate with caution in the area.

5. Former Notice 2439(T)/22 is cancelled.
(WGS84 DATUM)

Charts affected — 13 — 14 — 4473 — 4477

4419(P)/24 MALAYSIA - Sarawak - Submarine pipeline.

Source: Marine Department, Sarawak Notice 76(T)/24

1. Pipeline laying operations are taking place, joining the following positions:

3° 22'·58N., 113° 03'·95E.
5° 08'·87N., 112° 56'·02E.
5° 18'·67N., 112° 51'·66E.

2. Charts will be updated when works are complete.

3. Mariners are advised to keep 5 nautical miles away from the above location.
(WGS84 DATUM)

Charts affected — 1336 — 2100 — 3483 — 3837 — 3838

4639(P)/24 PHILIPPINE ISLANDS - Submarine cable.

Source: Philippine Notice 4/34/24

1. A submarine cable has been laid between Mactan and Maasin, joining the following positions:

10° 07'·7N., 124° 51'·7E.
10° 06'·6N., 124° 48'·9E.
10° 06'·7N., 124° 45'·6E.
10° 08'·5N., 124° 43'·6E.
10° 15'·7N., 124° 44'·2E.
10° 16'·9N., 124° 44'·0E.
10° 17'·8N., 124° 42'·8E.
10° 17'·9N., 124° 40'·1E.
10° 19'·1N., 124° 37'·2E.
10° 22'·7N., 124° 24'·5E.
10° 23'·4N., 124° 19'·3E.
10° 23'·3N., 124° 14'·4E.
10° 22'·6N., 124° 08'·8E.
10° 20'·5N., 124° 02'·3E.
10° 19'·7N., 124° 02'·2E.

2. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 3809

4755(P)/24 PHILIPPINE ISLANDS - Submarine cables.

Source: DITO Telecommunity Co. Ltd

1. Submarine cable laying operations are taking place, joining the following positions:

10° 40'·97N., 122° 32'·50E.
10° 40'·33N., 122° 34'·23E.
10° 39'·95N., 122° 34'·57E.
10° 39'·49N., 122° 34'·54E.

4755(P)/24 PHILIPPINE ISLANDS - Submarine cables. (continued)

and

10° 39'·96N., 122° 43'·12E.

10° 38'·63N., 122° 49'·71E.

10° 37'·58N., 122° 50'·98E.

10° 36'·08N., 122° 54'·36E.

and

12° 02'·18N., 123° 11'·51E.

12° 00'·74N., 123° 09'·52E.

11° 56'·01N., 123° 05'·26E.

11° 54'·05N., 123° 04'·84E.

11° 48'·92N., 123° 04'·98E.

11° 46'·81N., 123° 05'·90E.

11° 34'·87N., 123° 05'·82E.

11° 33'·37N., 123° 06'·76E.

and

12° 35'·31N., 124° 05'·76E.

12° 35'·10N., 124° 06'·25E.

12° 35'·57N., 124° 07'·88E.

12° 32'·38N., 124° 10'·10E.

12° 29'·21N., 124° 08'·15E.

12° 28'·42N., 124° 06'·70E.

12° 26'·85N., 124° 05'·30E.

12° 26'·23N., 124° 01'·78E.

12° 24'·66N., 123° 59'·17E.

12° 20'·33N., 123° 55'·26E.

12° 18'·06N., 123° 51'·23E.

12° 16'·86N., 123° 50'·00E.

12° 15'·90N., 123° 47'·57E.

12° 17'·42N., 123° 45'·68E.

12° 17'·10N., 123° 43'·42E.

2. Mariners are advised to navigate with caution in the area.

3. Charts will be updated when full details are available.

(WGS84 DATUM)

Charts affected — 2391 — 3484 — 3809 — 4413 — 4416 — 4417 — 4478 — 4479 — 4480 — 4485 — 4486 — 4487**4831(P)/24 BRUNEI - Dredged area. Works. Buoyage.**

Source: Brunei Notice 66/24 (T)

1. Offshore construction and dredging works are taking place in an area bounded by the following positions:

5° 00'·32N., 115° 04'·99E.

5° 00'·31N., 115° 04'·94E.

5° 00'·31N., 115° 04'·61E.

5° 00'·54N., 115° 04'·31E.

5° 00'·75N., 115° 04'·30E.

5° 00'·71N., 115° 04'·53E.

2. Lit special marker buoys have been established around the limits of the area.

3. Mariners are advised to navigate with caution in the area.

4. Charts will be updated when the works are complete.

(WGS84 DATUM)

Chart affected — 2134**4931(T)/24 MALAYSIA - Sabah - Buoyage.**

Source: Marine Department, Sabah Notice 29(T)/24

1. Marine buoys have been temporarily established in the following positions:

6° 36'·40N., 116° 07'·50E.

6° 40'·70N., 116° 12'·27E.

6° 45'·15N., 116° 13'·74E.

4931(T)/24 MALAYSIA - Sabah - Buoyage. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 967 — 1338 — 2112 — 3728

5104(P)/24 PHILIPPINE ISLANDS - Works. Submarine cables.

Source: NAMIRA NAVPHIL 158/24

- A submarine cable is being laid, joining the following positions:

21° 40'·0N., 126° 27'·7E.
 20° 54'·8N., 126° 11'·9E.
 19° 33'·3N., 126° 12'·2E.
 16° 08'·3N., 125° 43'·6E.
 11° 52'·6N., 127° 04'·2E.
 7° 34'·9N., 128° 05'·0E.
 6° 58'·1N., 127° 52'·3E.
 5° 59'·9N., 126° 23'·1E.
 5° 38'·7N., 126° 05'·4E.
 5° 14'·0N., 125° 28'·2E.
 5° 03'·5N., 124° 21'·6E.
 4° 47'·9N., 123° 55'·4E.
 4° 50'·3N., 123° 19'·2E.
 4° 09'·7N., 121° 05'·9E.
 3° 29'·6N., 120° 32'·6E.
 2° 22'·0N., 120° 16'·3E.
 1° 22'·7N., 119° 37'·1E.
 0° 45'·0N., 119° 24'·9E.
 and
 15° 45'·6N., 121° 34'·1E.
 15° 46'·8N., 121° 41'·9E.
 15° 36'·9N., 121° 59'·2E.
 15° 33'·9N., 122° 24'·6E.
 15° 36'·6N., 122° 45'·9E.

15° 59'·1N., 123° 35'·9E.
 16° 14'·5N., 125° 18'·1E.
 16° 08'·3N., 125° 43'·6E.
 and
 6° 44'·31N., 125° 22'·91E.
 6° 41'·35N., 125° 24'·74E.
 6° 38'·93N., 125° 34'·18E.
 6° 31'·06N., 125° 40'·67E.
 6° 28'·59N., 125° 56'·48E.
 6° 13'·24N., 126° 01'·21E.
 6° 07'·48N., 126° 05'·80E.
 6° 07'·70N., 126° 11'·36E.
 6° 11'·31N., 126° 17'·74E.
 6° 15'·56N., 126° 34'·06E.
 6° 13'·90N., 126° 37'·24E.
 6° 09'·32N., 126° 37'·46E.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 2471 — 2894 — 2948 — 2951 — 2957 — 3483 — 3484 — 4412 — 4417 — 4418 — 4419 — 4420 — 4469 — 4494 — 4495 — 4507 — 4508 — 4509

5152(P)/24 PHILIPPINE ISLANDS - Mindanao - Traffic separation schemes. Works. Bridge.

Source: Philippines Notice 3/21/24, NAMIRA NAVPHIL 210/24

- Two new traffic separation schemes have been established in the Davao Gulf.
- Northern Approaches to Davao Port:
 - A separation zone has been established, bounded by the following positions:

5152(P)/24 PHILIPPINE ISLANDS - Mindanao - Traffic separation schemes. Works. Bridge. (continued)

7° 13'·72N., 125° 41'·92E.

7° 13'·53N., 125° 42'·00E.

7° 14'·47N., 125° 46'·45E.

7° 13'·80N., 125° 47'·63E.

7° 10'·00N., 125° 49'·50E.

7° 10'·00N., 125° 49'·77E.

7° 13'·97N., 125° 47'·80E.

7° 14'·70N., 125° 46'·52E.

b. A traffic lane for inbound traffic has been established between the separation zone in 2a. above and a line joining the following positions:

7° 14'·40N., 125° 41'·57E.

7° 15'·47N., 125° 46'·72E.

7° 14'·58N., 125° 48'·35E.

7° 10'·00N., 125° 50'·60E.

c. A traffic lane for outbound traffic has been established between the separation zone in 2a. above and a line joining the following positions:

7° 10'·00N., 125° 48'·67E.

7° 13'·20N., 125° 47'·08E.

7° 13'·67N., 125° 46'·25E.

7° 12'·85N., 125° 42'·33E.

3. Davao Port:

a. A separation zone has been established, joining the following positions:

7° 12'·30N., 125° 40'·95E.

7° 10'·27N., 125° 40'·17E.

7° 07'·73N., 125° 40'·18E.

7° 06'·62N., 125° 39'·68E.

7° 01'·00N., 125° 38'·20E.

b. A traffic lane for northbound traffic has been established between the separation zone in 3a. above and a line joining the following positions:

7° 12'·20N., 125° 41'·10E.

7° 10'·20N., 125° 40'·42E.

7° 07'·73N., 125° 40'·33E.

7° 06'·62N., 125° 39'·82E.

7° 01'·00N., 125° 38'·50E.

c. A traffic lane for southbound traffic has been established between the separation zone in 3a. above and a line joining the following positions:

7° 01'·00N., 125° 37'·90E.

7° 06'·62N., 125° 39'·52E.

7° 07'·83N., 125° 40'·03E.

7° 10'·33N., 125° 39'·92E.

7° 12'·40N., 125° 40'·80E.

4. *Bridge construction works are taking place within an area bounded by the following positions:

7° 06'·33N., 125° 39'·07E.

7° 06'·10N., 125° 39'·82E.

and

7° 06'·07N., 125° 39'·02E.

7° 05'·84N., 125° 39'·85E.

5. *Mariners are advised to navigate with caution in the area.

6. Charts will be updated when full details are available.

7. *Former Notice 1998(P)/24 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 4419 — 4420 — 4494

5323(P)/24 PHILIPPINE ISLANDS - Submarine cables.

Source: NAMRIA NAVPHIL 202/22 and UKHO

1. Submarine cables have been laid, joining the following positions:

10° 32'·2N., 124° 10'·8E.
10° 24'·9N., 124° 06'·9E.
10° 20'·4N., 124° 01'·9E.
10° 20'·0N., 124° 02'·1E.

2. and

10° 22'·2N., 123° 37'·1E.
10° 29'·6N., 123° 27'·3E.
10° 29'·2N., 123° 26'·7E.
10° 29'·4N., 123° 25'·3E.

3. and

10° 14'·4N., 123° 49'·3E.
10° 13'·4N., 123° 49'·7E.
10° 12'·5N., 123° 49'·4E.
10° 09'·2N., 123° 50'·2E.
9° 49'·0N., 123° 42'·2E.
9° 46'·8N., 123° 42'·1E.
9° 43'·0N., 123° 43'·9E.
9° 42'·8N., 123° 46'·6E.
9° 40'·8N., 123° 50'·5E.
9° 41'·1N., 123° 51'·2E.

4. and

9° 37'·2N., 123° 55'·4E.
9° 34'·0N., 123° 54'·3E.
9° 33'·0N., 123° 54'·9E.
9° 32'·2N., 123° 56'·0E.
9° 29'·3N., 123° 58'·6E.
9° 23'·7N., 123° 59'·8E.
9° 03'·3N., 124° 15'·7E.
8° 47'·3N., 124° 35'·5E.
8° 34'·4N., 124° 40'·2E.
8° 32'·5N., 124° 40'·1E.
8° 30'·6N., 124° 39'·0E.

5. and

8° 34'·8N., 123° 20'·1E.
8° 35'·1N., 123° 19'·7E.
8° 39'·0N., 123° 20'·1E.
8° 44'·8N., 123° 21'·7E.
8° 45'·6N., 123° 22'·3E.
8° 43'·6N., 123° 49'·2E.
8° 39'·1N., 124° 19'·1E.
8° 38'·9N., 124° 27'·2E.
8° 38'·3N., 124° 31'·5E.
8° 31'·2N., 124° 39'·2E.
8° 30'·6N., 124° 39'·0E.

6. and

8° 34'·8N., 123° 20'·1E.
8° 35'·1N., 123° 19'·5E.
8° 41'·2N., 123° 19'·8E.
8° 45'·0N., 123° 19'·0E.
8° 49'·4N., 123° 15'·0E.
8° 52'·3N., 123° 14'·2E.
8° 57'·7N., 123° 14'·5E.
9° 03'·3N., 123° 13'·9E.
9° 06'·1N., 123° 12'·2E.

5323(P)/24 PHILIPPINE ISLANDS - Submarine cables. (continued)

7. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3809 — 3811

5467(T)/24 BRUNEI - Works. Scientific instruments.

Source: Maritime and Port Authority of Brunei Darussalam

1. *Water quality and coral survey work are being conducted in the following positions:

5° 02'·21N., 115° 05'·89E.

5° 02'·03N., 115° 05'·90E.

5° 01'·87N., 115° 06'·20E.

5° 02'·43N., 115° 07'·55E.

5° 02'·21N., 115° 08'·12E.

5° 02'·02N., 115° 08'·12E.

5° 02'·35N., 115° 10'·96E.

5° 01'·12N., 115° 09'·62E.

4° 59'·91N., 115° 08'·34E.

4° 59'·42N., 115° 06'·55E.

4° 58'·81N., 115° 04'·41E.

* 4° 59'·43N., 115° 07'·48E.

* 4° 59'·46N., 115° 07'·56E.

* 4° 59'·67N., 115° 07'·98E.

* 4° 59'·76N., 115° 08'·07E.

2. The presence of scientific equipment on the seabed may reduce the depth of water available at these locations.
3. When a survey vessel is on station, mariners should maintain a safe distance of at least 20m and when diving operations are conducted a distance of at least 92m must be maintained.
4. *Former Notice 497(T)/23 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1844 — 2134

179(T)/25 PHILIPPINE ISLANDS - Luzon - Wreck. Restricted area.

Source: Philippine Notice 10/110(T)/24

1. An exclusion zone, with a 4NM radius, has been established around a wreck that exists in position
14° 30'·3N., 120° 40'·5E.
2. Vessels should not navigate or remain within the exclusion zone, unless permitted by the Philippine Coastguard.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4411 — 4413 — 4414 — 4491

221(T)/25 INDONESIA - Papua - Depth.

Source: ENC ID400191, ENC ID5225R1, Indonesian Chart 225

1. Shoal depths have been reported in the vicinity of position: 1° 13'·2S., 136° 02'·5E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3924

277(T)/25 MALAYSIA - Sarawak - Single Point Mooring.

Source: Marine Department, Sarawak Notice 188(T)/24

1. A Single Point Mooring has been deployed, until further notice, in position 5° 09'·2N., 112° 54'·6E.
(WGS84 DATUM)

Chart affected — 3483

316(P)/25 PHILIPPINE ISLANDS - Sulu Sea - Depths.

Source: Philippine Charts 1546 and 5009

- Depths less than charted exist within The Sulu Sea between Tubbataha Reefs and Cuyo Islands. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4 3/4fm	9° 57'·2N., 119° 13'·3E.
301fm	10° 12'·6N., 120° 08'·6E.
417fm	9° 36'·7N., 119° 44'·8E.
371fm	9° 38'·9N., 120° 34'·8E.
417fm	9° 07'·9N., 120° 26'·7E.
123fm	10° 16'·9N., 122° 27'·5E.
144fm	10° 37'·3N., 122° 20'·8E.
374fm	10° 15'·5N., 121° 57'·3E.
407fm	10° 12'·3N., 121° 56'·4E.
217fm	9° 24'·1N., 120° 51'·5E.
323fm	9° 22'·2N., 120° 58'·3E.

- These details will be included in a New Chart to be published during 2025.
(WGS84 DATUM)

Charts affected — 3809 — 3811**499(T)/25 BRUNEI - Anchorage area.**

Source: Brunei Notice 87(T)/24

- * A temporary anchorage area has been established, bounded by the following positions:

5° 00'·43N., 115° 04'·09E.
 5° 00'·43N., 115° 04'·14E.
 5° 00'·36N., 115° 04'·14E.
 5° 00'·36N., 115° 04'·09E.

- Mariners are advised to navigate with caution in the area.
- *Former Notice 1553(T)/23 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 2134**514(P)/25 INDONESIA - Timor - Works. Submarine cable.**

Source: ENC ID300323

- Submarine cable laying operations are taking place in connection with Palapa Ring cable system, joining the following positions:

10° 08'·01S., 123° 39'·63E.
 10° 06'·95S., 123° 39'·05E.
 10° 03'·93S., 123° 34'·42E.
 10° 04'·23S., 123° 33'·51E.
 10° 03'·93S., 123° 32'·07E.
 10° 03'·03S., 123° 30'·01E.
 10° 00'·52S., 123° 20'·01E.
 10° 00'·43S., 123° 16'·71E.
 10° 01'·14S., 123° 13'·91E.
 10° 02'·60S., 123° 12'·07E.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 2472 — 2874 — 2903 — 2908 — 3296

693(T)/25 INDONESIA - Kalimantan - Anchorage areas.

Source: Indonesian Notice 50/495(T)/24

1. Circular anchorages, radius 450m, have been established centred on the following positions:

1° 27'·60S., 116° 49'·13E.

1° 28'·60S., 116° 49'·13E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2639 — 2893**1087(T)/25 MALAYSIA - Sarawak - Wreck.**

Source: Marine Department, Sarawak Notice 12(T)/25

1. A wreck, depth unknown has been reported in position 4° 58'·89N., 115° 15'·12E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1844**1337(T)/25 BRUNEI - Wreck.**

Source: Brunei Notice 11(T)/25

1. A partially submerged wreck has been reported in position 5° 01'·66N., 115° 04'·57E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2134**1517(T)/25 BRUNEI - Scientific instruments. Buoy.**

Source: Maritime and Port Authority of Brunei Darussalam

1. Scientific instrumentation, marked by a special light-buoy, has been established in the following position
5° 00'·74N., 114° 04'·46E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2109**1563(P)/25 PHILIPPINE ISLANDS - Palawan - Buoyage.**

Source: NAMRIA NAVPHIL 18/25

1. Light buoys have been established in Puerto Princesa Harbor in the following positions:

<i>Buoy Type</i>	<i>Position</i>
Port Hand	9° 42'·30N., 118° 45'·68E.
Starboard Hand	9° 42'·77N., 118° 45'·75E.
Port Hand	9° 42'·64N., 118° 44'·86E.
Starboard Hand	9° 43'·08N., 118° 44'·97E.
Port Hand	9° 42'·91N., 118° 44'·20E.
Starboard Hand	9° 43'·38N., 118° 44'·26E.
North Cardinal	9° 44'·37N., 118° 43'·20E.
North Cardinal	9° 44'·58N., 118° 43'·26E.
North Cardinal	9° 44'·79N., 118° 43'·81E.

2. Chart 2914 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 2914**2006(P)/25 MALAYSIA - Sabah - Port developments. Jetty. Depths. Light-beacons. Harbour limit.**

Source: Malaysian Chart 8447

1. Port developments have taken place within Kunak. The most significant are as follows.
2. A new jetty has been established in the vicinity of position 4° 41'·94N., 118° 15'·10E.

2006(P)/25 MALAYSIA - Sabah - Port developments. Jetty. Depths. Light-beacons. Harbour limit. (continued)

- Land reclamation has taken place in the vicinity of position 4° 41'·71N., 118° 14'·94E.
- Recent survey information has shown that numerous depths less than charted exist in the approaches to Kunak. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
6·3fm	4° 44'·51N., 118° 13'·84E.
9·5fm	4° 44'·35N., 118° 15'·78E.
1·3fm	4° 43'·19N., 118° 19'·02E.
5·5fm	4° 41'·85N., 118° 18'·49E.
4·4fm	4° 42'·84N., 118° 14'·87E.

- Light-beacons have been established in the following positions:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
Fl.G.2s	G5	4° 42'·93N., 118° 15'·96E.
Fl.G.2s	G4	4° 42'·49N., 118° 15'·50E.

- The limit of Kunak Harbour has been amended and now joins the following positions:

4° 45'·05N., 118° 19'·85E.
4° 40'·25N., 118° 19'·85E.

- Mariners are advised to navigate with caution in the area.
(UNDETERMINED DATUM)

Chart affected — 1686

2191(P)/25 MALAYSIA - Sarawak - Submarine pipeline.

Source: Marine Department, Sarawak Notice 31/2025

- Pipeline laying operations are taking place, joining the following positions:

3° 35'·06N., 113° 20'·18E.
3° 35'·69N., 113° 19'·44E.
3° 38'·82N., 113° 16'·19E.
3° 38'·13N., 113° 11'·42E.
3° 30'·90N., 113° 04'·41E.
3° 30'·33N., 113° 04'·05E.
3° 27'·00N., 113° 02'·82E.
3° 19'·96N., 113° 04'·77E.
3° 18'·12N., 113° 05'·96E.

- Charts will be updated when works are complete.
- Mariners are advised to keep 5 nautical miles away from the above location.
(WGS84 DATUM)

Charts affected — 1748 — 2100 — 3837

2319(P)/25 PHILIPPINE ISLANDS - Restricted areas.

Source: New Editions of GB Charts 4473, 4477, 4478, 4413, 4414, 4416, Philippine Charts 1537, 1542, 5003, 5004, Philippine Notices 4/33/24, 6/53/24, 7/60/24, 8/84/24, 7/59/24 and NAMRIA

- Marine Protected Areas in Philippine waters have been designated in the following areas. Anchoring and Fishing are prohibited in these areas:

Alibijaban Protected Area
13° 22'·38N., 122° 43'·65E.
13° 18'·86N., 122° 43'·70E.
13° 18'·84N., 122° 42'·57E.
13° 22'·36N., 122° 42'·66E.

2319(P)/25 PHILIPPINE ISLANDS - Restricted areas. (continued)

2. and

Ticao Burias Pass Protected Seascope

13° 11'·4N., 122° 45'·7E.
13° 18'·7N., 123° 14'·3E.
12° 32'·2N., 124° 08'·3E.
12° 17'·2N., 123° 49'·1E.
12° 40'·1N., 123° 36'·1E.
12° 41'·7N., 123° 23'·3E.
12° 51'·4N., 123° 16'·4E.
13° 06'·8N., 122° 55'·9E.
13° 06'·5N., 122° 49'·6E.
13° 09'·2N., 122° 45'·0E.

3. and

Tañon Strait Protected Seascope

11° 17'·9N., 123° 44'·6E.
11° 16'·3N., 123° 59'·9E.
10° 44'·1N., 123° 53'·2E.
9° 58'·2N., 123° 24'·2E.
9° 24'·9N., 123° 20'·1E.
9° 21'·7N., 123° 17'·5E.
9° 32'·3N., 123° 06'·2E.
9° 50'·5N., 123° 07'·9E.
10° 54'·3N., 123° 30'·9E.
10° 56'·6N., 123° 36'·9E.

4. and

Guiuan Marine Resource Protected Landscape and Seascope

10° 56'·85N., 125° 50'·53E.
10° 44'·81N., 125° 58'·90E.
10° 42'·06N., 125° 48'·73E.
10° 45'·49N., 125° 41'·90E.
10° 49'·29N., 125° 44'·82E.
10° 54'·38N., 125° 44'·60E.
11° 00'·60N., 125° 34'·54E.
11° 04'·94N., 125° 40'·53E.

5. and

Cuatro Islas Protected Landscape and Seascope

10° 27'·3N., 124° 39'·4E.
10° 32'·8N., 124° 35'·1E.
10° 35'·4N., 124° 41'·0E.
10° 29'·7N., 124° 42'·9E.

6. and

Talibon Group of Islands Protected Landscape and Seascope

10° 11'·60N., 124° 15'·71E.
10° 16'·23N., 124° 19'·80E.
10° 15'·40N., 124° 21'·10E.
10° 13'·00N., 124° 22'·06E.
10° 12'·15N., 124° 21'·86E.
10° 10'·33N., 124° 18'·08E.
10° 10'·65N., 124° 16'·31E.

2319(P)/25 PHILIPPINE ISLANDS - Restricted areas. (continued)

7. and

Siargao Island Protected Landscape and Seascape

9° 32'·5N., 126° 09'·9E.
 9° 32'·0N., 126° 00'·5E.
 9° 32'·8N., 125° 54'·3E.
 9° 39'·5N., 125° 50'·4E.
 9° 48'·0N., 125° 53'·4E.
 9° 55'·8N., 125° 46'·5E.
 10° 02'·6N., 125° 56'·2E.
 10° 09'·4N., 126° 04'·1E.
 10° 06'·3N., 126° 10'·3E.
 9° 52'·3N., 126° 18'·7E.
 9° 38'·7N., 126° 19'·9E.

8. and

Selinog Island Protected Landscape and Seascape

8° 52'·1N., 123° 23'·1E.
 8° 53'·1N., 123° 25'·8E.
 8° 50'·4N., 123° 27'·2E.
 8° 49'·5N., 123° 24'·2E.

9. and

Aliguay Island Protected Landscape and Seascape

8° 46'·1N., 123° 11'·3E.
 8° 46'·8N., 123° 14'·1E.
 8° 44'·1N., 123° 15'·5E.
 8° 43'·1N., 123° 12'·5E.

10. and

**Davao Protected Landscape and Seascape*

* 7° 14'·09N., 125° 50'·92E.
 * 7° 13'·19N., 125° 48'·47E.
 * 7° 15'·64N., 125° 46'·12E.
 * 7° 17'·04N., 125° 46'·78E.
 * 7° 20'·24N., 125° 49'·30E.
 * 7° 20'·86N., 125° 50'·37E.
 * 7° 20'·46N., 125° 51'·32E.

11. and

**Turtle Island Wildlife Sanctuary*

* 6° 00'·03N., 118° 20'·14E.
 * 6° 00'·10N., 118° 37'·74E.
 * 6° 09'·53N., 118° 37'·70E.
 * 6° 13'·92N., 118° 36'·45E.
 * 6° 20'·76N., 118° 27'·40E.
 * 6° 22'·17N., 118° 23'·10E.
 * 6° 22'·82N., 118° 13'·44E.
 * 6° 28'·35N., 118° 05'·83E.
 * 6° 28'·28N., 117° 58'·04E.
 * 6° 16'·90N., 117° 58'·15E.

12. A Wilderness Area has been established, bounded by the following positions:

9° 56'·17N., 125° 37'·49E.
 9° 54'·55N., 125° 37'·31E.
 9° 56'·60N., 125° 32'·50E.
 9° 59'·33N., 125° 31'·64E.
 9° 59'·54N., 125° 32'·25E.
 9° 56'·14N., 125° 36'·09E.

13. *These changes will be included in New Editions of Charts 3484, 3489, 4417, 4476, 4479, 4486, 4488, 4494 and 4497.

14. Charts 3809 and 3811 will be withdrawn in 2025.

15. *Charts 967, 4419, 4420, 4485 and 4487 will be updated by Notice to Mariners.

16. *Charts 1649, 3483, 4418 and 4449 will be updated when full details are available..

2319(P)/25 PHILIPPINE ISLANDS - Restricted areas. (continued)

17. *Former Notice 5841(P)/24 is cancelled

*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1649 — 3483 — 3484 — 3809 — 3811 — 4417 — 4418 — 4449 — 4476 — 4479 — 4486 — 4494 — 4497

2521(P)/25 PHILIPPINE ISLANDS - Submarine cable.

Source: NAMRIA NAVPHIL 96/25

1. Submarine cable laying operations are taking place, joining the following positions:

13° 36'·06N., 124° 05'·32E.
13° 35'·06N., 124° 03'·51E.
13° 34'·97N., 123° 59'·37E.
13° 35'·54N., 123° 57'·07E.
13° 37'·29N., 123° 54'·89E.
13° 40'·68N., 123° 52'·66E.
13° 44'·18N., 123° 52'·10E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3484 — 4413 — 4417 — 4486

2740(P)/25 PHILIPPINE ISLANDS - Cebu - Traffic separation schemes. Precautionary area.

Source: Philippine Notice 4/11(P)/25

1. Cebu Harbour traffic separation scheme is reported to have been significantly amended. New reported traffic separation schemes for Cebu Harbour have been established.

2. Northern entrance to Cebu Harbour:

a. A separation zone has reportedly been established joining the following positions:

10° 19'·150N., 123° 57'·267E.
10° 19'·250N., 123° 57'·510E.
10° 20'·273N., 123° 59'·101E.
10° 21'·033N., 124° 00'·633E.

b. A traffic lane for outbound traffic has reportedly been established, between the separation zone in 2a. above and a line joining the following positions:

10° 19'·117N., 123° 57'·276E.
10° 19'·225N., 123° 57'·529E.
10° 20'·232N., 123° 59'·131E.
10° 20'·967N., 124° 00'·650E.

c. A traffic lane for inbound traffic has reportedly been established, between the separation zone in 2a. above and a line joining the following positions:

10° 19'·172N., 123° 57'·252E.
10° 19'·275N., 123° 57'·494E.
10° 20'·311N., 123° 59'·072E.
10° 21'·083N., 124° 00'·617E.

3. Southern entrance to Cebu Harbour:

a. A separation zone has reportedly been established, joining the following positions:

10° 17'·300N., 123° 54'·231E.
10° 17'·188N., 123° 53'·919E.
10° 16'·608N., 123° 53'·455E.
10° 14'·115N., 123° 53'·215E.

b. A traffic lane for outbound traffic has reportedly been established, between the separation zone in 3a. above and a line joining the following positions:

10° 17'·335N., 123° 54'·215E.
10° 17'·230N., 123° 53'·894E.
10° 16'·718N., 123° 53'·358E.
10° 14'·113N., 123° 53'·038E.

2740(P)/25 PHILIPPINE ISLANDS - Cebu - Traffic separation schemes. Precautionary area. (continued)

c. A traffic lane for inbound traffic has reportedly been established, between the separation zone in 3a. above and a line joining the following positions:

10° 17'·262N., 123° 54'·245E.
10° 17'·150N., 123° 53'·955E.
10° 16'·217N., 123° 53'·550E.
10° 14'·129N., 123° 53'·402E.

4. A precautionary area has been established bounded by the following positions:

10° 17'·106N., 123° 54'·414E.
10° 17'·407N., 123° 54'·248E.
10° 17'·434N., 123° 54'·479E.
10° 17'·964N., 123° 54'·750E.
10° 19'·246N., 123° 56'·467E.
10° 19'·072N., 123° 56'·886E.
10° 19'·198N., 123° 57'·237E.
10° 19'·080N., 123° 57'·288E.

5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

6. Charts 13 and 14 will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 13 — 14**2923(P)/25 PHILIPPINE ISLANDS - Luzon - Submarine cables. Works.**

Source: NAMRIA NAVPHIL 97/25

1. Submarine cable laying operations are taking place, joining the following positions:

18° 36'·40N., 121° 04'·03E.
18° 39'·29N., 121° 05'·49E.
18° 40'·70N., 121° 07'·62E.
18° 41'·04N., 121° 10'·65E.
18° 40'·64N., 121° 15'·32E.
18° 39'·94N., 121° 18'·10E.
18° 37'·75N., 121° 21'·59E.
18° 31'·10N., 121° 28'·80E.
18° 28'·80N., 121° 30'·25E.
18° 25'·05N., 121° 30'·59E.

2. and

17° 57'·6N., 120° 28'·5E.
17° 59'·1N., 120° 26'·7E.
18° 06'·6N., 120° 22'·3E.
18° 09'·4N., 120° 21'·5E.
18° 10'·9N., 120° 22'·2E.
18° 14'·7N., 120° 22'·0E.
18° 24'·4N., 120° 23'·7E.
18° 33'·6N., 120° 28'·6E.
18° 38'·1N., 120° 33'·3E.
18° 40'·6N., 120° 39'·5E.
18° 42'·3N., 120° 41'·5E.
18° 43'·0N., 120° 43'·2E.
18° 42'·8N., 120° 51'·8E.
18° 42'·0N., 120° 55'·2E.
18° 42'·2N., 120° 59'·6E.
18° 41'·5N., 121° 01'·4E.
18° 39'·2N., 121° 04'·5E.
18° 36'·4N., 121° 04'·0E.

2923(P)/25

PHILIPPINE ISLANDS - Luzon - Submarine cables. Works. (continued)

3. and

17° 57'·6N., 120° 28'·5E.
17° 56'·4N., 120° 20'·6E.
17° 54'·4N., 120° 17'·2E.
17° 49'·7N., 120° 13'·7E.
17° 40'·5N., 120° 11'·1E.
17° 37'·8N., 120° 11'·4E.
17° 36'·0N., 120° 12'·4E.
17° 33'·0N., 120° 17'·5E.
17° 30'·7N., 120° 20'·0E.
17° 29'·6N., 120° 22'·6E.
17° 27'·8N., 120° 24'·2E.
17° 27'·0N., 120° 24'·2E.
17° 26'·2N., 120° 24'·9E.
17° 23'·5N., 120° 24'·1E.
17° 21'·4N., 120° 24'·8E.
17° 17'·3N., 120° 22'·8E.
17° 13'·9N., 120° 22'·3E.
17° 08'·0N., 120° 23'·4E.
17° 05'·6N., 120° 23'·3E.
17° 00'·7N., 120° 21'·0E.
16° 59'·5N., 120° 21'·0E.
16° 57'·5N., 120° 20'·2E.
16° 55'·6N., 120° 20'·1E.
16° 53'·5N., 120° 20'·7E.
16° 51'·6N., 120° 22'·7E.

4. and

15° 53'·1N., 119° 53'·6E.
15° 54'·2N., 119° 50'·8E.
15° 53'·8N., 119° 47'·7E.
15° 55'·0N., 119° 40'·4E.
15° 55'·8N., 119° 38'·7E.
15° 57'·4N., 119° 37'·5E.
15° 59'·8N., 119° 36'·1E.
16° 02'·4N., 119° 35'·8E.
16° 11'·4N., 119° 36'·8E.
16° 20'·1N., 119° 36'·5E.
16° 21'·5N., 119° 37'·2E.
16° 22'·5N., 119° 38'·1E.
16° 24'·8N., 119° 39'·0E.
16° 26'·8N., 119° 41'·4E.
16° 28'·2N., 119° 44'·0E.
16° 30'·6N., 119° 45'·9E.
16° 45'·1N., 120° 03'·0E.
16° 47'·5N., 120° 04'·7E.
16° 48'·2N., 120° 05'·6E.
16° 48'·5N., 120° 06'·7E.
16° 50'·7N., 120° 10'·3E.
16° 51'·3N., 120° 14'·2E.
16° 52'·2N., 120° 16'·8E.
16° 52'·3N., 120° 20'·1E.
16° 51'·6N., 120° 22'·7E.

2923(P)/25 PHILIPPINE ISLANDS - Luzon - Submarine cables. Works. (continued)

5. and

15° 53'·07N., 119° 53'·56E.
15° 52'·35N., 119° 52'·73E.
15° 52'·80N., 119° 49'·85E.
15° 52'·51N., 119° 48'·62E.
15° 50'·51N., 119° 45'·64E.
15° 46'·46N., 119° 41'·22E.
15° 43'·15N., 119° 40'·38E.
15° 30'·01N., 119° 41'·98E.
15° 24'·92N., 119° 43'·56E.
15° 18'·78N., 119° 49'·69E.
15° 17'·54N., 119° 56'·11E.
15° 16'·24N., 119° 58'·14E.
15° 14'·69N., 119° 58'·67E.
15° 12'·36N., 119° 57'·29E.
15° 10'·17N., 119° 57'·12E.
15° 07'·24N., 119° 58'·11E.
15° 04'·03N., 120° 01'·61E.
15° 03'·65N., 120° 03'·64E.

6. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3489 — 4410 — 4411 — 4412 — 4425 — 4492**2983(P)/25 INDONESIA - Jawa - Platform. Submarine pipeline. Works.**

Source: Indonesian Notice 19/175(T)/25

1. Platform construction works are taking place in position 6° 15'·88S., 108° 26'·00E.
2. Pipeline laying operations are taking place, joining the following positions:

6° 21'·46S., 108° 23'·14E.
6° 20'·23S., 108° 23'·90E.
6° 16'·77S., 108° 25'·21E.
6° 15'·88S., 108° 26'·00E.

3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1066 — 2797 — 2862 — 3729 — 3730**3128(T)/25 MALAYSIA - Sarawak - Buoy.**

Source: Marine Department, Sarawak Notice 78(T)/25

1. The light-buoy, *Fl.G.4s*, in position 2° 28'·67N., 111° 11'·43E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 163 — 3835 — 3836

3363(P)/25 PHILIPPINE ISLANDS - Luzon - Submarine cables. Works.

Source: UKHO

1. Submarine cable laying operations are taking place, joining the following positions:

16° 51'·6N., 120° 22'·7E.
 16° 53'·0N., 120° 20'·0E.
 16° 53'·8N., 120° 16'·0E.
 16° 53'·1N., 119° 56'·3E.
 16° 55'·3N., 119° 52'·4E.
 16° 59'·0N., 119° 32'·9E.
 16° 59'·8N., 119° 17'·4E.
 17° 04'·1N., 118° 52'·0E.
 16° 55'·7N., 118° 18'·2E.
 16° 59'·0N., 118° 04'·4E.
 16° 59'·5N., 117° 26'·4E.
 16° 54'·2N., 116° 58'·1E.
 17° 11'·9N., 116° 35'·0E.
 17° 11'·1N., 116° 20'·8E.
 17° 00'·8N., 115° 54'·6E.
 16° 55'·1N., 115° 48'·6E.

2. and

16° 32'·6N., 120° 19'·1E.
 16° 31'·1N., 120° 16'·0E.
 16° 35'·7N., 120° 03'·0E.
 16° 35'·4N., 119° 50'·0E.
 16° 34'·2N., 119° 36'·3E.
 16° 28'·6N., 119° 21'·8E.
 16° 27'·8N., 119° 03'·5E.
 16° 33'·6N., 118° 48'·5E.
 16° 43'·9N., 118° 26'·7E.
 16° 40'·2N., 117° 53'·7E.
 16° 29'·9N., 117° 37'·7E.
 16° 24'·3N., 117° 22'·7E.
 16° 20'·1N., 116° 46'·4E.
 16° 08'·7N., 116° 29'·5E.
 16° 06'·9N., 116° 05'·0E.
 15° 58'·2N., 115° 56'·0E.

3. Mariners are advised to navigate with caution in the area.
4. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 3489 — 4411**3392(P)/25 MALAYSIA - Sarawak - Submarine pipeline. Works.**

Source: Marine Department, Sarawak Notices 59/25 and 87/25

1. Pipeline laying operations are taking place, joining the following positions:

* 3° 22'·58N., 113° 03'·95E.
 4° 13'·88N., 112° 58'·30E.
 5° 08'·86N., 112° 55'·99E.

2. Charts will be updated when works are complete.
3. Mariners are advised to keep 5 nautical miles away from the above location.
4. *Former Notice 2632(P)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 1336 — 2100 — 3483 — 3837 — 3838

3897(T)/25 MALAYSIA - Sarawak - Buoy.

Source: Marine Department, Sarawak Notice 88(T)/25

1. The isolated danger light-buoy, *Fl(2)10s*, in position $1^{\circ} 45' \cdot 09\text{N}$., $110^{\circ} 16' \cdot 05\text{E}$., is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3834 — 3835

3915(T)/25 MALAYSIA - Sabah - Buoy.

Source: Marine Department, Sabah Notice 44(T)/25

1. The isolated danger light-buoy, *Fl(2)8s*, in position $5^{\circ} 46' \cdot 48\text{N}$., $118^{\circ} 49' \cdot 64\text{E}$. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4418 — 4449

4053(T)/25 PHILIPPINE ISLANDS - Luzon - Buoyage.

Source: NAMRIA NAVPHIL 148/25 and Philippine Notice 6/19/25

1. The following special purpose light-buoys, *Fl(4)Y.10s*, are reported destroyed:
 $15^{\circ} 50' \cdot 6\text{N}$., $124^{\circ} 16' \cdot 3\text{E}$.
 $15^{\circ} 47' \cdot 5\text{N}$., $124^{\circ} 18' \cdot 5\text{E}$.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 3103(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 4412

4352(T)/25 BRUNEI - Works. Buoyage.

Source: Brunei Notice 41(T)/25

1. Harbour works are taking place in the vicinity of position $5^{\circ} 01' \cdot 30\text{N}$., $115^{\circ} 04' \cdot 09\text{E}$.
2. Special buoys have been established marking the limit of the works area.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2134

4497(P)/25 PHILIPPINE ISLANDS - Depth.

Source: NAMRIA

1. A shoal depth of 16·4m exists in position $12^{\circ} 01' \cdot 07\text{N}$., $120^{\circ} 27' \cdot 37\text{E}$.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 3483 — 3484 — 3489 — 4413 — 4414 — 4482 — 4483

4625(T)/25 MALAYSIA - Sabah - Buoy.

Source: Marine Department, Sabah Notice 45(T)/25

1. The Gem Reef isolated danger light-buoy, *Fl(2)10s*, in position $5^{\circ} 35' \cdot 00\text{N}$., $119^{\circ} 08' \cdot 42\text{E}$. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4448

4653(P)/25 PHILIPPINE ISLANDS - Leyte - Submarine cable.

Source: NAMRIA NAVPHIL 232/25

1. A submarine cable is being laid, joining the following positions:

11° 32'·36N., 124° 17'·65E.

11° 33'·76N., 124° 16'·44E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3484 — 4416 — 4417 — 4477 — 4478**4712(T)/25 MALAYSIA - Sarawak - Spoil ground.**

Source: Marine Department, Sarawak Notice 133(T)/25

1. A spoil ground has been established, within an area bounded by the following positions:

3° 43'·12N., 113° 11'·35E.

3° 44'·04N., 113° 12'·54E.

3° 43'·01N., 113° 13'·33E.

3° 42'·09N., 113° 12'·14E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 3483 — 3837**4887(P)/25 INDONESIA - Kalimantan - Wrecks.**

Source: ENC ID400259

1. Dangerous wrecks on the approaches to Lingkas, have been reported in the following positions:

3° 15'·82N., 117° 36'·06E.

3° 14'·22N., 117° 36'·94E.

3° 14'·23N., 117° 37'·09E.

3° 14'·07N., 117° 37'·46E.

3° 13'·49N., 117° 39'·68E.

3° 14'·11N., 117° 39'·83E.

3° 14'·76N., 117° 51'·77E.

3° 14'·84N., 117° 51'·80E.

3° 14'·16N., 117° 53'·16E.

3° 14'·50N., 117° 53'·57E.

3° 14'·28N., 117° 54'·14E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 1852 — 3483**5034(T)/25 INDONESIA - Timor - Buoy.**

Source: Australian Notice 11/448(T)/25

1. A special light-buoy, *Fl. Y*, exists in position 9° 49'·3S., 130° 16'·2E.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 3032(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 2473

5152(T)/25 BRUNEI - Scientific instruments.

Source: Maritime and Port Authority of Brunei Darussalam

- The installation of scientific equipment at beacons 4E, 7W and 39 have been established in the following positions:

<i>Designation</i>	<i>Position</i>
39	4° 51'·78N., 114° 57'·29E.
4E	5° 02'·99N., 115° 06'·22E.
7W	5° 02'·12N., 115° 05'·43E.

- These are expected to remain in place until May 2028.
- Mariners are advised to give these beacons a wide berth and navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2134**5226(T)/25 MALAYSIA - Sarawak - Buoy.**

Source: Marine Department, Sarawak Notice 154(T)/25

- The starboard-hand lateral light-buoy, *Fl.G.5s No 5*, in position 1° 42'·33N., 110° 33'·04E. is reported off station and unlit.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1822**5526(P)/25 INDONESIA - Kalimantan - Swept areas. Depths. Light-beacons.**

Source: ENC ID50039C

- Wire swept depth areas centred on the following positions have been removed:

<i>Swept Area</i>	<i>Position</i>
12·1m	0° 05'·829N., 117° 29'·020E.
13·2m	0° 05'·700N., 117° 29'·246E.
13·8m	0° 05'·638N., 117° 29'·518E.
13·2m	0° 05'·653N., 117° 30'·080E.
14m	0° 05'·672N., 117° 29'·833E.
14·8m	0° 05'·660N., 117° 30'·748E.

- Depths less than charted exist within Pelabuhan Bontang. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
5·5m	0° 06'·127N., 117° 28'·890E.
9·4m	0° 06'·081N., 117° 28'·796E.
12·2m	0° 05'·865N., 117° 28'·796E.
5·3m	0° 05'·191N., 117° 29'·419E.
12·6m	0° 05'·077N., 117° 29'·316E.
11·4m	0° 05'·797N., 117° 28'·757E.
5·8m	0° 06'·059N., 117° 28'·810E.
10·9m	0° 04'·971N., 117° 29'·109E.
9·9m	0° 05'·058N., 117° 29'·258E.

- The following light-beacons have been moved:

<i>Characteristic</i>	<i>Designation</i>	<i>Former Position</i>	<i>New Position</i>
Fl.G.3s4M	No 29	0° 06'·035N., 117° 28'·997E.	0° 06'·036N., 117° 28'·980E.
Fl.G.3s4M	No 27	0° 05'·913N., 117° 29'·240E.	0° 05'·908N., 117° 29'·217E.

- These changes will be included in the next New Edition of Chart 3051.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3051**5788(T)/25 MALAYSIA - Sarawak - Buoy.**

Source: Marine Department, Sarawak Notice 191(T)/2025

- The light-buoy, *Fl.Y.5s*, in position 4° 36'·26N., 113° 54'·67E. is reported off station.

5788(T)/25 MALAYSIA - Sarawak - Buoy. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1949**5800(T)/25 MALAYSIA - Sarawak - Buoy.**

Source: Marine Department, Sarawak Notice 193(T)/25

1. The Starboard-hand Lateral light-buoy, *Fl.G.5s A*, in position 3° 15'·64N., 113° 00'·03E. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1748 — 2100

(18) AUSTRALIA AND PAPUA NEW GUINEA

3938(T)/16 AUSTRALIA - New South Wales - Obstructions.

Source: Australian Notice 13/709(T)/16

- Obstructions exist in the following positions:
28° 36'·20S., 153° 44'·30E.
28° 36'·95S., 153° 44'·02E.
- Mariners are advised to navigate with caution in the area.
(WGS84 Datum)

Chart affected — Aus 813**3534(P)/17 AUSTRALIA - Queensland - Depths.**

Source: Australian Notice 13/523(P)/17

- Latest survey data indicates depths less than charted may exist within an area bounded by the following positions:
19° 27'·10S., 149° 38'·90E.
19° 39'·20S., 150° 18'·50E.
20° 12'·20S., 150° 18'·50E.
20° 12'·20S., 149° 39'·10E.
- Charts will be updated when further information becomes available.
(WGS84 DATUM)

Charts affected — Aus 821 — Aus 824 — Aus 825**5441(P)/17 AUSTRALIA - Queensland - Depths.**

Source: Australian Notice 21/872(P)/17

- Depths less than charted may exist between Osborne Reef (13° 02'·63S., 143° 37'·58E.) and Clack Reef (14° 04'·00S., 144° 14'·50E.)
- Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — Aus 833 — Aus 834**5635(T)/17 AUSTRALIA - New South Wales - Scientific instruments.**

Source: Australian Notice 22/909(T)/17

- Subsurface scientific instruments have been established in the following positions:

<i>Position</i>	<i>Metres below surface</i>
33° 53'·74S., 151° 17'·30E.	27
33° 53'·91S., 151° 17'·75E.	41
33° 54'·16S., 151° 18'·18E.	58
33° 54'·42S., 151° 18'·60E.	63
33° 54'·69S., 151° 19'·06E.	64
33° 54'·95S., 151° 19'·52E.	64
33° 55'·21S., 151° 19'·94E.	71
33° 55'·46S., 151° 20'·37E.	70
33° 55'·71S., 151° 20'·79E.	80
33° 55'·98S., 151° 21'·25E.	80
33° 56'·24S., 151° 21'·71E.	82
33° 56'·49S., 151° 22'·16E.	87
33° 56'·75S., 151° 22'·59E.	90
33° 57'·06S., 151° 23'·02E.	98
33° 57'·32S., 151° 23'·47E.	119
33° 57'·84S., 151° 24'·32E.	127
34° 01'·16S., 151° 29'·70E.	145
34° 01'·46S., 151° 30'·18E.	149

- Former Notice 715(T)/16 is cancelled.
(WGS84 DATUM)

Chart affected — Aus 808

4723(T)/18 PAPUA NEW GUINEA - Fish traps.

Source: Australian Notice 18/789(T)/18

1. Fish aggregating devices exist within an area bounded by the following positions:

4° 30'·0S., 149° 55'·0E.

4° 40'·0S., 149° 55'·0E.

4° 40'·0S., 150° 45'·0E.

4° 30'·0S., 150° 45'·0E.

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Chart affected — 4622**1191(P)/19 AUSTRALIA - Queensland - Depths.**

Source: Australian Notice 3/118(P)/19

1. Latest survey data shows shoaler depths than charted may exist in areas bounded by the following positions:

22° 11'·75S., 150° 22'·51E.

22° 11'·90S., 150° 22'·99E.

22° 13'·77S., 150° 22'·25E.

22° 13'·51S., 150° 21'·60E.

and

22° 00'·22S., 150° 23'·51E.

22° 01'·04S., 150° 23'·61E.

22° 02'·68S., 150° 18'·70E.

22° 01'·44S., 150° 16'·29E.

22° 00'·19S., 150° 21'·01E.

2. Mariners are advised to navigate with caution in the area.

3. Charts will be updated when full details are available.

(WGS84 DATUM)

Chart affected — Aus 822**2363(P)/19 PAPUA NEW GUINEA - Depths.**

Source: Australian Notice 6/286(P)/19

1. Depths less than charted may exist within an area bounded by the following positions:

5° 11'·75S., 145° 47'·82E.

5° 04'·51S., 145° 48'·06E.

5° 04'·14S., 145° 48'·99E.

5° 10'·14S., 145° 50'·36E.

5° 11'·91S., 145° 49'·61E.

2. Mariners are advised to navigate with caution in the area.

3. Charts will be updated when full details are available.

(WGS84 DATUM)

Chart affected — PNG 646**2626(T)/19 PAPUA NEW GUINEA - Buoy.**

Source: Australian Notice 7/346(T)/19

1. The isolated danger light-buoy, *Q(2)5s*, in position 6° 48'·39S., 146° 58'·27E. is off station.

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Chart affected — PNG 643

3258(P)/19 AUSTRALIA - Queensland - Depths.

Source: Australian Notice 11/548(P)/19

1. Depths less than charted exist in an area bounded by the following positions:

20° 36'·52S., 150° 04'·39E.
20° 30'·63S., 150° 17'·03E.
20° 23'·93S., 150° 16'·63E.
20° 06'·15S., 150° 04'·79E.
20° 11'·27S., 150° 00'·18E.
20° 21'·88S., 150° 04'·70E.
20° 27'·57S., 150° 09'·82E.
20° 32'·65S., 150° 01'·91E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — Aus 821 — Aus 824**1733(T)/20 AUSTRALIA - Western Australia - Works.**

Source: Australian Notice 5/209(T)/20

1. Drilling operations are being conducted by drill rig *Valaris DPS-1* in position 19° 49'·7S., 115° 10'·6E.
(WGS84 DATUM)

Chart affected — 4723**2227(P)/20 PAPUA NEW GUINEA - Depths.**

Source: Australian Notice 8/395(P)/20

1. Depths less than charted exist within an area bounded by the following positions:

10° 44'·21S., 152° 21'·44E.
10° 43'·04S., 152° 22'·09E.
10° 43'·94S., 152° 24'·33E.
10° 45'·28S., 152° 23'·63E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
4. Former Notice 2520(P)/19 was cancelled on withdrawal of Chart AUS512 in NM Weekly 16/20.
5. NOTE: Content of Notice unchanged.
(WGS84 DATUM)

Chart affected — PNG 512**3609(T)/20 AUSTRALIA - New South Wales - Obstructions.**

Source: Australian Notice 13/485(T)/20

1. Shipping containers and debris may exist along the coast and in offshore waters between Tathra (36° 43'·55S., 149° 59'·46E.) and Seal Rocks (32° 27'·86S., 152° 33'·22E.)
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4601 — 4602 — Aus 806 — Aus 807 — Aus 808 — Aus 809 — Aus 810**5545(T)/20 PAPUA NEW GUINEA - Fish traps.**

Source: Australian Notices 20/829-830(T)/20

1. 23 fish aggregating devices exist in an area bounded by the following positions:

7° 00'·0S., 147° 40'·0E.
7° 55'·0S., 147° 40'·0E.
7° 55'·0S., 148° 50'·0E.
7° 00'·0S., 148° 50'·0E.

2. Mariners are advised to navigate with caution in the area.

5545(T)/20 PAPUA NEW GUINEA - Fish traps. (continued)

3. Former Notice 4755(T)/20 is cancelled.
(WGS84 DATUM)

Charts affected — 4622 — PNG 386 — PNG 521 — PNG 522 — PNG 523

6232(T)/20 AUSTRALIA - New South Wales - Scientific instruments.

Source: Australian Notice 24/997(T)/20

1. Special light buoys, *Fl(5)Y.20s*, exist in the following positions:

35° 50'·90S., 150° 11'·30E.
35° 52'·80S., 150° 09'·70E.
36° 54'·50S., 149° 55'·00E.
(WGS84 DATUM)

Charts affected — Aus 806 — Aus 807

1919(P)/21 AUSTRALIA - Queensland - Depths.

Source: Australian Notice 8/337(P)/21

1. Latest survey shows shoaler depths than those charted may exist in areas bounded by the following positions:

9° 14'·38S., 142° 15'·82E.
9° 15'·78S., 142° 19'·88E.
9° 15'·49S., 142° 20'·00E.
9° 13'·58S., 142° 16'·26E.
and
9° 12'·49S., 142° 15'·50E.
9° 12'·33S., 142° 13'·73E.
9° 13'·16S., 142° 13'·24E.
9° 13'·20S., 142° 15'·21E.

2. Mariners are advised to navigate with caution in the area.
3. Charts to be updated by Notices to Mariners.
(WGS84 DATUM)

Chart affected — Aus 841

4619(T)/21 AUSTRALIA - New South Wales - Buoy.

Source: Australian Notice 21/880(T)/21

1. The special light-buoy, *Fl.Y.5s*, in position 28° 35'·40S., 153° 38'·11E. is off station.
(WGS84 DATUM)

Chart affected — Aus 813

5114(T)/21 PAPUA NEW GUINEA - Depths.

Source: Australian Notice 23/985(T)/21

1. Latest survey shows shoaler depths than those charted may exist in an area bounded by the following positions:

9° 20'·66S., 142° 36'·94E.
9° 21'·74S., 142° 34'·60E.
9° 22'·46S., 142° 34'·10E.
9° 22'·72S., 142° 35'·37E.
*9° 22'·75S., 142° 37'·04E.
9° 21'·80S., 142° 37'·67E.
9° 21'·01S., 142° 40'·60E.
*9° 21'·86S., 142° 47'·07E.
*9° 17'·86S., 142° 48'·32E.
*9° 20'·15S., 142° 39'·81E.

2. Mariners are advised to navigate with caution in the area.
3. Charts to be updated by Notices to Mariners.

5114(T)/21 PAPUA NEW GUINEA - Depths. (continued)

4. Former Notice 1344(T)/21 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — Aus 840 — Aus 841

5378(T)/21 AUSTRALIA - Queensland - Scientific instrument.

Source: Australian Notice 24/1025(T)/21

1. A special light-buoy, *Fl(5)Y.20s*, exists in the following position 10° 03'·18S., 143° 03'·12E.
2. Former notice 2531(T)/21 is cancelled.
(WGS84 DATUM)

Chart affected — Aus 839

460(P)/22 PAPUA NEW GUINEA - Depths.

Source: Australian Notice 1/27(P)/22

1. The drying area (9° 15'·51S., 142° 06'·09E). extends 0·27M northwest to position 9° 15'·31S., 142° 05'·91E.
2. The reef (9° 11'·96S., 142° 10'·56E). extends 0·27M south to position 9° 12'·23S., 142° 10'·56E.
3. Mariners are advised to navigate with caution in the area.
4. Chart Aus841 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — Aus 841

1602(T)/22 AUSTRALIA - Victoria - Area to be avoided. Buoyage.

Source: Australian Notice 7/294(T)/22

1. *A 300m exclusion zone exists outwards from the centreline of Point Wilson Pier (38° 05'·54S., 144° 31'·48E.). It is marked by special light-buoys, *Is0.2s*, in the following positions:
 38° 05'·68S., 144° 31'·32E.
 38° 05'·84S., 144° 31'·86E.
 *38° 05'·89S., 144° 32'·45E.
 *38° 05'·64S., 144° 32'·48E.
 38° 05'·55S., 144° 32'·04E.
 *38° 05'·38S., 144° 31'·47E.
 *38° 05'·20S., 144° 30'·93E.
 38° 05'·51S., 144° 30'·73E.
2. Only vessels involved in the remediation works are permitted to enter the area.
3. Mariners are advised to navigate with caution in the area.
4. *Former notice 134(T)/22 is cancelled.
*Indicates new or revised entry.
(WGS84 DATUM)

Chart affected — Aus 143

2043(P)/22 AUSTRALIA - Victoria - Wells. Traffic separation scheme.

Source: Australian Notice 9/369(P)/22

1. Decommissioning of oil and gas infrastructure will take place at Blackback Prod Well (38° 32'·4S., 148° 33'·2E.), Gudgeon Well (38° 30'·8S., 148° 28'·2E.) and Terakihi Well (38° 30'·3S., 148° 32'·9E.).
2. New temporary shipping fairways and a separation zone have been established to keep transiting ships away from decommissioning activities. The new shipping fairways and separation zone are bounded by the following positions:

Northeast bound 38° 36'·9S., 148° 45'·8E.
lane

38° 39'·5S., 148° 48'·0E.
38° 44'·6S., 148° 23'·0E.
38° 42'·0S., 148° 20'·8E.

Southwest bound 38° 33'·4S., 148° 42'·5E.
lane

2043(P)/22 AUSTRALIA - Victoria - Wells. Traffic separation scheme. (continued)

38° 35'·7S., 148° 44'·7E.
38° 40'·8S., 148° 19'·7E.
38° 38'·5S., 148° 17'·5E.

Separation zone 38° 35'·7S., 148° 44'·7E.
38° 36'·9S., 148° 45'·8E.
38° 42'·0S., 148° 20'·8E.
38° 40'·8S., 148° 19'·7E.

3. The fairways and separation zone come into effect on 1 August 2022 at 0000 UTC and will remain in place until further notice.
4. Mariners should follow the appropriate traffic lane and navigate in the general direction of traffic flow for that lane. They should, as far as practicable, keep clear of the separation zone.
5. Due to an increased risk of collision, particularly with vessels that may be restricted in their ability to manoeuvre, mariners should keep a good look out and take early action to avoid collisions.
(WGS84 DATUM)

Chart affected — Aus 357

3009(T)/22 AUSTRALIA - Queensland - Buoy.

Source: Australian Notice 13/490(T)/22

1. The special light-buoy, *Fl.Y.4s*, in position 27° 54'·94S., 153° 27'·59E. has been destroyed and has sunk in position.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 814

31(T)/23 AUSTRALIA - Queensland - Obstructions.

Source: Australian Notice 25/1026(T)/22

1. Obstructions on the seabed exist within a 1M radius of position 19° 44'·13S., 147° 40'·74E.
2. Mariners are advised not to anchor or trawl in the area.
(WGS84 DATUM)

Chart affected — Aus 826

754(T)/23 AUSTRALIA - Victoria - Virtual aids to navigation.

Source: Australian Notice 3/112(T)/23

1. Special virtual AIS have been established in the Gippsland region to denote an area of oil and gas decommissioning work in the following positions:

38° 25'·8S., 148° 25'·5E.
38° 24'·6S., 148° 30'·9E.
38° 23'·5S., 148° 36'·4E.
38° 31'·3S., 148° 25'·5E.
38° 29'·1S., 148° 36'·4E.
38° 36'·9S., 148° 25'·5E.
38° 35'·8S., 148° 30'·9E.
38° 34'·7S., 148° 36'·4E.

2. Transiting ships are requested to keep clear of the area marked by the special virtual AIS.
(WGS84 DATUM)

Chart affected — Aus 357

952(T)/23 AUSTRALIA - New South Wales - Wreck.

Source: Australian Notice 4/133(T)/23

1. A wreck exists in position: 28° 29'·43S., 153° 38'·52E.
(WGS84 DATUM)

Chart affected — Aus 813

1131(T)/23 AUSTRALIA - Western Australia - Scientific instruments.

Source: Australian Notice 5/210(T)/23

1. Subsurface scientific instruments, 0·8m above the seabed, exist in the following positions:

21° 37'·67S., 115° 07'·81E.

21° 37'·97S., 115° 07'·66E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 743

1512(T)/23 AUSTRALIA - Western Australia - Scientific instrument.

Source: Australian Notice 7/293(T)/23

1. A scientific instrument exists on the seabed in position 20° 17'·89S., 116° 51'·58E.
2. Mariners are advised to navigate with caution in the area.
3. Former Notice 2035(T)/22 is cancelled.
(WGS84 DATUM)

Charts affected — Aus 57 — Aus 327

1782(T)/23 AUSTRALIA - Queensland - Wreck.

Source: Australian Notice 9/357(T)/23

1. A wreck exists in the vicinity of position: 27° 53'·80S., 153° 38'·50E.
(WGS84 DATUM)

Chart affected — Aus 814

2051(T)/23 AUSTRALIA - Victoria - Wreck.

Source: Australian Notice 465(T)/23

1. A wreck, least depth 11·4m, exists in position: 37° 55'·93S., 144° 56'·86E.
(WGS84 DATUM)

Chart affected — Aus 143

2237(T)/23 AUSTRALIA - Queensland - Buoy.

Source: Australian Notice 12/484(T)/23

1. A special light buoy, *Fl.Y.5s*, exists in position: 23° 27'·85S., 150° 56'·60E.
(WGS84 DATUM)

Chart affected — Aus 819

3129(T)/23 AUSTRALIA - New South Wales - Scientific instruments.

Source: Australian Notice 17/701(T)/23

1. Scientific instruments exist in the following positions:

Positions

*33° 48'·05S., 151° 18'·33E.
 *33° 49'·59S., 151° 17'·89E.
 *33° 49'·85S., 151° 17'·64E.
 *33° 50'·05S., 151° 17'·48E.
 *33° 50'·25S., 151° 17'·30E.
 33° 53'·74S., 151° 17'·30E.
 33° 53'·91S., 151° 17'·75E.
 33° 54'·16S., 151° 18'·18E.
 33° 54'·42S., 151° 18'·60E.
 33° 54'·69S., 151° 19'·06E.
 33° 54'·95S., 151° 19'·52E.
 33° 55'·21S., 151° 19'·94E.
 33° 55'·46S., 151° 20'·37E.
 33° 55'·71S., 151° 20'·79E.
 33° 55'·98S., 151° 21'·25E.
 33° 56'·24S., 151° 21'·71E.
 33° 56'·49S., 151° 22'·16E.
 33° 56'·75S., 151° 22'·59E.
 33° 57'·06S., 151° 23'·02E.
 33° 57'·32S., 151° 23'·47E.

Remarks

24m below sea surface
 28m below sea surface
 28m below sea surface
 27m below sea surface
 26·5m below sea surface
 27m below sea surface
 41m below sea surface
 58m below sea surface
 63m below sea surface
 64m below sea surface
 64m below sea surface
 71m below sea surface
 70m below sea surface
 80m below sea surface
 80m below sea surface
 82m below sea surface
 87m below sea surface
 90m below sea surface
 98m below sea surface
 119m below sea surface

2. *Former Notice 4271(T)/20 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — Aus 808 — Aus 809**3613(T)/23 AUSTRALIA - Western Australia - Buoy.**

Source: Australian Notice 19/822(T)/23

1. A special light buoy, *Fl(5)Y.20s*, exists in position: 20° 30'·81S., 116° 45'·56E. (WGS84 DATUM)

Chart affected — Aus 57**410(T)/24 AUSTRALIA - Queensland - Scientific instrument. Buoy.**

Source: Australian Notice 1/17(T)/24

1. A special light buoy, *Fl(5)Y.20s*, exists in position 9° 44'·70S., 143° 24'·29E. (WGS84 DATUM)

Charts affected — Aus 377 — Aus 840**412(T)/24 AUSTRALIA - Western Australia - Buoy.**

Source: Australian Notice 1/25(T)/24

1. A special light buoy, *Fl(5)Y.20s*, exists in position: 20° 16'·8S., 116° 33'·7E. (WGS84 DATUM)

Chart affected — Aus 327

931(T)/24 AUSTRALIA - New South Wales - Scientific instruments.

Source: Australian Notice 3/105(T)/24

- Subsurface scientific instruments exist as follows:

<i>Position</i>	<i>Metres below surface</i>
30° 12' .27 S. , 153° 16' .54 E.	43
30° 12' .27 S. , 153° 17' .05 E.	50
30° 12' .31 S. , 153° 15' .46 E.	23
30° 12' .44 S. , 153° 14' .95 E.	30
30° 12' .49 S. , 153° 14' .43 E.	31
30° 12' .55 S. , 153° 13' .92 E.	35
30° 12' .58 S. , 153° 13' .40 E.	34
30° 12' .64 S. , 153° 12' .90 E.	25
30° 12' .67 S. , 153° 10' .48 E.	16
30° 12' .70 S. , 153° 12' .41 E.	26
30° 12' .73 S. , 153° 11' .91 E.	24
30° 12' .77 S. , 153° 11' .40 E.	23
30° 12' .81 S. , 153° 10' .87 E.	20

(WGS84 DATUM)

Chart affected — Aus 812**981(T)/24 AUSTRALIA - New South Wales - Scientific instruments.**

Source: Australian Notice 3/107(T)/24

- Subsurface scientific instruments exist as follows:

<i>Position</i>	<i>Metres below surface</i>
32° 27' .16S., 152° 33' .47E.	35
32° 27' .16S., 152° 32' .75E.	28
32° 27' .45S., 152° 32' .94E.	26
32° 28' .45S., 152° 33' .80E.	38
32° 28' .81S., 152° 34' .11E.	42

(WGS84 DATUM)

Chart affected — Aus 810**982(T)/24 AUSTRALIA - New South Wales - Scientific instruments.**

Source: Australian Notice 3/106(T)/24

- Subsurface scientific instruments exist as follows:

<i>Position</i>	<i>Metres below surface</i>
36° 15' .28S., 150° 14' .20E.	49
36° 15' .40S., 150° 13' .08E.	7
36° 15' .47S., 150° 12' .58E.	33
36° 15' .52S., 150° 12' .04E.	38
36° 15' .59S., 150° 11' .50E.	31
36° 15' .66S., 150° 10' .96E.	30
36° 15' .71S., 150° 10' .43E.	29
36° 15' .75S., 150° 09' .15E.	12
36° 15' .77S., 150° 09' .97E.	29

(WGS84 DATUM)

Charts affected — Aus 806 — Aus 807**1851(T)/24 AUSTRALIA - Western Australia - Obstruction.**

Source: Australian Notice 7/265(T)/24

- An obstruction, 15m below the surface, exists in position: 21° 24'.17 S 115° 02'.81 E.
(WGS84 DATUM)

Chart affected — Aus 743

2228(T)/24 AUSTRALIA - Queensland - Light.

Source: Australian Notice 9/324(T)/24

- The light, WR & Fl.4s 56m 12M (F Day) in position (19° 53'·12S., 148° 04'·55E.), has been temporarily amended to Fl.4s (F Day).
(WGS84 DATUM)

Chart affected — Aus 826**2897(T)/24 AUSTRALIA - Queensland - Scientific instruments.**

Source: Australian Notice 11/408(T)/24

- Subsurface scientific instruments exist as follows:

<i>Position</i>	<i>Metres below surface</i>
27° 25'·29S., 153° 35'·08E.	50
27° 25'·34S., 153° 34'·57E.	46
27° 25'·37S., 153° 34'·08E.	45
27° 25'·44S., 153° 33'·31E.	28

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 814**2898(T)/24 AUSTRALIA - Queensland - Scientific instruments.**

Source: Australian Notice 11/409(T)/24

- Subsurface scientific instruments exist as follows:

<i>Position</i>	<i>Metres below surface</i>
23° 25'·97S., 151° 55'·61E.	19
23° 26'·20S., 151° 58'·84E.	10
23° 26'·38S., 151° 53'·98E.	9
23° 26'·85S., 151° 54'·74E.	15
23° 28'·26S., 151° 56'·82E.	16
23° 28'·26S., 151° 56'·82E.	8
23° 28'·34S., 151° 58'·69E.	15
23° 28'·76S., 152° 04'·96E.	12
23° 29'·52S., 152° 02'·75E.	16
23° 30'·37S., 152° 02'·43E.	8
23° 30'·52S., 152° 03'·33E.	13
23° 30'·83S., 152° 05'·63E.	18

Chart affected — Aus 819**3442(T)/24 AUSTRALIA - Western Australia - Buoy.**

Source: Australian Notice 13/493(T)/24

- The lit mooring buoy, in position 20° 06'·9S., 116° 26'·1E. is unlit
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 327**3749(T)/24 AUSTRALIA - Western Australia - Scientific instruments.**

Source: Australian Notice 5/212(T)/20 and UKHO

- Subsurface scientific instruments exist in the following positions:

<i>Position</i>	<i>Depth</i>
31° 38'·8S., 115° 11'·8E.	24m below surface
31° 43'·7S., 115° 02'·5E.	23m below surface
31° 59'·4S., 115° 23'·1E.	22m below surface

3749(T)/24 AUSTRALIA - Western Australia - Scientific instruments. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4708 — 4709

3984(T)/24 AUSTRALIA - Queensland - Scientific instruments.

Source: Australian Notice 16/604(T)/24

- Subsurface scientific instruments exist as follows:

<i>Position</i>	<i>Metres below surface</i>
10° 09'·57S., 143° 02'·39E.	23·2
10° 24'·34S., 141° 07'·25E.	27·6

(WGS84 DATUM)

Charts affected — Aus 700 — Aus 839

3988(T)/24 AUSTRALIA - Queensland - Buoyage.

Source: Australian Notice 16/596(T)/24

- Special light buoys, *FL.Y.2-5s*, exist in the following positions:

19° 06'·45S., 146° 32'·48E.
 19° 07'·34S., 146° 52'·92E.
 19° 09'·32S., 146° 52'·10E.
 19° 11'·81S., 146° 49'·07E.
 19° 12'·79S., 146° 47'·55E.
 19° 13'·58S., 146° 56'·98E.
 19° 14'·80S., 146° 48'·90E.

- Mariners are advised to navigate with caution in the area.
- Former Notice 1150(T)/23 is cancelled.
(WGS84 DATUM)

Chart affected — Aus 827

4833(P)/24 PAPUA NEW GUINEA - Coastline.

Source: Australian Notice 20/746(P)/24

- The coastline between Karavia Bay (4° 16'·84S., 152° 09'·83E.) and Nodup (4° 11'·66S., 152° 12'·32E.) may differ to what is currently charted.
- Mariners are advised to navigate with caution in the area.
- Charts will updated in due course
(WGS84 DATUM)

Charts affected — PNG 554 — PNG 680

5459(T)/24 AUSTRALIA - Victoria - Depths.

Source: UKHO

- Depths less than charted exist within the approaches to Port Phillip. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
9·9m	38° 18'·34S., 144° 37'·94E.
6·8m	38° 17'·12S., 144° 42'·14E.
5·3m	38° 17'·03S., 144° 42'·24E.
5·7m	38° 16'·93S., 144° 42'·39E.
1·1m	38° 16'·67S., 144° 42'·71E.
1·6m	38° 16'·34S., 144° 43'·12E.
4m	38° 16'·65S., 144° 43'·56E.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 143

5489(T)/24 AUSTRALIA - Queensland - Tidal gauges.

Source: Australian Notice 23/866(T)/24

1. Tide gauges exist in the following positions:

10° 27'·06S., 141° 20'·32E.

10° 28'·40S., 141° 41'·78E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 700**5803(T)/24 AUSTRALIA - Western Australia - Lights.**

Source: Australian Notice 24/918(T)/24

1. Light, Fl.21M, in position 21° 48'·4S., 114° 09'·6E. has been extinguished.
2. A temporary light, Fl.10s19M (Obscd 172·5° - 202·5° (030°)), exists in position 21° 49'·2S., 114° 06'·1E.
(WGS84 DATUM)

Charts affected — 4060 — 4070 — 4071 — 4073 — 4708 — 4723**119(T)/25 AUSTRALIA - Victoria - Scientific instruments.**

Source: Australian Notice 21/792(T)/24

1. Subsurface scientific instruments, 20m below the surface, exist in the following positions:

38° 45'·20S., 147° 05'·60E.

38° 50'·96S., 147° 17'·54E.

38° 55'·81S., 146° 50'·01E.

39° 03'·60S., 147° 39'·10E.

39° 21'·71S., 146° 58'·05E.

2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 4181(T)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — Aus 357 — Aus 802**125(T)/25 AUSTRALIA - Western Australia - Buoy.**

Source: Australian Notice 25/992(T)/24

1. A special light-buoy, *Fl.Y.5s FAD (Oct-Apr)*, exists in position 30° 18'·5S., 114° 35'·3E.
(WGS84 DATUM)

Chart affected — 4708**127(T)/25 AUSTRALIA - Victoria - Moorings.**

Source: Australian Notice 25/1005(T)/24

1. Temporary moorings exist in the vicinity of position 38° 20'·48S., 144° 50'·78E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 143**128(T)/25 AUSTRALIA - Queensland - Buoy.**

Source: Australian Notice 25/968(T)/24

1. A special light buoy, *Fl(5)Y.20s*, exists in position 12° 10'·2S., 140° 16'·8E.
(WGS84 DATUM)

Chart affected — 4603

142(P)/25 AUSTRALIA - Western Australia - Depths.

Source: Australian Notice 25/999(P)/24

1. Latest survey indicates shoaler depths than those charted may exist within an area bounded by the following positions:

20° 27'·96S., 117° 25'·65E.

20° 27'·96S., 117° 27'·02E.

20° 29'·89S., 117° 27'·02E.

20° 29'·89S., 117° 25'·65E.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts will be updated when full details are available.
4. *Former Notice 4969(P)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — Aus 55 — Aus 326**869(T)/25 AUSTRALIA - Victoria - Works.**

Source: Australian Notice 2/109(T)/25

1. An unmanned surface vehicle (USV) will be conducting survey operations in areas bounded by the coast and the following positions:

38° 27'·3S., 147° 05'·6E.

38° 33'·6S., 147° 03'·3E.

38° 27'·3S., 147° 11'·2E.

38° 25'·2S., 147° 08'·4E.

and

38° 23'·2S., 147° 10'·9E.

38° 25'·3S., 147° 13'·5E.

38° 19'·5S., 147° 21'·1E.

38° 22'·0S., 147° 12'·5E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 357**1079(T)/25 AUSTRALIA - Queensland - Buoy. Scientific instrument.**

Source: Australian Notice 3/136(T)/25

1. The special light-buoy, *Fl.Y.3s FAD*, in position 24° 39'·27S., 152° 33'·01E., is off station.
2. A subsurface scientific instrument, 14m below the surface, exists in situ.
(WGS84 DATUM)

Chart affected — Aus 818**1110(T)/25 AUSTRALIA - Victoria - Buoy. Light-float. Scientific instruments.**

Source: Australian Notices 3/158(T)-160(T)/25

1. A special light-buoy, *Fl(5)Y.20s*, exists in position 39° 06'·2S., 147° 29'·7E.
2. A yellow light-float, *Fl(5)Y.20s*, exists in position 39° 16'·8S., 147° 32'·2E.
3. Subsurface scientific instruments, 1·5m above the seabed, exist in the following positions:

39° 04'·6S., 147° 59'·5E.

39° 07'·26S., 147° 16'·15E.

39° 16'·4S., 147° 31'·8E.

39° 21'·68S., 147° 04'·50E.

4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — Aus 357 — Aus 802

1221(P)/25 AUSTRALIA - Western Australia - Obstruction.

Source: Australian Notice 4/179(P)/25

1. An obstruction on the sea floor has been reported in the vicinity of position 20° 36'·27S., 116° 35'·13E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 57**1263(P)/25 AUSTRALIA - Victoria - Wreck.**

Source: Australian Notice 4/196(P)/25

1. Latest survey indicates a wreck, with least depth 21·5m, exists in position 38° 08'·09S., 144° 56'·58E.
2. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — Aus 143**1541(T)/25 AUSTRALIA - Western Australia - Submarine cables.**

Source: Australian Notice 5/222(T)/25

1. Vessel *Ile de Brehat* is conducting cable laying operations between positions 12° 58'·1S., 124° 26'·7E. and 13° 26'·5S., 124° 34'·9E.; and in the vicinity of position 19° 53'·1S., 113° 14'·0E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4603 — 4708 — 4722 — 4723**1678(T)/25 AUSTRALIA - Queensland - Buoy.**

Source: Australian Notice 6/255(T)/25

1. The special light--buoy, *Fl.Y.3s* (27° 57'·60S., 153° 27'·43E.), is off station.
(WGS84 DATUM)

Chart affected — Aus 814**1694(T)/25 AUSTRALIA - Western Australia - Tidal gauges. Buoyage.**

Source: Australian Notice 6/263(T)/25

1. During hydrographic survey operations, subsurface tide gauges with release buoys will be deployed in an area bounded by the following positions:
34° 13'·4S., 123° 59'·2E.
34° 13'·1S., 124° 19'·2E.
33° 34'·5S., 124° 19'·4E.
33° 34'·8S., 124° 07'·2E.
33° 44'·0S., 123° 58'·8E.
33° 59'·8S., 123° 35'·9E.
34° 07'·5S., 123° 39'·0E.
2. An additional subsurface tide gauge with release buoy will be deployed in position 33° 57'·0S., 121° 49'·6E.
3. A special light buoy, *Fl.Y.I-5s*, will be deployed for 72 hours at various locations during the survey.
4. Mariners are advised to navigate with caution in the area.
5. Former Notice 1539(T)/25 is cancelled.
(WGS84 DATUM)

Chart affected — 4709

1946(T)/25 AUSTRALIA - Victoria - Works.

Source: Australian Notice 7/310(T)/25

1. The vessel *Lobo* is conducting sampling works, which involves the towing of nets 5m in length, within an area bounded by the following positions:

37° 59'·66S., 144° 50'·48E.
 38° 00'·83S., 144° 37'·40E.
 38° 00'·73S., 144° 35'·14E.
 38° 01'·99S., 144° 34'·02E.
 38° 03'·22S., 144° 31'·36E.
 38° 04'·98S., 144° 31'·04E.
 38° 06'·22S., 144° 49'·21E.

2. The vessel can be contacted on 0423 771 047 / 0415 892 572 or on VHF Ch 12.
3. Mariners are advised to navigate with caution in the area. Minimum passing distance of 100m requested. (WGS84 DATUM)

Chart affected — Aus 143**1947(T)/25 AUSTRALIA - Western Australia - Scientific instruments.**

Source: Australian Notice 7/306(T)/25

1. Subsurface scientific instruments exist as follows:

<i>Position</i>	<i>Remarks</i>
12° 57'·6S., 124° 40'·4E.	1·2m above seabed
12° 57'·8S., 124° 12'·6E.	1·2m above seabed
12° 58'·1S., 123° 42'·3E.	1·2m above seabed
13° 59'·2S., 121° 46'·4E.	1·5m above seabed
13° 59'·6S., 121° 58'·9E.	1·5m above seabed
14° 02'·0S., 122° 00'·9E.	1·5m above seabed
14° 02'·4S., 121° 58'·5E.	20m below the surface
* 14° 31'·2S., 121° 37'·6E.	1·5m above seabed

2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 5100(T)/24 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 4722**2057(T)/25 AUSTRALIA - Queensland - Wreck. Buoy.**

Source: Australian Notice 8/334(T)/25

1. A stranded wreck, marked by a special light-buoy, *Fl.Y.4s*, exists in position 10° 36'·23S., 142° 14'·17E.
2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Chart affected — Aus 293

2059(T)/25 AUSTRALIA - Western Australia - Works.

Source: Australian Notice 8/341(T)/25

1. Diving and mooring removal activities are in progress in the following positions:

21° 38'·17S., 114° 55'·43E.
 21° 26'·42S., 115° 03'·24E.
 21° 24'·00S., 115° 02'·55E.
 21° 24'·33S., 115° 02'·79E.
 21° 24'·35S., 115° 02'·82E.
 21° 24'·36S., 115° 02'·94E.
 21° 24'·15S., 115° 03'·07E.
 21° 24'·06S., 115° 03'·00E.
 21° 24'·05S., 115° 02'·97E.
 21° 24'·27S., 115° 02'·97E.
 21° 24'·00S., 115° 02'·86E.
 21° 24'·13S., 115° 02'·62E.

2. Vessels will display appropriate lights and shapes and will monitor VHF Ch 14 and Ch 16.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 743**2197(T)/25 AUSTRALIA - Victoria - Light-beacon. Virtual aid to navigation. Buoy.**

Source: Australian Notice 9/379(T)/25

1. The north cardinal light-beacon, Q.9m 9M , in position 38° 17'·70S., 144° 41'·15E., has been destroyed; a north cardinal virtual AIS and a north cardinal light-buoy, exist in situ.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 143**2201(T)/25 AUSTRALIA - Queensland - Works. Buoy. Tidal gauges.**

Source: Australian Notice 9/366(T)/25

1. An unmanned surface vehicle (USV) will be conducting survey operations in an area bounded by the coast and the following positions:

22° 33'·30S., 150° 47'·47E.
 22° 33'·30S., 150° 48'·80E.
 22° 39'·40S., 150° 48'·80E.
 22° 39'·40S., 150° 48'·27E.
2. Tide gauges marked by a special light-buoy, *Fl.Y.2s*, exist in position 22° 37'·8S., 150° 48'·1E.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 820**2254(T)/25 AUSTRALIA - Victoria - Restricted area.**

Source: Australian Notice 9/375(T)/25

1. A 500m radius safety zone exists centred on position 38° 11'·8S., 148° 33'·8E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 357**2553(T)/25 AUSTRALIA - Queensland - Buoy.**

Source: Australian Notice 10/410(T)/25

1. The special light-buoy, *Fl.Y.3s FAD*, in position 27° 41'·28S., 153° 36'·83E., is off station and exists in position 27° 40'·55S., 153° 36'·17E.
2. Mariners are advised to navigate with caution in the area.

2553(T)/25 AUSTRALIA - Queensland - Buoy. (continued)

3. Former Notice 1692(T)/25 is cancelled.
(WGS84 DATUM)

Chart affected — Aus 814

2727(T)/25 AUSTRALIA - Queensland - Buoy.

Source: Australian Notice 11/443(T)/25

1. The special light-buoy, *FL.Y.4s*, in position 18° 12'·34S., 146° 09'·36E., is off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 828

2735(T)/25 AUSTRALIA - Western Australia - Works.

Source: Australian Notice 11/449(T)/25

1. On or about 4 June 2025, drill rig *Valaris DPS-1* and support vessels will be conducting drilling operations in the following positions:

19° 45'·9S., 113° 14'·5E.
19° 49'·5S., 113° 13'·1E.
19° 52'·5S., 113° 06'·7E.
19° 52'·6S., 113° 13'·4E.
19° 53'·3S., 113° 10'·1E.
19° 53'·4S., 113° 08'·7E.
19° 53'·5S., 113° 08'·7E.
19° 53'·8S., 113° 06'·9E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4723

2738(T)/25 AUSTRALIA - Western Australia - Works.

Source: Australian Notice 11/451(T)/25

1. On or about 1 June 2025, vessel *DLV2000* will be conducting subsea operations in the vicinity of position 12° 57'·9S., 124° 26'·6E.
2. Mariners are advised to navigate with caution in the area. 2·5M clearance requested.
(WGS84 DATUM)

Chart affected — 4722

2967(T)/25 AUSTRALIA - Victoria - Buoy. Scientific instrument.

Source: Australian Notice 12/505(T)/25

1. A special light-buoy, *Q(5).Y.20s*, exists in position 38° 38'·6S., 147° 23'·0E.
(WGS84 DATUM)

Chart affected — Aus 357

3079(P)/25 AUSTRALIA - Western Australia - Submarine cable. Works.

Source: OMS Group and Australian Notice 12/497(T)/25

1. A submarine cable is being laid between Perth and Sydney, in the vicinity of the lines joining following positions:

31° 56'·2S., 115° 45'·3E.
31° 52'·8S., 115° 41'·5E.
31° 47'·4S., 115° 39'·7E.
31° 47'·4S., 115° 30'·2E.
31° 48'·6S., 115° 24'·8E.
31° 48'·7S., 115° 20'·6E.

3079(P)/25 AUSTRALIA - Western Australia - Submarine cable. Works. (continued)

2. and

32° 12'·6S., 115° 40'·2E.
32° 12'·4S., 115° 33'·9E.
32° 01'·3S., 115° 21'·7E.
31° 48'·7S., 115° 20'·6E.

3. and

31° 48'·7S., 115° 20'·6E.
31° 48'·1S., 115° 11'·4E.
31° 39'·8S., 114° 50'·2E.
31° 41'·2S., 114° 39'·8E.
31° 38'·2S., 114° 27'·4E.
31° 37'·5S., 114° 07'·6E.
31° 41'·8S., 113° 59'·8E.
31° 48'·7S., 113° 54'·8E.
32° 34'·2S., 113° 44'·8E.
32° 54'·0S., 113° 48'·2E.
34° 13'·9S., 113° 49'·1E.
34° 36'·5S., 113° 54'·7E.
34° 55'·0S., 114° 05'·9E.
35° 06'·4S., 114° 20'·8E.
35° 11'·7S., 114° 32'·6E.
35° 17'·5S., 114° 37'·9E.
35° 31'·8S., 114° 40'·2E.
35° 37'·4S., 114° 44'·9E.
35° 48'·6S., 115° 17'·2E.
35° 59'·6S., 117° 30'·0E.

4. and

35° 59'·6S., 117° 30'·0E.
36° 12'·1S., 120° 22'·9E.
36° 15'·2S., 121° 26'·8E.
36° 19'·2S., 121° 56'·7E.
36° 20'·0S., 123° 40'·8E.
36° 26'·5S., 125° 06'·3E.
36° 23'·8S., 125° 36'·3E.
36° 28'·3S., 126° 07'·4E.
36° 30'·4S., 126° 58'·7E.
36° 28'·5S., 127° 36'·2E.
36° 37'·3S., 130° 19'·8E.
36° 42'·1S., 133° 26'·4E.
36° 41'·4S., 134° 31'·4E.
36° 49'·4S., 135° 18'·7E.

5. and

36° 49'·4S., 135° 18'·7E.
36° 41'·7S., 135° 15'·9E.
36° 32'·9S., 135° 19'·2E.
36° 23'·2S., 135° 26'·7E.
36° 16'·4S., 135° 34'·5E.
35° 51'·4S., 135° 52'·5E.
35° 40'·4S., 136° 03'·4E.
35° 38'·5S., 136° 07'·5E.
35° 32'·1S., 136° 45'·5E.
35° 31'·8S., 137° 11'·9E.
35° 19'·8S., 137° 56'·4E.
35° 14'·9S., 138° 06'·8E.
35° 00'·4S., 138° 22'·2E.
34° 58'·1S., 138° 26'·1E.
34° 57'·6S., 138° 30'·1E.

3079(P)/25 AUSTRALIA - Western Australia - Submarine cable. Works. (continued)

6. and

36° 49'·4S., 135° 18'·7E.
37° 26'·8S., 136° 17'·2E.
38° 31'·8S., 138° 32'·0E.
39° 21'·8S., 139° 44'·7E.
39° 55'·9S., 140° 51'·5E.
39° 56'·7S., 141° 26'·5E.
39° 53'·6S., 142° 30'·1E.
39° 51'·1S., 142° 42'·3E.
39° 22'·2S., 143° 29'·9E.
38° 43'·6S., 144° 08'·3E.
38° 27'·7S., 144° 25'·4E.
38° 26'·9S., 144° 27'·4E.
38° 26'·8S., 144° 29'·2E.

7. and

38° 20'·4S., 144° 19'·4E.
38° 21'·0S., 144° 19'·9E.
38° 21'·2S., 144° 20'·3E.
38° 21'·9S., 144° 23'·1E.
38° 22'·0S., 144° 23'·5E.
38° 24'·7S., 144° 26'·2E.
38° 26'·9S., 144° 27'·4E.

8. and

38° 20'·4S., 144° 19'·4E.
38° 21'·0S., 144° 19'·9E.
38° 21'·2S., 144° 20'·2E.
38° 21'·8S., 144° 23'·3E.
38° 22'·0S., 144° 23'·7E.
38° 23'·1S., 144° 25'·0E.
38° 25'·0S., 144° 28'·5E.
38° 25'·7S., 144° 29'·3E.
38° 26'·8S., 144° 29'·2E.

9. and

38° 26'·8S., 144° 29'·2E.
38° 28'·0S., 144° 31'·1E.
38° 43'·0S., 144° 49'·5E.
39° 00'·1S., 145° 31'·1E.
39° 00'·3S., 145° 33'·0E.
39° 17'·0S., 146° 14'·2E.
39° 18'·9S., 146° 17'·2E.
39° 33'·4S., 146° 30'·0E.
39° 36'·1S., 146° 33'·4E.
39° 36'·5S., 147° 23'·3E.
39° 32'·4S., 147° 32'·4E.
39° 25'·0S., 148° 36'·4E.
39° 20'·3S., 148° 43'·6E.
39° 18'·5S., 148° 45'·8E.
39° 17'·0S., 148° 48'·5E.
39° 15'·6S., 148° 53'·6E.
39° 14'·9S., 149° 06'·2E.
39° 15'·8S., 149° 28'·0E.

3079(P)/25 AUSTRALIA - Western Australia - Submarine cable. Works. (continued)

10. and

39° 15'·8S., 149° 28'·0E.
 39° 15'·9S., 149° 30'·0E.
 39° 11'·5S., 149° 54'·1E.
 39° 07'·2S., 150° 04'·5E.
 38° 33'·9S., 150° 46'·5E.
 38° 20'·4S., 150° 58'·5E.
 35° 17'·1S., 151° 56'·5E.
 35° 00'·2S., 152° 00'·5E.
 34° 45'·7S., 151° 58'·0E.
 34° 35'·1S., 151° 53'·8E.
 34° 28'·9S., 151° 46'·3E.
 34° 20'·6S., 151° 43'·6E.
 34° 17'·9S., 151° 39'·4E.
 34° 12'·6S., 151° 32'·4E.
 34° 10'·2S., 151° 28'·3E.
 34° 02'·7S., 151° 24'·6E.
 34° 02'·0S., 151° 22'·4E.
 33° 58'·2S., 151° 20'·6E.
 33° 57'·3S., 151° 18'·7E.
 33° 56'·9S., 151° 15'·4E.

11. The associated cable laying operations will begin in June and are estimated to be completed by September 2025.
12. Mariners are advised to navigate with caution in the area.
13. Charts will be updated when full details are available upon completion of the submarine cable laying works.
14. Former Notice 3466(P)/24 is cancelled.
(WGS84 DATUM)

Charts affected — 4601 — 4602 — 4708 — 4709 — 4710 — Aus 143 — Aus 357 — Aus 801 — Aus 802 — Aus 808**3221(T)/25 AUSTRALIA - Victoria - Buoyage. Scientific instruments.**

Source: Australian Notice 13/574(T)/25

1. Special light-buoys, *Fl.Y.2-5s*, exist in the following positions:

37° 58'·72S., 144° 59'·73E.
 38° 08'·16S., 144° 45'·18E.
 38° 09'·73S., 145° 03'·26E.
 38° 18'·09S., 144° 52'·36E.
 38° 18'·50S., 144° 41'·52E.
 38° 18'·95S., 144° 42'·74E.
 38° 19'·22S., 144° 43'·91E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 143**3281(T)/25 AUSTRALIA - Victoria - Restricted area.**

Source: Australian Notice 13/566(T)/25

1. On 1 July 2025, a 500m radius safety zone will exist centred on position 38° 23'·9S., 148° 18'·9E.
(WGS84 DATUM)

Chart affected — Aus 357**3282(T)/25 AUSTRALIA - Victoria - Light-beacons.**

Source: Australian Notice 13/573(T)/25

1. The starboard lateral light-beacon, Fl.G.3s No1, in position 38° 17'·96S., 144° 42'·43E., has been destroyed. A replacement light-beacon, Fl.G.3s, exists in situ.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 143

3436(T)/25 AUSTRALIA - Victoria - Scientific instruments.

Source: Australian Notice 14/632(T)/25

1. Subsurface scientific instruments, 2m above seabed, exist in the following positions:

38° 31'·6S., 147° 09'·0E.

38° 29'·2S., 147° 12'·0E.

38° 37'·2S., 147° 14'·5E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 357**3441(P)/25 AUSTRALIA - Western Australia - Depths.**

Source: Australian Notice 14/631(P)/25

1. Recent survey information shows that depths less than charted exist in the following positions:

Depth

566m

630m

Position

38° 47'·2S., 119° 25'·5E.

38° 27'·3S., 116° 50'·9E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4060 — 4708 — 4709 — 4710**3505(T)/25 AUSTRALIA - Western Australia - Harbour developments.**

Source: Australian Notice 15/673(T)/25

1. Harbour works are in progress in an area bounded by the following positions:

20° 37'·06S., 116° 44'·87E.

20° 36'·90S., 116° 44'·87E.

20° 36'·90S., 116° 44'·93E.

20° 37'·06S., 116° 44'·93E.

2. Entry into the area is prohibited unless authorised by the primary contractor, Clough. Any arrivals or departures from the area must be reported to Dampier VTS along with confirmation that permission has been obtained.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — Aus 57 — Aus 59**3559(P)/25 AUSTRALIA - Queensland - Rock. Depth.**

Source: Australian Notice 15/665(P)/25

1. An uncharted rock, with least depth 42m, has been reported in position 19° 26'·39S., 148° 05'·46E.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — Aus 826**3560(T)/25 AUSTRALIA - Western Australia - Buoy.**

Source: Australian Notice 15/679(T)/25

1. The east cardinal light-buoy, *Q(3)10s*, in position 21° 26'·39S., 115° 03'·48E., has been temporarily altered to, *Fl(3)15s 5M*.
(WGS84 DATUM)

Chart affected — Aus 743**3570(T)/25 AUSTRALIA - Victoria - Buoyage.**

Source: Australian Notice 15/683(T)/25

1. Special light-buoys, *Q(5)Y.20s*, exist in positions 38° 33'·7S., 147° 12'·5E. and 38° 38'·6S., 147° 14'·6E.

3570(T)/25 AUSTRALIA - Victoria - Buoyage. (continued)

2. Former Notice 3442(T)/25 is cancelled.
(WGS84 DATUM)

Chart affected — Aus 357

3696(T)/25 AUSTRALIA - Victoria - Scientific instruments.

Source: Australian Notice 16/721(T)/25

1. Subsurface scientific instruments, 1·5m above seabed, exist in the following positions:

38° 41'·4S., 147° 12'·8E.
38° 28'·4S., 147° 18'·0E.
38° 47'·2S., 147° 25'·7E.
38° 38'·1S., 147° 30'·8E.
38° 41'·1S., 147° 48'·7E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 357

4128(T)/25 AUSTRALIA - Queensland - Buoy.

Source: Australian Notice 17/745(T)/25

1. A special light-buoy, *Fl(5)Y.20s*, exists in position 23° 28'·65S., 152° 12'·21E.
2. Mariners are advised to navigate with caution in the area and not to use the buoy as a mooring.
(WGS84 DATUM)

Chart affected — Aus 819

4298(T)/25 AUSTRALIA - Western Australia - Works.

Source: Australian Notice 18/792(T)/25

1. Subsea operations associated with the cessation of production activities are in progress between positions 20° 01'·45S., 116° 18'·58E. and 20° 24'·64S., 116° 20'·14E.
2. Mariners are advised to navigate with caution in the area.

Charts affected — Aus 57 — Aus 327

4301(T)/25 AUSTRALIA - Western Australia - Moored storage tanker. Obstruction. Buoy.

Source: Australian Notice 18/798(T)/25

1. *The lit FPSO *Ningaloo Vision Mo(U)15s*, in position 21° 24'·2S., 114° 05'·3E., is off station; a direct turret mooring, with least depth 35m, exists in situ, marked by a special light buoy, *Fl.Y.4s*.
2. *Former Notice 4136(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 4723

4538(T)/25 AUSTRALIA - Queensland - Buoy.

Source: Australian Notice 19/827(T)/25

1. The west cardinal light buoy, *Q(9)15s*, in position 19° 17'·85S., 147° 22'·64E., is off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 827

4775(P)/25 AUSTRALIA - New South Wales - Depths.

Source: Australian Notice 20/870(P)/25

1. Latest survey indicates shoaler depths than those charted may exist in an area bounded by the following positions:

33° 20'·97S., 151° 31'·17E.

33° 24'·41S., 151° 29'·00E.

33° 24'·22S., 151° 30'·14E.

33° 21'·19S., 151° 32'·26E.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated in due course.
(WGS84 DATUM)

Chart affected — Aus 809**4801(T)/25 AUSTRALIA - Queensland - Obstruction.**

Source: Australian Notice 20/874(T)/25

1. An obstruction exists, 1m below the surface, in position: 22° 25'·37S., 150° 43'·66E.
(WGS84 DATUM)

Charts affected — Aus 820 — Aus 822**4813(T)/25 AUSTRALIA - Queensland - Buoyage.**

Source: Australian Notice 20/875(T)/25

1. The following light-buoys are off station:

Position

19° 43'·62S., 147° 35'·95E.

19° 43'·61S., 147° 36'·36E.

19° 43'·37S., 147° 36'·78E.

RemarksStarboard lateral light buoy, *Fl.G.3s*Port lateral light buoy, *Fl.R.4s*Port lateral light buoy, *Fl.R.1·5s*

2. Mariners are advised to navigate with caution in the area.
3. Former Notice 2736(T)/25 is cancelled
(WGS84 DATUM)

Chart affected — Aus 826**5136(T)/25 AUSTRALIA - Queensland - Works. Restricted area. Buoyage.**

Source: Australian Notice 21/908(T)/25

1. Works associated with the construction of a reclamation bund wall are in progress. A restricted area exists bounded by the following positions:

23° 46'·10S., 151° 08'·56E.

23° 45'·40S., 151° 09'·07E.

23° 45'·88S., 151° 09'·74E.

23° 46'·05S., 151° 09'·45E.

23° 46'·82S., 151° 09'·32E.

23° 47'·00S., 151° 08'·98E.

2. Light-buoys, *Fl.Y.2·5s*, exist in the following positions:

23° 45'·87S., 151° 09'·70E.

23° 45'·82S., 151° 09'·63E.

23° 45'·77S., 151° 09'·56E.

23° 45'·69S., 151° 09'·44E.

23° 45'·60S., 151° 09'·33E.

23° 45'·52S., 151° 09'·21E.

3. Mariners are advised to navigate with caution in the area.
4. Former Notice 4130(T)/25 is cancelled.
(WGS84 DATUM)

Chart affected — Aus 819

5138(T)/25 AUSTRALIA - Western Australia - Works. Obstructions.

Source: Australian Notice 21/920(T)/25

1. A large number of concrete pads have been placed on the seabed in the vicinity of 19° 49'·0S., 113° 12'·0E., to facilitate gravity meter survey operations. They pose no threat to surface navigation, but mariners should be aware when conducting any subsurface activities.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4723**5140(T)/25 PAPUA NEW GUINEA - Light.**

Source: Australian Notice 21/912(T)/25

1. The light, Fl(2) 8s 23m 10M in position 9° 37'·78S., 150° 01'·37E., is unlit.
(WGS84 DATUM)

Charts affected — PNG 518 — PNG 519**5251(T)/25 AUSTRALIA - Western Australia - Works.**

Source: Australian Notice 22/951(T)/25

1. *Vessel *Deep Orient* will be conducting subsea structure recovery operations in the Griffin Field (21° 13'·4S., 114° 38'·7E.), the Stybarrow Field (21° 24'·3S., 113° 51'·7E.) and the Echo Yodel Field (19° 44'·3S., 115° 44'·9E.).
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 4134(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 4723 — Aus 327**5256(T)/25 AUSTRALIA - Victoria - Scientific instruments.**

Source: Australian Notice 22/956(T)/25

1. Subsurface scientific instruments, 2m above the seabed, exist in the following positions:

38° 52'·7S., 147° 48'·6E.
 38° 56'·1S., 147° 52'·9E.
 38° 56'·5S., 147° 38'·5E.
 38° 56'·7S., 147° 48'·4E.
 38° 58'·1S., 147° 42'·7E.
 38° 58'·9S., 147° 57'·0E.
 38° 59'·3S., 147° 48'·0E.
 39° 00'·1S., 147° 53'·7E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 357**5257(T)/25 AUSTRALIA - Western Australia - Buoy.**

Source: Australian Notice 22/953(T)/25

1. A lit mooring buoy, *Fl*, exists in position 12° 57'·0S., 124° 25'·7E.
(WGS84 DATUM)

Chart affected — 4722

5258(T)/25 AUSTRALIA - Queensland - Works. Submarine cable.

Source: Australian Notice 22/944(T)/25

1. Vessel *CS Dependable* is conducting cable laying operations between the following positions:

26° 39'·43S., 153° 06'·62E.
26° 36'·36S., 153° 10'·26E.
26° 37'·26S., 153° 13'·76E.
26° 55'·25S., 153° 40'·78E.
27° 03'·9S., 154° 45'·6E.
27° 50'·7S., 156° 00'·8E.
28° 23'·0S., 157° 16'·4E.
28° 43'·3S., 157° 29'·4E.
26° 44'·6S., 161° 22'·3E.

2. Mariners are advised to navigate with caution in the area. 1M clearance requested.
(WGS84 DATUM)

Charts affected — 4060 — 4602 — Aus 814 — Aus 815**5263(T)/25 AUSTRALIA - Victoria - Scientific instruments.**

Source: Australian Notice 22/957(T)/25

1. Subsurface scientific instruments, 4m above the seabed, exist in areas bounded by the following positions:

40° 21'·9S., 146° 17'·9E.
40° 21'·5S., 147° 25'·8E.
40° 46'·9S., 147° 26'·3E.
40° 47'·4S., 146° 18'·4E.
and
39° 21'·4S., 146° 04'·2E.
39° 19'·7S., 146° 06'·7E.
39° 44'·3S., 146° 34'·8E.
39° 46'·0S., 146° 32'·2E.
and
39° 04'·88S., 147° 22'·85E.
39° 03'·70S., 147° 25'·54E.
39° 36'·5S., 147° 50'·7E.
39° 37'·7S., 147° 47'·4E.
and
38° 55'·05S., 147° 13'·40E.
38° 39'·8S., 146° 58'·2E.
38° 38'·1S., 147° 00'·7E.
38° 53'·41S., 147° 16'·12E.
and
38° 41'·3S., 147° 49'·7E.
38° 16'·5S., 147° 26'·8E.
38° 14'·9S., 147° 29'·3E.
38° 39'·9S., 147° 52'·5E.
and
37° 56'·1S., 148° 02'·8E.
38° 21'·2S., 148° 24'·9E.
38° 22'·9S., 148° 22'·5E.
37° 57'·7S., 148° 00'·3E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4601 — Aus 357 — Aus 802

5551(T)/25 AUSTRALIA - Western Australia - Light-beacon.

Source: Australian Notice 23/998(T)/25

1. The port lateral light beacon, *Fl.R.3s* (20° 50'·60S., 115° 31'·92E.) is unreliable.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — Aus 743**5559(T)/25 AUSTRALIA - Queensland - Buoy. Scientific instrument.**

Source: Australian Notice 23/990(T)/25

1. A special light buoy, *Fl.Y.2·5s*, exists in position 17° 58'·45S., 146° 11'·66E.
2. Former Notice 3451(T)/25 is cancelled
(WGS84 DATUM)

Charts affected — Aus 828 — Aus 829**5570(T)/25 AUSTRALIA - New South Wales - Buoy.**

Source: Australian Notice 23/987(T)/25

1. The special light-buoy, *Fl.Y.5s FAD (Sep-Jun)* (29° 36'·76S., 153° 29'·19E.), is off station and in position 29° 37'·27S., 153° 29'·15E.
(WGS84 DATUM)

Charts affected — Aus 812 — Aus 813**5578(T)/25 AUSTRALIA - Western Australia - Works. Light.**

Source: Australian Notice 23/1001(T)/25

1. *A yellow steel truss structure, with a height of 19m, has been installed in position 12° 57'·9S., 124° 26'·6E. for a future drill rig. The structure is marked by a light, *Mo(A)7s*.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 5135(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 4722**5635(T)/25 AUSTRALIA - Western Australia - Wreck. Buoy.**

Source: Australian Notice 24/1041(T)/25

1. *A stranded wreck, marked by an isolated danger light-buoy, *Fl(2)*, exists in position 20° 39'·95S., 116° 41'·58E.
2. Mariners are advised to navigate with caution in the area.
3. Former Notice 5422(T)/25 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — Aus 57 — Aus 60**5760(T)/25 AUSTRALIA - Western Australia - Works.**

Source: Australian Notice 24/1044(T)/25

1. Vessel *MMA Pinnacle* is conducting subsea structure recovery operations in the Stybarrow Field (21° 27'·0S., 113° 49'·5E).
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4723

5777(T)/25 AUSTRALIA - Western Australia - Works.

Source: Australian Notice 24/1042(T)/25

1. On or about 30 November 2025, an unmanned survey vessel (USV) will be conducting gravimetry survey operations in an area bounded by the following positions:

19° 39'·1S., 113° 04'·0E.
19° 39'·1S., 113° 24'·0E.
19° 44'·1S., 113° 24'·0E.
19° 44'·1S., 113° 19'·0E.
20° 00'·0S., 113° 19'·2E.
20° 00'·0S., 113° 04'·0E.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 4723**5778(P)/25 AUSTRALIA - Queensland - Wreck.**

Source: Australian Notice 24/1031(P)/25

1. Latest survey indicates a wreck, least depth 29·7m, exists in position: 19° 35'·47S., 147° 53'·72E.
2. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — Aus 826**5779(T)/25 AUSTRALIA - Victoria - Works.**

Source: Australian Notice 24/1056(T)/25

1. Jack up barge *Sealift 3* and support vessels are conducting geotechnical operations in an area bounded by the following positions:

38° 02'·11S., 144° 33'·76E.
38° 02'·60S., 144° 34'·70E.
38° 02'·34S., 144° 36'·43E.
38° 02'·23S., 144° 40'·27E.
38° 02'·05S., 144° 47'·91E.
38° 02'·82S., 144° 47'·91E.
38° 02'·76S., 144° 36'·71E.
38° 03'·05S., 144° 34'·70E.
38° 02'·31S., 144° 33'·52E.

2. Vessels will display appropriate lights and shapes and will monitor VHF Ch 12.
3. Mariners are advised to navigate with caution in the area and are requested to maintain a minimum passing distance of 500m.
(WGS84 DATUM)

Chart affected — Aus 143**5782(T)/25 AUSTRALIA - Victoria - Works.**

Source: Australian Notice 24/1057(T)/25

1. On or about 5 December 2025, vessel *Ocean Dynasty* will be conducting survey operations in an area bounded by the following positions:

39° 15'·72S., 147° 19'·34E.
39° 20'·61S., 147° 25'·98E.
39° 31'·47S., 147° 26'·00E.
39° 33'·40S., 147° 23'·19E.
39° 33'·38S., 146° 39'·18E.
39° 23'·07S., 146° 49'·84E.
39° 23'·03S., 147° 06'·25E.

5782(T)/25 AUSTRALIA - Victoria - Works. (continued)

2. Two subsurface scientific moorings exist on the seabed in the following positions:

39° 15'·2S., 147° 19'·4E.
39° 26'·2S., 146° 45'·0E.
39° 22'·0S., 146° 56'·3E.
39° 22'·5S., 147° 13'·2E.
39° 30'·1S., 146° 58'·0E.
39° 27'·1S., 147° 19'·6E.

3. A special light-buoy, *Fl.Y.3-2s*, may be deployed in the vicinity of the above positions.

4. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — Aus 357 — Aus 802



(19) NEW ZEALAND

3261(T)/22 NEW ZEALAND - North Island - Buoy.

Source: New Zealand Notice 15/51(T)/22

1. A yellow wave buoy, *Fl.3s*, has been deployed, until further notice, in position 39° 28'·22S., 176° 53'·67E. (WGS84 DATUM)

Chart affected — NZ 5612

2876(T)/23 NEW ZEALAND - South Island - Light-beacon.

Source: New Zealand Notice 16/56(T)/23

1. The lit beacon No. 70, *Fl(3)R.6s*, in position 45° 52'·613S., 170° 31'·275E., has been temporarily removed until further notice.
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Chart affected — NZ 6612

3371(P)/23 NEW ZEALAND - South Island - Works. Jetties. Restricted area.

Source: New Zealand Notice 18/61(P)/23

1. Until further notice, demolition work to remove No.4, No.5 and No.6 jetties is underway.
2. An exclusion zone has been established bounded by the following positions:
43° 36'·281S., 172° 43'·198E.
43° 36'·380S., 172° 43'·090E.
43° 36'·290S., 172° 43'·010E.
43° 36'·248S., 172° 43'·035E.
3. No vessel is permitted to enter the exclusion zone without consent, and mariners are requested to keep clear of the area, and exercise caution when accessing adjacent jetties.
4. All vessels will maintain a listening watch on Lyttelton Harbour Radio VHF channel 12.
5. Charts will be updated when full details are available. (WGS84 DATUM)

Chart affected — NZ 6321

550(T)/24 NEW ZEALAND - South Island - Buoy.

Source: New Zealand Notice 2/26(T)/24

1. A lit wave buoy, *Fl(5)Y.20s*, has been deployed in position 41° 12'·200S., 174° 20'·930E., until further notice.
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Charts affected — NZ 6153 — NZ 6154

3622(P)/24 NEW ZEALAND - South Island - Light-beacons.

Source: New Zealand Notice 14/55(P)/24 and New Zealand Lights List Corrections 14/24

1. Mariners are advised that the light characteristics of the lateral light-beacons in Upper Harbour, Victoria Channel and Dunedin Wharves have been altered to *Fl.R.3s* and *Fl.G.3s* respectively along the marked channel between the positions 45° 49'·71S., 170° 37'·24E. and 45° 52'·85S., 170° 30'·76E..
2. Mariners are advised to refer to the Admiralty Lights List, Volume K, light entries K4373.3 to K4375.1 for updated information.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. These changes will be included in the next New Edition of Chart NZ6612. (WGS84 DATUM)

Chart affected — NZ 6612

4285(T)/24 NEW ZEALAND - North Island - Scientific instruments.

Source: New Zealand Notice 18/73(T)/24

1. Subsurface scientific instruments have been deployed at the following locations until further notice:

39° 54'·09S., 173° 55'·73E.

39° 51'·20S., 174° 12'·86E.

39° 59'·92S., 174° 14'·05E.

2. Mariners are requested to remain at least 500 metres clear of the charted positions. Mariners should avoid anchoring, taking the ground or ground fishing.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — NZ 45**5767(P)/24 NEW ZEALAND - South Island - Depths.**

Source: New Zealand Notice 24/83(P)/24

1. A recent hydrographic survey (2024) in the vicinity of Otago Harbour has indicated changes to charted features and depths. The most significant change is as follows:

Depth Position

9·7m 45° 45'·07S., 170° 41'·80E.

2. Mariners are advised to navigate with caution in the area.
3. Charting action will take place in due course.
(WGS84 DATUM)

Chart affected — NZ 6612**2575(T)/25 NEW ZEALAND - North Island - Dredged depth. Rocks.**

Source: New Zealand Notice 11/38(T)/25

1. Mariners are advised that the depth of the dredged area at Berth 1, centred on position 39° 03'·377S., 174° 01'·928E., is temporarily reduced from 8·5m to 6·4m until further notice.
2. Underwater rocks have been identified in the following positions:

Depth

9·5m

7·8m

Position

39° 03'·366S., 174° 01'·943E.

39° 03'·364S., 174° 01'·939E.

3. Mariners are advised to navigate with caution in the area and consult the local Harbourmaster for information on the latest depths.
(WGS84 DATUM)

Chart affected — NZ 4432**2644(T)/25 NEW ZEALAND - North Island - Restricted area.**

Source: New Zealand Notice 11/39(T)/25

1. Until further notice, the Master of any vessel greater than 500 gross tonnes will not cause that vessel to enter the following exclusion zone:
Mōtītī Island, a circle of 2·0 nautical miles radius centred on position 37° 36'·43S., 176° 25'·14E.
2. This direction may be amended, extended or rescinded at any time by the Harbourmaster as considered necessary for the purpose of maritime safety.
3. Mariners are advised to exercise caution when navigating in the area.
(WGS84 DATUM)

Charts affected — NZ 54 — NZ 541

4947(T)/25 NEW ZEALAND - North Island - Scientific instruments.

Source: New Zealand Notice 21/61(T)/25

1. Subsurface scientific instruments have been deployed at the following locations until further notice:

37° 08'·09S., 174° 31'·98E.
 37° 08'·82S., 174° 27'·74E.
 37° 09'·05S., 174° 32'·61E.
 37° 09'·80S., 174° 28'·31E.
 37° 10'·1S., 174° 33'·2E.
 37° 10'·8S., 174° 28'·9E.

2. Mariners should avoid anchoring, taking the ground or ground fishing.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — NZ 42 — NZ 43 — NZ 4314**5439(T)/25 NEW ZEALAND - South Island - Buoy.**

Source: New Zealand Notice 23/68(T)/25

1. A lit yellow wave buoy with *AIS, Fl(5), Y.20s4M*, (MMSI 995121225), has been deployed at position 46° 38'·00S., 168° 22'·05E., until further notice.
2. Mariners are advised to exercise caution when navigating in the area.
(WGS84 DATUM)

Charts affected — NZ 681 — NZ 6821**5700(P)/25 NEW ZEALAND - South Island - Light.**

Source: New Zealand Notice 24/71(P)/25

1. A new port entry light has been installed at Victoria Wharf with the following characteristics:

<i>Name</i>	<i>Description</i>	<i>Sectors</i>	<i>Position</i>
U Shed Sector Light	F.WRG.11m2M	F.R 251·75° - 252·25° (0·5°) F.W 252·25° - 252·75° (0·5°) F.G 252·75° - 253·25° (0·5°)	45° 52'·66S., 170° 30'·86E.

2. Mariners are advised to navigate with caution in the area.
3. Chart NZ6612 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — NZ 6612**5712(T)/25 NEW ZEALAND - North Island - Restricted areas. General information.**

Source: New Zealand Notice 24/70(T)/25

1. *Mariners are advised that Controlled Area Notices are in place for: Great Barrier Island (Aotea Island), Great Mercury Island (Ahuahu), Te Hauturu-o-Toi / Little Barrier Island, Te Rawhiti Inlet in the Bay of Islands and Waiheke Island.
2. The Controlled Area Notices outline restrictions to some anchoring and fishing to prevent the spread of exotic Caulerpa.
3. *For full restrictions and prohibited activities in these areas, mariners are advised to refer to the anchoring and fishing rules to stop the spread of exotic Caulerpa. Information is available at the following website: <https://www.mpi.govt.nz/biosecurity/exotic-pests-and-diseases-in-new-zealand/long-term-biosecurity-management-programmes/exotic-caulerpa-seaweeds-caulerpa-brachypus-and-caulerpa-parvifolia-in-new-zealand/the-legal-rules-for-boating-and-fishing-to-stop-the-spread-of-exotic-caulerpa/>
4. *Former Notice 3698(T)/25 is cancelled.
*Indicates new or revised entry

Charts affected — NZ 522 — NZ 531 — NZ 5125 — NZ 5324**5741(P)/25 NEW ZEALAND - North Island - Marine Reserves.**

Source: New Zealand Bulletin 24/25 General Notice

1. Mariners are advised that new marine protected areas are now in effect in the Hauraki Gulf / Tīkapa Moana / Te Moananui ā Toi.

5741(P)/25 NEW ZEALAND - North Island - Marine Reserves. (continued)

2. See the Department of Conservation website for the full detailed extents and restrictions: <https://www.doc.govt.nz/parks-and-recreation/places-to-go/auckland/hauraki-gulf-marine-park/hauraki-gulf-marine-protected-areas/>
3. Charting action will take place in due course.
(WGS84 DATUM)

Charts affected — NZ 52 — NZ 53 — NZ 54 — NZ 522 — NZ 531 — NZ 532 — NZ 5321 — NZ 5324



(20) PACIFIC OCEAN

679(T)/14 SOUTH PACIFIC OCEAN - Vanuatu - Buoyage.Source: mv *Pacific Jewel*

1. The buoy in position 17° 51'·76S., 168° 11'·86E. is reported missing.
2. A buoy is reported to exist in position 17° 53'·87S., 168° 14'·22E.
(All positions are referred to WGS84 Datum)

Charts affected — 1494 — 1570 — 1576**4792(T)/18 SOUTH PACIFIC OCEAN - Fiji Islands - Beacons.**

Source: Fiji HO

1. Unlit beacons are damaged in the following positions:
16° 44'·45S., 179° 21'·16E.
16° 44'·91S., 179° 20'·91E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 378**6384(T)/19 NORTH PACIFIC OCEAN - Data buoys.**

Source: NOAA

1. *The National Oceanic and Atmospheric Administration (NOAA) maintains an array of buoys called Tropical Atmosphere Ocean (TAO) in the Pacific Ocean.
2. *The TAO buoys, grey, 2 metre toroid buoys with radar reflectors, which make up the array are located in the following revised positions:

8° 01'·7N., 94° 58'·3W.	5° 00'·5N., 154° 57'·9W.
*5° 03'·6N., 94° 57'·3W.	1° 59'·2N., 154° 58'·4W.
*1° 56'·7N., 95° 28'·2W.	0° 00'·4N., 154° 56'·4W.
*0° 04'·3N., 95° 34'·2W.	1° 58'·4S., 155° 01'·4W.
1° 58'·8S., 95° 11'·9W.	4° 59'·3S., 154° 58'·7W.
4° 57'·8S., 94° 59'·3W.	8° 15'·7S., 155° 03'·4W.
8° 00'·0S., 95° 15'·1W.	7° 59'·7N., 170° 05'·6W.
*8° 02'·2N., 110° 10'·3W.	5° 00'·1N., 170° 00'·7W.
5° 00'·1N., 110° 03'·5W.	2° 01'·7N., 170° 00'·6W.
2° 00'·9N., 110° 02'·9W.	0° 02'·1S., 170° 01'·4W.
0° 01'·9N., 109° 55'·1W.	2° 09'·6S., 170° 01'·9W.
*1° 58'·3S., 109° 57'·0W.	5° 00'·6S., 170° 00'·7W.
4° 58'·4S., 109° 58'·8W.	7° 23'·9S., 168° 24'·3W.
7° 57'·5S., 110° 04'·8W.	7° 59'·9N., 179° 53'·3W.
8° 01'·4N., 125° 00'·7W.	5° 00'·6N., 179° 53'·9W.
5° 04'·2N., 124° 57'·2W.	2° 01'·6N., 179° 50'·2W.
1° 57'·6N., 125° 04'·4W.	0° 02'·4N., 179° 57'·1W.
*0° 10'·9S., 124° 23'·1W.	1° 59'·5S., 179° 52'·6W.
*2° 06'·0S., 124° 52'·0W.	*4° 59'·4S., 179° 43'·6W.
4° 59'·4S., 124° 57'·4W.	8° 00'·6S., 179° 56'·5E.
7° 58'·8S., 124° 59'·0W.	8° 03'·5N., 165° 08'·2E.
*9° 00'·1N., 140° 14'·9W.	*5° 04'·8N., 165° 00'·4E.
5° 01'·3N., 139° 59'·8W.	*0° 04'·1N., 165° 09'·7E.
1° 58'·2N., 140° 02'·0W.	*2° 00'·0S., 165° 00'·0E.
0° 02'·0N., 139° 56'·3W.	5° 01'·0S., 165° 10'·0E.
2° 02'·6S., 140° 01'·6W.	*2° 02'·0N., 164° 59'·7E.
5° 00'·2S., 139° 55'·1W.	
7° 57'·8N., 155° 00'·2W.	

3. Mariners are advised to give all TAO buoys a 5 nautical mile wide berth.
* Indicates new or revised entry.

6384(T)/19 NORTH PACIFIC OCEAN - Data buoys. (continued)

4. Former Notice 5955(T)/18 is cancelled.
(WGS84 DATUM)

Charts affected — 761 — 4051 — 4052 — 4060 — 4061 — 4062 — 4506 — 4604 — 4605 — 4606 — 4607 — 4615 — 4617 — 4618 — 4619 — 4624 — 4625 — 4626 — 4629 — 4632 — 4653 — 4802 — 4808 — 4811

1534(P)/20 SOUTH PACIFIC OCEAN - Solomon Islands - Depths.

Source: Australian Notice 4/184(P)/20

1. Depths less than charted exist in areas bounded by the following positions:

8° 15'·07S., 157° 11'·77E.
8° 15'·36S., 157° 11'·71E.
8° 15'·43S., 157° 11'·52E.
8° 15'·78S., 157° 11'·47E.
8° 15'·78S., 157° 12'·00E.
8° 15'·07S., 157° 11'·89E.
and
8° 19'·68S., 157° 11'·83E.
8° 21'·27S., 157° 12'·62E.
8° 21'·09S., 157° 13'·14E.
8° 19'·05S., 157° 12'·30E.
8° 19'·17S., 157° 11'·76E.

(WGS84 DATUM)

Chart affected — SLB 102

2356(T)/20 NORTH PACIFIC OCEAN - Buoyage.

Source: JAMSTEC

1. Scientific instruments, Triton buoys, have been established in the following positions:

<i>Number</i>	<i>Position</i>
* 4	0° 01'·0N., 155° 57'·6E.
* 10	7° 52'·1N., 136° 29'·5E.
* 40	12° 53'·7N., 136° 54'·3E.

2. Former Notice 5147(T)/18 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 763 — 4506 — 4507 — 4604 — 4622

5433(P)/20 SOUTH PACIFIC OCEAN - Tuvalu - Depths. Drying heights.

Source: Government of Tuvalu

1. Recent Lidar survey information has shown that numerous depths and drying heights less than charted exist at Funafuti Atoll. The most significant are as follows:

<i>Depth(m)</i>	<i>Position</i>
6·6	8° 26'·018S., 179° 06'·239E.
4·2	8° 26'·339S., 179° 05'·518E.
4·7	8° 26'·582S., 179° 05'·736E.
25·5	8° 26'·921S., 179° 07'·152E.
15·9	8° 27'·19S., 179° 06'·62E.
4·9	8° 27'·91S., 179° 04'·40E.
7·9	8° 27'·97S., 179° 04'·54E.
2·1	8° 28'·18S., 179° 04'·69E.
18·5	8° 27'·92S., 179° 07'·35E.
0·1	8° 28'·43S., 179° 10'·82E.
2·8	8° 29'·26S., 179° 03'·55E.
3·4	8° 29'·45S., 179° 03'·88E.
5·6	8° 29'·49S., 179° 05'·89E.
14·2	8° 29'·664S., 179° 10'·629E.
9·2	8° 30'·39S., 179° 04'·48E.
2·0	8° 30'·53S., 179° 04'·73E.

5433(P)/20 SOUTH PACIFIC OCEAN - Tuvalu - Depths. Drying heights. (continued)

12·5	8° 30'·48S., 179° 06'·09E.
0·9	8° 31'·22S., 179° 03'·82E.
1·3	8° 31'·54S., 179° 04'·27E.
9·8	8° 31'·09S., 179° 04'·81E.
15·7	8° 31'·15S., 179° 05'·72E.
14·0	8° 31'·11S., 179° 07'·73E.
8·3	8° 30'·440S., 179° 11'·598E.
15·7	8° 30'·699S., 179° 11'·221E.
7·6	8° 30'·847S., 179° 11'·610E.
10·1	8° 32'·202S., 179° 03'·719E.
19·4	8° 32'·25S., 179° 08'·57E.
13·6	8° 32'·819S., 179° 03'·523E.
20·0	8° 32'·803S., 179° 03'·926E.
20·8	8° 32'·25S., 179° 08'·57E.
0·1	8° 33'·192S., 179° 03'·903E.
1·4	8° 33'·00S., 179° 05'·30E.
21·5	8° 33'·076S., 179° 07'·381E.
18·8	8° 33'·53S., 179° 06'·24E.
1·2	8° 34'·01S., 179° 04'·95E.
25	8° 34'·210S., 179° 06'·627E.
11·4	8° 34'·265S., 179° 07'·460E.
0·8	8° 34'·42S., 179° 05'·65E.
8	8° 34'·93S., 179° 05'·92E.
4·4	8° 36'·16S., 179° 04'·98E.
6·1	8° 36'·16S., 179° 05'·70E.

Drying Height (m)***Position***

0·1	8° 30'·345S., 179° 11'·756E.
0·1	8° 30'·725S., 179° 11'·680E.

- Mariners are advised to navigate with caution in the area.
- These changes will be included in the next New Edition of Chart 2983.
(WGS84 DATUM)

Chart affected — 2983**2221(T)/21 SOUTH PACIFIC OCEAN - Fiji Islands - Wreck.**

Source: Maritime Safety Authority of Fiji, HYDROPAC 988/21(83) and Fiji CNW 19/21

- A stranded wreck has been reported in position 16° 46'·69S., 179° 20'·09E.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 378**4077(P)/22 SOUTH PACIFIC OCEAN - Fiji Islands - Submarine power cables.**

Source: Fijian Coastal Warning 58/22

- A submarine power cable is being laid between Malau and Mali Island, joining the following positions:
 - 16° 20'·95S., 179° 22'·25E.
 - 16° 21'·18S., 179° 22'·32E.
 - 16° 21'·27S., 179° 22'·34E.
 - 16° 21'·51S., 179° 22'·34E.
 - 16° 21'·58S., 179° 22'·32E.
- A submarine power cable is being laid between Mali Island and Vorovoro Island, joining the following positions:
 - 16° 20'·70S., 179° 19'·40E.
 - 16° 20'·70S., 179° 19'·56E.
- Mariners are advised to navigate with caution in the area.
- Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 377 — 384

4402(P)/23 SOUTH PACIFIC OCEAN - Submarine cables.

Source: French Notice 38/15(T)/23

1. Submarine cables have been laid joining the following positions:

<i>Cable Number</i>	<i>Position</i>
-------------------------	-----------------

1	17° 45'·19S., 149° 19'·29W.
	17° 45'·69S., 149° 19'·49W.
	17° 45'·89S., 149° 20'·09W.
	17° 56'·49S., 149° 22'·19W.
	18° 01'·1S., 149° 29'·8W.
	20° 16'·0S., 150° 11'·2W.
	22° 15'·2S., 150° 52'·0W.
2	22° 26'·8S., 151° 20'·5W.
	22° 18'·5S., 151° 12'·9W.
	22° 14'·5S., 151° 00'·5W.
	22° 15'·1S., 150° 52'·0W.
3	22° 15'·1S., 150° 52'·0W.
	22° 53'·7S., 150° 05'·1W.
	22° 21'·1S., 149° 30'·2W.

2. Charts will be updated when full details are available.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 4654 — 4656 — 4657

4404(P)/23 SOUTH PACIFIC OCEAN - Nouvelle-Calédonie - Depth.

Source: French Notice 41/11(P)/23

1. A depth of 9·4m is reported to exist in position 22° 12'·30S., 166° 19'·68E.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2463

1084(T)/24 SOUTH PACIFIC OCEAN - Kiribati - Buoyage. Automatic Identification System.

Source: IIC Technologies

1. *Aids to Navigation in the Approaches to Betio are reported as being unreliable.
2. The lateral light-buoy, *Fl.R.3s No 6*, in position 1° 23'·30N., 172° 56'·42E. is reported missing.
3. *The East Cardinal light-buoy, *Q(3)7s*, in position 1° 22'·59N., 172° 55'·70E. is reported missing.
4. *An uncharted East Cardinal Mark, has been reported in position 1° 21'·98N., 172° 56'·23E.
5. Mariners are advised to navigate with caution in the area.
6. *Former notice 4711(T)/23 is cancelled
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 729

2585(T)/24 SOUTH PACIFIC OCEAN - Solomon Islands - Buoyage.

Source: Australian Notice 10/387(T)/24

1. The port lateral light buoy, *Fl.R.3s* (9° 46'·81S., 160° 51'·08E.), and the starboard lateral light buoy, *Fl.G.3s* (9° 46'·54S., 160° 50'·48E.), are off station.

Chart affected — SLB 101

3929(P)/24 SOUTH PACIFIC OCEAN - Fiji Islands - Works. Rock. Obstruction.

Source: Fiji Hydrographic Office

1. Dredging works are taking place in the vicinity of 17° 36'·152S., 177° 26'·403E.
2. Burt Rock has been reported to be removed from position 17° 36'·212S., 177° 26'·379E.
3. An obstruction has been reported to be removed from position 17° 36'·135S., 177° 26'·380E.

3929(P)/24 SOUTH PACIFIC OCEAN - Fiji Islands - Works. Rock. Obstruction. (continued)

4. Mariners are advised to navigate with caution in the area.
5. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 389 — 1670

4829(P)/24 SOUTH PACIFIC OCEAN - Solomon Islands - Depths.

Source: Australian Notice 20/768(P)/24

1. Latest survey indicates, shoaler depths than those charted, may exist between Diamond Narrows (8° 15'·62S., 157° 11'·69E.) and Munda Bar (8° 20'·94S., 157° 12'·72E.).
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — SLB 102 — SLB 302

5109(P)/24 SOUTH PACIFIC OCEAN - Nouvelle-Calédonie - Depths. Lights. Recommended tracks.

Source: French Chart 7755

1. Depths less than charted exist within Baie de Canala to Passe du Cap Bayes. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
6m	21° 02'·80S., 165° 24'·52E.
14·5m	21° 03'·80S., 165° 29'·06E.
6·2m	21° 07'·13S., 165° 29'·10E.
7·1m	21° 07'·71S., 165° 29'·80E.
11m	21° 04'·11S., 165° 33'·54E.
7·6m	21° 04'·19S., 165° 34'·70E.
4·8m	21° 07'·89S., 165° 31'·86E.
12·9m	21° 15'·47S., 165° 38'·19E.
18·1m	21° 12'·59S., 165° 40'·17E.
24m	21° 13'·35S., 165° 40'·97E.
22m	21° 13'·64S., 165° 41'·90E.
21m	21° 13'·75S., 165° 42'·27E.
26·5m	21° 17'·16S., 165° 43'·16E.
14m	21° 17'·91S., 165° 43'·86E.
0·7m	21° 10'·31S., 165° 45'·49E.
3·5m	21° 24'·56S., 165° 50'·05E.
37m	21° 21'·05S., 165° 52'·96E.
6m	21° 18'·92S., 165° 58'·14E.
53m	21° 16'·59S., 165° 53'·73E.
25·5m	21° 12'·30S., 165° 41'·76E.

2. The light in position 21° 23'·08S., 165° 52'·92E. has been amended to Dir Iso.4s12M.
3. The light in position 21° 23'·19S., 165° 53'·06E. has been amended to Dir Iso.4s12M.
4. The light in position 21° 21'·37S., 165° 52'·67E. has been amended to Q.6M.
5. A recommended track has been established joining the following positions:

21° 03'·39S., 165° 26'·17E.
21° 01'·32S., 165° 26'·19E.
6. A recommended track has been established joining the following positions:

21° 08'·89S., 165° 38'·74E.
21° 03'·67S., 165° 31'·50E.
21° 03'·36S., 165° 25'·53E.
7. A recommended track has been established joining the following positions:

21° 14'·27S., 165° 43'·07E.
21° 08'·45S., 165° 35'·46E.

5109(P)/24 SOUTH PACIFIC OCEAN - Nouvelle-Calédonie - Depths. Lights. Recommended tracks.
(continued)

8. A recommended track has been established joining the following positions:

21° 15'·41S., 165° 38'·49E.

21° 14'·58S., 165° 39'·75E.

9. A recommended track has been established joining the following positions:

21° 17'·20S., 165° 43'·36E.

21° 16'·19S., 165° 42'·29E.

21° 12'·53S., 165° 43'·79E.

10. A recommended track has been established joining the following positions:

21° 22'·14S., 165° 50'·10E.

21° 21'·25S., 165° 50'·09E.

21° 20'·93S., 165° 49'·69E.

11. A recommended track has been established joining the following positions:

21° 22'·52S., 165° 49'·59E.

21° 20'·94S., 165° 51'·72E.

12. A recommended track has been established joining the following positions:

21° 25'·65S., 165° 56'·60E.

21° 23'·80S., 165° 56'·04E.

13. Mariners are advised to navigate with caution in the area.

(UNDETERMINED DATUM)

Charts affected — 339 — 2928

5675(P)/24 SOUTH PACIFIC OCEAN - Solomon Islands - Depths. Coral.

Source: Australian Notice 24/938(P)/24

1. Latest survey information has shown that shoaler depths than those charted may exist in the Blackett Strait in an area bounded by the following positions:

8° 07'·55S., 157° 06'·68E.

8° 07'·37S., 157° 09'·94E.

8° 09'·85S., 157° 09'·94E.

8° 08'·92S., 157° 06'·68E.

2. Drying coral exists in position 8° 07'·94S., 157° 09'·74E.

3. Mariners are advised to navigate with caution in the area.

4. Charts will be updated when full details are available.

(WGS84 DATUM)

Charts affected — SLB 102 — SLB 302

5815(T)/24 SOUTH PACIFIC OCEAN - Solomon Islands - Buoy.

Source: Australian Notice 24/940(T)/24

1. The isolated danger light-buoy, *Fl(2)10s*, in position 9° 25'·89S., 159° 57'·76E., is unlit.
(WGS84 DATUM)

Chart affected — SLB 101

572(T)/25 SOUTH PACIFIC OCEAN - Fiji Islands - Quay.

Source: Maritime Safety Authority of Fiji Notice 01/25

1. Due to extensive damage, the Ellington wharf is closed for all operations in the vicinity of position 17° 20'·249S., 178° 13'·328E.

2. Consult the local port authorities for the latest information.

(WGS84 DATUM)

Charts affected — 387 — 748 — 750

583(T)/25 SOUTH PACIFIC OCEAN - Tuvalu - Light-beacon.

Source: NAVAREA XIV Warning 43/24

1. The Strickland Rock Port Lateral Beacon, LFL.5s in position 8° 33'·68S., 179° 07'·01E. has been reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2983**1127(P)/25 SOUTH PACIFIC OCEAN - Nouvelle-Calédonie - Depths. Recommended tracks. Leading lights. Leading line.**

Source: French Chart 6949

1. Depths less than charted exist within the vicinity of Cap Bégat to and Récif Intérieur. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
26·5m	21° 29'·48S., 166° 06'·58E.
23m	21° 33'·34S., 166° 11'·32E.
30m	21° 33'·33S., 166° 12'·03E.
26·5m	21° 33'·69S., 166° 13'·12E.

2. Two-way recommended tracks have been established, joining the following positions:

21° 28'·17S., 165° 57'·36E.
 21° 23'·81S., 165° 56'·04E.
 and
 21° 35'·49S., 166° 14'·36E.
 21° 29'·01S., 166° 05'·82E.
 and
 21° 36'·06S., 166° 17'·69E.
 21° 31'·50S., 166° 09'·09E.

3. The leading lights at Pointe Méanh (Méa) have been amended as follows:

<i>Leading Light</i>	<i>Characteristic</i>	<i>Position</i>
Front	Dir Fl(3)12s10/7M	21° 28'·19S., 166° 03'·20E.
Rear	Dir Fl(3)12s10/7M	21° 27'·99S., 166° 02'·58E.

The bearing of the associated leading line has been amended to 289°.

Mariners are advised to navigate with caution in the area.

(IGN 1972 DATUM)

Charts affected — 339 — 936 — 2928**1680(T)/25 SOUTH PACIFIC OCEAN - Solomon Islands - Light.**

Source: Australian Notice 6/276(T)/25

1. The light, Fl.10s 11m 10M (8° 48'·9S., 157° 45'·2E.), is unlit;
2. Mariners are advised to navigate with caution within the area
(WGS84 DATUM)

Charts affected — 4604 — SLB 302**2908(T)/25 SOUTH PACIFIC OCEAN - Fiji Islands - Buoy.**

Source: Fiji Coastal Navigation Warning 34/25

1. The South Cardinal Buoy, South Thurston, *Q(6)+LFL.15s*, in position 18° 08'·186S., 178° 24'·729E. is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1660**4294(T)/25 SOUTH PACIFIC OCEAN - Solomon Islands - Light-beacons.**

Source: Australian Notice 18/805(T)/25

1. The light beacon, Fl(3)R.10s 11m 5M (8° 05'·55S., 156° 51'·82E.), is unlit and the topmark has been destroyed.

4294(T)/25 SOUTH PACIFIC OCEAN - Solomon Islands - Light-beacons. (continued)

- The topmark on light beacon, Fl(2)G.10s 9m 3M (8° 05'·81S., 156° 51'·66E.), has been destroyed.
(WGS84 DATUM)

Charts affected — SLB 102 — SLB 301 — SLB 302

4580(T)/25 SOUTH PACIFIC OCEAN - Fiji Islands - Lights.

Source: Maritime Safety Authority of Fiji

- The following lights are reported to be temporarily unlit:

<i>Characteristic</i>	<i>Position</i>
LFl(2)30s14m12M	18° 08'·02S., 178° 41'·22E.
Fl.5s70m15M	16° 13'·41S., 179° 05'·77E.

- Mariners are advised to navigate with caution in the area.
- *Former Notice 3404(T)/25 is cancelled.
- *Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 384 — 440 — 441 — 488 — 744 — 745 — 749 — 1674 — 2691 — 4632 — 4638

4759(P)/25 SOUTH PACIFIC OCEAN - Kiribati - Submarine cable. Works.

Source: MICT Kiribati

- Submarine cable laying works are taking place along a line joining the following positions:

1° 19'·77N., 172° 59'·66E.
 1° 18'·56N., 172° 59'·82E.
 1° 17'·98N., 172° 59'·45E.
 1° 14'·68N., 172° 56'·05E.
 1° 12'·84N., 172° 53'·27E.
 1° 09'·78N., 172° 43'·01E.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 729 — 730 — 731

4814(T)/25 SOUTH PACIFIC OCEAN - Solomon Islands - Buoy.

Source: Australian Notice 20/892(T)/25

- The special light buoy, *Fl.Y.10s* (9° 25'·45S., 159° 57'·53E.), has been temporarily removed.
- Former Notice 5807(T)/24 is cancelled
(WGS84 DATUM)

Chart affected — SLB 101

4921(P)/25 SOUTH PACIFIC OCEAN - Solomon Islands - Depths.

Source: NE 4922

- Latest survey data indicates depths less than charted may exist in and around the islands and reefs between Naru Island (8° 08'·30S., 156° 55'·10E.) and Sepo Island (8° 03'·20S., 156° 49'·50E.).
- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
- *Former Notice 935(P)/18 is cancelled.
- *NOTE: Content of Notice unchanged, re-issued to include Chart SLB102.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — SLB 102 — SLB 301 — SLB 302

5209(T)/25 NORTH PACIFIC OCEAN - General information.

Source: Japanese Notice 44/5479(T)/25

- A rocket launch is due to take place from the Tanegashima Space Center between 6 December 2025 to 30 January 2026.

5209(T)/25 NORTH PACIFIC OCEAN - General information. (continued)

2. A sea warning area will be established, bounded by the coastline and the following positions:

30° 25'·67N., 130° 58'·35E.
 30° 26'·80N., 130° 59'·88E.
 30° 27'·60N., 131° 00'·33E.
 30° 27'·60N., 131° 30'·00E.
 30° 15'·60N., 131° 30'·00E.
 30° 15'·60N., 130° 57'·82E.
 30° 21'·95N., 130° 57'·82E.
 30° 22'·33N., 130° 57'·68E.

3. Between 7 December 2025 and 31 January 2026, rocket debris is predicted to fall within areas bounded by the following positions:

30° 03'·0N., 132° 22'·0E.
 30° 30'·0N., 132° 26'·0E.
 30° 20'·0N., 133° 40'·0E.
 30° 03'·5N., 133° 38'·2E.
 29° 54'·4N., 133° 26'·3E.

4. and

29° 03'·1N., 139° 52'·2E.
 29° 11'·2N., 139° 40'·0E.
 29° 57'·6N., 139° 47'·1E.
 30° 06'·0N., 140° 15'·6E.
 29° 30'·9N., 144° 07'·2E.
 29° 23'·9N., 144° 19'·2E.
 28° 35'·9N., 144° 11'·7E.
 28° 29'·1N., 143° 42'·0E.

5. and

24° 47'·0N., 160° 46'·0E.
 26° 42'·0N., 161° 26'·0E.
 24° 16'·0N., 168° 20'·0E.
 22° 22'·0N., 167° 40'·0E.

6. Mariners are advised to navigate with caution within these areas.
 (WGS84 DATUM)

Charts affected — 2347 — 2412 — 3237 — 3551 — 4052 — 4053 — 4509 — 4510 — 4521 — JP 1221

5385(P)/25 SOUTH PACIFIC OCEAN - Fiji Islands - Coastline. Marina. Wreck.

Source: UKHO

- There have been extensive changes to the coastline of Nawi Island due to construction of a new marina, in the vicinity of 16° 46'·51S., 179° 19'·996E.
- *A dangerous wreck has been reported in position 16° 46'·647S., 179° 20'·337E.
- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
- *Former Notice 2501(P)/21 is cancelled.
 *Indicates new or revised entry.
 (WGS84 DATUM)

Chart affected — 378

5441(T)/25 SOUTH PACIFIC OCEAN - Buoy.

Source: Ecuadorean Daily Notice 29/10/25

- An *ODAS* buoy, has been deployed until further notice in position 0° 28'·9S., 92° 14'·8W.
 (WGS84 DATUM)

Charts affected — 4051 — 4062 — 4618 — 4811

(21) ALEUTIAN ISLANDS, ALASKA AND WEST COAST OF NORTH AMERICA INCLUDING MEXICO

706(T)/21 UNITED STATES OF AMERICA - West Coast - Disused submarine cable. Foul.

Source: US Coast Guard District 11 LNM 2/18650/21

1. A disused submarine power cable has been reported to foul anchors in Anchorage 8 in the vicinity of position 37° 47'·58N., 122° 21'·48W.
2. Mariners are advised to navigate with caution in the area.
3. For further information contact USCG Sector San Francisco Waterways Management at SFWaterways@uscg.mil (NAD83 DATUM)


Charts affected — 588 — 591**810(P)/23 UNITED STATES OF AMERICA - West Coast - Traffic separation scheme. Area to be avoided.**

Source: IMO Documents COLREG.2/Circ.78 and SN.1/Circ 342

1. Amendments to the existing Traffic Separation Scheme, 'In the Santa Barbara Channel' and to the existing Area to be avoided 'Off the California Coast', have been adopted by the International Maritime Organization (IMO) and are to be implemented at 0000 UTC on 1 June 2023.
2. The details of the amended scheme and Area to be avoided are shown in the accompanying diagram. The numbered positions in the diagram relate to the positions listed below.
3. An extension to the Traffic Separation Scheme 'In the Santa Barbara Channel' will be established as follows:
 - a. The description of the Traffic Separation Scheme 'Between Point Conception and Point Arguello' is replaced by the following:
 - b. A separation zone is bounded by a line connecting the following geographical positions:
 - (1) 34° 29'·15N., 121° 06'·94W.
 - (2) 34° 28'·19N., 121° 07'·26W.
 - (3) 34° 19'·88N., 120° 30'·59W.
 - (4) 34° 20'·84N., 120° 30'·28W.
 - c. A traffic lane for westbound traffic is established between the separation zone and a line connecting the following geographical positions:
 - (5) 34° 30'·11N., 121° 06'·63W.
 - (6) 34° 21'·80N., 120° 29'·96W.
 - d. A traffic lane for eastbound traffic is established between the separation zone and a line connecting the following geographical positions:
 - (7) 34° 27'·23N., 121° 07'·57W.
 - (8) 34° 18'·92N., 120° 30'·91W.
4. The existing Area to be avoided, 'Off the California Coast', will be enlarged. The replacement Area to be avoided limits will be bounded by the following positions:
 - (7) 34° 27'·23N., 121° 07'·57W.
 - (9) 34° 02'·01N., 119° 16'·56W.
 - (10) 33° 59'·77N., 119° 11'·85W.
 - (11) 33° 54'·01N., 119° 16'·87W.
 - (12) 33° 46'·03N., 120° 09'·56W.
 - (13) 33° 49'·02N., 120° 54'·39W.
 - (14) 34° 14'·04N., 121° 11'·90W.
5. These changes will be included in a New Edition of Chart 4911 to be published mid 2023. Charts 2530, 4908, 4910 and 4912 will be updated by Notice to Mariners.
(WGS84 DATUM)

Charts affected — 2530 — 4908 — 4910 — 4912

To accompany Notice to Mariners 810(P)/23

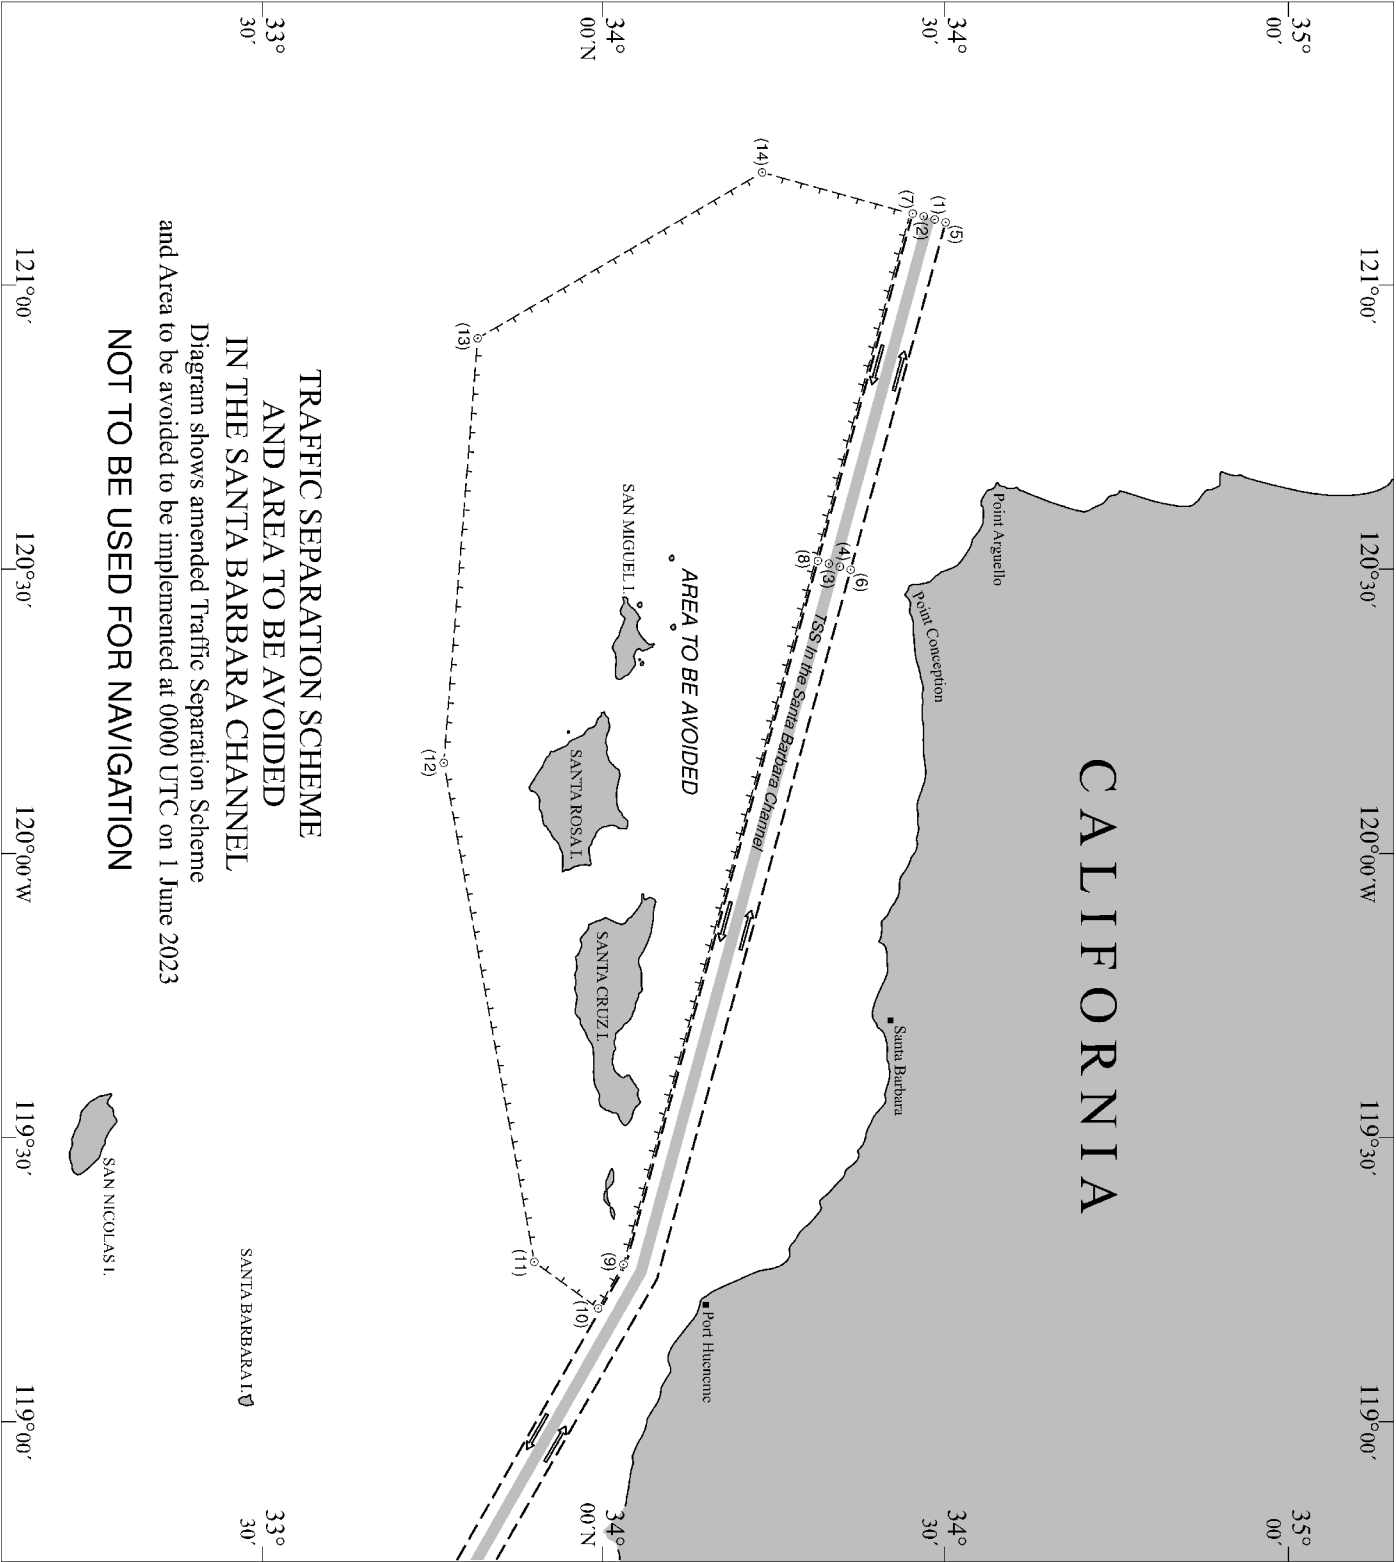

2460(T)/24 CANADA - British Columbia - Restricted area.

Source: Canadian Notice 2/208/24

1. *A voluntary protection zone for shipping has been established off the West Coast of Haida Gwaii in the following positions:

54° 11'·8N., 134° 30'·7W.
 53° 44'·1N., 134° 32'·6W.
 53° 11'·1N., 134° 16'·3W.
 52° 18'·5N., 133° 20'·8W.
 51° 24'·6N., 132° 04'·0W.
 51° 56'·2N., 131° 01'·7W.
 54° 15'·5N., 133° 04'·7W.
 54° 17'·6N., 134° 02'·4W.
 54° 13'·6N., 134° 19'·3W.

2. *For more information, please see Canadian Notice to Mariners bulletin 2/24, Western Edition, dated 23 February 2024, Notice 208. This can be accessed at <https://www.notmar.gc.ca/monthly>
3. *Former Notice 5181(T)/21 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 3754 — 4801 — 4810 — 4920 — 4923 — 4975**32(P)/25 UNITED STATES OF AMERICA - West Coast - Works. Submarine cable.**

Source: Alcatel Submarine Networks

1. *Submarine cable laying operations are taking place, joining the following positions:

32° 18'·6N., 117° 04'·9W.
 32° 07'·2N., 117° 18'·1W.
 31° 55'·4N., 117° 21'·5W.
 31° 48'·2N., 117° 29'·4W.
 31° 44'·6N., 117° 41'·9W.
 31° 08'·4N., 117° 51'·8W.
 31° 03'·5N., 118° 00'·1W.
 31° 04'·6N., 118° 37'·7W.
 30° 58'·3N., 118° 49'·4W.
 30° 57'·6N., 119° 02'·7W.
 31° 09'·1N., 119° 33'·8W.
 31° 12'·4N., 120° 21'·9W.
 31° 38'·9N., 121° 21'·3W.
 31° 39'·6N., 121° 40'·1W.
 31° 46'·1N., 121° 50'·8W.
 31° 58'·5N., 122° 01'·7W.
 32° 07'·2N., 122° 07'·0W.
 32° 33'·3N., 122° 08'·8W.
 32° 51'·0N., 122° 26'·4W.
 33° 03'·3N., 122° 31'·2W.

2.

33° 13'·2N., 122° 43'·1W.
 33° 31'·7N., 122° 45'·0W.
 33° 50'·6N., 123° 03'·3W.
 33° 58'·3N., 123° 05'·2W.
 34° 19'·3N., 123° 23'·7W.
 34° 45'·5N., 123° 34'·5W.
 34° 51'·2N., 123° 40'·6W.
 34° 59'·7N., 124° 03'·1W.
 35° 14'·0N., 124° 17'·2W.
 35° 19'·3N., 124° 27'·7W.
 35° 26'·6N., 124° 32'·7W.
 35° 33'·8N., 124° 32'·1W.
 35° 38'·0N., 124° 28'·8W.
 35° 39'·8N., 124° 25'·7W.

3. Mariners are advised to navigate with caution in the area.

32(P)/25 UNITED STATES OF AMERICA - West Coast - Works. Submarine cable. (continued)

4. Charts will be updated when works are complete.
5. *Former Notice 1375(P)/21 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)


Charts affected — 1029 — 1049 — 2530 — 4050 — 4051 — 4801 — 4802 — 4806 — 4807

302(T)/25 CANADA - British Columbia - General information.

Source: Canadian Notice 10/1105/24

1. North Coast Waterway Management voluntary guidelines have been established to improve water safety on the shipping route between Kitimat and Browning Entrance, within the vicinity of positions 53° 46'·26N., 130° 45'·04W. and 53° 46'·25N., 128° 57'·24W.
2. *For more information, please see Canadian Notice to Mariners bulletin 11/24, Western Edition, dated 29 November 2024, Notice 1105. Further details can be found at the following link:
https://www.notmar.gc.ca/publications/monthly/documents/NorthCoastWaterwayManagementGuidelines_Nov2024.pdf
3. *Former Notice 4752(T)/23 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 3754 — 4923 — 4928 — 4939

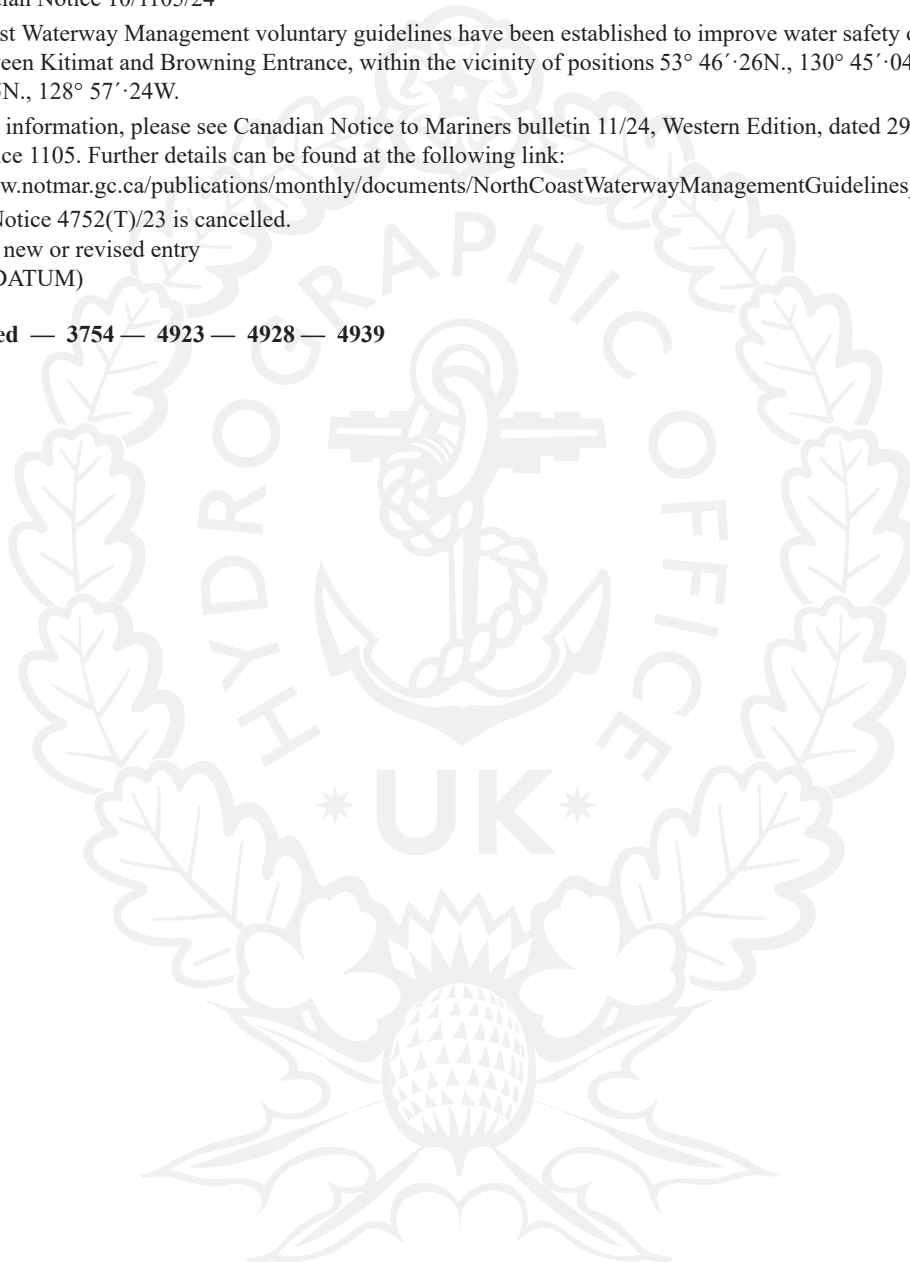

(22) WEST COASTS OF CENTRAL AND SOUTH AMERICA

3467(T)/15 PERU - Precautionary area.

Source: Peruvian Notice 5/34(T)/15

1. A Precautionary area has been established within the area bounded by the following positions:

17° 00'·178S., 72° 06'·687W.

17° 00'·198S., 72° 06'·580W.

17° 00'·305S., 72° 06'·678W.

17° 00'·220S., 72° 06'·753W.

(WGS84 Datum.)

Chart affected — 3084**720(P)/17 MEXICO - Pacific Ocean Coast - Works.**

Source: Mexican Notice 1/399(P)/17

1. Works are taking place to extend Ensenada W groyne, 400m, in a SSW direction in the vicinity of position 31° 50'·63N., 116° 37'·53W.
2. The light-beacon at the head of the groyne will be extinguished and a green buoy, *Fl.G.5s*, will mark the progress of the works.
3. Mariners should navigate with caution in the area.
4. Chart 1938 will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 1938**2263(T)/18 MEXICO - Pacific Ocean Coast - Buoy. Radar beacon.**

Source: Mexican Notices 7/70(T)-71(T)/18

1. The special light-buoy, *Fl.10s*, and associated radar beacon, *Racon(A)*, in position 31° 48'·47N., 116° 39'·23W. are temporarily out of service.
(WGS84 DATUM)

Chart affected — 1938**2630(P)/19 MEXICO - Pacific Ocean Coast - Wreck.**

Source: Mexican Notice 7/80(P)/19

1. A dangerous wreck exists in position 31° 50'·148N., 116° 38'·298W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1938**6272(T)/20 COLOMBIA - Pacific Ocean Coast - Wreck.**

Source: Colombian Notice 195/20

1. A stranded wreck has been reported in position 3° 52'·64N., 77° 04'·50W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2319**4224(T)/22 MEXICO - Pacific Ocean Coast - Buoy.**

Source: Mexican Notice 12/130(T)/22

1. The *No 9* light-buoy, *Fl.G.3s*, in position 27° 55'·070N., 110° 52'·482W. is temporarily out of service.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1105

4288(T)/22 ECUADOR - Bridge.

Source: Ecuadorian Daily Notice 1st July 2022

1. The Guayaquil-Santay bascule bridge in position $2^{\circ} 13' \cdot 07S.$, $79^{\circ} 53' \cdot 00W.$ is restricted to only opening in emergencies and for naval vessels.
(WGS84 DATUM)

Chart affected — 512

4327(T)/22 PERU - Area to be avoided.

Source: Peruvian Notice 5/38(T)/22

1. An area to be avoided has been established, bounded by the following positions:

$12^{\circ} 00' \cdot 12S.$, $77^{\circ} 12' \cdot 72W.$

$12^{\circ} 00' \cdot 18S.$, $77^{\circ} 12' \cdot 25W.$

$12^{\circ} 00' \cdot 64S.$, $77^{\circ} 12' \cdot 31W.$

$12^{\circ} 00' \cdot 58S.$, $77^{\circ} 12' \cdot 79W.$

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1853

2821(T)/23 MEXICO - Pacific Ocean Coast - Buoy.

Source: Mexican Notice 5/60(T)/23

1. The *No 8* light-buoy, *Fl.R.3s*, in position $27^{\circ} 54' \cdot 88N.$, $110^{\circ} 52' \cdot 68W.$, is temporarily out of service.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1105

3307(T)/23 MEXICO - Pacific Ocean Coast - Buoy.

Source: Mexican Notice 8/102(T)/23

1. The safe water light-buoy, *Lfl.10s*, in position $27^{\circ} 52' \cdot 198N.$, $110^{\circ} 50' \cdot 802W.$ is reported out of service.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1105

4153(T)/23 COLOMBIA - Pacific Ocean Coast - Virtual aid to navigation.

Source: Colombian Notice 281/23

1. A virtual aid to navigation (V-AIS), south cardinal topmark, has been established in position $3^{\circ} 53' \cdot 813N.$, $77^{\circ} 04' \cdot 880W.$
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2319

4470(P)/23 PANAMA - Pacific Ocean Coast - Anchor berths. Anchorage areas.

Source: ENC PA5CP005 and ENC US515410

1. Numerous anchorage berths have been established in the approaches to the Panama Canal Pacific entrance.

4470(P)/23 PANAMA - Pacific Ocean Coast - Anchor berths. Anchorage areas. (continued)

2. Anchorage areas with a maximum draft, 8·76m, maximum length, 526 ft, and a circular limit, radius 326·5m, have been established, centred on the following positions:

<i>Designation</i>	<i>Position</i>
PE01	8° 53'·37N., 79° 30'·90W.
PE02	8° 53'·71N., 79° 30'·75W.
PE03	8° 53'·87N., 79° 30'·41W.
PE04	8° 53'·07N., 79° 30'·67W.
PE05	8° 53'·42N., 79° 30'·51W.
PE06	8° 53'·58N., 79° 30'·17W.
PE07	8° 52'·79N., 79° 30'·42W.
PE08	8° 53'·14N., 79° 30'·26W.
PE09	8° 53'·31N., 79° 29'·92W.
PE10	8° 52'·93N., 79° 29'·94W.
PE11	8° 52'·91N., 79° 29'·56W.

3. Anchorage areas with a maximum draft, 14·96m and a circular limit, radius 502·7m, have been established, centred on the following positions:

<i>Designation</i>	<i>Maximum length overall (ft)</i>	<i>Position</i>
PE12	800	8° 52'·48N., 79° 30'·06W.
PE13	800	8° 52'·04N., 79° 29'·70W.
PE14	800	8° 52'·49N., 79° 29'·36W.
PE15	800	8° 52'·90N., 79° 28'·98W.
PE16	800	8° 51'·60N., 79° 29'·36W.
PE17	800	8° 52'·05N., 79° 29'·02W.
PE18	800	8° 52'·46N., 79° 28'·63W.
PE19	800	8° 51'·92N., 79° 28'·46W.
PE20	800	8° 52'·20N., 79° 27'·97W.
PE21	N/A	8° 52'·55N., 79° 27'·52W.
PE22	N/A	8° 52'·91N., 79° 27'·06W.
PE23	800	8° 51'·48N., 79° 28'·10W.
PE24	N/A	8° 51'·69N., 79° 27'·53W.

4. Anchorage areas with a maximum draft of 17·66m and a circular limit, radius 679·6m, have been established, centred on the following positions:

<i>Designation</i>	<i>Maximum length overall (ft)</i>	<i>Position</i>
PE25	1215	8° 51'·32N., 79° 28'·75W.
PE26	N/A	8° 51'·83N., 79° 28'·04W.
PE27	1215	8° 52'·38N., 79° 27'·52W.
PE28	N/A	8° 52'·83N., 79° 26'·86W.
PE29	1215	8° 50'·60N., 79° 28'·46W.
PE30	1215	8° 51'·03N., 79° 27'·61W.
PE31	N/A	8° 51'·74N., 79° 26'·86W.
PE32	1215	8° 50'·27N., 79° 27'·76W.
PE33	N/A	8° 50'·94N., 79° 26'·84W.
PE34	N/A	8° 49'·52N., 79° 27'·61W.
PE35	N/A	8° 50'·17N., 79° 26'·85W.
PE36	N/A	8° 49'·40N., 79° 26'·84W.

4470(P)/23 PANAMA - Pacific Ocean Coast - Anchor berths. Anchorage areas. (continued)

5. Anchorage areas with a maximum draft, 8·53m, maximum length, 526 ft, and a circular limit, radius 326·5m, have been established, centred on the following positions:

<i>Designation</i>	<i>Position</i>
PW01	8° 52'·45N., 79° 31'·48W.
PW02	8° 52'·14N., 79° 31'·69W.
PW03	8° 52'·31N., 79° 32'·03W.
PW04	8° 52'·00N., 79° 32'·27W.
PW05	8° 52'·29N., 79° 31'·14W.
PW06	8° 51'·98N., 79° 31'·35W.
PW07	8° 51'·67N., 79° 31'·58W.
PW08	8° 51'·84N., 79° 31'·93W.
PW09	8° 52'·11N., 79° 30'·81W.
PW10	8° 51'·80N., 79° 31'·02W.
PW11	8° 51'·48N., 79° 31'·24W.
PW12	8° 51'·81N., 79° 30'·58W.
PW13	8° 51'·50N., 79° 30'·80W.

6. Anchorage areas with a maximum draft of 9·76m and a circular limit, radius 502·7m, have been established, centred on the following positions:

<i>Designation</i>	<i>Maximum length overall (ft)</i>	<i>Position</i>
PW14	800	8° 51'·42N., 79° 30'·33W.
PW15	800	8° 51'·04N., 79° 30'·74W.
PW16	800	8° 50'·98N., 79° 31'·33W.
PW17	800	8° 51'·30N., 79° 32'·00W.
PW18	800	8° 50'·73N., 79° 31'·90W.
PW19	800	8° 50'·97N., 79° 29'·98W.
PW20	800	8° 50'·59N., 79° 30'·40W.
PW21	800	8° 50'·42N., 79° 30'·93W.
PW22	800	8° 50'·29N., 79° 31'·52W.
PW23	800	8° 50'·53N., 79° 29'·62W.
PW24	800	8° 50'·06N., 79° 30'·21W.
PW25	800	8° 49'·89N., 79° 30'·75W.
PW26	800	8° 49'·76N., 79° 31'·32W.
PW27	800	8° 49'·97N., 79° 29'·65W.
PW28	N/A	8° 49'·31N., 79° 30'·96W.
PW29	800	8° 49'·86N., 79° 29'·10W.

7. Anchorage areas with a maximum draft of 18·83m and a circular limit, radius 679·6m, have been established, centred on the following positions:

<i>Designation</i>	<i>Maximum length overall (ft)</i>	<i>Position</i>
PW30	1215	8° 50'·09N., 79° 29'·44W.
PW31	N/A	8° 49'·41N., 79° 30'·29W.
PW32	N/A	8° 49'·29N., 79° 28'·76W.
PW33	N/A	8° 49'·32N., 79° 29'·53W.
PW34	N/A	8° 48'·54N., 79° 28'·61W.
PW35	N/A	8° 48'·55N., 79° 29'·37W.
PW36	N/A	8° 47'·78N., 79° 28'·61W.
PW37	N/A	8° 47'·78N., 79° 29'·38W.

8. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
 9. These changes will be included in the next New Edition of Chart CP5.
 10. Chart 5504 will be updated when full details are available.
 (WGS84 DATUM)

Charts affected — 5504 — CP 5

2015(P)/24 NICARAGUA - Pacific Ocean Coast - Buoy.

Source: mv Seleccion

1. The light-buoy, *Fl*, in position 12° 09'·59N., 86° 48'·49W. is reported off station in position 12° 08'·72N., 86° 49'·53W.
 2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

2015(P)/24 NICARAGUA - Pacific Ocean Coast - Buoy. (continued)

3. Chart 1969 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1969

2877(P)/24 COLOMBIA - Pacific Ocean Coast - Marine Reserve.

Source: Colombian Charts 304 and 305

1. A marine reserve has been established, joined by the following positions:
- 4° 31'·2N., 77° 20'·3W.
4° 31'·1N., 77° 32'·0W.
5° 13'·0N., 77° 32'·6W.
2. Chart 2258 will be updated when full details are available.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2258 — 4811

3444(T)/24 CHILE - Estrecho de Magallanes - Anchorage areas. Scientific instruments.

Source: NAVAREA XV 0031/24

1. Sea-floor anchorages with hydrophones attached have been established in the following approximate positions:
- 52° 15'·48S., 69° 02'·60W.
52° 17'·86S., 69° 02'·73W.
52° 16'·45S., 69° 02'·58W.
52° 18'·29S., 69° 06'·73W.
52° 17'·35S., 69° 04'·24W.
52° 18'·49S., 69° 02'·45W.
52° 16'·83S., 69° 08'·43W.
52° 21'·00S., 68° 40'·00W.
2. Mariners are advised to navigate with caution in the area.
(UNDETERMINED DATUM)

Charts affected — 1692 — 1693

3464(T)/24 MEXICO - Pacific Ocean Coast - Firing practice areas.

Source: Mexican Notices 4/23(T)-46(T)/24

1. Firing Practice Areas have been established, joining the following positions:

<i>Positions</i>	<i>Chart</i>
31° 10'·0N., 116° 40'·0W.	1049
31° 10'·0N., 116° 30'·0W.	
31° 00'·0N., 116° 30'·0W.	
31° 00'·0N., 116° 40'·0W.	
and	
30° 50'·0N., 113° 42'·0W.	1017
31° 00'·0N., 113° 42'·0W.	
31° 00'·0N., 113° 31'·0W.	
30° 50'·0N., 113° 31'·0W.	
and	
26° 50'·0N., 111° 11'·0W.	1017
27° 00'·0N., 111° 11'·0W.	
27° 00'·0N., 111° 00'·0W.	
26° 50'·0N., 111° 00'·0W.	

3464(T)/24 MEXICO - Pacific Ocean Coast - Firing practice areas. (continued)

2.

and
25° 34'·0N., 110° 41'·5W. 1017
25° 34'·0N., 110° 30'·0W.
25° 25'·5N., 110° 30'·0W.
25° 25'·5N., 110° 41'·5W.
and
22° 12'·0N., 107° 12'·0W. 1027
22° 02'·0N., 107° 12'·0W.
22° 02'·0N., 107° 00'·0W.
22° 12'·0N., 107° 00'·0W.
and
18° 25'·0N., 104° 50'·0W. 1026
18° 25'·0N., 104° 30'·0W.
18° 15'·0N., 104° 30'·0W.
18° 15'·0N., 104° 50'·0W.

3.

and
17° 00'·0N., 102° 45'·0W. 1024, 1026
17° 08'·0N., 102° 45'·0W.
17° 08'·0N., 102° 30'·0W.
17° 00'·0N., 102° 30'·0W.
and
16° 28'·7N., 100° 11'·0W. 1024
16° 20'·7N., 99° 51'·7W.
16° 06'·9N., 99° 57'·7W.
16° 15'·9N., 100° 16'·5W.
and
15° 25'·0N., 96° 10'·0W. 1023
15° 25'·0N., 95° 55'·0W.
15° 15'·0N., 95° 55'·0W.
15° 15'·0N., 96° 10'·0W.

4.

and
15° 42'·0N., 95° 33'·0W. 1023
15° 37'·0N., 95° 48'·0W.
15° 27'·0N., 95° 44'·5W.
15° 32'·0N., 95° 30'·5W.
and
14° 40'·0N., 93° 07'·0W. 1023
14° 45'·0N., 93° 00'·0W.
14° 38'·0N., 92° 50'·0W.
14° 33'·0N., 92° 57'·0W.
and
25° 12'·0N., 97° 12'·0W. 3768
25° 12'·0N., 97° 00'·0W.
25° 00'·0N., 97° 00'·0W.
25° 00'·0N., 97° 12'·0W.

3464(T)/24 MEXICO - Pacific Ocean Coast - Firing practice areas. (continued)

5.

and
 23° 39'·0N., 97° 34'·0W. 3768
 23° 39'·0N., 97° 23'·0W.
 23° 26'·0N., 97° 23'·0W.
 23° 26'·0N., 97° 34'·0W.
 and
 22° 05'·0N., 97° 37'·0W. 376, 3768
 22° 05'·0N., 97° 25'·0W.
 21° 57'·0N., 97° 23'·0W.
 21° 57'·0N., 97° 35'·0W.
 and
 * 21° 03'·3N., 96° 35'·0W. 376
 * 20° 53'·0N., 96° 30'·0W.
 * 20° 53'·0N., 96° 19'·0W.
 * 21° 03'·0N., 96° 24'·0W.

6.

and
 * 19° 05'·0N., 94° 35'·0W. 1307
 * 18° 55'·0N., 94° 35'·0W.
 * 18° 55'·0N., 94° 24'·0W.
 * 19° 05'·0N., 94° 24'·0W.
 and
 18° 55'·0N., 92° 15'·0W. 2626
 18° 55'·0N., 92° 08'·0W.
 18° 50'·0N., 92° 08'·0W.
 18° 50'·0N., 92° 15'·0W.
 and
 20° 00'·0N., 91° 00'·0W. 2626
 20° 00'·0N., 91° 05'·0W.
 20° 05'·0N., 91° 05'·0W.
 20° 05'·0N., 91° 00'·0W.

7.

and
 22° 20'·0N., 91° 34'·0W. 1307
 22° 10'·0N., 91° 34'·0W.
 22° 20'·2N., 91° 16'·0W.
 22° 10'·0N., 91° 16'·0W.
 and
 21° 51'·0N., 89° 51'·0W. 1307
 21° 58'·0N., 89° 58'·0W.
 22° 04'·0N., 89° 51'·0W.
 21° 58'·0N., 89° 45'·0W.

8.

and
 21° 38'·0N., 86° 44'·0W. 2833
 21° 24'·0N., 86° 44'·0W.
 21° 24'·0N., 86° 36'·5W.
 21° 38'·0N., 86° 36'·5W.
 and
 18° 50'·0N., 87° 33'·0W. 662
 19° 01'·0N., 87° 30'·0W.
 19° 01'·0N., 87° 25'·0W.
 18° 50'·0N., 87° 28'·0W.
 and
 19° 50'·0N., 87° 00'·0W. 662
 19° 50'·0N., 86° 55'·0W.
 19° 38'·0N., 86° 55'·0W.
 19° 38'·0N., 87° 00'·0W.

9. Mariners are advised to navigate with caution in the vicinity of the areas and to contact the local port authorities for details of when the exercises are to take place.

3464(T)/24 MEXICO - Pacific Ocean Coast - Firing practice areas. (continued)

10. *Former Notice 2504(T)/23 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 376 — 662 — 1017 — 1023 — 1024 — 1026 — 1027 — 1049 — 1307 — 2626 — 2833 — 3768

3500(T)/24 PERU - Buoy.

Source: Peruvian Notice 4/41(T)/24

1. The conical light-buoy, *Fl(3)R.8s*, in position $12^{\circ} 02' \cdot 797S.$, $77^{\circ} 10' \cdot 257W.$ is reported off station.

(WGS84 DATUM)

Chart affected — 1853

5435(P)/24 ECUADOR - Obstruction.

Source: ENC EC401083

1. In the approaches to Canal del Morro, a linear obstruction, awash, exists joining positions.

$2^{\circ} 57' \cdot 50S.$, $80^{\circ} 20' \cdot 50W.$

$2^{\circ} 57' \cdot 26S.$, $80^{\circ} 21' \cdot 41W.$

$2^{\circ} 56' \cdot 50S.$, $80^{\circ} 22' \cdot 07W.$

$2^{\circ} 56' \cdot 33S.$, $80^{\circ} 23' \cdot 23W.$

$2^{\circ} 56' \cdot 02S.$, $80^{\circ} 23' \cdot 44W.$

$2^{\circ} 55' \cdot 46S.$, $80^{\circ} 21' \cdot 97W.$

$2^{\circ} 55' \cdot 43S.$, $80^{\circ} 20' \cdot 65W.$

$2^{\circ} 55' \cdot 19S.$, $80^{\circ} 21' \cdot 64W.$

$2^{\circ} 54' \cdot 56S.$, $80^{\circ} 23' \cdot 26W.$

2. Mariners are advised to navigate with caution in the area.

3. Charts will be updated when full details are available.

(WGS84 DATUM)

Chart affected — 586

468(T)/25 PERU - Buoyage.

Source: Peruvian Notice 11/146(T)/24

1. Two yellow spherical buoys with x -shape topmarks, marking the southern limit of a marine reserve have been temporarily removed from the following positions:

$9^{\circ} 04' \cdot 34S.$, $78^{\circ} 43' \cdot 17W.$

$9^{\circ} 04' \cdot 29S.$, $78^{\circ} 38' \cdot 61W.$

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Chart affected — 3087

4503(P)/25 ECUADOR - Marine farm.

Source: Ecuadorean Daily Notice 01/08/25

1. A marine farm has been reported in position $0^{\circ} 47' \cdot 6S.$, $80^{\circ} 42' \cdot 2W.$

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Chart affected — 2257

4626(P)/25 MEXICO - Pacific Ocean Coast - Submarine cable.

Source: Mexican Notice 15/85/25

1. A submarine cable is being laid between San José del Cabo and Mazatlan, joining the following positions:

23° 15'·7N., 106° 30'·7W.
 22° 52'·8N., 106° 54'·8W.
 22° 47'·5N., 106° 59'·3W.
 22° 43'·5N., 107° 05'·1W.
 22° 43'·2N., 107° 09'·8W.
 22° 37'·9N., 107° 22'·6W.
 22° 35'·2N., 107° 25'·5W.
 22° 34'·0N., 107° 28'·9W.
 22° 33'·7N., 107° 33'·1W.
 22° 36'·7N., 107° 48'·2W.
 22° 36'·9N., 107° 59'·6W.
 22° 39'·1N., 108° 07'·6W.
 22° 42'·0N., 108° 12'·6W.
 22° 42'·8N., 108° 20'·3W.
 22° 48'·9N., 108° 54'·5W.
 22° 52'·6N., 109° 06'·1W.
 22° 52'·4N., 109° 13'·6W.
 22° 55'·6N., 109° 25'·0W.
 22° 55'·4N., 109° 26'·9W.
 22° 57'·3N., 109° 33'·1W.
 22° 58'·8N., 109° 35'·4W.
 22° 59'·1N., 109° 37'·5W.
 23° 02'·0N., 109° 41'·7W.

2. Charts will be updated when works are complete.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1017 — 1027 — 1028 — 4802**4654(P)/25 COLOMBIA - Pacific Ocean Coast - Jetty. Works.**

Source: ENC CO500730

1. Jetty construction works are taking place within an area bounded by the following positions:

3° 54'·052N., 77° 05'·088W.
 3° 53'·942N., 77° 04'·969W.
 3° 53'·923N., 77° 04'·985W.
 3° 54'·034N., 77° 05'·104W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Chart affected — 2319**5001(T)/25 PERU - Leading light.**

Source: Peruvian Notice 9/143/25

1. The rear leading light, Fl.G.3s16m5M, in position 17° 38'·68S., 71° 20'·81W. has been extinguished.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3090**5036(T)/25 PERU - Buoy.**

Source: Peruvian Notice 9/144(T)/25

1. The isolated danger light-buoy, *Fl(2)6s '2'*, in position 17° 38'·62S., 71° 20'·97W. has been temporarily extinguished.

5036(T)/25 PERU - Buoy. (continued)

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3090

5413(P)/25 CHILE - Northern Coasts - Depths, Wrecks, Obstructions.

Source: Chilean Chart 6111

1. Depths less than charted exist within Bahia Concepcion. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4·9m	36° 43'·297S., 73° 04'·024W.
4·8m	36° 43'·242S., 73° 04'·222W.
5m	36° 43'·121S., 73° 04'·417W.
4·9m	36° 43'·111S., 73° 04'·721W.
4·7m	36° 43'·106S., 73° 04'·525W.
9·8m	36° 41'·454S., 73° 05'·741W.

2. Wrecks and obstructions exist in the following positions:

	<i>Depth</i>	<i>Position</i>
Obstruction	6·3m	36° 42'·777S., 73° 05'·749W.
Wreck	5·1m	36° 42'·774S., 73° 06'·195W.
Obstruction	3·8m	36° 42'·834S., 73° 06'·294W.
Obstruction	5·3m	36° 42'·721S., 73° 06'·149W.
Obstruction	3·8m	36° 42'·690S., 73° 06'·140W.
Obstruction	10·3m	36° 42'·085S., 73° 05'·302W.
Obstruction	9·7m	36° 42'·009S., 73° 05'·201W.
Obstruction	9·5m	36° 42'·172S., 73° 05'·723W.
Obstruction	9·2m	36° 42'·066S., 73° 05'·797W.
Obstruction	8m	36° 41'·988S., 73° 06'·198W.
Obstruction	6·2m	36° 42'·154S., 73° 06'·291W.
Obstruction	12·4m	36° 41'·901S., 73° 05'·469W.
Obstruction	9m	36° 41'·817S., 73° 05'·859W.
Obstruction	8·7m	36° 41'·847S., 73° 05'·838W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. These and other changes will be included in a New Edition of Chart 4248 to be published early 2026.
(WGS84 DATUM)

Chart affected — 4248

5421(T)/25 PERU - Foul. Wreck.

Source: Peruvian Notice 10/157(T)/25

1. A foul area consisting of sunken containers, exists within anchorage areas No 2 and No 12 , bounded by the following positions:

12° 00'·91S., 77° 11'·84W.
12° 01'·02S., 77° 11'·74W.
12° 01'·19S., 77° 11'·66W.
12° 01'·24S., 77° 11'·72W.
12° 01'·22S., 77° 11'·86W.
12° 01'·13S., 77° 11'·89W.
12° 01'·02S., 77° 11'·80W.
12° 00'·93S., 77° 11'·87W.

2. A wreck with a reported depth of 34·1m, exists in position 12° 01'·21S., 77° 11'·74W.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 1853

5434(T)/25 ECUADOR - Buoy.

Source: Ecuadorean Daily Notice 29/10/25

1. A Tsunami Warning buoy, has been deployed until further notice in position $4^{\circ} 08' \cdot 9S$, $89^{\circ} 00' \cdot 5W$. (WGS84 DATUM)

Charts affected — 4051 — 4062 — 4608 — 4618

5471(T)/25 MEXICO - Pacific Ocean Coast - Radar beacon.

Source: Mexican Notice 20/110(T)/25

1. The radar beacon, *Racon(A)*, in position $19^{\circ} 02' \cdot 30N$, $104^{\circ} 22' \cdot 80W$, is temporarily out of service. (WGS84 DATUM)

Charts affected — 1026 — 1979

5473(T)/25 MEXICO - Pacific Ocean Coast - Buoy.

Source: Mexican Notice 20/102(T)/25

1. The *No 11* light-buoy, *Fl.G.3s*, in position $19^{\circ} 00' \cdot 48N$, $104^{\circ} 15' \cdot 35W$. is temporarily out of service.
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Chart affected — 1936

5596(T)/25 PERU - Buoy.

Source: Peruvian Notice 10/159(T)/25

1. The starboard hand lateral light-buoy, *Fl(3)R.8s*, in position $12^{\circ} 02' \cdot 82S$, $77^{\circ} 09' \cdot 96W$, is reported to be unlit.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 1853

5597(T)/25 PERU - Light.

Source: Navarea XVI Warning 150/25

1. Islote Pelado light, *Fl(4)20s61m10M*, in position $11^{\circ} 26' \cdot 5S$, $77^{\circ} 50' \cdot 5W$, has been temporarily extinguished.
2. Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Charts affected — 3086 — 3087 — 4608

(23) ANTARCTICA

4399(P)/14 ANTARCTICA - Coastline. Rocks. Depths.

Source: Brazilian Chart 25122 and UKHO

1. Latest survey information between King George Island and Livingston Island has indicated that coastline, rocks and depths in Maxwell Bay, Nelson Strait and McFarlane Strait and depths within 5 miles of the coast between positions $62^{\circ} 45' \cdot 6S.$, $60^{\circ} 20' \cdot 4W.$ and $62^{\circ} 12' \cdot 9S.$, $58^{\circ} 25' \cdot 5W.$ have changed.
2. These changes will be included in the next New Edition of Chart 1776.
3. Former Notice 4809(P)/09 is cancelled.
(Undetermined Datum)

Chart affected — 1776

239(P)/22 ANTARCTICA - Depths.

Source: UKHO

1. Depths less than charted have been reported, the most significant of which is 4·6m, in an area bounded by the following positions:
 $60^{\circ} 42' \cdot 30S.$, $45^{\circ} 42' \cdot 20W.$
 $60^{\circ} 42' \cdot 30S.$, $45^{\circ} 41' \cdot 40W.$
 $60^{\circ} 43' \cdot 40S.$, $45^{\circ} 41' \cdot 40W.$
 $60^{\circ} 43' \cdot 40S.$, $45^{\circ} 42' \cdot 20W.$
2. Mariners are advised to navigate with caution in the area.
3. Charts 1779 and 1775 will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 1775 — 1779

2604(T)/24 SOUTHERN OCEAN - Scientific instrument.

Source: Australian Notice 6/228(T)/24 & UKHO

1. A subsurface scientific instrument, 90m below the surface, exists in the position: $55^{\circ} 47' \cdot 6S.$, $152^{\circ} 43' \cdot 6E.$
2. Former notice 1632(T)/24 is cancelled.
3. NOTE: Content of Notice unchanged, re-issued to include Chart 4065.
(WGS84 DATUM)

Charts affected — 4065 — 4074

4714(P)/25 ANTARCTICA - Depth.

Source: ENC CL5MA830

1. A depth of 8·1m exists in position $62^{\circ} 25' \cdot 02S.$, $59^{\circ} 37' \cdot 50W.$
2. Mariners are advised to navigate with caution in the area.
3. This update will be included in a New Edition of Chart 1741 to be published late 2025.
(UNDETERMINED DATUM)

Chart affected — 1741

4955(P)/25 SOUTHERN OCEAN - Depths.

Source: British Antarctic Survey

1. Survey information has shown that there are numerous changes to depths around the South Sandwich Islands.

4955(P)/25 SOUTHERN OCEAN - Depths. (continued)

2. Depths less than charted exist, the most significant are as follows:

<i>Depth</i>	<i>Position</i>
*250m	59° 41'·2S., 27° 47'·7W.
*624m	59° 39'·4S., 28° 21'·0W.
165m	57° 08'·8S., 26° 45'·23W.
156m	57° 06'·9S., 26° 40'·48W.
126m	56° 11'·0S., 27° 20'·1W.
436m	56° 00'·9S., 28° 14'·9W.
343m	55° 54'·7S., 28° 07'·5W.
237m	55° 57'·0S., 27° 51'·1W.
270m	55° 55'·6S., 27° 42'·3W.

3. Mariners are advised to navigate with caution in the area.

4. *These changes will be included in a New Edition of Chart 3593 to be published early 2026.

5. *Former Notice 1452(P)/25 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 3593



(24) EAST COAST OF SOUTH AMERICA AND THE FALKLAND ISLANDS

884(T)/16 SOUTH ATLANTIC OCEAN - Falkland Islands - Light-beacon. Leading line.

Source: UKHO

1. It has been reported that the white light sector of light-beacon 'L', Fl.WR.2s8m6M, in position 51° 54'·636S., 58° 26'·449W., is currently unreliable.
2. The white sector of the light is currently showing a visible sector from 105° to 113° giving the leading line a new bearing of 109° and not 107° as charted.
3. Mariners should apply a clearing line of no greater than 109° to light-beacon 'L'. The centre bearing and safest line remains at 107°.
(WGS84 Datum)

Chart affected — 2506**1015(T)/17 BRAZIL - East Coast - Works. Buoyage.**

Source: Brazilian Notice 21/128(T)/10

1. A turning basin is being established West of Dow Chemical Terminal (12° 46'·95S., 38° 28'·57W).
The area is marked by four special light-buoys, *Fl.Y.2s*, located in the following positions:
 - * 12° 47'·15S., 38° 28'·89W.
 - * 12° 47'·07S., 38° 28'·85W.
 - * 12° 47'·03S., 38° 28'·81W.
 - * 12° 47'·02S., 38° 28'·76W.
2. Mariners are advised to navigate with caution in this area.
3. Former notice 6114(T)/10 is cancelled.
* Indicates new or revised entry.
(WGS84 DATUM)

Chart affected — 545**3655(P)/18 BRAZIL - North Coast - Lights. Radar beacon. Automatic Identification Systems. Buoyage. Virtual aids to navigation.**

Source: Brazilian Notices 12/87(P)/18 and 12/88(T)/18

1. Changes have been made to navigational aids within the entrance to Rio Pará.
2. Light, Fl.G.10s8m8M, in position 0° 34'·67S., 48° 01'·90W. has been extinguished.
3. Light, Fl(2)10s35m18M and its associated radar beacon, Racon(B), in position 0° 33'·44S., 47° 53'·87W. has been extinguished.
4. Temporary Automatic Identification System (AIS) transmitters have replaced the lights above.
5. A temporary Automatic Identification System (AIS) transmitter has been established at light Q.13m9M in position 1° 22'·65S., 48° 29'·55W.
6. The following light-buoys have been removed:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.R.5s</i>	<i>No 1</i>	Starboard lateral	0° 24'·57S., 47° 55'·09W.
<i>Fl(3)G.12s</i>	<i>No 2</i>	Port Lateral	0° 24'·31S., 47° 50'·02W.
<i>Fl(2)R.5s</i>	<i>No 3</i>	Starboard lateral	0° 18'·00S., 47° 59'·72W.
<i>Fl(2)G.6s</i>	<i>No 4</i>	Port Lateral	0° 25'·31S., 47° 53'·22W.
<i>Fl.R.5s</i>	<i>No 5</i>	Starboard lateral	0° 56'·20S., 48° 26'·83W.
<i>Fl.G.5s</i>	<i>No 6</i>	Port Lateral	0° 25'·74S., 47° 55'·02W.
<i>Fl.G.3s</i>	<i>No 8</i>	Port Lateral	0° 28'·07S., 47° 57'·26W.

7. Temporary Virtual Automatic Identification System (AIS) aids to navigation, with lateral mark functions, have replaced the light-buoys above.
8. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 329 — 330 — 331 — 520 — 3959

4956(P)/18 BRAZIL - South Coast - Obstructions.

Source: Brazilian Notice 17/123(P)/18

1. A 2·8m obstruction exists within an area bounded by the following positions:

22° 49'·88S., 43° 10'·66W.

22° 49'·88S., 43° 10'·54W.

22° 49'·94S., 43° 10'·54W.

22° 49'·94S., 43° 10'·66W.

2. A 3·1m obstruction exists within an area bounded by the following positions:

22° 49'·98S., 43° 10'·82W.

22° 49'·98S., 43° 10'·75W.

22° 50'·01S., 43° 10'·75W.

22° 50'·01S., 43° 10'·82W.

3. Mariners are advised to navigate with caution in the area.
4. These changes will be included in the next New Edition of Chart 566.
(WGS84 DATUM)

Chart affected — 566**2025(T)/19 BRAZIL - East Coast - Wreck.**

Source: Brazilian Notice 5/54(P)/19

1. A stranded wreck, has been reported in position 0° 03'·48S., 51° 10'·93W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2189**2578(P)/19 BRAZIL - South Coast - Wreck.**

Source: Brazilian Notice 7/81(P)/19

1. A dangerous wreck exists in position 22° 56'·02S., 43° 06'·54W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 566**2582(P)/19 BRAZIL - East Coast - Obstructions.**

Source: Brazilian Notice 7/79(P)/19

1. Obstructions exist within an area bounded by the following positions:

21° 50'·08S., 40° 59'·68W.

21° 49'·96S., 40° 59'·31W.

21° 50'·04S., 40° 59'·28W.

21° 50'·15S., 40° 59'·65W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 495**4952(T)/19 BRAZIL - South Coast - Buoy.**

Source: UKHO and Brazilian Notice 24/177(T)/17

1. An ODAS light-buoy, *Fl(5)Y.20s*, has been temporarily established in position 32° 17'·72S., 52° 01'·50W.
2. Former Notice 4285(T)/19 is cancelled.
(WGS84 DATUM)

Charts affected — 2012 — 3984

1232(P)/20 BRAZIL - East Coast - Virtual aids to navigation.

Source: Brazilian Notice 2/E 12(P)/20

1. Virtual aids to navigation, V-AIS, have been established in the following positions:

<i>Designation</i>	<i>Position</i>	<i>Topmark</i>
<i>No 1</i>	12° 56'·81S., 38° 31'·62W.	Starboard-hand lateral
<i>No 2</i>	12° 56'·65S., 38° 31'·19W.	Port-hand lateral
<i>No 3</i>	12° 56'·89S., 38° 31'·20W.	Starboard-hand lateral
<i>No 4</i>	12° 56'·50S., 38° 30'·79W.	Port-hand lateral
<i>No 5</i>	12° 56'·97S., 38° 30'·81W.	Starboard-hand lateral
<i>No 6</i>	12° 56'·82S., 38° 30'·52W.	Port-hand lateral

(WGS84 DATUM)

Charts affected — 540 — 545**4847(T)/21 BRAZIL - East Coast - Wreck.**

Source: Hydrolant 2072/21 (24)

1. A vessel has sunk in position 16° 29'·8S., 38° 55'·4W.
(WGS84 DATUM)

Chart affected — 3974**1116(P)/22 BRAZIL - South Coast - Buoyage. Superbuoy.**

Source: Brazilian Notice 1/E 2(P)/22

1. Mooring buoys have been established in the following positions:

22° 30'·3S., 40° 31'·4W.
 22° 03'·7S., 39° 57'·0W.
 22° 15'·4S., 40° 28'·1W.
 23° 29'·2S., 41° 19'·2W.

2. A superbuoy has been established in position 22° 14'·3S., 40° 20'·2W.
3. Former Notice 1309(T)/13 is cancelled.
(WGS84 DATUM)

Charts affected — 529 — 530 — 3971 — 3972**1200(P)/22 BRAZIL - South Coast - Dredged areas. Buoyage. Lights. Depths. Fouls. Obstructions. Rocks. Submarine cable.**

Source: ENC BR502133

1. The dredged channels in the approaches to Porto Alegre are no longer maintained. The buoyage and lights remain.
2. Depths throughout the approaches have changed. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
6·5m	30° 13'·61S., 51° 14'·11W.
5·3m	30° 13'·08S., 51° 14'·90W.
5·8m	30° 11'·15S., 51° 16'·29W.
9·6m	30° 08'·59S., 51° 17'·29W.
2·6m	30° 07'·41S., 51° 17'·51W.
2·9m	30° 06'·31S., 51° 17'·38W.
5·7m	30° 06'·12S., 51° 16'·96W.
2·1m	30° 06'·13S., 51° 16'·81W.
5·7m	30° 04'·19S., 51° 14'·88W.
6·2m	30° 02'·62S., 51° 15'·01W.
2·4m	30° 10'·03S., 51° 17'·72W.
1·9m	30° 09'·85S., 51° 18'·10W.
2·5m	30° 09'·67S., 51° 18'·07W.
0·7m	30° 08'·61S., 51° 18'·51W.
2·1m	30° 08'·47S., 51° 18'·43W.

**1200(P)/22 BRAZIL - South Coast - Dredged areas. Buoyage. Lights. Depths. Fouls. Obstructions. Rocks.
Submarine cable. (continued)**

3. Fouls exist in the following positions:

30° 09'·20S., 51° 17'·23W.
 30° 06'·89S., 51° 17'·72W.
 30° 01'·73S., 51° 14'·18W.
 30° 01'·50S., 51° 13'·91W.
 30° 00'·78S., 51° 12'·99W.
 30° 00'·30S., 51° 12'·67W.

4. Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
Unknown	30° 04'·40S., 51° 14'·90W.
9·1m	30° 01'·87S., 51° 14'·72W.

5. Rocks exist in the following positions:

<i>Depth</i>	<i>Position</i>
5·2m	30° 01'·86S., 51° 14'·45W.
Unknown	30° 00'·83S., 51° 12'·91W.
Unknown	30° 00'·55S., 51° 12'·77W.

6. A submarine cable has been laid joining the following positions:

30° 01'·93S., 51° 15'·06W.
 30° 01'·98S., 51° 14'·51W.

7. Mariners are advised to navigate with caution in the area.

8. These changes will be included in the next New Edition of Chart 582.
 (WGS84 DATUM)

Chart affected — 582

1246(T)/22 ARGENTINA - Buoy.

Source: Argentine Notice 12/160/21

1. An ODAS light-buoy, *Fl(5)Y.20s*, has been temporarily established in position 38° 35'·80S., 58° 41'·64W.
 2. Former Notice 4821(T)/21 is cancelled.
 (WGS84 DATUM)

Chart affected — 534

1699(P)/22 BRAZIL - North Coast - Depth.

Source: Brazilian Notice 7/N 73(P)/22

1. A least depth of 7·9m exists within an area bounded by the following positions:

2° 35'·250S., 44° 25'·700W.
 2° 35'·250S., 44° 25'·267W.
 2° 35'·311S., 44° 25'·267W.
 2° 35'·311S., 44° 25'·161W.
 2° 35'·565S., 44° 25'·267W.
 2° 35'·750S., 44° 25'·267W.
 2° 35'·750S., 44° 25'·700W.

2. Mariners are advised to navigate with caution in the area.
 3. Chart 541 will be updated when full details are available.
 4. Former Notice 3679(P)/18 is cancelled.
 (WGS84 DATUM)

Chart affected — 541

2219(T)/22 BRAZIL - South Coast - Buoy.

Source: Brazilian Notice 5/S 50(P)/22

1. An ODAS buoy, *Fl.Y.20s*, has been established in position 32° 11'·64S., 52° 04'·81W.
(WGS84 DATUM)

Charts affected — 2002 — 2012**3744(P)/22 BRAZIL - North Coast - Buoy.**

Source: Brazilian Notice 7/N 74(P)/22

1. A yellow, spherical light-buoy, *Fl.Y.3s*, has been established in position 3° 41'·14S., 38° 32'·06W.
(WGS84 DATUM)

Chart affected — 526**1379(P)/23 BRAZIL - East Coast - Depth.**

Source: Brazilian Notice 5/E 38(P)/23

1. A least depth of 9·7m exists within an area bounded by the following positions:

12° 57'·26S., 38° 31'·40W.

12° 57'·33S., 38° 31'·41W.

12° 57'·33S., 38° 31'·50W.

12° 57'·26S., 38° 31'·50W.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 540 — 545**1596(P)/23 BRAZIL - South Coast - Buoy.**

Source: Brazilian Notice 1/S 9(P)/23

1. A yellow pillar light-buoy, *Fl(5)Y.20s ODAS*, has been established in position 30° 03'·18S., 50° 06'·20W.
(WGS84 DATUM)

Chart affected — 3983**2749(P)/23 BRAZIL - North Coast - Depth.**

Source: Brazilian Notice 4/N 31(P)/23

1. A least depth of 3·8m has been reported, within an area bounded by the following positions:

3° 43'·02S., 38° 27'·79W.

3° 42'·87S., 38° 27'·42W.

3° 43'·59S., 38° 27'·05W.

3° 43'·78S., 38° 27'·40W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 526**3304(P)/23 BRAZIL - South Coast - Obstruction.**

Source: Brazilian Notice 9/S 73(P)/23

1. An obstruction exists in position 22° 52'·18S., 43° 10'·55W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 566

3419(P)/23 BRAZIL - South Coast - Obstructions.

Source: Brazilian Notice 12/S 111(P)/23

1. Obstructions exist in an area bounded by the following positions:

25° 30'·12S., 48° 32'·68W.

25° 30'·17S., 48° 32'·68W.

25° 30'·19S., 48° 33'·12W.

25° 30'·14S., 48° 33'·11W.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 587**3421(P)/23 BRAZIL - South Coast - Buoyage.**

Source: Brazilian Notice 11/S 105(P)/23

1. ODAS light-buoys, *Fl(5)Y.20s*, have been established in the following positions:

25° 49'·3S., 42° 58'·1W.

25° 32'·8S., 42° 26'·4W.

(WGS84 DATUM)

Charts affected — 530 — 4201**3424(P)/23 BRAZIL - South Coast - Foul.**

Source: Brazilian Notice 11/S 102(P)/23

1. A foul exists in position 23° 56'·82S., 46° 18'·72W.
(WGS84 DATUM)

Chart affected — 29**3426(P)/23 BRAZIL - North Coast - Depths. Obstructions.**

Source: Brazilian Notice 12/I 108(P)/23

1. Depths less than charted exist within the Rio Pará. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
8·6m	0° 24'·51S., 48° 04'·20W.
9·6m	0° 24'·85S., 48° 04'·63W.
7m	1° 00'·27S., 48° 30'·41W.

2. Obstructions exist in areas bounded by the following positions:

0° 23'·19S., 47° 59'·68W.

0° 21'·53S., 47° 58'·01W.

0° 21'·66S., 47° 57'·84W.

0° 23'·36S., 47° 59'·38W.

and

0° 31'·16S., 47° 54'·14W.

0° 30'·27S., 47° 53'·50W.

0° 30'·40S., 47° 53'·24W.

0° 31'·38S., 47° 53'·59W.

and

0° 33'·50S., 47° 55'·43W.

0° 32'·94S., 47° 54'·61W.

0° 33'·18S., 47° 54'·38W.

0° 33'·73S., 47° 55'·18W.

3. Mariners are advised to navigate with caution in the area.
4. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 329 — 330 — 331 — 3959

3561(P)/23 BRAZIL - South Coast - Depths.

Source: Brazilian Notice 11/S 103(P)/23 and ENC BR401804

- Depths less than charted exist within Rio São Francisco do Sul. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
0·7m	26° 13'·678S., 48° 38'·032W.
0·9m	26° 13'·566S., 48° 38'·106W.
1m	26° 13'·619S., 48° 38'·186W.
11·3m	26° 13'·699S., 48° 38'·133W.
11·7m	26° 13'·586S., 48° 38'·063W.
13·7m	26° 13'·633S., 48° 38'·111W.

- Shoaling is reported as follows:

- Least depth 9·4m within an area bounded by the following positions:

26° 13'·435S., 48° 38'·025W.
 26° 13'·458S., 48° 38'·004W.
 26° 13'·526S., 48° 38'·008W.
 26° 13'·527S., 48° 38'·077W.
 26° 13'·501S., 48° 38'·117W.

- Least depth 8·4m within an area bounded by the following positions:

26° 13'·542S., 48° 37'·913W.
 26° 13'·573S., 48° 37'·892W.
 26° 13'·671S., 48° 37'·990W.
 26° 13'·640S., 48° 38'·011W.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 555**4531(P)/23 BRAZIL - South Coast - Depths.**

Source: Brazilian Notice 19/S 168(P)/23

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
43m	23° 06'·92S., 43° 03'·84W.
46m	23° 06'·34S., 43° 03'·90W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 553 — 3970 — 3971**4599(P)/23 BRAZIL - South Coast - Depths.**

Source: Brazilian Local Navigation Warning S 8224

- Shoaling has been reported to the south of Pedras do Aracaju, in the vicinity of a line joining the following positions:

28° 13'·50S., 48° 38'·68W.
 28° 13'·80S., 48° 38'·48W.

- The most significant depth is 11·7m, in position 28° 13'·80S., 48° 38'·54W.
- Mariners are advised to navigate with caution in the area and to consult the local authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3982**4602(P)/23 BRAZIL - East Coast - Fouls.**

Source: Brazilian Notice 16/E 141(P)/23

- Fouls exist in the following positions:

19° 50'·7S., 39° 59'·9W.
 19° 48'·7S., 40° 00'·6W.

4602(P)/23 BRAZIL - East Coast - Fouls. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3972

225(P)/24 BRAZIL - South Coast - Depths.

Source: Brazilian Notice 22/S 187(P)/23

- Shoaling, with minimum depth 13·1m, has been reported in the vicinity of a line joining the following positions:

23° 57'·76S., 46° 17'·83W.

23° 57'·54S., 46° 18'·04W.

- Shoaling, with minimum depth 5·2m, has been reported in the vicinity of a line joining the following positions:

23° 57'·32S., 46° 18'·23W.

23° 57'·53S., 46° 17'·99W.

- Shoaling, with minimum depth 13·5m, has been reported in the vicinity of a line joining the following positions:

23° 58'·15S., 46° 17'·73W.

23° 57'·61S., 46° 18'·19W.

- Shoaling, with minimum depth 12·9m, has been reported in the vicinity of a line joining the following positions:

23° 58'·55S., 46° 17'·44W.

23° 58'·21S., 46° 17'·68W.

- Depths less than charted exist within Porto de Santos. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
--------------	-----------------

9·3m	23° 58'·68S., 46° 17'·46W.
------	----------------------------

10·6m	23° 58'·85S., 46° 17'·44W.
-------	----------------------------

8·9m	23° 59'·26S., 46° 17'·37W.
------	----------------------------

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 29

428(T)/24 SOUTH ATLANTIC OCEAN - Falkland Islands - Scientific instruments.

Source: Falkland Islands Government

- *Unmarked scientific instruments have been established in the following positions:

51° 35'·41S., 57° 48'·00W.

51° 36'·01S., 60° 24'·01W.

- Mariners are advised to navigate with caution in the area.

- *Former Notice 491(T)/23 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 2514 — 2547

1189(P)/24 URUGUAY - Wreck. Buoy.

Source: Argentine Nav Warning 2329/2/24

- A dangerous wreck, marked by a buoy, *Fl(2)10s* exists in position 34° 29'·94S., 57° 53'·18W.

- Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Charts affected — 1749 — 3561

1203(P)/24 URUGUAY - Wreck. Buoy.

Source: Uruguayan Navigation Warning 72/24

- A stranded wreck, marked by an emergency wreck marking light-buoy, exists in position 34° 57'·85S., 56° 09'·45W.

1203(P)/24 URUGUAY - Wreck. Buoy. (continued)

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1749 — 2001**2661(P)/24 BRAZIL - East Coast - Depths.**

Source: Brazilian Notice 23/E 198(P)/23

- Depths less than charted exist within Ilhéus. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
8·4m	14° 45'·75S., 39° 01'·52W.
7·7m	14° 45'·82S., 39° 01'·52W.
6·7m	14° 45'·89S., 39° 01'·51W.
6·0m	14° 45'·96S., 39° 01'·51W.
4·7m	14° 46'·02S., 39° 01'·54W.
7·6m	14° 45'·95S., 39° 02'·00W.
0·3m	14° 46'·14S., 39° 01'·59W.
0·9m	14° 46'·21S., 39° 01'·58W.
6·2m	14° 46'·26S., 39° 01'·99W.
0·3m	14° 46'·39S., 39° 01'·58W.
9·8m	14° 46'·52S., 39° 01'·65W.

- Shoaling, with minimum depth 9·1m, has been reported in the vicinity of a line joining the following positions:

14° 45'·60S., 39° 01'·51W.
14° 45'·46S., 39° 01'·98W.

- Shoaling, with minimum depth -0·4m, has been reported in the vicinity of a line joining the following positions:

14° 46'·55S., 39° 01'·58W.
14° 46'·44S., 39° 01'·59W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 551**2763(P)/24 ARGENTINA - Submarine pipeline.**

Source: Argentine Notice 1/5(P)/24

- Submarine pipeline laying operations are taking place, joining the following positions:

53° 05'·3S., 67° 19'·3W.
53° 17'·9S., 67° 44'·4W.

- Mariners are advised to navigate with caution in the area
(WGS84 DATUM)

Charts affected — 3006 — 3335**2790(P)/24 BRAZIL - South Coast - Depth.**

Source: Brazilian Notice 24/E 211(P)/23

- A depth of 4m exists in position 22° 25'·75S., 41° 47'·64W.
- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 550 — 3971**3440(P)/24 BRAZIL - South Coast - Foul.**

Source: mv MT Palermo

- A foul has been reported in position 24° 10'·40S., 46° 12'·26W.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

3440(P)/24 BRAZIL - South Coast - Foul. (continued)

- Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 191 — 3980

3459(T)/24 BRAZIL - North Coast - Wreck.

Source: HYDROLANT 569/24

- A dangerous wreck exists in position 4° 21'·6S., 37° 45'·5W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3955

3477(P)/24 BRAZIL - North Coast - Depths.

Source: : Brazilian Notice 6/I 42(P)/24

- Depths less than charted exist within the vicinity of Vila do Conde. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
15·5m	1° 33'·44S., 48° 48'·96W.
14·2m	1° 34'·15S., 48° 48'·78W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 331

3494(P)/24 BRAZIL - East Coast - Danger area. Depth.

Source: Brazilian Notice 8/E 58(P)/24

- Shoaling, with minimum depth 10m, has been reported in the vicinity of position
 5° 45'·315S., 35° 12'·110W.
 5° 45'·300S., 35° 12'·080W.
 5° 45'·340S., 35° 12'·050W.
 5° 45'·359S., 35° 12'·091W.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 504

3519(P)/24 BRAZIL - East Coast - Depths.

Source: Brazilian Notice 10/E 88(P)/24

- Shoaling, with minimum depth 9·7m, has been reported within an area joining the following positions:

19° 50'·753S., 40° 03'·562W.
 19° 50'·633S., 40° 03'·684W.
 19° 50'·581S., 40° 03'·701W.
 19° 50'·551S., 40° 03'·687W.
 19° 50'·564S., 40° 03'·657W.
 19° 50'·600S., 40° 03'·607W.
 19° 50'·655S., 40° 03'·586W.

- Shoaling, with minimum depth 9·4m, has been reported within the area joining the following positions:

19° 50'·551S., 40° 03'·649W.
 19° 50'·535S., 40° 03'·687W.
 19° 50'·478S., 40° 03'·660W.
 19° 50'·496S., 40° 03'·603W.

- A depth of 10·3m has been reported in position 19° 50'·543S., 40° 03'·599W.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Chart 551 will be updated when full details are available.

3519(P)/24 BRAZIL - East Coast - Depths. (continued)

6. Former Notice 4348(P)/23 is cancelled.
(WGS84 DATUM)

Chart affected — 551

4215(P)/24 BRAZIL - North Coast - Depths.

Source: Brazilian Notice 11/102(P)/24

1. Depths less than charted exist in the vicinity of the berths at Porto de Itaquí:

<i>Depth</i>	<i>Position</i>
18·7m	2° 33'·45S., 44° 22'·763W.
19·4m	2° 32'·795S., 44° 22'·703W.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
4. Former Notice 360(P)/21 is cancelled.
(WGS84 DATUM)

Chart affected — 541

4228(P)/24 BRAZIL - South Coast - Depths.

Source: Brazilian Notice 10/S 95(P)/24

1. Shoaling has been reported in the vicinity of the lines joining the following positions:

<i>Depth</i>	<i>Position</i>
18·3m	23° 00'·16S., 43° 59'·69W.
	22° 59'·76S., 43° 59'·01W.
8·8m	23° 00'·71S., 43° 58'·50W.
	23° 00'·34S., 43° 58'·50W.
10m	22° 58'·04S., 43° 57'·55W.
	22° 57'·71S., 43° 57'·86W.
7·2m	22° 57'·27S., 43° 50'·18W.
	22° 57'·68S., 43° 50'·85W.

2. Depths less than charted exist within the approaches to Porto de Sepetiba. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
8·2m	23° 00'·68S., 43° 59'·28W.
12·6m	22° 59'·10S., 43° 56'·88W.
7·9m	22° 57'·49S., 43° 56'·31W.
13·1m	22° 59'·37S., 43° 56'·72W.
10·3m	23° 00'·70S., 43° 59'·42W.
8·2m	23° 00'·68S., 43° 59'·28W.
11·2m	23° 00'·62S., 43° 59'·19W.
12·5m	23° 00'·45S., 43° 59'·35W.
10·8m	23° 00'·65S., 43° 59'·00W.
10·7m	23° 00'·49S., 43° 58'·92W.
11·5m	22° 59'·41S., 43° 58'·47W.
13·8m	22° 59'·23S., 43° 58'·10W.
13·1m	22° 59'·37S., 43° 56'·72W.
19·8m	22° 58'·19S., 43° 53'·47W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. Former Notice 2468(P)/24 is cancelled.
(WGS84 DATUM)

Charts affected — 431 — 432

4259(P)/24 BRAZIL - East Coast - Depths.

Source: Brazilian Notice 10/E 86(P)/24

- Depths less than charted exist within Porto de Vitoria and approaches. The most significant are as follows:

Depth Position

4·7m 20° 19'·177S., 40° 19'·230W.

12·9m 20° 19'·467S., 40° 19'·873W.

12m 20° 19'·379S., 40° 20'·016W.

11·8m 20° 19'·350S., 40° 20'·155W.

- Shoaling, with minimum depth 11m, has been reported in the vicinity of a line joining the following positions:

20° 18'·751S., 40° 15'·879W.

20° 18'·961S., 40° 16'·331W.

- Shoaling, with minimum depth 13·7m, has been reported in the vicinity of a line joining the following positions:

20° 19'·316S., 40° 18'·631W.

20° 19'·269S., 40° 18'·895W.

- Shoaling, with minimum depth 6·4m, has been reported in the vicinity of a line joining the following positions:

20° 19'·321S., 40° 19'·226W.

20° 19'·471S., 40° 19'·255W.

- Shoaling, with minimum depth 8·7m, has been reported in the vicinity of a line joining the following positions:

20° 19'·315S., 40° 19'·912W.

20° 19'·342S., 40° 20'·065W.

- Shoaling, with minimum depth 10·6m, has been reported in the vicinity of a line joining the following positions:

20° 19'·453S., 40° 20'·097W.

20° 19'·483S., 40° 20'·427W.

- Shoaling, with minimum depth 9·2m, has been reported in the vicinity of a line joining the following positions:

20° 19'·380S., 40° 20'·231W.

20° 19'·399S., 40° 20'·377W.

- Shoaling, with minimum depth 8·8m, has been reported in the vicinity of a line joining the following positions:

20° 19'·475S., 40° 20'·638W.

20° 19'·497S., 40° 20'·797W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 598**4262(P)/24 BRAZIL - South Coast - Depths.**

Source: Brazilian Notice 10/S 91(P)/24

- A shoal depth of 1m has been reported in the vicinity of position 22° 51'·91S., 43° 12'·78W.
- Shoaling, with minimum depth 2·1m, has been reported in the vicinity of a line joining the following positions:

22° 52'·31S., 43° 12'·93W.

22° 52'·16S., 43° 12'·78W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 566**4264(P)/24 BRAZIL - South Coast - Foul.**

Source: Brazilian Notice 10/S 92(P)/24

- An area of foul ground exists, bounded by the following positions:

22° 49'·91S., 43° 07'·54W.

22° 50'·28S., 43° 07'·55W.

22° 50'·28S., 43° 07'·81W.

22° 49'·91S., 43° 07'·80W.

4264(P)/24 BRAZIL - South Coast - Foul. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 566

4280(P)/24 BRAZIL - North Coast - Depths.

Source: Brazilian Notice 11/N 101(P)/24

1. Depths less than charted exist within the approaches to Baía de São Marcos in the following positions:

<i>Depth</i>	<i>Position</i>
17·5m	2° 02'·77S., 44° 07'·32W.
24m	2° 02'·43S., 44° 05'·66W.
19·8m	1° 57'·72S., 44° 02'·49W.

2. Shoaling, with minimum depth 21·5m, has been reported in the vicinity of a line joining the following positions:

2° 05'·68S., 44° 07'·46W.
2° 07'·12S., 44° 08'·50W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
4. Former Notice 2043(P)/24 is cancelled.
(WGS84 DATUM)

Charts affected — 543 — 3958

4339(P)/24 BRAZIL - North Coast - Depths.

Source: Brazilian Notice 11/N 103(P)/24

1. Depths less than charted exist within the vicinity of the berths at Porto de Itaqui, in the following positions:

<i>Depth</i>	<i>Position</i>
14m	2° 34'·074S., 44° 22'·750W.
22·5m	2° 33'·747S., 44° 22'·812W.

2. Mariners are advised to navigate with caution in the area.
3. Chart 541 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 541

4366(P)/24 BRAZIL - South Coast - Depths.

Source: Brazilian Notice 11/S 114(P)/24

1. Depths less than charted exist within the approach to Porto de Santos.
2. Shoaling, with minimum depth 9·5m, has been reported in the vicinity of a line joining the following positions:

23° 59'·48S., 46° 19'·38W.
23° 59'·46S., 46° 18'·95W.
23° 59'·51S., 46° 18'·40W.

3. Shoaling, with minimum depth 8m, has been reported in the vicinity of a line joining the following positions:

23° 59'·62S., 46° 19'·30W.
23° 59'·62S., 46° 18'·84W.
23° 59'·64S., 46° 18'·40W.

4. An area of shoaling, with minimum depth 13·1m, has been reported bounded by the following positions:

23° 59'·60S., 46° 19'·31W.
23° 59'·51S., 46° 19'·37W.
23° 59'·48S., 46° 19'·20W.
23° 59'·48S., 46° 18'·85W.
23° 59'·54S., 46° 18'·40W.
23° 59'·62S., 46° 18'·40W.
23° 59'·61S., 46° 18'·62W.
23° 59'·59S., 46° 18'·96W.

4366(P)/24 BRAZIL - South Coast - Depths. (continued)

5. Chart 29 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 29

4370(P)/24 BRAZIL - South Coast - Depth.

Source: Brazilian Notice 11/S 115(P)/24

1. Shoaling, with minimum depth 15·3m, has been reported in the vicinity of a line joining the following positions:

23° 59'·58S., 46° 17'·88W.

23° 59'·49S., 46° 17'·71W.

23° 59'·35S., 46° 17'·56W.

(WGS84 DATUM)

Chart affected — 29

4372(P)/24 BRAZIL - North Coast - Depths.

Source: Brazilian Notice 11/N 104(P)/24

1. *Depths less than charted exist within the approaches to Terminal da Alumar. The most significant are as follows:

Depth

6·7m

0·2m

Position

2° 38'·457S., 44° 21'·704W.

2° 40'·271S., 44° 21'·681W.

2. *Shoaling, with minimum depth 2m, has been reported in the vicinity of a line joining the following positions:

2° 38'·190S., 44° 21'·869W.

2° 38'·134S., 44° 21'·905W.

3. *Shoaling, with minimum depth 3·3m, has been reported in the vicinity of a line joining the following positions:

2° 38'·240S., 44° 21'·688W.

2° 38'·112S., 44° 21'·776W.

4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

5. Charts will be updated when full details are available.

6. *Former Notice 4328(P)/22 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Chart affected — 541

4567(P)/24 BRAZIL - East Coast - Foul.

Source: Brazilian Notice 12/E 130(P)/24

1. A foul exists in position 21° 51'·78S., 40° 56'·35W.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 495 — 496

4569(P)/24 BRAZIL - East Coast - Depth.

Source: Brazilian Notice 12/E 126(P)/24

1. A shoal depth of 9·8m exists in position 20° 47'·142S., 40° 34'·364W.
2. Mariners are advised to navigate with caution in the area.
3. Chart 551 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 551

4570(P)/24 BRAZIL - East Coast - Foul.

Source: Brazilian Notice 12/E 129(P)/24

1. A foul exists in position 21° 52'·46S., 40° 56'·87W.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 495 — 496**4572(P)/24 BRAZIL - East Coast - Depths.**

Source: BR NM 12/E 132(P)/24

1. Shoaling, with minimum depth 8·7m, has been reported in the vicinity of a line joining the following positions:
21° 50'·48S., 40° 59'·01W.
21° 50'·81S., 40° 59'·52W.
2. Shoaling, with minimum depth 13·7m, has been reported in the vicinity of a line joining the following positions:
21° 50'·57S., 40° 59'·60W.
21° 50'·19S., 40° 59'·15W.
3. Shoaling, with minimum depth 12·8m, has been reported in the vicinity of a line joining the following positions:
21° 50'·07S., 40° 59'·27W.
21° 50'·37S., 40° 59'·68W.
4. Depths less than charted exist within Porto Do Açú. The most significant are as follows:

Depth1·5m
9·8m***Position***21° 51'·48S., 41° 01'·22W.
21° 50'·19S., 40° 59'·75W.

5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
6. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 495**4573(P)/24 BRAZIL - East Coast - Foul.**

Source: Brazilian Notice 12/E 128(P)/24

1. A foul exists in position 21° 53'·16S., 40° 56'·68W.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 495 — 496**4769(P)/24 BRAZIL - East Coast - Depths.**

Source: Brazilian Notice 12/E 133(P)/24

1. *Depths less than charted exist within Porto do Açú. The most significant are as follows:

Depth9·4m
9·9m***Position***21° 53'·01S., 41° 00'·37W.
21° 53'·06S., 41° 00'·29W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts will be updated when full details are available.
4. Former Notice 2791(P)/24 is cancelled
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 495

4775(P)/24 BRAZIL - South Coast - Depths.

Source: Brazilian Notice 13/S 155(P)/24

- Depths less than charted exist within the approach to Porto do Rio Grande. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
17·5m	32° 13'·59S., 52° 00'·35W.
18·1m	32° 14'·59S., 51° 59'·04W.

- Mariners are advised to navigate with caution in the area.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 2002 — 2012**4836(T)/24 SOUTH ATLANTIC OCEAN - Buoy.**

Source: Australian Notice 20/741(T)/24

- The special light buoy, *Fl. Y. 2s*, in position 44° 47'·4S., 161° 42'·0E., is off station.
(WGS84 DATUM)

Chart affected — 4601**4859(P)/24 BRAZIL - East Coast - Depths.**

Source: Brazilian Local Navigational Warning E 8061/24

- Depths less than charted have been reported in the following positions:

<i>Depth</i>	<i>Position</i>
16·4m	8° 24'·94S., 34° 54'·24W.
17·7m	8° 25'·45S., 34° 54'·93W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 961 — 969**4860(P)/24 BRAZIL - South Coast - Depths.**

Source: Brazilian Notice 13/S 153(P)/24 and ENC BR502101

- Depths less than charted exist within Rio Grande. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
10·6m	32° 10'·98S., 52° 05'·02W.
12·2m	32° 08'·57S., 52° 05'·81W.
15·6m	32° 08'·37S., 52° 05'·98W.
12·7m	32° 02'·21S., 52° 02'·69W.

- Shoaling, with minimum depth 15·2m, has been reported in the vicinity of a line joining the following positions:

32° 12'·76S., 52° 02'·22W.
32° 11'·52S., 52° 04'·48W.

- Shoaling, with minimum depth 18·9m, has been reported in the vicinity of a line joining the following positions:

32° 11'·36S., 52° 04'·60W.
32° 10'·96S., 52° 04'·75W.

- Shoaling, with minimum depth 14·7m, has been reported in the vicinity of a line joining the following positions:

32° 09'·38S., 52° 05'·62W.
32° 10'·97S., 52° 04'·81W.

- Shoaling, with minimum depth 8·2m, has been reported in the vicinity of a line joining the following positions:

32° 10'·50S., 52° 05'·21W.
32° 09'·33S., 52° 05'·79W.

- Shoaling, with minimum depth 14·7m, has been reported in the vicinity of a line joining the following positions:

32° 06'·57S., 52° 06'·06W.
32° 05'·87S., 52° 06'·01W.

4860(P)/24 BRAZIL - South Coast - Depths. (continued)

7. Shoaling, with minimum depth 4·1m, has been reported in the vicinity of a line joining the following positions:

32° 05'·74S., 52° 05'·72W.
32° 05'·27S., 52° 05'·55W.

8. Shoaling, with minimum depth 5·2m, has been reported in the vicinity of a line joining the following positions:

32° 04'·82S., 52° 05'·28W.
32° 05'·26S., 52° 05'·57W.

9. Shoaling, with minimum depth 7m, has been reported in the vicinity of a line joining the following positions:

32° 04'·48S., 52° 04'·92W.
32° 04'·82S., 52° 05'·28W.

10. Shoaling, with minimum depth 8·6m, has been reported in the vicinity of a line joining the following positions:

32° 04'·13S., 52° 04'·49W.
32° 04'·48S., 52° 04'·92W.

11. Shoaling, with minimum depth 8·9m, has been reported in the vicinity of a line joining the following positions:

32° 03'·54S., 52° 03'·49W.
32° 03'·93S., 52° 03'·94W.

12. Shoaling, with minimum depth 8·2m, has been reported in the vicinity of a line joining the following positions:

32° 03'·15S., 52° 04'·17W.
32° 03'·51S., 52° 04'·17W.
32° 03'·93S., 52° 04'·47W.

13. Shoaling, with minimum depth 7·8m, has been reported in the vicinity of a line joining the following positions:

32° 02'·29S., 52° 04'·51W.
32° 03'·17S., 52° 04'·20W.

14. Shoaling, with minimum depth 7·9m, has been reported in the vicinity of a line joining the following positions:

32° 01'·90S., 52° 04'·58W.
32° 02'·13S., 52° 04'·56W.

15. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2002 — 2012

4861(P)/24 BRAZIL - South Coast - Depths.

Source: Brazilian Notice 13/S 154(P)/24

1. Depths less than charted exist within Porto do Rio Grande. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
1·8m	32° 07'·09S., 52° 06'·22W.
1·8m	32° 07'·15S., 52° 06'·22W.
3·3m	32° 06'·76S., 52° 06'·22W.
14·6m	32° 06'·86S., 52° 06'·07W.
14·7m	32° 06'·99S., 52° 06'·14W.
4·9m	32° 07'·29S., 52° 06'·17W.
16·7m	32° 07'·64S., 52° 05'·97W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2002

4966(P)/24 BRAZIL - South Coast - Depth.

Source: Brazilian Notice 14/S 171(P)/24

1. A depth of 12·6m is reported to exist in position 32° 11'·60S., 52° 04'·36W.
2. Mariners are advised to navigate with caution in the area.

4966(P)/24 BRAZIL - South Coast - Depth. (continued)

3. Former Notice 3326(T)/24 is cancelled.
(WGS84 DATUM)

Charts affected — 2002 — 2012

5007(P)/24 BRAZIL - South Coast - Depths.

Source: : Brazilian Notice 15/S 191(P)/24

1. Depths less than charted exist in the following positions:

Depth Position

4·6m 22° 52'·78S., 43° 07'·03W.

6·2m 22° 52'·68S., 43° 08'·42W.

6·9m 22° 52'·88S., 43° 06'·93W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 566

5014(P)/24 BRAZIL - South Coast - Depths. Obstruction.

Source: Brazilian Notice 15/S 199(P)/24

1. Shoaling has been reported within Porto de Itajaí and approaches. The most significant are as follows:

Depth Position

13·5m 26° 53'·903S., 48° 39'·995W.

12·5m 26° 53'·959S., 48° 39'·761W.

12·6m 26° 54'·004S., 48° 39'·562W.

2. An obstruction has been reported in position: 26° 53'·821S., 48° 40'·087W.
3. Least Depth, 11·8m, has been reported in the vicinity of a line joining the following positions:

26° 54'·021S., 48° 39'·430W.

26° 53'·946S., 48° 39'·504W.

26° 53'·881S., 48° 39'·824W.

4. Least Depth, 11·7m, has been reported in the vicinity of a line joining the following positions:

26° 54'·606S., 48° 38'·887W.

26° 54'·218S., 48° 39'·236W.

5. Least Depth, 11·4m, has been reported within the area bounded by the following positions:

26° 54'·646S., 48° 38'·943W.

26° 54'·565S., 48° 38'·831W.

26° 54'·639S., 48° 38'·694W.

26° 54'·701S., 48° 38'·665W.

26° 54'·872S., 48° 38'·785W.

26° 54'·815S., 48° 38'·889W.

26° 54'·714S., 48° 38'·960W.

6. Least Depth, 11·6m, has been reported in the vicinity of a line joining the following positions:

26° 54'·787S., 48° 38'·725W.

26° 54'·788S., 48° 38'·471W.

26° 54'·830S., 48° 38'·101W.

7. Least Depth, 11·8m, has been reported in the vicinity of a line joining the following positions:

26° 54'·583S., 48° 35'·863W.

26° 54'·720S., 48° 37'·018W.

26° 54'·830S., 48° 38'·101W.

8. Mariners are advised to navigate with caution in the area.
9. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 547

5040(P)/24 BRAZIL - South Coast - Depths.

Source: Brazilian Local Navigational Warning S 8282/24

- Depths less than charted have been reported in the following positions:

<i>Depth</i>	<i>Position</i>
9·6m	25° 29'·15S., 48° 27'·35W.
10·8m	25° 29'·52S., 48° 27'·22W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 579**5187(P)/24 BRAZIL - East Coast - Depths.**

Source: Brazilian Local Navigation Warning E 8316/24

- Shoaling has been reported in the vicinity of a line joining the following positions:

20° 19'·38S., 40° 20'·08W.
20° 19'·38S., 40° 20'·22W.

- The most significant depth is 11·5m, in position 20° 19'·38S., 40° 20'·10W.
- A depth of 12·3m has been reported in position 20° 19'·35S., 40° 19'·85W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 598**5188(P)/24 BRAZIL - South Coast - Depth.**

Source: Brazilian Notice 15/S 189(P)/24

- A depth of 0·6m exists in position 22° 53'·77S., 43° 12'·62W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 566**5199(P)/24 BRAZIL - South Coast - Depths.**

Source: Brazilian Notice 15/S 193(P)/24

- Depths less than charted exist within Baía de Guanabara. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4·2m	22° 51'·12S., 43° 10'·18W.
5·6m	22° 51'·64S., 43° 11'·62W.
10·6m	22° 49'·51S., 43° 07'·88W.
11·9m	22° 50'·85S., 43° 08'·33W.
8·7m	22° 51'·75S., 43° 10'·06W.

- Shoaling has been reported, with a least depth of 7·2m, within an area bounded by the following positions:

22° 50'·99S., 43° 08'·01W.
22° 50'·09S., 43° 07'·80W.
22° 49'·77S., 43° 07'·70W.
22° 49'·82S., 43° 07'·46W.
22° 50'·98S., 43° 07'·77W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 564 — 566**5208(P)/24 BRAZIL - South Coast - Depths.**

Source: Brazilian Notice 15/S 192(P)/24

- Shoaling is reported as follows:
 - Least depth of 6m within an area bounded by the following positions:

5208(P)/24 BRAZIL - South Coast - Depths. (continued)

22° 47'·09S., 43° 08'·674W.
 22° 46'·959S., 43° 08'·741W.
 22° 46'·891S., 43° 08'·611W.
 22° 47'·020S., 43° 08'·517W.

b) Least depth of 6·5m within an area bounded by the following positions:

22° 45'·665S., 43° 09'·893W.
 22° 45'·320S., 43° 09'·771W.
 22° 45'·462S., 43° 09'·059W.
 22° 46'·036S., 43° 08'·377W.
 22° 46'·221S., 43° 08'·558W.
 22° 45'·783S., 43° 09'·031W.

c) Least depth of 5·1m within an area bounded by the following positions:

22° 46'·036S., 43° 08'·377W.
 22° 45'·462S., 43° 09'·059W.
 22° 45'·320S., 43° 09'·771W.
 22° 44'·935S., 43° 09'·634W.
 22° 44'·911S., 43° 09'·511W.
 22° 45'·230S., 43° 09'·010W.
 22° 45'·856S., 43° 08'·153W.

d) Least depth of 4·2m within an area bounded by the following positions:

22° 45'·504S., 43° 10'·795W.
 22° 44'·916S., 43° 10'·538W.
 22° 44'·935S., 43° 09'·634W.
 22° 45'·665S., 43° 09'·893W.

2. A depth of 20·6m exists in position 22° 48'·038S., 43° 08'·467W.
3. Mariners are advised to navigate with caution in the area.
4. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 564 — 566

5239(P)/24 BRAZIL - South Coast - Depths.

Source: Brazilian Notice 15/S 190(P)/24

1. Depths less than charted exist within Rio de Janeiro Harbour. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4·8m	22° 52'·67S., 43° 11'·62W.
12·3m	22° 53'·33S., 43° 10'·87W.
14·5m	22° 52'·36S., 43° 12'·10W.
14·7m	22° 52'·85S., 43° 12'·55W.

2. Shoaling, with minimum depth 8·6m, has been reported within the area joining the following positions:

22° 53'·42S., 43° 11'·15W.
 22° 53'·36S., 43° 11'·10W.
 22° 53'·39S., 43° 10'·90W.
 22° 53'·49S., 43° 10'·95W.

3. Mariners are advised to navigate with caution in the area.
4. Former Notice 930(P)/22 is cancelled.
(WGS84 DATUM)

Chart affected — 566

5466(P)/24 BRAZIL - South Coast - Depths.

Source: Brazilian Navigational Warning 20/S 8945/24

- Depths less than charted are reported to exist at, and in the vicinity of, the Navegantes and Itajai Container Terminals. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4·9m	26° 53'·870S., 48° 39'·700W.
4·5m	26° 53'·880S., 48° 39'·660W.
5m	26° 53'·890S., 48° 39'·600W.
4·5m	26° 53'·900S., 48° 39'·560W.
13m	26° 54'·000S., 48° 39'·980W.
13·3m	26° 53'·930S., 48° 39'·750W.
13·3m	26° 53'·960S., 48° 39'·610W.
12·9m	26° 54'·060S., 48° 39'·370W.
13m	26° 54'·120S., 48° 39'·300W.
12·1m	26° 53'·940S., 48° 40'·120W.

- Mariners are advised to navigate with caution in the area and to consult the local port authorities for the latest information.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 547**5528(P)/24 BRAZIL - North Coast - Depths.**

Source: Brazilian Notice 16/209(P)/24

- Shoaling, with minimum depth 5·3m, has been reported in the vicinity of a line joining the following positions:
2° 24'·18S., 44° 22'·35W.
2° 24'·04S., 44° 22'·81W.
- Shoaling, with minimum depth 21·5m, has been reported in the vicinity of a line joining the following positions:
2° 28'·08S., 44° 21'·30W.
2° 28'·30S., 44° 21'·00W.
- Depths less than charted exist within the approaches to São Luis. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
19·1m	2° 25'·18S., 44° 21'·57W.
22·4m	2° 27'·07S., 44° 19'·80W.
3·9m	2° 29'·14S., 44° 20'·77W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 543 — 565**5533(P)/24 BRAZIL - East Coast - Depths.**

Source: Brazilian Notice 16/E 214(P)/24

- Shoaling, with minimum depth 7·9m, has been reported in the vicinity of a line joining the following positions:
6° 57'·64S., 34° 50'·78W.
6° 57'·95S., 34° 50'·84W.
- Depths less than charted exist within Cabedelo. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
10·9m	6° 57'·68S., 34° 50'·71W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 960

5659(P)/24 BRAZIL - North Coast - Wreck.

Source: Brazilian Notice 21/I 291(P)/24

1. A dangerous wreck exists in position 1° 27'·20S., 48° 45'·49W.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 331**5932(P)/24 ARGENTINA - Channel.**

Source: ENC AR401450

1. Changes to the maintained channel within Rio Parana have taken place between the following positions
32° 21'·50S., 60° 44'·48W.
32° 02'·52S., 60° 40'·29W.
2. Mariners are advised to navigate with caution in the area and to consult the local port authorities for the latest information.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1335**5968(P)/24 BRAZIL - South Coast - Depths.**

Source: Brazilian Notice 18/S 261(P)/24

1. Depths less than charted exist within Baía de Guanabara. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
4·1m	22° 52'·26S., 43° 07'·73W.
2·9m	22° 52'·15S., 43° 07'·30W.
5·1m	22° 52'·41S., 43° 07'·69W.
2. Shoaling, with minimum depth 7·1m has been reported in the vicinity of the line joining the following positions:

22° 52'·01S., 43° 07'·94W.
22° 51'·82S., 43° 08'·18W.
22° 51'·76S., 43° 08'·26W.
3. Shoaling, with minimum depth 5·4m has been reported in the vicinity of the line joining the following positions:

22° 52'·02S., 43° 08'·02W.
22° 51'·91S., 43° 08'·15W.
4. Shoaling, with minimum depth 4·7m has been reported in the vicinity of the line joining the following positions:

22° 52'·40S., 43° 07'·89W.
22° 52'·25S., 43° 07'·90W.
22° 52'·15S., 43° 07'·94W.
5. A minimum depth of 5·4m has been reported in the vicinity of: 22° 52'·09S., 43° 07'·84W.
6. Mariners are advised to navigate with caution in the area.
7. Former Notice 2209(P)/24 is cancelled.
(WGS84 DATUM)

Chart affected — 566**34(P)/25 BRAZIL - East Coast - Depth.**

Source: Brazilian Local Navigational Warning I 8863/24

1. A shoal depth of 5·5m has been reported to exist in position 0° 00'·86S., 50° 12'·26W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2189 — 3962

299(P)/25 BRAZIL - South Coast - Depths. Obstructions.

Source: Brazilian Notice 21/S 299(P)/24

- Depths less than charted exist within Rio Itajai - Açú. The most significant are as follows:

Depth Position

5·8m	26° 53'·625S., 48° 40'·261W.
5·7m	26° 53'·155S., 48° 39'·901W.
2·1m	26° 53'·186S., 48° 41'·082W.
1·1m	26° 53'·181S., 48° 41'·168W.
7·8m	26° 53'·220S., 48° 41'·333W.
5·8m	26° 53'·167S., 48° 41'·303W.
4·8m	26° 52'·845S., 48° 41'·460W.
4·1m	26° 52'·741S., 48° 41'·432W.
7·8m	26° 52'·687S., 48° 41'·447W.
1·9m	26° 52'·343S., 48° 41'·267W.
5·8m	26° 52'·043S., 48° 41'·352W.
6·1m	26° 51'·817S., 48° 42'·002W.
5·6m	26° 51'·967S., 48° 42'·239W.
7·4m	26° 52'·596S., 48° 42'·752W.

- Obstructions exist in the following positions:

Depth Position

2·4m	26° 53'·348S., 48° 39'·869W.
2·2m	26° 53'·235S., 48° 39'·820W.

- Mariners are advised to navigate with caution in the area.
- Former Notice 3424(P)/24 is cancelled.
(WGS84 DATUM)

Chart affected — 547**443(P)/25 BRAZIL - East Coast - Depths. Obstructions.**

Source: Brazilian Notice 20/ E 280(P)/24

- Depths less than charted exist within Porto de Suape, in the following positions:

Depth***Position***

4·8m	8° 23'·377S., 34° 57'·583W.
9·8m	8° 22'·935S., 34° 58'·574W.
9·9m	8° 22'·886S., 34° 58'·772W.

- A least depth of 10m exists within an area bounded by the following positions:

8° 23'·022S., 34° 58'·286W.
8° 23'·113S., 34° 58'·343W.
8° 23'·004S., 34° 58'·518W.
8° 22'·890S., 34° 58'·515W.
8° 22'·898S., 34° 58'·335W.
8° 22'·869S., 34° 58'·223W.
8° 22'·965S., 34° 58'·117W.

- *A least depth of 13·7m exists within an area bounded by the following positions:

8° 23'·111S., 34° 58'·328W.
8° 23'·415S., 34° 58'·192W.
8° 23'·653S., 34° 57'·703W.
8° 23'·591S., 34° 57'·640W.
8° 23'·370S., 34° 58'·120W.
8° 23'·036S., 34° 58'·110W.

443(P)/25 BRAZIL - East Coast - Depths. Obstructions. (continued)

4. Obstructions exist in areas bounded by the following positions:

8° 23'·259S., 34° 57'·935W.
 8° 23'·291S., 34° 57'·928W.
 8° 23'·205S., 34° 58'·037W.
 8° 22'·895S., 34° 58'·108W.
 8° 22'·873S., 34° 58'·043W.
 8° 22'·894S., 34° 58'·037W.

5. Mariners are advised to navigate with caution in the area and consult the local authorities for the latest information.

6. Former Notice 4217(P)/23 is cancelled.

*Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 961

624(P)/25 BRAZIL - East Coast - Depths.

Source: Brazilian Local Navigational Warning E 8892/24

1. Depths less than charted are reported to exist within the approaches to Porto De Natal. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
9·3m	5° 45'·26S., 35° 11'·99W.
10·1m	5° 45'·29S., 35° 12'·02W.
10·9m	5° 45'·28S., 35° 12'·09W.
7·1m	5° 45'·34S., 35° 12'·07W.
3·8m	5° 45'·34S., 35° 11'·97W.
1·9m	5° 45'·38S., 35° 12'·03W.

2. Mariners are advised to navigate with caution in the area.

3. Chart 504 will be updated when full details are available.
 (WGS84 DATUM)

Chart affected — 504

637(P)/25 BRAZIL - East Coast - Depths.

Source: Brazilian Local Navigational Warning E 8893/24

1. Depths less than charted are reported to exist within Porto Do Açú. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
1·3m	21° 51'·41S., 41° 00'·81W.
0·9m	21° 51'·45S., 41° 01'·03W.

2. Mariners are advised to navigate with caution in the area.

3. Chart 495 will be updated when full details are available.
 (WGS84 DATUM)

Chart affected — 495

649(P)/25 BRAZIL - South Coast - Works. Submarine cable.

Source: Brazilian Local Navigational Warning E 337/24

1. Submarine cable laying operations are taking place, joining the following positions:

20° 48'·0S., 40° 35'·0W.
 21° 03'·5S., 40° 23'·4W.
 21° 09'·8S., 40° 19'·7W.
 21° 15'·9S., 40° 06'·6W.
 21° 31'·4S., 39° 59'·5W.
 21° 38'·7S., 39° 50'·2W.
 21° 53'·7S., 39° 40'·0W.
 22° 07'·7S., 39° 46'·1W.
 22° 17'·4S., 39° 57'·8W.
 22° 30'·2S., 40° 03'·6W.
 22° 40'·8S., 40° 09'·4W.
 22° 42'·8S., 40° 25'·2W.
 22° 35'·2S., 40° 40'·7W.
 22° 26'·2S., 40° 54'·3W.
 22° 11'·3S., 41° 06'·4W.

2. Charts will be updated when works are complete.
3. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 529 — 530 — 551 — 3971 — 3972 — 4201 — 4202**657(P)/25 BRAZIL - East Coast - Depth.**

Source: Brazilian Local Navigational Warning E 8901/24

1. A shoal depth of 9·7m exists in position 12° 46'·80S., 38° 35'·08W.
2. Mariners are advised to navigate with caution in the area.
3. Chart 545 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 545**689(P)/25 BRAZIL - South Coast - Depths.**

Source: Brazilian Local Navigational Warning S 8980/24

1. Depths less than charted are reported to exist within Baía de Guanabara. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
0·6m	22° 52'·29S., 43° 13'·18W.
1·9m	22° 52'·31S., 43° 13'·08W.
1·2m	22° 52'·31S., 43° 12'·97W.
2·9m	22° 52'·29S., 43° 12'·92W.
4·6m	22° 52'·24S., 43° 12'·86W.

2. Mariners are advised to navigate with caution in the area.
3. Chart 566 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 566**694(P)/25 BRAZIL - South Coast - Wreck.**

Source: Brazilian Notice 23/S 313(P)/24

1. A dangerous wreck has been reported in position 22° 45'·473S., 43° 06'·720W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 564

761(P)/25 BRAZIL - North Coast - Submarine cable.

Source: Alcatel Submarine Networks

1. A submarine cable is planned to be laid during July - August 2026, between Cayenne, French Guiana and the Ellalink system near Fortaleza, Brazil, joining the following approximate positions:

4° 55'·9N., 52° 16'·0W.
 5° 53'·8N., 51° 21'·3W.
 6° 01'·0N., 51° 00'·7W.
 6° 00'·5N., 50° 39'·6W.
 5° 49'·6N., 49° 56'·9W.
 5° 23'·9N., 49° 06'·4W.
 4° 37'·9N., 48° 04'·2W.
 3° 37'·5N., 47° 04'·3W.
 1° 31'·2N., 45° 32'·7W.
 1° 01'·9N., 44° 27'·8W.
 0° 31'·8N., 43° 13'·0W.
 1° 46'·4S., 40° 06'·8W.
 1° 50'·1S., 39° 55'·5W.
 1° 45'·9S., 39° 40'·0W.
 1° 49'·2S., 39° 25'·8W.
 1° 50'·0S., 38° 56'·2W.
 1° 53'·8S., 38° 28'·3W.
 1° 53'·2S., 38° 05'·6W.
 2° 14'·7S., 37° 41'·5W.
 2° 11'·7S., 37° 00'·8W.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 517 — 520 — 528 — 3957 — 3958 — 4216**1030(P)/25 BRAZIL - South Coast - Obstruction.**

Source: Brazilian Local Navigational Warning S 9800/24

1. An obstruction, depth 16·2m, exists in position 22° 51'·2S., 43° 09'·3W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 566**1369(P)/25 BRAZIL - North Coast - Depths.**

Source: Brazilian Local Navigational Warning I 9555/24

1. Shoaling has been reported in the vicinity of a line joining the following positions:
 1° 34'·63S., 48° 50'·38W.
 1° 20'·93S., 48° 42'·50W.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 331**1401(P)/25 BRAZIL - South Coast - Depth.**

Source: Brazilian Local Navigational Warning S 7089/25

1. A shoal depth of 4·4m exists in position 32° 02'·50S., 52° 02'·48W.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 2002

1646(P)/25 BRAZIL - South Coast - Depths.

Source: Brazilian Local Navigational Warning S 7106/25

- Depths less than charted exist in the approaches to São Francisco do Sul. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
6·4m	26° 14'·20S., 48° 38'·97W.
9·3m	26° 14'·33S., 48° 39'·03W.
8·8m	26° 15'·08S., 48° 39'·48W.
6·5m	26° 15'·05S., 48° 39'·54W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 555**1762(P)/25 BRAZIL - South Coast - Submarine cable.**

Source: UKHO

- A submarine cable is being laid, joining the following positions:

23° 02'·1S., 43° 29'·4W.
 23° 03'·8S., 43° 28'·9W.
 23° 04'·6S., 43° 28'·8W.
 23° 06'·0S., 43° 27'·9W.
 23° 06'·6S., 43° 27'·9W.
 23° 07'·5S., 43° 28'·2W.
 23° 25'·4S., 43° 22'·5W.
 23° 34'·7S., 43° 15'·4W.
 24° 06'·2S., 42° 42'·4W.
 24° 13'·0S., 42° 38'·2W.
 24° 16'·8S., 42° 27'·4W.
 24° 24'·9S., 42° 14'·1W.
 24° 28'·4S., 42° 14'·2W.
 24° 30'·8S., 42° 17'·6W.
 24° 26'·4S., 42° 30'·0W.
 24° 25'·2S., 42° 36'·3W.
 24° 31'·7S., 42° 44'·6W.
 24° 42'·5S., 42° 37'·5W.
 25° 02'·7S., 42° 49'·2W.
 25° 15'·3S., 42° 48'·6W.
 25° 28'·9S., 42° 52'·5W.
 25° 30'·8S., 42° 56'·3W.
 25° 28'·0S., 43° 03'·4W.
 25° 17'·6S., 43° 12'·8W.
 25° 07'·9S., 43° 48'·8W.

- continued:

25° 09'·2S., 43° 54'·7W.
 25° 03'·3S., 44° 00'·5W.
 25° 02'·3S., 44° 05'·3W.
 24° 54'·8S., 44° 08'·8W.
 24° 41'·3S., 44° 30'·0W.

- and

24° 22'·0S., 44° 23'·2W.
 24° 41'·3S., 44° 30'·0W.

- and

24° 04'·9S., 46° 30'·8W.
 24° 07'·8S., 46° 29'·9W.
 24° 11'·0S., 46° 28'·5W.
 24° 32'·0S., 46° 09'·7W.
 24° 29'·5S., 46° 04'·2W.
 24° 41'·3S., 44° 30'·0W.

1762(P)/25 BRAZIL - South Coast - Submarine cable. (continued)

5. Mariners are advised to navigate with caution in the area.
6. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 191 — 529 — 530 — 3970 — 3971 — 3980

1822(P)/25 BRAZIL - South Coast - Submarine cables.

Source: SubCom

1. A submarine cable has been laid joining the following positions:

24° 03'·38S., 46° 32'·21W.
 24° 04'·63S., 46° 31'·05W.
 24° 09'·32S., 46° 29'·88W.
 24° 11'·26S., 46° 28'·77W.
 24° 20'·27S., 46° 20'·99W.
 24° 45'·26S., 45° 58'·75W.
 25° 01'·92S., 45° 43'·73W.
 25° 26'·86S., 45° 19'·95W.
 25° 30'·44S., 45° 14'·67W.
 25° 36'·50S., 45° 13'·97W.
 25° 41'·58S., 45° 08'·98W.
 25° 58'·58S., 44° 40'·52W.

2. and

34° 57'·1S., 54° 55'·7W.
 34° 58'·2S., 54° 54'·6W.
 34° 58'·9S., 54° 54'·2W.
 34° 59'·3S., 54° 53'·7W.
 34° 59'·2S., 54° 52'·2W.
 35° 00'·0S., 54° 50'·9W.
 35° 01'·8S., 54° 49'·8W.
 35° 07'·1S., 54° 44'·6W.
 35° 07'·3S., 54° 44'·3W.
 35° 25'·6S., 53° 52'·1W.
 35° 27'·4S., 53° 48'·2W.
 35° 35'·6S., 52° 52'·3W.
 35° 36'·8S., 52° 44'·2W.
 35° 38'·1S., 52° 39'·7W.
 35° 40'·6S., 52° 34'·4W.
 35° 47'·4S., 52° 17'·5W.

3. and

36° 29'·1S., 56° 41'·5W.
 36° 31'·1S., 55° 49'·7W.
 36° 34'·0S., 55° 32'·0W.
 36° 40'·7S., 54° 46'·1W.
 36° 43'·2S., 54° 31'·3W.
 36° 46'·8S., 54° 07'·6W.
 36° 47'·3S., 54° 02'·8W.
 36° 47'·7S., 54° 01'·2W.
 36° 47'·9S., 54° 00'·0W.
 36° 49'·0S., 53° 31'·9W.
 36° 50'·8S., 53° 22'·1W.
 36° 50'·7S., 53° 17'·6W.
 36° 50'·0S., 53° 13'·5W.

4. Mariners are advised to navigate with caution in the area.
5. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 191 — 530 — 556 — 3064 — 3324 — 3980

1990(P)/25 BRAZIL - South Coast - Submarine cables.

Source: UKHO

1. A submarine cable is being laid, joining the following positions:

36° 29'·2S., 56° 38'·7W.
36° 34'·4S., 55° 28'·1W.
36° 50'·7S., 53° 21'·4W.
36° 47'·2S., 52° 31'·0W.
36° 32'·8S., 51° 17'·4W.
36° 21'·2S., 50° 32'·0W.
36° 26'·3S., 50° 08'·3W.
36° 14'·8S., 49° 48'·9W.
36° 11'·8S., 49° 34'·9W.
34° 26'·2S., 47° 46'·1W.
33° 16'·6S., 46° 55'·2W.
31° 31'·9S., 45° 38'·2W.
29° 13'·2S., 44° 03'·2W.
28° 09'·8S., 43° 23'·8W.
27° 40'·6S., 42° 57'·3W.
27° 29'·1S., 42° 36'·0W.
27° 20'·8S., 42° 26'·7W.
26° 25'·7S., 40° 57'·4W.
25° 56'·6S., 39° 54'·6W.
24° 26'·6S., 36° 01'·8W.
22° 15'·4S., 32° 37'·4W.
20° 49'·3S., 30° 37'·1W.
20° 27'·1S., 30° 24'·8W.
20° 02'·1S., 30° 24'·3W.
15° 57'·4S., 29° 37'·3W.

- 2.

15° 20'·1S., 29° 36'·0W.
13° 47'·1S., 29° 21'·2W.
13° 09'·5S., 29° 29'·8W.
11° 18'·4S., 29° 29'·5W.
9° 35'·5S., 29° 29'·2W.
8° 58'·0S., 29° 31'·6W.
8° 35'·8S., 29° 37'·4W.
7° 21'·9S., 30° 16'·2W.
6° 41'·2S., 30° 34'·3W.
6° 09'·7S., 30° 43'·0W.
4° 57'·1S., 30° 54'·9W.
3° 46'·8S., 31° 39'·3W.
3° 24'·6S., 32° 00'·1W.
2° 43'·2S., 32° 12'·0W.
2° 24'·4S., 32° 27'·2W.
1° 41'·7S., 32° 56'·3W.
1° 31'·6S., 33° 06'·5W.
1° 07'·7S., 33° 46'·4W.
0° 36'·1S., 34° 05'·0W.
0° 10'·2N., 34° 31'·4W.
0° 52'·7N., 35° 24'·8W.
3° 35'·6N., 38° 06'·0W.
6° 52'·6N., 41° 16'·1W.
7° 51'·4N., 42° 20'·3W.
8° 24'·8N., 43° 33'·9W.

1990(P)/25 BRAZIL - South Coast - Submarine cables. (continued)

3.

9° 18'·3N., 44° 16'·1W.
 10° 00'·0N., 45° 11'·1W.
 10° 49'·0N., 46° 11'·4W.
 11° 27'·0N., 46° 46'·0W.
 12° 28'·9N., 47° 54'·9W.
 14° 09'·6N., 50° 35'·3W.
 14° 54'·4N., 51° 10'·9W.
 16° 47'·7N., 54° 15'·8W.
 17° 55'·5N., 56° 08'·4W.
 19° 06'·5N., 57° 31'·9W.
 21° 37'·1N., 61° 08'·9W.
 22° 17'·0N., 63° 07'·1W.
 22° 13'·5N., 63° 44'·1W.
 22° 23'·1N., 64° 14'·0W.
 22° 20'·6N., 64° 40'·6W.
 22° 13'·0N., 64° 47'·9W.

4. and

24° 03'·6S., 46° 31'·3W.
 24° 09'·5S., 46° 29'·8W.
 24° 11'·7S., 46° 28'·4W.
 25° 00'·8S., 45° 44'·7W.
 25° 27'·6S., 45° 18'·8W.
 25° 31'·0S., 45° 14'·3W.
 25° 35'·7S., 45° 14'·3W.
 25° 41'·6S., 45° 09'·1W.
 26° 11'·6S., 44° 18'·3W.
 26° 47'·0S., 43° 15'·5W.
 27° 09'·2S., 42° 38'·6W.
 27° 20'·8S., 42° 26'·7W.

5. and

34° 57'·3S., 54° 55'·5W.
 35° 02'·5S., 54° 49'·1W.
 35° 07'·3S., 54° 44'·3W.
 35° 27'·9S., 53° 44'·8W.
 35° 37'·4S., 52° 42'·2W.
 35° 48'·9S., 52° 14'·3W.
 35° 51'·4S., 52° 08'·0W.
 35° 49'·7S., 51° 42'·3W.
 35° 53'·4S., 50° 19'·7W.
 35° 56'·6S., 50° 05'·8W.
 36° 02'·6S., 49° 58'·2W.
 36° 13'·0S., 49° 51'·8W.
 36° 14'·8S., 49° 48'·9W.

6. Mariners are advised to navigate with caution in the area.

7. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 191 — 528 — 529 — 530 — 556 — 3064 — 3324 — 3703 — 3980 — 4200 — 4201 — 4402

2043(P)/25 BRAZIL - East Coast - Wreck.

Source: Brazilian Local Navigational Warning E 7411/25

1. A dangerous wreck has been reported in position 12° 56'·23S., 38° 32'·20W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 540 — 545

2121(P)/25 BRAZIL - East Coast - Depths.

Source: Brazillian Local Navigation Warning E 7498/25

- Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
5·5m	6° 55'·70S., 34° 48'·70W.
10·1m	6° 55'·77S., 34° 47'·91W.
9·6m	6° 55'·80S., 34° 48'·40W.
9·5m	6° 57'·17S., 34° 47'·53W.
7·2m	6° 57'·34S., 34° 47'·99W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 960 — 3978 — 3979**2176(P)/25 URUGUAY - Submarine cable. Marine Reserve. Restricted areas.**

Source: Uruguayan Chart 31

- A submarine cable has been laid, joining the following positions:

34° 57'·17S., 54° 55'·71W.
 34° 57'·36S., 54° 55'·39W.
 34° 58'·29S., 54° 54'·56W.
 34° 58'·88S., 54° 54'·21W.
 34° 59'·25S., 54° 53'·75W.
 34° 59'·32S., 54° 53'·45W.
 34° 59'·14S., 54° 52'·53W.
 34° 59'·21S., 54° 52'·15W.
 34° 59'·92S., 54° 51'·00W.

- A marine reserve limit has been established, bounded by the following positions:

34° 59'·70S., 54° 54'·78W.
 34° 59'·70S., 54° 50'·46W.
 35° 02'·16S., 54° 50'·58W.
 35° 03'·00S., 54° 51'·24W.
 35° 03'·00S., 54° 55'·08W.

- Restricted areas, anchoring and fishing prohibited, have been amended and are now bounded by the following positions:

34° 57'·91S., 54° 56'·53W.
 34° 58'·82S., 54° 55'·59W.
 35° 00'·01S., 54° 54'·54W.
 35° 00'·31S., 54° 53'·34W.
 35° 01'·10S., 54° 52'·08W.
 35° 02'·30S., 54° 51'·42W.

- and

34° 56'·36S., 54° 54'·41W.
 34° 57'·27S., 54° 53'·23W.
 34° 58'·14S., 54° 52'·57W.
 34° 58'·28S., 54° 51'·72W.
 34° 58'·65S., 54° 51'·00W.

- and

34° 55'·29S., 54° 58'·25W.
 34° 56'·62S., 55° 00'·51W.
 34° 57'·67S., 55° 01'·27W.

- and

34° 55'·11S., 54° 58'·57W.
 34° 55'·32S., 54° 59'·02W.
 34° 56'·41S., 55° 00'·73W.
 34° 57'·67S., 55° 01'·81W.

2176(P)/25 URUGUAY - Submarine cable. Marine Reserve. Restricted areas. (continued)

- Mariners are advised to navigate with caution in the area.
- These changes will be included in the next New Edition of Chart 3703.
- Former Notice 3789(P)/23 is cancelled.
(WGS84 DATUM)

Chart affected — 3703

2192(P)/25 BRAZIL - East Coast - Foul.

Source: Brazilian Notice 6 E/46(P)/25

- A foul exists in position 21° 50'·80S., 40° 56'·10W.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 495 — 496

2392(P)/25 BRAZIL - East Coast - Wreck.

Source: Brazilian Notice 8/E 69(P)/25

- A dangerous wreck has been reported in position 13° 02'·97S., 38° 29'·07W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 540 — 3975

2725(P)/25 BRAZIL - South Coast - Wreck.

Source: HYDROLANT 726/25

- A dangerous wreck has been reported in position 23° 31'·5S., 44° 45'·3W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 530 — 3970

2803(T)/25 SOUTH ATLANTIC OCEAN - Falkland Islands - Lights.

Source: Falklands Maritime Authority

- A replacement program for Aids to Navigation is in place from 23rd October 2023 until further notice.
- The operation of the following lights may be disrupted during this time:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
Fl.WRG.2s9m6-5M	Blanco Bay	51° 40'·11S., 57° 50'·93W.
Fl.10s10M	Bull Roads	52° 20'·40S., 59° 18'·61W.

- Mariners are advised to navigate with caution in the area.
- *Former Notice 1683(T)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 539 — 558 — 1614 — 2505 — 2508 — 2512 — 2517 — 2518 — 2519 — 2520 — 2560

2827(P)/25 BRAZIL - North Coast - Depths. Drying heights.

Source: Brazilian Notice 7/N 56(P)/25

- Shoaling, with minimum depth 8·7m, has been reported within an area bounded by the following positions:
2° 34'·45S., 44° 24'·77W.
2° 34'·13S., 44° 24'·68W.
2° 34'·32S., 44° 23'·99W.
2° 34'·64S., 44° 24'·11W.

2827(P)/25 BRAZIL - North Coast - Depths. Drying heights. (continued)

2. Shoaling, with minimum depth 12·4m, has been reported within an area bounded by the following positions:
- 2° 35'·99S., 44° 25'·10W.
* 2° 36'·11S., 44° 24'·48W.
* 2° 34'·27S., 44° 23'·75W.
2° 34'·20S., 44° 23'·94W.
2° 34'·64S., 44° 24'·11W.
2° 34'·45S., 44° 24'·77W.
3. *Shoaling, with minimum drying height -3·5m, has been reported within an area bounded by the following positions:
- *2° 38'·49S., 44° 23'·57W.
*2° 38'·46S., 44° 23'·09W.
*2° 38'·31S., 44° 23'·05W.
*2° 37'·84S., 44° 22'·84W.
*2° 36'·43S., 44° 22'·44W.
*2° 35'·44S., 44° 22'·50W.
*2° 35'·45S., 44° 22'·98W.
4. *Shoaling, with minimum depth 5·5m, has been reported within an area bounded by the following positions:
- *2° 36'·42S., 44° 23'·59W.
*2° 36'·27S., 44° 24'·39W.
*2° 37'·07S., 44° 24'·21W.
*2° 37'·03S., 44° 23'·56W.
5. Shoaling, with minimum depth 2·7m, has been reported within an area bounded by the following positions:
- 2° 36'·02S., 44° 25'·02W.
* 2° 36'·27S., 44° 24'·39W.
* 2° 37'·07S., 44° 24'·21W.
2° 37'·63S., 44° 24'·46W.
2° 37'·48S., 44° 24'·77W.
2° 37'·07S., 44° 24'·77W.
2° 37'·07S., 44° 25'·13W.
6. *Shoaling, with minimum drying height -1·7m, has been reported within an area bounded by the following positions:
- * 2° 37'·61S., 44° 23'·86W.
2° 37'·66S., 44° 23'·52W.
2° 38'·91S., 44° 23'·74W.
2° 38'·74S., 44° 23'·86W.
7. Shoaling, with minimum depth 8·5m, has been reported within an area bounded by the following positions:
- 2° 39'·10S., 44° 23'·49W.
2° 38'·57S., 44° 23'·37W.
2° 38'·60S., 44° 23'·25W.
2° 39'·10S., 44° 23'·37W.
8. Shoaling, with minimum depth 10·1m, has been reported within an area bounded by the following positions:
- 2° 39'·10S., 44° 23'·24W.
2° 38'·31S., 44° 23'·04W.
2° 38'·40S., 44° 22'·70W.
2° 39'·10S., 44° 22'·83W.
9. *Shoaling, with minimum depth 8·2m, has been reported within an area bounded by the following positions:
- * 2° 34'·70S., 44° 22'·94W.
* 2° 34'·85S., 44° 22'·92W.
* 2° 34'·83S., 44° 22'·77W.
* 2° 34'·68S., 44° 22'·85W.
10. *Shoaling, with minimum depth 0·4m, has been reported within an area bounded by the following positions:
- 2° 35'·24S., 44° 22'·06W.
2° 35'·81S., 44° 21'·95W.
2° 35'·81S., 44° 21'·91W.
2° 35'·39S., 44° 21'·97W.
2° 35'·40S., 44° 22'·00W.
2° 35'·23S., 44° 22'·05W.

2827(P)/25 BRAZIL - North Coast - Depths. Drying heights. (continued)

11. *Shoaling, with minimum depth 2·2m, has been reported within an area bounded by the following positions:

2° 36'·61S., 44° 22'·02W.
2° 36'·88S., 44° 21'·95W.
2° 36'·65S., 44° 21'·86W.
2° 36'·27S., 44° 21'·85W.

12. *Shoaling, with minimum depth 2m, has been reported within an area bounded by the following positions:

2° 37'·80S., 44° 21'·97W.
2° 37'·92S., 44° 21'·93W.
2° 37'·27S., 44° 21'·86W.
2° 37'·24S., 44° 21'·89W.

13. *Shoaling, with minimum depth 5m, has been reported within an area bounded by the following positions:

2° 37'·97S., 44° 21'·99W.
2° 37'·92S., 44° 21'·93W.
2° 37'·80S., 44° 21'·97W.
2° 37'·83S., 44° 22'·07W.

14. *Shoaling, with minimum depth 8·8m, has been reported within an area bounded by the following positions:

2° 37'·86S., 44° 22'·24W.
2° 38'·00S., 44° 22'·16W.
2° 37'·99S., 44° 22'·10W.
2° 37'·85S., 44° 22'·13W.

15. *Shoaling, with minimum depth 7·9m, has been reported within an area bounded by the following positions:

2° 38'·04S., 44° 22'·04W.
2° 38'·26S., 44° 22'·14W.
2° 38'·27S., 44° 22'·09W.
2° 38'·16S., 44° 22'·03W.
2° 38'·05S., 44° 22'·00W.

16. *Shoaling, with minimum depth 4·2m, has been reported within an area bounded by the following positions:

2° 37'·14S., 44° 24'·17W.
2° 37'·13S., 44° 24'·24W.
2° 37'·24S., 44° 24'·29W.
2° 37'·24S., 44° 24'·23W.

17. Depths less than charted exist within Porto de Itaqui. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
0·9m	2° 38'·95S., 44° 22'·51W.
3·6m	2° 38'·66S., 44° 23'·42W.
*10·6m	2° 34'·67S., 44° 22'·88W.
*7·2m	2° 36'·02S., 44° 21'·97W.
*12·7m	2° 37'·11S., 44° 22'·56W.
*9·3m	2° 37'·26S., 44° 21'·99W.
*12·5m	2° 37'·27S., 44° 22'·67W.
*13·3m	2° 37'·49S., 44° 22'·70W.
*13·7m	2° 37'·60S., 44° 22'·57W.
*11·9m	2° 37'·84S., 44° 22'·62W.
*12·9m	2° 37'·91S., 44° 22'·81W.
*10·5m	2° 37'·93S., 44° 22'·06W.
*Drying	2° 38'·75S., 44° 22'·13W.
0·3m	

18. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

19. *Former Notice 744(P)/25 is cancelled.

*Indicates a new or revised entry
(WGS84 DATUM)

Chart affected — 541

2874(T)/25 BRAZIL - East Coast - Depth.

Source: HYDROLANT 915/25

1. A depth of 18·3m has been reported to exist in position 20° 35'·7S., 34° 46'·1W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 529 — 4020 — 4022 — 4201 — 4202**3137(P)/25 BRAZIL - East Coast - Depth. Drying height.**

Source: Brazilian Local Navigation Warning E 7674/25

1. Depths less than charted exist in the following positions:

<i>Depth</i>	<i>Position</i>
6m	6° 58'·59S., 34° 50'·38W.
-0·2m	6° 58'·51S., 34° 50'·49W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 960**3214(P)/25 BRAZIL - North Coast - Depths.**

Source: Brazilian Navigational Warning N 8069/25

1. Depths up to 10m less than charted have been reported to exist within 250m of a line joining the following positions:

2° 33'·81S., 44° 24'·60W.
2° 35'·16S., 44° 25'·99W.

2. The most significant depths are as follows:

<i>Depth</i>	<i>Position</i>
7·3m	2° 34'·57S., 44° 25'·30W.
8·8m	2° 35'·12S., 44° 25'·87W.

3. Mariners are advised to navigate with caution in the area and to consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 541**3463(P)/25 BRAZIL - South Coast - Submarine cable. Works.**

Source: Alcatel Submarine Networks

1. A submarine cable is being laid, joining the following positions:

30° 14'·9S., 50° 13'·6W.
30° 16'·5S., 50° 08'·8W.
30° 29'·5S., 49° 43'·7W.
30° 48'·4S., 49° 13'·7W.
31° 50'·3S., 48° 02'·8W.
31° 51'·8S., 48° 02'·9W.

2. Works are due to take place between March and October 2026.
3. Vessels should navigate with caution and avoid anchoring or trawling in the vicinity of the cable route.
4. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 530 — 556 — 3983 — 4201

3473(P)/25 BRAZIL - North Coast - Depths.

Source: HYDROLANT 1213/25

- Depths less than charted are reported to exist within an area bounded by the following positions:

2° 10'·31S., 44° 09'·39W.
 2° 10'·15S., 44° 09'·19W.
 2° 10'·52S., 44° 09'·00W.
 2° 10'·77S., 44° 08'·99W.
 2° 10'·84S., 44° 09'·04W.
 2° 10'·77S., 44° 09'·16W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 543 — 565**3861(P)/25 BRAZIL - East Coast - Wreck.**

Source: Brazilian Notice 13/E 117(P)/25

- A dangerous wreck exists in position 8° 25'·133S., 34° 58'·150W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 961**3937(P)/25 BRAZIL - East Coast - Depth.**

Source: Brazilian Local Navigation Warning E 8086/25

- A depth of 4·5m exists in position 5° 45'·35S., 35° 12'·04W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 504**4011(T)/25 SOUTH ATLANTIC OCEAN - Buoyage.**

Source: NOAA

- The National Oceanographic and Atmospheric Administration (NOAA) maintains an array of buoys called Prediction and Research Moored Array in the Atlantic (PIRATA).
- The PIRATA buoys, white and orange, 2 metre toroid buoys with radar reflectors, are located in the following positions:

Designation*PI287A**PI286A**PI280A**PI285A**PI284A**PI283A**PT073**PT074**PT065**PT068**PT069**PT075**PT070**PT062**PT063**PT072****Position***

0° 00'·4N., 2° 41'·9W.

0° 01'·2N., 9° 52'·8W.

18° 51'·1S., 34° 39'·5W.

0° 00'·6N., 34° 59'·8W.

7° 56'·8N., 38° 01'·8W.

4° 00'·5N., 37° 56'·2W.

6° 02'·0S., 10° 00'·4W.

9° 54'·5S., 9° 58'·7W.

20° 27'·1N., 23° 08'·5W.

11° 29'·3N., 22° 59'·2W.

4° 02'·7N., 22° 59'·2W.

0° 16'·0N., 21° 01'·6W.

8° 00'·5S., 30° 38'·0W.

13° 31'·4S., 32° 35'·8W.

20° 01'·5N., 37° 50'·8W.

15° 00'·2N., 37° 59'·5W.

- NOAA also maintain Climate Moorings in the North Pacific Ocean. The buoy is a yellow 2 metre solid hull discus buoy with radar reflectors which is located in the following position:

Designation*PA019****Position***

50° 07'·6N., 144° 49'·5W.

- Mariners are advised to give all buoys a 5 nautical mile wide berth.

4011(T)/25 SOUTH ATLANTIC OCEAN - Buoyage. (continued)

5. Further information and up to date positions are available on the National Data Buoy Center website <https://www.ndbc.noaa.gov/>.
6. Former Notice 1894(T)/25 is cancelled.
(WGS84 DATUM)

Charts affected — 529 — 4104 — 4115 — 4202 — 4203 — 4209 — 4215 — 4216 — 4806 — 4810

4032(P)/25 BRAZIL - East Coast - Foul.

Source: Brazilian Notice 13/E 118(P)/25

1. A foul exists in position 10° 50'·64S., 36° 55'·41W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 3977

4048(P)/25 BRAZIL - South Coast - Depths.

Source: Brazilian Notice 12/S 110(P)/25

1. Depths less than charted exist within Baía de Guanabara. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
0·2m	22° 48'·254S., 43° 09'·105W.
1·9m	22° 48'·271S., 43° 09'·191W.

2. Shoaling is reported as follows:

- a) Least depth 3·1m within an area bounded by the following positions:

22° 48'·055S., 43° 10'·329W.
 22° 48'·000S., 43° 10'·277W.
 22° 48'·119S., 43° 10'·069W.
 22° 48'·585S., 43° 09'·783W.
 22° 48'·690S., 43° 09'·940W.

3. b) Least depth 2·9m within an area bounded by the following positions:

22° 48'·412S., 43° 09'·569W.
 22° 48'·392S., 43° 09'·666W.
 22° 48'·213S., 43° 09'·584W.
 22° 48'·186S., 43° 09'·428W.
 22° 48'·287S., 43° 09'·442W.

4. c) Least depth 4m within an area bounded by the following positions:

22° 48'·783S., 43° 09'·527W.
 22° 48'·643S., 43° 09'·450W.
 22° 48'·874S., 43° 09'·236W.
 22° 49'·069S., 43° 09'·279W.
 22° 48'·974S., 43° 09'·470W.

5. d) Least depth 8·3m within an area bounded by the following positions:

22° 48'·482S., 43° 08'·882W.
 22° 48'·651S., 43° 08'·943W.
 22° 48'·683S., 43° 09'·199W.
 22° 48'·551S., 43° 09'·150W.

6. *Shoaling, with the minimum depth 7·4m, has been reported in the vicinity of a line joining the following positions:

22° 48'·456S., 43° 08'·545W.
 22° 48'·343S., 43° 08'·127W.

7. Mariners are advised to navigate with caution in the area.
8. Charts will be updated when full details are available.
9. *Former Notice 3768(P)/23 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 564 — 566

4350(P)/25 BRAZIL - South Coast - Wreck.

Source: HYDROLANT 1548/25

1. A dangerous wreck has been reported in position 24° 16'·15S., 46° 28'·07W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 191 — 530 — 3980**4501(T)/25 BRAZIL - South Coast - Buoy.**

Source: Nav Area V Navigational Warning 0453/25

1. A yellow buoy, *Fl(5)Y.20s ODAS*, has been established in position 25° 33'·6S., 44° 03'·2W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 530 — 4201**4562(P)/25 BRAZIL - South Coast - Depth.**

Source: Brazilian Local Navigational Warning S 8317/25

1. A depth of 3·2m exists in position 22° 52'·81S., 43° 06'·93W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 566**4609(T)/25 SOUTH ATLANTIC OCEAN - Falkland Islands - Light-beacons.**

Source: Falklands Maritime Authority Navigation Warning 20/25

1. Until further notice, the following light-beacons are temporarily extinguished:

<i>Characteristic</i>	<i>Designation</i>	<i>Position</i>
Fl.3s4m6M	I	51° 53'·527S., 58° 29'·867W.
Oc.WRG.5s20m9-6M	J	51° 54'·038S., 58° 28'·229W.
Fl.WR.2s8m6M	L	51° 54'·635S., 58° 26'·447W.
Oc.6s8m7M	K	51° 54'·344S., 58° 25'·694W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 2506 — 2508 — 2536 — 2561**4628(P)/25 BRAZIL - South Coast - Wreck.**

Source: HYDROLANT 1494/25

1. A dangerous wreck has been reported in position 23° 01'·12S., 43° 08'·12W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 553 — 566 — 3970 — 3971**4631(P)/25 BRAZIL - East Coast - Wreck.**

Source: Brazilian Notice 17/E 144(P)/25

1. A Dangerous wreck exists in position 5° 42'·70S., 35° 10'·50W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 504

4633(T)/25 BRAZIL - North Coast - Buoyage.

Source: Brazilian Navigational Warnings N 0388/25 and N 0389/25

1. ODAS buoys have been established in the following positions:

4° 49'·14S., 37° 02'·47W.

4° 49'·21S., 37° 02'·50W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Former Notice 3869(T)/25 is cancelled.
(WGS84 DATUM)

Chart affected — 526

4721(P)/25 URUGUAY - Wreck.

Source: Uruguayan Navigational Warning 0537.25

1. A dangerous wreck has been reported in position 34° 55'·8S., 55° 16'·4W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 3064

4918(P)/25 SOUTH ATLANTIC OCEAN - Submarine cables. Works.

Source: Alcatel Submarine Networks

1. Cable laying operations are taking place to install the WAMKELEKILE Submarine Fibre Optic Cable system, joining the following positions:

1° 44'·3S., 33° 39'·3W.

1° 52'·3S., 33° 40'·9W.

2. and

3° 44'·4S., 38° 27'·2W.

3° 44'·2S., 38° 26'·9W.

3° 44'·3S., 38° 25'·7W.

3° 44'·2S., 38° 25'·0W.

3° 44'·1S., 38° 24'·6W.

3° 44'·0S., 38° 24'·2W.

3° 41'·3S., 38° 18'·3W.

3° 36'·8S., 38° 08'·8W.

3° 36'·3S., 38° 07'·2W.

3° 35'·8S., 38° 06'·7W.

3° 31'·6S., 37° 59'·1W.

3° 29'·5S., 37° 56'·7W.

3° 22'·5S., 37° 51'·3W.

3° 20'·2S., 37° 50'·2W.

3° 18'·2S., 37° 49'·2W.

3° 13'·8S., 37° 46'·6W.

3° 12'·0S., 37° 46'·1W.

3° 07'·7S., 37° 47'·3W.

3° 01'·5S., 37° 48'·0W.

2° 56'·5S., 37° 49'·7W.

2° 53'·5S., 37° 49'·7W.

2° 50'·7S., 37° 48'·2W.

2° 49'·0S., 37° 45'·9W.

2° 48'·1S., 37° 41'·6W.

2° 48'·5S., 37° 37'·5W.

4918(P)/25 SOUTH ATLANTIC OCEAN - Submarine cables. Works. (continued)

3. and

2° 50'·1S., 37° 32'·0W.
2° 49'·7S., 37° 28'·0W.
2° 40'·7S., 37° 06'·8W.
2° 39'·4S., 37° 04'·5W.
2° 37'·5S., 37° 00'·3W.
2° 34'·3S., 36° 50'·8W.
2° 31'·9S., 36° 41'·4W.
2° 27'·2S., 35° 59'·3W.
2° 26'·3S., 35° 26'·8W.
2° 19'·4S., 35° 03'·8W.
2° 10'·2S., 33° 54'·4W.
2° 02'·8S., 33° 40'·7W.
1° 55'·4S., 33° 35'·2W.
1° 51'·3S., 33° 33'·2W.
1° 48'·0S., 33° 29'·5W.

4. and

33° 39'·0N., 78° 55'·6W.
33° 38'·8N., 78° 55'·3W.
33° 38'·7N., 78° 55'·1W.
33° 38'·2N., 78° 54'·1W.
33° 37'·2N., 78° 52'·6W.
33° 36'·3N., 78° 51'·1W.
33° 35'·6N., 78° 50'·2W.
33° 34'·8N., 78° 48'·4W.
33° 34'·2N., 78° 46'·7W.
33° 29'·4N., 78° 37'·2W.
33° 25'·7N., 78° 29'·5W.
33° 18'·8N., 78° 17'·6W.
33° 11'·1N., 77° 59'·8W.
33° 04'·4N., 77° 43'·4W.
32° 58'·9N., 77° 24'·2W.
32° 54'·5N., 77° 10'·8W.
32° 38'·1N., 76° 17'·1W.
32° 36'·1N., 76° 14'·3W.
32° 33'·8N., 76° 12'·9W.
32° 29'·3N., 76° 11'·9W.
32° 23'·9N., 76° 11'·4W.
32° 17'·6N., 76° 09'·8W.
32° 07'·7N., 76° 05'·2W.
31° 29'·3N., 75° 27'·5W.
31° 21'·2N., 75° 12'·0W.

4918(P)/25 SOUTH ATLANTIC OCEAN - Submarine cables. Works. (continued)

5. and

31° 17'·2N., 74° 55'·7W.
31° 16'·7N., 73° 58'·4W.
31° 06'·7N., 73° 20'·7W.
30° 50'·2N., 72° 52'·0W.
30° 19'·5N., 72° 17'·8W.
27° 04'·8N., 69° 49'·3W.
25° 47'·0N., 68° 32'·7W.
23° 36'·1N., 65° 44'·9W.
23° 09'·3N., 64° 34'·3W.
23° 09'·5N., 64° 27'·5W.
23° 12'·1N., 64° 21'·1W.
23° 12'·8N., 64° 14'·1W.
23° 11'·5N., 64° 05'·2W.
22° 55'·4N., 63° 30'·3W.
22° 47'·6N., 62° 55'·6W.
21° 42'·0N., 60° 29'·0W.
19° 41'·1N., 57° 21'·7W.
18° 11'·6N., 56° 00'·8W.
17° 31'·9N., 55° 19'·1W.
17° 20'·7N., 55° 12'·4W.
17° 12'·7N., 55° 11'·8W.
17° 02'·0N., 55° 07'·9W.
16° 48'·5N., 54° 57'·0W.
16° 35'·3N., 54° 54'·5W.
16° 20'·7N., 54° 55'·8W.

6. and

16° 14'·3N., 54° 53'·4W.
16° 06'·1N., 54° 45'·5W.
15° 59'·5N., 54° 35'·6W.
14° 27'·2N., 52° 43'·6W.
13° 30'·6N., 51° 55'·1W.
11° 55'·0N., 50° 21'·7W.
11° 21'·0N., 49° 43'·8W.
11° 13'·8N., 49° 31'·2W.
11° 12'·1N., 49° 19'·9W.
11° 13'·6N., 49° 11'·9W.
11° 17'·3N., 49° 05'·9W.
11° 22'·6N., 49° 01'·0W.
11° 25'·5N., 48° 55'·8W.
11° 27'·7N., 48° 46'·4W.
11° 26'·5N., 48° 34'·7W.
11° 19'·6N., 48° 15'·2W.
9° 51'·4N., 46° 11'·2W.
8° 18'·4N., 44° 16'·6W.
7° 34'·3N., 43° 14'·0W.
5° 01'·2N., 40° 45'·2W.
2° 19'·4N., 38° 21'·9W.
1° 09'·5N., 37° 28'·3W.
0° 57'·6N., 37° 08'·8W.
0° 23'·1S., 35° 57'·4W.
0° 33'·2S., 35° 40'·7W.

7. and

0° 40'·6S., 35° 19'·2W.
0° 51'·4S., 34° 54'·7W.
1° 25'·6S., 33° 56'·2W.
1° 37'·1S., 33° 42'·9W.
1° 44'·3S., 33° 39'·3W.
1° 47'·2S., 33° 34'·5W.
1° 48'·0S., 33° 29'·5W.

4918(P)/25 SOUTH ATLANTIC OCEAN - Submarine cables. Works. (continued)

8.

- *33° 41'·67S., 18° 26'·39E.
- *33° 48'·73S., 17° 38'·99E.
- *33° 42'·92S., 16° 47'·77E.
- *33° 46'·48S., 15° 30'·49E.
- *29° 14'·31S., 4° 25'·57E.
- *28° 44'·61S., 3° 27'·41E.
- *27° 25'·46S., 2° 27'·86E.
- *24° 37'·53S., 2° 39'·97W.
- *23° 45'·77S., 3° 16'·74W.
- *19° 01'·39S., 8° 49'·60W.
- *17° 30'·42S., 11° 04'·00W.
- *15° 29'·98S., 12° 12'·78W.
- *14° 47'·91S., 13° 08'·32W.
- *14° 40'·04S., 15° 48'·75W.
- *1° 47'·91S., 33° 29'·63W.

9. Mariners are advised to navigate with caution in the area.

10. Charts will be updated when works are complete.

11. *Former Notice 3891(P)/25 is cancelled.

*Indicates new or revised entry.

12. (WGS84 DATUM)

Charts affected — 517 — 520 — 528 — 2710 — 2864 — 3955 — 3957 — 4146 — 4148 — 4150 — 4151 — 4152 — 4177 — 4178 — 4202 — 4203 — 4204 — 4208 — 4215 — 4216 — 4400 — 4401 — 4402 — 4403 — 4407

5185(P)/25 BRAZIL - East Coast - Buoy.

Source: HYDROLANT 1711/25

1. A yellow ODAS buoy has been established in position 18° 03'·7S., 38° 51'·1W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3973**5186(T)/25 BRAZIL - North Coast - Buoy.**

Source: HYDROLANT 1769/25

1. An ODAS buoy has been established, in position 4° 53'·0S., 35° 46'·0W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 3955 — 3979**5225(P)/25 BRAZIL - North Coast - Depths. Dredged depths. Alongside depth.**

Source: ENC BR500320

1. Numerous depths less than charted exist within Baia de Guajara. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
7·8m	1° 24'·06S., 48° 31'·03W.
8·7m	1° 23'·02S., 48° 29'·98W.
4·3m	1° 27'·40S., 48° 30'·84W.
4·7m	1° 27'·69S., 48° 30'·73W.
4·3m	1° 27'·90S., 48° 30'·65W.
6·3m	1° 23'·80S., 48° 30'·95W.
3·3m	1° 23'·47S., 48° 30'·63W.
2·6m	1° 23'·28S., 48° 30'·46W.
9·4m	1° 23'·13S., 48° 29'·98W.
8·8m	1° 23'·24S., 48° 30'·01W.
1·4m	1° 23'·11S., 48° 30'·40W.
7·4m	1° 22'·73S., 48° 31'·88W.
5·3m	1° 24'·11S., 48° 29'·73W.

5225(P)/25 BRAZIL - North Coast - Depths. Dredged depths. Alongside depth. (continued)

2. The dredged areas, centred on the following positions, no longer exist:

<i>Dredged depth</i>	<i>Position</i>
2·9m (1991)	1° 26'·54S., 48° 29'·81W.
2·9m (1991)	1° 25'·02S., 48° 29'·74W.
6·0m (2016)	1° 24'·04S., 48° 29'·76W.

3. An alongside depth of 6·5m exists in position 1° 26'·25S., 48° 29'·68W.
4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
5. These changes will be included in a New Edition of Chart 331 to be published late 2025.
6. Former Notice 3135(P)/25 is cancelled.
(WGS84 DATUM)

Chart affected — 331

5420(T)/25 BRAZIL - South Coast - Platform.

Source: NAVAREA V Navigational Warning 0521/25

1. A container has been reported in the vicinity of platform P-74 (24° 39'·0S., 42° 30'·9W.)
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 529 — 530 — 4201

5676(T)/25 BRAZIL - South Coast - Buoy.

Source: HYDROLANT 1946/25

1. An ODAS buoy has been established in position 32° 32'·4S., 52° 05'·0W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 3984

5683(P)/25 BRAZIL - South Coast - Scientific instrument.

Source: Hydrolant 1873/25

1. A subsurface scientific instrument has been established in position 23° 49'·2S., 45° 00'·3W.
2. Mariners are advised to navigate with caution in the area.
3. Former Notice 3942(P)/25 is cancelled.
(WGS84 DATUM)

Chart affected — 3970

(25) CARIBBEAN SEA, WEST INDIES AND THE GULF OF MEXICO

2586(T)/16 MEXICO - Gulf of Mexico - Buoy.

Source: Mexican HO

1. A scientific yellow special light-buoy, *Fl(5)Y.20s*, has been temporarily established in position 18° 50'·1N., 95° 25'·9W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 Datum)

Charts affected — 376 — 1307

4258(P)/16 DOMINICAN REPUBLIC - Buoyage.

Source: SHARD

1. Numerous changes have been made to buoyage in the vicinities of San Pedro de Macorís and Puerto de Santo Domingo.
2. Light-buoys have been established in the following positions:

San Pedro de Macorís

Type	Characteristic	Position
emergency wreck marking buoy	<i>Fl.Y.Bu</i>	18° 26'·366N., 69° 18'·886W.
safe water marking buoy	<i>Fl.W</i>	18° 25'·788N., 69° 18'·432W.
special purpose buoy	-	18° 26'·619N., 69° 18'·720W.
port lateral buoy '9'	<i>Fl.G</i>	18° 26'·710N., 69° 18'·922W.

3. The following light-buoys have been moved:

San Pedro de
Macorís

Designation	Characteristic	Old Position	New Position
'1'	<i>Fl.G</i>	18° 26'·050N., 69° 18'·690W.	18° 26'·110N., 69° 18'·704W.
'2'	<i>Fl.R</i>	18° 26'·140N., 69° 18'·640W.	18° 26'·131N., 69° 18'·622W.
'3'	<i>Fl.G</i>	18° 26'·150N., 69° 18'·795W.	18° 26'·171N., 69° 18'·776W.
'4'	<i>Fl.R</i>	18° 26'·390N., 69° 18'·880W.	18° 26'·394N., 69° 18'·913W.
'5'	<i>Fl.G</i>	18° 26'·330N., 69° 18'·970W.	18° 26'·368N., 69° 18'·989W.
'6'	<i>Fl.R</i>	18° 26'·480N., 69° 18'·930W.	18° 26'·496N., 69° 18'·912W.
'7'	<i>Fl.G</i>	18° 26'·520N., 69° 19'·020W.	18° 26'·524N., 69° 19'·023W.

4. The following light-buoys have changed as follows:

Puerto
de Santo
Domingo

Designation	Old Characteristic	New Characteristic	Position
'1'	<i>Q.G</i>	<i>Fl.G</i>	18° 27'·625N., 69° 53'·485W.
'3'	<i>Q.G</i>	<i>Fl.G</i>	18° 27'·740N., 69° 53'·370W.

5. These and other changes will be included in the next New Edition of Chart 467.
(NAD27 Datum)

Chart affected — 467

4292(P)/16 DOMINICAN REPUBLIC - Buoyage.

Source: SHARD

1. Numerous changes have been made to buoyage in the vicinity of Bahía de Andrés.
2. The following light-buoys have been moved:

Designation	Characteristic	Old Position	New Position
'1'	<i>Fl.G</i>	18° 25'·97N., 69° 37'·79W.	18° 25'·96N., 69° 37'·78W.
'2'	<i>Fl.R</i>	18° 26'·05N., 69° 37'·82W.	18° 26'·02N., 69° 37'·79W.
'3'	<i>Fl.G</i>	18° 26'·08N., 69° 37'·91W.	18° 26'·05N., 69° 37'·89W.
'4'	<i>Fl.R</i>	18° 26'·10N., 69° 37'·88W.	18° 26'·09N., 69° 37'·87W.
'5'	<i>Fl.G</i>	18° 26'·22N., 69° 37'·94W.	18° 26'·24N., 69° 37'·93W.
'6'	<i>Fl.R</i>	18° 26'·22N., 69° 37'·88W.	18° 26'·23N., 69° 37'·89W.
port preferred channel marker buoy	<i>Fl.R</i>	18° 25'·87N., 69° 37'·72W.	18° 25'·88N., 69° 37'·72W.

4292(P)/16 DOMINICAN REPUBLIC - Buoyage. (continued)

- These and other changes will be included in the next New Edition of Chart 467. (WGS84 Datum)

Chart affected — 467

4666(T)/16 WEST INDIES - Bahamas - Lights.

Source: Bahamas Maritime Authority

- Until further notice, the following lights are temporarily extinguished:

<i>Light</i>	<i>Position</i>
Fl.2s20ft PA	25° 30'·0N., 78° 13'·9W.
Fl.4s20ft PA	25° 28'·5N., 78° 25'·6W.
Fl.2s20ft PA	25° 40'·9N., 78° 39'·5W.
Fl.4s20ft8M PA	25° 27'·4N., 79° 01'·7W.
North Rock Fl.3s40ft8M	25° 48'·3N., 79° 16'·7W.

- Mariners are advised to navigate with caution in the area. (Undetermined Datum)

Charts affected — 2866 — 3910

6211(P)/16 HAITI - Depths. Coastline. Lights. Wrecks. Obstructions.

Source: SEMANAH

- As a consequence of Hurricane Matthew which occurred during October 2016, depths, coastline and sea levels may have changed throughout the region (19° 04'·0N., 73° 38'·0W.). Wrecks and obstructions may have been displaced. Tidal predictions may be unreliable and aids to navigation may have been damaged, destroyed or be out of position. Mariners should expect considerable change and seek local knowledge when making for ports or seeking refuge.
- Mariners are advised to navigate with extreme caution in the area.

Charts affected — 465 — 466 — 3907 — 3935

3276(T)/17 SURINAME - Obstruction. Light.

Source: Maritime Authority Suriname Notice 26(T)/17

- An obstruction exists in position 5° 45'·105N., 57° 10'·843W. with a drying height of 6m above high water. It is marked by a yellow light, Fl(2)5s.
- Mariners are advised to keep a safe distance of 100m from the obstruction. (WGS84 DATUM)

Chart affected — 2766

1763(T)/18 WEST INDIES - Windward Islands - Buoy.

Source: svg-MARAD

- The starboard-hand light-buoy, *Fl.R.4s PA*, in position 12° 38'·26N., 61° 24'·09W. marking Grand Col Pt reef is reported missing.
- Mariners are advised to navigate with caution in the area. (WGS84 DATUM)

Chart affected — 794

4628(T)/18 MEXICO - Gulf of Mexico - Buoy.

Source: Mexican Notice 15/199(T)/18 and UKHO

- A measuring instrument, marked by a light-buoy, *Fl(2)Y.5s BOMMI*, has been established in position 24° 35'·9N., 96° 37'·5W.
- Former Notice 4496(T)/18 is cancelled. (WGS84 DATUM)

Chart affected — 3768

5983(T)/18 MEXICO - Gulf of Campeche - Platform.

Source: UKHO

1. An unlit platform has been reported to exist in position, 19° 31'·6N., 92° 23'·1W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1307 — 2626**659(P)/19 VENEZUELA - Superbuoy. Submarine pipeline.**

Source: Venezuelan Notice 44/16

1. A superbuoy will be established in position 10° 09'·4N., 64° 51'·4W.
2. A submarine pipeline will be established between the new superbuoy and the shore in position 10° 05'·0N., 64° 50'·7W.
3. Mariners are advised to navigate with caution in the area.
4. Former notice 1263(P)/17 is cancelled.
5. NOTE: Content of Notice unchanged, re-issued to include Chart 230.
(WGS84 DATUM)

Charts affected — 230 — 2191**949(T)/19 WEST INDIES - Trinidad and Tobago - Platform. Light.**

Source: Trinidad and Tobago Ministry of Works and Transport Navigational Warning 9/19

1. The platform, Mora, in position 10° 11'·04N., 60° 51'·49W. is reported to be unlit.
2. Mariners should navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 501 — 517 — 1044 — 1045**972(T)/19 WEST INDIES - Trinidad and Tobago - Platforms.**

Source: Trinidad and Tobago Ministry of Works and Transport

1. The following platforms are reported to be unlit:

<i>Designation</i>	<i>Position</i>
DP 5	10° 15'·89N., 61° 38'·24W.
DP 2	10° 15'·19N., 61° 38'·90W.

2. An unlit platform is reported to exist in position 10° 15'·52N., 61° 38'·03W.
3. Mariners are advised to navigate with caution in this area.
(WGS84 DATUM)

Chart affected — 475**1895(T)/19 WEST INDIES - Trinidad and Tobago - Buoyage.**

Source: Trinidad and Tobago Ministry of Works and Transport Navigational Warning 39/19

1. Yellow ODAS light-buoys, *Fl(4)Y.20s*, have been deployed, in the following positions 10° 17'·31N., 61° 29'·15W. and 10° 17'·94N., 61° 30'·14W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1044 — 1045**2745(T)/19 MEXICO - Gulf of Mexico - Obstructions.**

Source: Mexican Notice 5/99(P)/17 and UKHO

1. Water quality sampling stations, between 5m and 20m depths, have been established in the approaches to Altamira and Tuxpan, in the following positions:
 22° 33'·18N., 97° 51'·12W.
 22° 33'·23N., 97° 50'·90W.
 22° 33'·27N., 97° 50'·67W.
 22° 33'·27N., 97° 50'·43W.
 22° 33'·62N., 97° 50'·27W.

2745(T)/19 MEXICO - Gulf of Mexico - Obstructions. (continued)

22° 33'·42N., 97° 49'·87W.
 22° 33'·53N., 97° 49'·30W.
 22° 33'·63N., 97° 48'·73W.
 22° 33'·85N., 97° 47'·58W.
 22° 34'·17N., 97° 45'·87W.
 and

21° 14'·38N., 97° 24'·68W.
 21° 14'·45N., 97° 24'·42W.
 21° 14'·52N., 97° 24'·13W.
 21° 14'·57N., 97° 23'·85W.
 21° 14'·63N., 97° 23'·57W.
 21° 14'·77N., 97° 23'·00W.
 21° 14'·90N., 97° 22'·43W.
 21° 15'·15N., 97° 21'·32W.
 21° 15'·53N., 97° 19'·63W.
 21° 15'·92N., 97° 17'·97W.

- Mariners are advised to navigate with caution in the area.
- Former Notice 3056(T)/17 is cancelled.
(WGS84 DATUM)

Charts affected — 364 — 365 — 376 — 3768

3392(T)/19 MEXICO - Gulf of Mexico - Buoy.

Source: Mexican Notice 10/95(T)/19

- The green lateral light-buoy, *Fl.G.3s*, in position 20° 58'·79N., 97° 17'·13W. is reported to be out of position.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2753

3977(T)/19 MEXICO - Caribbean Sea Coast - Fish havens.

Source: Mexican Notice 12/1/19

- Fish havens exist within an area bounded by the following positions:

18° 44'·8N., 87° 20'·9W.
 18° 48'·7N., 87° 26'·2W.
 18° 48'·7N., 87° 28'·5W.
 18° 44'·1N., 87° 28'·5W.
 18° 40'·4N., 87° 23'·6W.

- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 662

4086(T)/19 VENEZUELA - Buoy.

Source: Venezuelan Notice 22/19

- The North Cardinal light-buoy, *Q*, in position 10° 36'·307N., 66° 57'·535W. is reported missing.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 1629

4909(T)/19 VENEZUELA - Buoy.

Source: Venezuelan Notice 40(T)/19

- The West cardinal light-buoy, *VQ(9)10s*, in position 11° 03'·1N., 64° 28'·8W. is reported unlit.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1966 — 2191

5444(P)/19 MEXICO - Gulf of Campeche - Works. Depths.

Source: Mexican Notice 17/246/19

1. Dredging and dumping works are taking place for 12 months, between and in the vicinity of, the following positions:

18° 26'·34N., 93° 15'·16W.

18° 40'·01N., 93° 23'·32W.

2. Depths less than charted are likely to exist as a result of the dumping.
3. Mariners are advised to navigate with caution in the area.
4. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 359 — 1307 — 2626**207(T)/20 MEXICO - Gulf of Mexico - Buoy.**

Source: Mexican Notice 22/316(T)/19

1. The light-buoy, *Fl.10s*, in position 18° 12'·34N., 94° 25'·60W. is reported to be out of service.
(WGS84 DATUM)

Chart affected — 2751**630(P)/20 WEST INDIES - Leeward Islands - Lights.**

Source: SCASPA Seaports Limited, St Kitts and Nevis National Register and UKHO

1. Numerous changes to lights have taken place within the Port of Basseterre.
2. The lights in the following positions have been changed to:

<i>Characteristic</i>	<i>Position</i>
Fl.5s2M	17° 17'·48N., 62° 42'·69W.
Fl.R.10s3M	17° 17'·10N., 62° 42'·67W.
Fl(2)G.10s5M	17° 17'·33N., 62° 44'·09W.
Iso.5s3M	17° 17'·23N., 62° 43'·37W.
Fl.23M & F.R	17° 18'·76N., 62° 42'·15W.
Fl(3)G.5s1M	17° 17'·55N., 62° 43'·50W.

3. The following lights have been established:

<i>Characteristic</i>	<i>Position</i>
F.2M	17° 17'·40N., 62° 43'·26W.
F.2M	17° 17'·42N., 62° 43'·22W.
F.2M	17° 17'·42N., 62° 43'·19W.
Fl.9M	17° 22'·20N., 62° 51'·74W.
F.2M	17° 17'·14N., 62° 42'·64W.
Fl.R.10s5M	17° 17'·15N., 62° 42'·60W.
Iso.5s3M	17° 17'·27N., 62° 43'·37W.
Iso.5s3M	17° 17'·30N., 62° 43'·37W.

4. The following lights have been removed:

<i>Characteristic</i>	<i>Position</i>
Q.R.6m5M	17° 17'·66N., 62° 43'·61W.
F.G.11m2M	17° 17'·37N., 62° 42'·53W.

5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
6. These and other changes will be included in the next New Editions of the Charts affected.
7. Former Notice 356(P)/20 is cancelled.
(WGS84 DATUM)

Charts affected — 583 — 2016

969(P)/20 WEST INDIES - Virgin Islands - Depths.

Source: British Government Survey

- Recent survey information has shown that numerous depths less than charted exist around the British Virgin Islands. Significant depths are as follows:

<i>Depth</i>	<i>Position</i>
19·5m	18° 18'·17N., 64° 35'·77W.
18m	18° 22'·18N., 64° 31'·02W.
13·3m	18° 24'·87N., 64° 40'·83W.
15·1m	18° 25'·51N., 64° 41'·33W.
19·8m	18° 25'·67N., 64° 46'·12W.
17·8m	18° 25'·13N., 64° 45'·95W.
14m	18° 27'·02N., 64° 20'·64W.
12·2m	18° 28'·79N., 64° 19'·21W.
19·2m	18° 33'·12N., 64° 12'·28W.
5·4m	18° 35'·73N., 64° 10'·61W.
13·6m	18° 36'·39N., 64° 09'·39W.
9·5m	18° 40'·35N., 64° 24'·83W.
18·6m	18° 43'·59N., 64° 43'·01W.
3·7m	18° 30'·547N., 64° 21'·214W.

- These and other changes will be included in the next New Edition of Charts 2020, 2005, 2019, 2006, 2016.
- Mariners are advised to navigate with caution in the area.
- Charts 2020, 2005, 2019, 2006 and 2016 will be updated by Notice to Mariners for the most significant depths and drying heights.
(WGS84 DATUM)

Chart affected — 2016**1055(T)/20 HONDURAS - Buoy.**

Source: Departamento Ayudas a la Navegación, Honduras

- The red lateral light-buoy, *Fl.R.4·5s*, in position 15° 50'·563N., 87° 58'·301W., has been temporarily removed.
(WGS84 DATUM)

Chart affected — 2988**1111(T)/20 WEST INDIES - Leeward Islands - Works.**

Source: Anguilla Air and Sea Ports Authority

- Works to replace the existing RoRo jetty in Road Bay are taking place in the vicinity of position 18° 11'·892N., 63° 05'·565W.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2079**1818(T)/20 MEXICO - Gulf of Campeche - Buoy.**

Source: Mexican Notice 4/41(T)/20

- The safe water light-buoy, *LFl.10s*, in position 19° 50'·1N., 90° 37'·8W. is reported to be out of service.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2626**2058(P)/20 WEST INDIES - Leeward Islands - Marine Reserves. Restricted area.**

Source: St. Kitts Department of Maritime Affairs

- Marine Management Areas have been established out to approximately 2 miles offshore around St. Kitts and Nevis (17° 16'·84N., 62° 40'·50W.) including Monkey Shoals.
- These areas have different restrictions applying to fishing, conservation and tourism.
- Mariners are requested to consult the local port authorities for the latest information.

2058(P)/20 WEST INDIES - Leeward Islands - Marine Reserves. Restricted area. (continued)

4. These changes will be included in the next New Editions of Charts 487, 489, 583, 584, and 585.
(WGS84 DATUM)

Chart affected — 583**2211(T)/20 WEST INDIES - Windward Islands - Buoy.**

Source: HMS Medway

1. The port-hand lateral light-buoy, *Q.G Fairway*, in position 13° 06'·568N., 59° 38'·252W. is reported off station.
2. Mariners are advised to navigate with caution in the area .
(WGS84 DATUM)

Chart affected — 502**3403(P)/20 MEXICO - Gulf of Mexico - Works.**

Source: Mexican Notice 10/105(P)/20

1. Construction works are taking place, in an area bounded by the following positions:
22° 28'·50N., 97° 53'·09W.
22° 28'·51N., 97° 53'·05W.
22° 28'·52N., 97° 53'·04W.
22° 28'·57N., 97° 52'·82W.
22° 28'·06N., 97° 52'·70W.
22° 28'·00N., 97° 52'·97W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 365**4268(P)/20 WEST INDIES - Leeward Islands - Depth.**

Source: Netherlands Notice 32-33/232(T)/20

1. A depth of 195m has been reported in the vicinity of position: 17° 46'·11N., 63° 17'·72W.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 583 — 1025 — 2016 — 2600**4952(T)/20 WEST INDIES - Leeward Islands - Buoyage. Dredging area.**

Source: French Notice 34/6(T)/20

1. The 4 special mark light buoys marking the dredging area centred on position 16° 11'·12N., 61° 26'·77W. have been withdrawn.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 618**4958(T)/20 MEXICO - Gulf of Campeche - Buoy.**

Source: Mexican Notice 15/170(T)/20

1. The Isolated Danger light-buoy, *Fl(2).R.10s*, in position 18° 38'·53N., 91° 52'·07W. is temporarily out of service.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2626**219(T)/21 MEXICO - Gulf of Mexico - Obstruction.**

Source: Mexican Notice 21/279/20

1. An obstruction exists in position 18° 16'·45N., 94° 20'·94W.

219(T)/21 MEXICO - Gulf of Mexico - Obstruction. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2751**234(P)/21 WEST INDIES - Trinidad and Tobago - Works. Submarine pipeline.**

Source: Trinidad and Tobago Ministry of Works and Transport

1. Pipeline laying operations are taking place in the vicinity of Crown Point Light, within an area bounded by the following positions:

11° 08'·93N., 60° 50'·92W.

11° 08'·97N., 60° 50'·72W.

11° 08'·81N., 60° 50'·68W.

11° 08'·76N., 60° 50'·88W.

2. Mariners are advised to navigate with caution in the area.
3. Chart 477 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 477**1474(T)/21 MEXICO - Gulf of Mexico - Buoy.**

Source: Mexican Notice 2/15(T)/21

1. The west cardinal light-buoy, *VQ(9)10s*, in position 19° 14'·31N., 96° 07'·62W. is temporarily off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 375**1646(P)/21 DOMINICAN REPUBLIC - Port development. Depths.**

Source: mV CSCL Long Beach

1. A Container terminal has been constructed between the following approximate positions:

18° 25'·78N., 69° 37'·91W.

18° 25'·78N., 69° 37'·89W.

18° 25'·60N., 69° 37'·86W.

2. Depths in the approach channel to the new terminal are reported to be deeper than charted.
3. These and other changes will be included in the next New Edition of Chart 467.
4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 Datum)

Chart affected — 467**1783(T)/21 WEST INDIES - Windward Islands - Restricted area.**

Source: St Vincent and the Grenadines Notice 02/2021

1. Due to the increased seismic activities and volcanic eruptions from the La Soufrière volcano in St Vincent and the Grenadines, a 3NM strict exclusion zone has been established joining the following positions:

13° 15'·00N., 61° 19'·60W.

13° 18'·00N., 61° 18'·50W.

13° 22'·08N., 61° 15'·38W.

13° 26'·00N., 61° 09'·91W.

13° 23'·70N., 61° 05'·22W.

13° 22'·29N., 61° 04'·90W.

13° 19'·88N., 61° 04'·10W.

13° 14'·41N., 61° 03'·90W.

2. Mariners transiting the area are requested to observe the exclusion zone.
3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 596 — 597 — 791

3430(P)/21 WEST INDIES - Leeward Islands - Wrecks. Obstructions. Depths.

Source: Netherland Notices 24/204-205/21

1. Numerous wrecks, obstructions and depths exist in the vicinity of Simson Baai, Groot Baai and Baie de Marigot, the most significant are as follows:

<i>Type</i>	<i>Depth</i>	<i>Position</i>
Depth	2·8m	18° 04'·120N., 63° 06'·610W.
Obstruction	11·3m	18° 00'·250N., 63° 02'·620W.
Obstruction	13·5m	18° 00'·230N., 63° 02'·430W.
Obstruction	15·1m	18° 00'·200N., 63° 02'·380W.
Wreck	18·5m	17° 59'·300N., 63° 03'·680W.
Wreck	20·8m	17° 59'·220N., 63° 03'·740W.
Obstruction	8·3m	18° 00'·77N., 63° 04'·97W.
Wreck	28·5m	17° 59'·80N., 63° 05'·54W.
Obstruction	19·2m	18° 01'·23N., 63° 07'·00W.
Wreck	8·3m	18° 01'·28N., 63° 06'·78W.
Wreck	14·0m	18° 01'·27N., 63° 06'·65W.
Wreck	12·5m	18° 01'·55N., 63° 06'·71W.
Wreck	31·0m	18° 00'·34N., 63° 06'·29W.

2. Mariners are advised to navigate with caution in the area.
3. These changes will be included in a New Edition of Chart 2079 to be published late 2021.
(WGS84 DATUM)

Chart affected — 2079**3579(T)/21 WEST INDIES - Leeward Islands - Wreck.**

Source: French Notice 17/10(T)/21

1. A dangerous wreck exists in position 18° 00'·65N., 63° 01'·74W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 583 — 1025 — 2016 — 2600**3926(T)/21 WEST INDIES - Bahamas - Light-beacon.**

Source: MSC Cruise Management

1. The starboard-hand light-beacon, Fl.R.2·5s8m6M 10B, in position 25° 24'·886N., 79° 12'·329W. has been destroyed, leaving behind a sub-surface obstruction.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 461**4062(P)/21 WEST INDIES - Trinidad and Tobago - Submarine cable.**

Source: Trinidad and Tobago Navigational Warning 37/21

1. A submarine cable is being laid between the Poinsettia Platform and the Cassra Well Site, joining the following positions:
 - 11° 13'·7N., 61° 31'·4W.
 - 11° 15'·0N., 61° 23'·0W.
 - 11° 16'·2N., 61° 14'·1W.
 - 11° 17'·8N., 61° 09'·0W.
 - 11° 24'·2N., 60° 57'·8W.
 - 11° 30'·5N., 60° 46'·5W.
2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 500 — 1044

4145(P)/21 GUYANA - Submarine cable. Works.

Source: Guyanese Notice 103/21

1. Cable laying works are taking place within an area bounded by the following positions:

Position

8° 10'·9N., 56° 51'·1W.

7° 42'·9N., 56° 47'·6W.

7° 47'·3N., 57° 05'·5W.

8° 10'·3N., 57° 05'·1W.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 517 — 572**4253(T)/21 MEXICO - Gulf of Mexico - Buoy. Radar beacon.**

Source: Mexican Notices 11/148(T)-149(T)/21

1. The safe-water light-buoy, *Fl.10s*, and associated radar beacon, *Racon(B)*, in position 20° 59'·39N., 97° 15'·96W. is reported to be out of service.
(WGS84 DATUM)

Charts affected — 376 — 2753**4897(T)/21 MEXICO - Gulf of Campeche - Buoyage.**

Source: Mexican Notice 15/175(T)/21

1. A group of 8 unlit buoys have been deployed, until further notice, in the vicinity of position 18° 59'·4N., 93° 15'·0W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2626**4899(T)/21 MEXICO - Gulf of Mexico - Buoyage.**

Source: Mexican Notices 16/187(T)-188(T)/21

1. The following lateral light-buoys are temporarily out of service:

Characteristic Position*Fl.R.3s* 20° 58'·11N., 97° 18'·59W.*Fl.G.3s* 20° 58'·03N., 97° 18'·55W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2753**5164(T)/21 MEXICO - Gulf of Campeche - Anchorage area.**

Source: Mexican Notice 21/229(T)/21

1. Anchoring is prohibited, until further notice, in the tanker anchorage area bounded by the following positions:

19° 21'·1N., 92° 30'·8W.

19° 21'·1N., 92° 27'·7W.

19° 17'·5N., 92° 27'·7W.

19° 17'·5N., 92° 30'·8W.

2. Mariners are advised to navigate with caution and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 1307 — 2626

379(P)/22 COLOMBIA - Caribbean Sea Coast - Restricted area.

Source: ENC CO300026

1. The restricted fishing area, has been extended bounded by the following positions:

12° 09'·2N., 71° 04'·0W.
12° 12'·5N., 71° 06'·0W.
12° 18'·2N., 71° 07'·7W.
12° 21'·7N., 71° 12'·4W.
12° 23'·8N., 71° 17'·5W.
12° 24'·7N., 71° 21'·0W.
12° 27'·9N., 71° 29'·6W.
12° 29'·3N., 71° 35'·2W.
12° 28'·9N., 71° 40'·7W.
12° 26'·4N., 71° 44'·2W.

2. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 2194**1061(P)/22 DOMINICAN REPUBLIC - Works. Port developments. Dredging area. Pier.**

Source: Dominican Port Authority

1. Port developments and dredging have taken place within Puerto Plata to extend the main pier and deepen the port as part of the Taino Bay Cruise Terminal Project.
2. The main pier centred on 19° 48'·665N., 70° 41'·830W. has been extended to position 19° 48'·875N., 70° 41'·745W.
3. Further works are ongoing.
4. Mariners are advised to navigate with caution in the area and to contact the local port authority for the latest information.
5. The chart will be updated when full details are available.
(UNDETERMINED DATUM)

Chart affected — 463**1258(T)/22 WEST INDIES - Bahamas - Buoy.**

Source: mv Endurance IV

1. The red light-buoy, *Fl.5s Cable*, in position 26° 31'·49N., 78° 48'·71W. is reported missing.
(WGS84 DATUM)

Charts affected — 390 — 398 — 3910**1534(T)/22 COLOMBIA - Caribbean Sea Coast - Virtual aid to navigation.**

Source: Colombian Notice 105(T)/22

1. A virtual aid to navigation (V-AIS), isolated danger topmark, has been established in position 10° 57'·22N., 74° 45'·48W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2261**2153(T)/22 MEXICO - Gulf of Mexico - Buoy.**

Source: Mexican Notice 3/44(T)/22

1. The *No 4* light-buoy, *Fl.R.3s*, in position 19° 12'·334N., 96° 07'·755W. is reported off station.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 375

2220(T)/22 MEXICO - Gulf of Mexico - Buoy.

Source: Mexican Notice 4/49(T)/22

1. The No 8 lateral light-buoy, *Fl.R.3s*, in position 18° 09'·193N., 94° 24'·655W. is off station. (WGS84 DATUM)

Chart affected — 2751

3251(P)/22 WEST INDIES - Cayman Islands - Depths. Drying height.

Source: British Government Surveys

1. Numerous depths less than charted exist in the Cayman Islands. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
17·4m	19° 15'·89N., 81° 23'·77W.
23·5m	19° 15'·23N., 81° 23'·77W.
6·0m	19° 15'·93N., 81° 21'·46W.
14·8m	19° 17'·40N., 81° 11'·86W.
9·8m	19° 17'·38N., 81° 10'·63W.
1·7m	19° 18'·22N., 81° 05'·40W.
22·0m	19° 18'·73N., 81° 03'·91W.
1·6m	19° 19'·41N., 81° 04'·88W.
0·4m	19° 20'·39N., 81° 05'·00W.
13·9m	19° 21'·54N., 81° 07'·17W.
0·1m	19° 22'·11N., 81° 18'·62W.
0·4m	19° 23'·92N., 81° 23'·23W.
21·5m	19° 39'·21N., 80° 07'·27W.
15·9m	19° 39'·94N., 80° 02'·67W.
12·0m	19° 40'·57N., 80° 01'·82W.
12·9m	19° 41'·53N., 79° 58'·82W.
17·0m	19° 41'·85N., 79° 56'·91W.
9·7m	19° 42'·70N., 79° 57'·30W.
13·6m	19° 43'·07N., 79° 58'·90W.
2·4m	19° 41'·80N., 79° 49'·50W.
16·0m	19° 42'·43N., 79° 47'·82W.
13·2m	19° 43'·75N., 79° 44'·33W.
25·5m	19° 45'·37N., 79° 42'·82W.
19·2m	19° 45'·54N., 79° 43'·32W.
12·1m	19° 45'·54N., 79° 44'·33W.
14·9m	19° 44'·45N., 79° 46'·75W.
10·3m	19° 43'·86N., 79° 48'·81W.
17·2m	19° 43'·60N., 79° 49'·40W.
2·1m	19° 43'·02N., 79° 49'·93W.
11·5m	19° 42'·88N., 79° 50'·30W.
13·3m	19° 17'·42N., 81° 10'·17W.
14·5m	19° 21'·45N., 81° 08'·57W.
0·5m	19° 18'·46N., 81° 20'·46W.
<i>Drying height</i>	<i>Position</i>
0·3m	19° 23'·26N., 81° 21'·70W.

2. Mariners are advised to navigate with caution in the area.
3. These changes will be included in the next New Edition of Chart 462. (WGS84 DATUM)

Chart affected — 462

3631(T)/22 SURINAME - Buoy. Wreck.

Source: Netherlands Notice 11/80(T)/22 and Surinamese Notice 27(T)/2022

1. A dangerous to navigation wreck exists in position 6° 05'·40 N. , 55° 11'·80 W.
2. *A light-buoy, *Fl.Y.4s* , has been established in position 6° 04'·87N., 55° 11'·92W.
3. Mariners are advised to navigate with caution in the area.

3631(T)/22 SURINAME - Buoy. Wreck. (continued)

4. Former Notice 1358(T)/22 is cancelled.
 *Indicates new or revised entry.
 (WGS84 DATUM)

Chart affected — 2764

3656(T)/22 MEXICO - Gulf of Mexico - Buoy.

Source: Mexican Notice 13/147(T)/22

1. The No 3 light-buoy, *Fl(2)10s*, in position 21° 02'·15N., 97° 17'·68W., is temporarily out of service.
 (WGS84 DATUM)

Chart affected — 2753

4217(T)/22 WEST INDIES - Trinidad and Tobago - Buoy.

Source: Trinidad and Tobago Ministry of Works and Transport Navigational Warning 87/22

1. The Three Fathom Bank light-buoy, *Fl.R.3s*, in position 10° 03'·71N., 61° 57'·43W. is reported off station.
 2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 481 — 483

4882(T)/22 MEXICO - Gulf of Campeche - Buoy. Wreck.

Source: Mexican Notices 20/277(T)/19, 4/55(T)/22 and 15/165(T)/22

1. The safe water pillar light-buoy, *Fl.10s*, in position 18° 43'·65N., 91° 54'·15W., is reported off station. The buoy is now reported to be in position 18° 43'·32N., 91° 53'·84W.
 2. A stranded wreck exists in position 18° 43'·45N., 91° 47'·03W.
 3. Mariners are advised to navigate with caution in the area.
 4. *Former Notice 1906(T)/22 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 2626

485(P)/23 DOMINICAN REPUBLIC - Submarine cable.

Source: UKHO

1. A submarine cable is being laid, joining the following positions:

17° 25'·83N., 69° 52'·25W.
 17° 30'·20N., 69° 48'·97W.
 17° 37'·63N., 69° 47'·87W.
 18° 01'·70N., 69° 52'·98W.
 18° 13'·45N., 69° 54'·45W.
 18° 18'·56N., 69° 55'·60W.
 18° 23'·39N., 69° 54'·82W.
 18° 26'·68N., 69° 54'·69W.
 18° 27'·27N., 69° 54'·65W.
 18° 27'·29N., 69° 54'·65W.

2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 467 — 471 — 3001

490(P)/23 GUYANA - Works. Restricted area. General information. Quarantine anchorage.

Source: Maritime Administration Department of Guyana Notice 171/22

1. Works are in progress to extend the Demerara Main Ship Channel.

490(P)/23 GUYANA - Works. Restricted area. General information. Quarantine anchorage. (continued)

2. A new restricted area, anchoring prohibited, has been established bounded by the following positions:

6° 59'·19N., 58° 01'·85W.
 6° 59'·04N., 58° 02'·00W.
 6° 57'·48N., 58° 03'·56W.
 6° 56'·50N., 58° 04'·53W.
 6° 55'·73N., 58° 03'·77W.
 6° 56'·94N., 58° 02'·56W.
 6° 57'·90N., 58° 01'·61W.
 6° 58'·43N., 58° 01'·08W.

3. Whilst works are ongoing, the positions of floating aids to navigation in the area are subject to change.
 4. The limits of the Quarantine anchorage area have been amended. Areas still exist in the vicinity of the following positions: 6° 58'·41N., 58° 03'·18W. and 6° 57'·34N., 58° 01'·88W.
 5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
 6. Charts will be updated when full details become available.
 (WGS84 DATUM)

Charts affected — 527 — 537 — 2687

755(T)/23 MEXICO - Gulf of Mexico - Buoy.

Source: Mexican Notice 22/324(T)/19

1. The light-buoy, *Fl.R.3s No 6*, in position 19° 13'·633N., 96° 09'·111W. is reported to be out of position.
 2. Mariners are advised to navigate with caution in the area.
 3. *Former Notice 596(T)/22 is cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Chart affected — 375

1114(P)/23 MEXICO - Gulf of Mexico - Foul.

Source: mv Adriatic Wave

1. A foul has been reported to exist in the vicinity of position 22° 13'·02N., 97° 43'·62W.
 2. Mariners are advised to navigate with caution in the area.
 (WGS84 DATUM)

Charts affected — 363 — 364 — 376 — 3768

1822(P)/23 CARIBBEAN SEA - Submarine cable. Works.

Source: Alcatel Submarine Networks

1. The CSN-1 submarine cable system is due to be laid during 2024. The proposed positions of the segments are listed below along with the largest scale charts affected in brackets. The accompanying diagram shows the overall coverage of the proposed cables.
 2. A: Florida to Panama (3853, 2833, 1220, 2943, 396 and 1400)

9° 21'·88N., 79° 57'·85W.
 9° 22'·46N., 79° 58'·19W.
 9° 22'·72N., 80° 00'·79W.
 9° 23'·73N., 80° 02'·53W.
 9° 40'·3N., 80° 11'·1W.
 10° 12'·5N., 80° 10'·2W.
 10° 31'·4N., 80° 00'·6W.
 11° 36'·2N., 79° 18'·2W.
 11° 48'·7N., 79° 13'·9W.
 12° 26'·5N., 79° 22'·6W.
 13° 19'·1N., 79° 21'·2W.
 14° 13'·8N., 79° 25'·8W.
 14° 34'·7N., 79° 34'·2W.

15° 31'·5N., 80° 05'·5W.
 15° 54'·7N., 80° 39'·1W.
 16° 36'·1N., 81° 04'·1W.

1822(P)/23 CARIBBEAN SEA - Submarine cable. Works. (continued)

17° 02'·9N., 81° 38'·2W.
 17° 05'·2N., 81° 45'·5W.
 17° 09'·2N., 82° 20'·0W.
 17° 40'·9N., 83° 10'·9W.
 17° 59'·2N., 83° 25'·2W.
 18° 22'·3N., 83° 24'·7W.
 18° 59'·0N., 83° 32'·4W.
 19° 09'·2N., 83° 38'·2W.
 19° 33'·9N., 84° 14'·4W.
 20° 49'·0N., 84° 57'·1W.

21° 20'·0N., 85° 20'·5W.
 21° 52'·3N., 85° 27'·4W.
 22° 00'·8N., 85° 26'·9W.
 22° 19'·2N., 85° 17'·4W.
 22° 40'·0N., 85° 22'·2W.
 22° 48'·7N., 85° 25'·1W.
 22° 55'·4N., 85° 22'·8W.
 23° 46'·1N., 84° 34'·9W.
 24° 05'·4N., 83° 58'·6W.
 24° 35'·2N., 83° 30'·6W.
 25° 28'·6N., 82° 51'·4W.
 26° 08'·5N., 82° 15'·1W.
 26° 19'·8N., 81° 50'·9W.

3. B: Barranquilla East (1276 and 396)

11° 48'·7N., 79° 13'·9W.
 11° 49'·1N., 76° 49'·7W.
 11° 37'·4N., 76° 29'·6W.
 11° 35'·75N., 75° 32'·11W.
 11° 34'·66N., 75° 27'·58W.
 11° 32'·21N., 75° 24'·38W.
 11° 21'·12N., 75° 19'·52W.
 11° 08'·05N., 75° 09'·54W.
 11° 02'·46N., 75° 02'·04W.
 11° 01'·37N., 74° 56'·09W.

4. C: Panama to Ecuador (1929, 2258, 2257 and 3092)

2° 18'·0S., 80° 54'·4W.
 2° 22'·0S., 81° 01'·1W.
 2° 13'·1S., 81° 27'·4W.
 1° 59'·2S., 81° 35'·1W.
 1° 32'·5S., 81° 42'·2W.
 0° 54'·8S., 81° 42'·8W.
 0° 16'·9S., 81° 29'·4W.
 0° 12'·4S., 81° 29'·4W.
 0° 02'·2S., 81° 33'·7W.
 0° 26'·1N., 81° 32'·3W.
 1° 05'·8N., 81° 16'·6W.
 1° 38'·3N., 80° 47'·5W.
 2° 02'·5N., 80° 47'·6W.
 3° 10'·0N., 80° 30'·0W.
 3° 28'·2N., 80° 20'·2W.

4° 22'·1N., 79° 43'·6W.
 4° 38'·2N., 79° 36'·4W.
 6° 14'·2N., 79° 28'·9W.
 6° 36'·5N., 79° 21'·6W.
 6° 45'·1N., 79° 14'·8W.
 6° 58'·2N., 78° 58'·1W.
 7° 00'·6N., 78° 52'·6W.
 7° 08'·6N., 78° 45'·2W.

1822(P)/23 CARIBBEAN SEA - Submarine cable. Works. (continued)


7° 13'·0N., 78° 42'·9W.
7° 18'·0N., 78° 42'·7W.
7° 42'·1N., 78° 49'·6W.
8° 05'·2N., 79° 11'·2W.
8° 44'·8N., 79° 12'·7W.
9° 00'·4N., 79° 28'·8W.

5. Mariners are advised to navigate with caution in the area and to avoid anchoring or trawling in the vicinity of the cable route.
6. Charts will be updated when works are complete.
(WGS84 DATUM)

**Charts affected — 396 — 1220 — 1276 — 1400 — 1929 — 2257 — 2258 — 2833 — 2943 — 2996 — 3092 —
3853 — 4401 — 4402 — 4608 — 4811**



To accompany Notice to Mariners 1822(P)/23

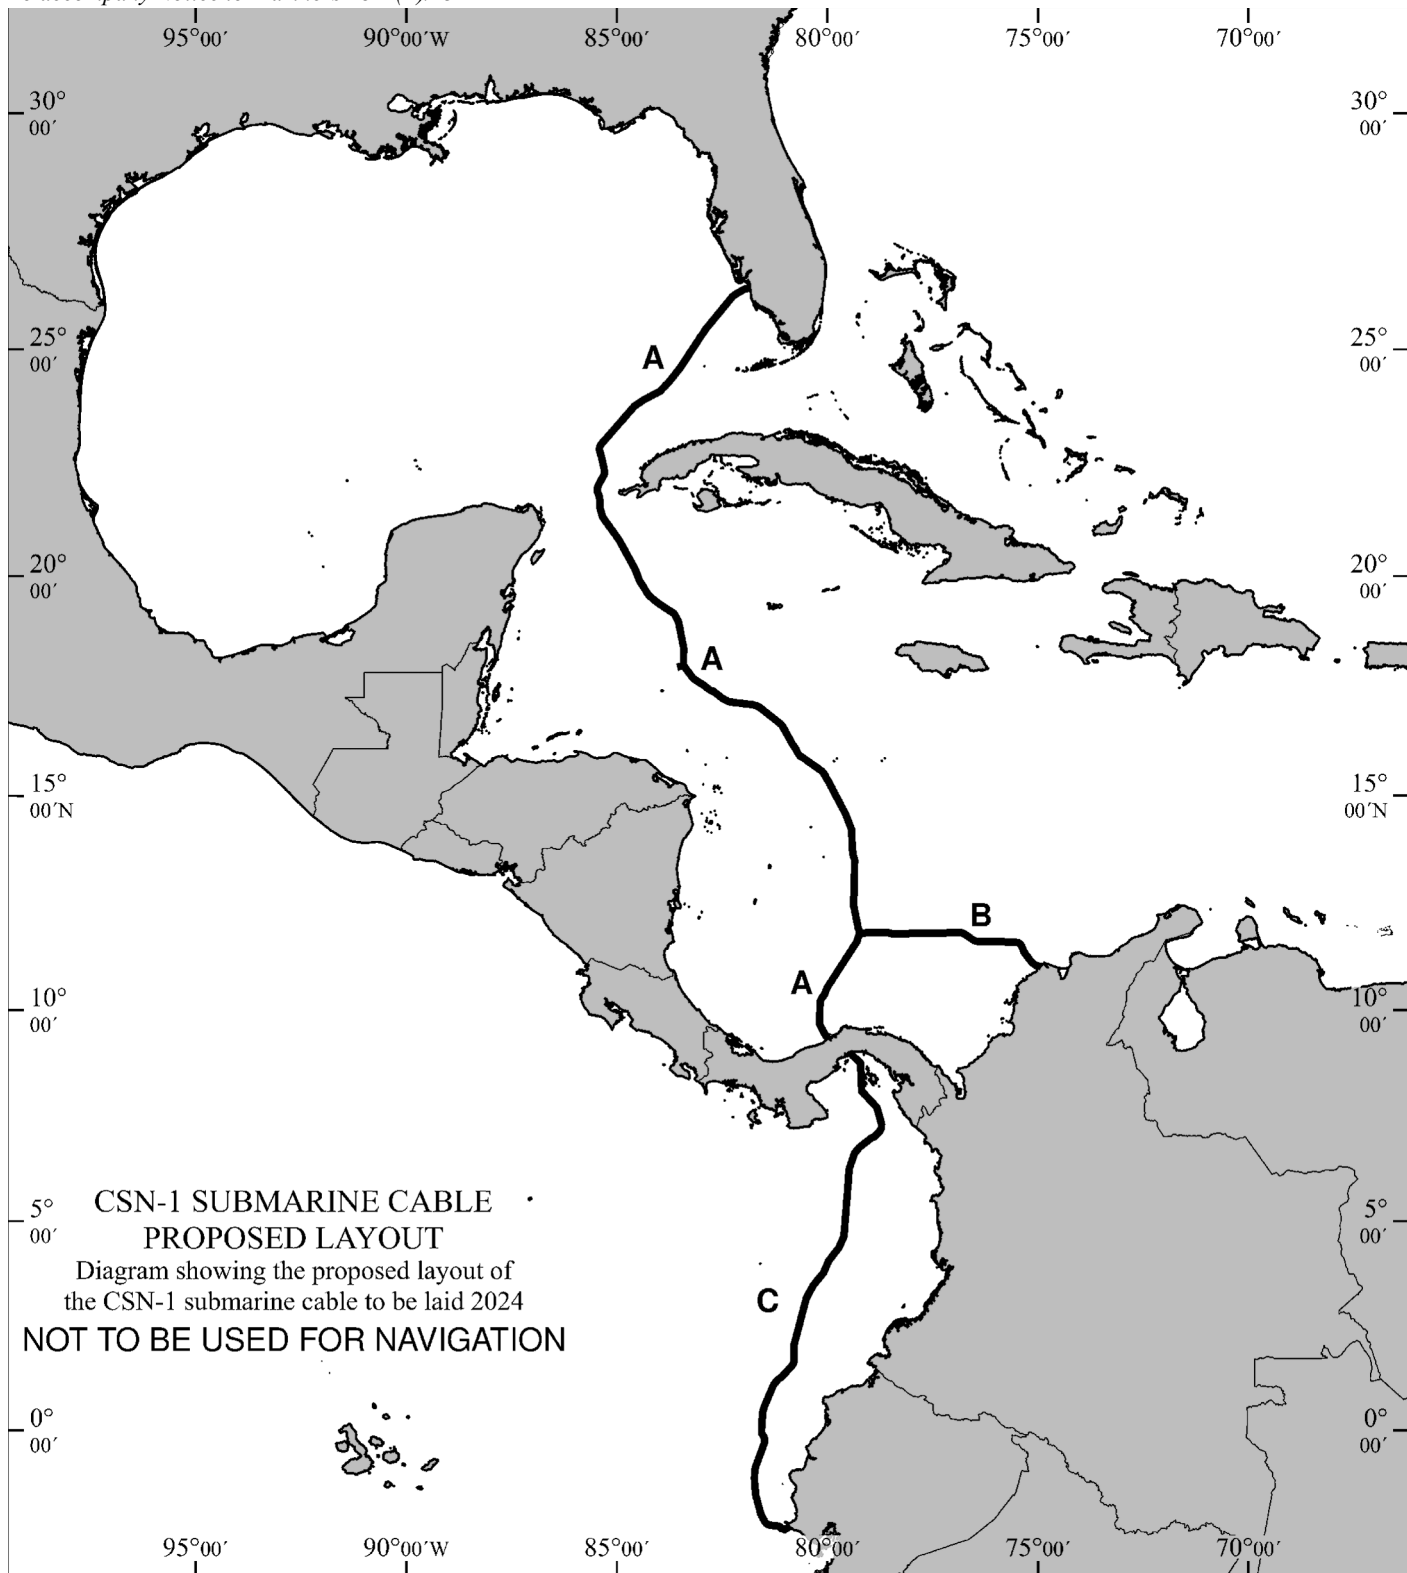

1905(T)/23 WEST INDIES - Windward Islands - Obstruction.

Source: French Notice 34/24(T)/2022

1. An obstruction, depth 42m, exists in position 14° 35'·74N., 61° 04'·85W.

1905(T)/23 WEST INDIES - Windward Islands - Obstruction. (continued)

- Mariners are advised to not to anchor within the vicinity of the obstruction and navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 368

1992(P)/23 UNITED STATES OF AMERICA - Gulf of Mexico - Depths. Obstructions. Dredged depths. Wreck.

Source: ENC US5HOU EC

- Numerous changes to depths, obstructions, and dredged depths in the vicinity of the Houston Ship Channel. The most significant are as follows:
- Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
33ft	29° 44' .638N., 95° 17' .040W.
16ft	29° 43' .832N., 95° 16' .642W.
13ft	29° 43' .820N., 95° 16' .640W.
12ft	29° 43' .713N., 95° 16' .596W.
31ft	29° 43' .441N., 95° 15' .054W.

- Depths less than charted exist. The most significant are:

<i>Depth</i>	<i>Position</i>
22ft	29° 43' .468N., 95° 16' .220W.
* 35ft	29° 44' .329N., 95° 16' .743W.
* 35ft	29° 44' .213N., 95° 16' .684W.

- *Many of the charted dredged depth areas within the Houston Shipping Channel are no longer maintained.
- Wreck and obstructions have been removed from the following positions:

Obstruction	29° 44' .723N., 95° 17' .129W.
Obstruction	29° 44' .063N., 95° 16' .615W.
Wreck	29° 43' .516N., 95° 16' .266W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Chart will be updated when works are complete.
- Former Notice 116(P)/23 is cancelled.
*Indicates new or revised entry
(NAD83 DATUM)

Chart affected — 3188

2094(P)/23 UNITED STATES OF AMERICA - Gulf of Mexico - Dredged depths. Obstructions. Depths. Channel limits.

Source: ENC US5HOU ED

- * Many of the charted dredged depth areas within the Houston Shipping Channel are no longer maintained.
- Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
9ft	29° 45' .462N. , 95° 10' .783W.
12ft	29° 45' .301N. , 95° 10' .620W.
41ft	29° 44' .759N. , 95° 10' .901W.
38ft	29° 43' .708N. , 95° 12' .596W.
27ft	29° 43' .457N. , 95° 13' .270W.
33ft	29° 43' .616N. , 95° 13' .397W.
26ft	29° 43' .645N. , 95° 13' .393W.
23ft	29° 43' .706N. , 95° 13' .465W.
40ft	29° 43' .228N. , 95° 14' .851W.
35ft	29° 43' .589N. , 95° 13' .409W.
14ft	29° 43' .534N. , 95° 14' .982W.

**2094(P)/23 UNITED STATES OF AMERICA - Gulf of Mexico - Dredged depths. Obstructions. Depths.
Channel limits. (continued)**

3. The following obstructions have been removed:

29° 44' .473N. , 95° 12' .109W.
29° 43' .594N. , 95° 13' .432W.
29° 43' .595N. , 95° 13' .465W.
29° 43' .555N. , 95° 13' .686W.
29° 43' .442N. , 95° 14' .035W.
29° 43' .427N. , 95° 14' .069W.
29° 43' .398N. , 95° 14' .109W.
29° 43' .392N. , 95° 14' .122W.
29° 43' .382N. , 95° 14' .136W.
29° 43' .370N. , 95° 14' .152W.
29° 43' .360N. , 95° 14' .169W.
29° 43' .131N. , 95° 14' .216W.
29° 43' .346N. , 95° 14' .943W.
29° 43' .418N. , 95° 14' .945W.
29° 43' .445N. , 95° 14' .946W.
29° 43' .460N. , 95° 14' .927W.

4. *Depths less than charted exist within the Houston Ship Channel. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
34ft	29° 44' .410N., 95° 12' .451W.
19ft	29° 43' .572N., 95° 13' .673W.

5. *Channel limits within the Houston Ship Channel have been removed in the vicinity of:

29° 44' .651N., 95° 11' .369W.
29° 43' .388N., 95° 14' .947W.

6. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

7. Charts will be updated when works are complete.

8. *Former Notice 865(P)/23 is cancelled.

*Indicates new or revised entry
(NAD83 DATUM)

Chart affected — 3188

**2146(P)/23 UNITED STATES OF AMERICA - Gulf of Mexico - Obstructions. Depths. Dredged depths.
Dolphins. Dredged area. Leading line.**

Source: ENC US5HOUF

1. There are numerous changes to depths, obstructions, and dredged depths in the vicinity of the Houston Shipping Channel.
The most significant are as follows:

2. Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
14ft	29° 43' .906N., 95° 03' .017W.
14ft	29° 43' .769N., 95° 03' .238W.
10ft	29° 45' .742N., 95° 04' .809W.
15ft	29° 46' .043N., 95° 05' .467W.
17ft	29° 45' .529N., 95° 05' .608W.
16ft	29° 45' .448N., 95° 05' .707W.

3. Depths less than charted exist. The most significant are:

<i>Depth</i>	<i>Position</i>
41ft	29° 43' .921N., 95° 03' .194W.
29ft	29° 44' .171N., 95° 03' .132W.
31ft	29° 45' .497N., 95° 05' .420W.
*36ft	29° 45' .779N., 95° 05' .403W.
*14ft	29° 45' .489N., 95° 05' .906W.
*41ft	29° 45' .263N., 95° 05' .722W.

4. *Many of the charted dredged depth areas within the Houston Shipping Channel are no longer maintained.

2146(P)/23 UNITED STATES OF AMERICA - Gulf of Mexico - Obstructions. Depths. Dredged depths. Dolphins. Dredged area. Leading line. (continued)

5. Obstructions have been removed from the following positions:

Obstruction	29° 45'·832N., 95° 04'·729W.
Obstruction	29° 46'·124N., 95° 04'·638W.
Obstruction	29° 45'·019N., 95° 05'·954W.
Obstruction	29° 44'·965N., 95° 05'·768W.
Obstructions	29° 44'·909N., 95° 05'·870W.
Obstructions	29° 44'·864N., 95° 05'·876W.
Obstructions	29° 44'·760N., 95° 05'·823W.
Obstruction	29° 44'·592N., 95° 05'·857W.

6. Dolphins have been established in the following positions:

29° 45'·235N., 95° 05'·779W.
29° 45'·200N., 95° 05'·805W.
29° 44'·873N., 95° 05'·880W.
29° 44'·864N., 95° 05'·871W.

7. The leading line, originating from rear leading light Iso.R.6s37ft in position 29° 46'·021N., 95° 05'·060W., now has a bearing of 301·7°. The front leading light remains unchanged.

8. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

9. Chart 3187 will be updated when works are complete.

10. *Former Notice 501(P)/23 is cancelled.

*Indicates new or revised entry
(NAD83 DATUM)

Chart affected — 3187

2152(P)/23 UNITED STATES OF AMERICA - Gulf of Mexico - Depths. Dredged depths. Dredged area. Obstructions. Dolphins. Coastline. Pier.

Source: ENC US5HOUUEE

1. There have been numerous changes to depths, obstructions and dredged depths in the vicinity of Houston Ship Channel.

2. Depths less than charted exist. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
12ft	29° 44'·535N., 95° 06'·253W.
15ft	29° 44'·419N., 95° 06'·469W.
26ft	29° 44'·130N., 95° 07'·232W.
26ft	29° 44'·140N., 95° 08'·210W.
33ft	29° 44'·165N., 95° 08'·520W.
14ft	29° 44'·655N., 95° 09'·943W.
19ft	29° 44'·576N., 95° 10'·447W.
*39ft	29° 44'·490N., 95° 06'·761W.
*31ft	29° 44'·489N., 95° 06'·850W.
*28ft	29° 44'·381N., 95° 07'·093W.

3. *Deeper depths exist, the minimum of which is 32ft, in an area bounded by the following positions:

29° 44'·400N., 95° 07'·415W.
29° 44'·227N., 95° 07'·338W.
29° 44'·267N., 95° 07'·242W.
29° 44'·303N., 95° 07'·290W.
29° 44'·415N., 95° 07'·355W.
29° 44'·400N., 95° 07'·415W.

4. * Many of the charted dredged depth areas within the Houston Shipping Channel are no longer maintained.

5. *The Jacinto Channel dredged area, Mid-half dredged depth 41ft (2022), has been established joining the following positions:

29° 44'·806N., 95° 06'·733W.
29° 44'·966N., 95° 06'·400W.
29° 44'·869N., 95° 06'·077W.

**2152(P)/23 UNITED STATES OF AMERICA - Gulf of Mexico - Depths. Dredged depths. Dredged area.
Obstructions. Dolphins. Coastline. Pier. (continued)**

6. Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
37ft	29° 44'·941N., 95° 06'·446W.
12ft	29° 44'·430N., 95° 07'·115W.
12ft	29° 44'·445N., 95° 07'·120W.
39ft	29° 44'·794N., 95° 10'·435W.
16ft	29° 44'·621N., 95° 10'·463W.
11ft	29° 44'·605N., 95° 10'·460W.
36ft	29° 44'·944N., 95° 10'·032W.
*36ft	29° 44'·960N., 95° 09'·950W.

7. Obstructions have been removed from the following positions:

<i>Depth</i>	<i>Position</i>
27ft	29° 44'·361N., 95° 07'·020W.
15ft	29° 44'·398N., 95° 07'·110W.
unknown	29° 44'·155N., 95° 08'·097W.

8. Dolphins are now unlit in the following positions:

29° 44'·170N., 95° 07'·514W.
29° 44'·165N., 95° 07'·634W.

9. The coastline has been changed between the following positions:

29° 44'·177N., 95° 07'·862W.
29° 44'·186N., 95° 08'·050W.

10. A dolphin has been established in position 29° 45'·000N., 95° 06'·397W.

11. A pier is under construction in the vicinity of position 29° 44'·228N., 95° 08'·824W.

12. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

13. Charts will be updated when works are complete.

14. *Former Notice 519(P)/23 is cancelled.

*Indicates new or revised entry
(NAD83 DATUM)

Charts affected — 3187 — 3188

2572(T)/23 DOMINICAN REPUBLIC - Light.

Source: HAL, ms Rotterdam

1. The Cabo Engaño light, Fl.5s43m11M, in position 18° 36'·96N., 68° 19'·59W., is reported temporarily extinguished and has been replaced by a South Cardinal mark, Q(6)+LFl, until further notice.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 472 — 3001

3241(T)/23 COLOMBIA - Caribbean Sea Coast - Virtual aids to navigation.

Source: Colombian Notices 305(T)/22 and 225/23

1. Virtual aids to navigation (V-AIS), have been established in the following positions:

<i>Designation</i>	<i>Position</i>
12A	11° 02'·03N., 74° 48'·32W.

2. *Former Notice 2415(T)/23 is cancelled.

*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 2261

3388(T)/23 GUYANA - Dredging area. Works.

Source: Maritime Administration Department of Guyana Notice 114/23

1. Dredging works are taking place in the Demerara Main Ship Channel, in the area bounded by the following positions:

6° 49'·17N., 58° 12'·00W.
6° 50'·921N., 58° 10'·851W.
6° 58'·10N., 58° 03'·70W.
7° 02'·18N., 57° 59'·64W.
7° 01'·23N., 57° 57'·52W.
6° 55'·04N., 58° 03'·69W.
6° 54'·30N., 58° 04'·77W.
6° 49'·856N., 58° 09'·611W.
6° 49'·745N., 58° 10'·488W.
6° 48'·872N., 58° 10'·632W.
6° 48'·880N., 58° 11'·123W.
6° 48'·965N., 58° 11'·123W.
6° 49'·09N., 58° 11'·66W.
6° 49'·07N., 58° 11'·86W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 519 — 527 — 537 — 572 — 2687

3534(T)/23 WEST INDIES - Windward Islands - Pipe. Buoy.

Source: French Notice 7/8(T)/23

1. A discharge pipe has been reported on the surface between Anse à l'Âne and Anse Mitan near the West CC cardinal buoy, located in position 14° 33'·05N., 61° 03'·80W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 368

3826(T)/23 WEST INDIES - Windward Islands - Wreck.

Source: French Notice 26/8(T)/23

1. A wreck, depth 20m, has been reported to exist in position 14° 33'·46N., 61° 02'·82W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 368

4268(T)/23 MEXICO - Gulf of Campeche - Wreck.

Source: Mexican Notice 16/187(T)/2023

1. A wreck of unknown depth exists in position 19° 40'·30N., 90° 43'·00W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2626

4581(P)/23 BELIZE - Depths.

Source: UKHO

- Recent survey information has shown that numerous depths less than charted exist between Hick's Cays and Guatemala. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
0·4m	16° 56'·220N., 88° 13'·709W.
0·8m	16° 56'·178N., 88° 13'·635W.
0·5m	16° 56'·139N., 88° 13'·776W.
2·4m	16° 56'·118N., 88° 13'·646W.
4·3m	16° 56'·190N., 88° 13'·427W.
3·9m	16° 56'·102N., 88° 13'·533W.
3·7m	16° 56'·031N., 88° 13'·668W.
3·9m	16° 55'·954N., 88° 13'·791W.
5m	16° 56'·071N., 88° 13'·381W.
5·6m	16° 55'·951N., 88° 13'·453W.
4·8m	16° 55'·890N., 88° 13'·599W.
4·4m	16° 55'·867N., 88° 13'·808W.
6m	16° 55'·771N., 88° 13'·627W.
6·3m	16° 55'·690N., 88° 13'·514W.
6·6m	16° 55'·543N., 88° 13'·625W.
7m	16° 55'·501N., 88° 13'·473W.
6·9m	16° 55'·392N., 88° 13'·574W.
8·8m	16° 55'·240N., 88° 13'·494W.
6·6m	16° 45'·85N., 88° 17'·04W.
5·9m	16° 37'·89N., 88° 19'·68W.
2·2m	16° 30'·97N., 88° 23'·13W.
13·7m	16° 21'·10N., 88° 16'·68W.

- Mariners are advised to navigate with caution in the area.
- These changes will be included in a New Edition of Chart 1797.
(WGS84 DATUM)

Chart affected — 1797**1225(T)/24 SURINAME - Works. Restricted area.**

Source: Maritieme Autoriteit Suriname Notice 1(T)/24

- Exploratory drilling is taking place at 7° 22'·5N., 55° 32'·9W.
- A safety zone of 1000m has been established, centred on this position.
- Communication is through VHF channel 12.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2764**1301(T)/24 WEST INDIES - Trinidad and Tobago - Buoy.**

Source: Trinidad and Tobago Ministry of Works and Transport

- The west cardinal light-buoy, *VQ(9)10s*, in position 10° 24'·08N., 61° 32'·08W. is unlit.
- Mariners are advised to navigate with caution in the area.
- Former Notice 1087(T)/21 is cancelled.
- NOTE: Content of Notice unchanged, re-issued to include Chart 483
(WGS84 DATUM)

Charts affected — 475 — 483**1359(T)/24 WEST INDIES - Trinidad and Tobago - Buoy.**

Source: Trinidad and Tobago Ministry of Works and Transport Navigational Warnings 105/19 and 40/20

- * Middle Channel light-buoy, *Fl.G.3s*, in position 10° 03'·95N., 61° 58'·68W. is reported off station and unlit.
- Mariners are advised to navigate with caution in the area.

1359(T)/24 WEST INDIES - Trinidad and Tobago - Buoy. (continued)

3. Former notice 5770(T)/20 is cancelled.

*Indicates new or revised entry.

(WGS84 DATUM)

Charts affected — 481 — 483

1500(T)/24 WEST INDIES - Windward Islands - Wreck.

Source: French Notice 48/21(T)/23

1. A dangerous wreck has been reported to exist in position 14° 26'·37N., 60° 53'·18W.

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Chart affected — 494

1712(T)/24 VENEZUELA - Buoy.

Source: Venezuelan Notice 18/23

1. The safe water pillar light-buoy, *Fl.6s*, in position 10° 36'·746N., 66° 57'·946W., has temporarily been moved to position 10° 36'·901N., 66° 57'·770W.

2. Former Notices 1497(T)/17 and 1226(T)/22 are cancelled.

(WGS84 DATUM)

Chart affected — 1629

1975(T)/24 WEST INDIES - Windward Islands - Wreck.

Source: French Notice 14/24(T)/24

1. A stranded wreck has been reported in position 14° 32'·55N., 61° 02'·23W.

2. Mariners are advised to navigate with caution in this area.

(WGS84 DATUM)

Chart affected — 368

2009(T)/24 SURINAME - Wreck. Light.

Source: Maritime Authority Suriname Notices 24(T)/24 and 25(T)/24

1. A stranded wreck exists in position 5° 58'·36N., 57° 02'·49W.

2. The wreck is marked by an attached light, *Fl.Y.4s*.

3. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Charts affected — 2764 — 2766

2027(P)/24 UNITED STATES OF AMERICA - Gulf of Mexico - Dredged depths. Alongside depths.

Source: ENC US5CRPBC

1. Many of the charted dredged depth areas within Corpus Christi Harbour are no longer maintained.

2. Alongside depths different to those charted exist. The most significant are as follows:

Alongside Depth

33ft

34ft

31ft

Position

27° 48'·84N., 97° 23'·76W.

27° 48'·72N., 97° 24'·33W.

27° 48'·89N., 97° 23'·86W.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

(NAD83 DATUM)

Chart affected — 3184

2670(P)/24 PANAMA - Panama Canal - Anchorage areas. Depths. Buoyage. Leading line.

Source: ENC PA5CP001

1. The *Hazardous Cargo Anchorage*, bounded by the following positions, has been deleted:

9° 22'·950N., 79° 55'·716W.
 9° 22'·651N., 79° 55'·533W.
 9° 22'·134N., 79° 56'·384W.
 9° 22'·345N., 79° 56'·518W.
 9° 22'·469N., 79° 56'·515W.

2. The limits of anchorage area *A* have been amended to the following positions:

9° 23'·224N., 79° 55'·278W.
 9° 22'·844N., 79° 55'·279W.
 9° 22'·299N., 79° 55'·282W.
 9° 21'·661N., 79° 55'·284W.
 9° 21'·333N., 79° 55'·234W.
 9° 21'·333N., 79° 55'·317W.
 9° 21'·333N., 79° 55'·633W.
 9° 21'·739N., 79° 55'·633W.
 9° 21'·783N., 79° 55'·833W.
 9° 22'·056N., 79° 55'·832W.
 9° 22'·233N., 79° 56'·083W.
 9° 22'·733N., 79° 56'·083W.

Anchorage *A* is for vessels with a draught of between 12·04 and 14·4 metres. Depths deeper than charted exist in this anchorage.

3. Anchorage *B* is now for vessels with a draught of less than 9·75 metres. Depths deeper than charted exist in this anchorage.

4. The characteristics of the following light buoys have been changed:

Former Designation	Former Buoy Type	Former Characteristic	New Designation	New Buoy Type	New Characteristic	Position
<i>E-4</i>	Black Yellow Pillar	<i>Fl.</i>	<i>E-4</i>	Black Yellow Pillar	<i>Q.12s</i>	9° 21'·945N., 79° 54'·728W.
	Yellow Black	<i>Fl.</i>	<i>West</i>	Black Red Black Pillar	<i>Fl(2)6s</i>	9° 21'·849N., 79° 56'·459W.
	Yellow Spherical		<i>Aganmenon</i>			
	Black Yellow	<i>Fl.</i>	<i>East</i>	Black Red Black Pillar	<i>Fl(2)6s</i>	9° 21'·859N., 79° 56'·405W.
	Black Spherical		<i>Aganmenon</i>			
	Yellow Black	<i>Fl.</i>	<i>South</i>	Black Red Black Pillar	<i>Fl(2)6s</i>	9° 21'·805N., 79° 56'·425W.
	Spherical		<i>Aganmenon</i>			
	Black Yellow	<i>Fl.</i>	<i>North</i>	Black Red Black Pillar	<i>Fl(2)6s</i>	9° 21'·897N., 79° 56'·442W.
	Spherical		<i>Aganmenon</i>			

5. New lateral buoys have been established in the following positions:

Characteristic	Designation	Buoy Type	Position
<i>Q.R.1s</i>	<i>W-6B</i>	Red Pillar	9° 22'·299N., 79° 55'·282W.
<i>Q.R.1s</i>	<i>W-6A</i>	Red Pillar	9° 22'·844N., 79° 55'·279W.
<i>Q.G.1s</i>	<i>3</i>	Green Pillar	9° 20'·865N., 79° 55'·064W.

6. New special purpose buoys have been established in the following positions:

Characteristic	Designation	Buoy Type	Position
<i>Q.Y.1s</i>	<i>K</i>	Yellow Pillar	9° 22'·847N., 79° 55'·829W.
<i>VQ(4)Y.5s</i>	<i>I</i>	Yellow Pillar	9° 21'·783N., 79° 55'·833W.
<i>VQ(4)Y.2s</i>	<i>M</i>	Yellow Pillar	9° 22'·301N., 79° 55'·830W.

7. The following light buoys have been removed:

Characteristic	Designation	Buoy Type	Position
<i>Fl. Y</i>	<i>'K'</i>	Yellow Pillar	9° 22'·950N., 79° 55'·716W.
<i>VQ. (4) Y</i>	<i>'I'</i>	Yellow Pillar	9° 21'·919N., 79° 55'·633W.
<i>Fl. Y</i>		Yellow Spherical	9° 23'·887N., 79° 55'·795W.
<i>Fl. Y</i>		Yellow Spherical	9° 23'·916N., 79° 55'·767W.
<i>Fl. Y</i>		Yellow Spherical	9° 23'·930N., 79° 55'·737W.

8. A leading line, pecked line, has been established, extending in direction 59° from the light in position 9° 22'·165N., 79° 56'·869W., with a bearing of 239°.

2670(P)/24 PANAMA - Panama Canal - Anchorage areas. Depths. Buoyage. Leading line. (continued)

9. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
10. These changes will be included in the next New Edition of Chart CP1.
(WGS84 DATUM)

Chart affected — CP 1**2690(P)/24 PANAMA - Panama Canal - Depth. Anchorage areas. Buoyage. Wrecks.**

Source: ENC PA5CP002, PA5CP001 & Panamanian Chart CP02

1. A depth of 18.2m exists in position 9° 15'·517N., 79° 53'·839W.
2. *The limits of anchorage areas *Fondeadero Monte Lirio* and *Peña Blanca* have been amended to the following positions:

Fondeadero Monte Lirio

9° 15'·701N., 79° 54'·304W.
 9° 15'·663N., 79° 54'·548W.
 9° 14'·996N., 79° 54'·448W.
 9° 14'·977N., 79° 53'·443W.
 9° 15'·091N., 79° 52'·891W.
 9° 15'·646N., 79° 53'·015W.
 9° 15'·516N., 79° 53'·477W.
 9° 15'·577N., 79° 54'·236W.

Peña Blanca

9° 14'·357N., 79° 55'·522W.
 9° 12'·635N., 79° 55'·517W.
 9° 11'·722N., 79° 53'·912W.
 9° 11'·232N., 79° 54'·194W.
 9° 12'·524N., 79° 56'·417W.
 9° 14'·358N., 79° 55'·916W.

3. Buoyage associated with the anchorages has been moved accordingly.
4. *A Small Craft anchorage area has been established, bounded by the following positions:

9° 15'·558N., 79° 53'·989W.
 9° 15'·603N., 79° 53'·965W.
 9° 15'·636N., 79° 53'·957W.
 9° 15'·667N., 79° 53'·958W.
 9° 15'·757N., 79° 53'·995W.
 9° 15'·705N., 79° 54'·306W.
 9° 15'·577N., 79° 54'·236W.

5. A 20.1m wreck exists in position 9° 15'·601N., 79° 54'·089W.
6. A 20.3m wreck exists in position 9° 15'·568N., 79° 54'·048W.
7. * Changes to mooring buoys have taken place
8. These changes will be included in the next New Edition of Chart CP2
9. Former Notice 5025(P)/21 is cancelled.
*Indicates a new or revised entry
(WGS84 DATUM)

Chart affected — CP 2

2711(P)/24 MEXICO - Gulf of Mexico - Depths.

Source: ENC's MX683211 and MX583210

- Depths less than charted exist within Dos Bocas. The most significant are as follows:

<i>Depth</i>	<i>Position</i>
10·6m	18° 25'·945N., 93° 12'·159W.
9·8m	18° 25'·981N., 93° 12'·133W.
9·4m	18° 26'·023N., 93° 12'·105W.
3·8m	18° 26'·619N., 93° 11'·510W.
7·1m	18° 25'·956N., 93° 11'·322W.
7·2m	18° 25'·875N., 93° 11'·330W.
4·9m	18° 26'·004N., 93° 11'·212W.
7m	18° 26'·010N., 93° 11'·157W.
6·1m	18° 26'·005N., 93° 11'·032W.
5·3m	18° 25'·878N., 93° 12'·594W.
9·3m	18° 27'·35N., 93° 13'·45W.
17·6m	18° 28'·97N., 93° 08'·36W.
19·9m	18° 28'·88N., 93° 11'·43W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 359**3463(T)/24 VENEZUELA - Buoy.**

Source: ENC VE401002 and Venezuelan Notice 5(T)/24

- The safe water mark light-buoy, *LFl.10s 'EM'*, in position 11° 13'·59N., 71° 33'·64W. is reported missing.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Charts affected — 1520 — 2194**3722(P)/24 MEXICO - Gulf of Mexico - Pier. Berth.**

Source: UKHO

- Terminal Remota Berth 3 is reported to have been extended southwards, joining the following approximate positions:

21° 20'·722N., 89° 40'·283W.
 21° 20'·694N., 89° 40'·283W.
 21° 20'·693N., 89° 40'·395W.
 21° 20'·719N., 89° 40'·414W.
 21° 20'·720N., 89° 40'·389W.

- The existing pier to the south of the cruise terminal is reported to have been extended westwards, joining the following approximate positions:

21° 20'·313N., 89° 40'·405W.
 21° 20'·314N., 89° 40'·498W.
 21° 20'·371N., 89° 40'·501W.
 21° 20'·372N., 89° 40'·377W.
 21° 20'·361N., 89° 40'·376W.
 21° 20'·362N., 89° 40'·404W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- Chart 1307 will be updated when full details are available.
(WGS84 DATUM)

Chart affected — 1307**3723(T)/24 WEST INDIES - Windward Islands - Wreck.**

Source: mv Dawn

- A dangerous wreck has been reported in approximate position 12° 35'·75N., 61° 24'·72W.

3723(T)/24 WEST INDIES - Windward Islands - Wreck. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 794

3730(P)/24 VENEZUELA - Pilot boarding places.

Source: ENC's VE501301 and VE401003

1. New pilot boarding places have been established in the following approximate positions:

10° 40'·85N., 71° 34'·25W.

10° 39'·34N., 71° 34'·89W.

2. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 1520 — 1521

4131(T)/24 DOMINICAN REPUBLIC - Light.

Source: UKHO

1. The Cabo Beata light, Fl.9s24m14M, in position 17° 36'·36N., 71° 25'·37W. is reported destroyed.
(WGS84 DATUM)

Charts affected — 471 — 3001

4233(T)/24 VENEZUELA - Buoyage.

Source: Venezuelan Notice 6(T)/24

1. The following light-buoys, *Fl.R.4s*, are reported off station:

Designation

B30

T40

Position

10° 58'·58N., 71° 36'·06W.

10° 54'·94N., 71° 36'·62W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 1520

4234(T)/24 VENEZUELA - Light. Radar beacon.

Source: Venezuelan Notice 16(T)/24

1. Light, Fl.15s160m13M, in position 11° 11'·7N., 63° 44'·1W. has been temporarily extinguished. The radar beacon remains operative.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1966 — 2191

5484(P)/24 PANAMA - Panama Canal - Depths. Dredged depths. General information.

Source: ENC PA5CP007

1. Significant changes have been reported in the vicinity of Bahía Manzanillo, in an area bounded by positions as follows:

9° 21'·179N., 79° 52'·726W.

9° 21'·188N., 79° 54'·591W.

9° 24'·935N., 79° 54'·582W.

9° 24'·935N., 79° 52'·717W.

2. Depths less than charted, have been reported to exist.
3. Aids to navigation are reported unreliable.
4. Charted channel dredged depths have been reported as unreliable.
5. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

5484(P)/24 PANAMA - Panama Canal - Depths. Dredged depths. General information. (continued)

6. Charts will be updated when full details are available.
(WGS84 DATUM)

Chart affected — CP 1

5495(P)/24 GUYANA - Beacons. Works. Light-beacon.

Source: Guyana Maritime Administration Department Notice 33/24

1. Unlit navigational beacons are under construction in the following positions:

6° 24'·19N., 58° 17'·48W.
6° 22'·27N., 58° 18'·95W.
6° 20'·63N., 58° 18'·64W.
6° 17'·68N., 58° 16'·07W.
6° 16'·99N., 58° 16'·10W.
6° 15'·39N., 58° 16'·39W.
6° 12'·62N., 58° 18'·06W.
6° 12'·60N., 58° 17'·96W.
6° 12'·51N., 58° 18'·05W.

2. *Light-beacon, Q.G, is under construction in position: 6° 56'·92N., 58° 14'·63W.
3. Mariners are advised to navigate with caution in the area.
4. Former Notice 1326(P)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Charts affected — 519 — 527

5502(T)/24 WEST INDIES - Trinidad and Tobago - Buoy.

Source: Trinidad and Tobago Ministry of Works and Transport Navigational Warning 01/24

1. Diamond Rock light-buoy, *VQ(9)10s*, in position 10° 40'·26N., 61° 46'·37W., is reported off station and unlit.
2. Mariners are advised to navigate with caution in the area.
3. *Former Notice 1652(T)/24 is cancelled.
* Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 483

5593(P)/24 MEXICO - Gulf of Mexico - Submarine pipeline. Platform. Precautionary area.

Source: Mexican Notice 16/160(P)/24

1. A gas pipeline and platform precautionary area has been established, bounded by the following positions:
22° 39'·63N., 97° 41'·05W.
22° 39'·63N., 97° 40'·40W.
22° 38'·99N., 97° 40'·40W.
22° 38'·99N., 97° 41'·05W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 364 — 376

162(T)/25 VENEZUELA - Buoy.

Source: Venezuelan Notice 43/24

1. The starboard lateral light-buoy, *Fl.R.5s*, in position 10° 12'·36N., 64° 40'·15W., is reported destroyed.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 1498

238(T)/25 WEST INDIES - Leeward Islands - Wreck.

Source: French Notice 46/21(T)/24

1. A wreck has been reported in position 15° 57'·47N., 61° 19'·19W.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 491**380(P)/25 WEST INDIES - Trinidad and Tobago - Works. Submarine pipeline.**

Source: Trinidad and Tobago Ministry of Works and Transport Navigational Warning 245/24

1. Pipeline laying operations are taking place, joining the following positions:

10° 01'·72N., 60° 38'·90W.

10° 13'·45N., 60° 37'·03W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 501 — 1044 — 1045**654(P)/25 CARIBBEAN SEA - Submarine cable.**

Source: Netherlands Notice 3/13(P)/25

1. A submarine cable is being laid joining the following positions:

12° 24'·8N., 69° 53'·0W.

12° 23'·7N., 69° 52'·7W.

12° 23'·0N., 69° 51'·8W.

12° 23'·4N., 69° 48'·7W.

12° 25'·2N., 69° 46'·7W.

12° 34'·6N., 69° 43'·0W.

12° 43'·0N., 69° 42'·9W.

12° 50'·0N., 69° 42'·3W.

(WGS84 DATUM)

Charts affected — 781 — 1966 — 2193 — 4402**921(P)/25 GUYANA - Bridges. Vertical clearance. Works. Transits. Buoyage.**

Source: : Guyana Maritime Administration Department Notices 79/23, 159/23 and 30/25

1. *A new bridge across the Demerara River, with a vertical clearance of 40m, is under construction in the vicinity of position 6° 46'·08N., 58° 11'·31W.
2. Two transits exist for vessels in the vicinity of the retractor and high spans of the existing Demerara Harbour Bridge.
3. *The following light-buoys have been established:

<i>Designation</i>	<i>Characteristic</i>	<i>Position</i>
Port Hand light-buoy #1	<i>Fl.G.6s</i>	6° 45'·96N., 58° 10'·95W.
Port Hand light-buoy #2	<i>Fl.G.6s</i>	6° 45'·83N., 58° 11'·01W.
Starboard Hand light-buoy #1	<i>Fl.R.6s</i>	6° 46'·01N., 58° 11'·06W.
Starboard Hand light-buoy #2	<i>Fl.R.6s</i>	6° 45'·87N., 58° 11'·12W.

4. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
5. Chart 519 will be updated when works are complete.
6. * Former notice 559(P)/24 is cancelled.
*Indicates new or revised entry
(WGS84 DATUM)

Chart affected — 519**1183(T)/25 WEST INDIES - Windward Islands - Wreck. Buoy.**

Source: French Notice 03/04(T)/25

1. A partially submerged wreck, marked on the surface by a buoy, has been reported in position 14° 34'·51N., 60° 50'·80W.

1183(T)/25 WEST INDIES - Windward Islands - Wreck. Buoy. (continued)

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 369 — 494

1386(T)/25 WEST INDIES - Trinidad and Tobago - Buoy.

Source: Trinidad and Tobago Ministry of Works and Transport Navigational Warning 38/25

1. The West Cardinal light-buoy, *VQ(9)10s*, in position 10° 05'·22N., 61° 55'·67W. is reported missing.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 481 — 483

1451(T)/25 WEST INDIES - Leeward Islands - Light.

Source: Netherlands Notice 10/63(T)/25

1. The light, Q, in position 17° 38'·87N., 63° 15'·37W., has been temporarily extinguished.
2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 487

1871(T)/25 WEST INDIES - Windward Islands - Restricted area.

Source: French Notice 10/5(T)/25

1. A restricted area, fishing prohibited, has been established bounded by the following positions:
 14° 37'·98N., 61° 08'·11W.
 14° 37'·74N., 61° 07'·36W.
 14° 37'·59N., 61° 07'·42W.
 14° 37'·81N., 61° 08'·14W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 369

1965(T)/25 COLOMBIA - Caribbean Sea Coast - Measuring instruments.

Source: Colombian Notices 52(T)/25 and 82(T)/25

1. Measuring instruments have been established in the following positions:

<i>Depth</i>	<i>Position</i>
10m	11° 45'·9N., 72° 48'·2W.
20m	11° 40'·0N., 73° 02'·1W.
20m	11° 33'·9N., 73° 10'·4W.
80m	11° 28'·0N., 73° 20'·1W.
160m	11° 30'·0N., 73° 24'·2W.
500m	11° 32'·0N., 73° 26'·1W.
800m	11° 34'·0N., 73° 34'·1W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 2195

2008(P)/25 CARIBBEAN SEA - Submarine cables.

Source: Alcatel Submarine Networks and UKHO

1. Submarine cable laying operations are taking place to install the Celia cable system, joining the following positions:

<i>Segment</i>	<i>Position</i>
USA (Fort Lauderdale) to Aruba	12° 50'·0N., 69° 42'·3W.
	13° 37'·2N., 69° 39'·2W.
	14° 16'·1N., 69° 27'·6W.
	14° 51'·5N., 69° 09'·7W.
	15° 09'·6N., 68° 54'·0W.
	15° 41'·0N., 68° 51'·5W.
	17° 08'·0N., 68° 29'·2W.
	17° 16'·9N., 68° 29'·8W.
	17° 25'·6N., 68° 27'·2W.
	17° 33'·2N., 68° 22'·8W.
	17° 38'·3N., 68° 22'·0W.
	17° 51'·1N., 68° 25'·4W.
	17° 55'·5N., 68° 25'·4W.
	18° 11'·5N., 68° 17'·0W.
	18° 14'·9N., 68° 12'·8W.
	18° 33'·9N., 68° 03'·4W.
	18° 40'·8N., 68° 03'·0W.
	18° 53'·1N., 67° 55'·5W.
	19° 13'·2N., 68° 01'·5W.
	20° 06'·1N., 68° 17'·6W.
	20° 43'·0N., 68° 46'·7W.
	21° 29'·2N., 69° 44'·7W.
	21° 41'·2N., 70° 14'·6W.
	22° 38'·3N., 71° 38'·1W.

- 2.

22° 45'·8N., 71° 43'·0W.
 23° 08'·0N., 71° 40'·4W.
 23° 21'·2N., 71° 45'·0W.
 24° 00'·8N., 72° 32'·0W.
 24° 59'·8N., 73° 52'·3W.
 25° 24'·5N., 74° 10'·7W.
 25° 46'·8N., 74° 48'·8W.
 27° 06'·9N., 77° 19'·0W.
 27° 26'·7N., 77° 50'·3W.
 27° 30'·3N., 78° 18'·6W.
 27° 36'·0N., 78° 29'·8W.
 27° 32'·2N., 79° 06'·5W.
 27° 29'·5N., 79° 14'·4W.
 27° 26'·8N., 79° 17'·3W.
 27° 23'·7N., 79° 28'·9W.
 27° 23'·1N., 79° 29'·7W.
 27° 21'·7N., 79° 30'·3W.
 27° 17'·2N., 79° 30'·1W.
 26° 49'·1N., 79° 29'·2W.
 26° 45'·6N., 79° 30'·0W.
 26° 41'·4N., 79° 32'·5W.
 26° 37'·2N., 79° 36'·6W.
 26° 36'·2N., 79° 38'·9W.
 26° 32'·5N., 79° 41'·8W.
 26° 29'·2N., 79° 48'·9W.

- 3.

26° 29'·0N., 79° 51'·1W.
 26° 26'·6N., 79° 54'·7W.
 26° 23'·9N., 80° 01'·6W.
 26° 22'·8N., 80° 02'·3W.
 26° 22'·7N., 80° 04'·1W.

2008(P)/25 CARIBBEAN SEA - Submarine cables. (continued)

4. and

<i>Segment</i>	<i>Position</i>
Mona Passage to Martinique	18° 53'·1N., 67° 55'·5W.
	18° 49'·5N., 67° 52'·7W.
	18° 47'·9N., 67° 45'·5W.
	18° 51'·7N., 67° 31'·1W.
	18° 56'·3N., 67° 21'·2W.
	19° 01'·7N., 67° 15'·6W.
	19° 05'·2N., 67° 00'·1W.
	19° 03'·1N., 66° 41'·6W.
	18° 55'·6N., 66° 25'·6W.
	18° 58'·4N., 66° 10'·3W.
	18° 54'·8N., 65° 57'·3W.
	18° 43'·0N., 65° 36'·0W.
	18° 42'·6N., 65° 33'·0W.
	18° 51'·0N., 65° 18'·1W.
	19° 00'·4N., 64° 35'·0W.
	19° 00'·1N., 64° 21'·0W.
	18° 52'·1N., 64° 04'·9W.
	18° 46'·4N., 63° 58'·7W.
	18° 15'·0N., 63° 47'·7W.
	18° 10'·9N., 63° 39'·7W.
	18° 05'·8N., 63° 36'·9W.
	17° 52'·7N., 63° 16'·8W.
	17° 48'·1N., 63° 00'·7W.
	17° 45'·9N., 62° 56'·6W.

5.

17° 32'·2N., 62° 35'·2W.
 17° 14'·3N., 62° 18'·3W.
 16° 55'·3N., 62° 01'·5W.
 16° 40'·9N., 61° 59'·7W.
 16° 33'·5N., 62° 03'·8W.
 15° 52'·2N., 62° 00'·9W.
 15° 07'·5N., 61° 49'·0W.
 14° 44'·7N., 61° 32'·8W.
 14° 40'·3N., 61° 24'·5W.
 14° 40'·3N., 61° 20'·8W.
 14° 37'·0N., 61° 16'·6W.
 14° 35'·8N., 61° 10'·6W.
 14° 33'·4N., 61° 05'·3W.
 14° 34'·1N., 61° 04'·7W.
 14° 34'·1N., 61° 02'·6W.
 14° 35'·2N., 61° 01'·8W.
 14° 35'·2N., 61° 01'·5W.

6. and

<i>Segment</i>	<i>Position</i>
Puerto Rico	18° 36'·5N., 65° 40'·3W.
	18° 36'·6N., 65° 38'·7W.
	18° 36'·5N., 65° 36'·0W.
	18° 35'·9N., 65° 33'·8W.
	18° 35'·9N., 65° 32'·5W.
	18° 36'·6N., 65° 31'·3W.
	18° 37'·9N., 65° 30'·5W.
	18° 39'·6N., 65° 30'·4W.
	18° 41'·4N., 65° 31'·3W.
	18° 42'·6N., 65° 33'·0W.

2008(P)/25 CARIBBEAN SEA - Submarine cables. (continued)

7. and

<i>Segment</i>	<i>Position</i>
Saint Barthélemy	17° 54'·2N., 62° 50'·1W.
	17° 54'·4N., 62° 50'·1W.
	17° 54'·8N., 62° 50'·0W.
	17° 55'·3N., 62° 49'·9W.
	17° 55'·9N., 62° 49'·1W.
	17° 56'·1N., 62° 48'·5W.
	17° 56'·2N., 62° 47'·8W.
	17° 55'·8N., 62° 47'·0W.
	17° 55'·2N., 62° 46'·3W.
	17° 54'·2N., 62° 45'·9W.
	17° 53'·3N., 62° 46'·0W.
	17° 52'·5N., 62° 46'·4W.
	17° 50'·7N., 62° 48'·0W.
	17° 47'·9N., 62° 51'·6W.
	17° 46'·2N., 62° 54'·6W.
	17° 45'·9N., 62° 56'·6W.

8. and

<i>Segment</i>	<i>Position</i>
Antigua	17° 01'·0N., 61° 50'·7W.
	17° 00'·9N., 61° 50'·8W.
	17° 00'·0N., 61° 51'·1W.
	16° 59'·0N., 61° 51'·5W.
	16° 57'·9N., 61° 52'·3W.
	16° 56'·6N., 61° 53'·8W.
	16° 55'·4N., 61° 55'·9W.
	16° 55'·0N., 61° 58'·9W.
	16° 55'·3N., 62° 01'·5W.

9. and

<i>Segment</i>	<i>Position</i>
Antigua to Barbuda	17° 34'·8N., 61° 51'·4W.
	17° 28'·1N., 61° 53'·5W.
	17° 25'·9N., 61° 54'·0W.
	17° 11'·6N., 61° 56'·3W.
	17° 10'·3N., 61° 56'·4W.
	17° 10'·0N., 61° 56'·3W.
	17° 09'·5N., 61° 56'·0W.
	17° 09'·0N., 61° 55'·5W.
	17° 07'·8N., 61° 54'·0W.
	17° 07'·6N., 61° 53'·6W.
	17° 07'·6N., 61° 53'·3W.
	17° 07'·6N., 61° 53'·2W.
	17° 07'·7N., 61° 53'·1W.
	17° 07'·7N., 61° 53'·1W.

10. Mariners are advised to navigate with caution in the area and to avoid anchoring or trawling in the vicinity of the cable route.

11. Charts will be updated when works are complete.
(WGS84 DATUM)

Charts affected — 254 — 368 — 369 — 472 — 494 — 583 — 584 — 585 — 593 — 594 — 596 — 1025 —
1042 — 2016 — 2064 — 2065 — 2066 — 2600 — 2710 — 2866 — 2996 — 3001 — 3408 — 3908 — 3910 —
3914 — 4216 — 4400 — 4401 — 4402 — 4403 — 4407

2177(T)/25 SURINAME - Obstructions. Scientific instruments.

Source: Maritime Authority Suriname Notice 20(T)/25

1. *Underwater buoys have been established within the water column, depth 40m, in the following positions:

*7° 15'·6N., 56° 03'·2W.
7° 15'·4N., 55° 54'·6W.

2177(T)/25 SURINAME - Obstructions. Scientific instruments. (continued)

2. Scientific instruments have been established near the seabed in the following positions:

6° 51'·2N., 56° 36'·0W.

*6° 46'·5N., 56° 09'·7W.

3. Mariners are advised to navigate with caution in the area.

4. *Former Notice 4487(T)/24 is cancelled.

*Indicates new or revised entry

(WGS84 DATUM)

Charts affected — 517 — 2764

2180(T)/25 SURINAME - Scientific instruments.

Source: Maritime Authority Suriname Notice 24/25(T)

1. Underwater Acoustic Doppler Current Profiler (ADCP) moorings, extending approximately 3m vertically from the seabed, have been established in the following positions:

6° 36'·6N., 56° 30'·2W.

6° 36'·6N., 56° 27'·4W.

2. Mariners are advised to navigate with caution in the area.

(WGS84 DATUM)

Charts affected — 517 — 2764

2518(P)/25 UNITED STATES OF AMERICA - Gulf of Mexico - Barge. Depths.

Source: ENC's US5CRPBC, US5CRPBD and US5CRPBE

1. A barge lane, with depth 12ft, has been established between the following positions:

27° 48'·91N., 97° 13'·26W.

27° 48'·73N., 97° 14'·27W.

27° 48'·69N., 97° 22'·75W.

2. A barge lane, with depth 13ft, has been established between the following positions:

27° 48'·64N., 97° 13'·76W.

27° 48'·56N., 97° 14'·30W.

27° 48'·53N., 97° 22'·75W.

3. Mariners are advised to navigate with caution and consult the local port authorities for the latest information.

(NAD83 DATUM)

Chart affected — 3184

3254(T)/25 WEST INDIES - Trinidad and Tobago - Buoyage.

Source: Trinidad and Tobago Ministry of Works

1. Temporary marker buoys have been established in the vicinity of the following positions:

11° 08'·12N., 60° 46'·27W.

11° 08'·02N., 60° 46'·75W.

11° 08'·05N., 60° 46'·65W.

2. Mariners are advised that all three buoys have been reported unlit.

3. The South cardinal light-buoy, *VQ(6)+LFl.10s*, in position 11° 07'·90N., 60° 47'·14W. has been reported unlit.

4. Mariners are advised to navigate with caution in the area and consult local port authorities for more information.

(WGS84 DATUM)

Charts affected — 477 — 500 — 1044

3468(T)/25 MEXICO - Gulf of Mexico - Depth.

Source: Mexican Notice 14/73(T)/25

1. A depth of 6·5m has been reported at the entrance to the Río Panuco, in position 22° 15'·92N., 97° 46'·30W.

3468(T)/25 MEXICO - Gulf of Mexico - Depth. (continued)

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 363

3883(P)/25 WEST INDIES - Windward Islands - Lights. Leading line.

Source: Barbados Port Inc.

- A directional light, Oc.WRG.4.5s.15m13/4M, has been established in position 13° 06'·564N., 59° 37'·584. The sectors are as follows:

<i>Colour</i>	<i>Bearing</i>
R	080·8° – 084·8° (4°)
W	084·8° – 088·2° (3·4°)
G	088·2° – 092·2° (4°)

- The existing leading lights, Iso.G.2s in position 13° 06'·526N., 59° 37'·673W. and Oc.G.4.5s in position 13° 06'·529N., 59° 37'·568W. and associated leading line have been removed.
- Mariners are advised to navigate with caution in the area.
- These changes will be included in the next New Edition of Chart 502.
(WGS84 Datum)

Chart affected — 502

4038(T)/25 VENEZUELA - Light.

Source: Venezuelan Notice 32(T)/25

- Light, Fl.7.5s17m11M, in position 10° 54'·2N., 65° 12'·2W. has been extinguished.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 1966 — 2191

4475(T)/25 WEST INDIES - Trinidad and Tobago - Buoy.

Source: Trinidad and Tobago Ministry of Works and Transport Navigational Warning 89/25

- The West Cardinal light-buoy, *VQ(9)15s*, in position 10° 08'·73N., 61° 51'·30W. is reported missing.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 481 — 483

4652(P)/25 UNITED STATES OF AMERICA - Gulf of Mexico - Depths. Dredged areas.

Source: ENC US5HOUDG

- Deeper depths exist, the minimum of which is 31ft, in an area bounded by the following positions:

29° 40'·942N., 95° 00'·016W.
29° 40'·945N., 95° 00'·020W.
29° 40'·951N., 95° 00'·020W.
29° 41'·028N., 94° 59'·453W.
29° 41'·022N., 94° 59'·444W.

- Deeper depths exist, the minimum of which is 36ft, in an area bounded by the following positions:

29° 40'·965N., 94° 59'·401W.
29° 41'·022N., 94° 58'·996W.
29° 41'·008N., 94° 58'·966W.
29° 40'·985N., 94° 58'·957W.
29° 40'·978N., 94° 58'·968W.
29° 40'·994N., 94° 59'·004W.
29° 40'·948N., 94° 59'·339W.
29° 40'·959N., 94° 59'·353W.
29° 40'·956N., 94° 59'·379W.

- Many of the charted dredged depth areas within the Houston Shipping Channel are no longer maintained.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.

4652(P)/25 UNITED STATES OF AMERICA - Gulf of Mexico - Depths. Dredged areas. (continued)

5. Charts will be updated when works are complete.
(NAD83 DATUM)

Charts affected — 3186 — 3187

4766(T)/25 VENEZUELA - Buoy.

Source: Venezuelan Notice 69(T)/25

- The lateral light-buoy, *Fl.R.4s*, in position 11° 42'·059N., 70° 13'·270W. is reported off station.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(SIRGAS DATUM)

Chart affected — 2190

4792(P)/25 GUYANA - Channel. Depth. Buoyage. Lights.

Source: Guyana Maritime Administration Department

- A new terminal, Vreed-en-Hoop Shore Base, has been established in the vicinity of 6° 48'·969N., 58° 10'·634W.
- A new approach channel, with a minimum depth of 8·5m, has been established between 6° 50'·266N., 58° 09'·970W. and 6° 48'·969N., 58° 10'·634W., marked by the following light-buoys:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Remarks</i>	<i>Position</i>
	<i>GT16</i>	Starboard Lateral	Reported missing	6° 50'·015N., 58° 10'·175W.
	<i>GT18</i>	Preferred channel to starboard	Reported missing	6° 49'·745N., 58° 10'·209W.
<i>Q.G</i>	<i>VESHI-1</i>	Port Lateral		6° 49'·193N., 58° 10'·391W.
<i>Fl.R.3s</i>	<i>VESHI-2</i>	Starboard Lateral		6° 49'·216N., 58° 10'·443W.
	<i>VESHI-3</i>	Port Lateral	Reported missing	6° 49'·044N., 58° 10'·428W.
	<i>VESHI-4</i>	Starboard Lateral	Reported missing	6° 49'·119N., 58° 10'·519W.
<i>Fl(2)G.10s</i>	<i>VESHI-5</i>	Port Lateral		6° 48'·893N., 58° 10'·566W.

- The following lights have been established:

<i>Characteristic</i>	<i>Position</i>
<i>Fl(2)G.12s</i>	6° 48'·914N., 58° 10'·634W.
<i>Fl.R.6s</i>	6° 49'·021N., 58° 10'·634W.

- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
- These changes will be included in a New Edition of Chart 519 to be published early 2026.
(WGS84 DATUM)

Chart affected — 519

4914(T)/25 WEST INDIES - Windward Islands - Wreck.

Source: French Notice 38/5(T)/25

- A vessel has been reported sunk in position 14° 27'·75N., 60° 51'·90W.
- Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Chart affected — 494

4963(P)/25 WEST INDIES - Leeward Islands - Restricted area. Anchorage areas.

Source: French Notice 28/264/25

- A restricted area, has been established bounded by the following positions:

15° 57'·95N., 61° 19'·13W.
15° 57'·61N., 61° 19'·16W.
15° 57'·51N., 61° 19'·15W.
15° 57'·27N., 61° 19'·20W.
15° 57'·27N., 61° 19'·39W.
15° 57'·27N., 61° 19'·49W.
15° 57'·96N., 61° 19'·44W.

4963(P)/25 WEST INDIES - Leeward Islands - Restricted area. Anchorage areas. (continued)

2. New anchorage areas have been established in the approaches to the Baie de Saint-Louis, bounded by the following positions:

15° 57'·84N., 61° 19'·14W.
15° 57'·61N., 61° 19'·16W.
15° 57'·62N., 61° 19'·35W.
15° 57'·85N., 61° 19'·33W.

3. and

15° 57'·51N., 61° 19'·15W.
15° 57'·27N., 61° 19'·20W.
15° 57'·27N., 61° 19'·39W.
15° 57'·51N., 61° 19'·37W.

4. and

15° 57'·57N., 61° 20'·36W.
15° 58'·05N., 61° 20'·10W.
15° 57'·93N., 61° 19'·73W.
15° 57'·49N., 61° 19'·84W.

5. New anchorage areas have been established in the approaches to Terre-de-haut, bounded by the following positions:

15° 51'·97N., 61° 36'·58W.
15° 52'·14N., 61° 36'·35W.
15° 51'·85N., 61° 36'·07W.
15° 51'·69N., 61° 36'·36W.

6. and

15° 52'·28N., 61° 35'·76W.
15° 52'·27N., 61° 35'·56W.
15° 52'·10N., 61° 35'·55W.
15° 52'·11N., 61° 35'·77W.

7. and

15° 52'·45N., 61° 35'·38W.
15° 52'·43N., 61° 35'·21W.
15° 52'·04N., 61° 35'·28W.
15° 52'·05N., 61° 35'·47W.

8. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
9. Chart 491 will be withdrawn in late 2025.
(WGS84 DATUM)

Chart affected — 491

5120(T)/25 SURINAME - Restricted area. Works.

Source: Maritime Authority Suriname Notice 76/25(T)

1. An exploration drilling area has been established, radius 2NM, centred on 6° 40'·2N., 56° 30'·3W.
2. Mariners are advised to navigate with caution in the area and maintain a minimum safety distance of at least 500m from any drilling vessel.
3. Communication is through VHF channel 16 and 10.
4. Works are expected to last until the end of December 2025
(WGS84 DATUM)

Chart affected — 2764

5230(T)/25 MEXICO - Gulf of Mexico - Dredging area. Works.

Source: Mexican Notice 19/89(T)/25

1. Dredging works are taking place in the area bounded by the following positions:

21° 25'·65N., 89° 41'·35W.
 21° 21'·30N., 89° 41'·28W.
 21° 21'·02N., 89° 41'·22W.
 21° 20'·81N., 89° 41'·05W.
 21° 20'·81N., 89° 41'·02W.
 21° 20'·64N., 89° 41'·01W.
 21° 20'·64N., 89° 41'·14W.
 21° 20'·82N., 89° 41'·37W.
 21° 25'·65N., 89° 41'·46W.

2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information. (WGS84 DATUM)

Chart affected — 1307

5303(T)/25 WEST INDIES - Trinidad and Tobago - Buoyage.

Source: Trinidad and Tobago Coastal Warning 129/25 and 130/25

1. The following light-buoys are currently reported missing:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>VQ(6)+LFl.10s</i>	<i>Bulldog Shoal</i>	South Cardinal Buoy	11° 08'·81N., 60° 44'·63W.
<i>Q(6)+LFl.15s</i>	<i>Minister Rock</i>	South Cardinal Buoy	11° 09'·71N., 60° 42'·25W.
<i>Q</i>	<i>Buccoo Reef North Buoy</i>	North Cardinal Buoy	11° 11'·87N., 60° 50'·00W.
<i>*VQ(9)10s</i>	<i>Buccoo Reef West Buoy</i>	West Cardinal Buoy	11° 11'·11N., 60° 51'·11W.
<i>*VQ(6)+LFl.10s</i>	<i>Great River Shoal</i>	South Cardinal Buoy	11° 10'·91N., 60° 37'·40W.

2. Mariners are advised to navigate with caution in the area.
3. *Former Notices 2531(T)/22, 2737(T)/22 and 1653(T)/24 are cancelled.
 *Indicates new or revised entry
 (WGS84 DATUM)

Charts affected — 477 — 500 — 1044

5524(P)/25 GUATEMALA - East Coast - Wrecks. Buoyage. Lights.

Source: ENC's US5PJ3B3 and US4PJ3B0

1. Changes to wrecks, buoyage and lights have taken place within Bahía de Amatique.
2. The following light-buoys have been established:

<i>Characteristic</i>	<i>Designation</i>	<i>Buoy Type</i>	<i>Position</i>
<i>Fl.G.5s</i>	<i>5</i>	Green Pillar	15° 45'·96N., 88° 36'·45W.
<i>Fl.R.5s</i>	<i>6</i>	Red Pillar	15° 45'·97N., 88° 36'·60W.
<i>Fl.G.5s</i>	<i>13</i>	Green Pillar	15° 43'·02N., 88° 36'·93W.
<i>Fl.R.5s</i>	<i>14</i>	Red Pillar	15° 43'·03N., 88° 37'·07W.
<i>Fl(5)Y.10s</i>		Yellow Spherical	15° 42'·26N., 88° 36'·79W.
<i>Fl.4s</i>		Isolated Danger	15° 42'·26N., 88° 36'·75W.
<i>Q.Y</i>		Yellow Pillar	15° 42'·23N., 88° 36'·65W.
<i>Fl.10s</i>		Safe Water	15° 50'·20N., 88° 43'·93W.

5524(P)/25 GUATEMALA - East Coast - Wrecks. Buoyage. Lights. (continued)

3. The following light-buoys have been amended:

<i>Former Designation</i>	<i>New Designation</i>	<i>Former Characteristic</i>	<i>New Characteristic</i>	<i>Position</i>
<i>ST</i>	<i>ST</i>	<i>Mo(A)</i>	<i>Fl.4s</i>	15° 48'·02N., 88° 36'·21W.
<i>1</i>	<i>1</i>	<i>Q.G</i>	<i>Fl.G.4s</i>	15° 47'·15N., 88° 36'·26W.
<i>2</i>	<i>2</i>	<i>Q.R</i>	<i>Fl.R.4s</i>	15° 47'·20N., 88° 36'·40W.
<i>3</i>	<i>3</i>	<i>Q.G</i>	<i>Fl.G.4s</i>	15° 46'·55N., 88° 36'·36W.
<i>4</i>	<i>4</i>	<i>Q.R</i>	<i>Fl.R.4s</i>	15° 46'·55N., 88° 36'·51W.
<i>5</i>	<i>7</i>	<i>Q.G</i>	<i>Fl.G.4s</i>	15° 45'·40N., 88° 36'·56W.
<i>6</i>	<i>8</i>	<i>Q.R</i>	<i>Fl.R.4s</i>	15° 45'·39N., 88° 36'·70W.
<i>7</i>	<i>9</i>	<i>Q.G</i>	<i>Fl.G.4s</i>	15° 44'·84N., 88° 36'·65W.
<i>8</i>	<i>10</i>	<i>Q.R</i>	<i>Fl.R.4s</i>	15° 44'·87N., 88° 36'·78W.
<i>9</i>	<i>11</i>	<i>Fl(2)G.5s</i>	<i>Fl.G.4s</i>	15° 43'·79N., 88° 36'·80W.
<i>10</i>	<i>12</i>	<i>Fl(2)R.5s</i>	<i>Fl.R.4s</i>	15° 43'·79N., 88° 36'·94W.
<i>11</i>	<i>15</i>	<i>Q.G</i>	<i>Fl.G.4s</i>	15° 42'·27N., 88° 37'·06W.
<i>12</i>	<i>16</i>	<i>Q.R</i>	<i>Fl.R.4s</i>	15° 42'·29N., 88° 37'·20W.
		<i>Fl.8s</i>	<i>Q.Y</i>	15° 44'·21N., 88° 36'·74W.
		<i>Q</i>	<i>Fl.Y.2s</i>	15° 44'·15N., 88° 36'·73W.

4. The red pillar buoy, *FR*, in position 15° 49'·96N., 88° 44'·00W., has been removed.

5. The following lights have been amended:

<i>Former Characteristic</i>	<i>New Characteristic</i>	<i>Position</i>
<i>Q.Y.11m</i>	<i>Fl.G.7s</i>	15° 41'·63N., 88° 37'·23W.
<i>Oc.Y.4s24m</i>	<i>Fl.Y.7s</i>	15° 41'·44N., 88° 37'·27W.
<i>Fl.Y</i>	<i>Fl.G.2s</i>	15° 41'·70N., 88° 37'·41W.
<i>Fl.Y</i>	<i>Fl.G.2s</i>	15° 41'·67N., 88° 37'·48W.
<i>Fl.R.3s6m</i>	<i>Fl.4s</i>	15° 50'·88N., 88° 40'·37W.
<i>Fl.3s40m17M</i>	<i>Fl.4s40m17M</i>	15° 57'·84N., 88° 35'·97W.
<i>Fl.3s5m</i>	<i>Fl.4s</i>	15° 45'·38N., 88° 37'·00W.

6. The following lights have been established:

<i>Designation</i>	<i>Characteristic</i>	<i>Position</i>
<i>Ox Tongue Shoal</i>	<i>Fl.4s</i>	15° 53'·62N., 88° 41'·12W.

7. Stranded wrecks, with *Fl.4s* lights established, exist in the following positions:

15° 43'·01N., 88° 38'·20W.

and

15° 42'·94N., 88° 38'·53W.

8. The following lights have been removed:

<i>Designation</i>	<i>Characteristic</i>	<i>Position</i>
<i>Ox Tongue Shoal</i>	<i>Fl.3s4m12M</i>	15° 53'·66N., 88° 41'·17W.
	<i>Fl.3s</i>	15° 42'·27N., 88° 36'·78W.

9. These changes will be included in a New Edition of Chart 2988 to be published early 2026.
(WGS84 DATUM)

Chart affected — 2988

5619(T)/25 SURINAME - Restricted area. Bridge.

Source: Maritieme Autoriteit Suriname Notice 96/2025

1. Bridge has been damaged and a temporary restricted area has been established in an area bounded by the following positions:

5° 37'·01N., 55° 02'·54W.

5° 36'·75N., 55° 02'·40W.

5° 36'·72N., 55° 02'·57W.

5° 36'·95N., 55° 02'·69W.

2. Passage is only permitted during daylight and towing and pushed convoys are prohibited.

3. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 2765

5645(T)/25 WEST INDIES - Leeward Islands - Wreck.

Source: NAVAREA IV Navigational Warning 1268/25

1. A partially submerged wreck has been reported in position 16° 12'·60N., 61° 31'·50W.
2. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(WGS84 DATUM)

Chart affected — 804

5679(T)/25 COLOMBIA - Caribbean Sea Coast - Works.

Source: Colombian Notice 400/25

1. Drilling works are taking place in the following position:

11° 35'·1N., 73° 38'·8W.
2. Mariners are advised to navigate with caution and maintain a safety margin, radius 1000m, centred on the drilling site.
(WGS84 DATUM)

Chart affected — 2195



(26) EAST COAST OF NORTH AMERICA AND GREENLAND

2681(P)/16 UNITED STATES OF AMERICA - East Coast - Maritime limit.

Source: NOAA


1. A Northern Right Whale critical habitat has been established for foraging within an area bounded by the following positions, as defined in 50 CFR 226:

44° 49'·7N., 66° 57'·9W.
44° 49'·5N., 66° 55'·9W.
44° 47'·7N., 66° 53'·1W.
44° 44'·7N., 66° 56'·2W.
44° 39'·3N., 66° 57'·4W.
44° 37'·0N., 67° 00'·6W.
44° 33'·5N., 67° 02'·9W.
44° 30'·6N., 67° 02'·6W.
44° 29'·1N., 67° 03'·7W.
44° 25'·5N., 67° 02'·2W.
44° 21'·7N., 67° 02'·5W.
44° 14'·1N., 67° 08'·6W.
44° 11'·2N., 67° 16'·7W.
42° 53'·2N., 67° 44'·6W.
42° 10'·3N., 67° 09'·6W.
42° 00'·0N., 67° 30'·0W.
42° 00'·0N., 67° 55'·0W.
40° 50'·0N., 68° 50'·0W.
40° 50'·0N., 69° 12'·0W.
41° 33'·1N., 69° 59'·7W.
41° 40'·5N., 69° 56'·1W.(shore)

2. It is illegal to approach any Right Whale closer than 1500 feet.
3. For further details see Admiralty List of Radio Signals and Admiralty Sailing Directions.
4. These changes will be included in the next New Editions of Charts 2490, 2492, 2670 and 4746. (NAD83 Datum)

Charts affected — 2490 — 4746

To accompany Notice to Mariners 2681(P)/16

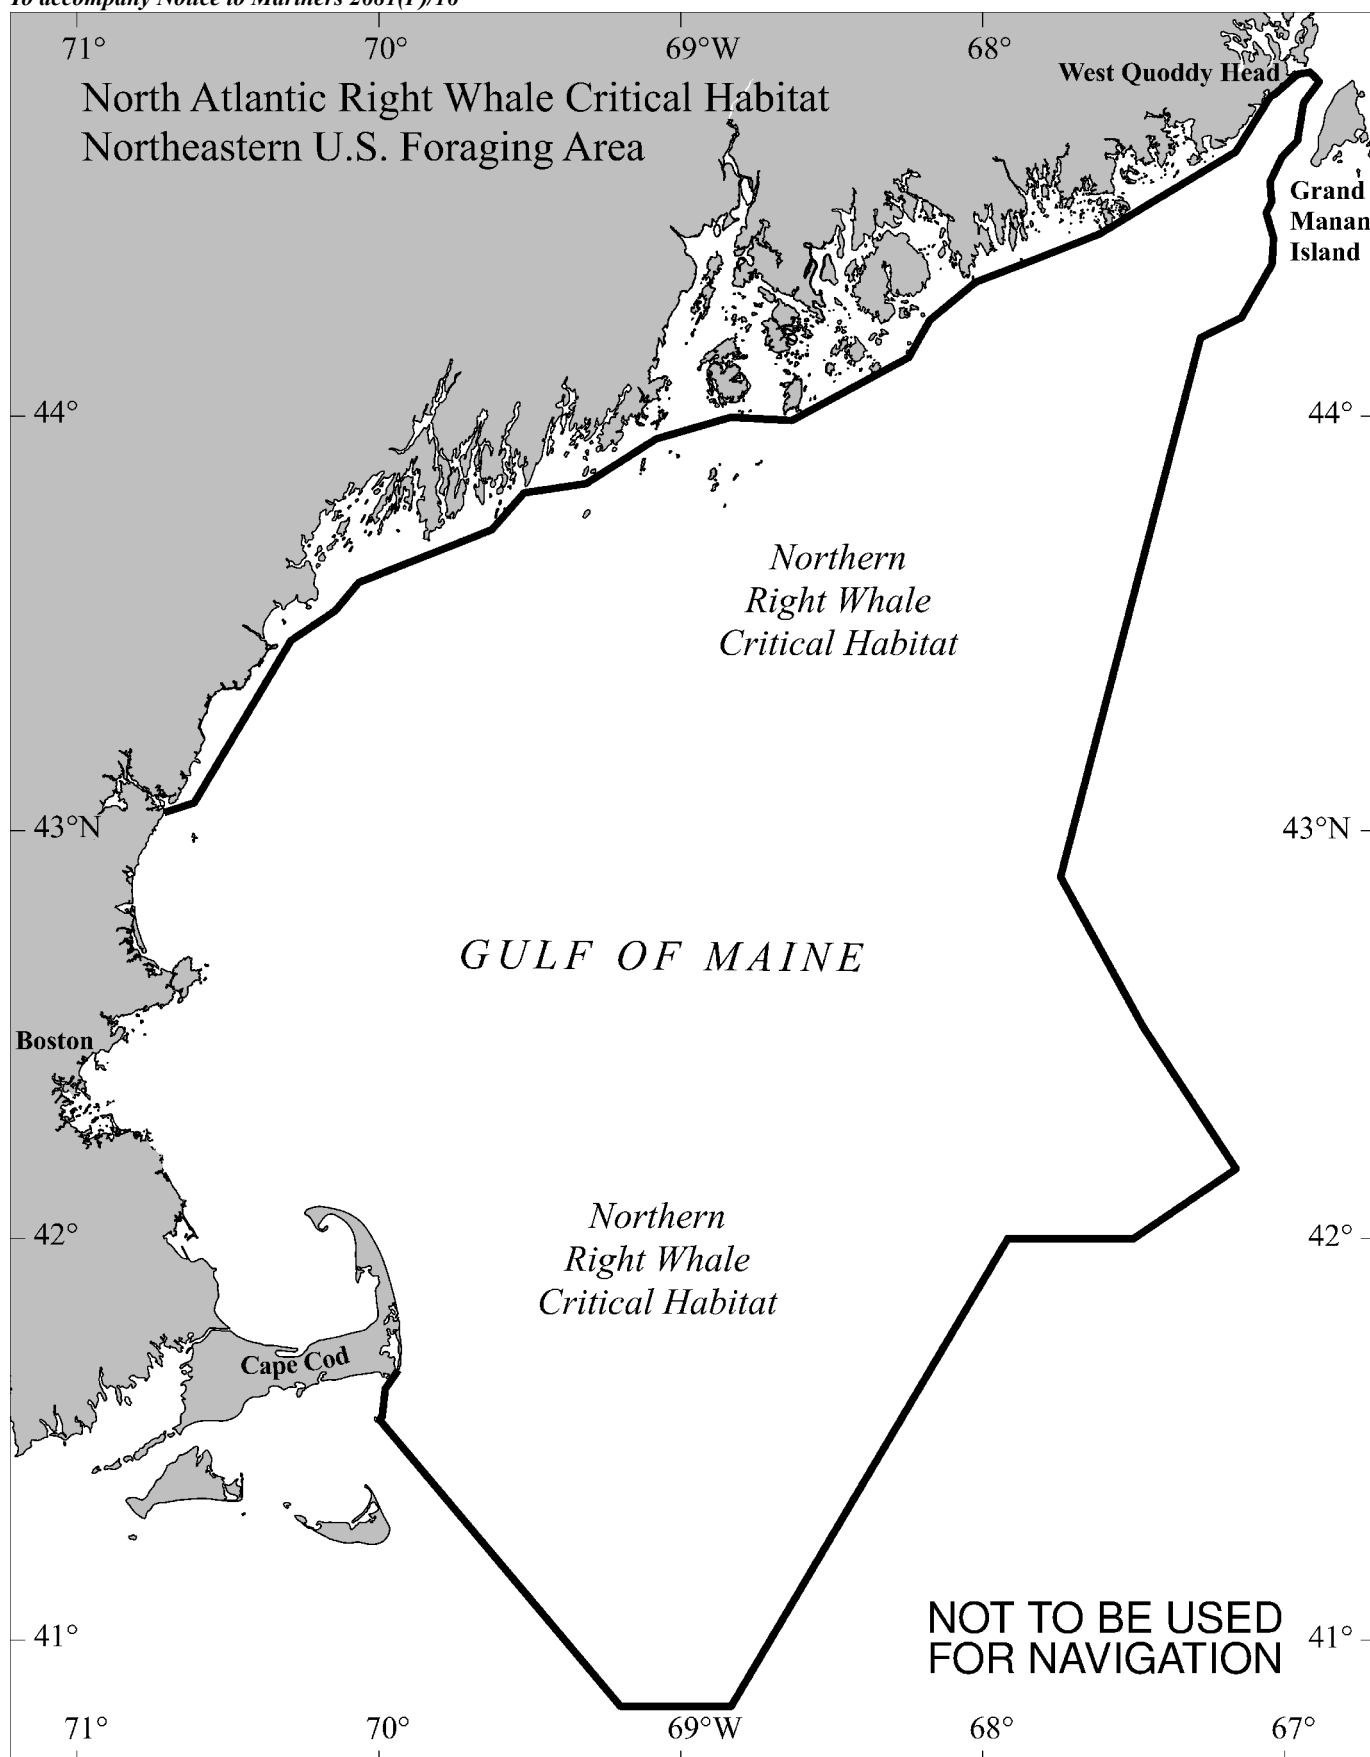

2682(P)/16 UNITED STATES OF AMERICA - East Coast - Maritime limit.

Source: NOAA


1. A Northern Right Whale critical habitat has been established for calving, inland of a line joined by the following positions, as defined in 50 CFR 226:

33° 50'·6N., 77° 57'·5W.(shore)
33° 42'·0N., 77° 43'·0W.
33° 37'·0N., 77° 47'·0W.
33° 28'·0N., 78° 33'·0W.
32° 59'·0N., 78° 50'·0W.
32° 17'·0N., 79° 53'·0W.
31° 31'·0N., 80° 33'·0W.
30° 43'·0N., 80° 49'·0W.
30° 30'·0N., 81° 01'·0W.
29° 45'·0N., 81° 01'·0W.
29° 15'·0N., 80° 55'·0W.
28° 38'·0N., 80° 30'·0W.
28° 28'·0N., 80° 26'·0W.
28° 24'·0N., 80° 27'·0W.
28° 21'·0N., 80° 31'·0W.
28° 16'·0N., 80° 31'·0W.
28° 11'·0N., 80° 33'·0W.
28° 00'·0N., 80° 29'·0W.
28° 00'·0N., 80° 31'·4W.(shore)

2. It is illegal to approach any Right Whale closer than 1500 feet.
3. For further details see Admiralty List of Radio Signals and Admiralty Sailing Directions.
4. These changes will be included in the next New Editions of Charts 2710, 2864, 2865, 2866, 3687, 3688, 3691 and 3692. (NAD83 Datum)

Charts affected — 2865 — 3691

To accompany Notice to Mariners 2682(P)/16

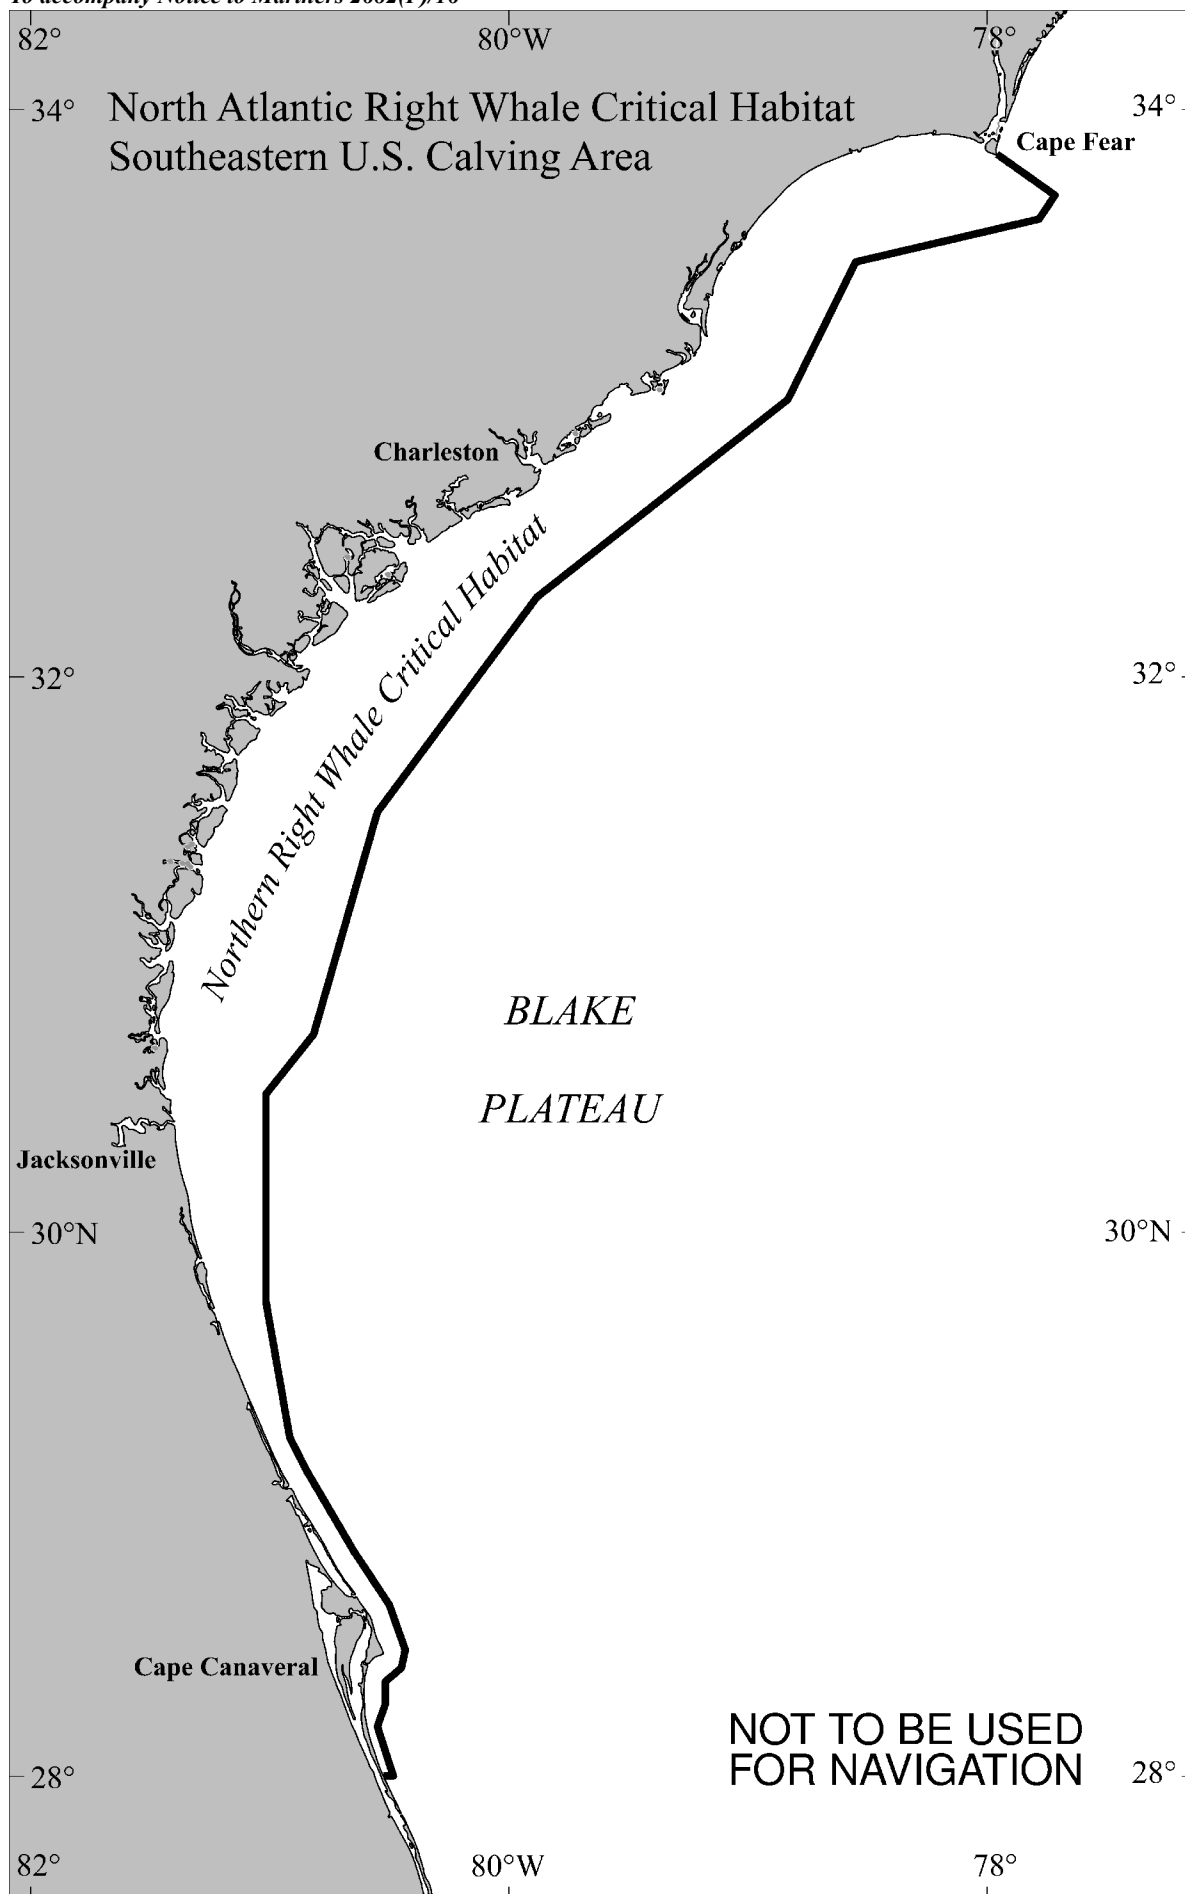

444(P)/20 UNITED STATES OF AMERICA - East Coast - Submarine cable.

Source: SubCom

1. A submarine cable is being laid, joining the following positions:

40° 11'·70N., 74° 00'·59W.
 40° 11'·22N., 73° 59'·35W.
 40° 11'·57N., 73° 57'·92W.
 40° 12'·63N., 73° 55'·57W.
 40° 12'·57N., 73° 49'·19W.
 40° 12'·03N., 73° 44'·88W.
 40° 11'·93N., 73° 40'·31W.
 40° 10'·92N., 73° 28'·19W.
 40° 09'·25N., 73° 19'·57W.
 39° 59'·92N., 72° 52'·93W.
 39° 45'·14N., 72° 17'·53W.
 39° 38'·30N., 72° 04'·52W.
 39° 33'·78N., 72° 04'·49W.

2. Mariners are advised to navigate with caution in the area.
3. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 2755 — 2860**397(P)/23 UNITED STATES OF AMERICA - East Coast - Channel limits. Depth information. Dredged areas. Dredged depths. Legends. Wreck.**

Source: US Coast Guard District 7 LNM 49/11491/22, US Notice 1/11491/23, ENCs US5FL52M, US5FL51M and US Chart 11491

1. There have been numerous changes to channel names, channel limits and channel reach separators and associated project depth legends. The most significant are as follows:
2. The Project Depths in the main channel, between positions 30° 23'·10N., 81° 33'·10W. and 30° 24'·01N., 81° 23'·44W. have changed from *40ft* to *47ft*.
3. The Project Depths in the main channel, between positions 30° 24'·01N., 81° 23'·44W. and 30° 23'·60N., 81° 19'·47W. have changed from *42ft* to *49ft*.
4. The Turning basin, centred on 30° 23'·15N., 81° 32'·31W. has changed from dredged depth, *41ft (2022)* to *Project Depth 47ft*.
5. The dredged area, centred on 30° 23'·30N., 81° 32'·37W. has changed from dredged depth, *48ft (2022)* to *Project Depth 47ft*.
6. The channel limit has been extended between 30° 23'·33N., 81° 33'·18W. and 30° 23'·16N., 81° 33'·24W.
7. A dredged area, with dredged depth, *28ft (2022)*, within, has been established, centred on the following position:
30° 23'·19N., 81° 33'·32W.
8. A wreck with depth *42ft* exists in approximate position 30° 23'·13N., 81° 32'·36W.
9. Mariners are advised to navigate with caution in the area.
10. For detailed channel information and minimum depths as reported by USACE, use NOAA Electronic Navigational Charts.
11. USACE surveys and channel condition reports are available at <http://navigation.usace.army.mil/Survey/Hydro>
12. These changes will be included in the next New Edition of Chart 2808.
(NAD83 DATUM)

Chart affected — 2808

899(P)/23 UNITED STATES OF AMERICA - East Coast - Restricted areas.

Source: US Coast Guard District 7 LNM's 51/11400/22, 51/11480/22 and 51/11484/22

1. As a result of the launching of certain space vehicles, Space Capsule Recovery Areas have been designated for the retrieval of such vehicles, bounded by the following positions:

Jacksonville site:

30° 55'·0N., 80° 28'·3W.

31° 06'·5N., 80° 15'·0W.

30° 55'·0N., 80° 01'·7W.

30° 43'·5N., 80° 15'·0W.

Daytona site:

29° 48'·0N., 80° 53'·2W.

29° 59'·5N., 80° 40'·0W.

29° 48'·0N., 80° 26'·9W.

29° 36'·5N., 80° 40'·0W.

Cape Canaveral site:

28° 51'·0N., 80° 26'·8W.

29° 02'·5N., 80° 13'·8W.

28° 51'·0N., 80° 00'·8W.

28° 39'·5N., 80° 13'·8W.

Tampa site:

28° 17'·4N., 83° 54'·0W.

28° 06'·0N., 83° 41'·0W.

27° 54'·5N., 83° 54'·0W.

28° 06'·0N., 84° 06'·9W.

Tallahassee site:

29° 06'·3N., 84° 11'·2W.

29° 22'·6N., 84° 05'·3W.

29° 17'·0N., 83° 58'·9W.

2. Mariners are advised to monitor VHF-FM Channel 16 for broadcasts.
3. For further information the United States Coast Guard should be contacted and refer to United States Code of Federal Regulations reference 165.T07-0806.
4. Charts will be updated when further details are available.
(NAD83 DATUM)

Charts affected — 2865 — 2866 — 3852 — 3853

1750(T)/23 CANADA - Gulf of Saint Lawrence - Marine farms. Buoyage.

Source: Canadian Notice 3/317(T)/23

1. Marine farms in *Cascapedia Bay* and *Tracadigache Bay* are marked by non-compliant buoyage in the following positions:

48° 07'·52N., 66° 00'·51W.

48° 07'·01N., 66° 00'·00W.

48° 06'·66N., 66° 00'·78W.

48° 07'·18N., 66° 01'·30W.

and

48° 07'·37N., 65° 53'·23W.

48° 06'·55N., 65° 53'·23W.

48° 06'·55N., 65° 55'·20W.

48° 07'·37N., 65° 55'·20W.

and

48° 05'·40N., 66° 01'·71W.

48° 06'·19N., 66° 00'·13W.

48° 05'·60N., 65° 59'·50W.

48° 04'·82N., 66° 01'·08W.

and

48° 05'·20N., 66° 12'·04W.

48° 05'·20N., 66° 11'·00W.

48° 04'·50N., 66° 11'·00W.

48° 04'·50N., 66° 12'·04W.

2. Surface and submerged equipment exists.

1750(T)/23 CANADA - Gulf of Saint Lawrence - Marine farms. Buoyage. (continued)

- Mariners are advised to navigate with caution in the area.
(NAD83 DATUM)

Charts affected — 4766 — 4768

4012(T)/23 CANADA - Saint Lawrence River - Mooring.

Source: Canadian Notice 7/710(T)/23

- Mooring is prohibited at wharf section 31, position 45° 31' 35.6"N., 73° 32' 33.9"W.
(NAD83 DATUM)

Chart affected — 4792

4603(P)/23 CANADA - Automatic Identification Systems.

Source: UKHO

- Not all AIS transmitters on aids to navigation are shown on this chart within US waters. V-AIS will be shown.
- For details, see ADMIRALTY List of Radio Signals.
(WGS84 DATUM)

Charts affected — 4746 — 4945 — 4947 — 4950 — 4951 — 4952 — 4953 — 4954 — 4955 — 4960

2295(T)/24 CANADA - Saint Lawrence River - Works. Quays.

Source: Canadian Notice 3/310(T)/24

- Wharf repair works are taking place at Port-Cartier Harbour, wharves 1, 2 and 3, in the vicinity of position:
50° 01' 54.9"N., 66° 47' 12.5"W.
- Operations, daily between 1100 UTC and 2100 UTC.
- Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
(NAD83 DATUM)

Chart affected — 4778

3734(P)/24 UNITED STATES OF AMERICA - East Coast - Works. Wind farm. Submarine power cables. Restricted areas.

Source: ENC's US3DE01M, US3NY01M and Bureau of Ocean Energy Management

- *Works are in progress to establish offshore wind farms associated with Wind Projects between Chesapeake Bay and Nantucket Island.
- *Wind farm construction work is taking place, within an area bounded by the following positions:
35° 21'·17N., 76° 44'·05W.
35° 21'·53N., 73° 33'·30W.
38° 59'·61N., 71° 59'·00W.
39° 01'·32N., 69° 41'·38W.
41° 16'·32N., 69° 40'·82W.
41° 15'·60N., 71° 17'·54W.
40° 31'·94N., 73° 41'·89W.
- A safety zone of 500 metres becomes operational around the turbines under construction.
- *Cable laying operations will also be conducted between the shore and wind farms under construction.
- *Mariners are advised to navigate with caution, as construction equipment may be moving in the area. Please refer to US Coast Guard District 1 Local Notices to Mariners and the Bureau of Ocean Energy Management for information on Safety Zones.
- *Please refer to the US ENC's for latest details on offshore wind farms.
- *Charts will be updated when works are complete.
- *Former notice 1565(P)/24 is cancelled.
*Indicates new or revised entry
(NAD83 DATUM)

Charts affected — 2456 — 2492 — 2670 — 2710 — 2730 — 2755 — 2860 — 2890 — 2919

4903(T)/24 UNITED STATES OF AMERICA - East Coast - Restricted area.

Source: ENC US5VA11M

1. An entry prohibited area has been established, radius 500m, centred on position 36° 48'·96N., 75° 57'·72W.
2. Prior permission must be obtained from the Local Port Authority to enter the area.
3. Mariners are advised to navigate with caution in the area.
(NAD83 DATUM)

Chart affected — 2919**4918(P)/24 UNITED STATES OF AMERICA - East Coast - Works. Lights. Buoyage.**

Source: ENC US5NYCEG and US Coast Guard District 1 LL 34/24

1. Hudson River tunnel construction is taking place between Pier 66 and Weehawken Cove.
2. A cofferdam is being established in an area bounded by the following positions:

40° 45'·321N., 74° 00'·888W.
40° 45'·297N., 74° 00'·533W.
40° 45'·211N., 74° 00'·544W.
40° 45'·236N., 74° 00'·894W.
3. The corners of the cofferdam will be marked by lights, Fl.4s
4. Additional lights will be added every 30ft of the structure.
5. Special purpose light-buoys, *Fl.4s*, marking the construction have been established in the following approximate positions:

DesignationA
B
C
D**Position**40° 45'·478N., 74° 00'·679W.
40° 45'·478N., 74° 00'·603W.
40° 45'·045N., 74° 00'·899W.
40° 45'·044N., 74° 00'·824W.

6. VHF Channel 13/16/67 will be monitored while onsite.
7. Mariners are advised to navigate with caution in the area and consult the local port authorities for full details.
(WGS84 DATUM)

Chart affected — 3454**92(T)/25 CANADA - Saint Lawrence River - Depths.**

Source: Canadian Notice 10/1021(T)/24

1. Shoal depths have been reported in the port of Trois-Rivières within areas bounded by the following positions:

Depth Position

10·4m	46° 20' 01·6"N., 72° 32' 36·8"W.
	46° 20' 02·2"N., 72° 32' 36·2"W.
	46° 20' 02·0"N., 72° 32' 35·8"W.
	46° 20' 01·5"N., 72° 32' 36·5"W.
10·0m	46° 19' 59·4"N., 72° 32' 47·7"W.
	46° 20' 01·0"N., 72° 32' 45·9"W.
	46° 20' 00·7"N., 72° 32' 38·9"W.
	46° 20' 00·2"N., 72° 32' 40·3"W.
	46° 19' 59·4"N., 72° 32' 44·3"W.
10·3m	46° 19' 57·8"N., 72° 32' 47·7"W.
	46° 19' 58·5"N., 72° 32' 47·1"W.
	46° 19' 59·2"N., 72° 32' 44·3"W.
	46° 19' 58·3"N., 72° 32' 44·4"W.
10·2m	46° 19' 59·4"N., 72° 32' 47·7"W.
	46° 19' 59·4"N., 72° 32' 46·3"W.
	46° 19' 57·8"N., 72° 32' 47·7"W.
	46° 19' 57·9"N., 72° 32' 49·3"W.
10·5m	46° 19' 58·0"N., 72° 32' 42·2"W.
	46° 19' 58·2"N., 72° 32' 44·7"W.
	46° 19' 58·5"N., 72° 32' 44·4"W.
	46° 19' 58·7"N., 72° 32' 41·7"W.
10·2m	46° 19' 59·1"N., 72° 32' 42·4"W.

92(T)/25 CANADA - Saint Lawrence River - Depths. (continued)

46° 20' 00.0"N., 72° 32' 41.3"W.
46° 19' 59.6"N., 72° 32' 39.6"W.

46° 19' 58.7"N., 72° 32' 40.6"W.
46° 19' 58.7"N., 72° 32' 41.9"W.
10.2m 46° 19' 51.1"N., 72° 32' 46.3"W.
46° 19' 51.0"N., 72° 32' 46.1"W.
46° 19' 50.7"N., 72° 32' 46.4"W.
46° 19' 50.7"N., 72° 32' 46.5"W.
10.5m 46° 19' 49.8"N., 72° 32' 47.1"W.
46° 19' 49.8"N., 72° 32' 47.2"W.
46° 19' 50.4"N., 72° 32' 46.8"W.
46° 19' 50.3"N., 72° 32' 46.7"W.
10.6m 46° 19' 47.1"N., 72° 32' 49.4"W.
46° 19' 48.0"N., 72° 32' 48.8"W.
46° 19' 47.9"N., 72° 32' 48.5"W.
46° 19' 46.9"N., 72° 32' 49.1"W.
10.5m 46° 19' 43.6"N., 72° 32' 52.4"W.
46° 19' 44.3"N., 72° 32' 51.8"W.
46° 19' 44.3"N., 72° 32' 51.5"W.
46° 19' 43.6"N., 72° 32' 52.2"W.

2. Mariners are advised to navigate with caution in the area.
3. Former Notice 2029(T)/24 is cancelled.
(NAD83 DATUM)

Chart affected — 4789

502(T)/25 CANADA - Saint Lawrence River - Depth.

Source: Canadian Notice 11/1118(T)/24

1. A depth of 10.4 has been reported at Port de Montréal in position 45° 30' 18.9"N., 73° 32' 48.3"W.
2. Mariners are advised to navigate with caution in the area.
(NAD83 DATUM)

Chart affected — 4792

676(T)/25 CANADA - Saint Lawrence River - Restricted area.

Source: Canadian Notice 11/1119(T)/24

1. Diving operations are taking place in Port of Trois-Rivières at Wharf 17 in the vicinity of position 46° 19' 53.6"N., 72° 32' 41.9"W.
2. The activities will take place from Monday to Friday, 1100 UTC to 2100 UTC.
3. Mariners are advised to navigate with caution in the area.
(NAD83 DATUM)

Chart affected — 4789

867(T)/25 CANADA - Saint Lawrence River - Moorings.

Source: Canadian Notice 12/1209(T)/24

1. The following subsurface scientific moorings have been established:

<i>Designation</i>	<i>Depth</i>	<i>Position</i>
<i>E1</i>	319m	48° 53' 32"N., 68° 06' 18"W.
<i>W1</i>	355m	48° 48' 03"N., 68° 23' 99"W.

(NAD83 DATUM)

Chart affected — 4777

2416(T)/25 UNITED STATES OF AMERICA - East Coast - Wreck.

Source: ENC US5BOSCE

1. Mariners are advised that F/V Eileen Rita has reportedly run aground in the approaches to Hypocrite Channel, within an area bounded by the following positions:

42° 20'·99N., 70° 53'·68W.

42° 21'·20N., 70° 53'·31W.

42° 20'·93N., 70° 53'·22W.

42° 20'·84N., 70° 53'·63W.

2. The vessel is currently partially submerged and potentially drifting into deeper water.
3. Mariners are advised to use extreme caution when transiting the area and report any changes in the position of the vessel to the Coast Guard Sector Boston Command Centre at (833) 449-0539.
(NAD83 DATUM)

Charts affected — 1227 — 1516**2594(T)/25 CANADA - Saint Lawrence River - Restricted areas.**

Source: Canadian Notice 4/405/25

1. To prevent collision with Beluga whales the following temporary restrictions are in place.
2. A compulsory speed reduction is in force up to the 31st of October 2025 in the mouth of the Saguenay Fjord. All vessels, excluding cargo vessels, must not exceed 15 knots within an area enclosed by the following limits:

48° 08'·91N., 69° 39'·99W.

48° 08'·87N., 69° 39'·93W.

48° 07'·50N., 69° 40'·25W.

48° 07'·18N., 69° 40'·47W.

48° 06'·45N., 69° 41'·00W.

3. and

48° 06'·42N., 69° 41'·06W.

48° 05'·87N., 69° 42'·40W.

4. and

48° 07'·58N., 69° 43'·75W.

48° 08'·35N., 69° 43'·58W.

48° 08'·36N., 69° 43'·57W.

5. Entry is prohibited from 21st of June to 21st of September 2025 into Baie Sainte-Marguerite to all vessels North East of a line joining the following positions:

48° 14'·41N., 69° 57'·29W.

48° 15'·36N., 69° 59'·32W.

6. A voluntary Transit area will be established from 21st of June to 21st of September 2025 enclosed by the following limits:

48° 14'·41N., 69° 57'·29W.

48° 13'·99N., 69° 57'·71W.

48° 14'·94N., 69° 59'·73W.

48° 15'·36N., 69° 59'·32W.

7. Navigation in this area is recommended at a speed of between 5 and 10 knots without stopping.
8. For more information, please consult <http://marinepark.ca/protect/#regulations> and Canadian Notice to Mariners bulletin 4/25, Eastern Edition, dated 25th April 2025, Notice 405, accessed at <https://www.notmar.gc.ca/monthly-mensuel-en.php>.
(NAD83 DATUM)

Charts affected — 4779 — 4782**2627(T)/25 CANADA - Saint Lawrence River - Restricted areas. Area to be avoided.**

Source: Canadian Notice 4/406/25

1. To prevent collision with endangered and other species of whales, the following temporary areas have been established, with voluntary restrictions in place.
2. The restrictions apply to merchant vessels and cruise ships, with measures only to be taken when they will not jeopardise navigational safety.

2627(T)/25 CANADA - Saint Lawrence River - Restricted areas. Area to be avoided. (continued)

3. Area to be avoided, bounded by the following positions:

48° 22'·55N., 69° 22'·03W.
48° 20'·94N., 69° 19'·92W.
48° 31'·38N., 69° 02'·62W.
48° 33'·34N., 69° 07'·46W.

4. Vessels should avoid transiting through this area to reduce noise and risk of whale collisions. If the area cannot be avoided, vessels should slow to a speed of 10 knots or less.

5. Speed reduction area, bounded by the following positions:

48° 22'·55N., 69° 22'·03W.
48° 20'·94N., 69° 19'·92W.
48° 19'·49N., 69° 22'·29W.
48° 15'·92N., 69° 26'·99W.
48° 12'·15N., 69° 33'·42W.
48° 10'·00N., 69° 29'·71W.
48° 12'·69N., 69° 24'·66W.
48° 13'·21N., 69° 22'·04W.
48° 11'·12N., 69° 24'·36W.
48° 06'·88N., 69° 31'·05W.
48° 05'·63N., 69° 33'·98W.
48° 06'·49N., 69° 36'·86W.
48° 09'·40N., 69° 38'·82W.

6. Vessels should slow down to 10 knots or less when transiting this area and post a lookout. It is further recommended for vessels to remain in the Laurentian Channel to the north of Île Rouge, position 48° 04'·17N., 69° 33'·28W., to minimise the impact of noise to the whales.

7. Outside of those areas' whales can be present, a heightened vigilance is critical and posting a lookout is recommended to avoid whale collisions. If bypassing the whales is not possible, slow down and wait for the animals to move away to a distance greater than 400m before resuming original speed.

8. The restrictions are in effect until 31st of October 2025.

9. For more information, please see Canadian Notice to Mariners bulletin 4/25, Eastern Edition, dated 25th April 2025, , Notice 406/25. This can be accessed at <https://www.notmar.gc.ca/monthly-mensuel-en.php>.
(NAD83 DATUM)

Charts affected — 4777 — 4779 — 4782

3175(P)/25 CANADA - Newfoundland and Labrador - Wreck. Restricted area.

Source: French Notice 24/11(P)/25

1. A wreck exists in position 46° 39'·2N., 56° 03'·0W.
2. A restricted area has been established, radius 1NM, centred on the wreck.
3. Mariners are advised to navigate with caution.
(NAD83 DATUM)

Charts affected — 4734 — 4763

4191(T)/25 CANADA - Gulf of Saint Lawrence - Restricted areas. General information.

Source: Canadian Notice 6/601/25

1. *Mandatory seasonal speed restrictions have been established in the Gulf of St. Lawrence for the protection of the North Atlantic Right Whale. The restrictions are a combination of static zones, dynamic shipping zones, seasonal management areas, restricted area and a voluntary seasonal slowdown zone.

4191(T)/25 CANADA - Gulf of Saint Lawrence - Restricted areas. General information. (continued)

2. A northern and a southern static zone have been established, bounded by the following positions:

Northern static zone:

50° 20'·0N., 65° 00'·0W.
50° 20'·0N., 63° 00'·0W.
49° 43'·0N., 63° 00'·0W.
49° 04'·0N., 62° 00'·0W.
49° 04'·0N., 61° 00'·0W.
48° 00'·0N., 61° 00'·0W.
47° 58'·1N., 61° 03'·5W.
48° 03'·0N., 61° 07'·5W.
48° 40'·0N., 62° 40'·0W.
48° 40'·0N., 64° 13'·0W.
49° 13'·0N., 65° 00'·0W.

3. and

Southern static zone:

48° 40'·00N., 65° 00'·00W.
48° 40'·00N., 62° 40'·00W.
48° 03'·00N., 61° 07'·50W.
47° 58'·10N., 61° 03'·50W.
47° 10'·00N., 62° 30'·00W.
47° 10'·00N., 65° 00'·00W.

4. Buffer zones associated with the static zones are located 5 nautical miles north or south of their adjacent border, in waters less than 36·57m (20 fathom) deep.
5. Within the static zones or associated buffer zone, excluding the dynamic shipping zones, vessels over 13m in length (LOA) are prohibited from exceeding 10 knots.
6. Vessels engaged in any commercial fishing activity may proceed at a safe operational speed in waters not more than 36·57m deep, within the static zones.
7. If a notice to fish harvesters and a NAVWARN state that a North Atlantic Right Whale has been detected within a static zone or its associated buffer zone that are not more than 36·57m deep, a speed not exceeding 10 knots will be in effect for all vessels above 13m in length (LOA) for 15 days after the detection date.
8. Dynamic shipping zones have been established, bounded by the following positions:

Zone A

49° 41'·0N., 65° 00'·0W.
49° 22'·0N., 64° 00'·0W.
49° 11'·0N., 64° 00'·0W.
49° 20'·0N., 65° 00'·0W.

9. and

Zone B

49° 22'·0N., 64° 00'·0W.
49° 00'·0N., 63° 00'·0W.
48° 48'·0N., 63° 00'·0W.
49° 11'·0N., 64° 00'·0W.

10. and

Zone C

49° 00'·0N., 63° 00'·0W.
48° 35'·0N., 62° 00'·0W.
48° 24'·0N., 62° 00'·0W.
48° 48'·0N., 63° 00'·0W.

11. and

Zone D

50° 16'·0N., 64° 00'·0W.
50° 16'·0N., 63° 00'·0W.
49° 56'·0N., 63° 00'·0W.
50° 00'·0N., 64° 00'·0W.

4191(T)/25 CANADA - Gulf of Saint Lawrence - Restricted areas. General information. (continued)

12. and

Zone E

48° 35'·0N., 62° 00'·0W.

48° 10'·5N., 61° 00'·0W.

48° 00'·0N., 61° 00'·0W.

47° 58'·1N., 61° 03'·5W.

48° 03'·0N., 61° 07'·5W.

48° 24'·0N., 62° 00'·0W.

13. Buffer zones are located 5 nautical miles south or 2·5 nautical miles from the eastern and western edges of the dynamic shipping zones.

14. Vessels can proceed at a safe operational speed through the dynamic shipping zones when the Government of Canada has determined that the North Atlantic Right Whales do not appear to be present. When presence has been determined inside a dynamic shipping zone, or in its associated buffer zones, all vessels will be notified via NAVWARN; and vessels above 13m in length (LOA) will be required to reduce their speed, to not exceed 10 knots within that dynamic shipping zone, and associated buffer zone. The speed restriction will be in effect for 15 days from the date of detection and may be extended past that date if the North Atlantic Right Whales continue to be detected.

15. Seasonal management areas have been established north and south of dynamic zone E:

Seasonal Management Area 1:

49° 04'·0N., 62° 00'·0W.

48° 35'·0N., 62° 00'·0W.

48° 10'·5N., 61° 00'·0W.

49° 04'·0N., 61° 00'·0W.

Seasonal Management Area 2:

48° 24'·0N., 62° 00'·0W.

47° 26'·7N., 62° 00'·0W.

47° 58'·1N., 61° 03'·5W.

48° 03'·0N., 61° 07'·5W.

16. Within the seasonal management areas, between 25th June 2025 and 15th November 2025, vessels above 13m in length (LOA) are allowed to proceed at a safe operational speed, unless a North Atlantic Right Whale is detected. If detected, a speed restriction of 10 knots will be in place for 15 days after the date of detection and may be extended if the North Atlantic Right Whales continue to be detected.

17. A mandatory restricted area is to be established in or near Shediac Valley to protect the gathering of the North Atlantic Right Whales for feeding and surface activity during the summer months:

48° 31'·80N., 63° 39'·60W.

48° 24'·72N., 63° 17'·88W.

47° 18'·84N., 64° 10'·80W.

47° 27'·18N., 64° 30'·72W.

18. The restriction will come into force once 80% of the restricted area is closed to fishing for the season as per the Department of Fisheries and Ocean's Right Whale closure protocol. Once the start date is determined, the information will be communicated through NAVWARNs. The restricted area will be lifted once the North Atlantic Right Whale detections decrease in the restricted area.

19. Vessels above 13m in length (LOA) are required to avoid the restricted area, unless they are part of the listed exceptions.

20. If permitted to navigate through this area, vessels must reduce their speed to not exceed 8 knots.

21. A voluntary seasonal slowdown zone has been established in Cabot Strait to coincide with the North Atlantic Right Whales entering and exiting the Gulf of St. Lawrence:

48° 10'·5N., 61° 00'·0W.

47° 37'·2N., 59° 18'·5W.

47° 02'·0N., 60° 23'·7W.

47° 58'·1N., 61° 03'·5W.

48° 00'·0N., 61° 00'·0W.

22. Mariners of vessels above 13m in length (LOA) are asked to voluntarily reduce their speed to not exceed 10 knots between 3rd of September 2025 to 15th of November 2025. Outside of this period, vessels may proceed at safe operational speeds.

23. Mariners will be notified via a Navigational Warning (NAVWARN) should the speed restriction status change within any zone or area due to inclement weather. When the speed restrictions are not in force, mariners are advised to proceed at a safe operational speed and with extreme caution, to avoid collision with the whales.


4191(T)/25 CANADA - Gulf of Saint Lawrence - Restricted areas. General information. (continued)

24. The Canadian Coast Guard (CCG) continues to promulgate valid NAVWARNs via radio broadcasts and online at <http://www.marinfo.gc.ca/e-nav> or <http://nis.ccg-gcc.gc.ca>. Mariners must ensure they have accurate and up-to-date information concerning the protection of the North Atlantic Right Whales as contained in all applicable Notice to Mariners (NOTMARs) and NAVWARNs.
25. Failure to comply with the mandatory speed restrictions could lead to enforcement action with administrative penalties up to a maximum of CAN \$250,000; and/or penal sanctions to a maximum fine of CAN \$1,000,000 or to imprisonment for a term of not more than 18 months, or to both.
26. The restrictions are in force up to 15th November 2025 and are subject to change depending on the presence of the North Atlantic Right Whales.
27. For more information, please see diagram and Canadian Notice to Mariners bulletin 4/25, Eastern Edition, dated 25th of April 2025, Notices 401 and 404. This can be accessed at <https://www.notmar.gc.ca>
28. *Former Notice 4121(T)/25 is cancelled.
*Indicates new or revised entry
(NAD83 DATUM)

Charts affected — 2666 — 4011 — 4013 — 4404 — 4763 — 4764 — 4765 — 4766 — 4767 — 4768 — 4774



To accompany Notice to Mariners 4191(T)/25

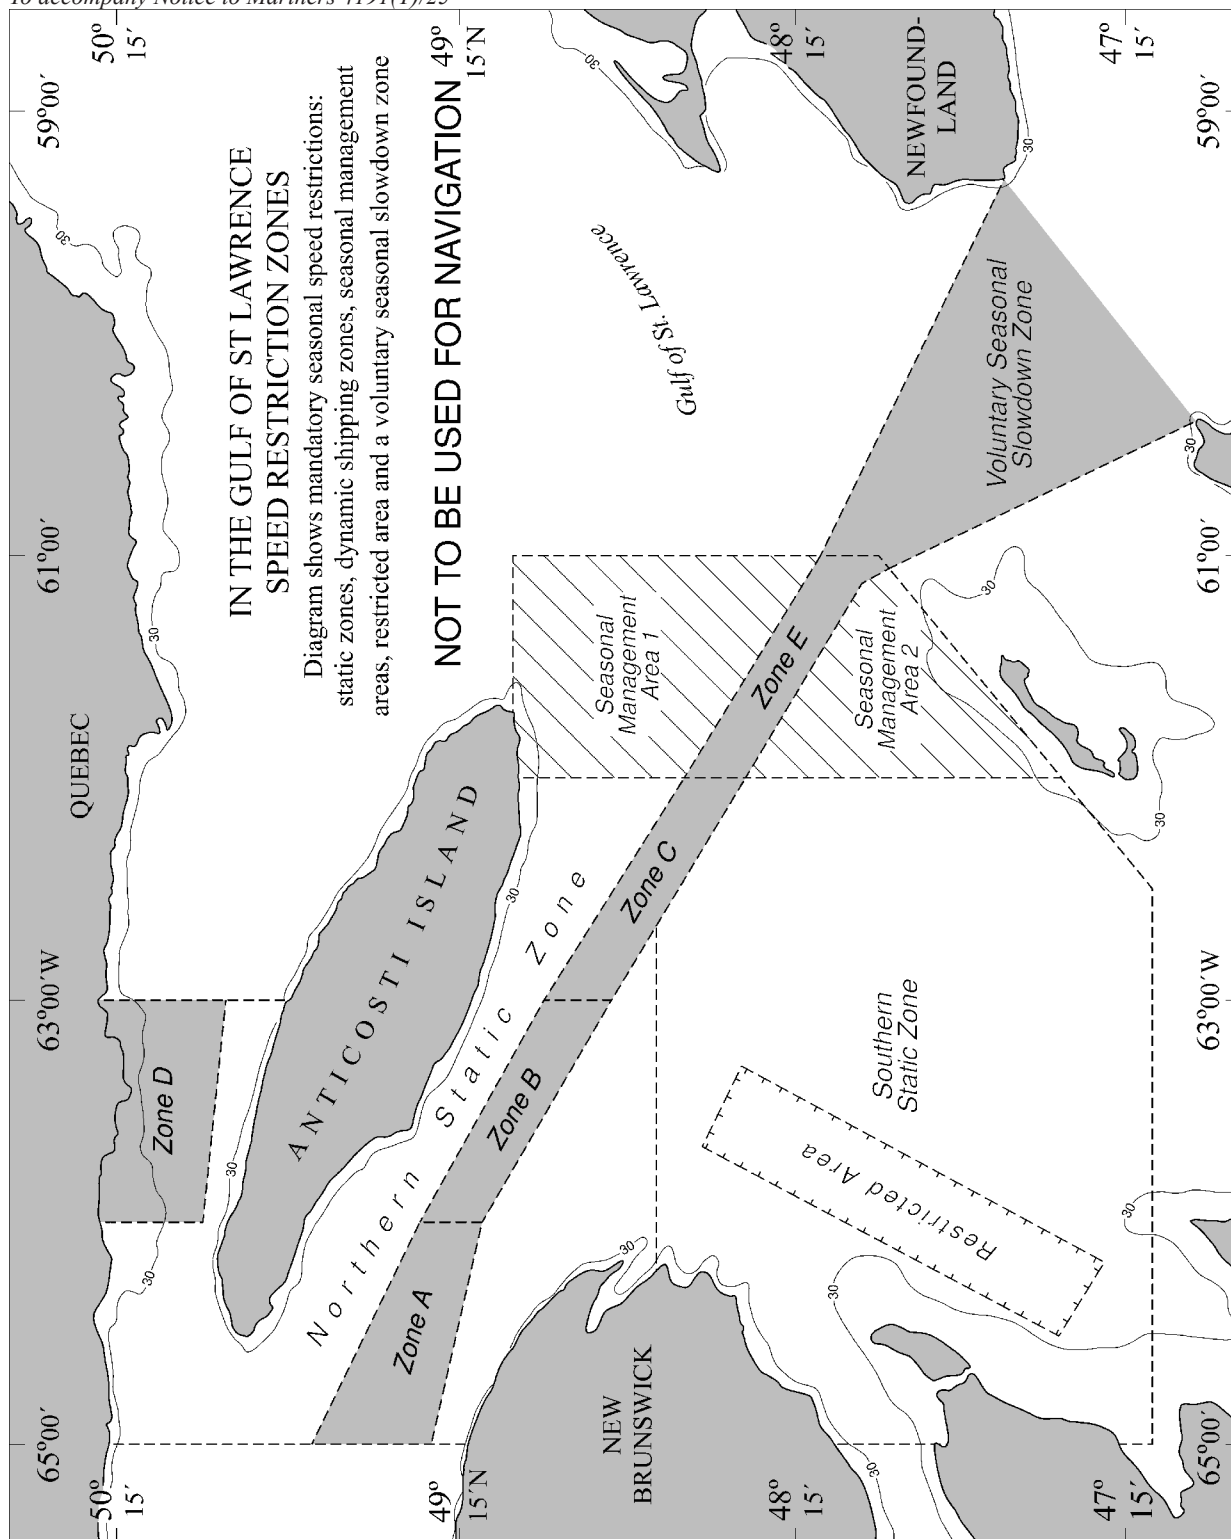

4639(P)/25 UNITED STATES OF AMERICA - East Coast - Unsurveyed area. Dredged area.

Source: ENC5 US5ORFCC, US5ORFCB, US5ORFBB and US5ORFBC

1. Craney Island Disposal Area has been extended, and an unsurveyed area has been established, bounded by the following positions:

36° 54'·71N., 76° 23'·41W.
 36° 55'·65N., 76° 23'·34W.
 36° 55'·61N., 76° 21'·32W.
 36° 55'·68N., 76° 20'·73W.
 36° 54'·01N., 76° 20'·44W.
 36° 53'·94N., 76° 20'·82W.
 36° 53'·66N., 76° 20'·77W.

2. Dredging is taking place in the unsurveyed area within Elizabeth River
3. Public access is strictly prohibited on Craney Island Federal property, within 1000-ft of shoreline, 500-ft of containment dikes
4. All access must be authorized by USACE; contact Craney Island Office at DLL-CENAO-WROCRANEY@usace.army.mil or 757-484-1021.
5. For further details use NOAA Electronical Navigational Charts.
6. Charts will be updated when full details are available.
(WGS84 DATUM)

Charts affected — 2813 — 2814**5573(P)/25 UNITED STATES OF AMERICA - East Coast - Dredged depths. Obstructions. Dolphin. Depth. Restricted area. Buoyage.**

Source: ENC US5ORFBC

1. Dredged depths have changed within Elizabeth River. The most significant are as follows:

<i>Depth</i>	<i>Date</i>	<i>Position</i>
36ft	2024	36° 52'·58N., 76° 20'·76W.
36ft	2024	36° 52'·70N., 76° 20'·36W.
47ft	2024	36° 52'·82N., 76° 19'·77W.
32ft	2024	36° 52'·75N., 76° 19'·79W.
17ft	2024	36° 52'·59N., 76° 19'·79W.
11ft	2024	36° 52'·56N., 76° 19'·82W.
2ft	2024	36° 52'·51N., 76° 19'·80W.
10ft	2024	36° 52'·49N., 76° 19'·77W.
11ft	2024	36° 52'·46N., 76° 19'·77W.
34ft	2024	36° 51'·51N., 76° 19'·13W.
23ft	2024	36° 52'·04N., 76° 19'·17W.
23ft	2024	36° 51'·97N., 76° 19'·09W.
26ft	2024	36° 51'·85N., 76° 18'·91W.
21ft	2024	36° 51'·76N., 76° 18'·85W.

2. Obstructions exist in the following positions:

<i>Depth</i>	<i>Position</i>
33ft	36° 50'·33N., 76° 17'·56W.
13ft	36° 50'·46N., 76° 17'·21W.
21ft	36° 51'·09N., 76° 18'·04W.
7ft	36° 51'·68N., 76° 19'·76W.
12ft	36° 52'·19N., 76° 20'·14W.
13ft	36° 52'·27N., 76° 20'·18W.
7ft	36° 51'·43N., 76° 18'·49W.

3. A dolphin has been established in position 36° 50'·96N., 76° 17'·83W.
4. A Depth of 17ft exists at position 36° 52'·50N., 76° 20'·35W.

**5573(P)/25 UNITED STATES OF AMERICA - East Coast - Dredged depths. Obstructions. Dolphin. Depth.
Restricted area. Buoyage. (continued)**

5. A restricted military area, marked by orange can buoys, has been established in an area bounded by the following positions:

36° 49'·66N., 76° 17'·47W.
36° 49'·66N., 76° 17'·51W.
36° 49'·85N., 76° 17'·60W.
36° 50'·09N., 76° 17'·65W.
36° 50'·19N., 76° 17'·62W.
36° 50'·20N., 76° 17'·57W.
36° 50'·15N., 76° 17'·55W.

6. Mariners are advised to navigate with caution in the area and consult the local port authorities for the latest information.
7. For full details use NOAA Electronical Navigational Charts.
8. These and other changes will be included in the next New Edition of Chart 2814 (NAD83 DATUM)

Chart affected — 2814

5784(T)/25 CANADA - Nova Scotia - Scientific instruments. Moorings.

Source: Canadian Notice 10/1012(T)/25

1. Subsurface scientific moorings have been established in the Northeast Channel. The scientific moorings are between five to six meters off the ocean floor at the following positions:

42° 39'·4N., 66° 27'·8W.
42° 39'·6N., 66° 20'·5W.
42° 34'·0N., 66° 27'·5W.
42° 34'·2N., 66° 20'·2W.
42° 34'·4N., 66° 12'·9W.
42° 34'·6N., 66° 05'·6W.
42° 28'·8N., 66° 20'·0W.
42° 29'·0N., 66° 12'·7W.
42° 29'·2N., 66° 05'·4W.
42° 29'·4N., 65° 58'·1W.
42° 29'·6N., 65° 50'·8W.
42° 23'·8N., 65° 05'·1W.
42° 24'·0N., 65° 57'·8W.
42° 24'·2N., 65° 50'·6W.
42° 24'·4N., 65° 43'·3W.
42° 18'·8N., 65° 50'·3W.
42° 19'·0N., 65° 43'·0W.
42° 13'·4N., 65° 50'·1W.

2. Mariners are advised to navigate with caution in the area.
(WGS84 DATUM)

Charts affected — 2670 — 4746