

**Layer 1: Top** 

Plastic: 1/16" Clear Acrylic

### Color Legend:


- Red: cut

- Black: raster

- Magenta: annotations, do not cut

Power settings for Universal Laser PLS6.150D with 120 watt laser cartridge:

- Red: Vector Mode, 80% Power, 15% Speed, 0.060" z-axis
- Black: Raster Mode, 50% Power, 100% Speed, 0.125" z-axis

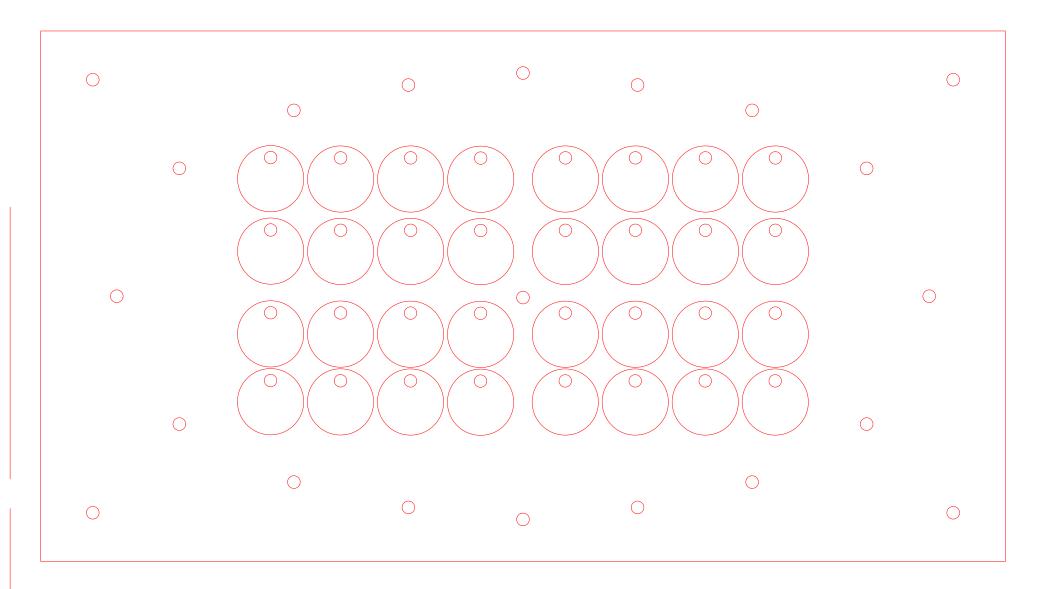

**Layer 2: Door Holders**Plastic: 1/8" Clear Acrylic


Color Legend:

- Red: cut

- Magenta: annotations, do not cut

Power settings for Universal Laser PLS6.150D with 120 watt laser cartridge:

- Red: Vector Mode, 100% Power, 6% Speed, 0.080" z-axis

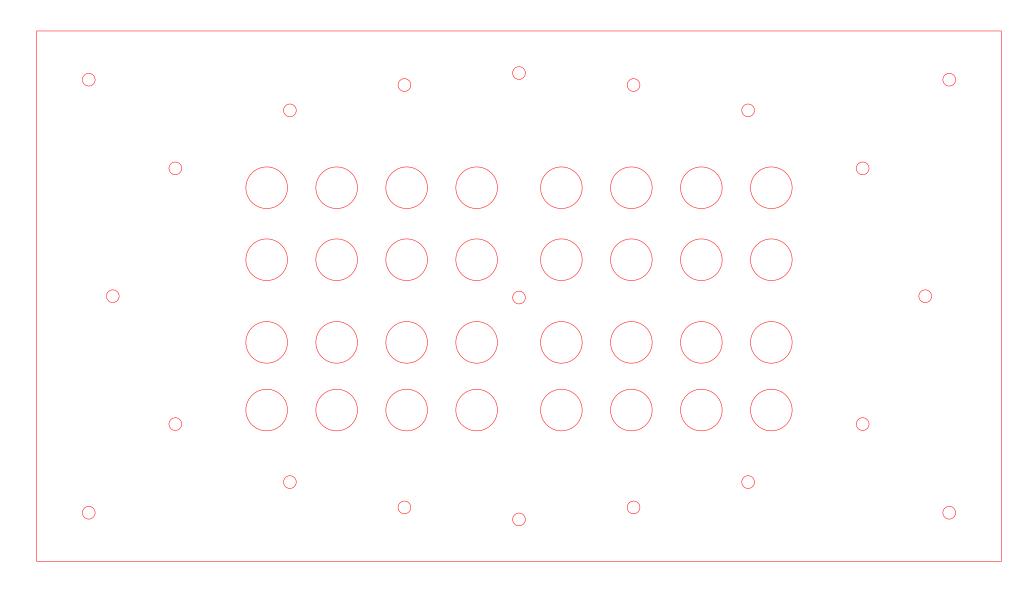

**Layer 3: Wells** 

Plastic: 1/8" Clear Acrylic


Color Legend:

- Red: cut

- Magenta: annotations, do not cut

Power settings for Universal Laser PLS6.150D with 120 watt laser cartridge:

- Red: Vector Mode, 100% Power, 6% Speed, 0.080" z-axis

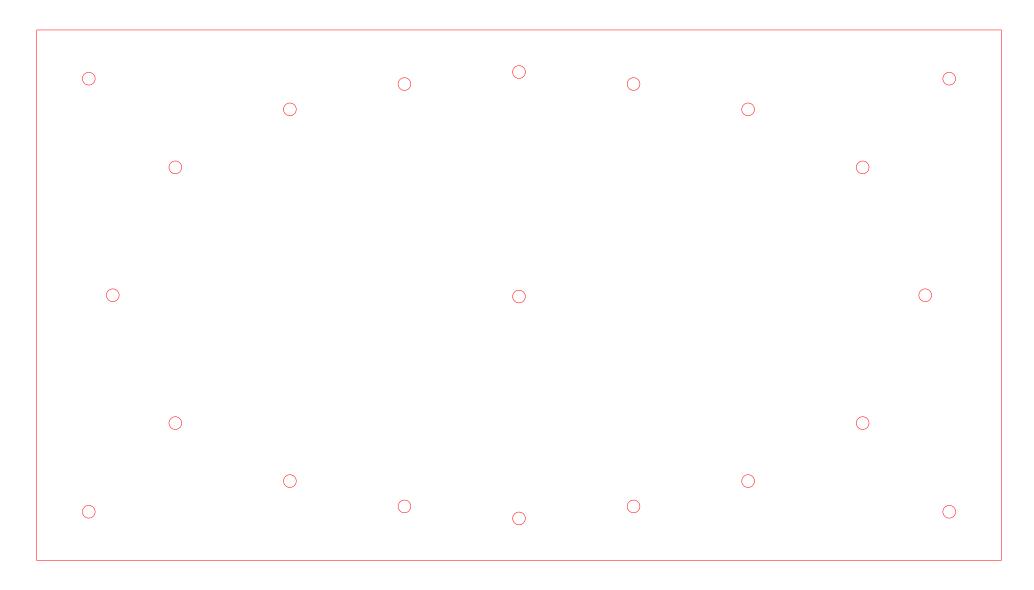

### **Layer 4: Well Bottoms**

Diffuser Paper


Color Legend:

- Red: cut

- Magenta: annotations, do not cut

Power settings for Universal Laser PLS6.150D with 120 watt laser cartridge:

- Red:

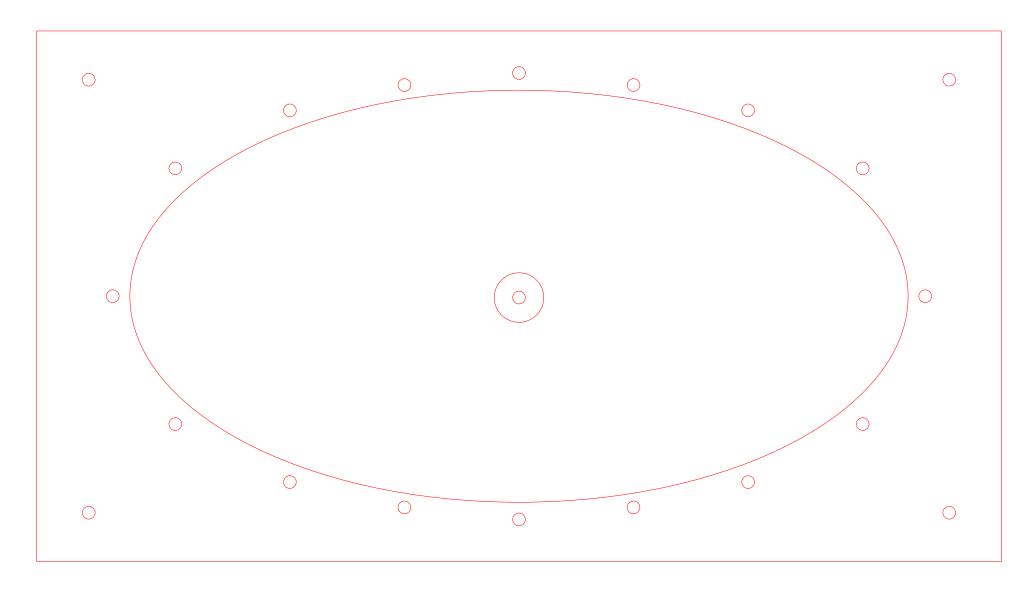

**Layer 5: Wells** 

Plastic: 1/8" Clear Acrylic


### Color Legend:

- Red: cut

- Magenta: annotations, do not cut

Power settings for Universal Laser PLS6.150D with 120 watt laser cartridge:

- Red: Vector Mode, 100% Power, 6% Speed, 0.080" z-axis

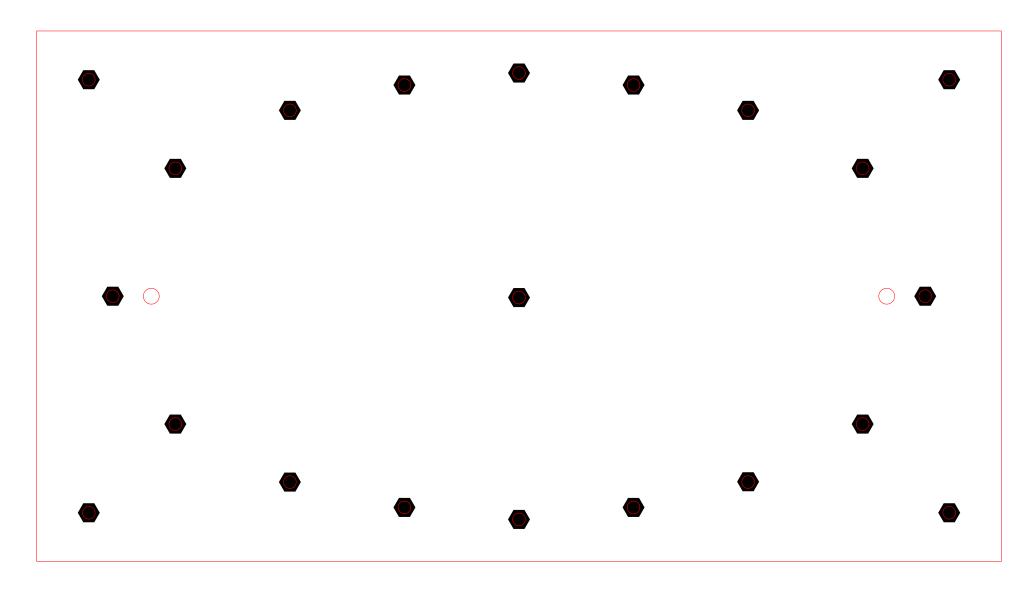

**Layer 6: Doors** 

**Plastic: 1/8" Clear Acrylic** 

#### **Color Legend:**

- Red: cut

- Black: raster

- Magenta: annotations, do not cut

#### **Power settings for Universal Laser PLS6.150D with 120 watt laser cartridge:**

- Red: Vector Mode, 100% Power, 6% Speed, 0.080" z-axis
- Black: Raster Mode, 100% Power, 24% Speed, 0.125" z-axis