

WI00U-01

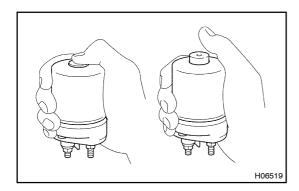

## **INSPECTION**


## **INSPECT MAGNET SWITCH NO.1**

(a) Push in the plunger and release it. Check that it returns quickly to its original position.

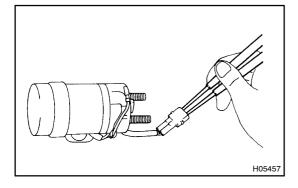

(b) Using an ohmmeter, measure the resistance between connector terminals.

Resistance: Approx. 7  $\Omega$ 

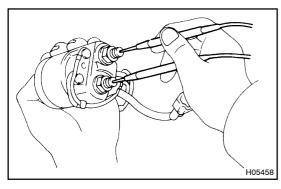

(c) Using an ohmmeter, check for no continuity between the terminals with the plunger released.