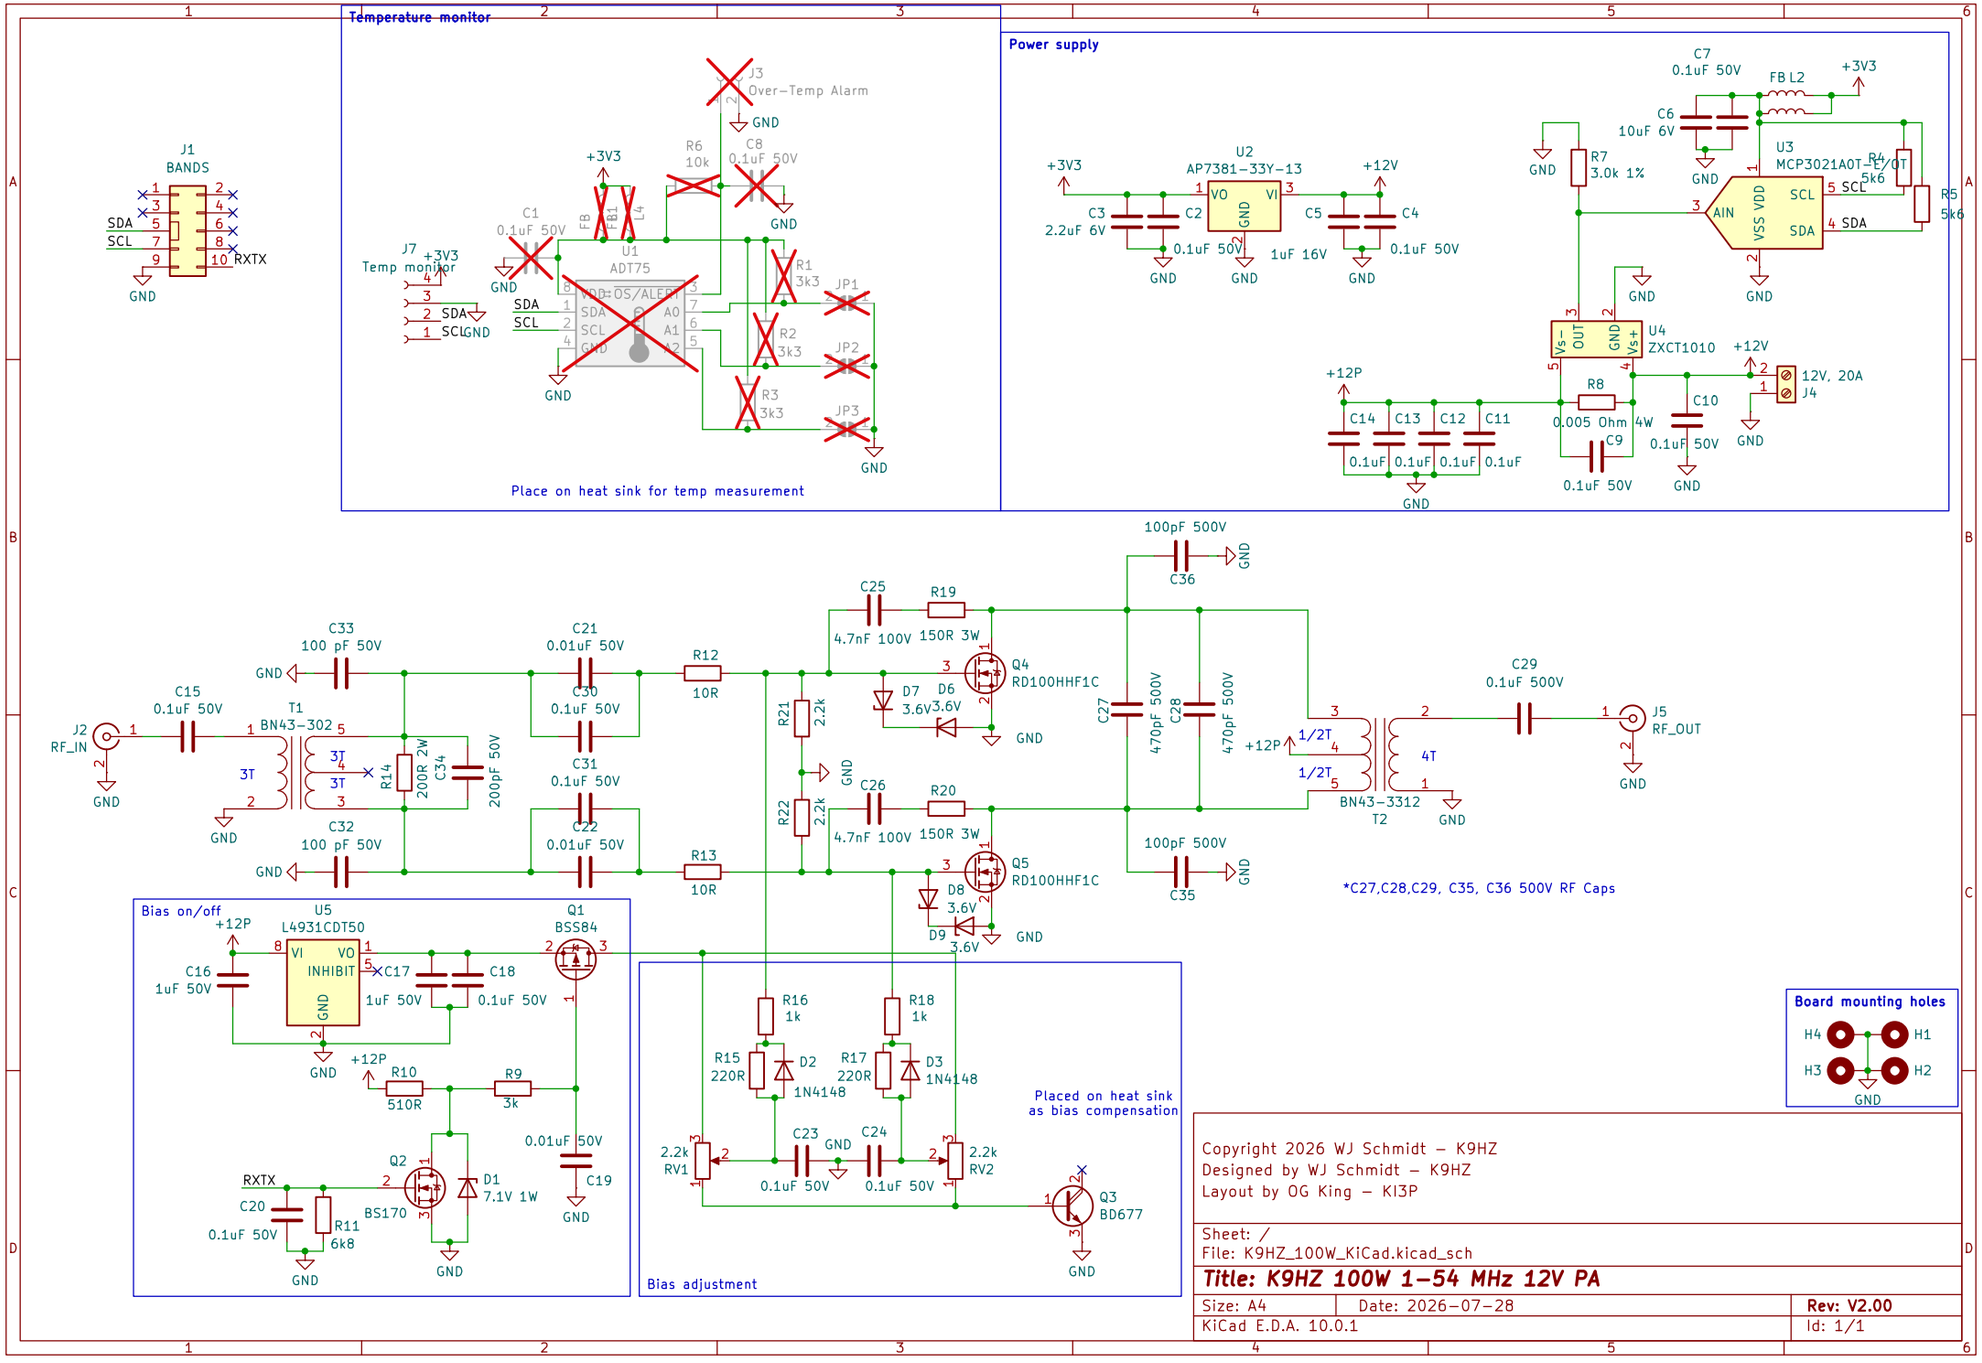

Temperature monitor
Power supply
Bias on/off
Bias adjustment
Board mounting holes
Place on heat sink for temp measurement
Placed on heat sink as bias compensation
*C27,C28,C29, C35, C36 500V RF Caps
J1 BANDS
J2 RF_IN
J3 Over-Temp Alarm
J4 12V, 20A
J5 RF_OUT
J7 Temp monitor
U1 ADT75
U2 AP7381-33Y-13
U3 MCP3021A0T-E/OT
U4 ZXCT1010
U5 L4931CDT50
T1 BN43-302
T2 BN43-3312
Q1 BSS84
Q2 BS170
Q3 BD677
Q4 RD100HHF1C
Q5 RD100HHF1C
D1 7.1V 1W
D2 1N4148
D3 1N4148
D6 3.6V
D7 3.6V
D8 3.6V
D9 3.6V
RXTX
SDA
SCL
+3V3
+12V
+12P
GND
Copyright 2026 WJ Schmidt - K9HZ
Designed by WJ Schmidt - K9HZ
Layout by OG King - KI3P
Sheet: /
File: K9HZ_100W_KiCad.kicad_sch
Title: K9HZ 100W 1-54 MHz 12V PA
Size: A4
Date: 2026-07-28
Rev: V2.00
KiCad E.D.A. 10.0.1
Id: 1/1