AI SITE HISTORY REPORT

502 Church Road, Taigum QLD 4018

Generated 07 Apr 2026 | Lat -27.333136, Lng 153.048862 | Confidence: High

Executive Summary

A single, distinct on-site circular pond feature exists which has persisted with stable shape and vegetation from 1995 through 2021. No evidence of multiple separate water bodies on site or major disturbance within the lot boundary was observed. Additional remainder-lot rescan indicates at least one further possible on-site basin/depression should be reviewed.

On-site: One on-site pond (Pond A) with a circular berm and central moist or wet area surrounded by vegetated edges, persistent across historical and current imagery. No clear signs of fill or major disturbance on site; the lot is mostly open with some scattered trees and a few small cleared spots unrelated to the pond. Remainder-lot rescan also identified additional possible on-site basin/depression features requiring field confirmation.

Adjacent / context: To the east and northeast, dense vegetation lines a creek (Cabbage Tree Creek) visible in current wide context imagery. Adjacent areas also show additional larger water bodies off-site. Dirt tracks and some cleared farm areas lie adjacent to the lot boundaries but do not extend inside.

Site Details

Address	502 Church Road, Taigum QLD 4018
Location source	polygon
Latitude / Longitude	-27.333136, 153.048862
Site bbox	93.1 m × 76.1 m
Context bbox	147.1 m × 130.1 m
Polygon supplied	Yes

Key Flags

Key Flag	Level	Comment
Former water features	High	Clearly identified single pond with berm and water presence historically and currently.
Vegetation / land change	Low	Natural vegetation retention mainly around pond edges and adjacent creek; surrounding land mostly cleared or lightly vegetated.
Fill / disturbance	Moderate	

Flag Summary

Potential Fill / Disturbance	Moderate
No significant indicators noted from current automated screening.	
Former Water Features	High
Clearly identified single pond with berm and water presence historically and currently.	
Vegetation / Land Change	Low

Natural vegetation retention mainly around pond edges and adjacent creek; surrounding land mostly cleared or lightly vegetated.

Screening Outcome

The site contains one persistent historic pond feature with no visible major fill or disturbance, which should be considered in geotechnical planning due to potential softer soils and moisture retention.

Distinct Feature Review

Feature	Type	Relation	Status	Notes
Pond A	pond	on_site	persistent	Circular pond with vegetated berm visible across all historical and current imagery within site boundary.
f1	pond	on_site	persistent	Main circular pond with vegetated berm consistently visible in all historical and current imagery.
f2	disturbance	on_site	uncertain	Scattered patches of vegetation and minor soil disturbances observed but no clear depression or pond characteristics.

Feature Timeline

Pond A — 1995: Pond present with water and intact berm structure.

Pond A — 2005: Pond still present, appears slightly vegetated but unchanged.

Pond A — 2011: Pond presents with more vegetation, shape stable.

Pond A — 2021-current: Pond maintains shape, vegetated edges, and moist center area.

Detailed Findings

Visible Observations

• Circular vegetated pond with berm and moist center on site.

• No multiple separate ponds inside the lot boundary.

• Surrounding cleared land with scattered trees on site.

• Dense riparian vegetation and creek immediately adjacent northeast.

• No visible fill or earthworks inside the lot boundary near the pond.

• Dirt tracks and access roads west and south of pond on site and adjacent.

• Historical images (1995, 2005, 2011) show pond present with water or wet soil centrally.

Overall Change Timeline

1995-2021: Pond A remains visually consistent in extent, shape, and vegetated berm; appears to retain water or moisture centrally in earlier images.

Possible Geotechnical Implications

• Potential for saturated or softer soils associated with historic pond area that could affect foundations.

• Local moisture retention near pond edges potentially leading to minor differential settlement risks if developing near pond.

Targeted Investigation Focus

• Soil strength and moisture profiling in pond and berm zone.

• Investigation of fill presence or heterogeneity near pond edges.

• Slope stability and drainage characteristics adjacent to pond.

• Assessment of potential seasonal water table influence.

Recommended Follow-Up

• Detailed geotechnical site investigation focused around pond area.

• Subsurface soil testing to assess moisture content, bearing capacity, and settlement potential near pond.

• Survey existing surface levels to evaluate pond extent and local drainage.

• Consider hydrological assessment for drainage and moisture management.

Supporting Imagery

current_wide_context — current

Source: mapbox_bbox_wide_context

current_context — current

Source: mapbox_bbox_context

current_site — current

Source: mapbox_bbox_site

current_subzone_west — current

Source: mapbox_bbox_subzone

current_subzone_east — current

Source: mapbox_bbox_subzone

historical_qld_followup_1 — 1995 (1995-06-18)

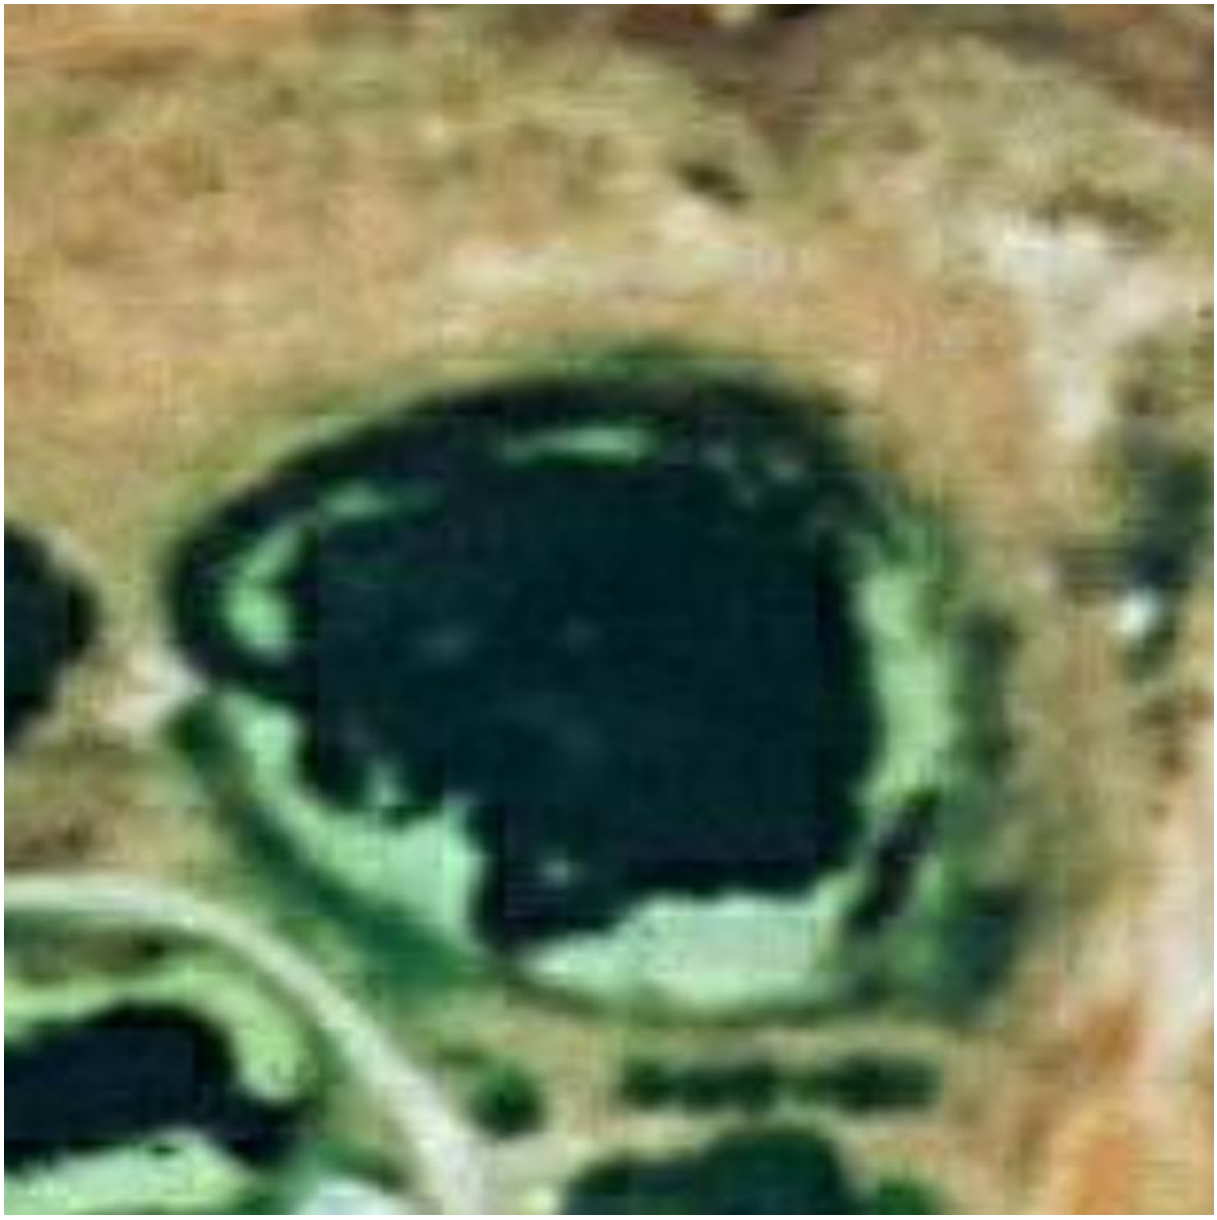

Source: qld_public_imagery | Queensland Digital Orthophoto Image Data - Brisbane_1995_60cm_9543 | Resolution: 60 2

historical_qld_followup_4 — 2015 (2015-05-30)

Source: qld_public_imagery | Queensland Digital Orthophoto Image Data - Brisbane_2015_10cm_SISP_LGA | Resolution: 10 2

historical_qld_followup_6 — 2021 (2021-07-17)

Source: qld_public_imagery | Queensland Digital Orthophoto Image Data - Brisbane_Urban_2021_10cm_SISP | Resolution: 10 2

Limitations & Disclaimer

- No subsurface information available to confirm soil conditions.
- Vegetation and water presence inferred from aerial imagery only.
- Possible small-scale disturbances or fill not visible at imagery resolution.

This AI site history scan is a preliminary screening tool only. It is intended to identify possible visual indicators for further professional review. It must not be relied on as a substitute for geotechnical investigation, engineering assessment, or design advice.