


FRONT CROSSMEMBER (ASSY)

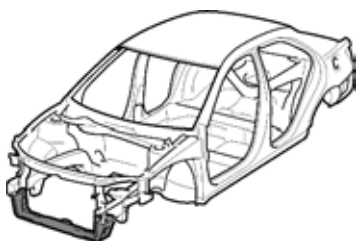

F25705A

Symbol meaning

REMOVAL

▲ ▲ ▲ : Remove Weld Points

☐ : Cut with disc sander, etc.




INSTALLATION

☐ M I : MIG Plug Weld

☐ : Tack Weld

F25705B

REMOVAL-INSTALLATION

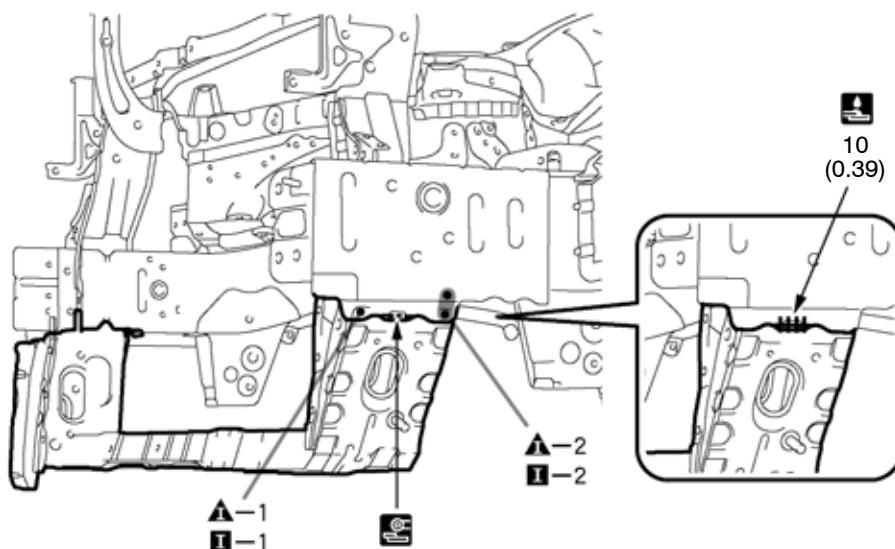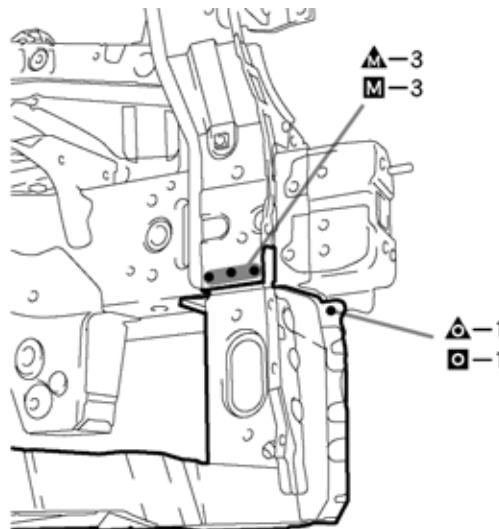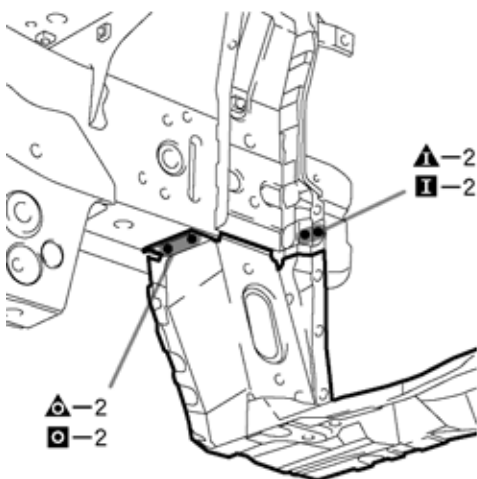

mm (in.)

F25705

INSTALLATION POINT

- 1 Inspect the fitting of the related parts around the new parts before welding. This affects the appearance of the finish.
- 2 Temporarily install the new parts and measure each part of the new parts in accordance with the body dimension diagram. (See the body dimension diagram)
- 3 After applying the top coat, apply anti-rust agent to the internal panel portion of the closed section structural weld points.