Projection handoff

R4 / Consolidated edition 2 / November 13, 2026

Contents

PDF pages

Project overview 2-6

Five-page illustrated summary of the installation and remaining acceptance work.

Signal flow diagrams 7-11

Picture, cue, projector control, pixel data and power paths.

AV1	Projection and operator display	7
CU1	Gio and network MIDI cues	8
CT1	Projector commands and monitoring	9
PX1	Pixel data and addressing	10
PW1	Pixel power and unresolved feeds	11

Crew acceptance workbook 12-16

Readiness, baseline, control, temperature, recovery, results and sign-off.

Source reference key 17

Numbered references used in the illustrated summary.

Using this handoff

Click a contents entry or use the PDF bookmarks to navigate.

The crew workbook is the selected field record. Its result fields are blank.

Page references here use the combined PDF count. Section footers keep their own numbering.

Frozen AV Project Summary

Walnut Street Theatre • November 13, 2026

The Frozen AV project combines scenic projection, illuminated deck elements and show-control integration at Walnut Street Theatre. Dave Robertson is the head of video for setup and technical handoff. The intended performance arrangement puts projection cueing with lighting and monitoring with a named house technician. That technician, backup and fault-response responsibilities still need confirmation. No dedicated video operator is assigned during the show.[1][2][4]



Scenic portals and stage opening during setup. Interpretation of the photograph and plot suggests that their depth and repeated framing affect coverage and masking.[P1][P2]


Project purpose and present position


Four projector lanes cover the stage-left portal, top portal, central stage and stage-right portal. Project records describe Millumin on a newer Studio for projection and an older M1 Studio for pixels. The final pixel application and show file remain unverified. Both are recorded in the third-floor rack in the Show Caller’s Booth. Separate systems carry picture, cue commands, projector control and pixel power.[2][3][5][11]

The immediate handoff dependencies are electrical clearance and portal-service findings, a released technical window, named house coverage, and approved show files with confirmed cue details. These inputs allow display recovery, cue tests and the house walkthrough to proceed.[1][4]

This report synthesizes project records reviewed on November 13. Observations and photographs retain their source dates. Live equipment condition and operational acceptance require the checks described in the following pages.[1][2][3][4][5]

Projection surfaces and display recovery

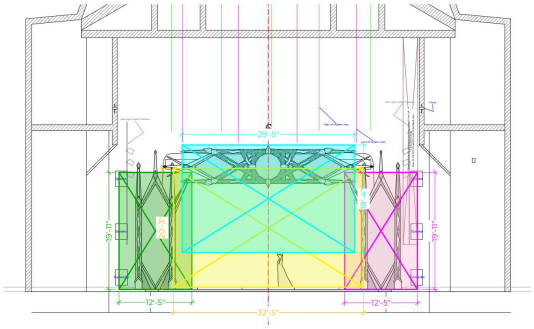

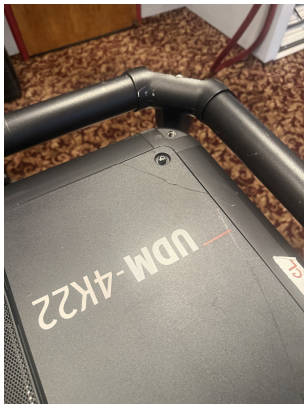

The front-elevation plot shows coverage relationships. The Barco photograph from November 5 supports the UDM 4K22 identity. The fitted lens remains unverified.[P2][P3][3]

A · magenta · SL portal B · cyan · top portal
C · yellow · stage D · green · SR portal[P2][5]

Four projection lanes

Lanes A and D serve the stage-left and stage-right portals with Panasonic PT-DW830U-family units in portrait orientation. Lane B serves the top portal with a Panasonic PT-RZ970-family unit. Lane C serves the stage with a Barco UDM 4K22, following Dave’s November 13 confirmation. Exact nameplate suffixes, the fitted Barco lens and the portal portrait configuration still require confirmation.[3][5]

Use lane, scenic destination and network identity together when checking control targets. Production P1–P4 labels and historical controller slots use different mappings.[2][3]

Picture transport and timing

The projection Studio feeds USB-to-HDMI adapters, short HDMI leads, AV Access HDBaseT transmitters, dedicated category-cable runs, receivers and projectors. The built-in HDMI connection serves the KVM or field monitor in the latest supplied layout. Exact ports, adapter models, extender suffixes and cable labels remain part of the physical trace.[11][2]

All four lanes are recorded receiving 1920 × 1200. The portal units have a different native raster. Exact refresh rate, display enumeration, portrait orientation, focus, scenic coverage and designer acceptance must be recorded against the final setup.[3][5][15][4]


Recovered display baseline

ATEN VC081A emulators are selected to preserve EDID, the display identification and timing data supplied to the computer. Dave reported recovering 1920 × 1200 after removing the ATEN units and reseating USB-C adapters. HDMI reseating alone had not worked. Capture that baseline and test one ATEN path in the agreed window. BetterDisplay’s contribution and restart retention remain unverified.[3][4][12]

Signal paths and projector control

Picture transport and network commands have different roles in the installation. The rack distributes video and control connections, while the cove equipment completes the projector paths. Technical interpretation of that topology supports tracing faults by connection, device and software path.[5][11]



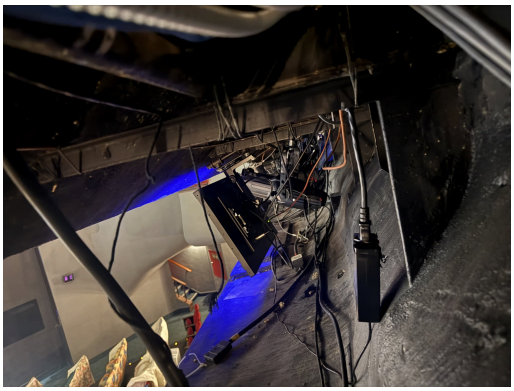

Booth network patching and a cove projector connection, photographed November 4. Port identities, extender models and cable labels remain part of the final trace.[P4][P5][5]

Cueing and command authority

Lighting is intended to trigger media playback in Millumin through MIDI messages. For A, B and D, projector power and shutter commands use PJLink on port 4352. Lane C records both Pulse JSON-RPC on port 9090 and a PJLink route on port 4352. The saved Current Rig file uses Pulse commands. Record the route used by each C cue and witness its result. The mioXL interface is identified, but its routing, messages and destination mappings await verification. Lighting and the A1, the audio operator, must confirm shared sound triggers and manual audio cues.[2][5][7][13][14][17]

Projctl provides manual control and monitoring. The accepted plan enables its Show Lock command restriction during performances. The intervention owner remains to be named. Millumin sends commands independently. Recovery must be programmed and witnessed to establish whether projection or pixels can be repeated without retriggering sound.[1][2][3][4]

Cue map action and remaining inputs

Dated faults and monitoring results

At 2:26 PM EST on November 13, a native status-page observation recorded lane A with Lamp 2 marked FAILED, Lamp 1 on and Lamp 2 off despite DUAL selection. Lane D reported both lamps on. Both portals reported horizontal-tilt warnings, while fan and temperature self-tests passed. The lamp-fault cause and final portrait setup remain unresolved.[3]

A November 12 monitoring entry recorded 37 portal control disconnects in one hour, with no lost pings. Thirty-six recovered at the next five-second check and one took 15 seconds. The cause remains unresolved. The record provides no corresponding evidence of picture interruption. Operators need fresh timestamps and explicit handling of missing telemetry.[6][4]

Documentation progress


The current Frozen Signal Flow R4 covers picture, cues, projector control, pixels and power, with connection schedules and acceptance fields. The owning record reports package verification. Field configuration and house acceptance remain open.[5]

Current signal flow and R4 issue record

Deck pixels and power distribution

Records describe M1 pixel playback through the lighting network to a DMXking LeDMX2 decoder. Final application and show-file acceptance remain open. Dave confirmed this decoder identity on November 13. Earlier OCTO references describe failed bench hardware. The house guide records six strips, three downstage and three upstage, and the patch uses twelve mapping slices.[2][3][8][9][11]



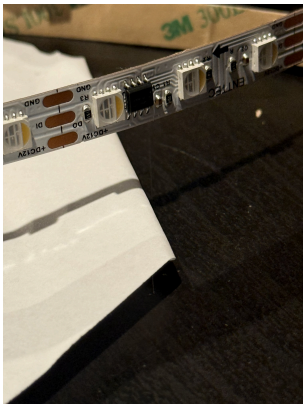

Left, a deck channel during installation on November 8. Right, LED tape and its components on November 7. These record physical construction. The final six-strip mapping and output still require a witnessed check.[P6][P7][4][9]

Playback patch and equipment

The November 12 patch records downstage on Port 1 at universe 221, channel 1, and upstage on Port 2 at universe 227, channel 1. Decoder firmware, per-port settings, numbering conventions, data direction and the final strip-to-slice correspondence remain subject to physical verification.[6][8][9][4]

The documented bench tape is ENTTEC 8PXB60-RGBW-12V-W with four-channel RGBW control. Installed tape must be checked against that identity. Two supplies are recorded under the stage, wall-mounted stage right at the far side of the orchestra pit. Installed lengths, power branches, injection points and returns still need a completed trace.[P9][9][10][2]

Electrical and operational acceptance

The project retains an open request for qualified inspection of exposed copper at mains terminals, distribution and fusing, and the disposition of an earlier faulty adapter. Electrical clearance and physical mapping must precede accepted pixel operation.[10][1][4]

The approved pixel show file, its backup, startup behavior and expected opening look must be recorded alongside the projection show. A coordinated test must demonstrate the intended strip output, the selected cue route and a reset agreed with lighting and the A1. Earlier preparation and bench records remain useful history, with final settings established on the installed system.[4][7][9]

House operation and completion



Rack keyboard and control access photographed November 4. A permanent keyboard, video and mouse (KVM) position, access route and operator remain to be confirmed.[P8][2][16]

People and access

House handoff requires named primary and backup technicians, a support contact and a scheduled walkthrough. The intended arrangement assigns cueing to lighting, with the A1 confirming sound responsibilities. Projection monitoring and recovery ownership remain open. Stage management retains interruption authority. Dave’s show-time support availability must be agreed.[1][2][4][7]

A permanent KVM/control position and a dedicated mini PC with venue Wi-Fi and restricted remote access are accepted directions. The recorded temporary arrangement extends a spare projector line downstairs. Confirm the permanent location, access from audio and each installed revision. The recorded RELAY-1 decision keeps the MacBook for control and the Studio for reporting. Studio polling at 60 seconds is selected, with application and current settings awaiting readback.[1][2][3][11]

Remaining sequence

The agreed sequence begins with a released technical window, electrical inspection and portal investigation. The team captures the recovered display configuration and tests one ATEN path. Reconnection, standby and Studio restart checks require defined interruption limits and a rollback route. NORMAL standby is the accepted direction for applicable Panasonic units, subject to per-unit checks. The Barco’s distinct power states require an agreed shutdown sequence and state readback.[1][3][4]

Handoff must identify approved show files, locations, backups, login behavior, startup steps and walk-in or opening looks. Witnessed testing must establish the actual Gio messages, response at both playback systems, intended projector behavior, recovery without retriggering sound, and the opening reset. Designer review covers focus, rotation, coverage and scenic masking.[1][4][7]

Record the accepted procedures and results in the existing guide and walkthrough. Independent operation depends on service findings, display and cue tests, agreed warning responses and house acceptance. The links open the source records in Notion.[2][4]


House operations guide • Handoff walkthrough • Project hub

AV1 / Projection and operator display

Four reported 1920 x 1200 feeds; direct HDMI operation and planned display-end ATEN branches.

R4 · 2026-11-13
Documentation reconciliation

Solid teal · Reported | Solid slate · Documented | Amber dashed · Planned | Gray dashed · Unresolved | Device tags repeat across sheets | Generic component illustrations

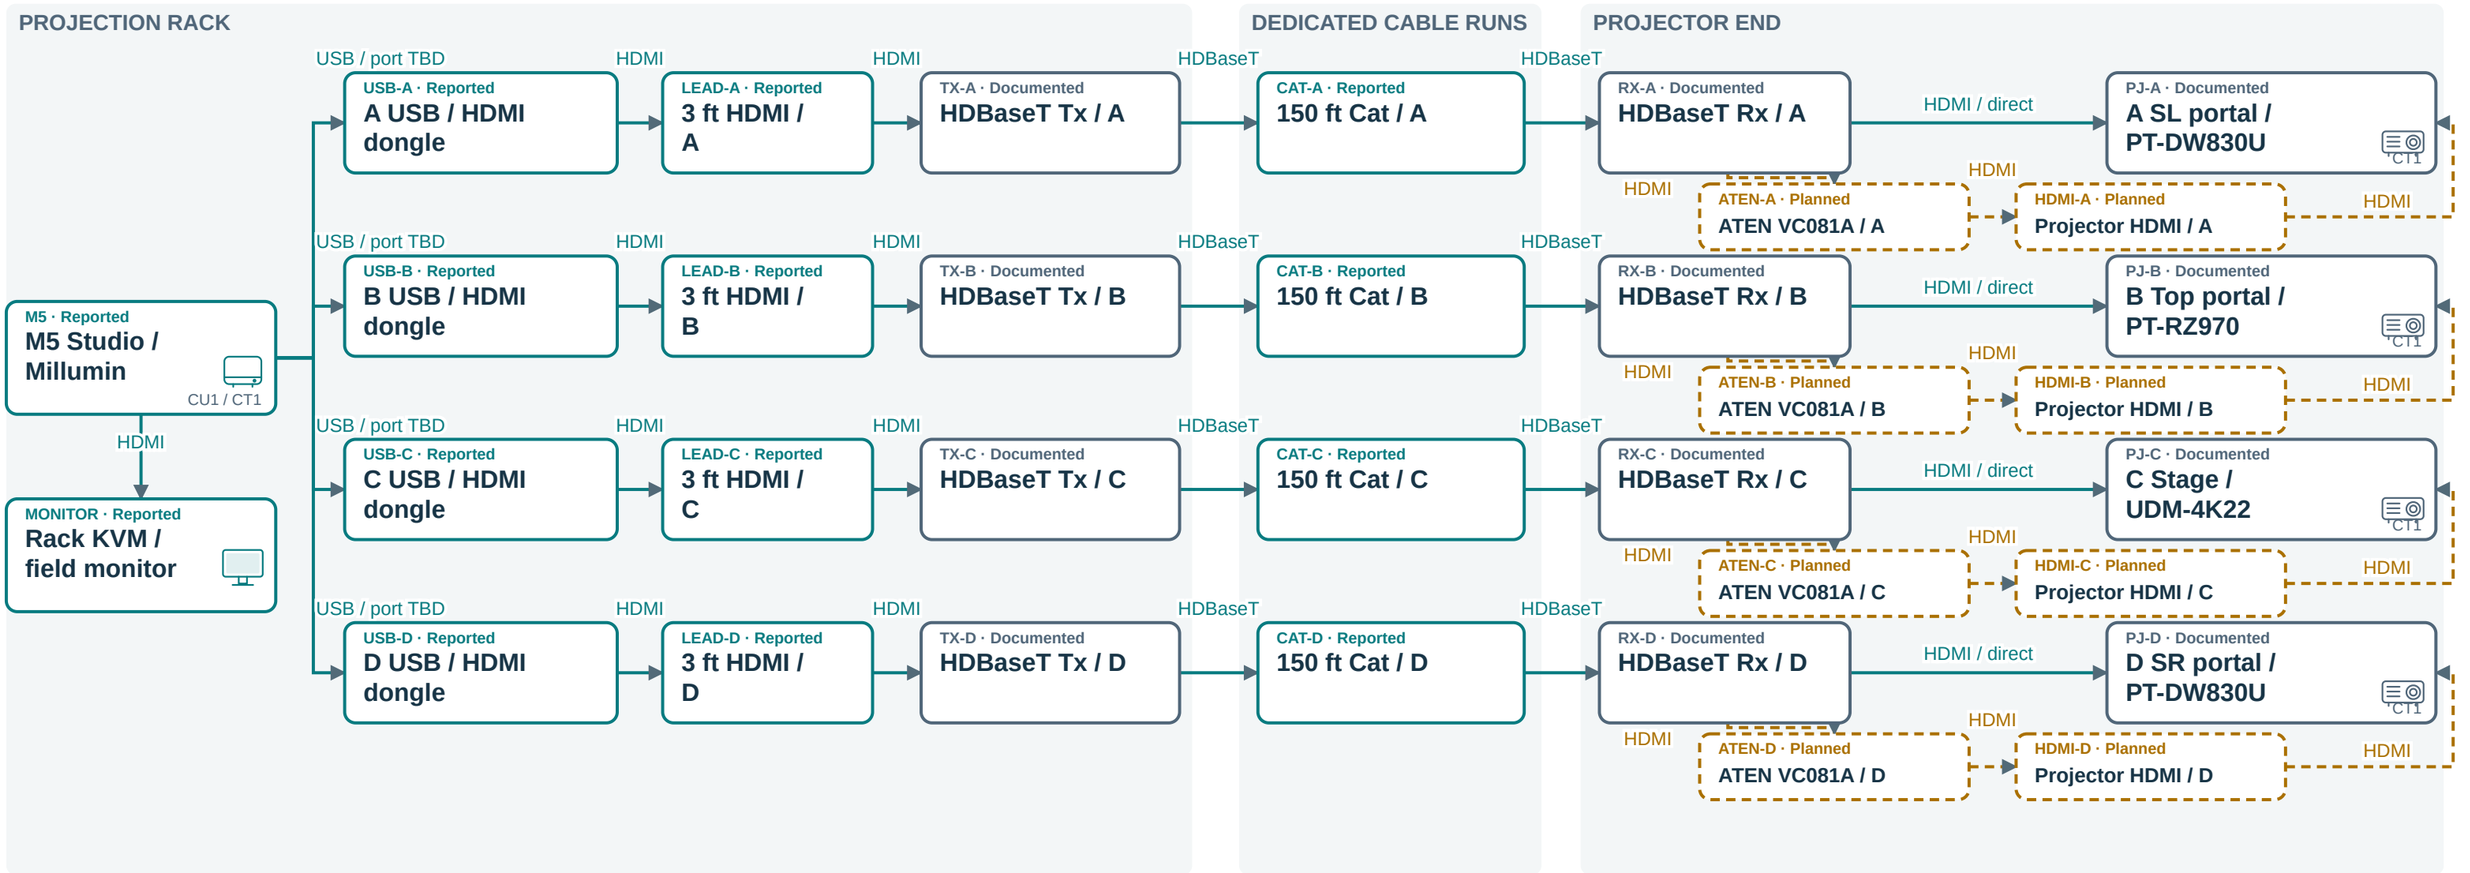

A to D connection schedule

Lane / surface	Mac / adapter	Rack lead / TX	Category run	RX / projector input
A / SL portal	USB socket TBD / dongle TBD	3 ft HDMI / TX-A suffix TBD	150 ft / cable label TBD	RX-A suffix TBD / HDMI socket TBD
B / Top portal	USB socket TBD / dongle TBD	3 ft HDMI / TX-B suffix TBD	150 ft / cable label TBD	RX-B suffix TBD / HDMI socket TBD
C / Stage	USB socket TBD / dongle TBD	3 ft HDMI / TX-C suffix TBD	150 ft / cable label TBD	RX-C suffix TBD / HDMI socket TBD
D / SR portal	USB socket TBD / dongle TBD	3 ft HDMI / TX-D suffix TBD	150 ft / cable label TBD	RX-D suffix TBD / HDMI socket TBD

Field verification and acceptance

Check	State	Owner / date
Label all sockets, adapters and cable ends	Pending	TBD / TBD
Confirm received refresh, mapping and recovery	Pending	TBD / TBD
Learn/test one ATEN route and record final installed state	Pending	TBD / TBD

Solid direct RX-to-projector routes reflect the reported ATEN-removed configuration. Amber branches show planned ATEN insertion.
Projector addresses are control-LAN references. Refresh and physical output acceptance remain pending.


Source SHA-256 a94c97956b5f655a162b9e8a0bd46df8b3aba09eead1277a09a75077d78317c4 · Graph Explorer d94683f599c3d1aaa62cd31b40b3a3c701e2d1ee

CU1 / Gio and network MIDI cues

Recorded cue destinations; unresolved physical connections and sessions are dashed.

R4 · 2026-11-13
Documentation reconciliation

Solid teal · Reported | Solid slate · Documented | Amber dashed · Planned | Gray dashed · Unresolved | Device tags repeat across sheets | Generic component illustrations

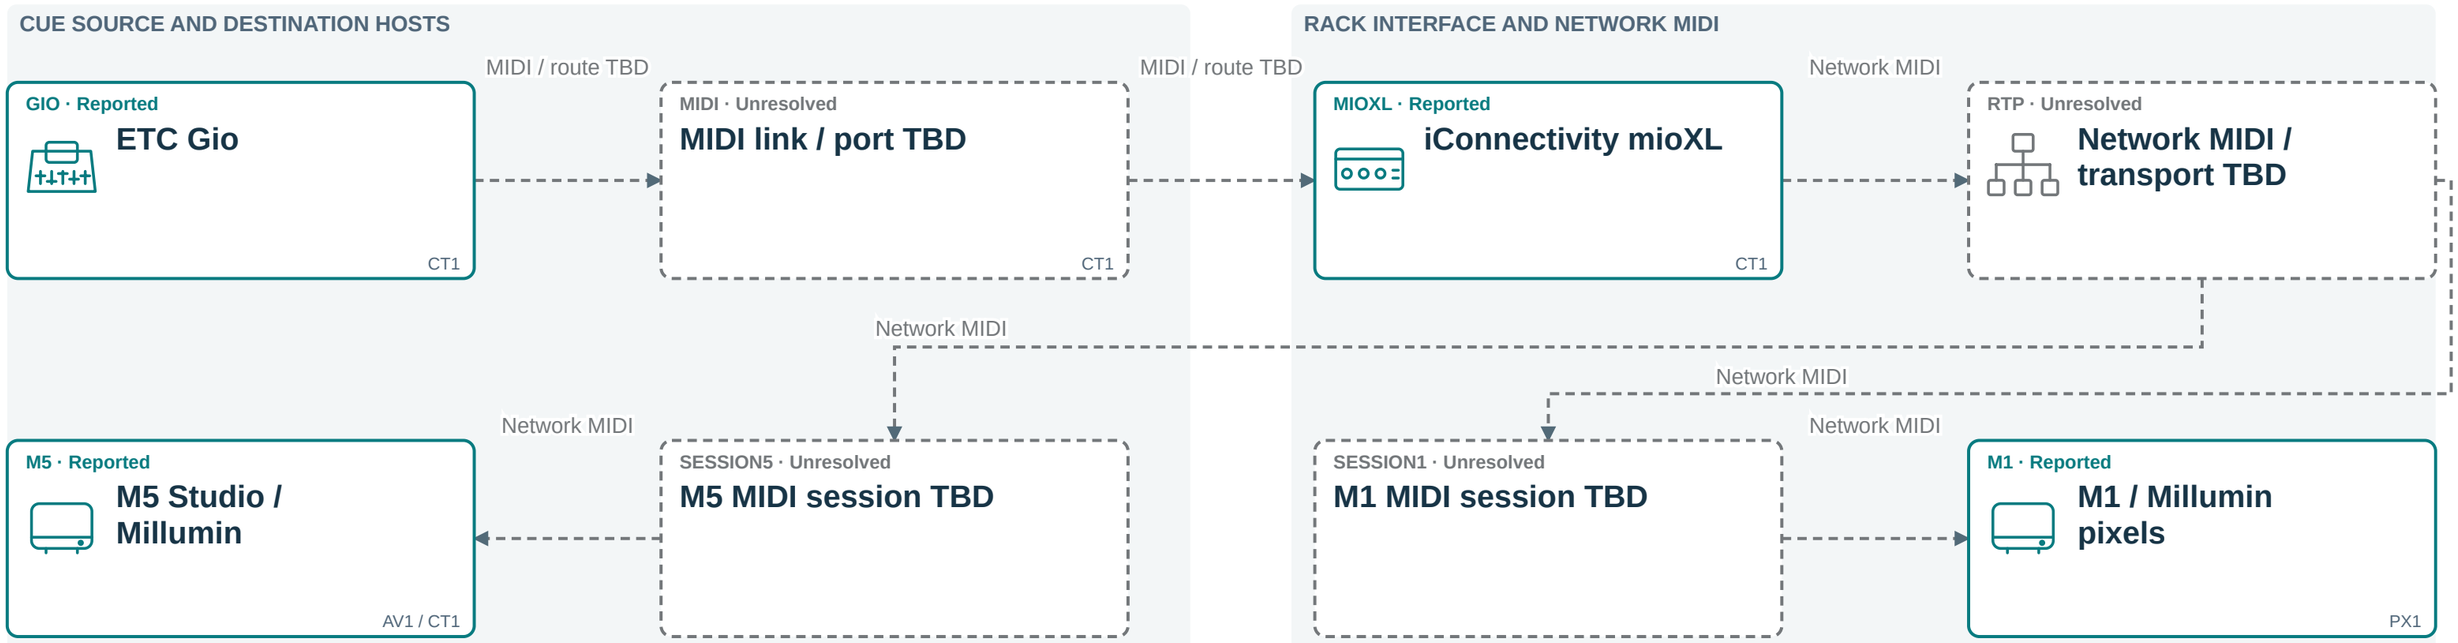

Cue routing record

Destination	mioXL port / session	Channel / note
M5 / Millumin / AV1 + CT1	TBD / TBD	TBD / TBD
M1 / Millumin / PX1	TBD / TBD	TBD / TBD

Field verification and acceptance

Check	State	Owner / date
Trace Gio physical connection and mioXL ports	Pending	TBD / TBD
Read network transport, session names and reconnect behavior	Pending	TBD / TBD
Witness one coordinated cue and audio-safe recovery	Pending	TBD / TBD

Millumin on the M1 drives pixels. Millumin on the M5 drives the four projector picture feeds.
The mioXL photo confirms model identity; it does not confirm the routed ports or active sessions.
A1/audio cue dependencies and coordinated cue replay remain to confirm with the house team.


Source SHA-256 a94c97956b5f655a162b9e8a0bd46df8b3aba09eead1277a09a75077d78317c4 · Graph Explorer d94683f599c3d1aaa62cd31b40b3a3c701e2d1ee

CT1 / Projector commands and monitoring

PJLink for A/B/D, Pulse JSON-RPC or PJLink for C, and the Projctl manual/monitoring path, independent of picture transport.

R4 · 2026-11-13
Documentation reconciliation

Solid teal · Reported | Solid slate · Documented | Amber dashed · Planned | Gray dashed · Unresolved | Device tags repeat across sheets | Generic component illustrations

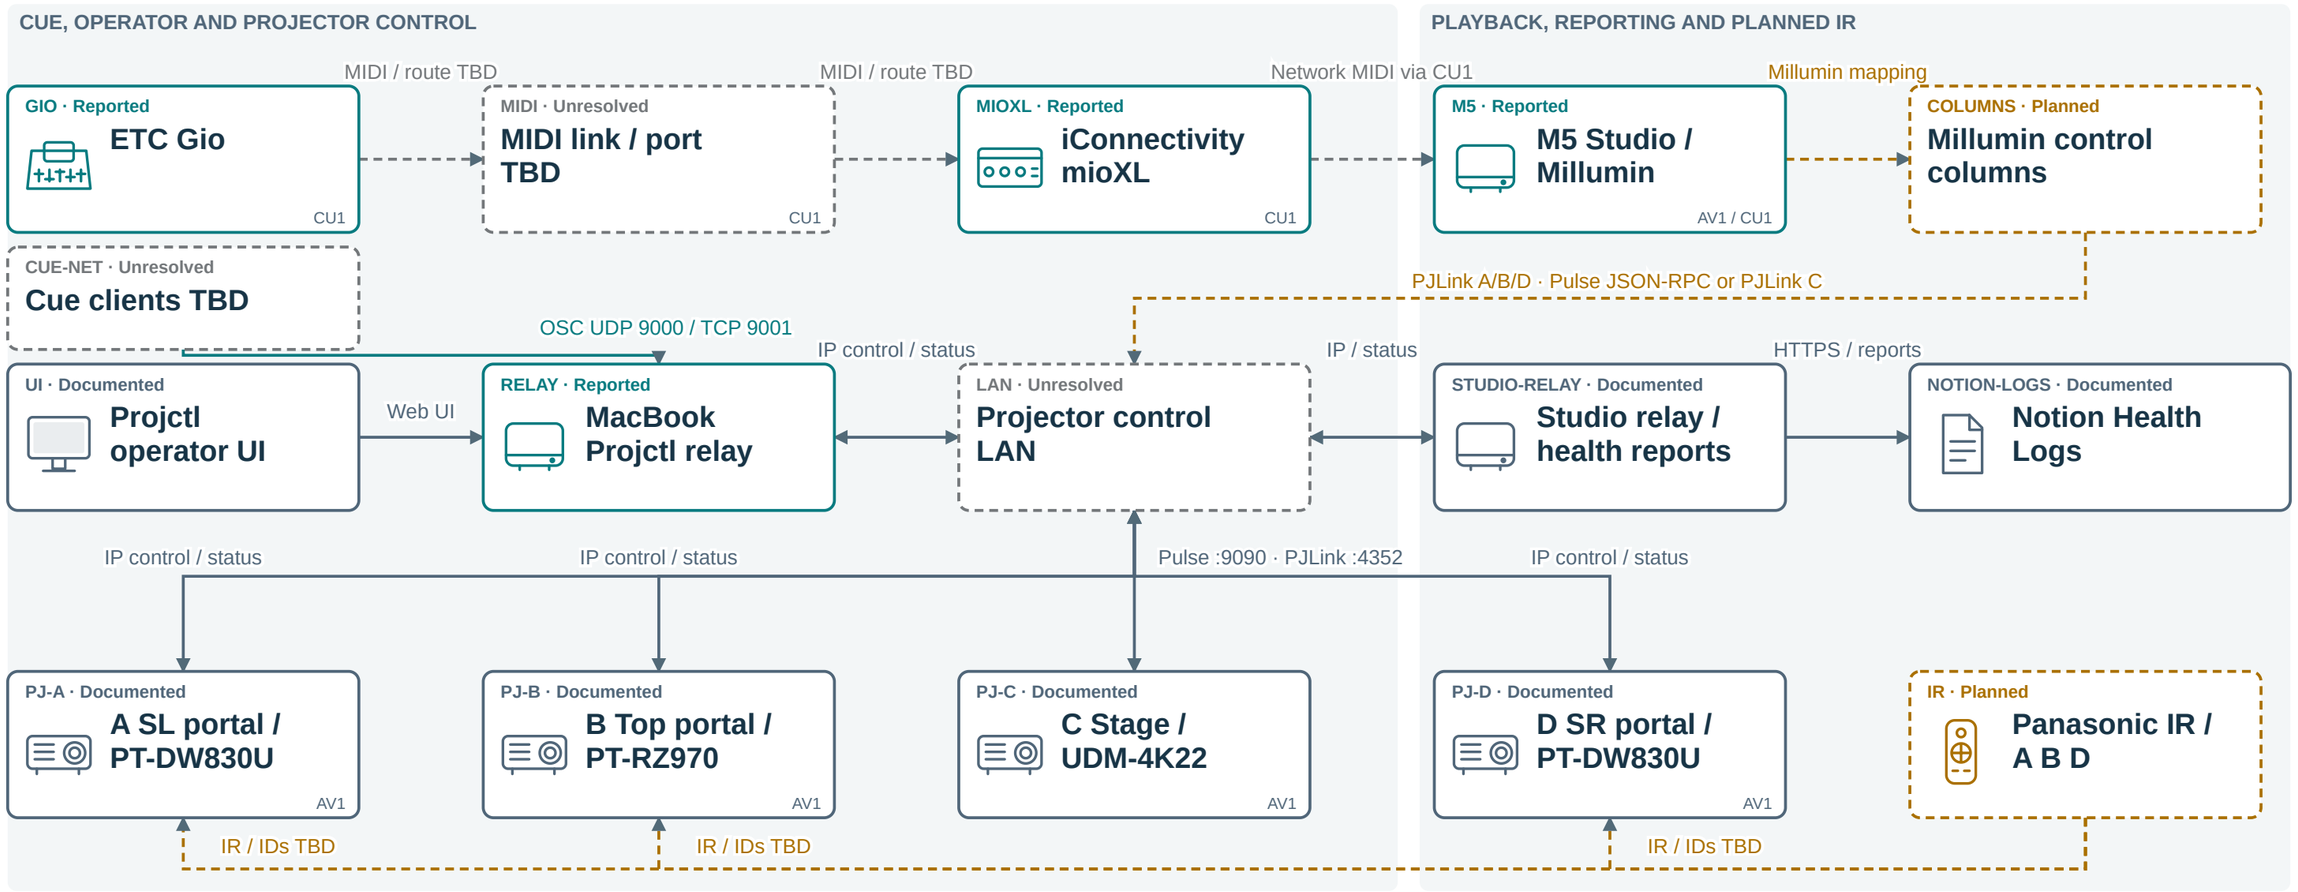

Projector control addresses

Tag / surface	IP address	Command route
PJ-A / SL portal	Private LAN	PJLink :4352
PJ-B / Top portal	Private LAN	PJLink :4352
PJ-C / Stage	Private LAN	Pulse :9090 / PJLink :4352
PJ-D / SR portal	Private LAN	PJLink :4352

Access record

Field	Readback
Recorded control endpoint	MacBook / Private LAN :8080
Studio reporting cadence	60 s selected; application pending
LAN switch / ports	TBD
IR remote IDs	TBD

Field verification and acceptance

Check	State	Owner / date
Confirm active relay arrangement and live endpoints	Pending	TBD / TBD
Verify power/shutter per lane; record C route (Pulse or PJLink)	Pending	TBD / TBD
Record Show Lock scope and approved cue recovery	Pending	TBD / TBD
Read cue listener source restrictions and approved hosts	Pending	TBD / TBD

LAN links carry outbound commands and returning status. The drawing does not establish current telemetry.
C records Pulse JSON-RPC :9090 and PJLink :4352. The saved Current Rig file uses Pulse. Validate both routes independently and record the selected route and resulting state for each cue.
Projctl Show Lock applies to its own command path. Independently issued Millumin projector commands (PJLink or Pulse) remain separate.
November 13 hub records both relays. MacBook is the selected control surface; Studio 60 s polling is a pending change. Read current settings before use.


Source SHA-256 a94c97956b5f655a162b9e8a0bd46df8b3aba09eead1277a09a75077d78317c4 · Graph Explorer d94683f599c3d1aaa62cd31b40b3a3c701e2d1ee

PX1 / Pixel data and addressing

R4 · 2026-11-13
Documentation reconciliation

Recorded Millumin Art-Net unicast target Private LAN (the November 7 OCTO bench address); LeDMX2 IP readback pending. Two recorded 300-cell RGBW lines.

Solid teal · Reported | Solid slate · Documented | Amber dashed · Planned | Gray dashed · Unresolved | Device tags repeat across sheets | Generic component illustrations

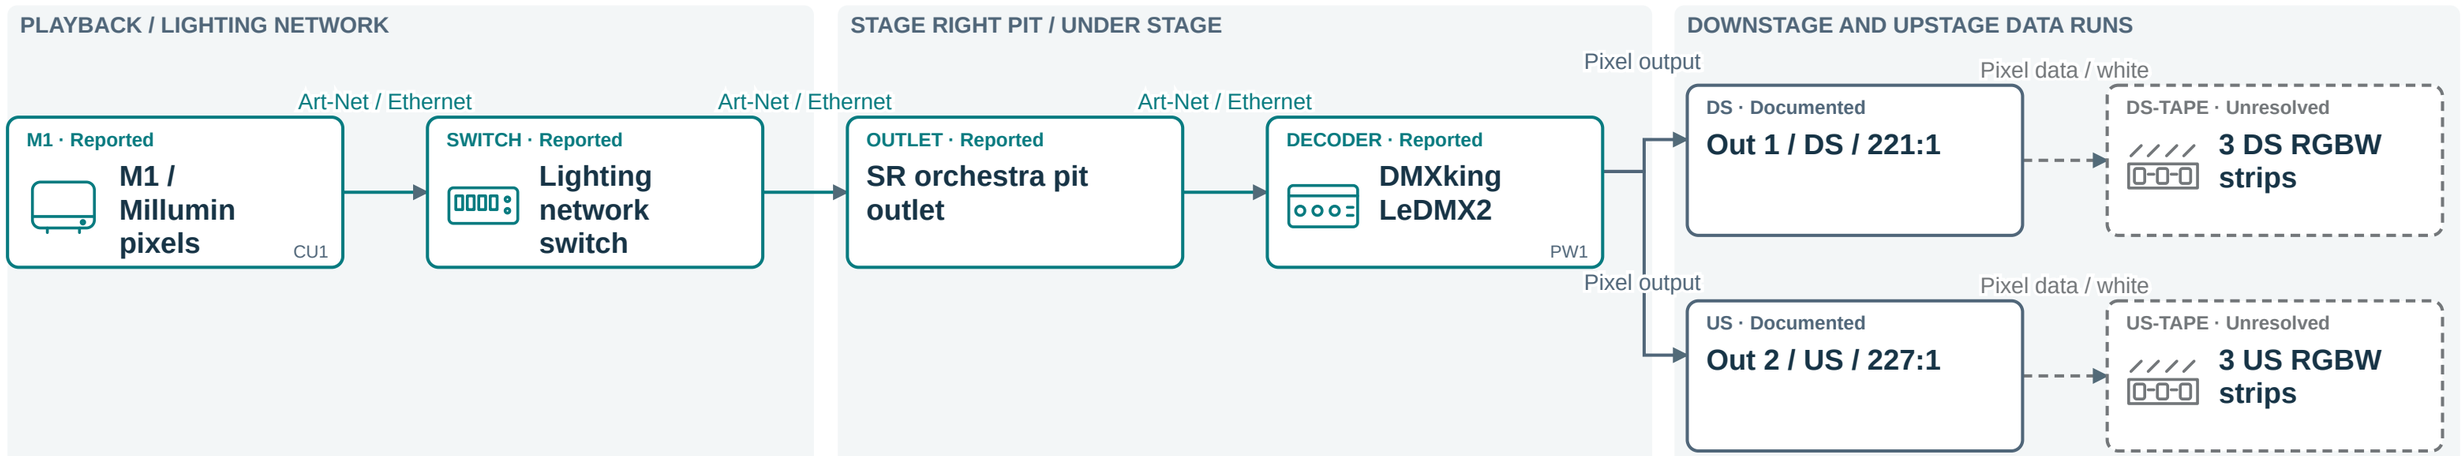

Port 1 / DS patch / 221:1 to 223:176

Slice	Cells / channels	Start	Physical strip(s)
DS 1	48 / 192	221:1	TBD
DS 2	52 / 208	221:193	TBD
DS 3	50 / 200	221:401	TBD
DS 4	50 / 200	222:89	TBD
DS 5	50 / 200	222:289	TBD
DS 6	50 / 200	222:489	TBD

Port 2 / US patch / 227:1 to 229:176

Slice	Cells / channels	Start	Physical strip(s)
US 1	50 / 200	227:1	TBD
US 2	50 / 200	227:201	TBD
US 3	50 / 200	227:401	TBD
US 4	50 / 200	228:89	TBD
US 5	50 / 200	228:289	TBD
US 6	50 / 200	228:489	TBD

Installed physical strips

Run	Quantity	Labels / lengths / direction
Downstage	3 reported	TBD / TBD / TBD
Upstage	3 reported	TBD / TBD / TBD

Field verification and acceptance

Check	State	Owner / date
Read LeDMX2 IP, firmware, port settings and numbering	Pending	TBD / TBD
Trace six physical strips to the twelve slices	Pending	TBD / TBD
Witness RGBW order, white, blackout and restore	Pending	TBD / TBD


Bench reel label: ENTTEC 8PXB60-RGBW-12V-W; installed strips not yet matched. Three physical LEDs per RGBW cell; four channels per cell. A full 5 m reel has 100 cells / 400 channels.
Each port has 300 cells / 1200 channels. Universe remapping is recorded off; installed numbering requires readback.

PW1 / Pixel power and unresolved feeds

Recorded two-supply arrangement and explicit controller power gap.

R4 · 2026-11-13
Documentation reconciliation

Solid teal · Reported | Solid slate · Documented | Amber dashed · Planned | Gray dashed · Unresolved | Device tags repeat across sheets | Generic component illustrations

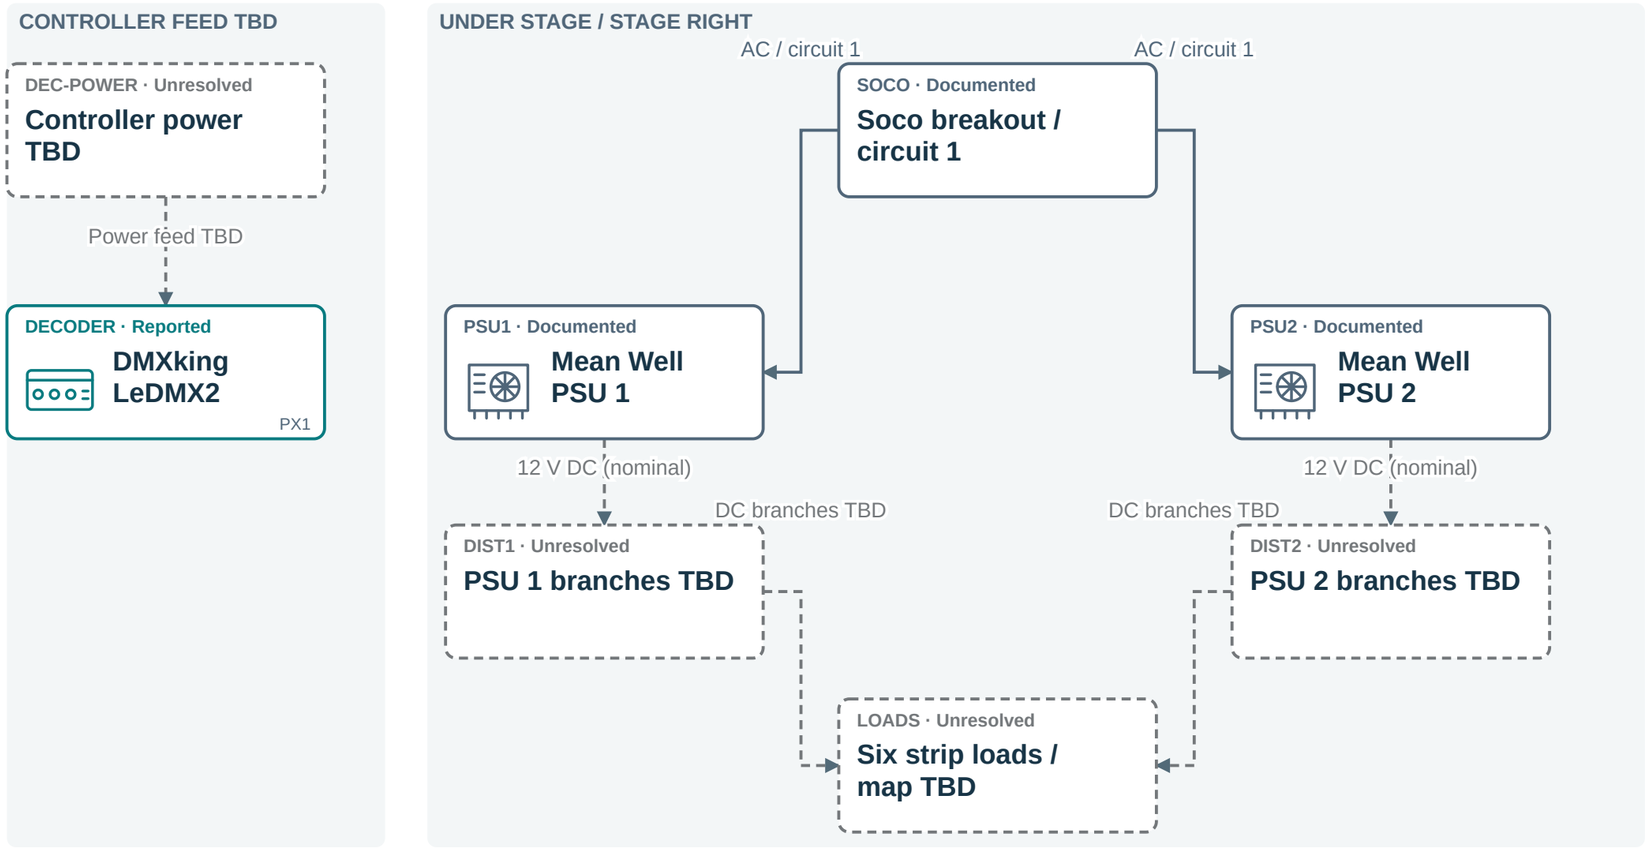

Power trace record

Field	PSU 1	PSU 2
Nameplate model	TBD	TBD
Recorded output	12 V / nominal 350 W	12 V / nominal 350 W
AC circuit	Soco circuit 1 reported	Soco circuit 1 reported
Switch / isolation point	TBD	TBD
DC branches / strip labels	TBD	TBD
Branch fuses / ratings	TBD	TBD
Wire / connector ratings	TBD	TBD
Injection / return routing	TBD	TBD

Controller feed

Field	Readback
Source / voltage / protection	TBD
Ground reference / isolation	TBD

Field verification and acceptance

Check	State	Owner / date
Record electrician inspection outcome	Pending	TBD / TBD
Trace each DC branch, return and injection point	Pending	TBD / TBD
Confirm controller power and intended maximum load	Pending	TBD / TBD

Decoder and supplies recorded under stage, wall-mounted stage right at the far side of the orchestra pit.
Separate branch nodes avoid implying paralleled PSU outputs. Actual strip assignments and returns require tracing.
Notion retains an unresolved electrician inspection item for exposed strands at PSU terminals.
Signal schematic, not to scale. Electrical capacity, protection and operational acceptance remain open.

Revision history R1 · Historical · Five-sheet Graph Explorer issue. Earlier Revision 0 and v0.2 retained as history. | R2 · 2026-11-13 · DMXking LeDMX2 identity and complete recorded control paths | R3 · 2026-11-13 · Ten handoff updates, enlarged diagrams and component illustrations | R4 · 2026-11-13 · Dual C routes, qualified pixel evidence, cue listener, field check IDs and documentation reconciliation

Source SHA-256 a94c97956b5f655a162b9e8a0bd46df8b3aba09eead1277a09a75077d78317c4 · Graph Explorer d94683f599c3d1aaa62cd31b40b3a3c701e2d1ee

FROZEN / WALNUT STREET THEATRE

Crew release and readiness

Date / time

Crew operator / stage witness

Released by / expiry

Permitted feeds / events

Stop / rollback owner

Evidence / results folder

Before interruption

Identify approved show files, backups and the active control endpoint. Record the separate reporting endpoint. Confirm Studio Python 3.9+, Screen Check/profile and the suite. The crew runs the pre-show check. Agree the cue, opening look, reset and audio coordination.

MacBook control relay / build

Studio reporting relay / actual cadence

OSC UDP 9000 / TCP 9001 source restriction readback

Approved show files / backup location

Open service gates

Lane A / SL portal Lamp 2 and portal tilt findings need a current service disposition.

Lamp / alignment contact and outcome

Ready to begin? YES / NO Confirmed by _____

Baseline and evidence

Four-lane baseline

Lane / surface	Mac mode / Hz	Projector mode / Hz	Port / adapter	Millumin destination
A / SL portal				
B / top portal				
C / stage				
D / SR portal				

Control monitor / refresh

BetterDisplay settings / ATEN baseline

> Record physical A/D identity. The direct-HDMI baseline and each ATEN retention test need separate evidence.

Mapping / image / focus / rotation / coverage observations

Suite evidence keys

ID	Scope
backup	rig
mapping	A/B/C/D

Original EDIDs / overrides / show-file backup

Physical mapping witness / timestamp

Control and temperature

Cue / MIDI message / channel

Interface ports / sessions / destinations

Opening look / reset

Lighting / audio witnesses

A/B/D use PJLink :4352. C records Pulse JSON-RPC :9090 and PJLink :4352. The saved Current Rig file uses Pulse. Record the actual route for every tested cue. The suite key **pjlink** is the existing command-check ID.

Lane	Command route / target	Power / shutter result	Image / cue result	P / F / NT
A				
B				
C				
D				

Temperature and alarms

Lane	Time / source	Reading / sensor	Configured limit / basis	Flags / missing data
A				
B				
C				
D				

Record the configured limit and its basis. The historical 40 °C portrait proposal and 45 °C model default differ. Missing measurements and unidentified sensors remain unknown.

Recovery and sign-off

Released recovery events

Suite ID / event	Before / after evidence	Lane results A–D	Automatic / manual
reboot / Studio restart			
standby / Studio sleep and wake			
usb / USB reconnect			
hdmi / HDMI reconnect			
shutdown / projector off, cooldown, startup			

Projector standby belongs to the shutdown observation. Logout/login and other released events are supplementary attachments. The suite has no separate required ID for them.

Configuration and restoration

Suite ID	Evidence / result
preset / each lane	
betterdisplay / rig	
aten / each lane	
show-restored / rig	

Shutdown report and delivery

Actual power-off time / observed state

Report kind / timestamp / linked event

Report publisher / capture endpoint

Notion or other destination / readback

> The current suite accepts power-off or relay-stop report kinds. A relay restart alone leaves actual projector shutdown unproven. Record the power-off observation and linked report for field sign-off. Treat the software acceptance-rule correction as open.

Failure / manual repair / retest evidence

Final show state / witness

Open issue / owner / next action / unresolved acceptance

Overall P / F / NT _____ Operator _____ Witness _____

P = pass, F = fail, NT = not tested. Manual repair remains a failed automatic-recovery attempt. Retain earlier failures and complete per-lane results.

Acceptance results and handoff

Date / time _____

Crew operator / stage witness _____

Released by / expiry _____

Permitted feeds / events _____

Stop / rollback owner _____

Evidence / results folder _____

Check ID	Scope / observation	P / F / NT	Evidence
backup	rig / Original EDIDs, overrides, show files and mapping backed up		
mapping	A–D / Physical surface, port and Millumin destination witnessed		
midi	A–D / Exact cue/message and response recorded		
pjlink	A–D / Projector command path; record Pulse or PJLink for C		
preset	A–D / Agreed preset/look and restoration witnessed		
temperature	A–D / Full report, sample time, limit basis and faults		
shutdown	A–D / Actual power-off/cooldown/startup state witnessed		
reboot	A–D / Studio reboot and automatic recovery		
standby	A–D / Studio sleep/wake and automatic recovery		
usb	A–D / USB reconnect and automatic recovery		
hdmi	A–D / HDMI reconnect and automatic recovery		
betterdisplay	rig / Login startup and protection settings		
aten	A–D / Model, position, learned source and retention		
shutdown-report	rig / Report trigger matched to actual shutdown evidence		
delivery	rig / Expected destination and human readback		
show-restored	rig / Opening/show state restored and witnessed		

Open issue / owner / next action / unresolved acceptance

Overall P / F / NT _____ Operator _____ Witness _____

P = pass, F = fail, NT = not tested. Manual repair remains a failed automatic-recovery attempt. Retain earlier failures and complete per-lane results.

Report source reference key

Companion to the five-page illustrated report. Numbered citations in that report use this key. The source audit contains statement-level evidence and original image paths.

[1] Frozen project hub
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[2] House Show Operations Guide
https://app.notion.com/p/416255fc8f44804983b4c3a997a717e4

[3] Projector Signal and Equipment
https://app.notion.com/p/40d255fc8f448089a269d124a1c204c3

[4] House Handoff Walkthrough
https://app.notion.com/p/0ea774b6d7c74c459f957d6223ca18ff

[5] Signal Flow revision record
https://app.notion.com/p/417255fc8f448094844fc84804ea8a30

[6] Operations Notes for November 12
https://app.notion.com/p/416255fc8f44808db3afcd6183cec227

[7] Cue map action
https://app.notion.com/p/416255fc8f4481fe964de23540ed082c

[8] Pixel Driver record
https://app.notion.com/p/417255fc8f44802e88fbe2e1535af1dd

[9] Pixel Strips record
https://app.notion.com/p/417255fc8f4480fa8e37d0166dee3e48

[10] Pixel PSU record
https://app.notion.com/p/417255fc8f448013b632d815a2794bf2

[11] Editable Signal Flow R4 source
https://app.notion.com/p/417255fc8f448094844fc84804ea8a30

[12] ATEN VC081A manufacturer specification
https://assets.aten.com/product/spec_sheet/vc081a-converter-ds-en.pdf

[13] Millumin Data-track documentation
https://help.millumin.com/docs/connect/datatrack/

[14] Millumin Interactions documentation
https://help.millumin.com/docs/connect/interactions/

[15] Panasonic PT-DW830 manufacturer specification
https://na.panasonic.com/ns/246000_dw830_spec_en.pdf

[16] StarTech KVM definition
https://www.startech.com/en-gb/faq/kvm-switchs-what-is-a-kvm-switch

[P1] Stage setup photograph
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[P2] Front-elevation projection plot
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[P3] Barco body photograph
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[P4] Booth patch photograph
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[P5] Cove connection photograph
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[P6] Deck-channel photograph
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[P7] LED tape close-up
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[P8] Rack keyboard photograph
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[P9] ENTTEC reel label photograph
https://app.notion.com/p/410255fc8f44811c8d80c85bedbcede7

[17] Saved Current Rig command file
https://app.notion.com/p/417255fc8f448094844fc84804ea8a30