

Common questions

南方科技大学：蒋苓利
邮箱：jiangll@sustech.edu.cn

SILVACO
ENGINEERED EXCELLENCE

How to cutline

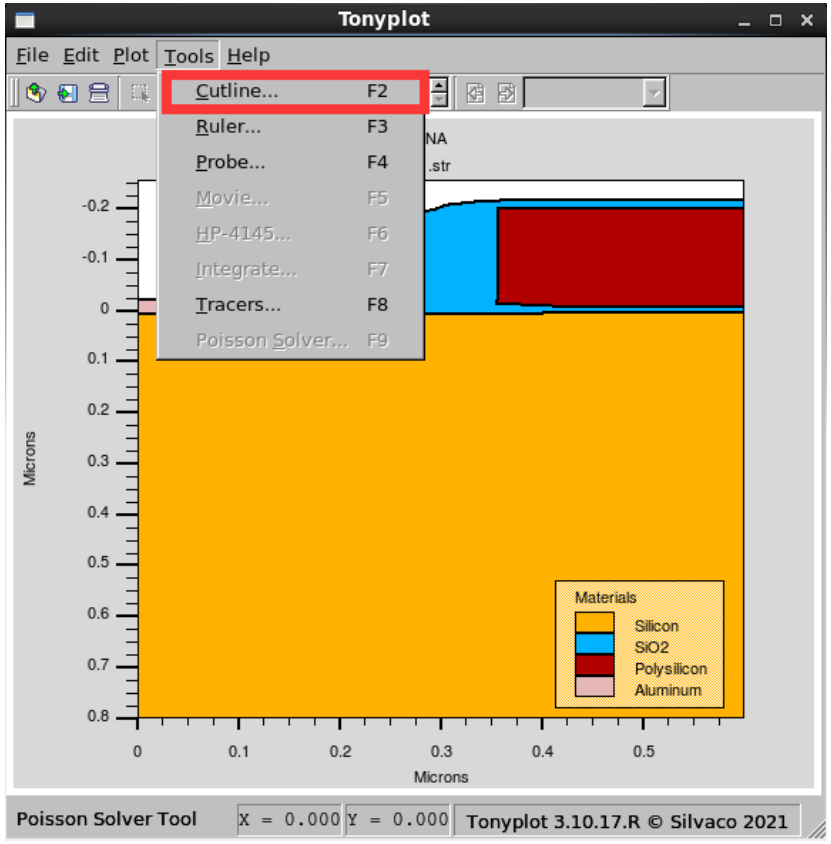


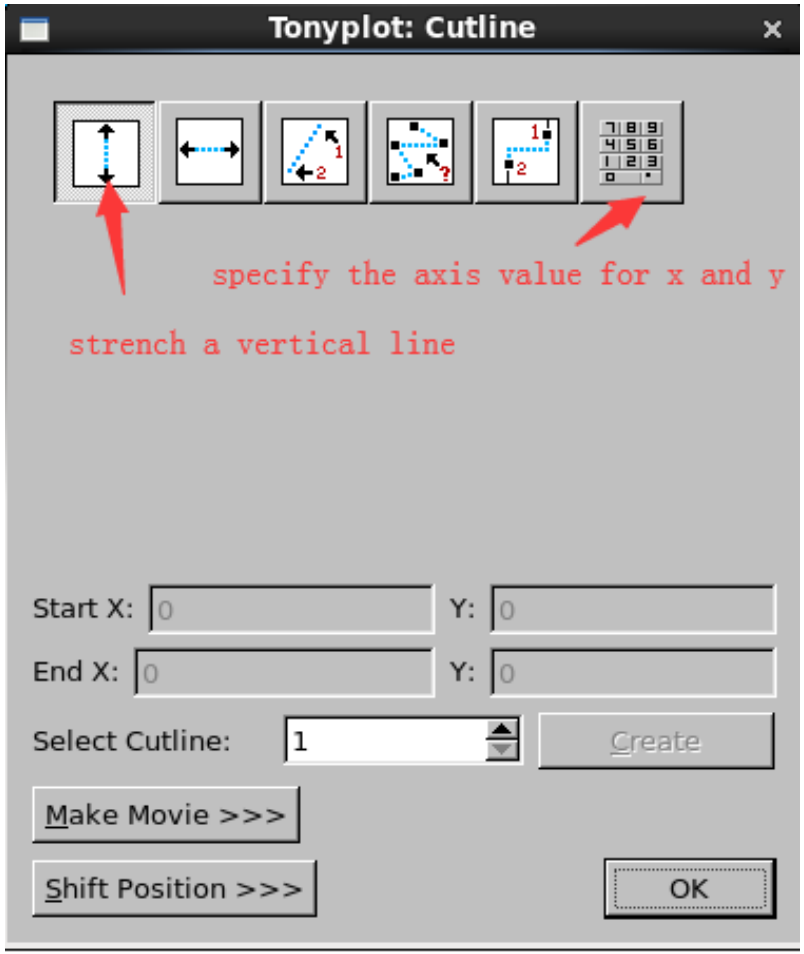



Note: if axis value for x and y is applied
You need to click Create but NOT OK

SILVACO

How to show other values for cutline

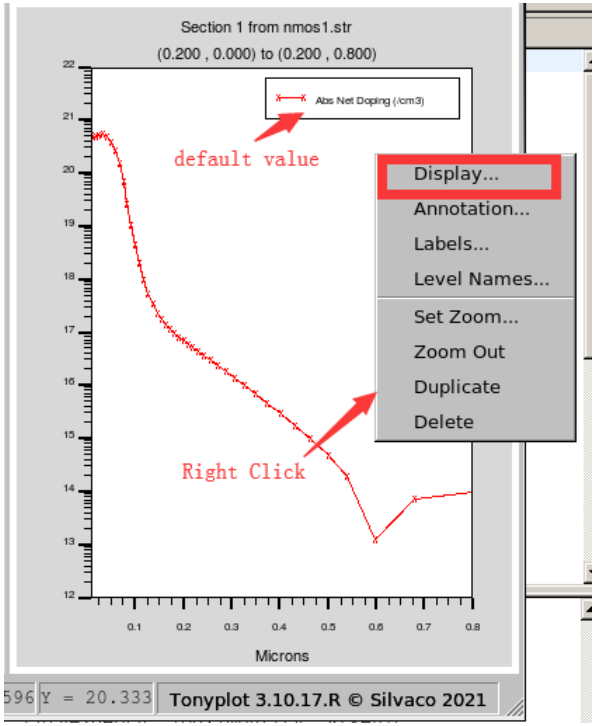


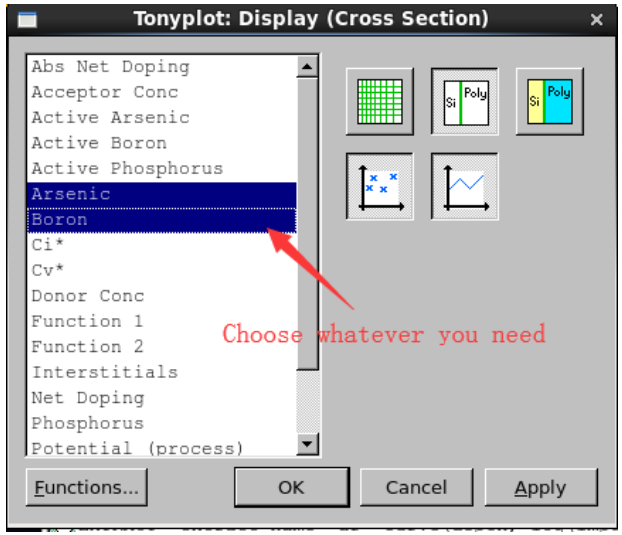


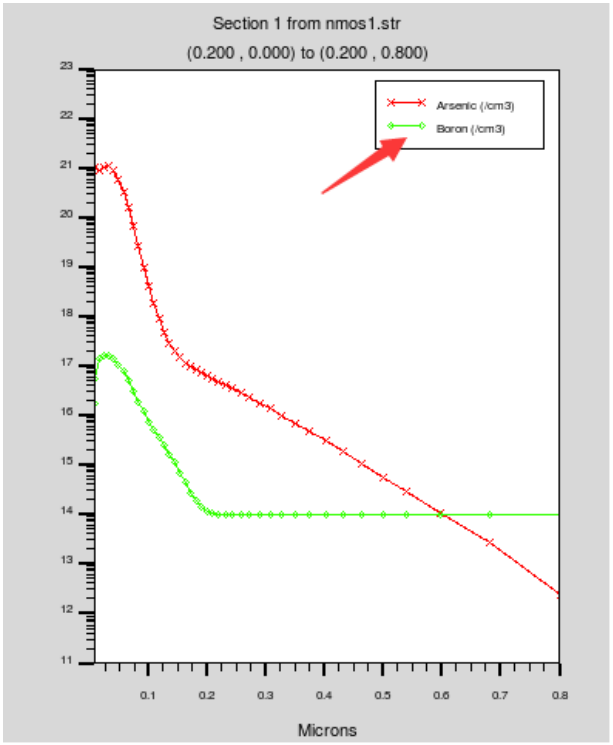


Note: you can show energy band curves with this method

How to draw log\dat curves together

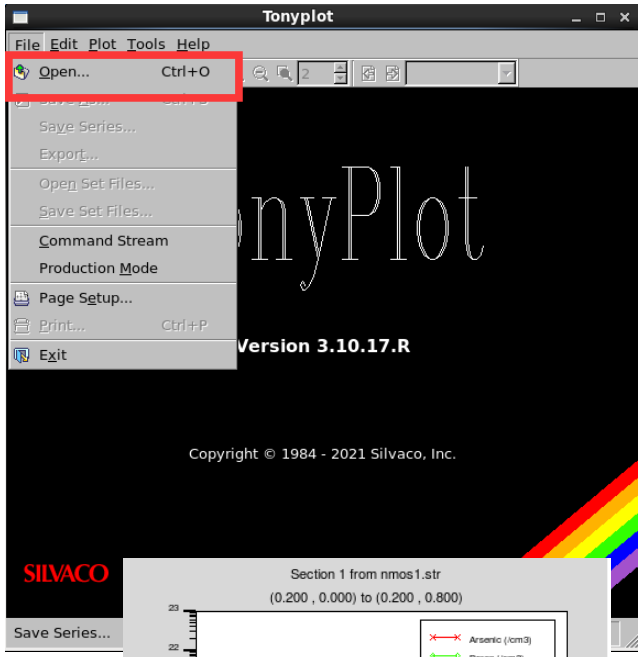


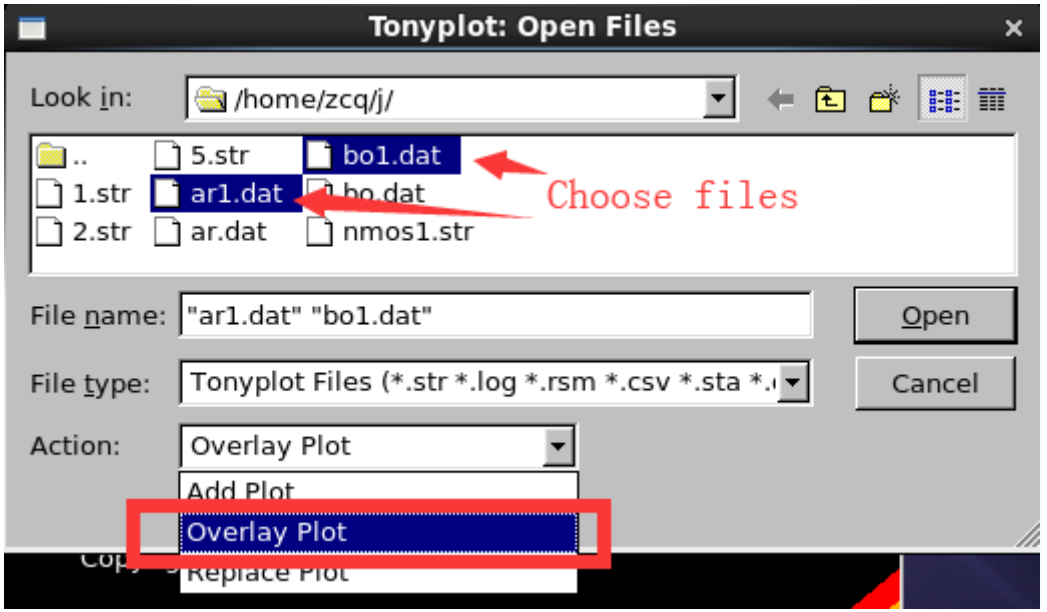


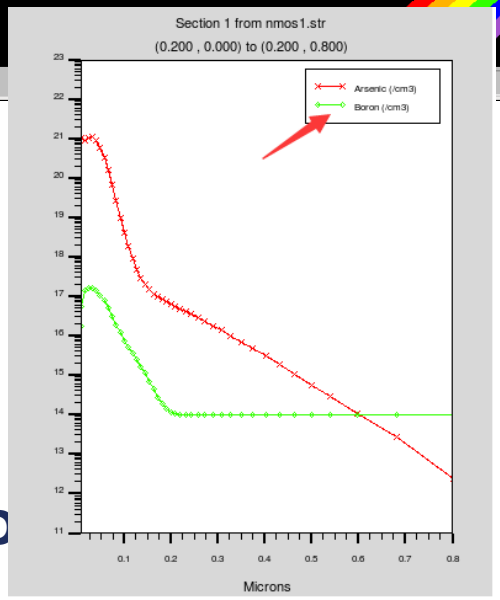



Log files can be draw together in the same way


How to draw electrical field together

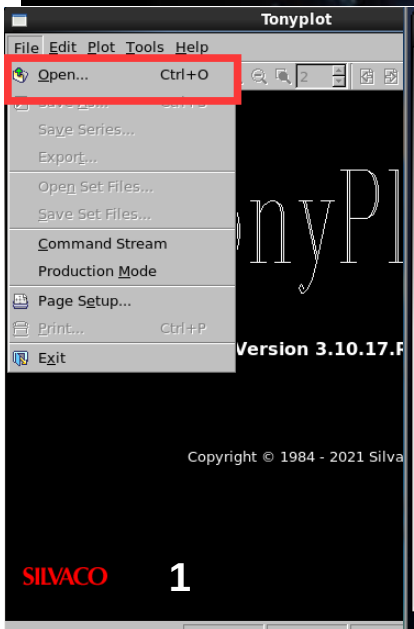


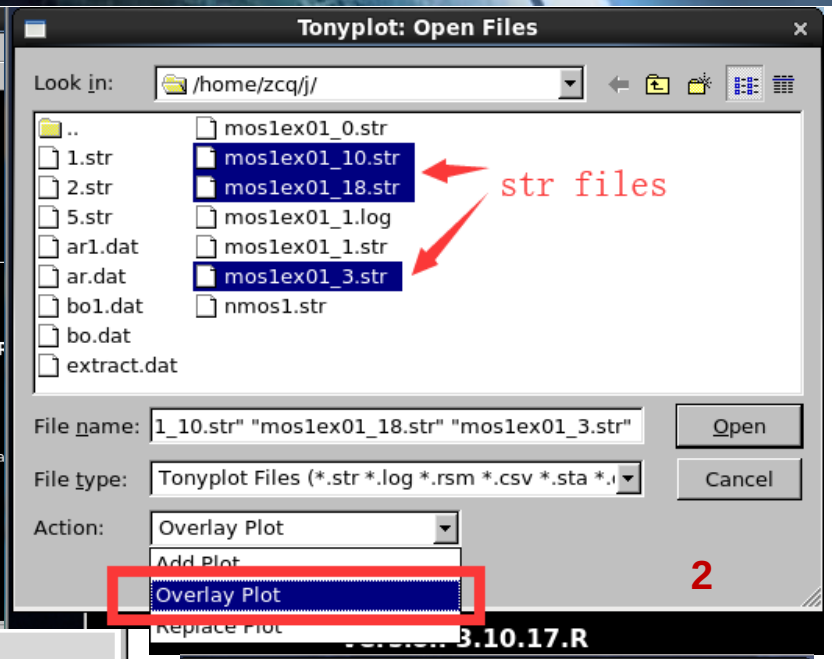

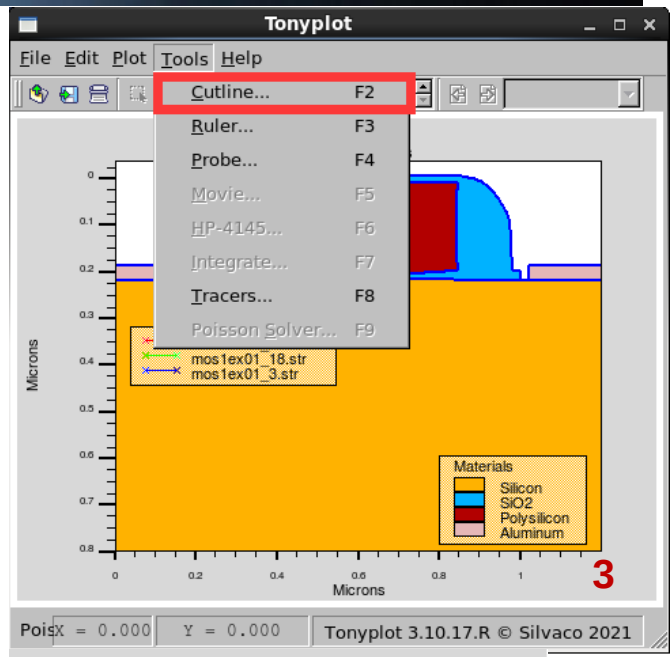

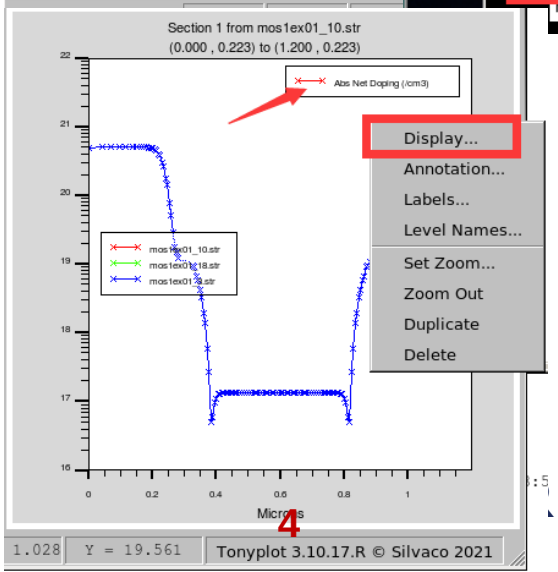

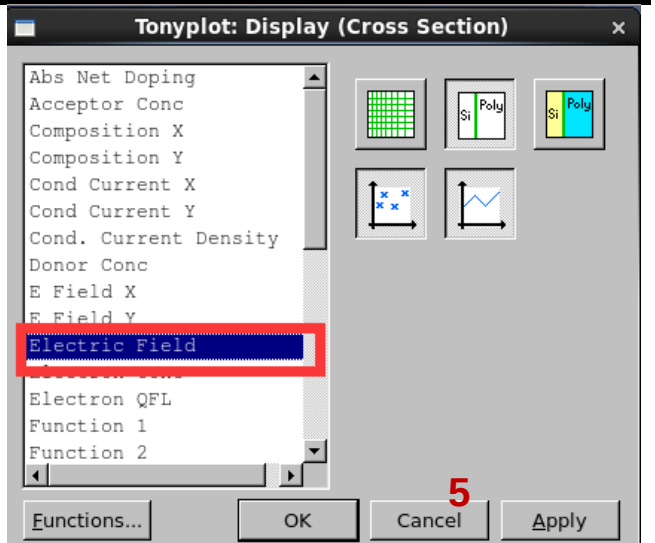

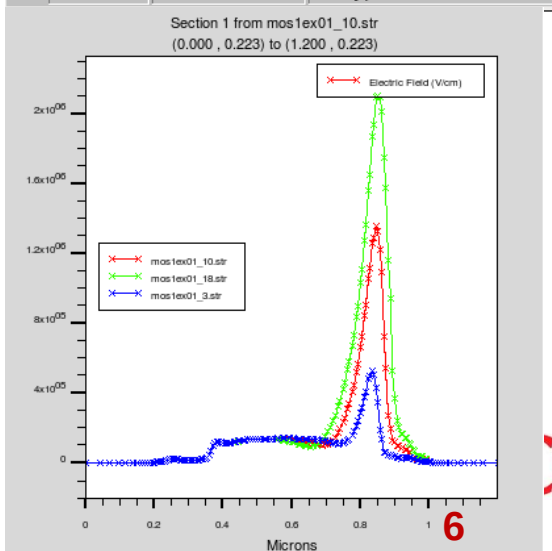



When do you need denser steps?


```
Warning: Newton algorithm did not converge in          25  iterations.


Warning: Bias step cut back more than 4
times.  Cannot trap.
```


if it's non-convergence, sometimes you need to optimize steps

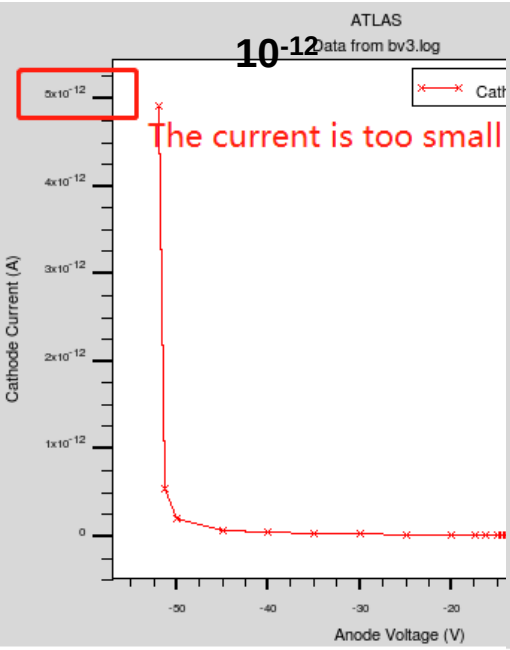

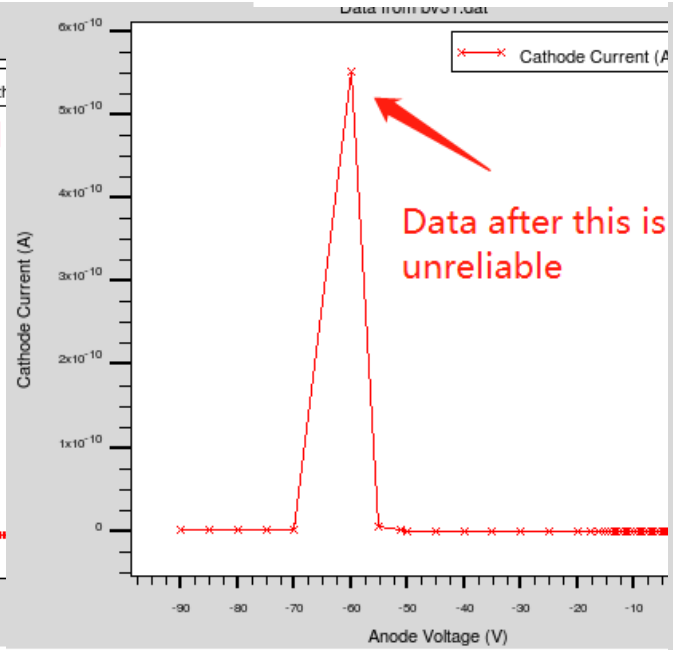

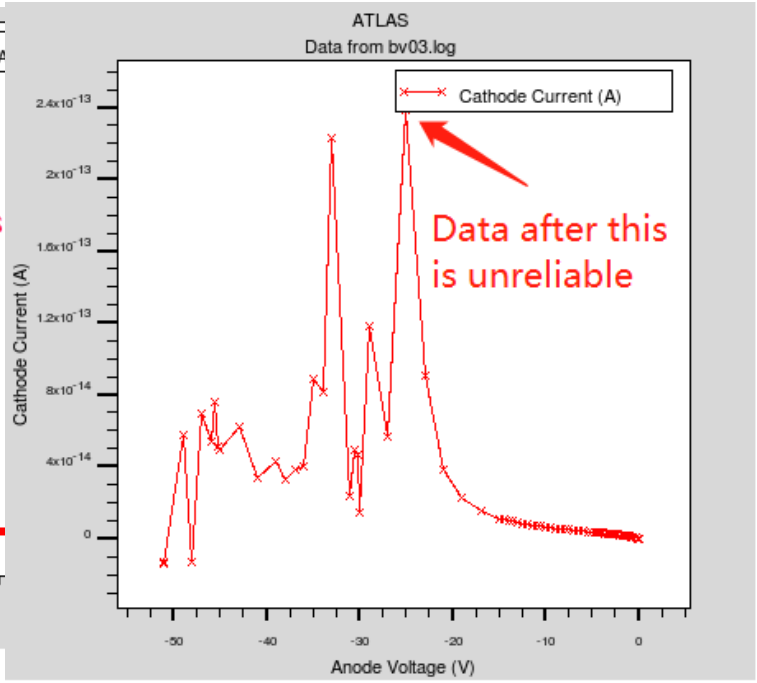

How to make steps dense

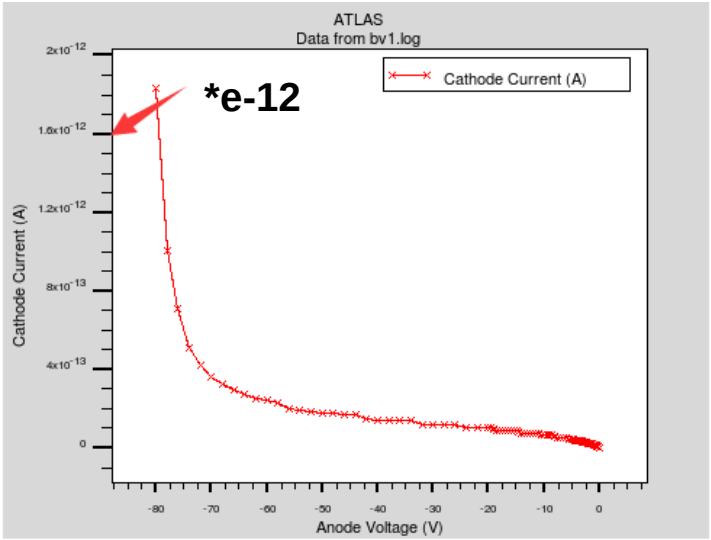



```
solve vanode=0 vstep=-0.2 vfinal=-5 name=anode
solve vanode=-5.5 vstep=-0.5 vfinal=-20 name=anode
solve vanode=-22 vstep=-2  vfinal=-80 name=anode
```





```
solve vanode=0 vstep=-0.2 vfinal=-5 name=anode
solve vanode=-5.5 vstep=-0.5 vfinal=-20 name=anode
solve vanode=-22 vstep=-2  vfinal=-70 name=anode
solve vanode=-70 vstep=-0.1  vfinal=-85 name=anode
```



Pay attention to the y axis

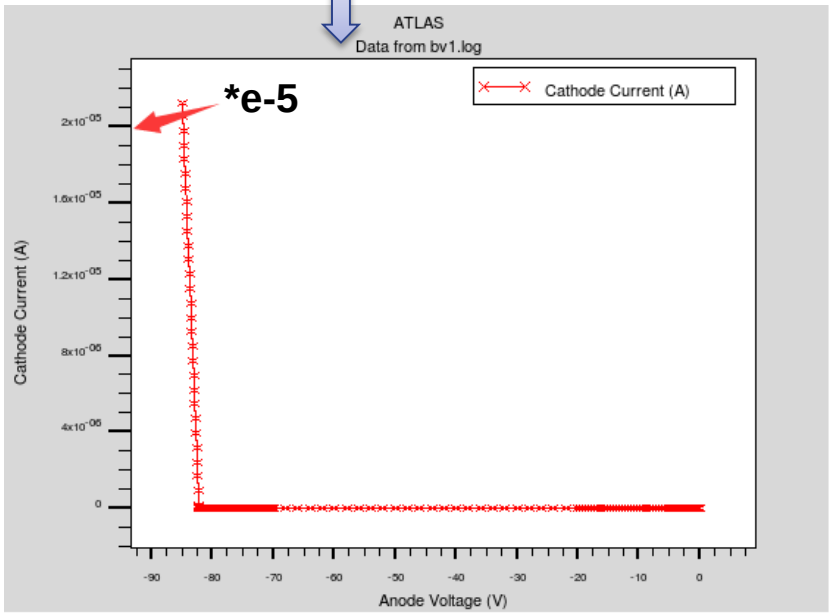



How to modify Y dispaly

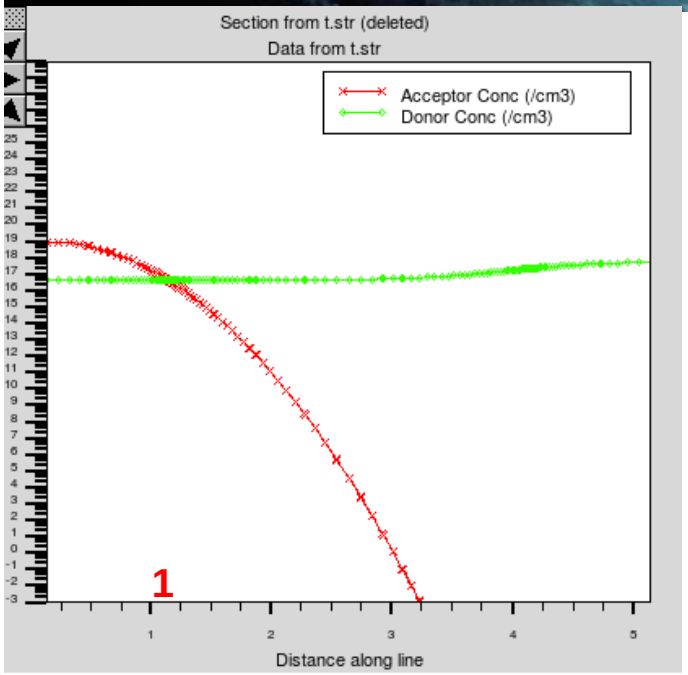

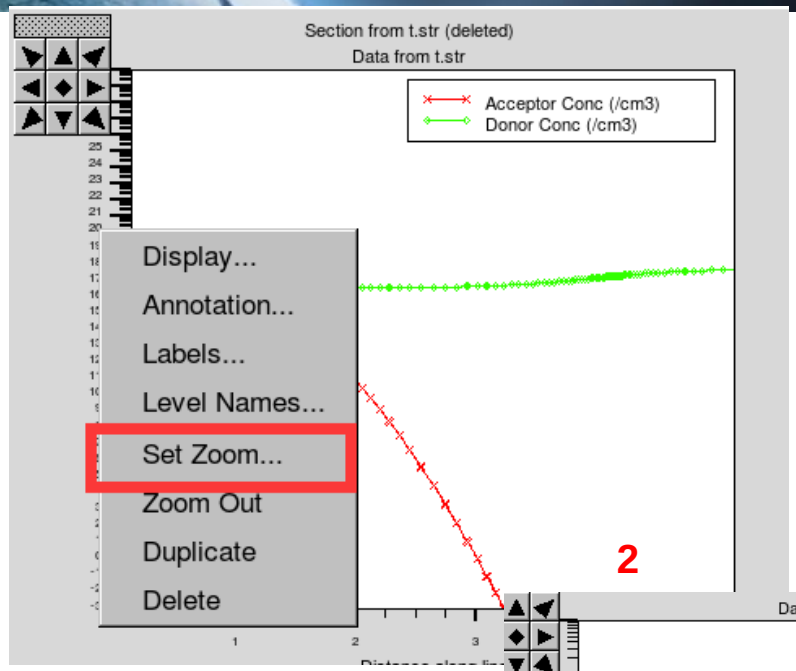


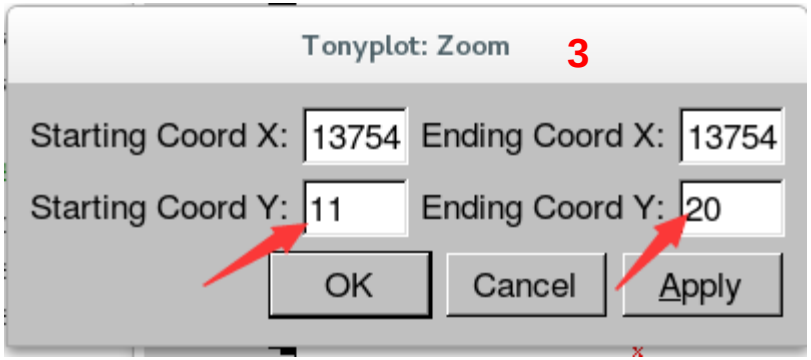

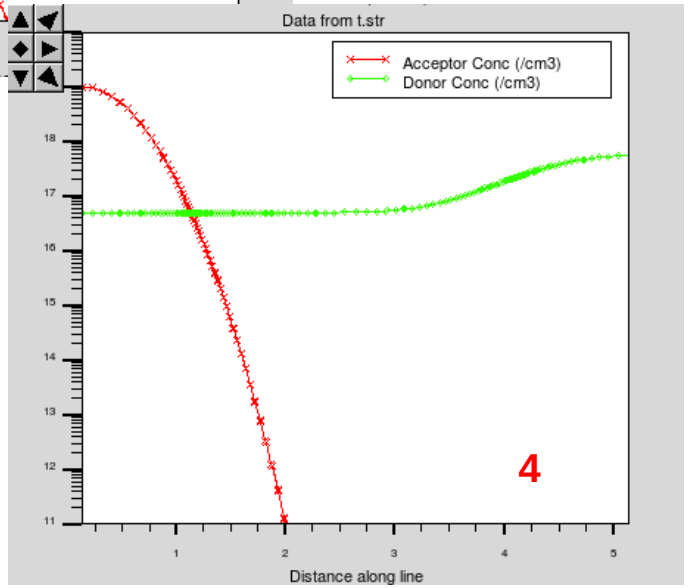

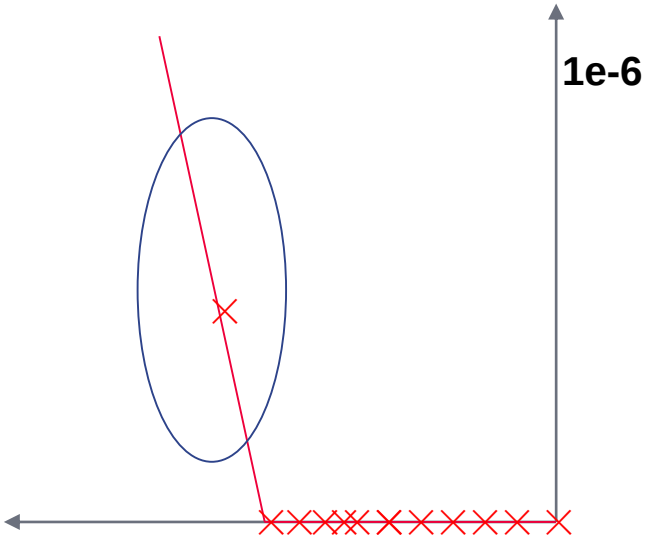

9点，反向击穿曲线
不接受可视数据点太少

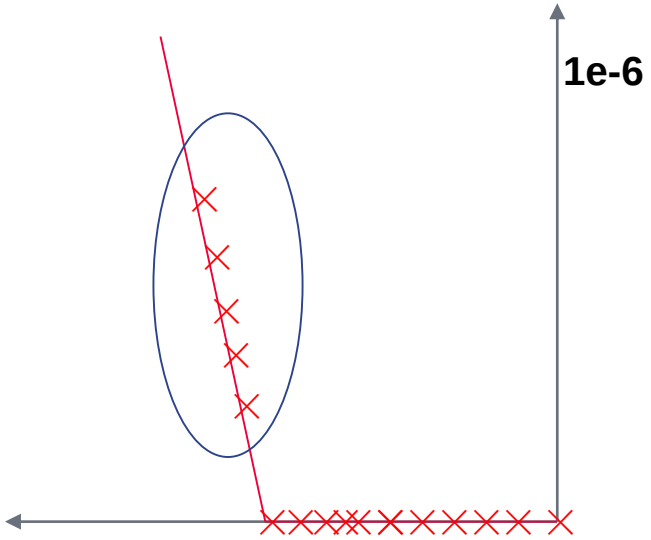


9点，反向击穿曲线
肉眼可见的电流数据点至少有5个

How to add output

models ……


method ……

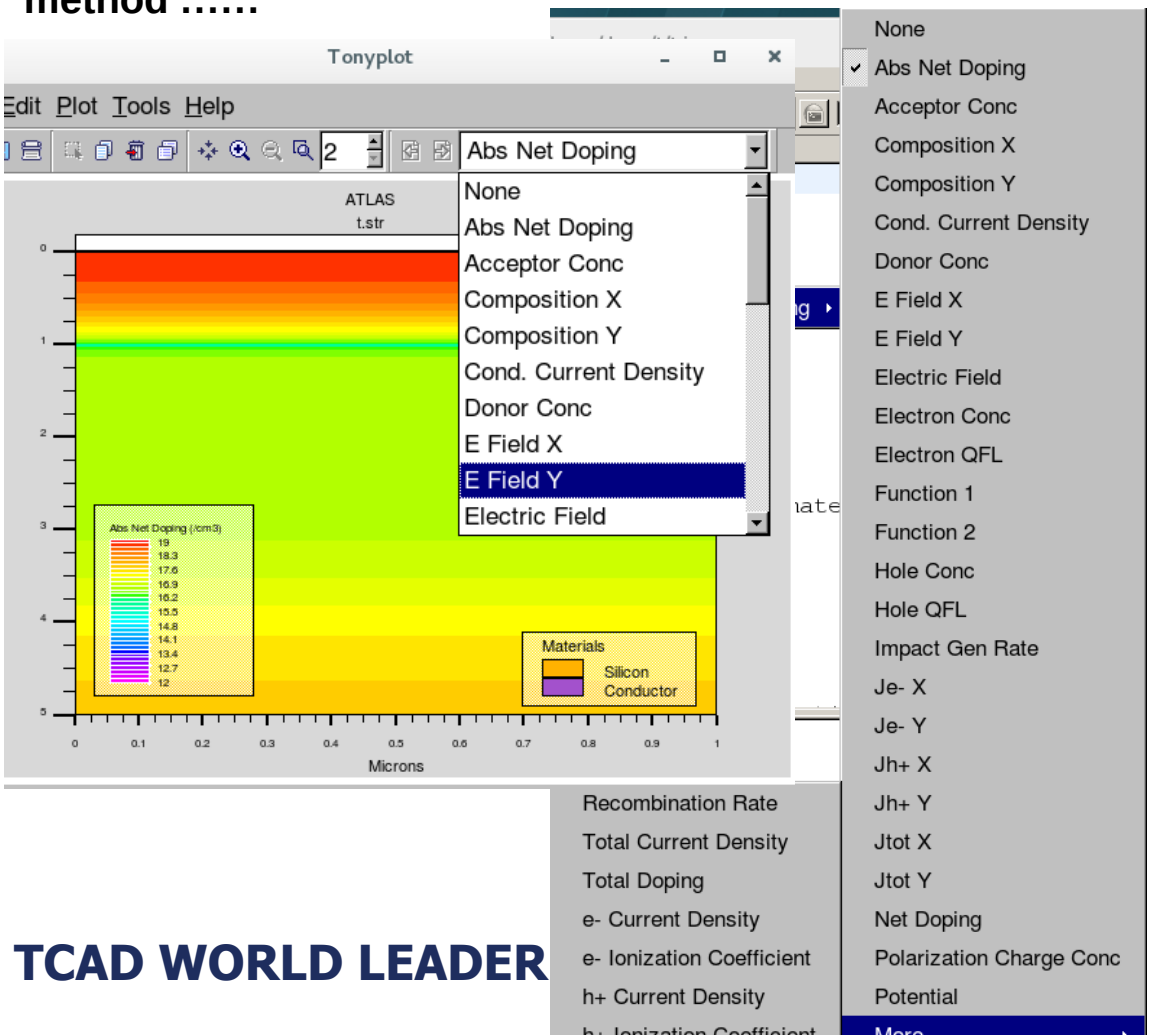


models ……

output con.band val.band

method ……

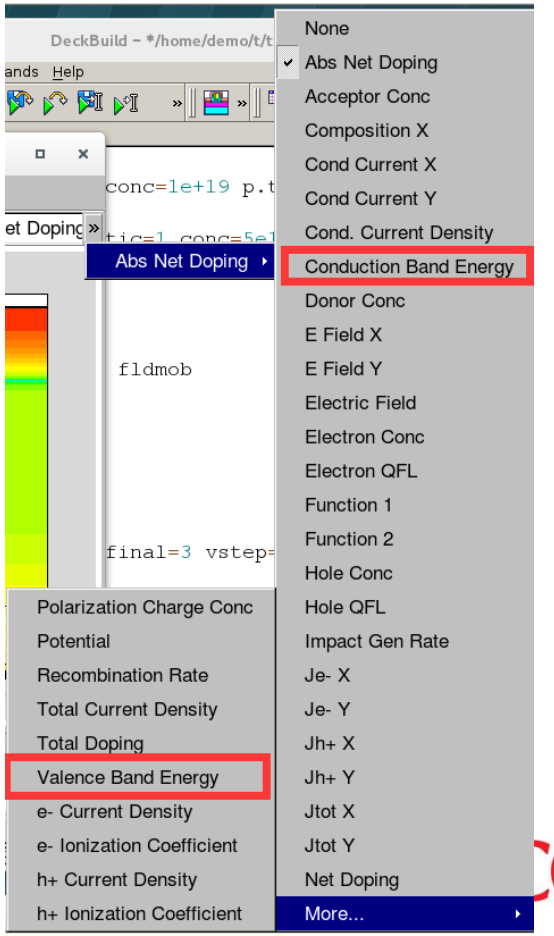


How to set global variable

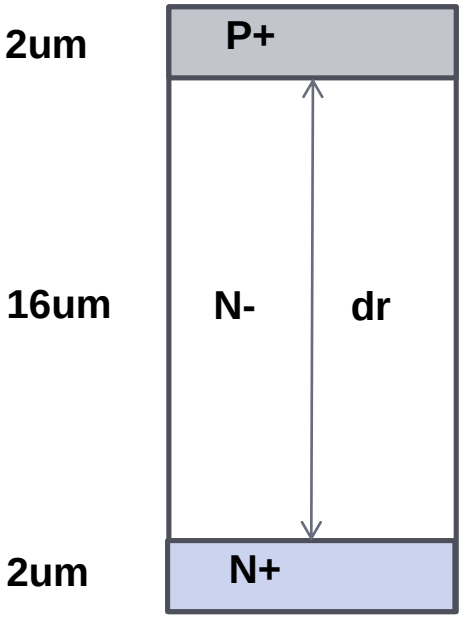


```
y.mesh loc=0 spac=0.5
y.mesh loc=2 spac=0.05
y.mesh loc=10  spac=1
y.mesh loc=18 spac=0.05
y.mesh loc=20 spac=0.5
```

set dr=16

Note: This sentence add after “go atlas”

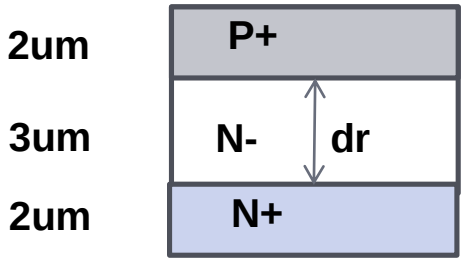


```
y.mesh loc=0 spac=0.5
y.mesh loc=2 spac=0.05
y.mesh loc=(@dr+4)/2  spac=1
y.mesh loc=@dr+2 spac=0.05
y.mesh loc=@dr+4 spac=0.5
```

Note: @ or $ are used to call the global variable