

GALĒNĒ Assembly Guide REV. 1

This document will guide you in the assembly of the Galene VCA module kit. The steps shown focus on the mechanical assembly of the Main Board and Panel. Please reference the BOM and component labels on the Main Board while assembling this kit.



Assemble the module following the steps in the order shown. Please read and follow these instructions carefully to avoid incorrect assembly or damage to the module.




Note that certain components on the Main Board assembly are ESD sensitive. Care should be taken when handling the Main Board and components during assembly.

1 Power Connector Assembly



- 1.1 Place and solder the power connector onto the back side of the Main Board. Carefully note the orientation of the connector shown in the diagram.

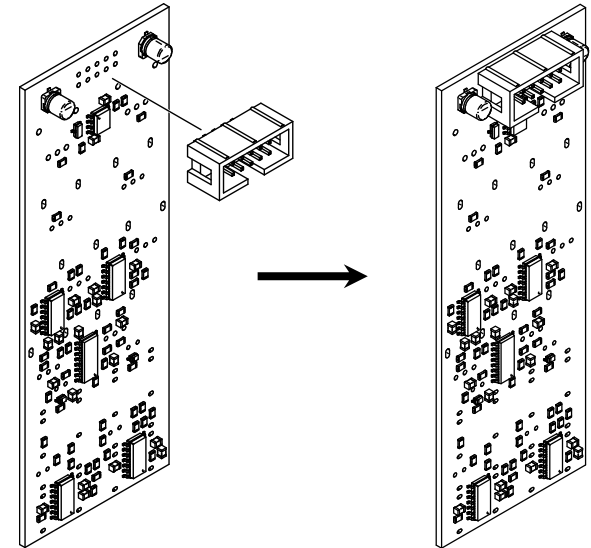

2 Potentiometer and Jack Assembly

- 2.1 Place but do not yet solder the potentiometers and jacks into the front side of the Main Board.


Note the placement of the different potentiometer values. The values of the trim potentiometers are printed on the underside of the component.

RV1, RV2: B10k Round Shaft Potentiometer

RV3, RV4: B10k (103) Knurled Trim Potentiometer

RV5, RV6: B100k (104) Knurled Trim Potentiometer

RV7, RV8: B10k (103) Knurled Trim Potentiometer

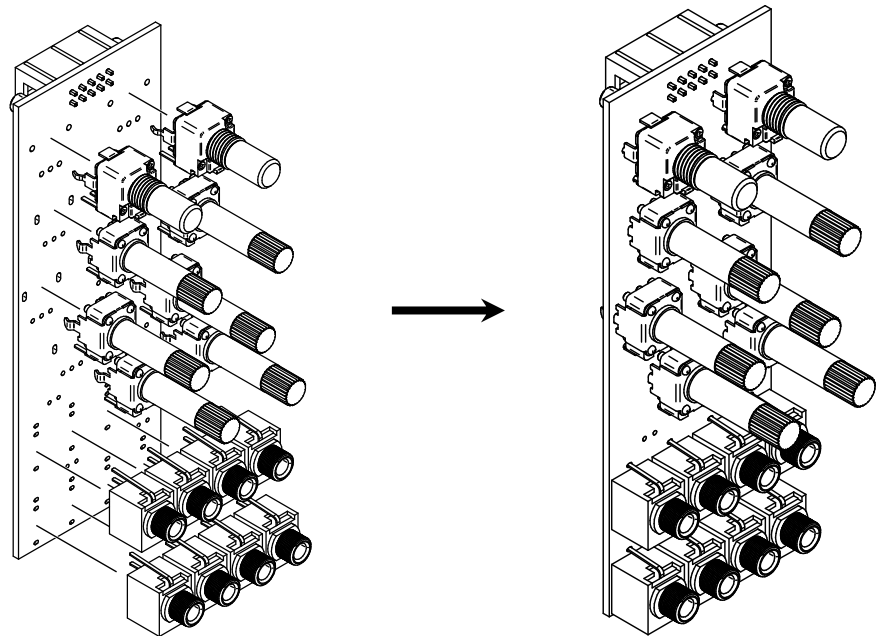


3 LED Assembly

- 3.1 Press LEDs into plastic spacers and place them onto the Main Board assembly. It may be helpful to bend the leads of the LEDs on the back side of the Main Board to keep them in place during the following assembly steps.

Note the placement of the different color LEDs:

D1, D2: 3mm Red LED

D3, D4: 3mm Bicolor Red/Green LED

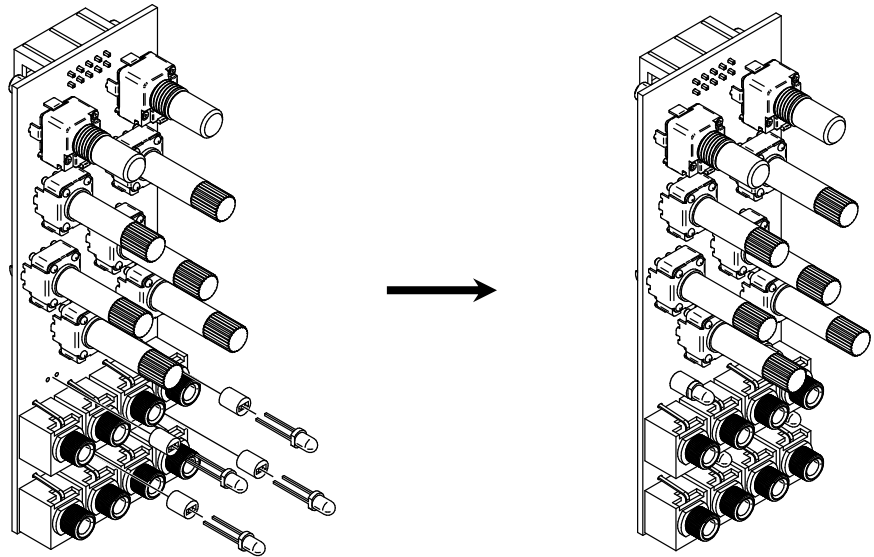

4 Final Assembly

- 3.1 Place the Panel onto the Main Board assembly and lightly thread the nuts onto the potentiometers and jacks to ensure proper alignment before soldering.

Solder components into place on the Main Board. Check that the LEDs sit vertically and are aligned with the windows in the Panel prior to soldering.

- 3.2 Align and tighten the knobs onto the round shaft potentiometers.

