Regional Municipality of Durham

Bid Opportunity: T-1034-2026 - General Contractor for the construction of 409 Centre Street South in Whitby

Closing Date: Friday, November 6, 2026 2:00 PM

Addendum number 6 – November 2, 2026

This addendum will form a part of the bid documents for the above-noted bid and shall be read in conjunction therewith. This addendum will take precedence over all requirements of the original bid documents and any addenda issued previously.

Bidders shall acknowledge receipt of this addendum with their electronic bid submission on the declaration page in the bidding system.

Attachments

1. Section 01 13 00 Delegated Design Requirements R2
2. Section 04 20 00 Unit Masonry R2
3. Section 06 20 00 Finish Carpentry R1
4. Section 07 62 00 Flashing and Sheet Metal R1
5. Section 09 06 00 Materials and Finishes Schedule R1
6. Section 09 21 16 Gypsum Board R1
7. Section 09 60 13 Acoustic Underlayment R1
8. Section 09 65 19 Resilient Tile Flooring R1
9. Section 22 13 00 Facility Drainage R1
10. Section 23 81 27 Packaged Terminal Air Conditioning Unit R1
11. Section 27 11 16 Communications Cabinets, Racks, Frames, and Enclosures R1

12. Section 27 11 19 Communications Termination Blocks and Patch Panels R1
13. Section 27 13 23 Communications Optical Fiber Backbone Cabling R1
14. Section 27 15 13 Communications Copper Horizontal Cabling R1
15. Section 27 16 19 Communications Patch Cords, Station Cords, and Cross Connect Wire R1
16. Section 27 51 23 Intercommunications and Program Systems R1
17. Section 32 00 00A Roadworks Detailed Specifications R2
18. Section 32 39 13 Manufactured Metal Bollards
19. A0601 - Site Plan - Ground Plan
20. A0603 - Site Plan Details
21. A2230 - Site/Building Elevations
22. A2231 - Site/Building Elevations
23. A4401 - Enlarged Plans & Interior Elevations - Entry & Lobby
24. A5200 - Envelope Details - Sections - Base & Sill Conditions
25. A5201 - Envelope Details - Sections - Louvre/Windows, & Reveals
26. A5202 - Envelope Details - Sections - Amenity & Gutter Details
27. A5203 - Envelope Details - Sections - Canopy
28. A5204 - Envelope Details - Sections - Roof & Parapet
29. A5301 - Envelope Details - Plans
30. A6110 - Schedule - Room Finish
31. A6130 - Schedule - Door
32. A8100 - Casework / Millwork Notes & Legend, Schedule
33. A8301 - Millwork - Elevations, Sections & Section Details
34. SG-1 – Site Grading Plan
35. L.1 – Landscape Plan
36. S200 – Basement & Foundation Plan
37. S201 – Level 1 Framing
38. S500 – Foundation Sections
39. S501 – Foundation Sections

40. M-003 - Mechanical Schedules I
41. M-004 - Mechanical Schedules II
42. M-100 - Mechanical Site Plan
43. M-120 - Sanitary & Storm Schematic
44. M-121 - Domestic Water Schematic
45. M-130 - Ventilation & Natural Gas Schematics
46. M-131 - VRF Schematics
47. M-140 - Fire Protection Schematic
48. M-200 - Plumbing – Foundation
49. M-201 - Plumbing – Basement
50. M-202 - Plumbing – Level 1
51. M-300 - HVAC – Basement
52. M-301 - HVAC – Level 1
53. M-302 - HVAC – Level 2
54. M-303 - HVAC – Level 3
55. M-304 - HVAC – Roof
56. M-403 - Fire Protection - Level 3
57. M-404 - Fire Protection – Roof
58. M-501 - Mechanical Sections and Enlarged Plans I
59. M-502 - Mechanical Sections and Enlarged Plans II
60. M-700 - Mechanical Control Sequences I
61. M-701 - Mechanical Control Sequences II
62. M-802 - Plumbing Typical Details II
63. E-303 - Power and Systems New Work Plan – Level 3
64. E-304 - Power and Systems New Work Plan - Roof
65. E-700 - Single Line Diagram
66. E-932 - Electrical Schedules – Power Systems
67. E-933 - Electrical Schedules – Power Systems
68. T-001 - ICAT Legend & Drawing List
69. T-100 - ICAT Site Plan

70. T-101 - ICAT Site Details 1
71. T-300 - ICAT New Work Plan - Basement
72. T-301 - ICAT New Work Plan - Level 1 T-302 ICAT New Work Plan - Level 2
73. T-302 - ICAT New Work Plan - Level 3
74. T-302 - ICAT New Work Plan - Roof
75. T-600 - Enlarged Suites and It Spaces - ICAT
76. T-700 - Communications Riser and Schematics
77. T-701 - Security Riser Diagram
78. T-702 - Audio/Visual Riser and Schematics
79. T-703 - Cabinet Elevations and Network Diagram
80. T-800 - ICAT Typical Details 1
81. T-800 - ICAT Typical Details 2

Appendix D-1 Deliverables

Architectural Specifications

1. Section 00 13 00 Delegated Design Requirements R2; Replace and forms part of this Addendum.
    - Additions: Indicated in **bold** text.
    - Omissions: Indicated by ~~strikethrough.~~
2. Section 04 20 00 Unit Masonry R2; Replace and forms part of this Addendum.
    - Additions: Indicated in **bold** text.
    - Omissions: Indicated by ~~strikethrough.~~
3. Section 06 20 00 Finish Carpentry R1; Replace and forms part of this Addendum.
    - Additions: Indicated in **bold** text.
    - Omissions: Indicated by ~~strikethrough.~~

4. Section 07 62 00 Flashing and Sheet Metal R1; Replace and forms part of this Addendum.
    - Additions: Indicated in **bold** text.
    - Omissions: Indicated by ~~strikethrough.~~
5. Section 09 06 00 Materials and Finishes Schedule R1; Replace and forms part of this Addendum.
    - Additions: Indicated in **bold** text.
    - Omissions: Indicated by ~~strikethrough.~~
6. Section 09 21 16 Gypsum Board R1; Replace and forms part of this Addendum.
    - Additions: Indicated in **bold** text.
    - Omissions: Indicated by ~~strikethrough.~~
7. Section 09 60 13 Acoustic Underlayment R1; Replace and forms part of this Addendum.
    - Additions: Indicated in **bold** text.
    - Omissions: Indicated by ~~strikethrough.~~
8. Section 09 65 19 Resilient Tile Flooring R1; Replace and forms part of this Addendum.
    - Additions: Indicated in **bold** text.
    - Omissions: Indicated by ~~strikethrough.~~
9. Section 22 13 00 Facility Drainage R1; Replace and forms part of this Addendum.
    - Added weeper piping specification.
10. Section 23 81 27 Packaged Terminal Air Conditioning Unit R1; Replace and forms part of this Addendum.
    - Added sentence regarding AHRI certification.
11. Section 27 11 16 Communications Cabinets, Racks, Frames, and Enclosures R1; Replace and forms part of this Addendum.
    - Added AV rack requirements.

12. Section 27 11 19 Communications Termination Blocks and Patch Panels R1; Replace and forms part of this Addendum.
    - Added Panduit and Commscope to vendors.
13. Section 27 13 23 Communications Optical Fiber Backbone Cabling R1; Replace and forms part of this Addendum.
    - Single mode remove, changed to OM4.
14. Section 27 15 13 Communications Copper Horizontal Cabling R1; Replace and forms part of this Addendum.
    - Reference to CAT6 removed, all Category cabling now CAT6A.
15. Section 27 16 19 Communications Patch Cords, Station Cords, and Cross Connect Wire R1; Replace and forms part of this Addendum.
    - Patch cord Quantities revised.
16. Section 27 51 23 Intercommunications and Program Systems R1; Replace and forms part of this Addendum.
    - Area of Refuge devices added.
17. Section 32 00 00A Roadworks Detailed Specifications R2; Replace and forms part of this Addendum.
    - Added concrete refuse area
    - Revised section to detail reinforcement and bedding for refuse slab
    - Detailed construction specification for refuse slab
    - Updated testing procedures for refuse slab concrete.
18. Section 32 39 13 Manufactured Metal Bollards; Add, forms part of this Addendum.

Appendix D-2 Deliverables

Drawings - Architectural

1. A0601 - Site Plan - Ground Plan
    - Additions:
        - Length of screen wall at waste collection staging area.

- Call out reference to typical screen wall detail

2. A0603 - Site Plan Details (New Sheet)
   - New Detail for The Screen Wall
3. A2230 - Site/Building Elevations
   - Additions:
     - Metal Finishes in the Legend.
   - Revisions:
     - MTL-2 In Equipment Area Revised To MTL-1
     - Incorrect MTL-1 Tags Revised With Metal Finish A & B As Indicated On The Drawings
4. A2230 - Site/Building Elevations
   - Additions:
     - Metal Finishes in the Legend.
   - Revisions:
     - MTL-2 In Equipment Area Revised To MTL-1
     - Incorrect MTL-1 Tags Revised With Metal Finish A & B As Indicated On The Drawings
5. A4401 - Enlarged Plans & Interior Elevations - Entry & Lobby
   - Omissions:
     - Detail 3 - PLAM Tags On MW110.
6. A5200 - Envelope Details - Sections - Base & Sill Conditions
   - Revisions:
     - WD01 Tag Revised With WD02 For Interior Window Sills
7. A5201 - Envelope Details - Sections - Louvre/Windows, & Reveals
   - Revisions:
     - Detail 4-8-10-11 - 3mm Continuous Prefinished Trim, C/W Sloped Drip Edge Revised With: 07 62 00. N02 - 22ga Continuous Prefinished Trim, C/W Sloped Drip Edge
8. A5202 - Envelope Details - Sections - Amenity & Gutter Details
   - Revisions:

- Detail 3 Revised As Indicated On Drawings

9. A5203 - Envelope Details - Sections – Canopy
   - Revisions:
     - Detail 1-2 - Wd01 Tag Revised With Wd02 For Interior Window Sills
     - Detail 1-2 - 07 46 19.A01 Metal Siding (Mtl-1) Revised With: 07 62 00.N03 - 22ga Continuous Prefinished Bent Steel Metal
10. A5204 - Envelope Details - Sections - Roof & Parapet
    - Revisions:
      - Wd01 Tag Revised With Wd02 For Interior Window Sills
11. A5301 - Envelope Details – Plans
    - Revisions:
      - Wd01 Tag Revised With Wd02 For Interior Window Sills
12. A6110 - Schedule - Room Finish
    - Revisions:
      - Room 106 Storage – Base Finish Revised To Pct03
13. A6120 - Schedule - Door
    - Additions:
      - Door 201 – Comments: Coordinate Grille On Door. Refer To Mechanical.
14. A8100 - Casework / Millwork Notes & Legend, Schedule
    - Revisions To Casework / Millwork Assembly Schedule
      - Mw101 – Countertop Material: Ss02
      - Mw105 – Material: Plam03
      - Mw110 - Provide Keyed Locking Hardware At Cabinet Above
      - Mailboxes
15. A8301 Millwork - Elevations, Sections & Section Details
    - Revisions:

    - Detail 5 – Wd01 Finish For Mw110
- Omissions:
    - Detail 6 - Incorrect Dimensions

Drawings - Civil

1. SG-1 – Site Grading Plan
    - Revised refuse area to provide flush concrete pad and revised curbline around refuse area
    - Added Specification For Refuse Pad (Note 12).

Drawings - Landscape

1. L.1 – Landscape Plan
    - The concrete pad for the garbage staging area has been lowered to be flush with the surrounding asphalt.
    - The curb for that concrete staging area has been moved to the south and west where the edges meet the landscape design and screen wall.

Drawings - Structural

1. S200 – Basement & Foundation Plan
    - Add Foundation Wall And Detail 7/S501 At Grids K/1.
2. S201 – Level 1 Framing
    - Add CMU Screen Wall And Detail 7/S501 At Grids K/1.
3. S500 – Foundation Sections
    - Clarify Fence Posts Size To HSSS127x127x6.4.
4. S501 – Foundation Sections
    - Add Detail 7/S501.

Drawings - Mechanical

1. M-003 - Mechanical Schedules I
    - Revised ceiling-concealed air source heat pump tag numbers to match suite numbers.
    - Added fire rated grille to Grilles and Diffusers Schedule.

- Added exhaust fan EF-7.

2. M-004 - Mechanical Schedules II
    - Revised VRF and split indoor and outdoor models to not use refrigerant R410A
3. M-100 - Mechanical Site Plan
    - Revised incoming domestic water pipe size and invert
4. M-120 - Sanitary & Storm Schematic
    - Added note to sanitary schematic
5. M-121 - Domestic Water Schematic
    - Revised DCW main sizes
6. M-130 - Ventilation & Natural Gas Schematics
    - Revised laundry exhaust duct diagrammatic routing
7. M-131 - VRF Schematics
    - Revised schematics to suit revised equipment models
8. M-140 - Fire Protection Schematic
    - Added dry sprinkler system for attic
9. M-200 - Plumbing – Foundation
    - Added backflow preventer on drain pipe serving electrical room floor drains.
    - Added drain connection to funnel floor drain in electrical room
10. M-201 - Plumbing – Basement
    - Added drain connections to funnel floor drains.
    - Added funnel floor drain to electrical room
11. M-202 - Plumbing – Level 1
    - Added funnel floor drains in waste room
12. M-300 - HVAC – Basement
    - Revised detail reference in general note 18.
    - Added electric baseboard heater in electrical room corridor
13. M-301 - HVAC – Level 1
    - Revised detail reference in general note 18.

- Removed fire dampers on laundry exhaust ducts.
- Added fire wrapping on laundry exhaust ducts.
- Added electric heater in waste room

14. M-302 - HVAC – Level 2
    - Revised detail reference in general note 18.
    - Added exhaust fan serving elevator control room.
    - Added electric forced flow heaters in stairs
15. M-303 - HVAC – Level 3
    - Revised detail reference in general note 18.
    - Revised drawing notes.
    - Added electric forced flow heaters in stairs
16. M-304 - HVAC – Roof
    - Revised detail reference in general note 18.
    - Added condensing unit and associated refrigerant piping
17. M-403 - Fire Protection - Level 3
    - Added horizontal pipe through corridor serving attic dry system.
    - Added dry system valve assembly in mechanical room
18. M-404 - Fire Protection – Roof
    - Removed pipe down to standpipe in stair.
    - Added pipe down to dry valve assembly at level 3.
    - Revised zone name
19. M-501 - Mechanical Sections and Enlarged Plans I
    - Revised detail reference in general note 18
20. M-502 - Mechanical Sections and Enlarged Plans II
    - Revised detail reference in general note 18.
    - Removed fire dampers.
    - Added fire wrapping
21. M-700 - Mechanical Control Sequences I
    - Revised Electric Heater Control Sequence

22. M-701 - Mechanical Control Sequences II
    - Revised Constant Speed Fan Damper Interlock Control Sequence
    - Revised Domestic Water Heating Plant Control Sequence
23. M-802 - Plumbing Typical Details II
    - Revised note in detail #6

Drawings - Electrical

1. E-303 - Power and Systems New Work Plan – Level 3
    - Added Direct Connection for Branch Selector Box.
2. E-304 - Power and Systems New Work Plan - Roof
    - Revised Location for Cu-3 And Added Cu-4.
3. E-700 - Single Line Diagram
    - Revised Feeder for RP-BC.
4. E-932 - Electrical Schedules – Power Systems
    - Added Circuit for Branch Selector.
5. E-933 - Electrical Schedules – Power Systems
    - Revised RP-2M Circuits for CU-3 And Added CU-4.

Drawings - ICAT

1. T-100 - ICAT Legend & Drawing List
    - Responsibilities matrix added
2. T-100 - ICAT Site Plan
    - Notes adjusted, CCTV and Incoming services
3. T-101 - ICAT Site Details 1
    - Comm duct revised
4. T-300 - ICAT New Work Plan - Basement
    - Riser location identified
5. T-301 - ICAT New Work Plan - Level 1
    - Data adjusting in office, callout have access control hidden
6. T-302 ICAT New Work Plan - Level 2
    - Title block revised

7. T-302 - ICAT New Work Plan - Level 3
    - Title block revised
8. T-302 - ICAT New Work Plan - Roof
    - Title block revised
9. T-600 - Enlarged Suites and It Spaces - ICAT
    - Detail 4 added
10. T-700 - Communications Riser and Schematics
    - Comms room detail added.
    - Riser, L3 elect room, back board added
11. T-701 - Security Riser Diagram
    - Riser clarified.
    - Fire alarm interconnect to access control added
12. T-702 - Audio/Visual Riser and Schematics
    - Amenity – 107, details clarified
13. T-703 - Cabinet Elevations and Network Diagram
    - New riser added
14. T-800 - ICAT Typical Details 1
    - Title block revised.
15. T-800 - ICAT Typical Details 2
    - Title block revised.

Question 1:

ACCESS CONTROL

1. Door list: door numbers are not final and hardware schedule Set 04 lists no doors. Please confirm the final list of access controlled doors, plus door thickness and handing for the 24 wireless lock suites and 6 barrier-free suites.
2. Barrier-free suites: we are assuming a reader and strike on these 6 doors. Please confirm, and confirm who supplies the strikes and power supplies.

3. Readers: the spec calls for ICT field devices but also mentions HID readers, and the hardware schedule reader part differs from the ICT reader. Is the ICT keypad reader acceptable?
4. Wireless: the drawings show a gateway and RF node per floor. Please confirm the intent, and whether the locks are to be online or offline.
5. Life safety: which doors use maglocks, and will the fire alarm contractor supply the release relays? The spec describes a 15 second delayed egress but the code report does not mention it. Does any door require it?
6. Elevator: please confirm the elevator vendor handles car side card access and we connect and program the interface.

CAMERAS

1. We count about 27 cameras (11 outside including 2 pole mounts, 16 inside). Please confirm, and confirm who supplies poles, bases and underground conduit. The spec puts video storage in the data centre room but the equipment is shown on the riser in B101 - which is correct, and who supplies it?
2. Addendum 3 (28 21 00, 1.7) puts dedicated CCTV PoE switches in our scope. How many comm rooms or IDFs are there and where? Are the dedicated patch panels ours or Div 27? Can the intercom stations share these switches?

INTERCOM, DURESS AND CALL SYSTEMS

1. Intercom: we see 2 entry locations on Level 1 and a 6 station area of refuge with a lobby master. Please confirm quantities and the phone line source.
2. Duress: the spec (28 49 00) calls for duress buttons at reception and in the barrier-free washrooms with strobes, but we cannot find any duress devices on the ICAT or electrical plans. Is duress in scope, and what are the locations and quantities? Is it the Tech Works system in the spec or intercom duress stations? The spec also lists a fare-box audit room that is not in this building - can it be deleted?

3. Resident care: is nurse call, resident wandering (RWS appears in the door schedule legend) or RTLS required on this project? If it is by others, who supplies it and what interface to access control and intercom is expected? The video spec also mentions monitoring at the nurses' stations - where are they?
4. Trade split: please confirm Electrical supplies conduit, back boxes and 120V power, which cabling is Div 27 versus Convergint, and who supplies the universal washroom call devices.

Answer 1:

ACCESS CONTROL

1. Set#04 is for door D106.
2. Hager to supply the electric strikes and the auto operator will power the strikes.
3. ICT keypad/readers with OSDP connections are required, references to HID readers will be removed. Refer to attachment forming part of Addendum 6
4. ICT wireless locks, online.
5. No maglocks specified in hardware sets
6. Div 28 is responsible for card readers and programing interface

CAMERAS

1. Video storage is to be installed in ELEC & COMMS B101, this to be provided by Division 28.
2. Intercom will connect to client supplied switches.

INTERCOM, DURESS AND CALL SYSTEMS

1. Refer to attachment forming part of Addendum 6.
2. No duress buttons are required at reception or in washrooms, no far-boxes are present in this project.
3. No Nurse call or Resident wandering is required in this project.

4. No washroom call devices are required, only local alarms as detailed on E-832-6.

Question 2:

There is groundwater drain piping layout on drawing M-200. Please provide the specifications for this piping.

Answer 2:

Specification section 23 13 00 updated to include groundwater drainage piping. Refer to attachment forming part of Addendum 6

Question 3:

We noticed the groundwater drain piping layout on drawing M-200. Could you please clarify if this falls under the Mechanical scope of work? If it is, please provide the specifications for this piping

Answer 3:

Refer to attachment forming part of Addendum 6

Question 4:

Please advise if SOL SHADES could be approved as an equivalent to Sun glow and Elite for Window Coverings.

Answer 4:

No, the Region is no longer accepting ‘alternative product’ proposals as the deadline for requesting ‘equivalent products’ has expired, please refer to Part 1, Article 1.7.

Question 5:

Addendum Number 3 drawing A0201 states to provide shoring as required to allow for open cut excavation, please provide design for this or provide an allowance for this work.

Answer 5:

This is construction means & methods

Question 6:

Can we use pex piping for domestic water inside of suites?

Answer 6:

Yes.

Question 7:

Can we get a typical plumbing layout inside the suites?

Answer 7:

No, it is not in Quasar's scope to provide pipe routing within suites. Please identify practical pipe routes to all fixtures and price the work accordingly.

Question 8:

We just want to confirm the cable type for this install, the spec mentions Cat6 and Cat6a. I want to make sure I am quoting the proper cable. I would also want to confirm that Hubbell is a valid alternate for the spec. Please confirm.

Answer 8:

The Region’s specifications calls for CAT6E, but "6E" is not an official/recognized ANSI/TIA specification. Hubbel is an acceptable alternative.

Question 9:

Please confirm if the demolished building had a basement and if site was backfilled with compacted granular after demolition.

Answer 9:

No basement in the demolished building

Question 10:

Can you please confirm the materials of the exterior metal soffit system (SF1 and SF1a)? Are both of them 3mm thick aluminum panels?

Answer 10:

Section 07 40 25 can be deleted in its entirety.

Question 11:

Looking at the structural drawings set, level 2 section, Detail # 9 / S510. Please clarify the material used for the following: 140x191 between studs, connect to studs w/ 2-A35 Simpson angles each end.

Answer 11:

All lumber to be SPF no. 2 or better” see note 3 in GNS-009 on S100

Question 12:

1. Bird-friendly glass: A6250 specifies white ceramic-frit dots on surface 1, while Section 08 80 00, clause 2.2.6, specifies etched bird-friendly glass. Please confirm the required treatment, approved product and dot spacing.
2. Door glazing types: Please confirm the following discrepancies between A6120, A6130, A6250 and Section 08 80 00: D100B is scheduled with GL4, which is not defined in the exterior glazing schedule. Exterior door D1A-2 is scheduled with GL-1, whereas the specification assigns GL3 to exterior door glazing. Interior vestibule doors D101-2 and D108-2 are scheduled with GL-1 on A6120, but IGL-1 on A6130. Please confirm the glass type for glazed exterior door D107-2, as its glazing field on A6120 is blank.
3. Fire-rated glazing: D104-1 and D104-2 are scheduled as 20-minute-rated doors with F1D sidelight frames and IGL-1 tempered glazing. Please confirm the required sidelight rating and approved glass/frame assembly. Also confirm the required rating for the complete IS-03 screen at D107-1, as A6130 indicates IGL-F glazing while the door schedule leaves the fire-rating field blank.
4. Interior screen framing and supports: A6130 identifies hollow-metal screen construction, while A6120 identifies aluminum frames at D101-2 and D108-2. Please confirm frame materials and finishes for IS-01, IS-02 and IS-03.
5. Aluminum finishes: A6120 identifies painted finishes at several aluminum doors and frames, while Section 08 44 00, clause 2.6, specifies bronze anodizing. Please confirm the required finish and colour for each aluminum assembly.
6. Window quantities: Our preliminary floor-plan count differs from the elevation tags:
    a. W1a: 9 on plans versus 8 on elevations. Please reconcile the south elevation, including CW1-08.

b. W2: 20 on plans versus 19 on elevations.
c. W6a: 3 on plans versus 4 on elevations; the south Level 3 window is not tagged on A1403.
d. W6 appears in the schedule but has no corresponding tag on the reviewed floor plans. Please confirm whether it is required. References: A1401–A1403, A2230–A2231 and A6250.

Answer 12:

1. Please provide the glazing as indicated in the specifications. Dot spacing provided as specified in the bird friendly glazing pattern on sheet A6250. Refer to attachment forming part of Addendum 6
2. Glazing Types in the schedule clarified. Refer to attachment forming part of Addendum 6
3. IS-03 is required to have 20min rating. Fire rated glass is required for the sidelites at D104-1 and D104-2. Door schedule updated. Refer to attachment forming part of Addendum 6
4. Refer to attachment forming part of Addendum 6
5. Aluminum doors shall be provided with bronze anodizing
6. Missing tags updated. Refer to attachment forming part of Addendum 6

Question 13:

Appliance schedule does not list any laundry machines, please confirm that laundry machines and dryers are not required.

Answer 13:

Refer to Addendum #5

Question 14:

Can you please confirm that we will have sufficient heat in the Attic Space for wet pipe sprinkler system as shown on M404? If the space is not heated (which is typical) a dry system would be required and power for an Air Compressor would also be required, including a few new switches, for a Dry Pipe Valve Assembly.

Answer 14:

A dry system must be provided in the attic.

Question 15:

The Reflected Ceiling Plan (RCP) calls for wood panels (SF1a) on the south and west entrance soffits, whereas the specifications indicate that the exterior soffits are to be finished with 3 mm aluminum panels. Could you please confirm whether we should proceed with the wood panels (SF1a) as shown on the RCP or follow the specifications and use 3 mm aluminum panels?

Answer 15:

Section 07 40 25 can be deleted in its entirety. The soffits for the west and south entrance shall be Micro-CLT. The RCP tags and legend updated. Refer to attachment forming part of Addendum 6

Question 16:

The elevations identify the entrance canopy fascia as MTL1, corresponding to wall assembly EW3. According to the specifications, MTL1 refers to the Vicwest AD300 panel. Could you please confirm whether the fascia should remain as the Vicwest AD300 if the soffits is 3mm aluminum panel? Or we can provide pricing for fascia and soffit as 3mm or fascia and soffit AD300.

Answer 16:

The soffits for the west and south entrance shall be Micro-CLT. Canopy fascia to be priced as a 22ga bent steel metal, finished to match the anodized bronze colour of the aluminum window mullions. Refer to attachment forming part of Addendum 6

Question 17:

The East Elevation identifies the cladding in this area as MTL2, which corresponds to the standing seam roof panel (wall assembly EW4). However, the plans and details indicate EW3 (MTL1 – Vicwest AD300) on all four sides of this area. Could you please clarify whether MTL2 (standing seam panels Traditional 150) or MTL1 (Vicwest AD300 panels) should be used for this area?

Answer 17:

EW3 and MTL1 are to be used in this area. The soffits for the west and south entrance shall be Micro-CLT. Canopy fascia to be priced as a 22ga bent steel metal, finished to match the anodized bronze colour of the aluminum window mullions. Refer to attachment forming part of Addendum 6

Question 18:

Will you accept a quote for the Sika alternates for EFC01 and EFS01?

Answer 18:

No, the Region is no longer accepting ‘alternative product’ proposals as the deadline for requesting ‘equivalent products’ has expired, please refer to Part 1, Article 1.7.

Question 19:

This question is regarding Exterior Soffit - Drawing A0202 details SF1 and SF1a call for Micro CLT (wood soffit). Specification section 07 40 25 page 5 of 7 paragraph 2.1.1 lists Aluminum panels 3mm thick. Please confirm if specification governs the material selection.

Answer 19:

Section 07 40 25 can be deleted in its entirety. The soffits for the west and south entrance shall be Micro-CLT. The RCP tags and legend updated. Refer to attachment forming part of Addendum 6

Question 20:

This question is regarding Low Roof Mechanical Equipment Area - drawing A2230 detail 2 lists MTL 2 (Standing Seam Metal Roof), drawing A1404 shows the walls as EW3 metal siding. Please clarify what material should be applied to the walls of Low Roof Mechanical Equipment Area.

Answer 20:

EW3 and MTL1 are to be used in this area. Refer to attachment forming part of Addendum 6.

Question 21:

There are specs section 10 73 00 for Pergola. But couldn’t find it in the drawing. Please advise where we can find Pergola?

Answer 21:

The pergola section covers the bicycle rack shelter that is detailed on drawing L.6 (1/L6) and can be found at the north end of the building.

Question 22:

Please confirm the required number of arc fault breakers per typical suite panel.

Answer 22:

Refer to note 1 in Electrical Panelboard schedule on sheet E-934.

Question 23:

Please confirm if SPDs are to be installed integral or external to the DP and Branch Circuit Panels. Specification Section 26 43 13 Part 2.3.2 indicates they are to be external, meanwhile Section 26 24 16 Part 2.8 indicates they are to be integral.

Answer 23:

To be installed external as per drawings.

Question 24:

In addition to the above question, please confirm if the SPD for the Main Switchboard SWBD-A can be installed integral to the Switchboard.

Answer 24:

To be installed external as per drawings.

Question 25:

Almost all Panelboard schedules show a 3P breaker feeding an SPD. Please confirm if an SPD is truly required on these panelboards, or if the SPD in the Main Switchboard is sufficient for surge protection of the downstream panelboards.

Answer 25:

To be installed external as per drawings.

Question 26:

There are numerous meter cabinets shown external to the Panelboards and Switchboards on SLD Drawing E-700. Please confirm if all meter cabinets shown external (except the utility metering compartment) can be supplied through a third-party submetering vendor such as Carma, Intellimeter, or Triacta. If not, please confirm the approved vendors and specifications for these meters.

Answer 26:

Third party is good except for utility and fire pump

Question 27:

SWBD-A on the SLD Drawing E-700 has a breaker for the rooftop Solar PV that does not indicate the breakers rating. Please confirm the amperage/rating of this breaker.

Answer 27:

The rooftop solar PV system shown on Drawing E-700 is a future provision only. The breaker size/rating for the future PV connection has not been specified under this contract and will be determined as part of the future solar PV system design.

Question 28:

Panel RP-BC is shown to have incoming cables of 1 run of 500MCM (4W / A310) per phase and neutral. Since the downstream 45kVA transformer can only output 125A max, please confirm if 1 run of 250MCM or 300MCM can be utilized instead.

Answer 28:

Feeder size revised. Refer to attachment forming part of Addendum 6X

Question 29:

Almost all panel schedules require main breakers in the panels. Please confirm if all, or any, can be converted to main lugs only (MLO).

Answer 29:

MLO designations to be shown. Refer to attachment forming part of Addendum 6

Question 30:

DP Panels DP-E and DP-X are shown as MLO on the SLD Drawing E-700. However, their respective panel schedules show them all with a main breaker. Please confirm which is correct.

Answer 30:

Main circuit breaker required as per panel schedule.

Question 31:

There is no panel schedule for Panel DP-G. Please confirm if there is one available. If not, please confirm if it is c/w a main breaker and SPD.

Answer 31:

Refer to SLD on sheet E-700 for panel DP-G and its breaker count.

Question 32:

Please confirm the number of suites.

Answer 32:

30

Question 33:

The spec. didn’t mentioned any specific material for the soffit, what material should I allow? (3mm alum. plate?) Same for the wood siding.

Answer 33:

The soffits for the west and south entrance shall be Micro-CLT. Refer to spec section 06 26 00 for soffits and wall paneling. The RCP tags and legend updated. Refer to attachment forming part of Addendum 6

Question 34:

This question is regarding telecommunication, Drawing E-832, detail 4 Structured Wiring Enclosure, upper note states to provide conduits with pull string for Bell Fibre and Tel/data and cable TV outlets. Please confirm that telecommunication scope for this contract is to include rough in conduits with string only for future Bell/Rogers

Answer 34:

All in suite telecom is part of the contract include the Media Enclosure (P3000) data outlets and cabling. Pathway (i.e. conduit to suite P3000 Media Enclosure with pull string) is also in contract as rough in for Future ISP use.

Question 35:

Drawings do not show any camera security system, please confirm that is not part of this contract.

Answer 35:

Access control and CCTV devices are on the ICAT drawings and are part of the contract.

Question 36:

1. Regarding the attached Canopy Detail, the fascia is called out as “Metal Siding (MTL-1)”, the fascia measures 400mm and is shown as one solid piece, the specified AD300 measures 305mm, please confirm if we use one and a third pieces of AD300 or will the canopy be constructed to 305mm or is it easier to fabricate a 400mm, 22Ga. flashing at the fascia.
2. Regarding the paint system, most if not all approved PPG Duranar XL painters will not guarantee the paint on steel, this will also add significantly

to the cost, will the architect be willing to accept a standard AD300 colour at the canopies and the equipment area.

3. Regarding the Metal Reveal, because of the thickness of the 3mm aluminum or steel?, the bent drip as shown on the attached Metal Reveal is not possible, since it is only a 90mm reveal would the architect consider using 22Ga. material instead of 3mm aluminum or steel in available 22Ga. standard colours.

Answer 36:

1. Canopy fascia to be priced as a 22ga bent steel metal, finished to match the anodized bronze colour of the aluminum window mullions. Refer to attachment forming part of Addendum 6
2. A standard colour for the equipment area is acceptable. Canopy fascia to be priced as a 22ga bent steel metal, finished to match the anodized bronze colour of the aluminum window mullions. Refer to attachment forming part of Addendum 6
3. Metal reveal to be priced as a 22ga bent steel metal finished to match the anodized bronze colour of the aluminum window mullions. Refer to attachment forming part of Addendum 6

Question 37:

We’re seeing the beams and columns, the details on the columns are a little vague. The posts on the retaining wall do not show a height or thickness of the HSS tube ? I cannot find any details on interior or exterior stairs or handrails. Please send any information in regard to structural and miscellaneous steel that can help us with this quote.

Answer 37:

The posts on the retaining wall are HSS127x127x6.4. The tag updated. Architectural stair drawings are in the A4000 series. Refer to attachment forming part of Addendum 6

Question 38:

The specified manufacturer's PVC-free polyester solar screen is 2% openness, and its 1% screens are vinyl blends. Could the consultant confirm whether a 2% PVC-free screen is acceptable, or whether 1% openness takes priority over PVC-free?

Answer 38:

It is acceptable to have 2% openness with a PVC-free solar shade. The related spec section has been updated. Refer to attachment forming part of Addendum 6

Question 39:

Please refer to wall assembly EW5 on A0210 and details 1&2/A5203 for STN4 at canopy. Please provide height for STN4 in detail 1&2/A5203.

Answer 39:

The height is 225mm

Question 40:

Please refer to specs section 04 20 00, 3.14.7, Please explain about the tolerance of Column and wall cross-section dimensions within minus 6 mm and plus 12 mm.

Answer 40:

It refers to the thickness of the wall. For example if the spec says that the wall should be 200mm then it is allowed to be up to 212mm or down to 194mm

Question 41:

Please refer to section detail 11/A5201 and all related section details on A5201. There is measurement of 10mm but not given from where to where? Also, please provide projection of lip brick from the steel angle. Also, please advise tolerance on overhang as it could be possible that wood framing off in alignment and overhang from lintel can be varied.

Answer 41:

Please ignore the 10mm dimension. 2/3 of the brick should be captured on the angle. The lip should be 25mm or as per manufacturer. The brick must be installed plumb and true irrespective of tolerances in the wood framing.

Question 42:

1. Room #103 is labeled as Dining room but shows a 1-BD suite. Please review and advise.
2. Please advise if the cabinets are lockable or non-lockable. Both conditions are stated on Millwork Notes, drawing A8100.
3. MW110 (Mailbox Cabinet) is shown with PLAM01 on drawing 5/A8301 and with WD01 on drawing 3/A4401. Please review and advise the material.
4. Please provide details with dimensions for wood slat walls in the lobbies.

Answer 42:

1. Room 103 is a 1bed-unit

2. Refer to MW schedule on sheet A8100
3. Please refer to the millwork drawings on the A8000 series. Labels on 3/A4401 adjusted accordingly.
4. Plan & Section Details are provided on sheet A5401, A5501
5. Refer to attachment forming part of Addendum 6

Question 43:

In the architectural plans on drawing A1501 there is a beam marked for intumescent under the notation XB2, spanning half way from C2 - C3. When I look at the corresponding structural diagrams to get the associated steel member, there is no steel reported there, just notation SW1. Please clarify what size structural steel member is required.

Answer 43:

The tag in the architectural drawing is incorrect. Please ignore.

Question 44:

Room 301 , the floor is epoxy floor , the shower floor is epoxy as well ? Do we have to allow for wall tile at the shower ? Please, clarify

Answer 44:

Refer to 7/A4402. The shower shall be provided as a shower plate. Refer to the specifications. The wall tiles are indicated with a color-coded legend on the same drawing.

Question 45:

Room 106 storage room has PCT01 floor tile and RB 01 base , usually it is not common to install rubber base in floor tile area . Please clarify and advise.

Answer 45:

The base revised to tile. Refer to attachment forming part of Addendum 6

Question 46:

Please confirm that washing machines are not required for this project.

Answer 46:

Refer to Addendum #5

Question 47:

1. In Sections 27 10 00, 27 15 13, 27 16 16 and 27 16 19: Please confirm the required copper structured cabling category for the complete data system. Specifications reference Category 5e, Category 6 and Category 6A in different Division 27 sections above. Please confirm the required category for horizontal cable, jacks, patch panels, and patch cords.
2. Please confirm the required manufacturer as per specification 27 10 00 states Belden yet section 27 16 19 states Panduit patch cords.
3. Please confirm that all patch cords in specification section 27 16 19 sub-section 2.2 .3 are required for this project
4. In section 27. 16 19 sub-section 3.2.1.1 states to supply two patch cords for each telecom field outlet it this, correct?
5. Please confirm that all patch cords are to be installed by owner. (As per section 27. 16 19 sub-section 3.2.1.)

Answer 47:

1. CAT6A cable is required for cable, patch panels, patch cords and jacks.
2. Both Belden and Panduit are acceptable.

3. Patch cord quantities adjusted. Refer to attachment forming part of Addendum 6
4. Two patch cords total for each telecom field outlet are required, one for the patch panel and one at the field outlet. Patch cord quantities adjusted. Refer to attachment forming part of Addendum 6
5. Patching is to be by Division 27. Refer to attachment forming part of Addendum 6

Question 48:

Landscaping drawing L.1 specifies StreetBond SR in Slate. Please confirm the approved product/system, preparation and primer, coat count and thickness/coverage, required performance, and coating limits including any excluded asphalt areas.

Answer 48:

The application is for the entire asphalt area of the parking lot within the subject site including parking stalls and drive aisle. Does not apply outside the property limits within the right-of-way.The specification calls for four (4) coats for areas with vehicular traffic up to 500 cars. Apply coats one (1) week after asphalt paving is complete. Allow to cure for min. 24 hours before any additional painting. Screenshot from specifications with red outline added:

	5 gallon (20 Litre) unit	5 gallon (20 Litre) unit
Vehicular traffic		
Up to 500 cars per day per lane	4 layers at 600 ft2 (56m2) per 5 gallon (20 Litre) unit for a net coverage of 150 ft2 (13.9m2) per 5 gallon (20 Litre) unit	4 layers at 600 ft2 (56m2) per 5 gallon (20 Litre) unit for a net coverage of 150 ft2 (13.9m2) per 5 gallon (20 Litre) unit
500 to 1000 cars per day per lane	4 layers at 600 ft2 (56m2) per 5 gallon (20 Litre) unit for a net	4 layers at 600 ft2 (56m2) per 5 gallon (20 Litre) unit for a net

Question 49:

Please confirm the parking-marking details: 100 mm white stall lines; hatch width, spacing, colour and pattern for the three hatched zones; accessible symbol size/background; and the locations and stencil details for the four EV symbols.

Answer 49:

Please refer to detail 413 & 413.30 from the Town of Whitby. The details are included on the site plan drawing A0601

Question 50:

Please confirm the marking sequence relative to StreetBond curing and the requirement in Section 32 00 00A to mark within two working days of the final asphalt lift. Are the surface treatment and markings available for for landscaping trade to price?

Answer 50:

In accordance with manufacturer recommendations, StreetBond requires ~ 24 hours to cure. Pavement markings to be installed subsequently within the 48-hour window from final finished asphalt placement.

Question 51:

Due to current market fluctuations and tariff uncertainty, most subcontractors and suppliers are providing bid validity periods of only 30 days, with pricing subject to adjustment based on the actual costs at the time of order. Considering that numerous specified materials are sourced from the United States, we respectfully request that the Client confirm that our bid shall include only the tariffs in effect as of the bid closing date. Any subsequent increases in tariffs or other applicable import duties imposed after the bid closing date shall be treated as an adjustment

to the Contract Price, based on the actual applicable rates and costs at the time the materials are ordered. This approach would help address the current market uncertainty and ensure that bidders are not required to carry the financial risk of unforeseen tariff increases beyond their control. Please review and confirm acceptance of this request.

Answer 51:

Bidders are directed to Document 3, Appendix B - Supplementary Condition 28 (GC 10.1 – Taxes and Duties) to the CCDC 2 General Conditions which sets out the process for adjustments to Contract payments where a change to custom duties or import Tariffs occurs after Contract execution.

Question 52:

1. Please refer to drawing A6110 – Room Finish Schedule, which indicates that all suites on Levels 2 and 3 are to receive 2 mm acoustic underlayment. However, Specification Section 09 60 13, Paragraph 2.1.1, specifies Type 1 acoustic underlayment at 25 mm thick, while Paragraph 2.1.2 specifies Type 2 acoustic underlayment for suites at a minimum thickness of 2 mm. Additionally, floor assemblies FL2a, FL2b, and FL2c indicate a thickness of 25 mm.
2. Please clarify the required acoustic underlayment type and thickness for each applicable floor assembly and confirm which requirements govern where discrepancies exist between the drawings, specifications, and floor assembly details.
3. To facilitate coordination and installation, please also provide an annotated floor finish plan identifying the locations where Type 1 (25 mm) and Type 2 (minimum 2 mm) acoustic underlayment are required.

Answer 52:

1. Please provide Type 1 acoustic underlayment as indicated in the floor assemblies. The 2mm underlayment (Type 2) deleted. Refer to attachment forming part of Addendum 6
2. Please provide Type 1 acoustic underlayment as indicated in the floor assemblies. The 2mm underlayment (Type 2) deleted. Refer to attachment forming part of Addendum 6
3. Please provide Type 1 acoustic underlayment as indicated in the floor assemblies. The 2mm underlayment (Type 2) deleted. Refer to attachment forming part of Addendum 6

Question 53:

Regarding the attached Canopy Detail, the fascia is called out as “Metal Siding (MTL-1)”, the fascia measures 400mm and is shown as one solid piece, the specified AD300 measures 305mm, please confirm if we use one and a third pieces of AD300 or will the canopy be constructed to 305mm or is it easier to fabricate a 400mm, 22Ga. flashing at the fascia.

Answer 53:

Canopy fascia to be priced as a 22ga bent steel metal, finished to match the anodized bronze colour of the aluminum window mullions. Refer to attachment forming part of Addendum 6

Question 54:

Regarding the paint system, most if not all approved PPG Duranar XL painters will not guarantee the paint on steel, this will also add significantly to the cost, will the architect be willing to accept a standard AD300 colour at the canopies and the equipment area.

Answer 54:

A standard colour for the equipment area is acceptable. Canopy fascia to be priced as a 22ga bent steel metal, finished to match the anodized bronze colour of the aluminum window mullions. Refer to attachment forming part of Addendum 6

Question 55:

Regarding the Metal Reveal at Window/Louvre, because of the thickness of the 3mm aluminum or steel?, the bent drip as shown on the Metal Reveal is not possible, since it is only a 90mm reveal would the architect consider using 22Ga. material instead of 3mm aluminum or steel in available 22Ga. standard colours.

Answer 55:

Metal reveal to be priced as a 22ga bent steel metal finished to match the anodized bronze colour of the aluminum window mullions. Refer to attachment forming part of Addendum 6

Question 56:

Request for Approval of Alternative Automatic Door Operator – Rhino 7000 Series As per the Region’s approach, the contractor is required to prioritize Ontario- and Canadian-made products in accordance with Appendix E – Buy Ontario Act Domestic Supply Chain Plan (Evaluated Approach), which must be completed and submitted with the bid. The specified Hager 8318 automatic door operator does not appear to be domestically manufactured or supplied in compliance with the Region’s domestic supply chain objectives. Therefore, we respectfully request that the Region consider the attached Rhino 7000 Series automatic door operator as an acceptable alternative to the specified Hager 8318. The proposed alternative offers a significant cost advantage, as the specified Hager 8318 is approximately three times more expensive. We request

your review and approval of the proposed alternative, subject to confirmation that it meets the project's technical, operational, and applicable code requirements, while supporting the Region's domestic supply chain objectives. We have sent documents required per document 1 of 5, Article 1.7 for approval via email. Please advise.

Answer 56:

This is a medium duty operator and is not for high traffic areas.

Question 57:

Section 10 28 13 – Washroom Accessories – Item 2.2.19 Adult Changing Table (ACS) We would like to request approval for ASI Group Universal Change Station model #9060 It is a motorized, electronically height adjustable unit that can be hard wired or plugged into an outlet with battery back-up. Model #9060 has a safety guard with 227kg (500 lbs.) weight capacity. Wall-mounted, heavy duty steel structure and ABS tray, pneumatic gas-shock folding. Please find attached the Technical Data Sheet, Product Sheet, and Specifications. We have sent documents required per document 1 of 5, Article 1.7 for approval via email on Oct. 22nd, 2026, ten (10) days prior closing date Nov.6th Please advise

Answer 57:

It is acceptable for a quote to be submitted with the alternate product.

Question 58:

Specs section 07 55 52, 1.4 Quality Assurance, 1.4.2 Perform roofing work according to the CRCA Roofing Specifications Manual and membrane manufacturer's printed installation instructions. Please confirm that OIRCA/CRCA members are in good standing, not mandatory, as long as provide total warranty as per specification section 01 78 37.

Answer 58:

This is mandatory

Question 59:

Specs section 07 61 00, Please confirm that OIRCA/CRCA member is not mandatory if installer and manufacturers provide total warranty per spec section 01 78 37.

Answer 59:

This is mandatory

Question 60:

Div 21 Specs Section 3.11 mentions to provide detection devices and install in (.4). However, (.5) mentions supply devices and hand to Electrical trade on site? -Please confirm Detection Scope of Work, as the above contradicts.

Answer 60:

Electrical Contractor to install the detection devices and provide the associated conduit, wiring and terminations to the pre-action control panel. Div 21 to supply the pre-action devices

Question 61:

1. Please confirm countertop material and color for MW101 (Suite Vanity). The millwork schedule is blank.
2. Please confirm T4 and T5 from drawing A8111 are not used in the project; otherwise specify the locations.
3. Please confirm U4 from drawing A8111 is not used in the project; otherwise specify the locations.

4. Please confirm BS1 and BS2 from drawing A8112 are not used in the project; otherwise specify the locations.
5. CW101 and CW102 (Suite Servery): Please confirm cabinet kicks at suites are PLAM.
6. MW111 (Lobby Bench): Please advise if the width is 510mm with 60mm solid nosing or 457mm with 75mm solid nosing as the elevation and detail do not match.
7. Please confirm the windows at Stairs A and B do not have wood sill and frame, otherwise confirm the material.
8. Building Section 2/A3210: Please confirm the windows at corridor ends do not have wood sill and frame, otherwise confirm the material. Only detail 1/5203 illustrates the window sill.
9. Please advise the extents of FRP panels at Waste Chute Vestibules, rooms #208 and #308.
10. MW105 (Laundry Folding counter): Please confirm the material for finish panels, gables, and kicks. Also please specify the counter's width and depth

Answer 61:

1. Countertop material is SS02. The millwork updated. Refer to attachment forming part of Addendum 6
2. Not used
3. Not used
4. Not used
5. Please provide PLAM cabinet kicks to match finish above.
6. Dimensions clarified. Refer to attachment forming part of Addendum 6
7. All window sills in the corridors & stairs to be built as indicated in 1/A5203
8. All window sills in the corridors & stairs to be built as indicated in 1/A5203

9. FRP panels shall be provided on all walls to the u/s of ceiling. The Room Finish Schedule has been updated. Refer to attachment forming part of Addendum 6
10. counter length - refer to plan
    counter depth - 610mm
    material for finish panels, gables, kicks - match CW 100

Question 62:

Requesting you for one (1) week extension on bid closing and accept to review all submitted documents/RFI's for an alternative product to meet supply chain Ontario.

Answer 62:

Refer to Addendum #5

Question 63:

Please refer to Q/A#5 from Addendum 4, regarding to clarify what material to use for foundation backfill for unexcavated and excavated portion of the building. The answer says “Any shortfall of suitable on-site excavated material can be made up with imported granular material, OPSS Granular ‘B’ or equivalent. Question is whether we can use native material

Answer 63:

The statement reads “Any shortfall of suitable on-site excavated material can be made up with imported granular material, OPSS Granular ‘B’ or equivalent.” This already means that the on-site excavated material (I.e. native material) can be reused.

Question 64:

1. The cladding specified on Elevation 2/2203 between gridlines D and I is indicated as Standing Seam Siding, Type MTL2, however Drawing 4/5202 specifies Type MTL1 - Siding AD300. Could you please confirm which siding type should be used?
2. Please confirm the specified material for the MTL1 flashing shown on the elevations and Detail 4/A5201 (07 62 00.N02) . Should it be 3 mm aluminum or 22-gauge steel?
3. Details 2/A5301 and 10/A5201 both specify 07 62 00.B24 and A02 – Aluminum trims. Please confirm whether the trims for 22-gauge steel siding should be prefinished aluminum as specified, rather than the standard 24-gauge prefinished steel trim typically used with steel siding.

Answer 64:

1. EW3 and MTL1 are to be used in this area. Refer to attachment forming part of Addendum 6
2. 22ga steel. Refer to attachment forming part of Addendum 6
3. It can be provided as 24ga steel

Question 65:

Site Plan A0601 indicates proposed landscaping and a concrete sidewalk along Centre Street, as well as a new south entrance along Ontario Street West. Please confirm that all work beyond the property line, including but not limited to hardscape and softscape works such as sidewalks, irrigation, tree planting, landscaping, and any associated site improvements, is excluded from the scope of work.

Answer 65:

All work proposed in the documents is in scope.

Question 66:

Civil Drawing SG-1 and Structural Drawing S500 Civil Drawing SG-1 indicates that the average elevation along the neighbouring property on the east/southeast side is approximately 99.50, while the proposed average grade adjacent to the building towards this east is approximately 99.60. Based on these elevations, please confirm whether the concrete retaining wall along the east side, as shown on Structural Drawing S500, is required. Our understanding is that the retaining wall may not be necessary given the relatively minor grade difference. We propose using a raised concrete curb as an alternative to the retaining wall. Please review and confirm whether the retaining wall can be omitted and replaced with a raised concrete curb, subject to the design team's approval.

Answer 66:

The proposed building FFE is 100.50, with an average proposed grade of approximately 100.30 adjacent to the building. The referenced elevation of 99.60 does not correspond with the proposed grading shown on SG-1. The grade differential along the east property line (to the parking) ranges from approximately 0.35 m to 1.05 m. The retaining wall is therefore required as shown, and no adjustment to the proposed grading is permitted.

Question 67:

Hardware set #4 is missing any door numbers. All doors are accounted for with exception of D106, D107-3, D107-4, D1A-3 Please provide the door hardware set for these doors or confirm they are set #4.

Answer 67:

Hardware set #4 does apply to D106.
D1A-3 does not exist in the project
D107-3 & D107-4 are millwork doors

Question 68:

1. Pole Supply and Installation: Please confirm who is responsible for supplying and installing the camera poles.
2. Pole Camera Connectivity: Are the cameras mounted on the poles required to be connected to the server room via hybrid fiber-optic cables, or are alternative connection methods acceptable?
3. Camera Types on Drawings: Please identify the camera types on the site plan and basement drawings to clarify the required camera types and locations.
4. ADO Doors – Sequencers and Power Supplies: For doors equipped with automatic door operators (ADOs) and access control readers, where no door sequencer is indicated in the door schedule, please confirm who is responsible for supplying and installing the required sequencers and power supplies.
5. Intercom System: Please confirm the exact intercom models, quantities, and required components for the project.
6. Camera Monitoring Workstation: Is a dedicated workstation required for monitoring the CCTV cameras? If so, please confirm who is responsible for supplying and installing it.
7. Racks and Enclosures: Please confirm the required types and models of equipment racks and enclosures, and clarify who is responsible for supplying and installing them.

Answer 68:

1. CCTV cameras will mount on light poles, locations updated. Refer to attachment forming part of Addendum 6
2. Hybrid powered fiber optic or extended reach cable are acceptable options.
3. Camera types identified. Refer to attachment forming part of Addendum 6

4. Sequencers and Power Supplies have been noted within the hardware sets where required.
5. Intercom Entry systems are described in Section 28 15 23, Entry station X916 is required at "Vest 101" and IP Door phone is required at "Vest 108".
6. Provide a spot monitor for use in "Office 102" , Senstar Thin Clint 10D or equivalent.
7. Racks and Enclosures are described in Section 27 11 16. Racks and Enclosures are division 27 responsibility.

Question 69:

Specification section 26 05 73.16 page 4 of 6, paragraph 1.6.3 states that Short-Circuit Analysis and Coordination Study to be preformed by a registered Professional Engineer. Please confirm that cost for this needs to be included by general contractor. If this needs to be done by GC please provide an allowance for this.

Answer 69:

The short circuit study cost falls under the electrical trade. It is their responsibility to provide a stamped short circuit study for our review.

Question 70:

Please refer to door schedule A6102, all suite entry door frame and doors are wood doors. However, details 10/A8301 – Suite Entry Door surround says HM frame and door painted to match PLAM02. Please confirm the type of finish for the wood doors and frame

Answer 70:

Suite doors provided as specified in section 08 14 16, 2.1.4. The note on elevation 10/A8301 has been revised. Suite Door finish to be PLAM01 as indicated in the door schedule. Refer to attachment forming part of Addendum 6

Question 71:

Please refer to detail 10/A8301 says suite number signage refers to signage consultant. Please confirm that suite number signage and all other interior wayfinding signs are not in contract.

Answer 71:

Wayfinding & Signage is part of the contract. Refer to Wayfinding drawing (100 & 200 Series) provided as part of the tender documents

Question 72:

Please confirm that the 19mm wood slat is only for the location at grid line “D” & “4” on L1 – Lobby only per 8/A5401

Answer 72:

Refer to interior elevations A4401

Question 73:

Elevation 10/A8301 shows wood slats on one side of the suite entry surround, whereas plan detail 6/A5401 indicates wood slats on both sides of the suite entry door. Please confirm which detail should govern and whether wood slats are required on one side per elevation 10/A8301 or on both sides per plan detail 6/A5401.

Answer 73:

The typical suite door sorround shall be built as indicated on 10/A8301. The detail on 6/A5401 captures the unique condition at the corner of the elevator lobby and south corridor. This detail is applicable on all levels.

Question 74:

Access-Control Server Requirements: Please confirm whether the ICT Protege GX software will be installed on an Owner-supplied or contractor-supplied server/PC. If contractor-supplied, please provide the required specs requirements for the server/PC.

Answer 74:

The access control system will be connected to the Region of Durham regional Server.

Question 75:

Is there a shed that needs to be removed as a part of this contract.

Answer 75:

Yes

Question 76:

Please confirm that windowsill details are applicable for all levels per section 1&4/A5200.

Answer 76:

Interior window sills at suite shall be provided as per detail 1&4&5/A5200. Interior window sills at corridors & stairs to be built as indicated in 1/A5203

Question 77:

LVP01 Vinyl Flooring, in Section 09 06 00 is listed in the schedule as Click/Glueless, but the product specs on the manufacturers website show it requires a full glue-down installation. Please confirm if a click floor or a glue-down floor is preferred?

Answer 77:

Glue down is the preferred method. The specifications revised. Refer to attachment forming part of Addendum 6

Question 78:

Structural Plans note Fero Fast Thermal Brackets on Section Details S510. Can you please confirm the required bracket depth based on the load and design requirements.

Answer 78:

Brackets are mounted to the CLT and extend down to the elevation of the reveal, same depth to be used on the level above. Details 2 & 9/S510 show a 400mm dimension.

Question 79:

The structural drawings do not appear to include a wall and footing schedule. Please confirm the required wall types, footing sizes, and associated reinforcing details, or provide the applicable schedule/details for construction.

Answer 79:

The piers and footings are schedules on S300. There are 3 different concrete foundation walls, CW1, CW2 and CW3, they are tagged on plan and shown in details 2/S501, 6/S500 & 3/S500 respectively.

Question 80:

The appliance schedule specifies the following models, which are not available in the Canadian market:

• Dishwasher: LG ADFD5448AT
• Wall-Mount Range Hood: Summit SEH3630SSADA
• Under-Cabinet Range Hood: Summit H24RSSADA
• Built-In Wall Oven: LG WSED3023B

Clarification Requested: Please review and advise on acceptable alternative models available in Canada that meet the design intent and specified performance requirements. Alternatively, kindly confirm whether the contractor may propose equivalent appliances for the Architect’s review and approval prior to procurement.

Answer 80:

Contractor may propose an equivalent alternative

Question 81:

Requesting you to please remove delegate design requirements for below sections per 01 13 00 as it’s not normal and trades doesn’t do those services.

1. Section 04 20 00 Unit masonry: For unit masonry work, ties and anchors.
2. Section 09 21 16 Gypsum board: For light gauge metal framing of gypsum board partitions and ceilings.

3. Section 10 73 00 Protective covers / pergolas: For pergola system.
4. Section 11 82 00 Waste compactors and rubbish chutes: For rubbish chutes and connections.
5. Section 26 56 13 Lighting poles and standards: For soiling testing and pole base for lighting poles. Light pole base details should be by the Client's consultant.
6. Section 31 00 00 Earthwork: For shoring, bracing and underpinning, if required. As shoring drawings shall be provided by the Clinet's consultant.
7. Section 32 31 13 Wood fences: For wood fences serving as a guard. We will follow the fences details per landscape plan L.5 (5/L.5 and Ornamental fence details on L.5)

Answer 81:

Please follow the specifications requirements, including engineering requirements

Question 82:

Please confirm that the builder risk and wrap up insurance will be provided by the client.

Answer 82:

Refer to Addendum #2

Question 83:

Please refer to Q/A#14 from Addendum#4. Please confirm that the temporary dewatering permit application will be done by the Client.

Answer 83:

The temporary dewatering permit application will be done by EXP and retained by the GC.

Question 84:

Please advise plywood support will be required under the SS01 (solid surfaces - resident kitchens) and SS02 - Solid surfaces for resident washroom.

Answer 84:


Please refer to Casework and Millwork General Notes on A8100 and to typical details on A8111 & A8112.

Question 85:

Please refer to Q/A#25 from Add#4, continuous Shelf angle per section at the openings 2/S510 L102x102x6.4. Response was that the angle screwed to the CLT deck is not continuous. However, section detail 1/S510 along grid line 2 shows angle. Please confirm and provide extent of angle on plan.

Answer 85:

I marked up the below section to make clear which angle is and is not continuous

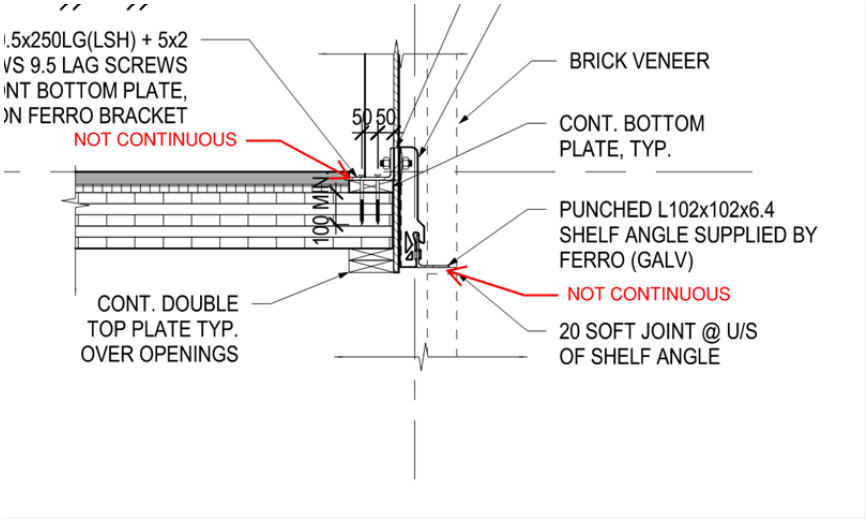

Question 86:

Appendix - Schedule of Sections and Prices section 00 61 14.04 lists Wrap-up insurance. Please confirm if Wrap up insurance is required as it is not listed in Appendix D.

Answer 86:

Refer to Addendum #2

Question 87:

Please specify the detail for F1A and F2A door frames on dwg A6102. Door details are include on sheets A6100, A6101.

Answer 87:

Door details are include on sheets A6100, A6101. For more details, refer to attachment forming part of Addendum 6

End of addendum