


Does the micro-Doppler survive after the detector has died?

Down the reference-SNR ladder detection collapses (Pd 1.00 → 0.81 → 0.00) and the blade-flash line loses 61 dB (85.3 → 32.5 → 24.4 dB) — still above the background at the rung where the detector reports nothing. But the comb dies two other ways that noise never causes: with ECA off the body line buries it, and at a 2 kHz illuminator frame rate the wingtip folds inside the window.

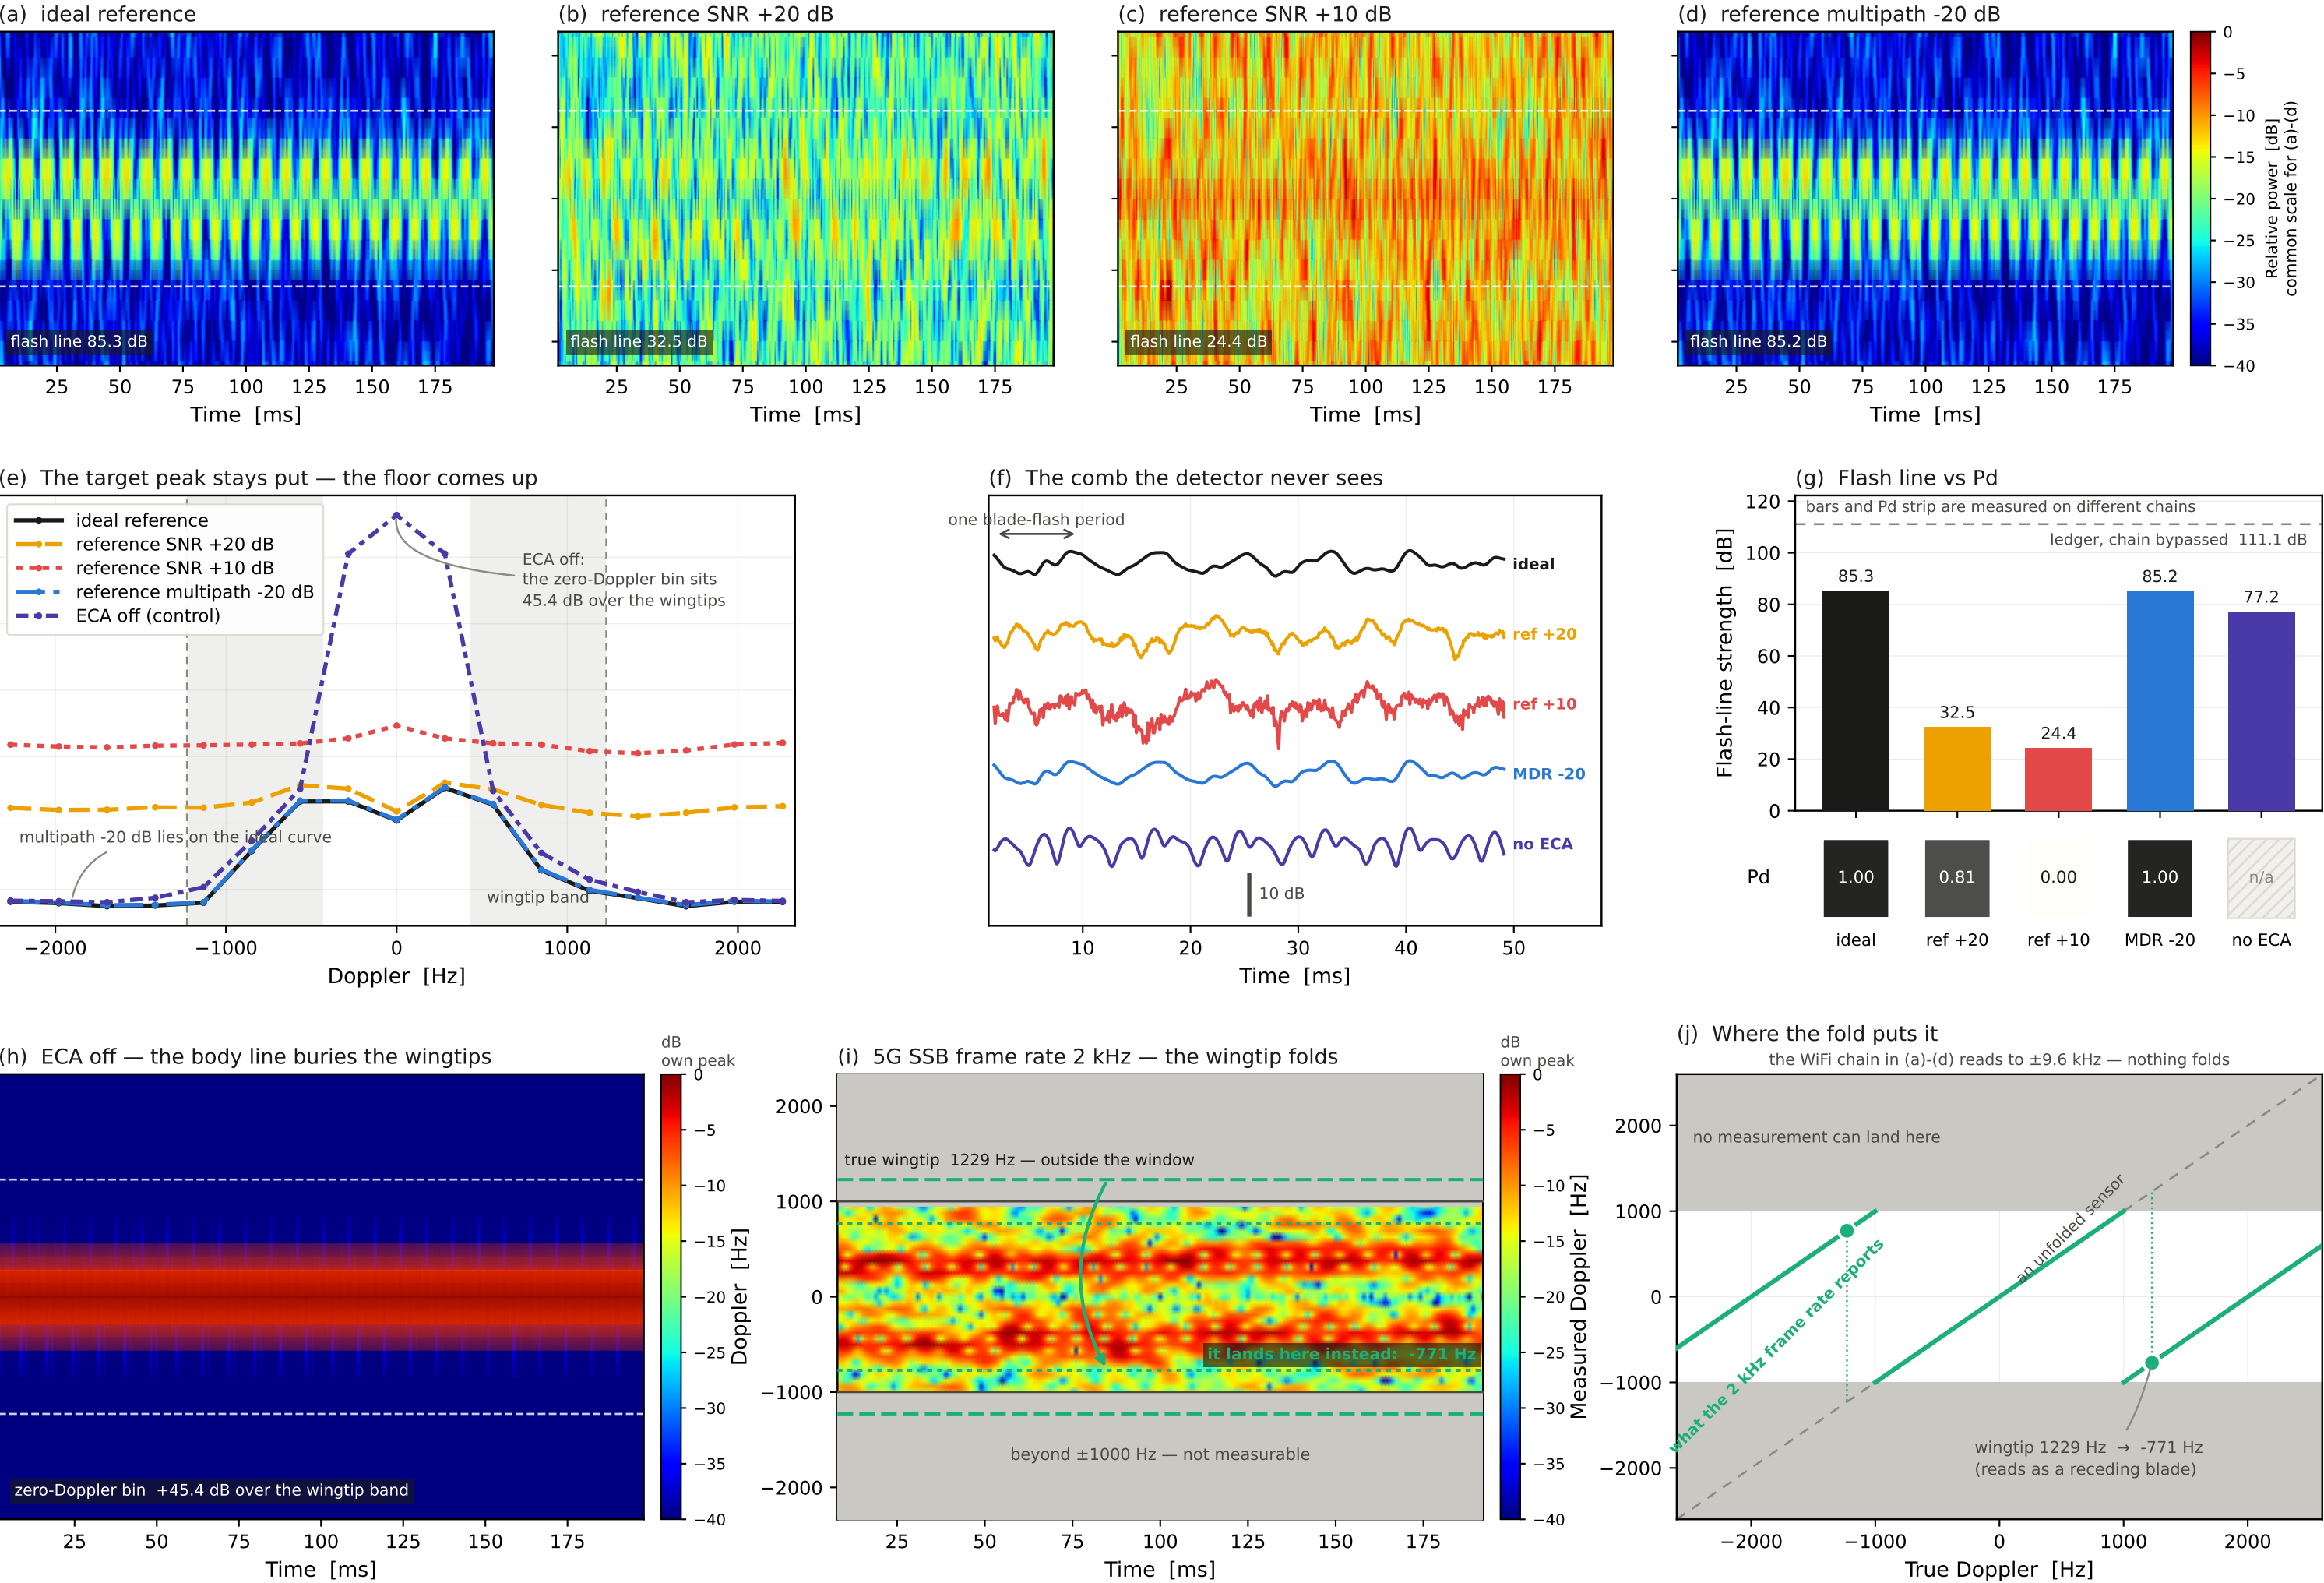

Every map is read at the target's known range bin — survival here is a statement about recognising a target, not about finding one. The Pd strip in (g) comes from a separate detection run whose slow-time chain differs from the one these maps use.