

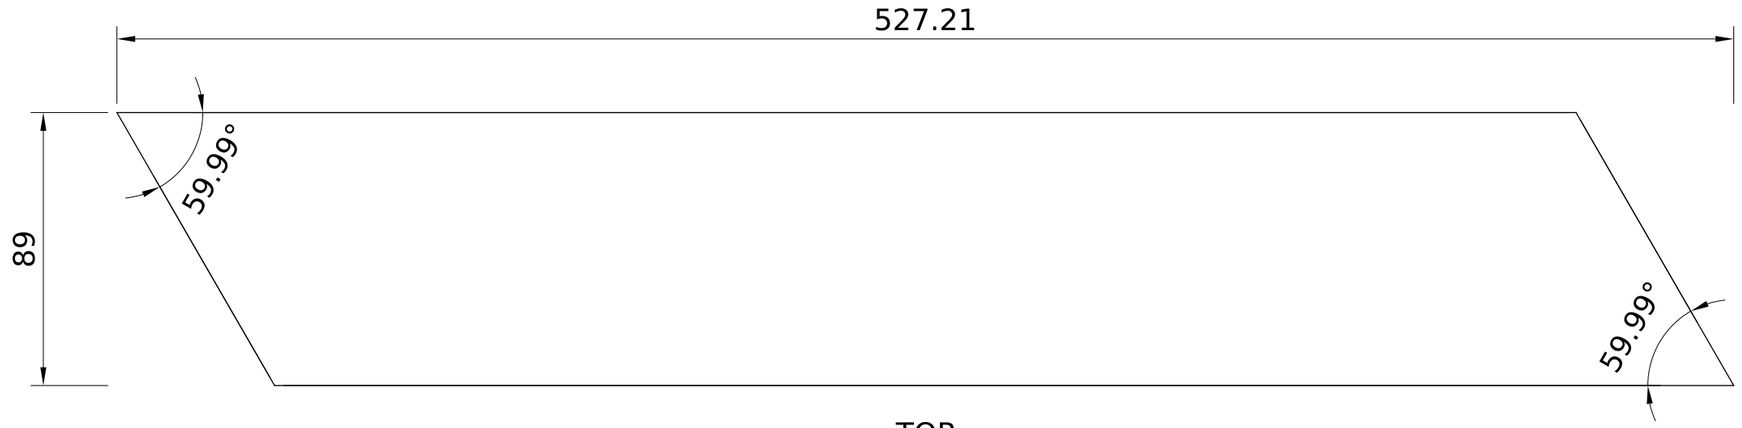



TOP

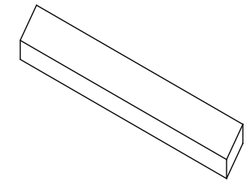

ISOMETRIC 1:10

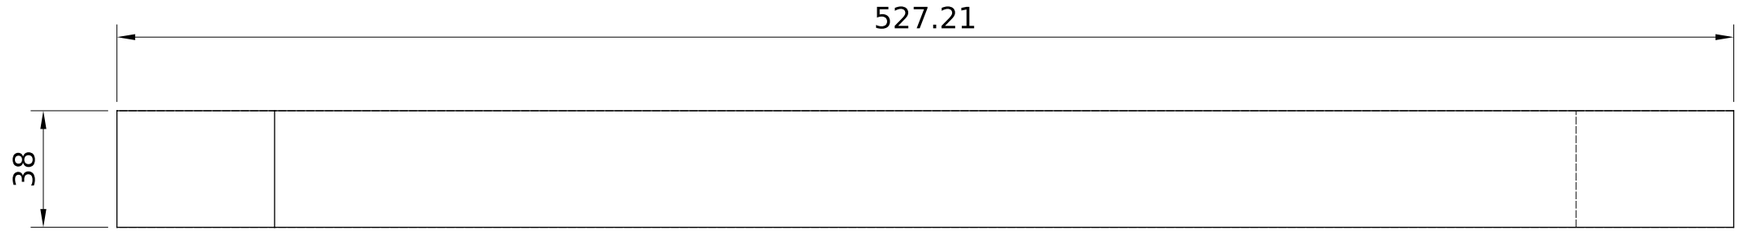


FRONT

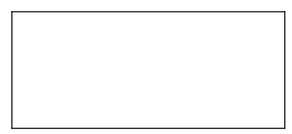


RIGHT

NOTES: 1. QTY 2.
2. CUT FROM 38×89 STOCK, LENGTH 527 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


# R1 · REAR FRONT LEG	SCALE 1:2 MM THIRD ANGLE
BP2-R1 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 1 OF 16 REV A bench_parts

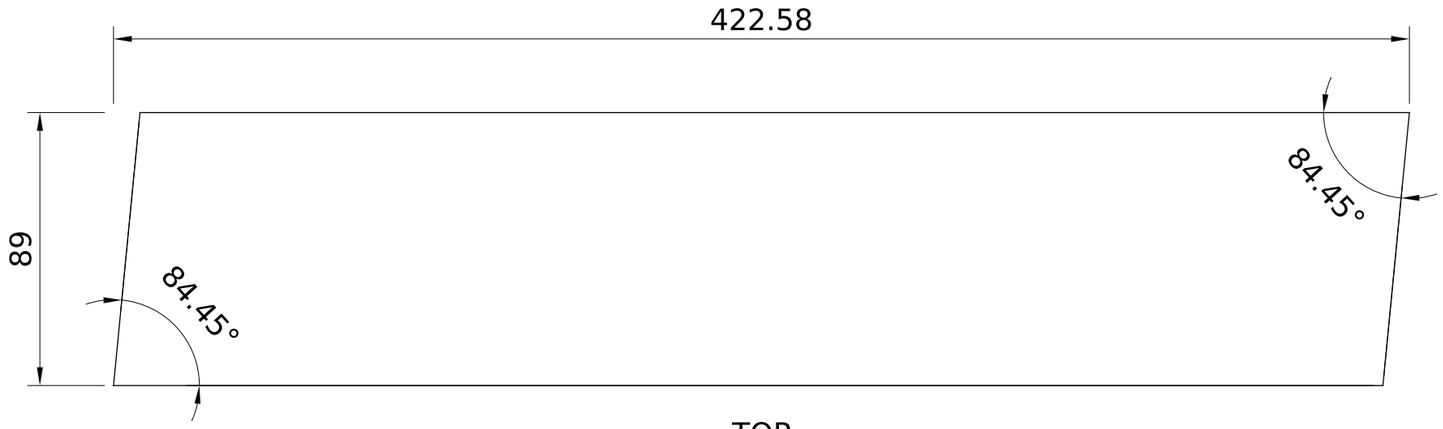

TOP

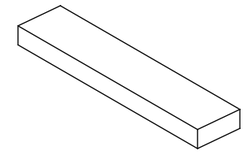

ISOMETRIC 1:10

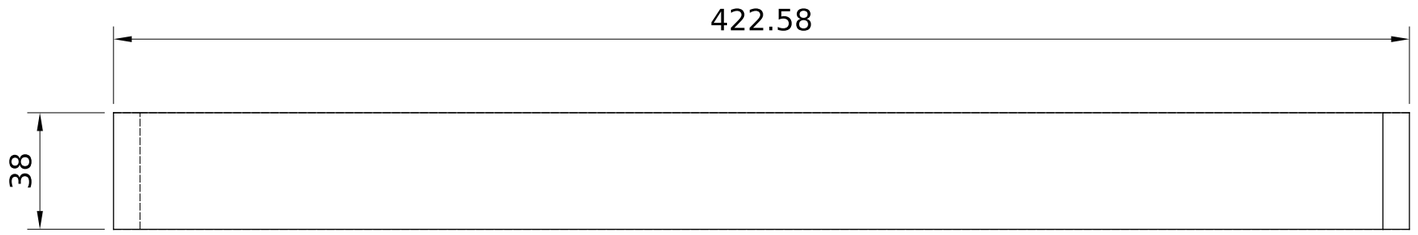


FRONT




RIGHT

NOTES: 1. QTY 2.
2. CUT FROM 38×89 STOCK, LENGTH 423 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


R2 · REAR BACK LEG	SCALE 1:2 MM THIRD ANGLE
BP2-R2 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 2 OF 16 REV A bench_parts

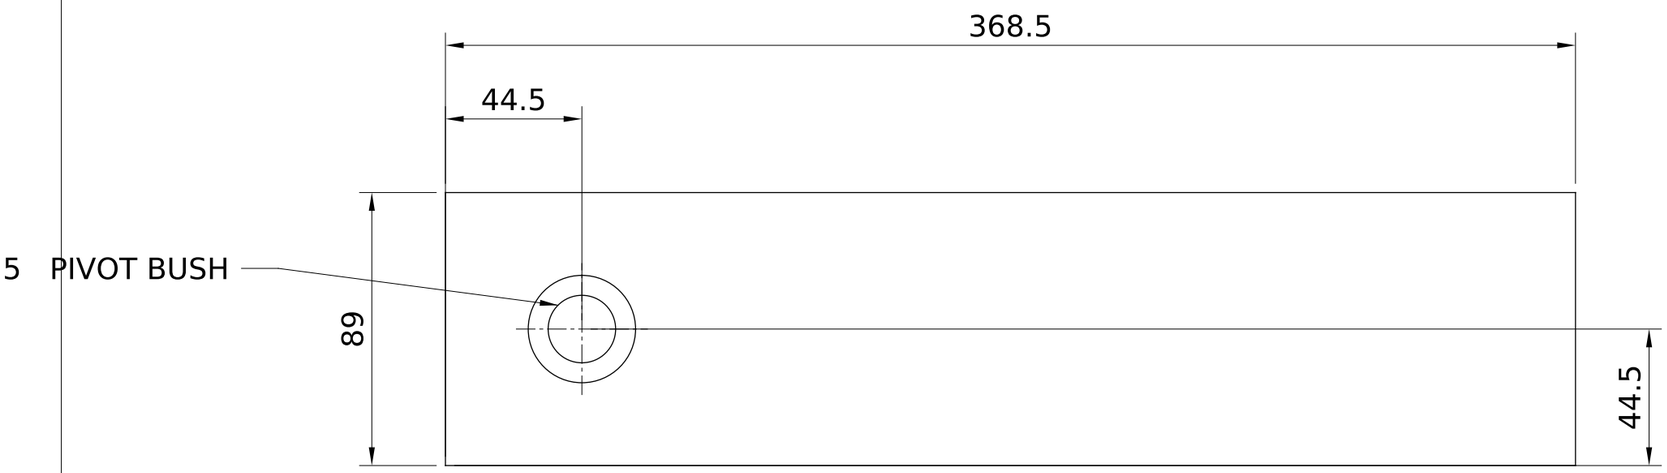

TOP

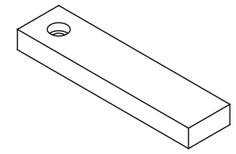

ISOMETRIC 1:9.34

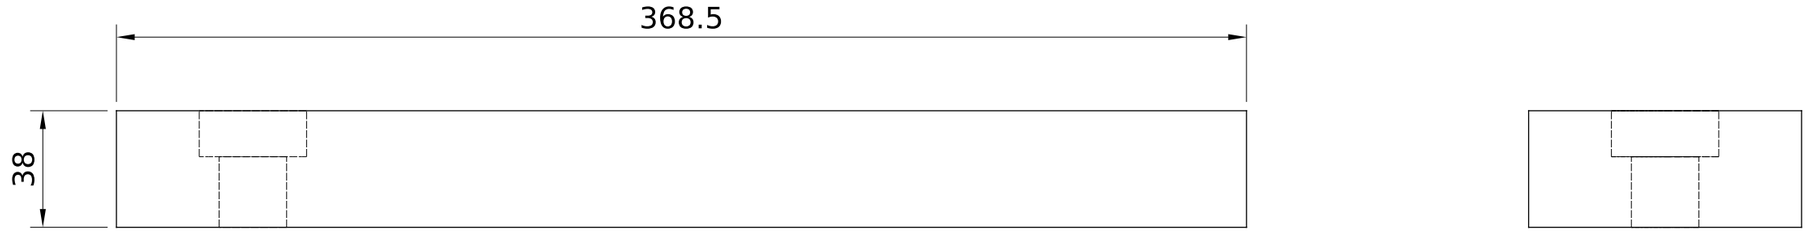


FRONT


RIGHT

NOTES: 1. QTY 2 — MAKE A LEFT AND A RIGHT (COUNTERBORES ON OPPOSITE FACES).
2. CUT FROM 38×89 STOCK, LENGTH 368 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


# R3 · REAR SEAT BEARER	SCALE 1:2 MM THIRD ANGLE
BP2-R3 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 3 OF 16 REV A bench_parts

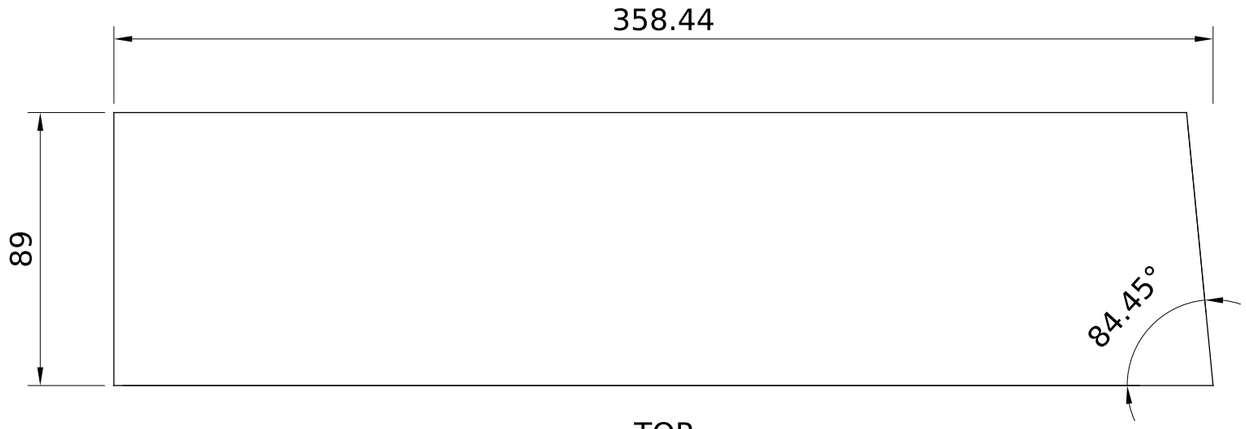

TOP

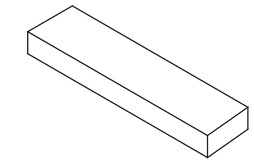

ISOMETRIC 1:8.64

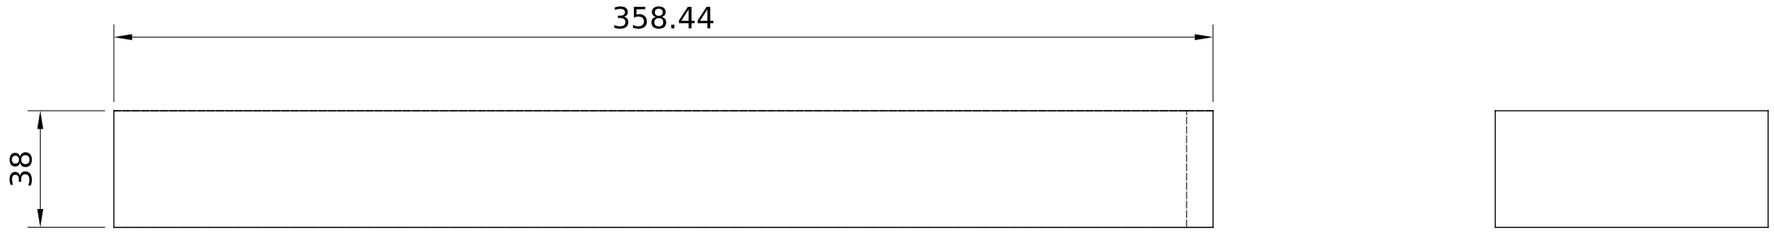


FRONT


RIGHT

NOTES: 1. QTY 2.
2. CUT FROM 38×89 STOCK, LENGTH 358 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


R4 · REAR LOW TIE	SCALE 1:2 MM THIRD ANGLE
BP2-R4 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 4 OF 16 REV A bench_parts

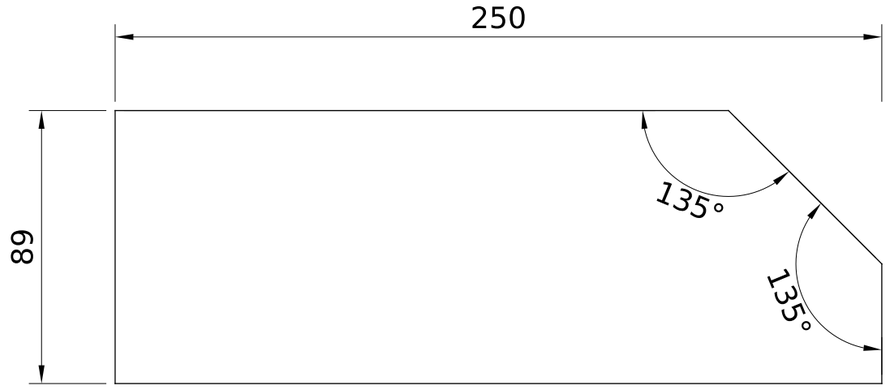


TOP

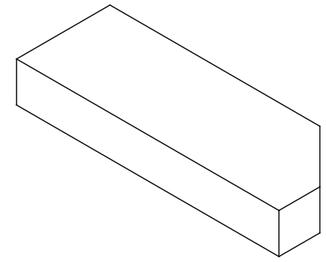

ISOMETRIC 1:4.13

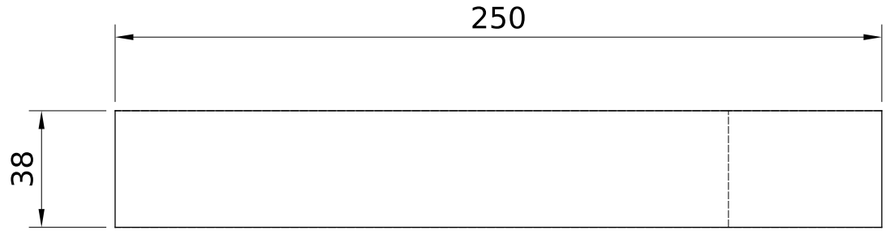


FRONT

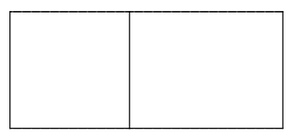


RIGHT

NOTES: 1. QTY 2.
2. CUT FROM 38×89 STOCK, LENGTH 250 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


R5 · REAR ANTI-TIP FOOT	SCALE 1:2 MM THIRD ANGLE
BP2-R5 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 5 OF 16 REV A bench_parts

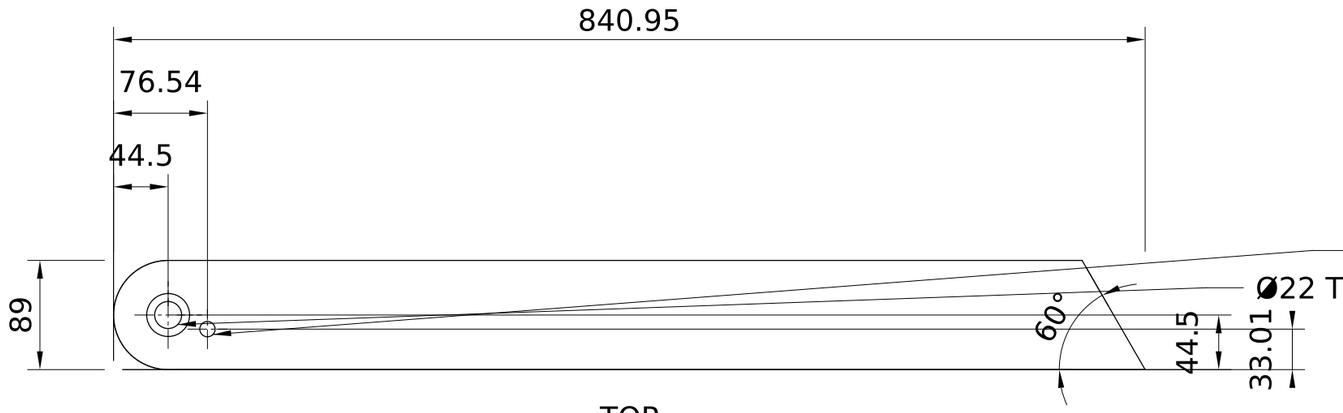

TOP



ISOMETRIC 1:25

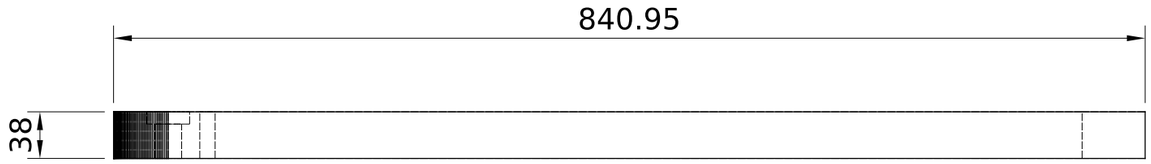


FRONT


RIGHT

NOTES: 1. QTY 2 — MAKE A LEFT AND A RIGHT (COUNTERBORES ON OPPOSITE FACES).
2. CUT FROM 38×89 STOCK, LENGTH 841 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


F1 · FRONT LONG LEG	SCALE 1:5 MM THIRD ANGLE
BP2-F1 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 6 OF 16 REV A bench_parts

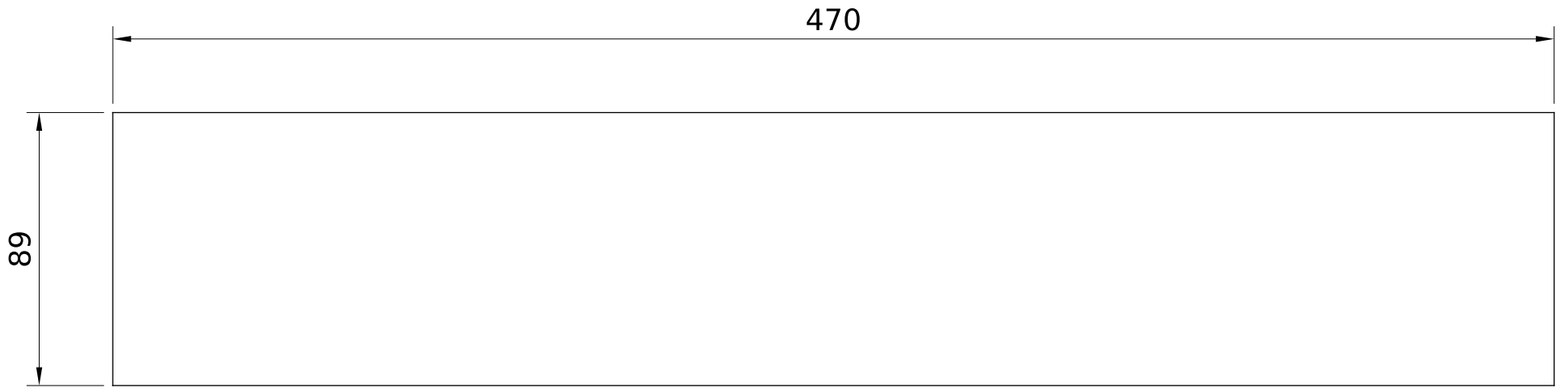


TOP

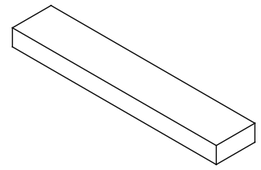

ISOMETRIC 1:10

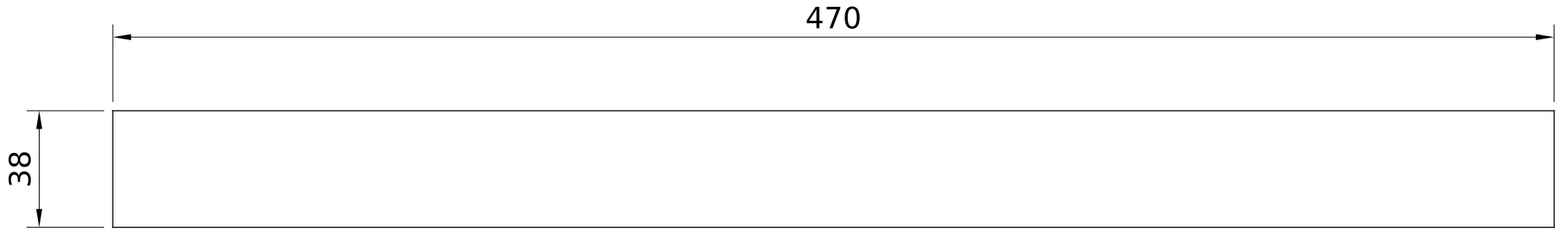


FRONT

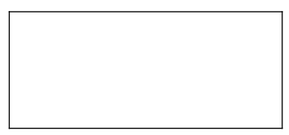


RIGHT

NOTES: 1. QTY 2.
2. CUT FROM 38×89 STOCK, LENGTH 470 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


F2 · FRONT SEAT BEARER	SCALE 1:2 MM THIRD ANGLE
BP2-F2 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 7 OF 16 REV A bench_parts

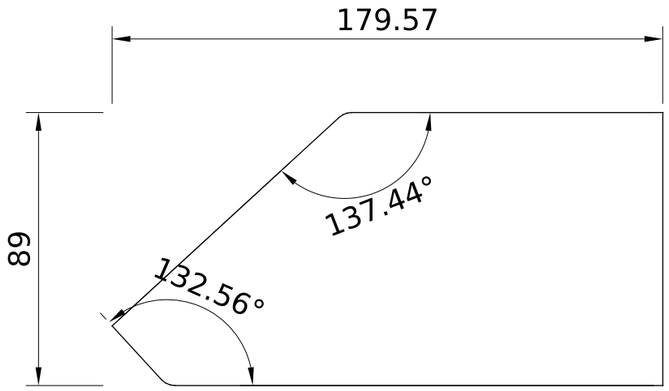


TOP

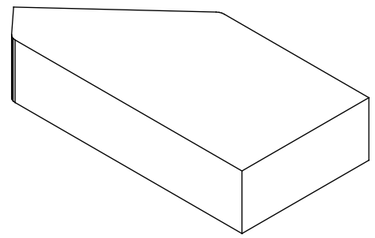

ISOMETRIC 1:3.04

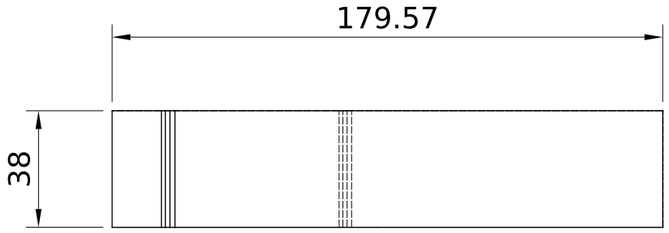


FRONT

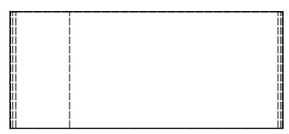


RIGHT

NOTES: 1. QTY 2.
2. CUT FROM 38×89 STOCK, LENGTH 180 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


F3 · FRONT DIAGONAL BRACE	SCALE 1:2 MM THIRD ANGLE
BP2-F3 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 8 OF 16 REV A bench_parts

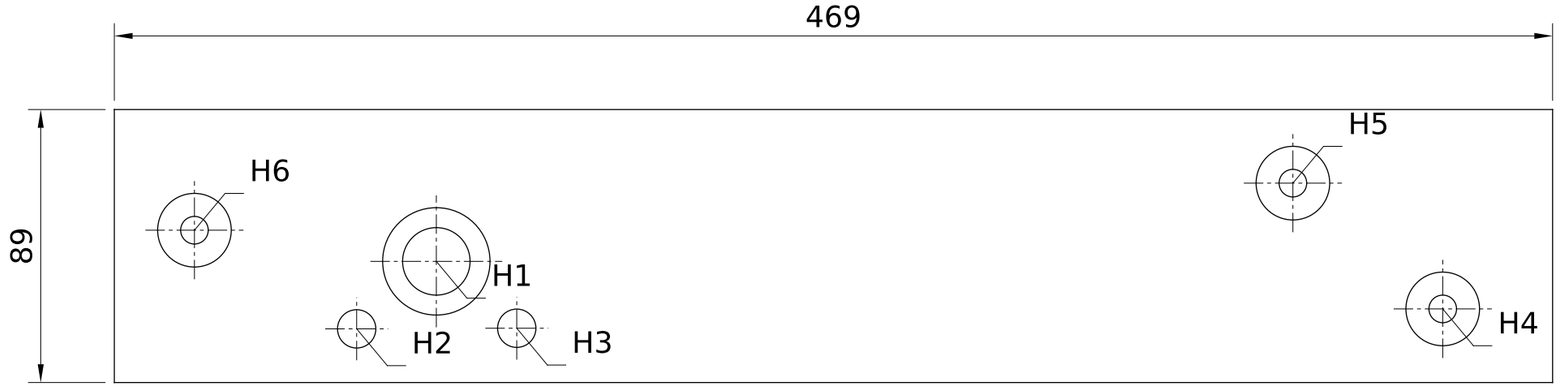


TOP

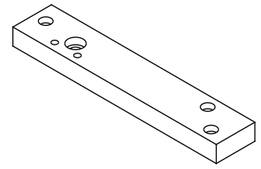

ISOMETRIC 1:10

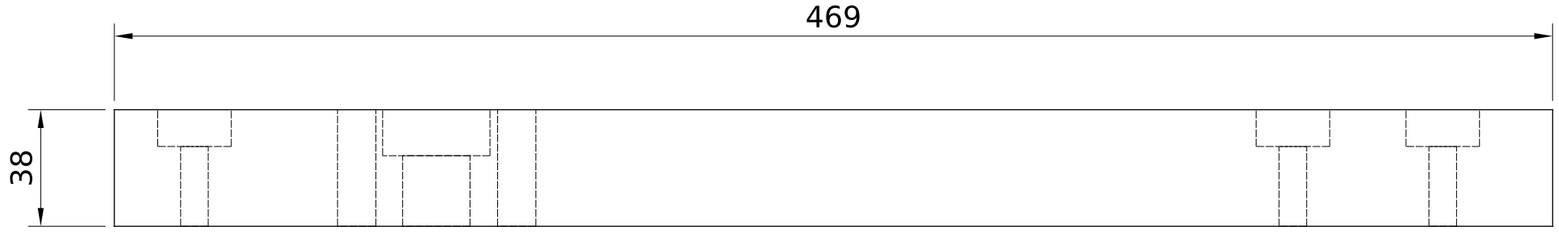


FRONT

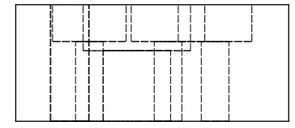


RIGHT

NOTES: 1. QTY 2 — MAKE A LEFT AND A RIGHT (COUNTERBORES ON OPPOSITE FACES).
2. CUT FROM 38×89 STOCK, LENGTH 469 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.
5. H1: X 105.0 Y 39.5 Ø22 THRU, CB Ø35×15 (FROM LOWER-LEFT CORNER, TOP VIEW)
6. H2: X 79.0 Y 17.5 Ø12.5 THRU (FROM LOWER-LEFT CORNER, TOP VIEW)
7. H3: X 131.2 Y 17.7 Ø12.5 THRU (FROM LOWER-LEFT CORNER, TOP VIEW)
8. H4: X 433.2 Y 24.0 Ø9 THRU, CB Ø24×12 (FROM LOWER-LEFT CORNER, TOP VIEW)
9. H5: X 384.3 Y 65.0 Ø9 THRU, CB Ø24×12 (FROM LOWER-LEFT CORNER, TOP VIEW)
10. H6: X 26.1 Y 49.7 Ø9 THRU, CB Ø24×12 (FROM LOWER-LEFT CORNER, TOP VIEW)


# T1 · TABLE / BACK BEARER	SCALE 1:2 MM THIRD ANGLE
BP2-T1 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 9 OF 16 REV A bench_parts

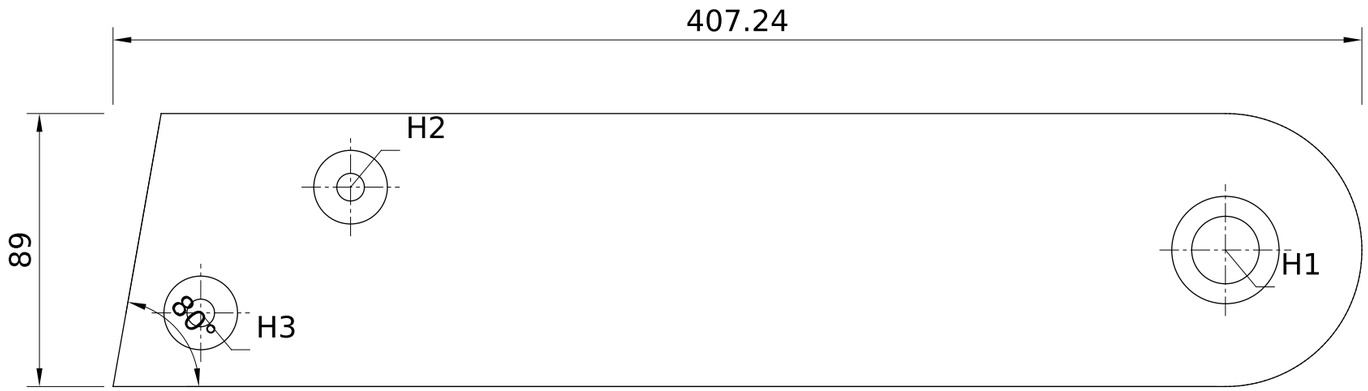

TOP

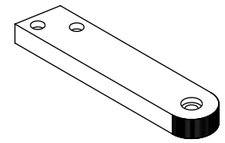

ISOMETRIC 1:10

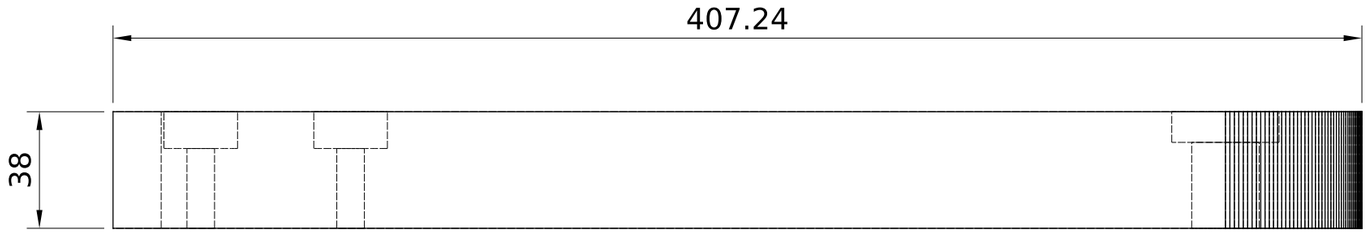


FRONT


RIGHT

NOTES: 1. QTY 2 — MAKE A LEFT AND A RIGHT (COUNTERBORES ON OPPOSITE FACES).
2. CUT FROM 38×89 STOCK, LENGTH 407 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.
5. H1: X 362.7 Y 44.5 Ø22 THRU, CB Ø35×10 (FROM LOWER-LEFT CORNER, TOP VIEW)
6. H2: X 77.5 Y 65.0 Ø9 THRU, CB Ø24×12 (FROM LOWER-LEFT CORNER, TOP VIEW)
7. H3: X 28.6 Y 24.0 Ø9 THRU, CB Ø24×12 (FROM LOWER-LEFT CORNER, TOP VIEW)


T2 · PIVOT EXTENSION	SCALE 1:2 MM THIRD ANGLE
BP2-T2 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 10 OF 16 REV A bench_parts

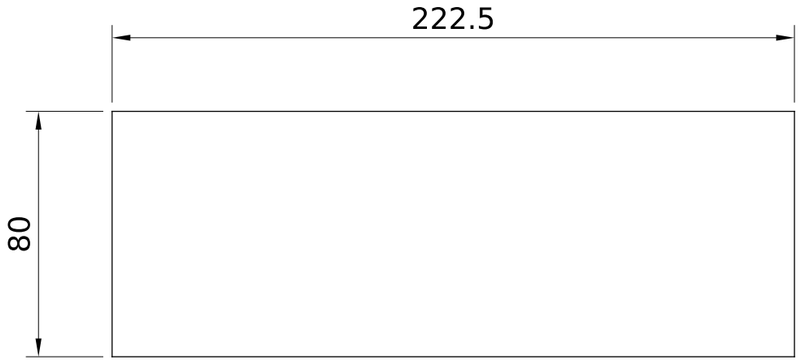

TOP

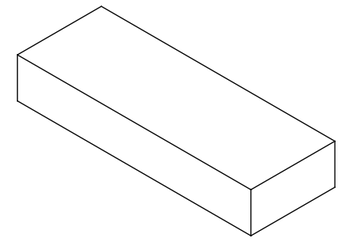

ISOMETRIC 1:4.13

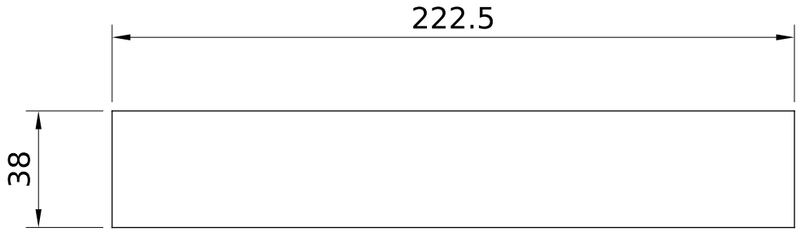


FRONT


RIGHT

NOTES: 1. QTY 2.
2. CUT FROM 38×89 STOCK, LENGTH 222 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


S1 · BENCH BEARING STOP	SCALE 1:2 MM THIRD ANGLE
BP2-S1 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 11 OF 16 REV A bench_parts

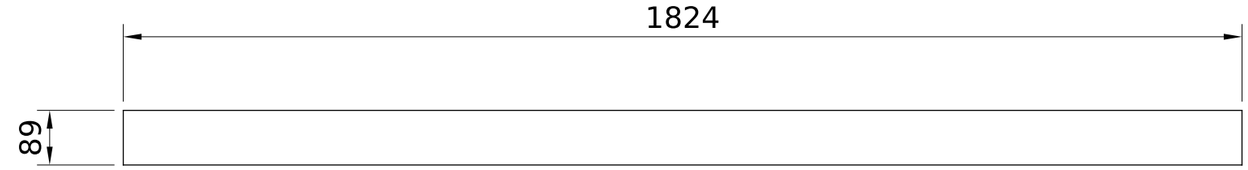

TOP



ISOMETRIC 1:50

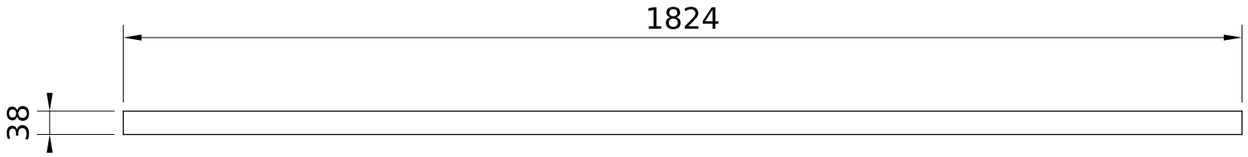


FRONT




RIGHT

NOTES: 1. QTY 4.
2. CUT TO 1824 MM.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


S2 · FRONT SEAT BOARD	SCALE 1:10 MM THIRD ANGLE
BP2-S2 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 12 OF 16 REV A bench_parts

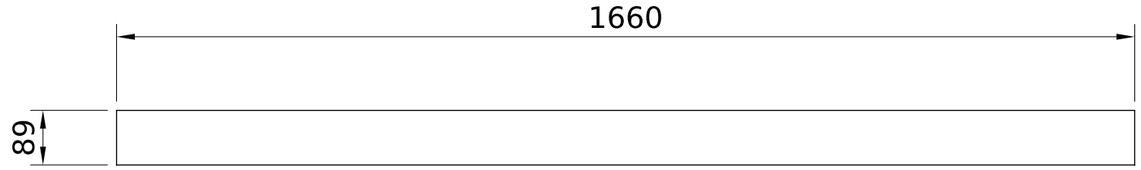

TOP



ISOMETRIC 1:50

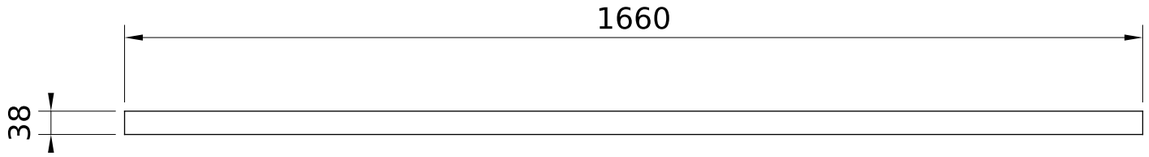


FRONT




RIGHT

NOTES: 1. QTY 2.
2. CUT TO 1660 MM.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


S3 · REAR SEAT BOARD	SCALE 1:10 MM THIRD ANGLE
BP2-S3 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 13 OF 16 REV A bench_parts

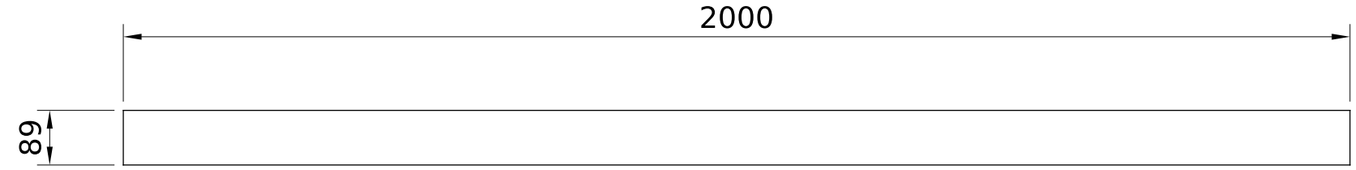

TOP



ISOMETRIC 1:50

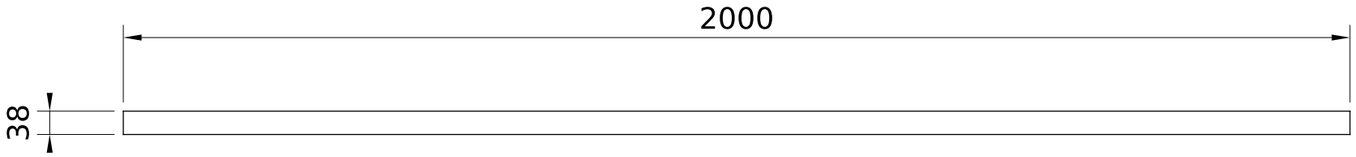


FRONT




RIGHT

NOTES: 1. QTY 5.
2. CUT TO 2000 MM.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


S4 · TABLE / BACK BOARD	SCALE 1:10 MM THIRD ANGLE
BP2-S4 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 14 OF 16 REV A bench_parts

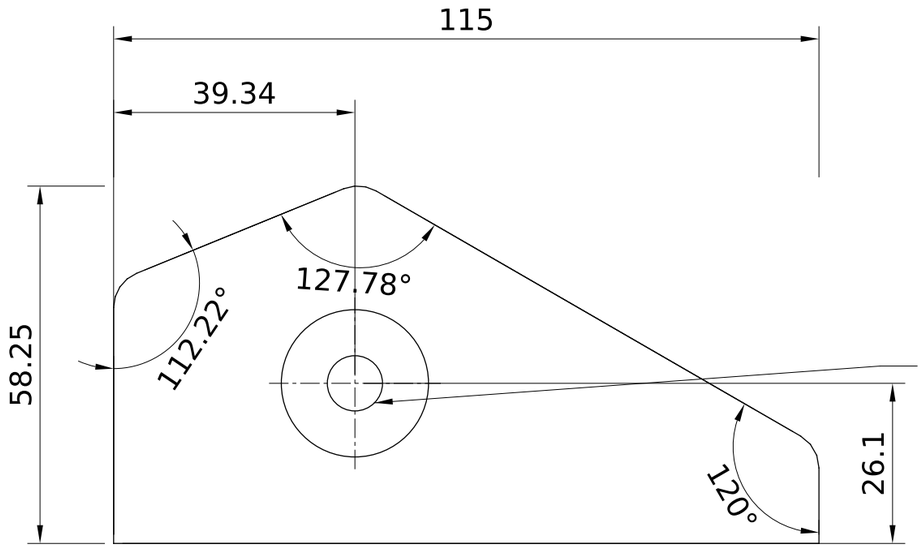

TOP

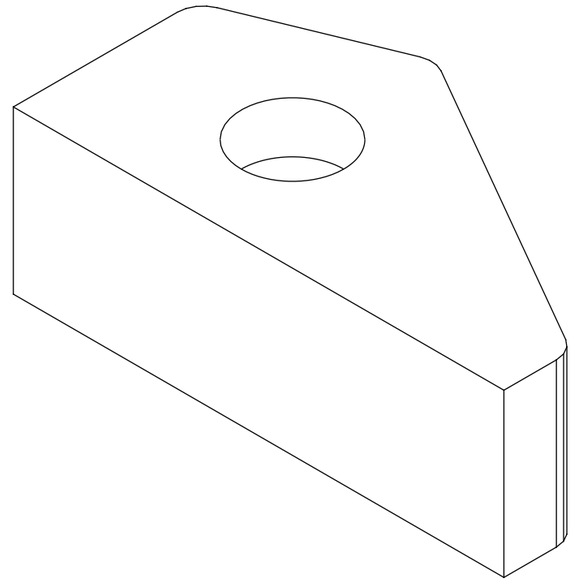

ISOMETRIC 1:1.02

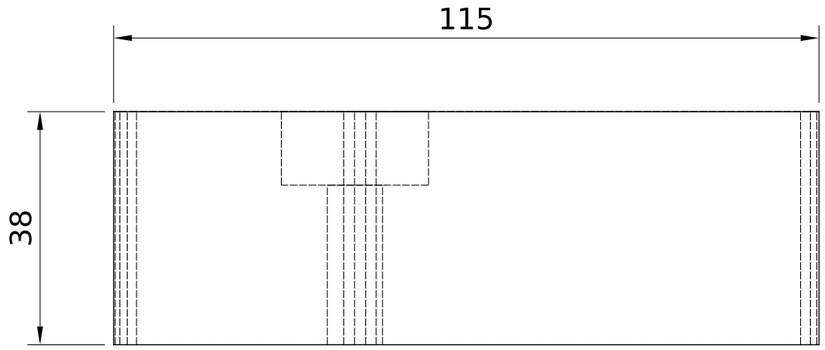


FRONT


RIGHT

NOTES: 1. QTY 2 — MAKE A LEFT AND A RIGHT (COUNTERBORES ON OPPOSITE FACES).
2. CUT FROM 38×89 STOCK, LENGTH 115 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.


T4 · TABLE SPREAD STOP	SCALE 1:1 MM THIRD ANGLE
BP2-T4 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 15 OF 16 REV A bench_parts

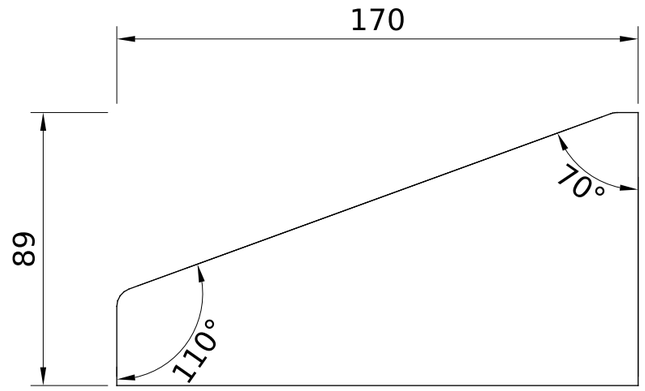


TOP

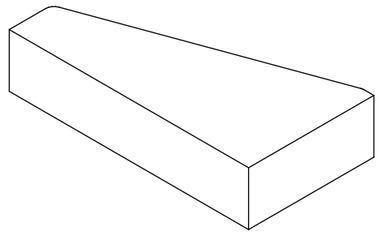

ISOMETRIC 1:3.08

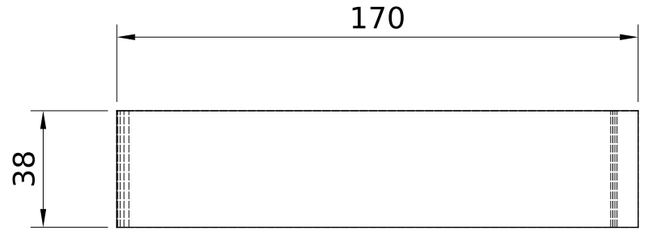

FRONT

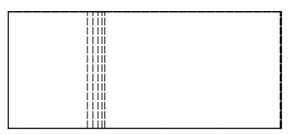

RIGHT

NOTES: 1. QTY 2.
2. CUT FROM 38×89 STOCK, LENGTH 170 MM BEFORE ANGLE CUTS.
3. ANGLES ARE SAW CUTS BETWEEN THE FACES SHOWN; ROUNDED CORNERS R6–R10 AFTER CUTTING.
4. BREAK ALL ARRISES R3. SEAL EVERY CUT END AND BORE.

T5 · BENCH STOP WEDGE	SCALE 1:2 MM THIRD ANGLE
BP2-T5 · PINE 38×89 PLANED, PRESSURE-TREATED · bench-project	SHEET 16 OF 16 REV A bench_parts