
POWER METAL OXIDE SEMICONDUCTOR FIELD EFFECT TRANSISTOR (POWER MOS FET) INSPECTION [FULL-AUTO AIR CONDITIONER]

id0740a1800300

- 1. Verify that the continuity between the power MOS FET terminals is as indicated in the table.
 - If there is any malfunction, replace the power MOS FET.
 - If the blower motor operation is not normal even though no malfunction can be verified, inspect the climate control unit. (See CLIMATE CONTROL UNIT INSPECTION [FULL-AUTO AIR CONDITIONER].)

| Tester lead | | Resistance (kilohm) |
|-------------|---|---------------------|
| + | - | Resistance (knomin) |
| Α | В | ∞ |
| Α | E | 9.7 |
| В | Α | ∞ |
| В | E | ∞ |
| E | Α | 9.7 |
| E | В | ∞ |

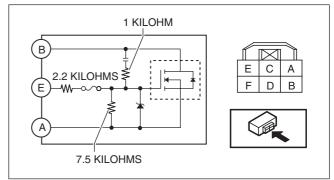

ac5wzw00002767