## D-PILLAR REINFORCEMENT (LOWER) INSTALLATION [PANEL REPLACEMENT]

id098008829400


## **Symbol Mark**

SYMBOL MARK	MEANING
•	SPOT WELDING
	PLUG WELDING (ARC WELDING)

ac5wzb00000230

## **Installation Procedure**

- 1. When installing new parts, measure and adjust the body as necessary to conform with standard dimensions.
- 2. Drill holes for the plug welding before installing the new parts.
- After temporarily installing new parts, make sure the related parts fit properly.
  Plug weld the 2 locations indicated by (A) shown in the figure.
- 5. Spot weld the 8 locations indicated by (B) shown in the figure, then install the D-pillar reinforcement (lower).

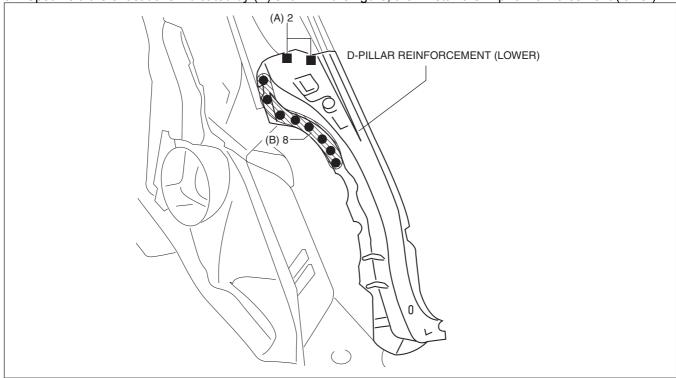

ac5wzb00000296