

32321348

Issue D

**Datasheet** 

RSC Series—High Resolution, High Accuracy, Compensated  $\pm 1.6$  mbar to  $\pm 10$  bar  $|\pm 160$  Pa to  $\pm 1$  MPa  $|\pm 0.5$  inH $_2$ O to  $\pm 150$  psi 24-bit Digital SPI-Compatible Output



### **DESCRIPTION**

The RSC Series is a piezoresistive silicon pressure sensor offering a digital output for reading pressure over the specified full scale pressure span and temperature range. It is calibrated and temperature compensated for sensor offset, sensitivity, temperature effects, and non-linearity using a 24-bit analog-to-digital converter with integrated EEPROM. Pressure data may be acquired at rates between 20 and 2000 samples per second over an SPI interface. It is intended for use with non-corrosive, non-ionic gases, such as air and other dry gases, designed and manufactured according to ISO 9001 standards, and is REACH and RoHS compliant.

### **VALUE TO CUSTOMERS**

- Enhances performance: Output accelerates performance through reduced conversion requirements and direct interface to microprocessors. Proprietary Honeywell technology combines high sensitivity with high burst and over pressure while providing industry leading stability (performance factors difficult to achieve in the same sensor), providing flexibility in implementation and minimizing requirements for protecting the sensor without sacrificing ability to sense very small changes in pressure.
- Cost-effective, high volume solution with a variety of options.
- Enhances reliability: High burst pressures promote system reliability, minimize downtime, and can simplify design. High working pressures allow ultra-low sensors to be used continuously above the calibrated pressure range.
- continuously above the calibrated pressure range.

   Easy to design in: Package is small when compared to many similar sensors, occupying less area on the PCB. Port and housing options simplify integration. Wide pressure range simplifies use.
- Meets IPC/JEDEC J-STD-020D.1 Moisture Sensitivity Level 1 requirements: Allows avoidance of thermal and mechanical damage during solder reflow attachment and/or repair that lesser rated sensors would incur, allows unlimited floor life when stored as specified (simplifying storage and reducing scrap), eliminates lengthy bakes prior to reflow, and allows for lean manufacturing due to stability and usability shortly after reflow.
- Energy efficient: Reduces system power requirements and enables extended battery life.

### **FEATURES**

- Pressure range: ±1.6 mbar to ±10 bar | ±160 Pa to ±1 MPa | ±0.5 inH<sub>2</sub>0 to ±150 psi; absolute range 1 bar to 8 bar | 15 psi to 150 psi
- Pressure types: Absolute: internal vacuum reference and an output value proportional to absolute pressure; Gage: referenced to atmospheric pressure and provide an output proportional to pressure variations from atmosphere; Differential: allows measurement of pressure between the two pressure ports
- Total Error Band: As low as ±0.25 %FSS depending on pressure range (after auto zero)
- Accuracy: ±0.1 %FSS BFSL (Full Scale Span Best Fit Straight Line)
- Compensated temperature range: -40°C to 85°C [-40°F to 185°F]
- Power consumption: Less than 10 mW, typ.
- Size: Miniature 10 mm x 12,5 mm [0.39 in x 0.49 in] package
- Output: 24-bit digital SPI-compatible
- Meets IPC/JEDEC J-STD-020D.1 Moisture Sensitivity Level 1 requirements

### **DIFFERENTIATION**

- Industry-leading long-term stability: Minimizes system calibration needs and significantly reduces downtime.
- Industry-leading accuracy: Reduces software to correct system inaccuracies, which minimizes design time, helps improve efficiency, and often simplifies development.
- Industry-leading flexibility: Modular design with many package styles and options simplify integration.
- Total Error Band: Provides true performance over the compensated temperature range, which eliminates the need to test and calibrate every sensor, thereby reducing manufacturing cost. Improves system accuracy and offers ease of sensor interchangeability due to minimal part-topart variation (see Figure 1 on page 3).

### **POTENTIAL APPLICATIONS**

- Medical: Airflow monitors, anesthesia machines, blood analysis machines, gas chromatography, gas flow instrumentation, hospital room air pressure, kidney dialysis machines, nebulizers, pneumatic controls, respiratory machines, sleep apnea equipment, spirometers, ventilators
- Industrial: Barometry, drones, flow calibrators, gas chromatography, gas flow instrumentation, HVAC clogged filter detection, HVAC systems, HVAC transmitters, indoor air quality, life sciences, pneumatic control, VAV (Variable Air Volume) control, weather balloons

### **PORTFOLIO**

Honeywell offers a variety of board mount pressure sensors for potential use in medical and industrial applications. Our categories of pressure sensor measurement include absolute, differential, gage or vacuum gage, with unamplified or amplified sensors and covering a wide pressure range.

### **Table of Contents**

Gene	eral Specifications	3-5
Nom	nenclature and Order Guide	6
Press	sure Range Specifications	
±1.6	6 mbar to ±10 bar	
±16	60 Pa to ±1 MPa	88
±0.5	5 inH <sub>2</sub> O to ±150 psi	
Dime	ensional Drawings	
DIP	Packages	10-12
SM	IT Packages	12-14
Reco	ommended PCB Pad Layouts	14
Pino	ut	14
Reco	ommended Circuit	15
1.0	System Overview	16
	1.1 Major System Blocks	16
	1.2 High-level Operating Sequence	16
	1.3 Compensation Mathematics	17
2.0	System Initialization – EEPROM.	18
	2.1 EEPROM Contents	18-19
	2.2 EEPROM Communication	20-21
3.0	System Operation – ADC	21
	3.1 ADC Communications and Initialization	22
	3.2 Programming the Data Rate and Pressure/Temperature Modes	22
	3.3 ADC Reset Command	
	3.4 ADC Programming Sequence – Power Up	23
	3.5 ADC Programming and Read Sequence – Temperature Reading	23-24
	3.6 ADC Programming and Read Sequence – Pressure Reading	24
4.0	Example Software	25
	4.1 Data Types	25
	4.2 Function Descriptions – Pressure_Comp.c	25-26
	4.3 Checksum Calculation	26
	4.4 Compensation Sequence	27
	4.5 Constraints	27
5.0	Sensor Offset Zero Correction Procedure	28
Addit	tional Information	back page

**RSC Series** 

Figure 1. TEB Components for TruStability™ Board Mount Pressure Sensors

### **All Possible Errors**

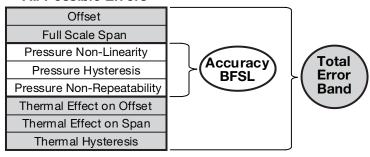


Table 1. Absolute Maximum Ratings<sup>1</sup>

Characteristic	Min.	Max.	Unit
Supply voltage (V <sub>supply</sub> )	2.7	6.0	Vdc
Voltage on any pin	-0.3	V <sub>supply</sub> + 0.3	V
Digital interface clock frequency	_	5	MHz
ESD susceptibility (human body model)	_	2	kV
Storage temperature	-40 [-40]	85 [185]	°C [°F]
Soldering time and temperature: lead solder temperature (DIP) peak reflow temperature (SMT)		4 s max. at 250°C [482°F] 15 s max. at 250°C [482°F]	

 $<sup>^{1}\!</sup>$ Absolute maximum ratings are the extreme limits the device will withstand without damage.

### **Table 2. Environmental Specifications**

Characteristic	Parameter
Humidity (gases only)	0% to 95% RH, non-condensing
Vibration	15 g, 10 Hz to 2 Hz
Shock	100 g, 6 ms duration
Life <sup>1</sup>	1 million pressure cycles minimum
Solder reflow	J-STD-020-D.1 Moisture Sensitivity Level 1 (unlimited shelf life when stored at <30°C/85 % RH)

 $<sup>^{1}\</sup>mbox{Life}$  may vary depending on specific application in which the sensor is utilized.

### Table 3. Wetted Materials<sup>1</sup>

Component	Port 1 (Pressure Port)	Port 2 (Reference Port)
Ports and covers	high temperature polyamide	high temperature polyamide
Substrate	alumina ceramic	alumina ceramic
Adhesives	epoxy, silicone	epoxy, silicone
Electronic components	plastic, silicon, glass, solder	silicon, glass, gold

 $<sup>^{1}\</sup>mbox{Contact}$  Honeywell Customer Service for detailed material information.

### **Table 4. Sensor Pressure Types**

<b>Pressure Type</b>	Description
Absolute	Output is proportional to the difference between applied pressure and a built-in vacuum reference.
Differential	Output is proportional to the difference between the pressures applied to each port (Port 1 – Port 2).
Gage	Output is proportional to the difference between applied pressure and atmospheric (ambient) pressure.

**Table 5. Digital Operating Specifications** 

Characteristic	Min.	Тур.	Max.	Unit
Supply voltage (V <sub>supply</sub> ): <sup>1,2,3</sup> pressure ranges ≥60 mbar   6 kPa   1 psi: 3.3 Vdc 5.0 Vdc  pressure ranges ≤40 mbar   4 kPa   20 inH <sub>2</sub> 0: 3.3 Vdc 5.0 Vdc	3.0 4.75 3.27 4.95	3.3 5.0 3.3 5.0	3.6 5.25 3.33 5.05	Vdc
	4.95	5.0	5.05	
Supply current: 3.3 Vdc: standby mode active mode 5.0 Vdc: standby mode active mode	- - -	1.3 1.7 2.1 2.6	_ _ _ _	mA
Operating temperature range <sup>4</sup>	-40 [-40]	_	85 [185]	°C [°F]
Compensated temperature range: <sup>5</sup> medical industrial extended	0 [32] -20 [-4] -40 [-40]	- - -	50 [122] 85 [185] 85 [185]	°C [°F]
Startup time (power up to data ready)	_	_	0.3	ms
Data rate	20, 40, 45, 9	0, 175, 180, 330, 35 1000, 1200, 2000	50, 600, 660,	samples per second
SPI voltage level: low high	_ 80		20 —	%Vsupply
Pull up on MISO, SCLK, CS_ADC, CS_EE, MOSI	1	_	_	kOhm
Accuracy <sup>6</sup>	_	_	0.1	%FSS BFSL <sup>6</sup>
Orientation sensitivity ( $\pm 1$ g): <sup>7,9</sup> pressure ranges $\le 40$ mbar   4 kPa   20 inH $_2$ 0 pressure ranges $\le 2.5$ mbar   250 Pa   1 inH $_2$ 0		±0.1 ±0.2	<u>-</u>	%FSS <sup>8</sup>

<sup>&</sup>lt;sup>1</sup>Sensors are either 3.3 Vdc or 5.0 Vdc based on the catalog listing selected.

<sup>&</sup>lt;sup>2</sup>Ratiometricity of the sensor (the ability of the device output to scale to the supply voltage) is achieved within the specified operating voltage.

<sup>&</sup>lt;sup>3</sup>The sensor is not reverse polarity protected. Incorrect application of supply voltage or ground to the wrong pin may cause electrical failure.

<sup>&</sup>lt;sup>4</sup>Operating temperature range: The temperature range over which the sensor will produce an output proportional to pressure.

<sup>&</sup>lt;sup>5</sup>Compensated temperature range: The temperature range over which the sensor will produce an output proportional to pressure within the specified performance limits (Total Error Band).


<sup>&</sup>lt;sup>6</sup>Accuracy: The maximum deviation in output from a Best Fit Straight Line (BFSL) fitted to the output measured over the pressure range. Includes all errors due to pressure non-linearity, pressure hysteresis, and non-repeatability.

Orientation sensitivity: The maximum change in offset of the sensor due to a change in position or orientation relative to Earth's gravitational field.

<sup>&</sup>lt;sup>8</sup>Full Scale Span (FSS): The algebraic difference between the output signal measured at the maximum (Pmax.) and minimum (Pmin.) limits of the pressure range. (See Figure 1 for ranges.)

 $<sup>^{9}</sup>$ Insignificant for pressure ranges above 40 mbar | 4 kPa | 20 inH $_{2}$ 0.

Figure 2. SPI Timing Requirements<sup>1</sup>

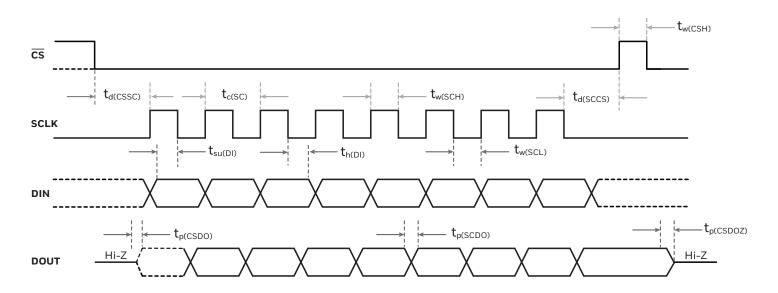

Characteristic	Description	Min.	Max.	Unit
t <sub>d(CSSC)</sub>	delay time; CS falling edge to first SCLK rising edge	50	_	ns
t <sub>d(SCCS)</sub>	delay time,;final SCLK falling edge to $\overline{\text{CS}}$ rising edge	30	_	ns
t <sub>w(CSH)</sub>	pulse duration; CS high	80	_	ns
t <sub>c(SC)</sub>	SCLK period	150	_	ns
t <sub>w(SCH)</sub>	pulse duration; SCLK high	75	_	ns
t <sub>w(SCL)</sub>	pulse duration; SCLK low	75	_	ns
t <sub>su(DI)</sub>	setup time; DIN valid before SCLK falling edge	50	_	ns
t <sub>h(DI)</sub>	hold time; DIN valid after SCLK falling edge	25	_	ns
t <sub>p(CSDO)</sub>	propagation delay time; CS falling edge to DOUT driven	_	50	ns
t <sub>p(SCDO)</sub>	propagation delay time; SCLK rising edge to valid new DOUT	0	50	ns
t <sub>p(CSDOZ)</sub>	propagation delay time; $\overline{\text{CS}}$ rising edge to DOUT high impedance	_	50	ns

 $<sup>^1\!</sup>$ Single byte communication is shown. Actual communication may be several bytes.

**RSC Series** 

Figure 3. Nomenclature and Order Guide

For example, RSCDNNM150PGSE3 defines an RSC Series TruStability™ Pressure Sensor, DIP package, NN pressure port, medical compensated temperature range, 150 psi gage pressure range, SPI output type, external math transfer function, 3.3 Vdc supply voltage.

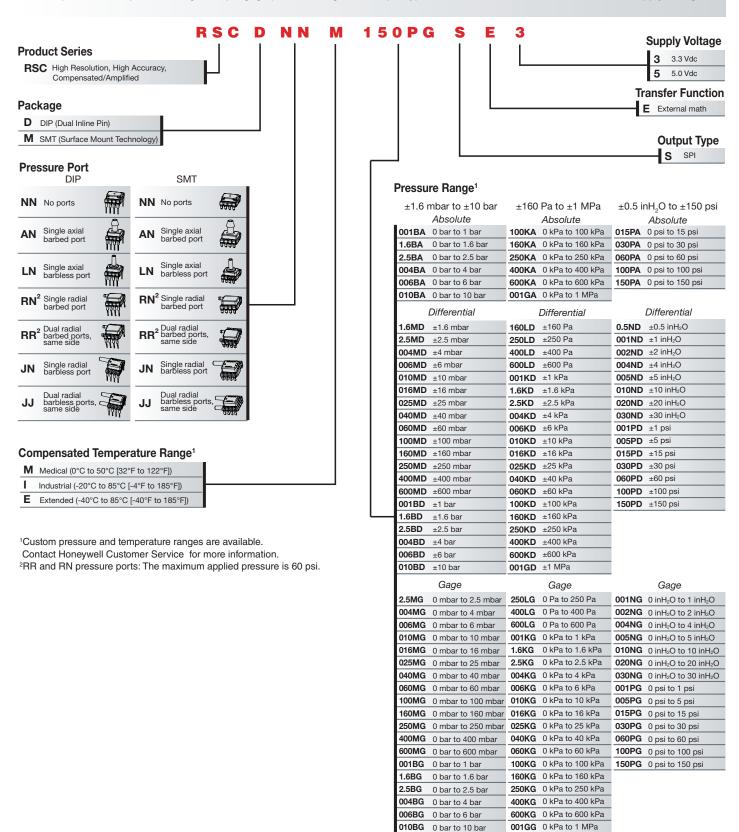


Table 6. Pressure Range Specifications for ±1.6 mbar to ±10 bar

Pressure Range	Rar	ssure nge X & E &	11	Working	Over	Burst	Common	Total Error	Total Error Band after	Long-term Stability	Effective Number of
(see Figure 3)	Pmin.		Unit	Pressure <sup>1</sup>	Pressure <sup>2</sup>	Pressure <sup>3</sup>	Mode Pressure <sup>4</sup>	Band⁵ (%FSS)	Auto-Zero <sup>6</sup> (%FSS)	1000 hr, 25°C (%FSS)	
						Absol	ute				
001BA	0	1	bar	_	2	4	_	±0.75	±0.25	±0.25	16
1.6BA	0	1.6	bar	_	4	8	_	±0.75	±0.25	±0.25	16
2.5BA	0	2.5	bar	_	6	8	_	±0.75	±0.25	±0.25	16
004BA	0	4	bar	_	8	16	_	±0.75	±0.25	±0.25	16
006BA	0	6	bar		17	17	_	±0.75	±0.25	±0.25	15
010BA	0	10	bar	_	17	17	_	±0.75	±0.25	±0.25	16
						Differe	ntial				
1.6MD	-1.6	1.6	mbar	335	675	1000	3450	±3	±0.5	±0.5	16
2.5MD	-2.5	2.5	mbar	335	675	1000	3450	±2	±0.5	±0.35	14
004MD	-4	4	mbar	335	675	1000	3450	±2	±0.5	±0.35	15
006MD	-6	6	mbar	335	675	1000	3450	±2	±0.5	±0.35	16
010MD	-10	10	mbar	375	750	1250	5450	±0.75	±0.25	±0.25	16
016MD	-16	16	mbar	375	750	1250	5450	±1	±0.25	±0.25	17
025MD	-25	25	mbar	435	850	1350	10450	±1	±0.25	±0.25	18
040MD	-40	40	mbar	435	850	1350	10450	±0.75	±0.25	±0.25	15
060MD	-60	60	mbar	_	850	1000	10000	±0.75	±0.25	±0.25	15
100MD	-100	100	mbar	_	1400	2500	10000	±0.75	±0.25	±0.25	15
160MD	-160		mbar	_	1400	2500	10000	±0.75	±0.25	±0.25	16
250MD	-250		mbar	_	1400	2500	10000	±0.75	±0.25	±0.25	16
400MD		400	mbar		2000	4000	10000	±0.75	±0.25	±0.25	15
600MD	-600	600	mbar	_	2000	4000	10000	±0.75	±0.25	±0.25	16
001BD	-1	1	bar		4	8	10	±0.75	±0.25	±0.25	16
1.6BD	-1.6	1.6	bar	_	8	16	10	±0.75	±0.25	±0.25	16
2.5BD	-2.5	2.5	bar		8	16	10	±0.75	±0.25	±0.25	16
004BD	-4.0	4.0	bar	_	16	17	10	±0.75	±0.25	±0.25	16
006BD	-6	6	bar		17	17	17	±0.75	±0.25	±0.25	16
010BD	-10	10	bar	_	17	17	17	±0.75	±0.25	±0.25	17
						Gag	е				
2.5MG	0	2.5	mbar	335	675	1000	3450	±3	±0.5	±0.5	15
004MG	0	4	mbar	335	675	1000	3450	±3	±0.5	±0.5	16
006MG	0	6	mbar	335	675	1000	3450	±2	±0.5	±0.35	15
010MG	0	10	mbar	335	675	1000	3450	±0.75	±0.25	±0.35	15
016MG	0	16	mbar	335	675	1000	3450	±0.75	±0.25	±0.25	16
025MG	0	25	mbar	375	750	1250	5450	±1	±0.25	±0.25	17
040MG	0	40	mbar	375	750	1250	5450	±0.75	±0.25	±0.25	15
060MG	0	60	mbar	_	850	1000	5450	±0.75	±0.25	±0.25	14
100MG	0	100	mbar	_	850	1000	10000	±0.75	±0.25	±0.25	15
160MG	0	160	mbar	_	850	1000	10000	±0.75	±0.25	±0.25	16
250MG	0	250	mbar	_	1400	2500	10000	±0.75	±0.25	±0.25	15
400MG	0	400	mbar	_	2000	4000	10000	±0.75	±0.25	±0.25	14
600MG	0	600	mbar		2000	4000	10000	±0.75	±0.25	±0.25	15
001BG	0	1	bar	_	2	4	10	±0.75	±0.25	±0.25	16
1.6BG	0	1.6	bar		4	8	10	±0.75	±0.25	±0.25	16
2.5BG	0	2.5	bar	_	8	16	10	±0.75	±0.25	±0.25	15
004BG	0	4	bar	_	8	16	16	±0.75	±0.25	±0.25	16
006BG	0	6	bar	_	17	17	17	±0.75	±0.25	±0.25	15
010BG	0	10	bar	_	17	17	17	±0.75 uous use. This pr	±0.25	±0.25	16

Working Pressure: The maximum pressure that may be applied to any port of the sensor in continuous use. This pressure may be outside the operating pressure range limits (Pmin. to Pmax.) in which case the sensor may not provide a valid output until pressure is returned to within the operating pressure range. Tested to 1 million cycles, minimum.

<sup>&</sup>lt;sup>2</sup>Overpressure: The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified this applies to all available pressure ports at any temperature with the operating temperature range.

<sup>&</sup>lt;sup>3</sup>Burst Pressure: The maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product should not be expected to function after exposure to any pressure beyond the burst pressure.

<sup>&</sup>lt;sup>4</sup>Common Mode Pressure: The maximum pressure that can be applied simultaneously to both ports of a differential pressure sensor without causing changes in specified performance.

Flotal Error Band: The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range. Includes all errors due to offset, full scale span, pressure non-linearity, pressure hysteresis, repeatability, thermal effect on offset, thermal effect on span, and thermal hysteresis (see Figure 1).

6Total Error Band after Auto-Zero: The maximum deviation from the ideal transfer function over the entire compensated pressure range for a minimum of 24 hours after an auto-zero operation. Includes all errors due to full scale span, pressure non-linearity, pressure hysteresis, and thermal effect on span.

<sup>&</sup>lt;sup>7</sup>Effective Number of Bits (ENOB): A measure of the dynamic performance of an analog-to-digital converter (ADC) and its related circuitry. ENOB is defined for the RSC Series per the following equation: ENOB = log<sub>2</sub> (Full Scale Span/Noise).

Table 7. Pressure Range Specifications for ±160 Pa to ±1 MPa

Pressure Range	Raı	sure nge		Working	Over	Burst	Common	Total Error	Total Error Band after	Long-term Stability	Effective Number of
(see Figure 3)	Pmin.	Pmax.	Unit	Pressure <sup>1</sup>	Pressure <sup>2</sup>	Pressure <sup>3</sup>	Mode Pressure <sup>4</sup>	Band⁵ (%FSS)		1000 hr, 25°C (%FSS)	
						Absol	ute				
100KA	0	100	kPa	_	200	400	_	±0.75	±0.25	±0.25	16
160KA	0	160	kPa	_	400	800	_	±0.75	±0.25	±0.25	16
250KA	0	250	kPa	_	600	800	_	±0.75	±0.25	±0.25	16
400KA	0	400	kPa	_	800	1600	_	±0.75	±0.25	±0.25	16
600KA	0	600	kPa	_	1700	1700	_	±0.75	±0.25	±0.25	15
001GA	0	1	MPa	_	1700	1700	_	±0.75	±0.25	±0.25	16
						Differe	ntial				
160LD	-160	160	Pa	33500	67500	100000	345000	±3	±0.5	±0.5	16
250LD	-250		Pa	33500	67500	100000	345000	±2	±0.5	±0.35	14
400LD	-400		Pa	33500	67500	100000	345000	±2	±0.5	±0.35	15
600LD	-600		Pa	33500	67500	100000	345000	±2	±0.5	±0.35	16
001KD	-1	1	kPa	37.5	75	125	545	±0.75	±0.25	±0.25	16
1.6KD	-1.6	1.6	kPa	37.5	75	125	545	±1	±0.25	±0.25	17
2.5KD	-2.5	2.5	kPa	43.5	85	135	1045	±1	±0.25	±0.25	18
004KD	-4	4	kPa	43.5	85	135	1045	±0.75	±0.25	±0.25	15
006KD	-6	6	kPa	_	85	100	1000	±0.75	±0.25	±0.25	15
010KD	-10	10	kPa	_	140	250	1000	±0.75	±0.25	±0.25	16
016KD	-16	16	kPa	_	140	250	1000	±0.75	±0.25	±0.25	17
025KD	-25	25	kPa	_	140	250	1000	±0.75	±0.25	±0.25	16
040KD	-40	40	kPa	_	200	400	1000	±0.75	±0.25	±0.25	17
060KD	-60	60	kPa	_	200	400	1000	±0.75	±0.25	±0.25	16
100KD	-100	100	kPa	_	400	800	1000	±0.75	±0.25	±0.25	16
160KD	-160	160	kPa	_	800	1600	1000	±0.75	±0.25	±0.25	16
250KD	-250	250	kPa	_	800	1600	1000	±0.75	±0.25	±0.25	16
400KD	-400	400	kPa	_	1600	1700	1000	±0.75	±0.25	±0.25	16
600KD	-600	600	kPa	_	1700	1700	1700	±0.75	±0.25	±0.25	16
001GD	-1	1	MPa	_	1.7	1.7	1.7	±0.75	±0.25	±0.25	17
						Gag	е				
250LG	0	250	Pa	33500	67500	100000	345000	±3	±0.5	±0.5	15
400LG	0	400	Pa	33500	67500	100000	345000	±3	±0.5	±0.5	16
600LG	0	600	Ра	33500	67500	100000	345000	±2	±0.5	±0.35	15
001KG	0	1	kPa	33.5	67.5	100	345	±0.75	±0.25	±0.35	15
1.6KG	0	1.6	kPa	33.5	67.5	100	345	±0.75	±0.25	±0.25	16
2.5KG	0	2.5	kPa	37.5	75	125	545	±1	±0.25	±0.25	17
004KG	0	4	kPa	37.5	75	125	545	±0.75	±0.25	±0.25	15
006KG	0	6	kPa	_	85	100	545	±0.75	±0.25	±0.25	14
010KG	0	10	kPa	_	85	100	1000	±0.75	±0.25	±0.25	15
016KG	0	16	kPa	_	85	100	1000	±0.75	±0.25	±0.25	16
025KG	0	25	kPa	_	140	250	1000	±0.75	±0.25	±0.25	15
040KG	0	40	kPa	_	200	400	1000	±0.75	±0.25	±0.25	14
060KG	0	60	kPa	_	200	400	1000	±0.75	±0.25	±0.25	15
100KG	0	100	kPa	_	200	400	1000	±0.75	±0.25	±0.25	16
160KG	0	160	kPa	_	400	800	1000	±0.75	±0.25	±0.25	16
250KG	0	250	kPa	_	800	1600	1000	±0.75	±0.25	±0.25	15
400KG	0	400	kPa	_	800	1600	1600	±0.75	±0.25	±0.25	16
600KG	0	600	kPa	_	1700	1700	1700	±0.75	±0.25	±0.25	15
001GG	0	1	MPa	_	1.7	1.7	1.7	±0.75	±0.25	±0.25	16

Working Pressure: The maximum pressure that may be applied to any port of the sensor in continuous use. This pressure may be outside the operating pressure range limits (Pmin. to Pmax.) in which case the sensor may not provide a valid output until pressure is returned to within the operating pressure range. Tested to 1 million cycles, minimum.

<sup>&</sup>lt;sup>2</sup>Overpressure: The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified this applies to all available pressure ports at any temperature with the operating temperature range.

FBurst Pressure: The maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product should not be expected to function after exposure to any pressure beyond the burst pressure.

<sup>&</sup>lt;sup>4</sup>Common Mode Pressure: The maximum pressure that can be applied simultaneously to both ports of a differential pressure sensor without causing changes in specified performance.

For a larger of the maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range. Includes all errors due to offset, full scale span, pressure non-linearity, pressure hysteresis, repeatability, thermal effect on offset, thermal effect on span, and thermal hysteresis (see Figure 1).

Total Error Band after Auto-Zero: The maximum deviation from the ideal transfer function over the entire compensated pressure range for a minimum of 24 hours after an auto-zero operation. Includes all errors due to full scale span, pressure non-linearity, pressure hysteresis, and thermal effect on span.

<sup>&</sup>lt;sup>7</sup>Effective Number of Bits (ENOB): A measure of the dynamic performance of an analog-to-digital converter (ADC) and its related circuitry. ENOB is defined for the RSC Series per the following equation: ENOB = log<sub>2</sub> (Full Scale Span/Noise).

Table 8. Pressure Range Specifications for ±0.5 in H<sub>2</sub>O to ±150 psi

Pressure Range	Rar			Working	Over	Burst	Common	Total Error	Total Error Band after	Long-term Stability	Effective Number of
(see Figure 3)	Pmin.	Ртах.	Unit	Pressure <sup>1</sup>	Pressure <sup>2</sup>	Pressure <sup>3</sup>	Mode Pressure <sup>4</sup>	Band⁵ (%FSS)	Auto-Zero <sup>6</sup> (%FSS)	1000 hr, 25°C (%FSS)	Bits (ENOB) at 20 SPS <sup>7</sup>
						Absolu	te				
015PA	0	15	psi	_	30	60	_	±0.75	±0.25	±0.25	16
030PA	0	30	psi	_	60	120	_	±0.75	±0.25	±0.25	16
060PA	0	60	psi	_	120	240	_	±0.75	±0.25	±0.25	16
100PA	0	100	psi	_	250	250	_	±0.75	±0.25	±0.25	16
150PA	0	150	psi	_	250	250	_	±0.75	±0.25	±0.25	16
						Differer	itial				
0.5ND	-0.5	0.5	inH <sub>2</sub> O	135	270	415	1400	±3	±0.5	±0.5	16
001ND	-1	1	inH <sub>2</sub> O	135	270	415	1400	±2	±0.5	±0.35	15
002ND	-2	2	inH <sub>2</sub> O	135	270	415	1400	±2	±0.5	±0.35	16
004ND	-4	4	inH <sub>2</sub> O	150	300	500	2200	±0.75	±0.25	±0.25	17
005ND	-5	5	inH <sub>2</sub> O	150	300	500	2200	±1	±0.5	±0.25	19
010ND	-10	10	inH <sub>2</sub> O	175	350	550	4200	±1	±0.25	±0.25	19
020ND	-20	20	inH <sub>2</sub> O	175	350	550	4200	±0.75	±0.25	±0.25	16
030ND	-30	30	inH <sub>2</sub> O	175	350	550	4200	±0.75	±0.25	±0.25	16
001PD	-1	1	psi	_	10	15	150	±0.75	±0.25	±0.25	15
005PD	-5	5	psi	_	30	40	150	±0.75	±0.25	±0.25	17
015PD	-15	15	psi	_	60	120	150	±0.75	±0.25	±0.25	17
030PD	-30	30	psi	_	120	240	150	±0.75	±0.25	±0.25	17
060PD	-60	60	psi	_	250	250	250	±0.75	±0.25	±0.25	17
100PD	-100	100	psi	_	250	250	250	±0.75	±0.25	±0.25	17
150PD	-150	150	psi	_	250	250	250	±0.75	±0.25	±0.25	17
						Gage	•				
001NG	0	1	inH <sub>2</sub> O	135	270	415	1400	±3	±0.5	±0.5	16
002NG	0	2	inH <sub>2</sub> O	135	270	415	1400	±2	±0.5	±0.35	15
004NG	0	4	inH <sub>2</sub> O	135	270	415	1400	±0.75	±0.25	±0.35	16
005NG	0	5	inH <sub>2</sub> O	135	270	415	1400	±0.75	±0.25	±0.25	16
010NG	0	10	inH <sub>2</sub> O	150	300	500	2200	±1	±0.25	±0.25	18
020NG	0	20	inH <sub>2</sub> O	175	350	550	4200	±0.75	±0.25	±0.25	15
030NG	0	30	inH <sub>2</sub> O	175	350	550	4200	±0.75	±0.25	±0.25	15
001PG	0	1	psi	_	10	15	150	±0.75	±0.25	±0.25	14
005PG	0	5	psi	_	30	40	150	±0.75	±0.25	±0.25	16
015PG	0	15	psi	_	30	60	150	±0.75	±0.25	±0.25	16
030PG	0	30	psi	_	60	120	150	±0.75	±0.25	±0.25	16
060PG	0	60	psi	_	120	240	250	±0.75	±0.25	±0.25	16
100PG	0	100	psi	_	250	250	250	±0.75	±0.25	±0.25	16
150PG	0	150	psi	_	250	250	250	±0.75	±0.25	±0.25	16
¹Working Pre	essure:			essure that mav		·	·		·	utside the opera	

Working Pressure: The maximum pressure that may be applied to any port of the sensor in continuous use. This pressure may be outside the operating pressure range limits (Pmin. to Pmax.) in which case the sensor may not provide a valid output until pressure is returned to within the operating pressure range. Tested to 1 million cycles, minimum.

<sup>&</sup>lt;sup>2</sup>Overpressure: The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified this applies to all available pressure ports at any temperature with the operating temperature range.

<sup>\*</sup>Burst Pressure: The maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product should not be expected to function after exposure to any pressure beyond the burst pressure.

\*Common Mode Pressure: The maximum pressure that can be applied simultaneously to both ports of a differential pressure sensor without causing changes in specified performance.

<sup>&</sup>lt;sup>5</sup>Total Error Band: The maximum deviation from the ideal transfer function over the entire compensated temperature and pressure range. Includes all errors due to offset, full scale span, pressure non-linearity, pressure hysteresis, repeatability, thermal effect on offset, thermal effect on span, and thermal hysteresis (see Figure 1).

Total Error Band after Auto-Zero: The maximum deviation from the ideal transfer function over the entire compensated pressure range for a minimum of 24 hours after an auto-zero operation. Includes all errors due to full scale span, pressure non-linearity, pressure hysteresis, and thermal effect on span.


7 Effective Number of Bits (ENOB): A measure of the dynamic performance of an analog-to-digital converter (ADC) and its related circuitry. ENOB is defined for the RSC Series per the following equation: ENOB = log<sub>2</sub> (Full Scale Span/Noise).

**RSC Series** 

Figure 4. DIP Package Dimensional Drawings (For reference only: mm [in].)


**DIP NN:** No ports



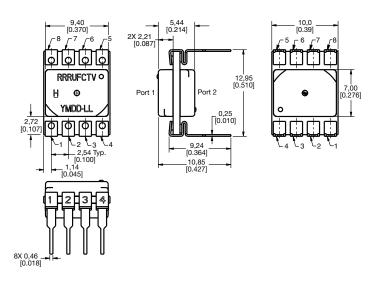


**DIP AN:** Single axial barbed port



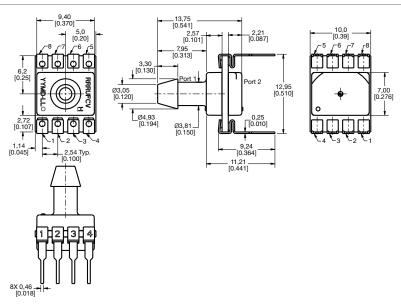

**DIP LN:** Single axial barbless port




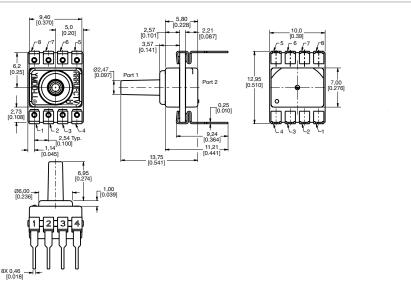


**RSC Series** 

Figure 4. DIP Package Dimensional Drawings (continued)


**DIP RN:** Single radial barbed port

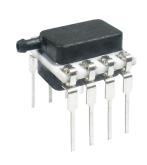

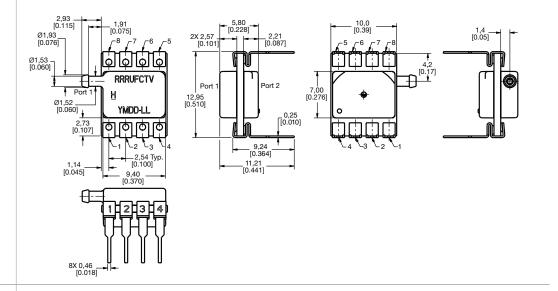


DIP RR: Dual radial barbed ports, same side



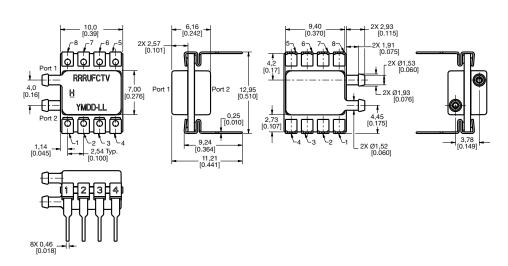

**DIP JN:** Single radial barbless port



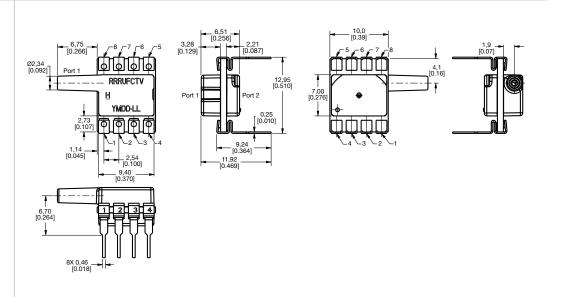

**RSC Series** 

Figure 4. DIP Package Dimensional Drawings (continued)

**DIP JJ:** Dual radial barbless ports, same side




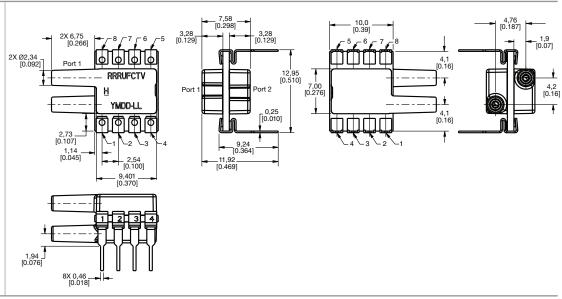


Figure 5. SMT Package Dimensional Drawings (For reference only: mm [in].)


**SMT NN:** No ports



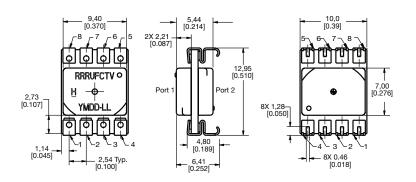

**SMT AN:** Single axial barbed port



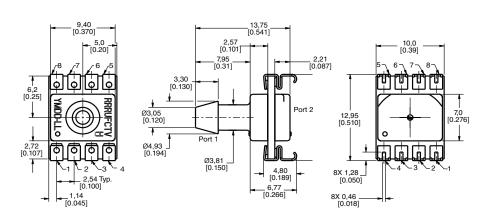


**RSC Series** 

Figure 5. SMT Package Dimensional Drawings (continued)


**SMT LN:** Single axial barbless port



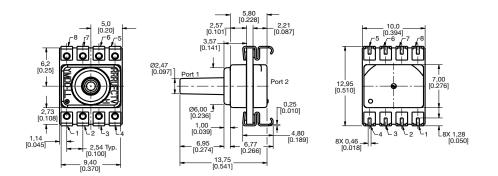

SMT RN: Single radial barbed port



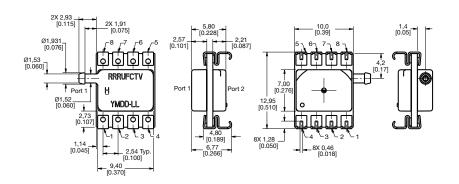

SMT RR: Dual radial barbed ports, same side




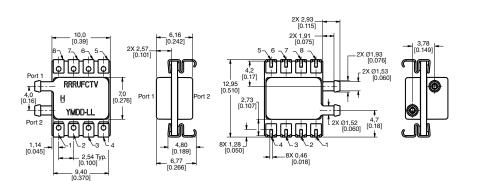


Figure 5. SMT Package Dimensional Drawings (continued)





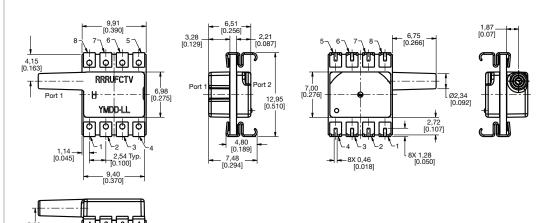

**SMT JJ:** Dual radial barbless ports, same side



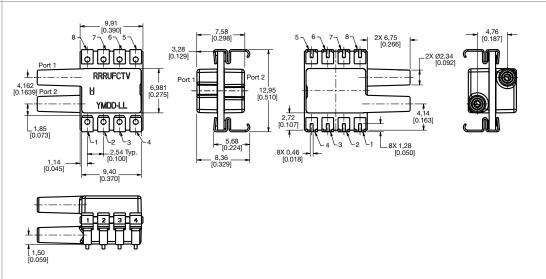



Figure 6. Recommended PCB Pad Layouts



Table 9. Pinout

Pin	Name Description				
1	SCLK	external clock source			
2	DRDY	data ready: active low			
3	DIN	serial data input			
4	CS_ADC	ADC chip select: active low			
5	GND	ground			
6	V <sub>cc</sub>	positive supply voltage			
7	CS_EE EEPROM chip select: active low				
8	DOUT serial data output				

Figure 7. Recommended Circuit

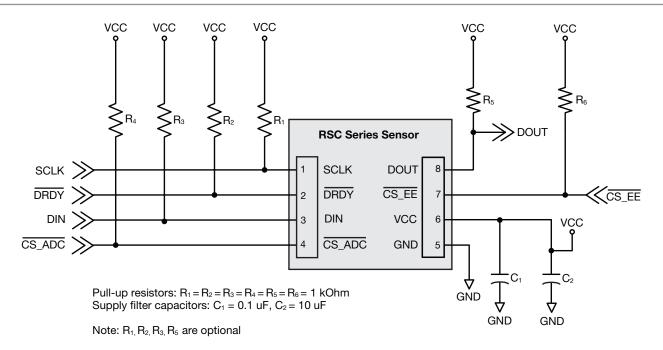


**RSC Series** 

### 1.0 SYSTEM OVERVIEW

### 1.1 Major System Blocks (see Figure 1-1)

- A piezoresistive Sense Element that provides a signal that changes when pressure is applied to the device.
- An Analog to Digital Converter (ADC) with an integrated amplifier that measures this signal. (Unlike many conventional sensors, this digital signal is neither compensated nor calibrated.)
- An onboard EEPROM Memory that contains the coefficients for compensating equations that can be used to correct the raw signal and provide a fully temperature-compensated, pressure-calibrated value.

Figure 1-1. Block Diagram

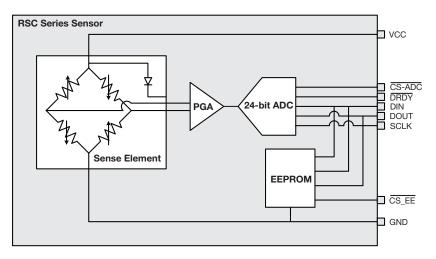

### 1.2 High-level Operating Sequence

The following operating sequence is required to make the device function. Each step is discussed in detail in the following sections.

- 1. Read the ADC settings and the compensation values from EEPROM.
- 2. Initialize the ADC converter using the settings provided in EEPROM.
- 3. Adjust the ADC sample rate if desired.
- 4. Command the ADC to take a temperature reading, and store this reading.
- 5. Give Delay (Example: if sample rate is 330SPS delay for 3.03 ms [1/330 s]).
- 6. Command the ADC to take a pressure reading, and store this reading.
- 7. Apply the compensation formulae to the temperature and pressure readings in order to calculate a pressure value.
- 8. Repeat steps 4, 5 and 6 in a loop to take additional readings.

**RSC Series** 

It is not necessary to take a new temperature reading in conjunction with every pressure reading. If a fast response to pressure is required, it is possible to take several pressure readings in a row and use an earlier temperature reading to compensate. The exact timing of this will be application specific and depend on the rapidity of possible temperature changes. A temperature reading approximately every 100 ms should be adequate for most applications except those with rapid temperature transients. Longer times between temperature readings may be possible for applications where rapid temperature changes are not possible. If multiple pressure readings for a single temperature reading are desired, the sequence of steps above becomes:

- 4. Command the ADC to take a temperature reading, and store this reading.
- 5. Command the ADC to take a pressure reading, and store this reading.
- 6. Apply the compensation formulae to the temperature and pressure readings in order to calculate a pressure value.
- 7. Repeat steps 5 and 6 in a loop to take additional pressure readings and compensate them.
- 8. After a pre-determined number of loops, repeat step 4.

#### 1.3 Compensation Mathematics (see Table 1-1)

This section gives a high-level overview of the compensation mathematics. Please refer to Section 2.0 for details on exact numeric formats and EEPROM addresses. It is assumed that all values have been correctly converted to a floating-point decimal format.

Table 1-1. Coefficients Read from EEPROM

Coefficient	Description
P <sub>Range</sub>	pressure range read from EEPROM
P <sub>min</sub>	pressure offset read from EEPROM
Eng Units	engineering units read from EEPROM
P <sub>raw</sub>	uncompensated pressure reading from ADC
$T_{raw}$	uncompensated temperature reading from ADC
P <sub>int1</sub>	intermediate value in calculations
P <sub>int2</sub>	intermediate value in calculations
P <sub>Comp_FS</sub>	compensated output pressure
P <sub>Comp</sub>	compensated output pressure, in engineering units

OffsetCoefficient<sub>3</sub>...OffsetCoefficient<sub>0</sub> = Correction values from EEPROM SpanCoefficient<sub>3</sub>...SpanCoefficient<sub>0</sub> = Correction values from EEPROM ShapeCoefficient<sub>3</sub>...ShapeCoefficient<sub>0</sub> = Correction values from EEPROM

P<sub>int1</sub> = P<sub>raw</sub> - (OffsetCoefficient<sub>3</sub> \* T<sub>raw</sub><sup>3</sup> + OffsetCoefficient<sub>2</sub> \* T<sub>raw</sub><sup>2</sup> + OffsetCoefficient<sub>1</sub> \* T<sub>raw</sub> + OffsetCoefficient<sub>0</sub>) P<sub>int2</sub> = P<sub>int1</sub> / (SpanCoefficient<sub>3</sub> \* T<sub>raw</sub><sup>3</sup> + SpanCoefficient<sub>2</sub> \* T<sub>raw</sub><sup>2</sup> + SpanCoefficient<sub>1</sub> \* T<sub>raw</sub> + SpanCoefficient<sub>0</sub>) P<sub>Comp. FS</sub> = ShapeCoefficient<sub>3</sub> \* P<sub>int2</sub><sup>3</sup> + ShapeCoefficient<sub>2</sub> \* P<sub>int2</sub><sup>2</sup> + ShapeCoefficient<sub>1</sub> \* P<sub>int2</sub> + ShapeCoefficient<sub>0</sub> P<sub>Comp</sub> = (P<sub>Comp</sub> FS \* P<sub>Range</sub>) + P<sub>min</sub> [Engineering Units]

#### 2.0 **SYSTEM INITIALIZATION - EEPROM**

The device on-board memory contains serialization, pressure range, ADC configuration and compensation information.

#### 2.1 **EEPROM Contents**

#### 2.11 Serialization and pressure range information: Stored in bytes 0 to 40 (see Table 2-1).

Table 2-1. Serialization and Pressure Range Information

Relative Address	Item	Detail	Data Type	Byte Order
0			ASCII Char	MSB
1			ASCII Char	
2			ASCII Char	
3			ASCII Char	
4			ASCII Char	
5			ASCII Char	
6			ASCII Char	
7			ASCII Char	
8	sensor catalog listing		ASCII Char	
9			ASCII Char	
10			ASCII Char	
11			ASCII Char	
12			ASCII Char	
13			ASCII Char	
14			ASCII Char	
15			ASCII Char	LSB
16			ASCII Char	MSB
17		\(\lambda\)	ASCII Char	
18		YYYY	ASCII Char	
19			ASCII Char	LSB
20			ASCII Char	MSB
21	serial number	DDD	ASCII Char	
22	(YYYYDDDXXXX)		ASCII Char	LSB
23			ASCII Char	MSB
24		V/////	ASCII Char	
25		XXXX	ASCII Char	
26			ASCII Char	LSB
27				LSB
28			□+	
29	pressure range		Float	
30				MSB
31				LSB
32			ГI+	
33	pressure minimum		Float	
34				MSB
35			ASCII Char	MSB
36			ASCII Char	
37	pressure unit		ASCII Char	
38			ASCII Char	
39			ASCII Char	LSB
40	pressure reference		ASCII Char	

#### 2.12 ADC Configuration Settings: Stored in bytes 61, 63, 65 and 67 (See Table 2-2).

**Table 2-2. ADC Configuration Setttings** 

Relative Address	Item	Detail	Data Type	Byte Order
60				
61		ADC CONFIG_00	unsigned character	-
62				
63	ADC configuration	ADC CONFIG_01	unsigned character	-
64	ADC configuration math		_	
65		ADC CONFIG_02	unsigned character	-
66				
67		ADC CONFIG_03	unsigned character	-

#### Polynomial coefficients: Stored in bytes 130 to 145 (see Table 2-3). 2.13

Table 2-3. Polynomial Coefficients

Relative Address	ltem	Detail	Data Type	Byte Order
130				LSB
131		OffsetCoefficient <sub>o</sub>	float	
132		OffsetCoefficient <sub>0</sub>	IlUal	
133				MSB
134				LSB
135		OffsetCoefficient <sub>1</sub>	float	
136		OffsetCoefficient <sub>1</sub>	Illat	
137	offset matrix	triv		MSB
138	OffSet matrix		float	LSB
139		OffsetCoefficient <sub>2</sub>		
140		OffsetCoefficient <sub>2</sub>	ItUat	
141				MSB
142				LSB
143		OffsetCoefficient <sub>3</sub>	float	
144		OnsetCoefficient3	rioat	
145				MSB

### Span coefficients: Stored in bytes 210 to 225 (see Table 2-4).

Table 2-4. Span Coefficients

Relative Address	Item	Detail	Data Type	Byte Order
210				LSB
211		CoopCoofficiont	floot	
212		SpanCoefficient <sub>0</sub>	float	
213				MSB
214				LSB
215		SpanCoefficient <sub>1</sub>	float	
216		SpanCoerricient <sub>1</sub>	ItOat	
217	anan matriy			MSB
218	span matrix			LSB
219		ChanCaafficiant	float	
220		SpanCoefficient <sub>2</sub>	ItOat	
221				MSB
222				LSB
223		SpanCoefficient <sub>3</sub>	float	
224		Span Coefficient <sub>3</sub>	float	
225				MSB

**RSC Series** 

#### Shape Coefficients: Stored in bytes 290 to 305 (see Table 2-5). 2.15

Table 2-5. Shape Coefficients

<b>Relative Address</b>	Item	Detail	Data Type	Byte Order
290				LSB
291		ChanaCaafficiant	float	
292		ShapeCoefficient <sub>o</sub>	Illuat	
293				MSB
294				LSB
295		Shana Coofficient	float	
296		ShapeCoefficient <sub>1</sub>	noat	
297				MSB
298	shape matrix			LSB
299		ChanaCaafficiant	float	
300		ShapeCoefficient <sub>2</sub>	noat	
301				MSB
302				LSB
303		ChanaCaaffiaiant	floot	
304		ShapeCoefficient <sub>3</sub>	float	
305				MSB

#### 2.16 Checksum address: Stored in byte 450 (see Table 2-6).

Table 2-6. Checksum Address

Relative Address	Item	Detail	Data Type	Byte Order
450	Chaptrouse			LSB
451	Checksum		unsigned short int	MSB

Any unspecified EEPROM addresses below address 451 are reserved for future enhancements.

#### 2.2 **EEPROM Communications**

The CS\_EE pin of the sensor selects the EEPROM for SPI communication. When CS\_EE is high, the EEPROM is in stand-by mode, and communications with the ADC are possible. When  $\overline{\text{CS\_EE}}$  is low, the EEPROM is enabled.  $\overline{\text{CS\_EE}}$  and  $\overline{\text{CS\_ADC}}$  must never be simultaneously low. EEPROM operates in SPI mode 0 where CPOL = 0 and CPHA = 0(0,0) and mode 3 where CPOL = 1and CPHA = 1(1,1).

Each memory of EEPROM contains 8-bit data or one byte. To read from memory, the host sends an EAD\_EEPROM instruction [0000 X011] followed by an 8-bit address. The 'X' bit in the read instruction is the ninth (MSB) address bit.


### Example:

- 1. To read data at address 1, the command sequence is  $[0000 \, 0011] \, [0000 \, 0001]$ .
- 2. To read data at address 290, the command sequence is [0000 **1**011] [0010 0010].

**RSC Series** 

After receiving the last address bit, the EEPROM responds by shifting out data on the DOUT pin, as shown in Figure 2-1. Sequentially stored data can be read out by simply continuing to run the clock. The internal address pointer is automatically incremented to the next higher address as data is shifted out. After reaching the highest memory address, the address counter "rolls over" to the lowest memory address, and the read cycle can be continued indefinitely. The read operation is terminated by taking CS\_EE high.

Figure 2-1. EEPROM Communications

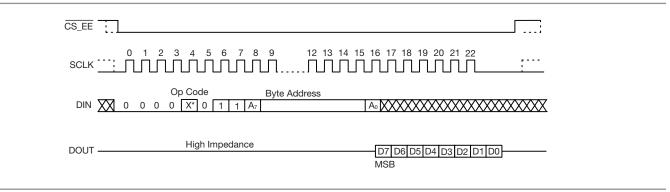

#### SYSTEM OPERATION - ADC 3.0

#### **ADC Communications and Initialization** 3.1

The CS\_ADC pin of the sensor selects the ADC for SPI communication. When CS\_ADC is high, the ADC is in stand-by mode, and communications with the EEPROM are possible. When  $\overline{\text{CS}}$  ADC is low, the ADC is enabled.  $\overline{\text{CS}}$  and  $\overline{\text{CS}}$  must never be simultaneously low. The ADC interface operates in SPI mode 1 where CPOL = 0 and CPHA = 1.

The ADC has four configuration registers. Three registers are 'reserved' and must be set to the default values contained in EEPROM. These registers contain setup values that are specific to the pressure sense element, and should not be changed. Configuration register 1 toggles the ADC between pressure and temperature readings and controls the data rate of the ADC.


To program a configuration register, the host sends a WREG command [0100 RRNN], where 'RR' is the register number and 'NN' is the number of bytes to be written -1.

Example: To write the single byte default configuration to register 3, the command is [0100 1100]. It is possible to write the default values to all configuration registers with a single command by setting the address to 0 and the number of bytes to (4-1) = 3, followed by all four configuration bytes in sequence. The command for this is [0100 0011].

The ADC is capable of full-duplex operation, which means commands are decoded at the same time that conversion data are read. Commands may be sent on any 8-bit data boundary during a data read operation. This allows for faster toggling between pressure and temperature modes. A WREG command can be sent without corrupting an ongoing read operation. Figure 3-1 shows an example of sending a WREG command while reading conversion data. Note that after the command is clocked in (after the 32nd SCLK falling edge), the sensor changes settings and starts converting using the new register settings. The WREG command can be sent on any of the 8-bit boundaries - the first, ninth, 17th or 25th SCLK rising edges as shown in Figure 3-1.

**RSC Series** 

Figure 3-1. ADC Communciations and Initialization

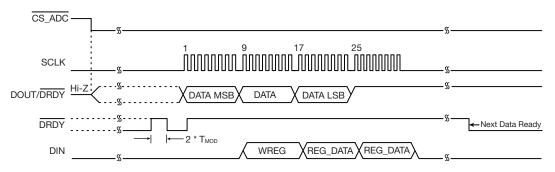

#### 3.2 **Programming the Data Rate and Pressure/Temperature Modes**

The ADC configuration register 1 contains the settings for the data rate and determines whether the ADCS takes a pressure reading or a temperature reading. This register can be changed as shown in Table 3-1 by using a WREG command. Typical data conversion times are shown in Table 3-2.

Table 3-1. ADC Configuration Register

ADC_CONFIG_01 [HEX]	Bit 7	Bit 6	Bit 5	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0
01h		DR[2:0]		MOD	E[1:0]	1	TS	0
	Data Ra	ite		Operating Mod	е	set to 1	Temperature Sensor Mode	set to 0
		5 0 0 0		00: <b>Normal Mo</b> modulator cloc 01: not used 10: <b>Fast Mode</b> modulator cloc	k) (default) (512 kHz		O: Pressure (sense element) reading 1: Temperature reading	
		0 0 0 0 0 00						

Table 3-2. Typical Data Conversion Times

	Normal Mode		Fast Mode
SPS	Time (ms)	SPS	Time (ms)
20	49.99	40	25.00
45	22.25	90	11.12
90	11.26	180	5.63
175	5.78	350	2.89
330	3.04	660	1.52
600	1.68	1200	0.84
1000	1.01	2000	0.51

**RSC Series** 

#### **ADC Reset Command** 3.3

The ADC reset command RESET [0000 0110] resets the ADC to the default values.

#### 3.4 **ADC Programming Sequence - Power Up**

At power-up it is necessary to initialize all the ADC registers. The sequence is:


- 1. Set the CS\_EE to high to disable EEPROM communication.
- Set the CS\_ADC to low to enable ADC communication.
- Initialize all four configuration registers to the default values in the EEPROM's Relative addresses 61, 63, 65 and 67 (see the MSB bytes in see Section 3.0) by sending a WREG command to address 0 [0100 0011] followed by the four bytes of data:
  - Send the the Reset command (06h) to make sure the ADC is properly reset after powerup
  - Write the respective register configuration using the WREG command (Example: 43h, 0Ah, 84h, 40h, and 00h)

Both a temperature and an uncompensated pressure reading are necessary to calculate a compensated value (see Section 3.5).

#### 3.5 ADC Programming and Read Sequence – Temperature Reading (see Figure 3-2 and Table 3-3)

- 1. Set the  $\overline{\text{CS}_ADC}$  low to enable ADC communication.
- Configure the sensor to temperature mode and the desired data rate by setting configuration register 1 by sending a WREG command to address 1, [0100 0100] followed by the single configuration byte. Bit 1 (TS) of the configuration register should
- Send 08h command to start data conversion on ADC.
- 4. The sensor will start to output the requested data on DOUT at the first SCLK rising edge after the command byte is received.

Figure 3-2. ADC Programming and Read Sequence - Temperature Reading

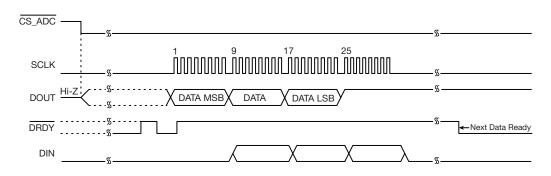

Interpret the data as follows: Temperature data are output starting with MSB. When reading 24 bits, the first 14 bits are used to indicate the temperature measurement result. The last 10 bits are random data and must be ignored. Negative temperature is represented in 2's complement format. MSB = 0 indicates positive result, MSB = 1 indicates negative value.

To convert the digital value to a Celsius temperature, first check if the MSB is 0 or 1. If the MSB = 0, simply multiply the decimal code by 0.03125°C to obtain the result. If the MSB = 1, subtract 1 from the result and complement all bits, multiply the result by -0.03125°C.

**RSC Series** 

Table 3-3. Data Interpretation Table


Temperature (°C)	Digital Output (Binary)	Hex
128	01 0000 0000 0000	1000
127.96875	00 1111 1111 1111	OFFF
100	00 1100 1000 0000	0C80
80	00 1010 0000 0000	0A00
75	00 1001 0110 0000	0960
50	00 0110 0100 0000	0640
25	00 0011 0010 0000	0320
0.25	00 0000 0000 1000	0008
0	00 0000 0000 0000	0000
-0.25	11 1111 1111 1000	3FF8
-25	11 1100 1110 0000	3CEO
-40	11 1011 0000 0000	3B00

**Example 1:** The ADC reads back 0960h: 0960h has an MSB =  $0.(0960h) \times (0.03125^{\circ}C) = (2400) \times (0.03125^{\circ}C) = 75^{\circ}C$ Example 2: The ADC reads back: 3CEOh: 3CEOh has an MSB = 1. Complement the result: 3CEOh = 0320h (0320h) × (-0.03125°C)  $=(800) \times (-0.03125^{\circ}C) = -25^{\circ}C$ 

#### 3.6 ADC Programming and Read Sequence - Pressure Reading (see Figure 3-3)

- Set the CS\_ADC low to enable ADC communication. 1.
- Configure the sensor to the pressure mode and the desired data rate by setting configuration register 1 by sending a WREG command to address 1, [0100 0100] followed by the single configuration byte. Bit 1 (TS) of the configuration register should be set to 0.
- Send 08h command to start data conversion on ADC.
- The sensor will start to output the requested data on DOUT at the first SCLK rising edge after the command byte is received.

Figure 3-3. ADC Programming and Read Sequence - Pressure Reading

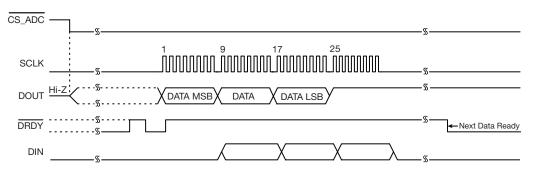

Interpret the data as shown in Table 3-4. Pressure data are output starting with MSB, in 24-bit 2's complement format.

Table 3-4. CompReturn\_Struct

Input Signal, VIN (AINP-AINN)	DEAL OUTPUTCODE
≥+FS(2 <sup>23</sup> - 1) / 2 <sup>23</sup>	7FFFFh
+FS / 2 <sup>23</sup>	000001h
0	0
-FS / 2 <sup>23</sup>	FFFFFh
≤-FS	800000h

**RSC Series** 

#### 4.0 **EXAMPLE SOFTWARE**

#### 4.1 **Data Types**

Specific data types defined by the Pressure\_Comp module defined in "Pressure\_Comp.h" are needed while interacting with the pressure compensation function (see Table 4-1).

Table 4-1. Data Types

Name	Description					
	Provides an enumerated data type to hold the status of pressure compensation module; pressure					
	compensation states are given be	elow:				
	COMPINIT_OK	Compensation init successful				
	COMPINIT_NOK	Compensation init failure				
CompStatus_Enum	CRC_FAILURE	CRC check failure				
	IP_PRESSURE_OUTOFRANGE	Input pressure out of range				
	IP_TEMP_OUTOFRANGE	Input temperature out of range				
	PRESSURE_VALID	Output pressure is valid				
	PRESSURE_INVALID	Output pressure is invalid				
	Provides structured a data type containing two elements such as f32PressureOutput and					
	CompStatus; details are given below:					
CompReturn_Struct	(22)	Provides output pressure of "float" data type				
	f32PressureOutput	Provides status of pressure compensation of "CompStatus_Enum"				
	CompStatus	data type				

#### 4.2 Function Descriptions - Pressure\_Comp.c

"Pressure\_Comp.c" provides the source code that provides functions to initialize the module by extracting all the coefficients from EEPROM after CRC validation and extracting the coefficients from it. This file also provides the function to compensate the pressure by having uncompensated raw pressure and temperature input. The "Pressure\_Comp.h" file provides the interfaces to the functions implemented in the "Pressure\_Comp.c" file that need to be included in the application where the pressure compensation is needed. Dependencies: "float.h", "crc.h" (see Tables 4-2, 4-3 and 4-4).

Table 4-2. Compensate\_Pressure\_Init()

Entity	Name	Description
Function	Compensate_Pressure_Init	Initializes the pressure compensation module
		Data Type: (unsigned char *)
Parameter	u8EEPROM_ptr	Provides a pointer to the EEPROM image which is read byte-wise in
		a contiguous memory buffer
		Returns the status of compensation initialization (either of the
D . T		compensation states given below)
Return Type	CompStatus_Enum	COMPINIT_OK Compensation init successful
		COMPINIT_NOK Compensation init failure

Table 4-3. Compensate\_Pressure()

Entity	Name	Description	
Function	Compensate_Pressure	Provides the compensated pressure based on the polynomial correction	
	u32PressureInput	Data Type: (unsigned long int)	
Parameter		Inputs the uncompensated pressure as read by the sensor	
	u32Temperature	Data Type: (unsigned long int)	
		Inputs the temperature as read by the sensor	
Return type	CompReturn_Struct.	Data Type: (CompStatus_Enum)	
	CompStatus	Provides the status of the compensation initialization	
	CompReturn_Struct. f32PressureOutput	Data Type: (float)	
		Returns the compensated pressure output in engineering units per the	
		sensor's specification	

### Table 4-4. AutoZero\_Pressure()

Entity	Name	Description	
Function	Autozero_Pressure	Sets a known, preset pressure to 50% full scale pressure (this function	
		should only be used at a known preset pressure that has to be output as	
		50% full scale pressure)	
		The term "autozero" refers to 50% full scale pressure	
Parameter	u32PressureZero	Data Type: (unsigned long int)	
		Inputs uncompensated pressure as read by the TSHUR sensor at preset	
		50% full scale pressure	
	u32TemperatureZero	Data Type: (unsigned long int)	
		Inputs temperature as read by the TSHUR sensor at preset 50% full scale	
		pressure	
Return type	CompReturn_Struct.	Data Type: (CompStatus_Enum)	
	CompStatus	Returns the status of AutoZero Correction	

#### 4.3 **Checksum Calculation**

"crc.c" provides a source code which, in turn, provides the functions to compute the 16-bit CCITT CRC. "crc.h" is an interface file for "pressure\_Comp.c" to get the interfaces to the functions which are implemented in the "crc.c"file (see Table 4-5).

Table 4-5. CrcComputeCrc16()

Entity	Name	Description	
Function	CrcComputeCrc16	Computes the 16-bit CRC-16-CCITT checksum	
		Uses a lookup table to compute the CRC-16-CCITT checksum with the	
		generator polynomial = 0x1021	
Parameter	u8Data	Data Type: (unsigned char)	
		Provides the current data passed to compute the CRC	
	100	Data Type: (unsigned short int)	
	u16CurrCrc	Provides the previously computed CRC Checksum	
Return type	unsigned short int	Returns the updated CCITT 16 bit CRC	

RSC Series

#### **Compensation Sequence** 4.4

- Set the endianness of the processor/controller where the sample code is planned to be integrated in "Pressure\_Comp.h" file Defines section (set only one of the following):
  - If little-endian, set "#define LITTLE\_ENDIAN\_FORMAT"
  - If big-endian, set "#define BIG\_ENDIAN\_FORMAT"
- 2. Include the four source files "Pressure\_Comp.c", "Pressure\_Comp.h", "crc.c", "crc.h" into the project build directory structure.
- Include the interface "#include "Pressure\_Comp.h" in the source file where the pressure needs to be compensated.
- Read and store the EEPROM contents in the application memory.
- Initialize the "Pressure\_Comp" module by calling the Compensate\_Pressure\_Init() function by passing the buffer pointer to the function. Check for the return status of type "CompStatus\_Enum" ensure the same is "COMPINIT\_OK".
- Set the reference pressure and temperature at which the AutoZero correction should happen. Read the raw pressure and temperature data from the sensor, pass the same as parameters to the AutoZero\_Pressure() function. Check for the return status of type "CompStatus\_Enum" to ensure it is the same as "COMPINIT\_OK".
- Read the raw pressure and temperature data from the sensor, pass the same as parameters to the Compensate\_Pressure() function. Check "CompReturn\_Struct.CompStatus" returned is PRESSURE\_VALID and get the compensated pressure data from "CompReturn\_Struct. f32PressureOutput".

### NOTICE

Initialization of the "Pressure\_Comp" module is done by calling the Compensate\_Pressure\_Init() function prior to calling the Compensate\_Pressure() function. If the initialization is not successful the same status is outputted from the Compensate\_ Pressure() function. When the Compensate\_Pressure() function returns any status other than the PRESSURE\_VALID status, the output pressure data should be discarded and should not be processed further.

#### 4.5 **Constraints**

The following considerations must be met to ensure the compiler settings are set to achieve the data type sizes shown in Table 4-6.

- Ensure the "float" data type is as per the IEEE 754 single-precision binary floating-point format: binary32.
- Ensure the endianness of the microcontroller has been configured correctly in the "Pressure\_Comp.h" function.
- Ensure the sample code has a minimum of 1 kB of RAM for its operation.

Table 4-6. Data Type Sizes

Data Type	Size
Unsigned char 1	1 byte
Float	4 byte (IEEE754)
Unsigned short int	2 byte
Unsigned long int	4 byte

**RSC Series** 

### NOTICE

The sample code provided has been tested on a limited number of microcontrollers and compliers to ensure proper functionality on a well defined/designed target system. The application developer needs to ensure compiler dependence as well as compatibility of the code with target environment.

#### SENSOR OFFSET ZERO CORRECTION PROCEDURE 5.0

Offset correction is a compensation technique based on sampling the output at a known reference condition within the compensated temperature and compensated pressure range of the sensor. Typically, a zero pressure reference, such as atmospheric pressure (or equal pressures on both pressure ports for a differential device), is used to allow the external correction of the offset error. Use the following sequence:

- 1. Set the sensor to zero pressure.
- 2. Measure  $P_{raw}$  and  $T_{raw}$  at a known zero reference ( $P_{raw0}$ ,  $T_{raw0}$ , for example).
- 3. Calculate  $P_{raw\_AZero} = (OffsetCoefficient_3 * T_{raw0}^3 + OffsetCoefficient_2 * T_{raw0}^2 + OffsetCoefficient_1 * T_{raw0} + OffsetCoefficient_0) P_{raw0}$
- 4. Add the  $P_{raw\_AZero}$  value to all  $P_{raw}$  values for use in the standard algorithm (see Section 1.3).
- 5. Calculate  $P_{\text{int1}}$  and  $P_{\text{int2}}$  as usual but use the modified  $P_{\text{raw}}$  values.

### ADDITIONAL INFORMATION

The following associated literature is available on the Honeywell web site at sensing.honeywell.com:

The following associated literature is available at sensing. honeywell.com:

- Product line guide
- Product range guide
- · Installation instructions
- Application information
- Sensor Evaluation Kit (SEK001) information including user instructions and software downloads

### Find out more

Honeywell Sensing and Internet of Things services its customers through a worldwide network of sales offices and distributors. For application assistance, current specifications, pricing or the nearest Authorized Distributor, visit sensing.honeywell.com or call:

USA/Canada +1 302 613 4491

Latin America +1 305 805 8188

Europe +44 1344 238258

Japan +81 (0) 3-6730-7152

+86 4006396841

Singapore +65 6355 2828

# **▲ WARNING**PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

# **▲ WARNING**MISUSE OF DOCUMENTATION

- The information presented in this datasheet is for reference only. Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

### Warranty/Remedy

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship during the applicable warranty period. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items that Honeywell, in its sole discretion, finds defective. The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While Honeywell may provide application assistance personally, through our literature and the Honeywell web site, it is buyer's sole responsibility to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this writing. However, Honeywell assumes no responsibility for its use.



830 East Arapaho Road Richardson, TX 75081 sensing.honeywell.com

Greater China



## **Mouser Electronics**

**Authorized Distributor** 

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

### Honeywell:

RSCDJJI060MDSE3 RSCDJNI060PASE3 RSCDJJE005PGSE3 RSCMNNI100KASE5 RSCDRRM160LDSE3
RSCDANI015PASE5 RSCMRRE001KDSE3 RSCDRRE400MDSE3 RSCDRRM006MDSE3 RSCDANI001PGSE3
RSCMRNI160MDSE3 RSCDJJM160LDSE3 RSCDLNE001BASE3 RSCDRRE001PDSE5 RSCDANI001PGSE5
RSCMJNM400MGSE3 RSCDANM150PGSE5 RSCDRRE015PDSE5 RSCMRRI250MDSE3 RSCMRRE025MDSE3
RSCDANM010KDSE5 RSCDRRM160MDSE5 RSCDJNE160KASE3 RSCDNNM030PASE5 RSCDJJM016KDSE3
RSCDJJI030NDSE5 RSCDRRM005PDSE3 RSCDJNE015PASE3 RSCDJJE001PGSE3 RSCDJJE010NGSE3
RSCMRRI1.6MDSE3 RSCMNNM100PGSE5 RSCDJNE015PASE3 RSCDJJM006MDSE3 RSCMRNE1.6BASE3
RSCDLNI1.6BASE3 RSCDNNM150PGSE5 RSCMRRM005PGSE5 RSCDNNM060PGSE5 RSCDANM040KGSE3
RSCDRRI025MDSE5 RSCDJJE005NGSE3 RSCMRRE2.5KGSE3 RSCMRNE030PASE3 RSCDJNI100PASE3
RSCDRNE015PASE5 RSCMRRE001PDSE3 RSCDJJM010KDSE3 RSCMRNM004NDSE3 RSCDJNI100PASE3
RSCDJJI160MDSE3