Page 1 of 1 **Document ID: 1765327**


2009 Chevrolet Express - AWD | Express, Savana (VIN G/H) Service Manual | Driver Information and Entertainment | Displays and Gages | Specifications | Document ID: 1765327

Fastener Tightening Specifications

	Specification	
Application	Metric	English
Instrument Cluster to Instrument Panel Screws	2 N·m	18 lb in

2009 Chevrolet Express - AWD | Express, Savana (VIN G/H) Service Manual | Driver Information and Entertainment | Displays and Gages | Repair Instructions | Document ID: 2037333

Ambient Air Temperature Gage Sensor Replacement

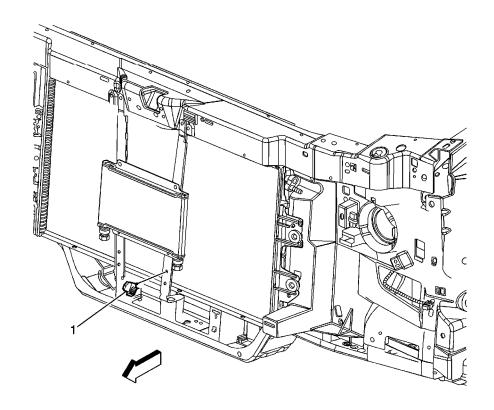




Callout	Component Name			
Preliminary Procedure				
Remove the front grill assembly. Refer to Grille Replacement.				
	Ambient Air Temperature Gauge Sensor Assembly			
1	Procedure			
	1. Unsnap the sensor from the bracket.			
	2. Disconnect the electrical connection.			

Page 1 of 1 Document ID: 2035564

2009 Chevrolet Express - AWD | Express, Savana (VIN G/H) Service Manual | Driver Information and Entertainment | Displays and Gages | Repair Instructions | Document ID: 2035564

Electronic Compass Module Replacement

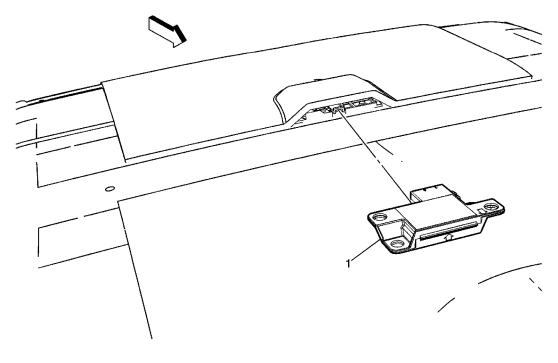



Component Name

Preliminary Procedure

Lower the rear edge of the front headliner to gain access. Refer to Headlining Front Trim Panel Replacement.

Electronic Compass Module

1


Procedure

- 1. Disconnect the electrical connection.
- 2. Unsnap the module from the headliner assembly.
- 3. For programming and set up procedures, refer to Control Module References.

Page 1 of 2 **Document ID: 1765320**

2009 Chevrolet Express - AWD | Express, Savana (VIN G/H) Service Manual | Driver Information and Entertainment | Displays and Gages | Repair Instructions | Document ID: 1765320

Multifunction Alarm Module Replacement Removal Procedure

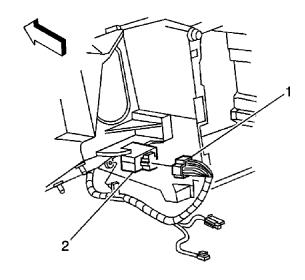




- 1. Remove the driver side knee bolster bracket. Refer to Driver Knee Bolster Bracket
- 2. Disconnect the multifunction audio alarm module (2) electrical connector (1).
- 3. Remove the multifunction audio alarm module (2) from the vehicle.

Installation Procedure

Document ID: 1765320 Page 2 of 2

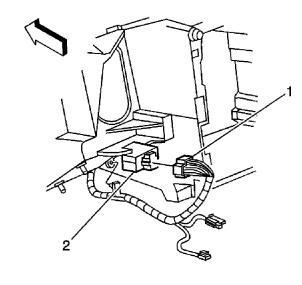




- 1. Install the multifunction audio alarm module (2) to the mag beam.
- 2. Connect the electrical connector (1) to the multifunction audio alarm module (2).
- 3. Install the driver side knee bolster bracket. Refer to <u>Driver Knee Bolster Bracket</u> Replacement .

Page 1 of 1 Document ID: 1892665

2009 Chevrolet Express - AWD | Express, Savana (VIN G/H) Service Manual | Driver Information and Entertainment | Displays and Gages | Repair Instructions | Document ID: 1892665

Driver Information Display Switch Replacement

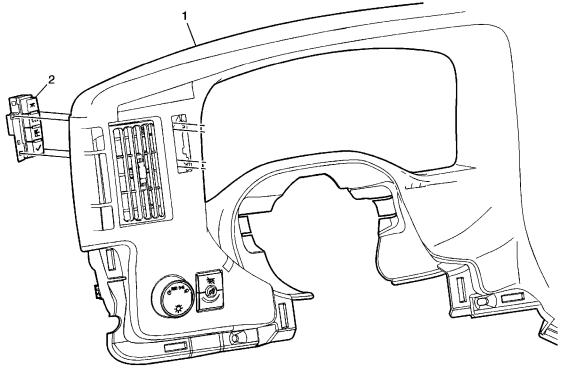




Callout	Component Name		
	Instrument Panel Cluster Trim Plate Bezel Assembly		
1	Refer to Instrument Panel Cluster Trim Plate Bezel Replacement.		
	Drivers Information Switch Assembly		
2	Procedure		
	Release the retaining tabs on the back of the switch and remove the switch from the cluster trim bezel assembly.		

Document ID: 2128559 Page 1 of 1

2009 Chevrolet Express - AWD | Express, Savana (VIN G/H) Service Manual | Driver Information and Entertainment | Displays and Gages | Repair Instructions | Document ID: 2128559

Instrument Cluster Replacement

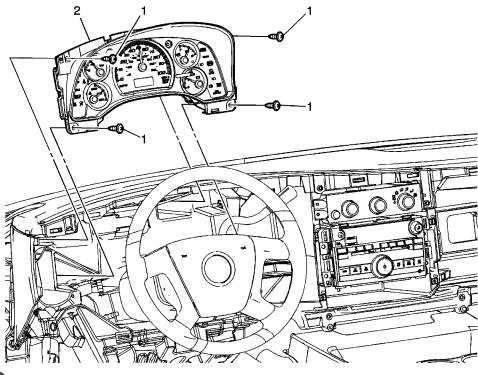



Callout	Component Name
	inary Procedures
Repla 2. Rem	ove both drivers and passenger knee bolsters. Refer to <u>Passenger Knee Bolster</u> accement and <u>Driver Knee Bolster Replacement</u> . ove the cluster trim plate assembly. Refer to <u>Instrument Panel Cluster Trim Plate</u> <u>I Replacement</u> .
1	Instrument Panel Cluster Screw (Qty: 3) Caution: Refer to Fastener Caution in the Preface section. Tighten 2 N·m (18 lb in)
2	Procedure 1. Disconnect the electrical connections. 2. Refer to Control Module References for programming and set up procedures.