

CÓDIGO	REVISÃO	DATA
FRGH.049		

REGISTRO DE INVESTIGAÇÃO DE PRODUTO

Caso algum campo não seja aplicável, preencha com N/A.

1. IDENTIFICAÇÃO DO PRODUTO

Produto:	HealthGo Air
Data:	10/04/2026
Número de Série / Lote:	202506240015
HGID:	25062512
Cliente (caso aplicável):	Centro Medico Aloha

2. INFORMAÇÕES DO PROBLEMA

PROBLEMA RELATADO PELO CLIENTE:
Cliente abriu o chamado relatando que o equipamento não estabelece conexão com o software, e está com o led vermelho piscando
PROBLEMA CONSTATADO PELO SUPORTE:
Falha de conexão com o Software, possível falha no HTU

3. ANÁLISE TÉCNICA INTERNA

RESULTADO DA INVESTIGAÇÃO:
O aparelho está piscando o led vermelho. Foi verificado a conexão via porta COM no Windows, atualizados os drivers do computador, resetado o firmware e realizada uma SVM. Identificamos com o terminal debug do software que há uma falha de autenticação no HTU conforme mostra evidência anexa. Solicito recolhimento para investigação
OBSERVAÇÕES:
GO PREMIUM: SIM.

4. EVIDÊNCIA FOTOGRÁFICA

CÓDIGO	REVISÃO	DATA
FRGH.049		

```
C:\WINDOWS\system32\cmd. X + - X
2026-03-30T16:10:56.9300847-03:00 INF Heartbeat persistence-only mode stopped
2026-03-30T16:10:56.9306276-03:00 INF Sensor monitor started
2026-03-30T16:10:58.4578308-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="\x1b[0;31mE (3032) gpio: gpio_in
tall_isr_service(502): GPIO isr service already installed\x1b[0m\n"
2026-03-30T16:11:00.0583551-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-03-30T16:11:00.0588645-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL descr
ption:"\n\nSM: INITIALIZE Erro no logger. \n\n""
2026-03-30T16:11:00.0594526-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-03-30T16:11:00.0594526-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
2026-03-30T16:11:02.0577634-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-03-30T16:11:02.059009-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL descri
ption:"\n\nSM: INITIALIZE Erro no logger. \n\n""
2026-03-30T16:11:02.0595914-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-03-30T16:11:02.0602288-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
2026-03-30T16:11:04.0582876-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-03-30T16:11:04.0589131-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL descr
ption:"\n\nSM: INITIALIZE Erro no logger. \n\n""
2026-03-30T16:11:04.0589131-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-03-30T16:11:04.0600469-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
2026-03-30T16:11:06.0588304-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-03-30T16:11:06.0594273-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL descr
ption:"\n\nSM: INITIALIZE Erro no logger. \n\n""
2026-03-30T16:11:06.0600097-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-03-30T16:11:06.0606288-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
2026-03-30T16:11:08.0575071-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-03-30T16:11:08.058752-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL descri
ption:"\n\nSM: INITIALIZE Erro no logger. \n\n""
2026-03-30T16:11:08.0593786-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-03-30T16:11:08.0599411-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
```

5. DISPOSIÇÃO FINAL

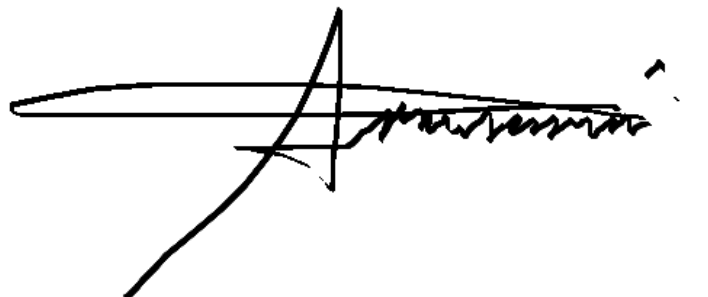
X Recolhimento do produto

Atualização de firmware

Recalibração Remota

CÓDIGO	REVISÃO	DATA
FRGH.049		

ASSINATURA

A handwritten signature in black ink, appearing to read 'André Luiz de Souza', is written over a horizontal line within a rectangular box.

Analista responsável: André Luiz de Souza