

CÓDIGO	REVISÃO	DATA
FRGH.049		

REGISTRO DE INVESTIGAÇÃO DE PRODUTO

Caso algum campo não seja aplicável, preencha com N/A.

1. IDENTIFICAÇÃO DO PRODUTO

Produto:	HealthGo Air
Data:	14/04/2026
Número de Série / Lote:	202506100007
HGID:	26022301
Cliente (caso aplicável):	ESPEDITO M PACIFICO

2. INFORMAÇÕES DO PROBLEMA

PROBLEMA RELATADO PELO CLIENTE:
O aparelho está piscando o led vermelho intermitentemente e não reconhece o dispositivo no Software.
PROBLEMA CONSTATADO PELO SUPORTE:
Falha de autenticação nos sensores

3. ANÁLISE TÉCNICA INTERNA

RESULTADO DA INVESTIGAÇÃO:
Foi identificado que a falha apresentada pelo aparelho se referia a uma falha de autenticação de algum dos sensores localizado na câmara. Realizamos a alteração do firmware junto à engenharia, subimos uma nova SVM e testamos a conexão. Apesar dos testes realizados identificamos que infelizmente o aparelho consta com falha na placa dos sensores da câmara. Todavia, recomendo o recolhimento para investigação.
OBSERVAÇÕES:
GO PREMIUM: NÃO

CÓDIGO	REVISÃO	DATA
FRGH.049		

4. EVIDÊNCIA FOTOGRÁFICA

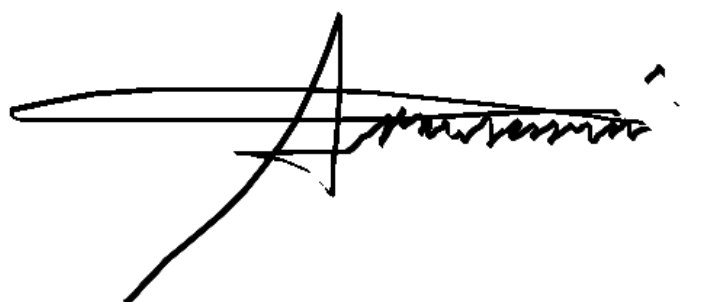
```
C:\WINDOWS\system32\cmd. X +
2026-04-14T10:22:58.5822925-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-04-14T10:22:58.5918884-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
2026-04-14T10:22:59.7417948-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="64: canal 4 fora dos limites, conversor 0. \n"
2026-04-14T10:22:59.7438632-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 3 fora dos limites, conversor 0. \n"
2026-04-14T10:23:00.5344747-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-04-14T10:23:00.5397692-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL description:"\n\nSM: INITIALIZE E
rrro no logger. \n\n""
2026-04-14T10:23:00.5416328-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-04-14T10:23:00.5440937-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
2026-04-14T10:23:00.5502472-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="SM: INITIALIZE Erro no logger. \n"
2026-04-14T10:23:02.5267029-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-04-14T10:23:02.5302813-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL description:"\n\nSM: INITIALIZE E
rrro no logger. \n\n""
2026-04-14T10:23:02.5441439-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-04-14T10:23:02.5479843-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
2026-04-14T10:23:02.553863-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="SM: INITIALIZE Erro no logger. \n"
2026-04-14T10:23:03.3414126-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="dos limites, conversor 0. \n"
2026-04-14T10:23:04.141529-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="imites, conversor 0. \n"
2026-04-14T10:23:04.1475445-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="MCP3564: canal 3 fora dos limites, conversor 0. \n"
2026-04-14T10:23:04.5266101-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-04-14T10:23:04.534812-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL description:"\n\nSM: INITIALIZE Er
ro no logger. \n\n""
2026-04-14T10:23:04.5353248-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
2026-04-14T10:23:04.5379553-03:00 WRN ERROR DESCRIPTION Description="\nSM: INITIALIZE Erro no logger. \n"
2026-04-14T10:23:04.5501526-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="SM: INITIALIZE Erro no logger. \n"
2026-04-14T10:23:04.9414405-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="3 fora dos limites, conversor 0. \n"
2026-04-14T10:23:05.1428968-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="nversor 0. \n"
2026-04-14T10:23:05.9408709-03:00 INF ESP-SPECIFIC DUMB TERMINAL MSG RECEIVED dumbMsg="3564: canal 3 fora dos limites, conversor 0. \n"
2026-04-14T10:23:06.5231907-03:00 WRN Received error from device error=INITIALIZATION_FAIL
2026-04-14T10:23:06.5260869-03:00 WRN FULL ERROR protoErr="payloadType:ERROR_EVENT errorCode:INITIALIZATION_FAIL description:"\n\nSM: INITIALIZE E
rrro no logger. \n\n""
2026-04-14T10:23:06.5284692-03:00 WRN ERROR CODE ErrorCode=INITIALIZATION_FAIL
```

5. DISPOSIÇÃO FINAL

- X Recolhimento do produto
- Atualização de firmware
- Recalibração Remota

CÓDIGO	REVISÃO	DATA
FRGH.049		

ASSINATURA

A handwritten signature in black ink, appearing to read 'André Luiz de Souza', is written over a horizontal line within a rectangular box.

Analista responsável: André Luiz de Souza