QKV-V HMMA instruction-level faults in one Transformer block

Qwen2.5-1.5B; 405 random HMMA sites; bits 28–30; one bit per run; no software injection

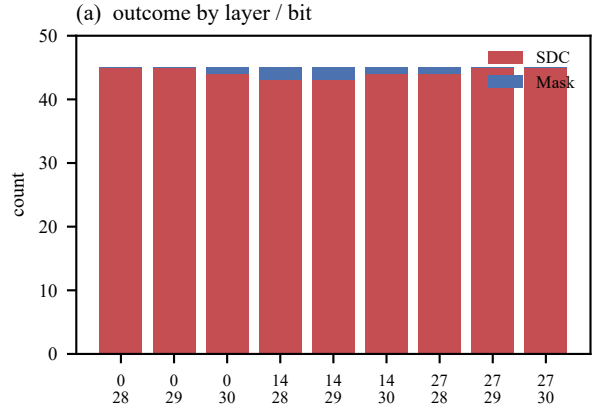

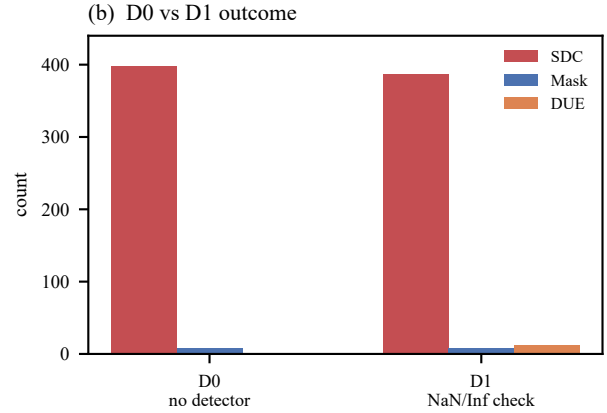

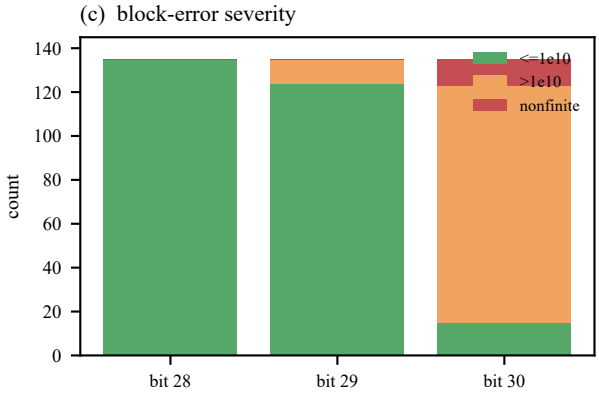

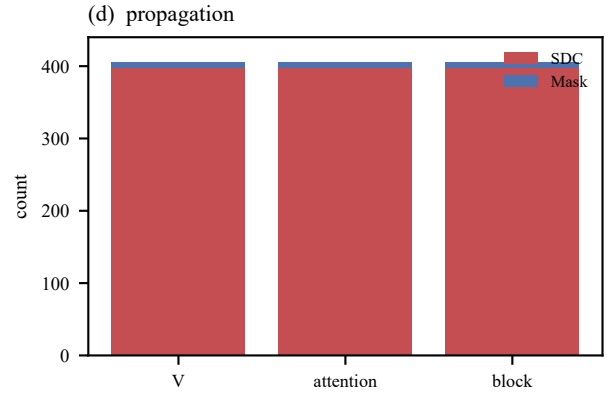

attention = after Wo; block = after MLP + residual. D0: no software detector; D1: NaN/Inf detector. Clean controls 30/30; sham 27/27.