



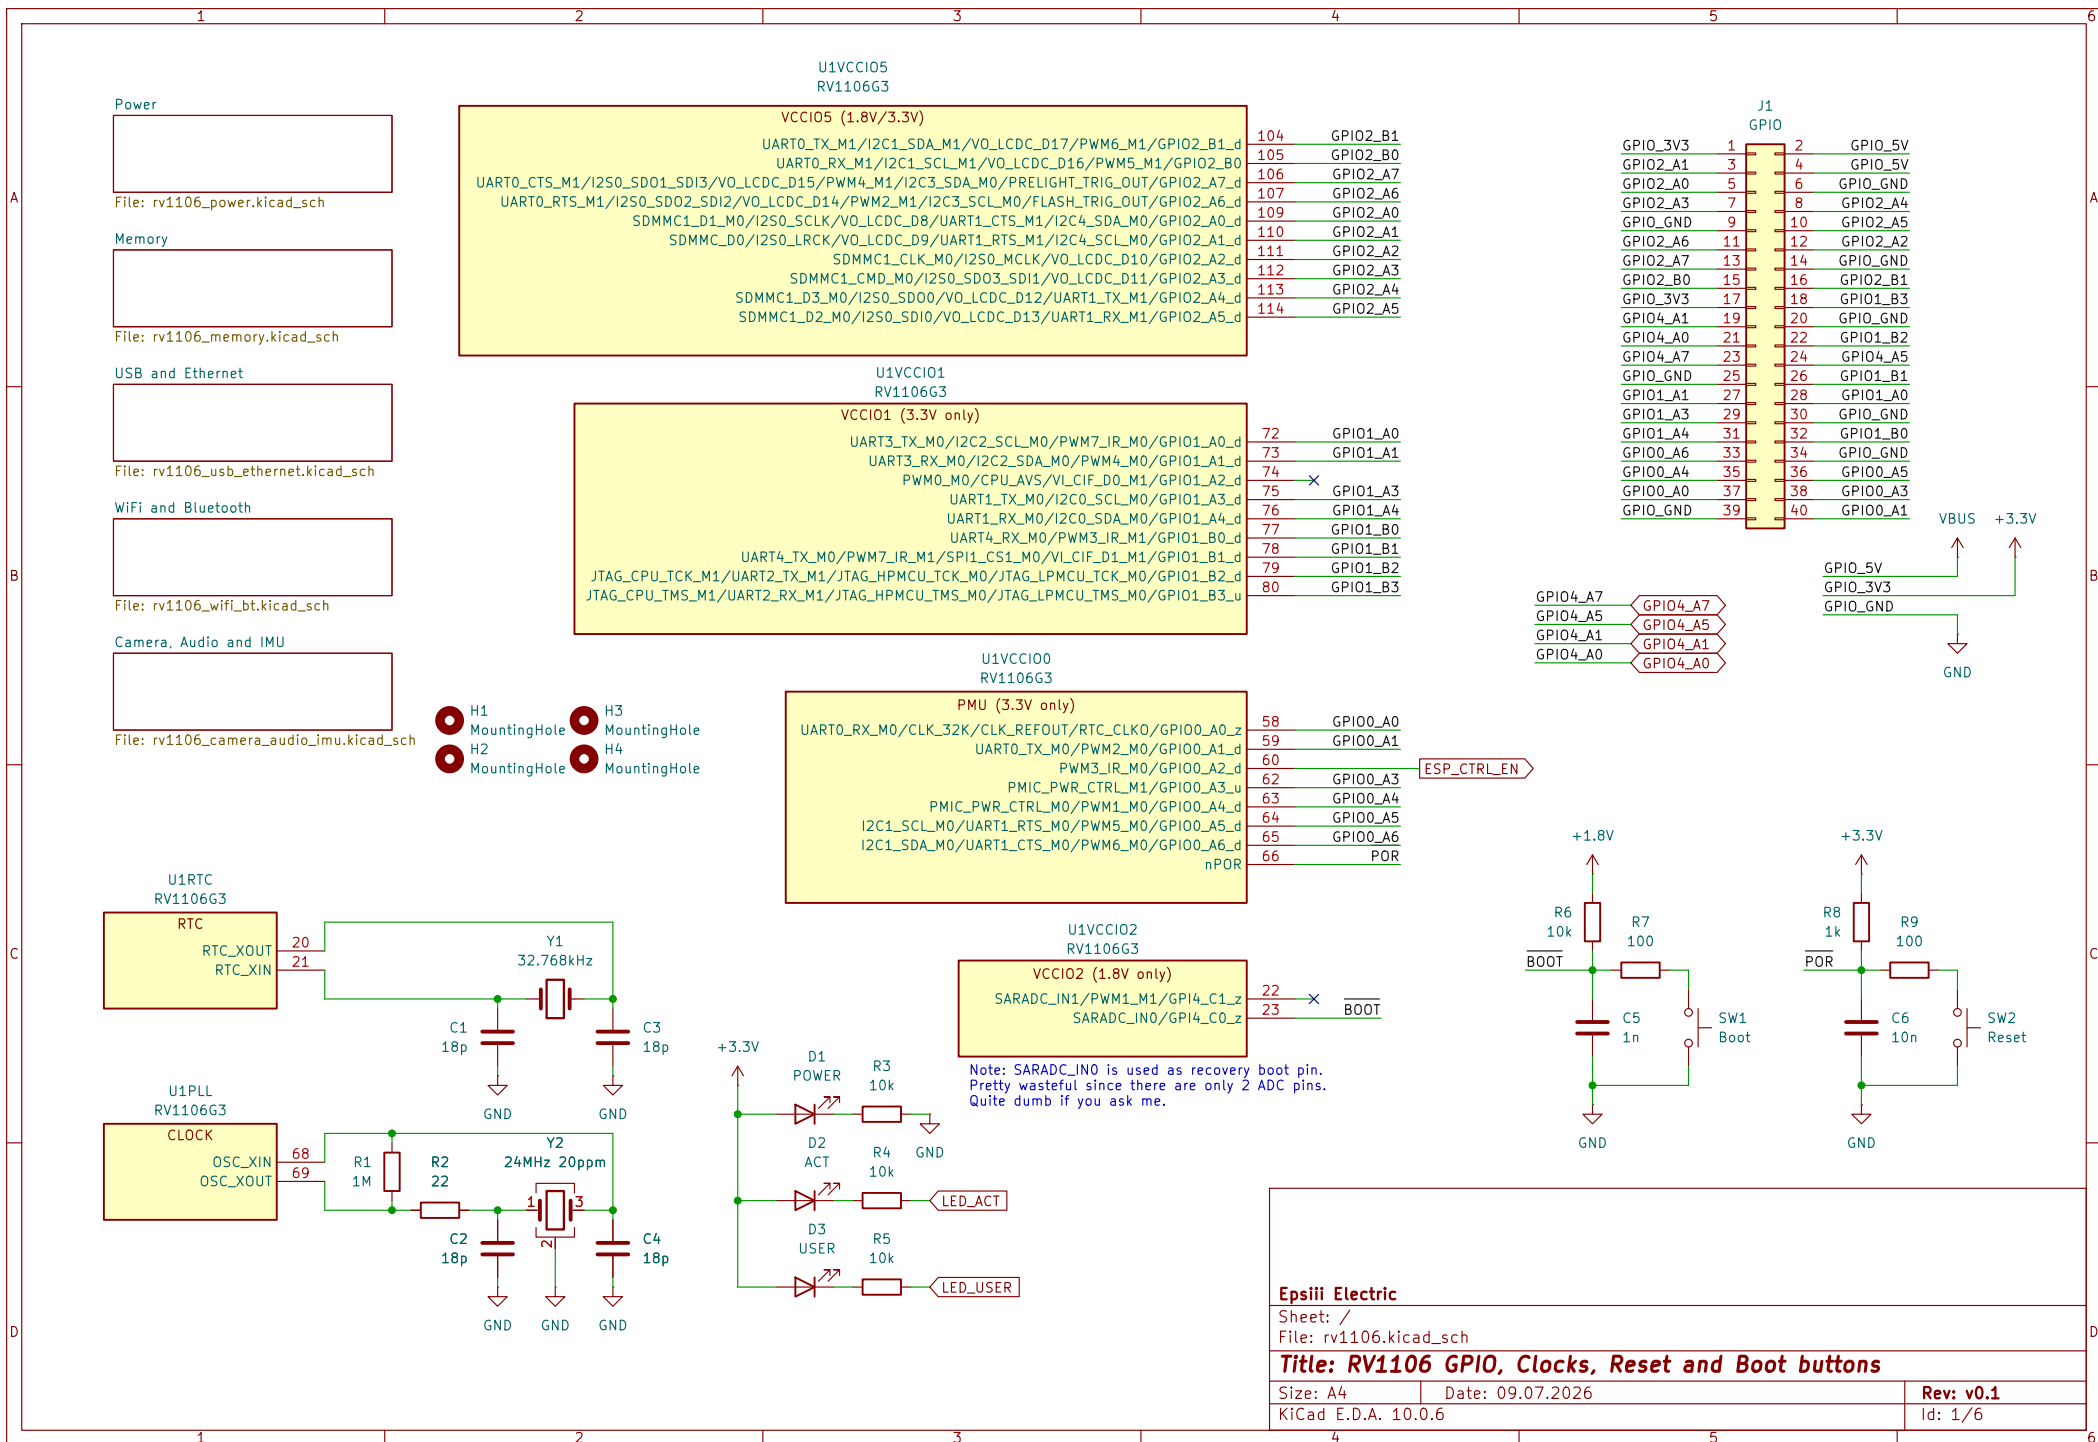

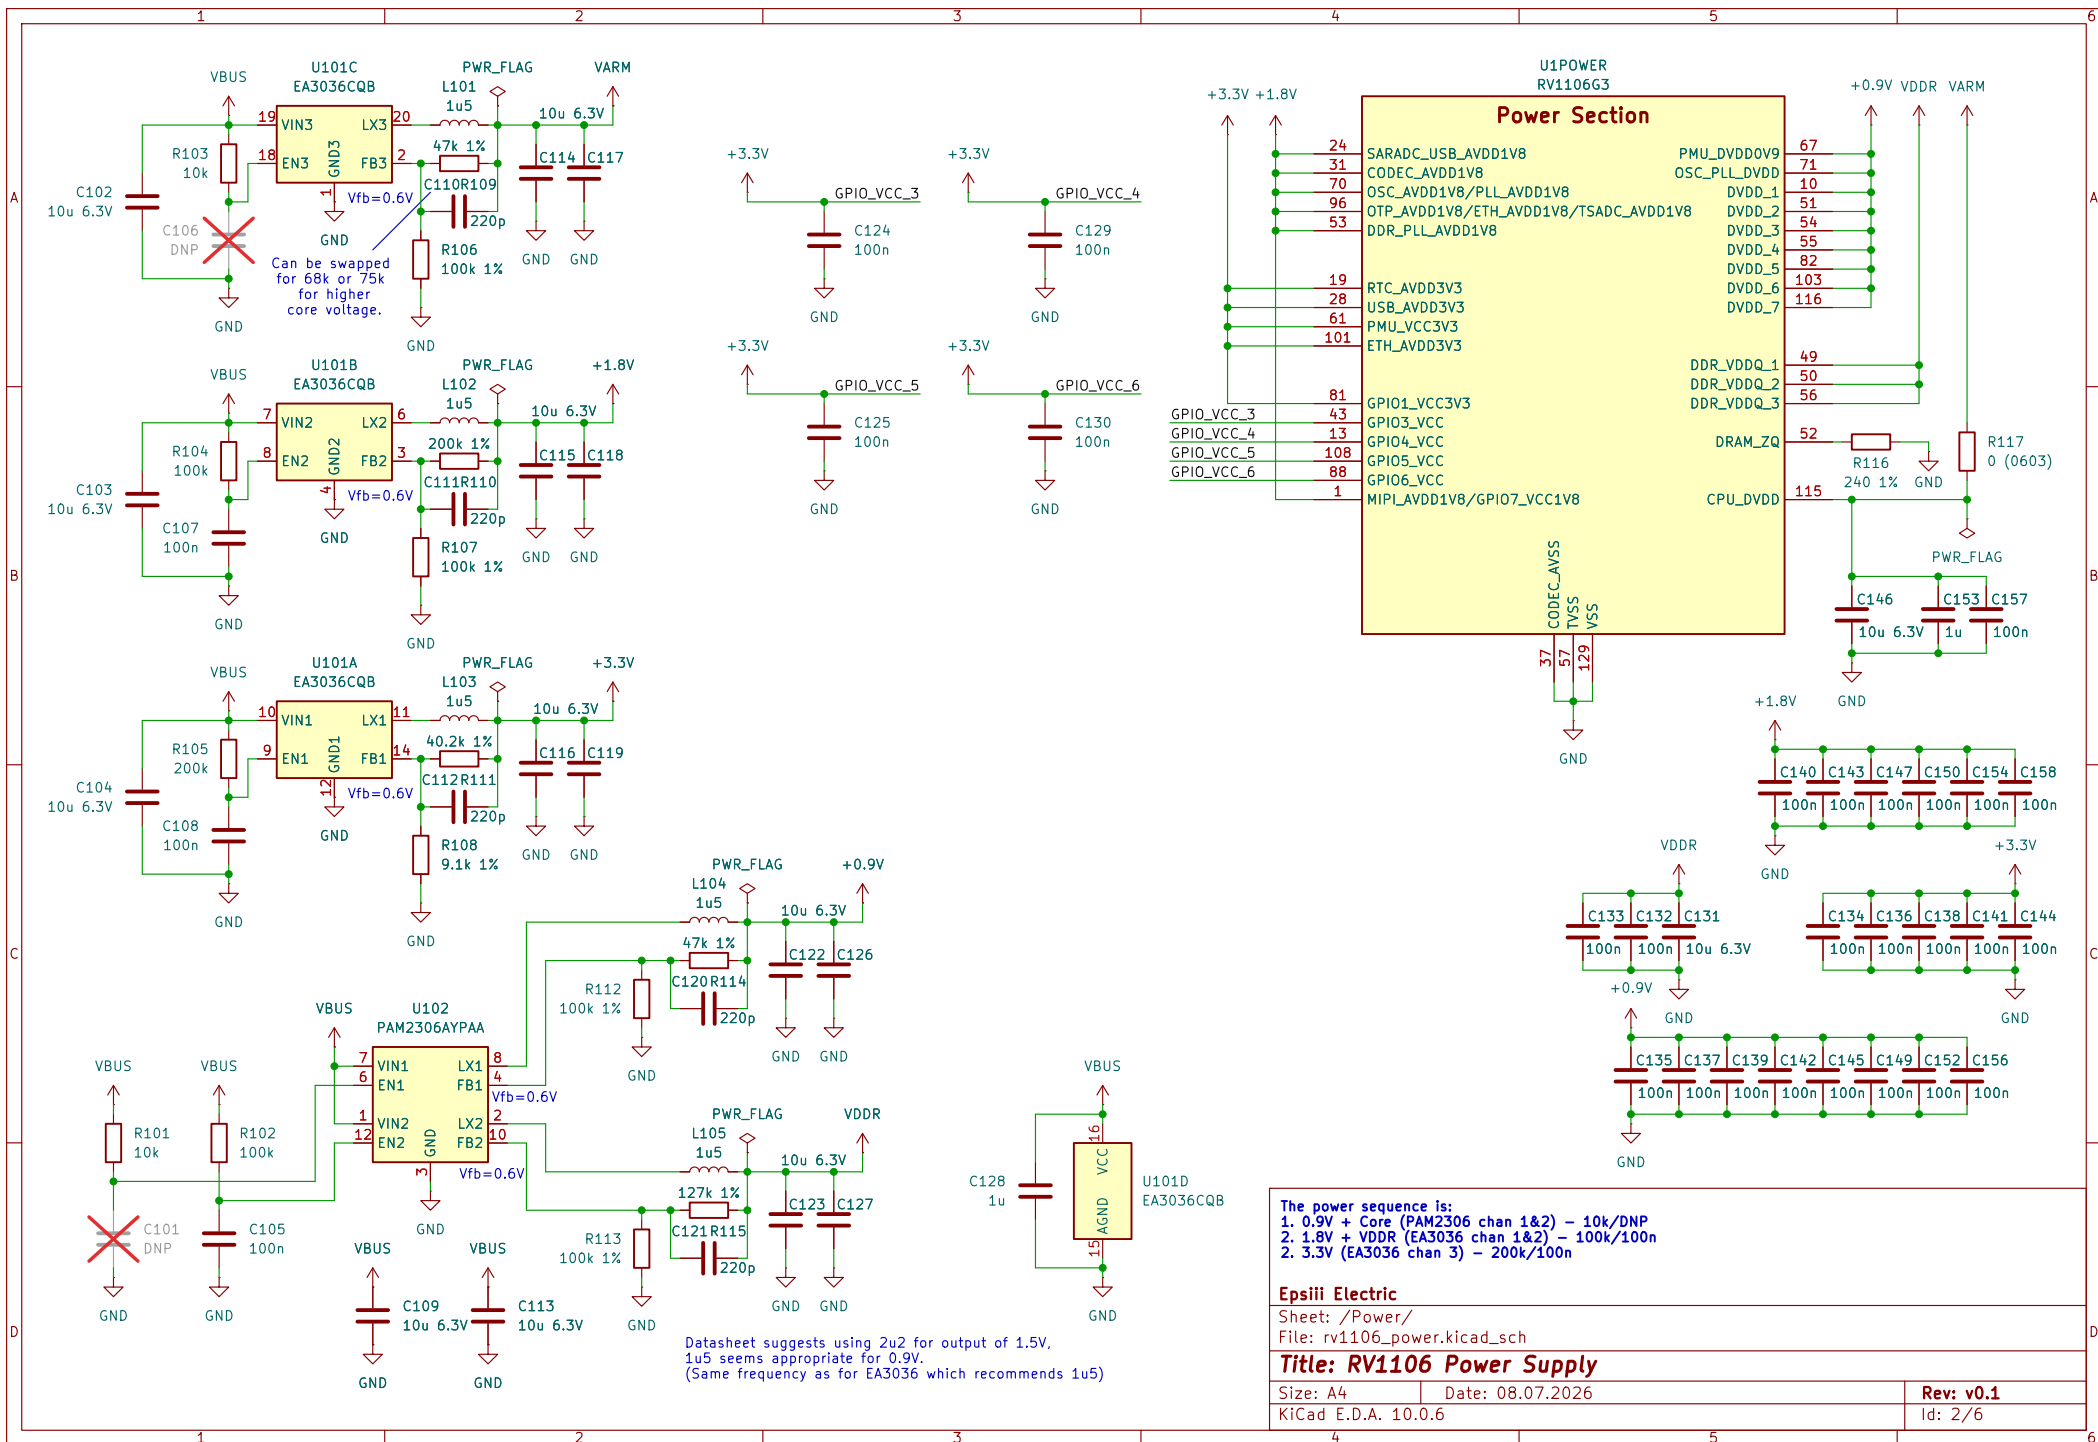

U1VCCIO6
RV1106G3

VCCIO6 (1.8V/3.3V)




VO_LCDC_D1/VL_CIF_D8_M1/PWM10_M1/UART4_RTS_M1/GPIO1_C6_d
VO_LCDC_D0/VL_CIF_D9_M1/PWM11_IR_M1/UART4_CTS_M1/GPIO1_C7_d
VO_LCDC_CLK/VL_CIF_CLK0_M1/I2C3_SCL_M1/UART5_TX_M1/PWM11_IR_M2/AUD_DSM_N/GPIO1_D3_d
VO_LCDC_VSYNC/VL_CIF_VSYNC_M1/I2C3_SDA_M1/UART5_RX_M1/SPI0_CS1_M0/PWM0_M1/AUD_DSM_P/GPIO1_D2_d
VO_LCDC_HSYNC/VL_CIF_HREF_M1/PWM10_M2/UART5_CTS_M1/UART3_RX_M1/GPIO1_D1_d
VO_LCDC_DEN/VL_CIF_CLK1_M1/PWM3_IR_M2/UART5_RTS_M1/UART3_TX_M1/GPIO1_D0_d
VO_LCDC_D2/VL_CIF_D7_M1/PWM9_M1/UART4_TX_M1/SDMMC1_D2_M1/GPIO1_C5_d
VO_LCDC_D3/VL_CIF_D6_M1/PWM8_M1/UART4_RX_M1/SDMMC1_D3_M1/GPIO1_C4_d
VO_LCDC_D4/VL_CIF_D5_M1/PWM6_M2/I2C4_SDA_M1/SDMMC1_CMD_M1/SPI0_MISO_M0/GPIO1_C3_d
VO_LCDC_D5/VL_CIF_D4_M1/PWM5_M2/I2C4_SCL_M1/SDMMC1_CLK_M1/SPI0_MOSI_M0/GPIO1_C2_d
VO_LCDC_D6/VL_CIF_D3_M1/PWM4_M2/SPI0_CLK_M0/SDMMC1_D0_M1/GPIO1_C1_d
VO_LCDC_D7/VL_CIF_D2_M1/PWM2_M2/SPI0_CS0_M0/SDMMC1_D1_M1/GPIO1_C0_d

83 R410 22 ESP_GPIO6
84 R411 22 ESP_GPIO7
85 ETH_LED_0
86 ETH_LED_1
87 RK_RX_ESP_TX
89 RK_TX_ESP_RX
90 ESP_SDIO_D2
91 ESP_SDIO_D3
92 ESP_SDIO_CMD
93 ESP_SDIO_CLK
94 ESP_SDIO_D0
95 ESP_SDIO_D1

RK_RX_ESP_TX R412 22 ESP_TX_RK_RX
RK_TX_ESP_RX R413 22 ESP_RX_RK_TX

RK_RX_ESP_TX R414 22 ESP_RX_RK_TX
RK_TX_ESP_RX R415 22 ESP_TX_RK_RX

Note: unless there's a mistake in the board design, these components SHOULD NEVER BE POPULATED.

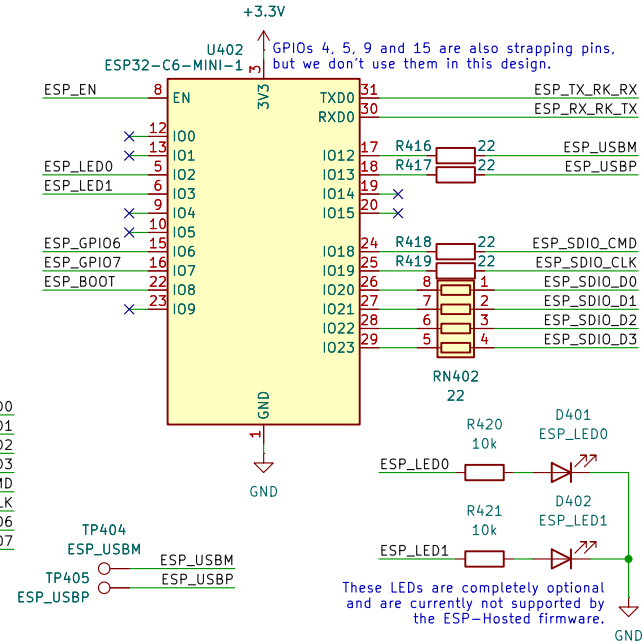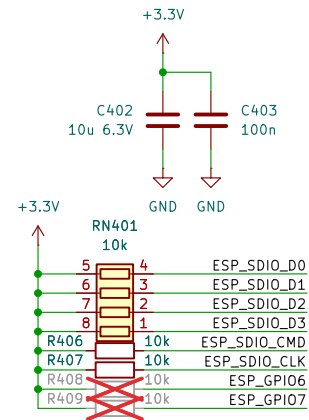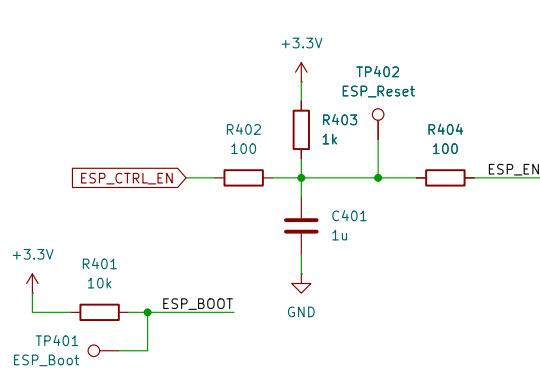

Note: In case of problems with the connection, we can fall back to SPI as it's on the same GPIOs as the SDIO. Two additional GPIOs are routed to the RV1106 in case of conflict with UART4 or other peripherals.

Epsili Electric

Sheet: /WiFi and Bluetooth/
File: rv1106_wifi_bt.kicad_sch

Title: RV1106 WiFi and Bluetooth

Size: A4 Date: 08.07.2026

KiCad E.D.A. 10.0.6

Rev: v0.1

Id: 5/6

